

SIEMENS

SINUMERIK

SINUMERIK 808D ADVANCED

Programming and Operating Manual (Milling)

User Manual

Legal information

Warning notice system

This manual contains notices you have to observe in order to ensure your personal safety, as well as to prevent damage to property. The notices referring to your personal safety are highlighted in the manual by a safety alert symbol, notices referring only to property damage have no safety alert symbol. These notices shown below are graded according to the degree of danger.

 DANGER
indicates that death or severe personal injury will result if proper precautions are not taken.
 WARNING
indicates that death or severe personal injury may result if proper precautions are not taken.
 CAUTION
indicates that minor personal injury can result if proper precautions are not taken.
NOTICE
indicates that property damage can result if proper precautions are not taken.

If more than one degree of danger is present, the warning notice representing the highest degree of danger will be used. A notice warning of injury to persons with a safety alert symbol may also include a warning relating to property damage.

Qualified Personnel

The product/system described in this documentation may be operated only by **personnel qualified** for the specific task in accordance with the relevant documentation, in particular its warning notices and safety instructions. Qualified personnel are those who, based on their training and experience, are capable of identifying risks and avoiding potential hazards when working with these products/systems.

Proper use of Siemens products

Note the following:

 WARNING
Siemens products may only be used for the applications described in the catalog and in the relevant technical documentation. If products and components from other manufacturers are used, these must be recommended or approved by Siemens. Proper transport, storage, installation, assembly, commissioning, operation and maintenance are required to ensure that the products operate safely and without any problems. The permissible ambient conditions must be complied with. The information in the relevant documentation must be observed.

Preface

Applicable products

This manual is valid for the following control systems:

Control system	Software version
SINUMERIK 808D ADVANCED M (Milling)	V4.90: PPU16x.3/PPU15x.3 with spindle/feed servo system

Documentation components and target audience

End-user documentation	Target audience
Programming and Operating Manual (Turning)	Programmers and operators of turning machines
Programming and Operating Manual (Milling)	Programmers and operators of milling machines
Programming and Operating Manual (ISO Turning/Milling)	Programmers and operators of turning/milling machines
Programming and Operating Manual (Manual Machine Plus (MM+), Turning)	Programmers and operators of turning machines
Diagnostics Manual	Mechanical and electrical designers, commissioning engineers, machine operators, and service and maintenance personnel
Manufacturer/service documentation	Target audience
Commissioning Manual	Installation personnel, commissioning engineers, and service and maintenance personnel
Function Manual	Mechanical and electrical designers, technical professionals
Parameter Manual	Mechanical and electrical designers, technical professionals
Service Manual	Mechanical and electrical designers, technical professionals, commissioning engineers, and service and maintenance personnel
Readme file	
Third-party software - Licensing terms and copyright information	

My Documentation Manager (MDM)

Under the following link you will find information to individually compile your documentation based on the Siemens content:

www.siemens.com/mdm

Standard scope

This manual only describes the functionality of the standard version. Extensions or changes made by the machine tool manufacturer are documented by the machine tool manufacturer.

Technical support

Country	Hotline ¹⁾	Further service contact information:
Germany	+49 911 895 7222	- Worldwide Web site: https://support.industry.siemens.com/cs/ww/en/ - Chinese Web site: http://www.siemens.com.cn/808D
China	+86 400 810 4288	

¹⁾ You can find more hotline information at the worldwide Web site given above.

EC Declaration of Conformity

The EC Declaration of Conformity for the EMC Directive can be found on the Internet at <https://support.industry.siemens.com/cs/ww/en/>.

Here, enter the number "59843164" as the search term or contact your local Siemens office.

Table of contents

	Preface	2
1	Fundamental safety instructions.....	7
1.1	General safety instructions.....	7
1.2	Warranty and liability for application examples.....	7
1.3	Industrial security	8
2	Introduction.....	8
2.1	Panel Processing Units (PPUs).....	9
2.1.1	PPU versions	9
2.1.2	PPU control elements.....	10
2.1.3	Screen layout	12
2.2	Machine Control Panels (MCPs)	13
2.2.1	MCP versions.....	13
2.2.2	MCP control elements	13
2.3	Coordinate systems.....	16
2.4	Protection levels.....	17
3	Common notices for machining operations	20
4	Switching on and referencing.....	20
5	Setting the user interface language.....	21
6	Setting up tools	21
6.1	Creating a tool.....	21
6.2	Creating/changing a cutting edge.....	22
6.3	Activating the tool and the spindle	23
6.4	Assigning the handwheel.....	24
6.4.1	Assigning the handwheel through the MCP	25
6.4.2	Assigning the handwheel through the PPU.....	25
6.5	Measuring the tool manually	27
6.6	Verifying the tool offset result.....	28
7	Creating part programs.....	29
7.1	Creating a part program.....	29
7.2	Editing the part program	31
7.2.1	Using a standard program structure	31
7.2.2	Editing a part program	31
7.2.3	Understanding frequently used programming instructions	37
7.2.3.1	Inch or metric dimensions (G70/G71).....	37
7.2.3.2	Definition of work offset (G54 to G59, G507 to G532, G500, G90/G91)	37
7.2.3.3	Rapid traverse (G00)	38
7.2.3.4	Tool and traverse (T, D, M6, F, G94/G95, S, M3/M4, G01).....	39
7.2.3.5	Tool radius compensation (G40, G41/G42)	39
7.2.3.6	Milling circles and arcs (G02/G03).....	40
7.2.3.7	Fixed point approach (G74/G75).....	41
7.2.3.8	Spindle control	42
7.2.3.9	Setting dwell time in the program (G04).....	42
8	Program simulation	42
8.1	Simulation prior to machining of the workpiece	42
8.2	Simultaneous recording prior to machining of the workpiece	44
9	Machining the workpiece.....	45
9.1	Executing a part program.....	45

9.2	Executing specified blocks	46
9.3	Correcting a part program	47
9.4	Simultaneous recording during machining of the workpiece.....	47
9.5	Entering the tool wear offsets	48
10	Other common operations.....	52
10.1	Program control functions	52
10.1.1	Program test.....	52
10.1.2	Dry run feedrate.....	52
10.1.3	Conditional stop.....	52
10.1.4	Skip block.....	52
10.1.5	Single block mode	52
10.1.6	Rapid traverse override.....	53
10.1.7	Auxiliary function lock	53
10.2	Calibrating the tool probe	53
10.3	Measuring the tool with a probe (auto).....	55
10.4	Setting up the workpiece.....	56
10.4.1	Measuring the workpiece	56
10.4.2	Entering/modifying workpiece offsets.....	58
10.5	Entering/modifying the setting data.....	59
10.6	Setting R parameters	62
10.7	Setting user data.....	63
10.8	Setting the date and time	63
10.9	Configuring the operating area after startup	64
10.10	Executing/transferring a part program from external.....	64
10.10.1	Executing/transferring through the USB interface.....	64
10.10.1.1	Executing from external (through USB interface).....	64
10.10.1.2	Transferring from external (through USB interface)	65
10.10.2	Executing/transferring through the Ethernet connection.....	66
10.10.2.1	Configuring the network drive.....	66
10.10.2.2	Executing from external (through Ethernet connection)	68
10.10.2.3	Transferring from external (through Ethernet connection)	69
10.10.3	Configuring the firewall.....	70
10.11	Extending/deactivating the CNC lock function	70
10.12	Data backup	72
10.12.1	Internal data backup	72
10.12.2	External data backup	74
10.12.2.1	External data backup in a data archive	74
10.12.2.2	External data backup of separate files	75
10.13	Pocket calculator	76
11	Programming principles	77
11.1	Fundamentals of programming.....	77
11.1.1	Program names	77
11.1.2	Program structure.....	78
11.2	Programming instructions.....	78
11.2.1	Programming dimensions.....	78
11.2.2	Plane selection: G17 to G19.....	79
11.2.3	Absolute/incremental dimensioning: G90, G91, AC, IC.....	79
11.2.4	Dimensions in metric units and inches: G71, G70, G710, G700	80
11.2.5	Polar coordinates, pole definition: G110, G111, G112	81
11.2.6	Programmable work offset: TRANS, ATRANS	83
11.2.7	Programmable rotation: ROT, AROT	84
11.2.8	Programmable scale factor: SCALE, ASCALE	85
11.2.9	Programmable mirroring: MIRROR, AMIRROR.....	86
11.2.10	Workpiece coordinate system - settable work offset: G54 to G59, G507 to G532, G500, G53, G153.....	87

11.2.11	NC block compression (COMPON, COMPCURV, COMPCAD)	88
11.3	Linear interpolation	90
11.3.1	Linear interpolation with rapid traverse: G0	90
11.3.2	Feedrate F	91
11.3.3	Linear interpolation with feedrate: G1	91
11.4	Circular interpolation	92
11.4.1	Circular interpolation: G2, G3	92
11.4.2	Circular interpolation via intermediate point: CIP	97
11.4.3	Circle with tangential transition: CT	98
11.4.4	Helix interpolation: G2/G3, TURN	98
11.4.5	Feedrate override for circles: CFTCP, CFC	99
11.5	Thread cutting	100
11.5.1	Thread cutting with constant lead: G33	100
11.5.2	Tapping with compensating chuck: G63	101
11.5.3	Thread interpolation: G331, G332	102
11.6	Fixed point approach	103
11.6.1	Fixed point approach: G75	103
11.6.2	Reference point approach: G74	104
11.7	Acceleration control and exact stop/continuous path	105
11.7.1	Acceleration pattern: BRISK, SOFT	105
11.7.2	Exact stop/continuous-path control mode: G9, G60, G64	105
11.7.3	Dwell time: G4	107
11.8	Spindle movements	108
11.8.1	Gear stages	108
11.8.2	Spindle speed S, directions of rotation	108
11.8.3	Spindle positioning: SPOS	108
11.9	Contour programming support	109
11.9.1	Contour definition programming	109
11.9.2	Rounding, chamfer	111
11.10	Tool and tool offset	114
11.10.1	General Information	114
11.10.2	Tool T	114
11.10.3	Tool compensation number D	115
11.10.4	Selecting the tool radius compensation: G41, G42	117
11.10.5	Corner behavior: G450, G451	119
11.10.6	Tool radius compensation OFF: G40	120
11.10.7	Special cases of the tool radius compensation	121
11.10.8	Example of tool radius compensation	123
11.11	Miscellaneous function M	123
11.12	H function	124
11.13	Arithmetic parameters, LUD and PLC variables	125
11.13.1	Arithmetic parameter R	125
11.13.2	Local User Data (LUD)	126
11.13.3	Reading and writing PLC variables	127
11.14	Program jumps	128
11.14.1	Unconditional program jumps	128
11.14.2	Conditional program jumps	128
11.14.3	Program example for jumps	130
11.14.4	Jump destination for program jumps	131
11.15	Subroutine technique	131
11.15.1	General information	131
11.15.2	Calling machining cycles	133
11.15.3	Modal subroutine call	133
11.15.4	Executing internal and external subroutines (CALL, EXTCALL)	134
11.16	Timers and workpiece counters	135
11.16.1	Runtime timer	135
11.16.2	Workpiece counter	137
11.17	Smooth approach and retraction	139

11.18	Cylinder surface transformation (TRACYL)	143
11.19	Coupled motion (TRAILON, TRAILOF)	150
12	Cycles.....	152
12.1	Overview of cycles	152
12.2	Programming cycles	153
12.3	Graphical cycle programming in the program editor.....	154
12.4	Drilling cycles	155
12.4.1	General information	155
12.4.2	Requirements	156
12.4.3	Drilling, centering - CYCLE81.....	157
12.4.4	Drilling, counterboring - CYCLE82.....	159
12.4.5	Deep-hole drilling - CYCLE83.....	161
12.4.6	Rigid tapping - CYCLE84	166
12.4.7	Tapping with compensating chuck - CYCLE840.....	170
12.4.8	Reaming 1 - CYCLE85.....	175
12.4.9	Boring - CYCLE86	177
12.5	Drilling pattern cycles	179
12.5.1	Requirements	179
12.5.2	Row of holes - HOLES1	180
12.5.3	Circle of holes - HOLES2	183
12.5.4	Arbitrary positions - CYCLE802.....	187
12.6	Milling cycles	188
12.6.1	Requirements	188
12.6.2	Face milling - CYCLE71.....	189
12.6.3	Contour milling - CYCLE72	193
12.6.4	Milling a rectangular spigot - CYCLE76.....	202
12.6.5	Milling a circular spigot - CYCLE77.....	206
12.6.6	Long holes located on a circle - LONGHOLE	209
12.6.7	Slots on a circle - SLOT1	213
12.6.8	Circumferential slot - SLOT2	218
12.6.9	Milling a rectangular pocket - POCKET3.....	223
12.6.10	Milling a circular pocket - POCKET4.....	229
12.6.11	Thread milling - CYCLE90.....	233
12.6.12	High speed settings - CYCLE832	237
12.7	Error messages and error handling.....	239
12.7.1	General Information	239
12.7.2	Error handling in the cycles	239
12.7.3	Overview of cycle alarms	239
12.7.4	Messages in the cycles	239
13	Machining typical milling parts	239
13.1	Operations before programming	239
13.2	Programming (Example 1)	240
13.3	Programming (Example 2)	250
13.4	Programming (Example 3)	258
13.5	Programming (Example 4)	273
13.6	Program simulation and execution.....	284
A	Appendix.....	285
A.1	Operating area overview	285
A.1.1	Machining operating area.....	285
A.1.2	Program editing operating area	285
A.1.3	Offset operating area	286
A.1.4	Program management operating area	287
A.1.5	System data operating area	291
A.1.6	Alarm operating area	292
A.2	Operating mode overview	293
A.2.1	"JOG" mode	293

A.2.1.1	Running the spindle manually	294
A.2.1.2	Executing M functions.....	295
A.2.1.3	Setting the relative coordinate system (REL)	296
A.2.1.4	Face milling.....	297
A.2.1.5	Setting the JOG data	298
A.2.2	"AUTO" mode.....	299
A.2.3	"MDA" mode	300
A.3	Activating the contour handwheel via the NC program	302
A.4	The help system.....	304
A.5	Operation wizard	306
A.6	Editing Chinese characters	307
A.7	Calculating contour elements.....	308
A.8	Free contour programming.....	312
A.8.1	Defining a start point.....	314
A.8.2	Programming contour element	315
A.8.3	Parameters for contour elements	318
A.8.4	Specifying contour elements in polar coordinates	321
A.8.5	Cycle support	323
A.8.6	Programming example for milling application.....	323
A.9	Word structure and address.....	331
A.10	Character set	331
A.11	Block format	332
A.12	List of instructions.....	333

1 Fundamental safety instructions

1.1 General safety instructions

 WARNING
Danger to life if the safety instructions and residual risks are not observed If the safety instructions and residual risks in the associated hardware documentation are not observed, accidents involving severe injuries or death can occur. • Observe the safety instructions given in the hardware documentation. • Consider the residual risks for the risk evaluation.

 WARNING
Malfunctions of the machine as a result of incorrect or changed parameter settings As a result of incorrect or changed parameterization, machines can malfunction, which in turn can lead to injuries or death. • Protect the parameterization (parameter assignments) against unauthorized access. • Handle possible malfunctions by taking suitable measures, e.g. emergency stop or emergency off.

1.2 Warranty and liability for application examples

Application examples are not binding and do not claim to be complete regarding configuration, equipment or any eventuality which may arise. Application examples do not represent specific customer solutions, but are only intended to provide support for typical tasks.

As the user you yourself are responsible for ensuring that the products described are operated correctly. Application examples do not relieve you of your responsibility for safe handling when using, installing, operating and maintaining the equipment.

1.3 Industrial security

Note

Industrial security

Siemens provides products and solutions with industrial security functions that support the secure operation of plants, systems, machines and networks.

In order to protect plants, systems, machines and networks against cyber threats, it is necessary to implement – and continuously maintain – a holistic, state-of-the-art industrial security concept. Siemens' products and solutions constitute one element of such a concept.

Customers are responsible for preventing unauthorized access to their plants, systems, machines and networks. Such systems, machines and components should only be connected to an enterprise network or the Internet if and to the extent such a connection is necessary and only when appropriate security measures (e.g. firewalls and/or network segmentation) are in place.

For additional information on industrial security measures that may be implemented, please visit:

Industrial security (<http://www.siemens.com/industrialsecurity>)

Siemens' products and solutions undergo continuous development to make them more secure. Siemens strongly recommends that product updates are applied as soon as they are available and that the latest product versions are used. Use of product versions that are no longer supported, and failure to apply the latest updates may increase customer's exposure to cyber threats.

To stay informed about product updates, subscribe to the Siemens Industrial Security RSS Feed at:

Industrial security (<http://www.siemens.com/industrialsecurity>)

Further information is provided on the Internet:

Industrial Security Configuration Manual (<https://support.industry.siemens.com/cs/ww/en/view/108862708>)

WARNING

Unsafe operating states resulting from software manipulation

Software manipulations (e.g. viruses, trojans, malware or worms) can cause unsafe operating states in your system that may lead to death, serious injury, and property damage.

- Keep the software up to date.
- Incorporate the automation and drive components into a holistic, state-of-the-art industrial security concept for the installation or machine.
- Make sure that you include all installed products into the holistic industrial security concept.
- Protect files stored on exchangeable storage media from malicious software by with suitable protection measures, e.g. virus scanners.
- Protect the drive against unauthorized changes by activating the "know-how protection" drive function.

2 Introduction

Note

Chapter "Machining typical milling parts (Page 239)" later in this manual provides you with typical machining examples including workpiece drawings, typical programs, and step-by-step operating instructions. It helps you to quickly understand CNC programming and operation through practical examples.

2.1 Panel Processing Units (PPUs)

2.1.1 PPU versions



PPU version	Technology variant	Operator panel variant	Applicable control system
PPU161.3	Turning variant	Horizontal panel, with English keys	SINUMERIK 808D ADVANCED T (Turning)
		Horizontal panel, with Chinese keys	
	Milling variant	Horizontal panel, with English keys	SINUMERIK 808D ADVANCED M (Milling)
		Horizontal panel, with Chinese keys	
PPU160.3	Turning variant	Vertical panel, with English keys	SINUMERIK 808D ADVANCED T (Turning)
		Vertical panel, with Chinese keys	
	Milling variant	Vertical panel, with English keys	SINUMERIK 808D ADVANCED M (Milling)
		Vertical panel, with Chinese keys	
PPU151.3	Turning variant	Horizontal panel, with English keys	SINUMERIK 808D ADVANCED T (Turning)
		Horizontal panel, with Chinese keys	
	Milling variant	Horizontal panel, with English keys	SINUMERIK 808D ADVANCED M (Milling)
		Horizontal panel, with Chinese keys	
PPU150.3	Turning variant	Vertical panel, with English keys	SINUMERIK 808D ADVANCED T (Turning)
		Vertical panel, with Chinese keys	
	Milling variant	Vertical panel, with English keys	SINUMERIK 808D ADVANCED M (Milling)
		Vertical panel, with Chinese keys	

2.1.2 PPU control elements

PPU160.3/PPU150.3



PPU161.3/PPU151.3

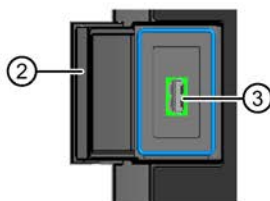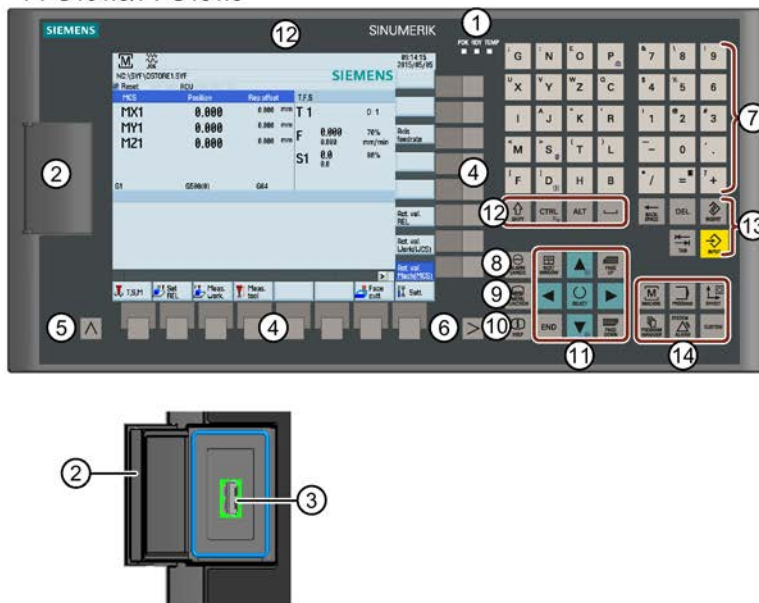

- | | |
|---|---|
| <p>① Status indicators</p> <p>② Protective cover for USB interface</p> <p>③ USB interface</p> <p>④ Horizontal and vertical keys
Call the corresponding vertical/horizontal softkeys on the screen</p> <p>⑤ Return key
Returns to the next higher-level menu</p> <p>⑥ Menu extension key
Calls the extended menu items</p> <p>⑦ Alphabetic and numeric keys</p> | <p>⑧ Alarm cancellation key
Cancels alarms and messages that are marked with the symbol on this key</p> <p>⑨ Wizard key
Guides you through performing basic commissioning and operation tasks</p> <p>⑩ Help key
Calls help information</p> <p>⑪ Cursor keys</p> <p>⑫ Modifier keys for use in key combinations</p> <p>⑬ Edit control keys</p> <p>⑭ Operating area keys</p> |
|---|---|

Additional information about keys

	<CTRL + P>: Creates a screenshot of the actual user interface
	<CTRL + S>: Saves start-up archives and action logs to a USB stick
	<CTRL + D>: Displays pre-defined slides on the screen <ALT + D>: Saves action logs to a USB stick
	Calls the calculator function when you position the cursor on the desired input field


	<CTRL + cursor key>: Changes the screen backlight brightness by an increment of 10% (brightness range: 10% to 100%) Note that after you release the key combination, the HMI saves your brightness setting and the brightness bar disappears after a few seconds.
	Enters the upper character shown on the alphabetic/numeric keys concerned
 + 	Opens the system data operating area
	In the program editor, pressing this key moves the cursor to the beginning of the selected program block.
	• Toggles between entries in the input field • Enters the "Set-up menu" dialog box at NC startup
	Enables user-defined extension applications, for example, generation of user dialog boxes with the EasyXLanguage function. For more information about this function, see the SINUMERIK 808D ADVANCED Function Manual.

Status indicators




Indicator	Status and meaning
"POK"	• Solid green: The power supply for the control system is switched on.
"RDY"	• Solid green: The control system is ready and the PLC is in run mode. • Solid red: The control system is in stop mode. • Solid orange: The PLC is in stop mode. • Flashing orange: The PLC is in power-up mode.
"TEMP"	• Off: The temperature of the control system is within the specified scope. • Solid orange: The temperature of the control system is beyond the scope.

2.1.3 Screen layout

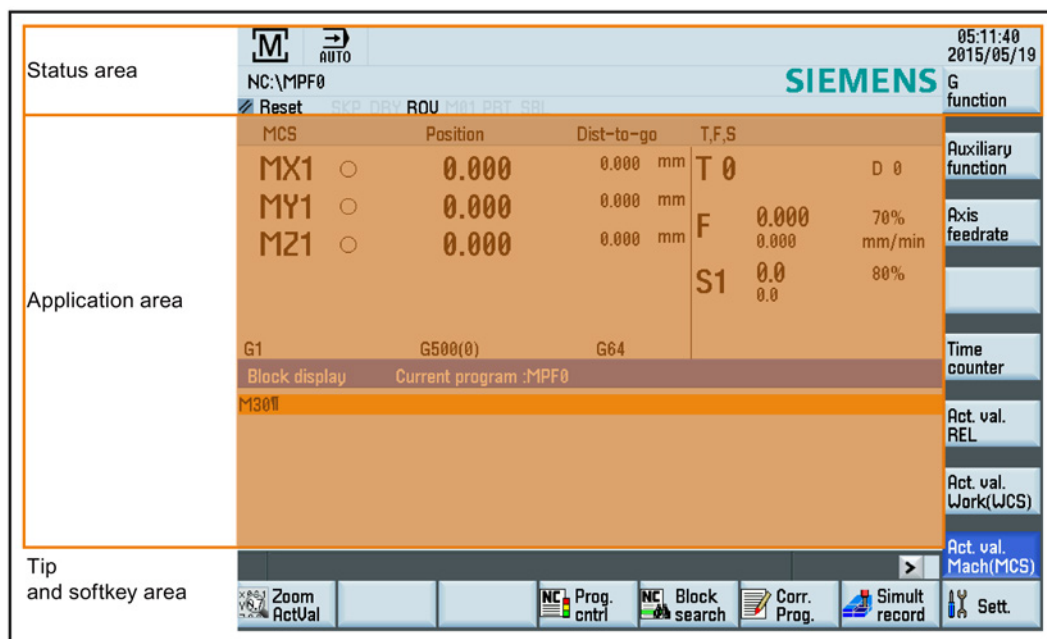

Alarms and messages in the status area

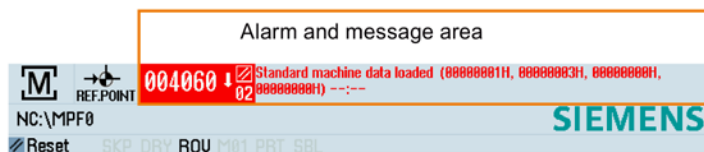

	Displays active alarms with alarm text The alarm number is displayed in white lettering on a red background. The associated alarm text is shown in red lettering. An arrow indicates that several alarms are active. The number to the right of the arrow indicates the total number of active alarms. When more than one alarm is active, the display scrolls through the alarms in sequence. An acknowledgement symbol indicates the alarm cancel criterion.
	Displays messages from NC programs Messages from NC programs do not have numbers and appear in green lettering.


2.2 Machine Control Panels (MCPs)

2.2.1 MCP versions

MCP version	Applicable control system
- Horizontal MCP, with English keys and override switches - Horizontal MCP, with Chinese keys and override switches - Vertical MCP, with English keys and a reserved slot for the handwheel - Vertical MCP, with Chinese keys and a reserved slot for the handwheel - Vertical MCP, with English keys and an override switch for the spindle - Vertical MCP, with Chinese keys and an override switch for the spindle	All MCP variants are applicable to any of the following control systems: - SINUMERIK 808D ADVANCED T (Turning) - SINUMERIK 808D ADVANCED M (Milling)


2.2.2 MCP control elements

Horizontal MCP

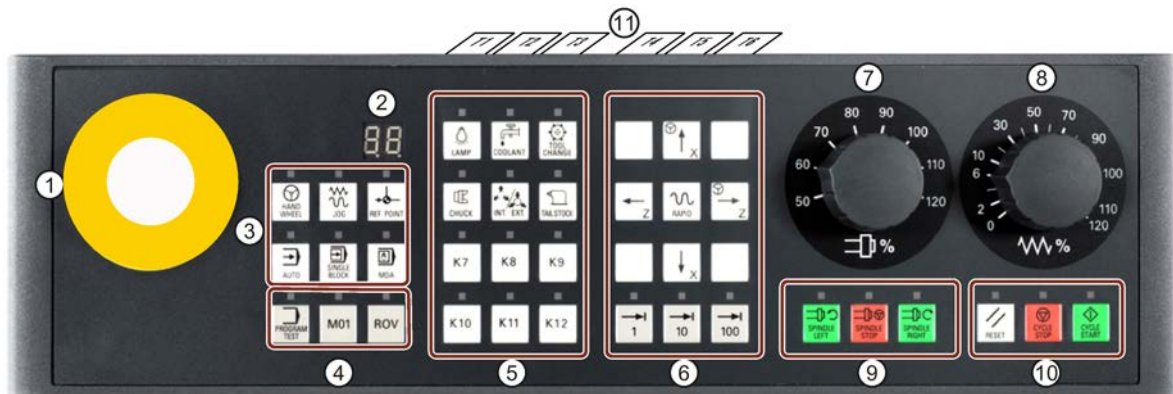


Vertical MCP

- Variant with an override switch for the spindle

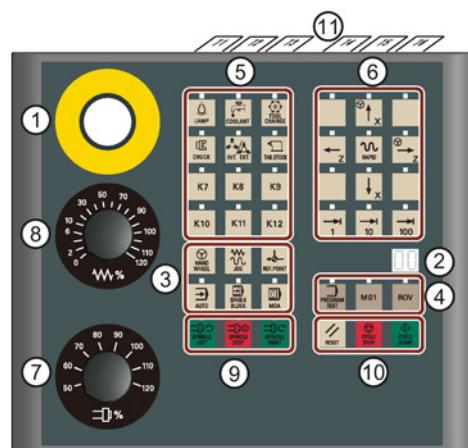

- Variant with a reserved slot for the handwheel

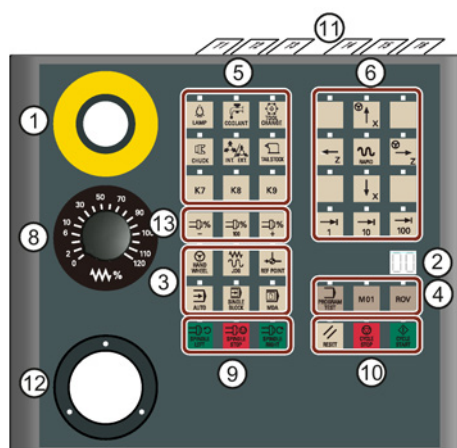

- | | |
|---|---|
| ① Reserved hole for emergency stop button | ⑧ Feedrate override switch |
| ② Tool number display
Displays the number of the currently active tool | ⑨ Spindle control keys |
| ③ Operating mode selection area | ⑩ Keys for program start, stop, and reset |
| ④ Program control keys | ⑪ Pre-defined labeling strips for keys of the MCP |
| ⑤ User-defined keys | ⑫ Reserved slot for the handwheel |
| ⑥ Axis traversing keys | ⑬ Spindle override control keys |
| ⑦ Spindle override switch | |

Functions of user-defined keys


	Switches on/off the machine tool working lamp (always active independent of the machine operating mode) Indicator on: The working lamp on the machine tool is switched on. Indicator off: The working lamp on the machine tool is switched off.
	Switches on/off of the coolant supply (always active independent of the machine operating mode) Indicator on: The coolant supply is switched on. Indicator off: The coolant supply is switched off.
	Controls the locking/unlocking of the safety door Indicator on: The safety door is unlocked. Indicator off: The safety door is locked. Note: If you want to unlock the safety door, make sure all axes and the spindle have stopped running.
	Controls if the magazine rotates clockwise (active only when the machine is in "JOG" mode) Indicator on: The magazine rotates clockwise. Indicator off: The magazine stops clockwise rotation.
	Controls if the magazine approaches the reference point (active only when the machine is in "JOG" mode) LED on: The magazine is referenced. LED off: The magazine is not yet referenced.

	Controls if the magazine rotates counter-clockwise (active only when the machine is in "JOG" mode) Indicator on: The magazine rotates counter-clockwise. Indicator off: The magazine stops counter-clockwise rotation.
	Controls if the chip remover rotates forward (active only when the machine is in "JOG" mode) Indicator on: The chip remover starts forward rotation. Indicator off: The chip remover stops rotation.
	Controls if the chip remover rotates reversely (active only when the machine is in "JOG" mode) Indicator on: The chip remover starts reverse rotation. Indicator off: The chip remover stops reverse rotation.
K9 to K12	Reserved keys. You can define the functions of these keys in PLC Programming Tool. For more information, see the SINUMERIK 808D ADVANCED Commissioning Manual.

Pre-defined labeling strips for keys of the MCP

The MCP package includes two sets (six pieces each) of pre-defined labeling strips. One set (① as shown below) is for the turning variant of the control system and pre-inserted on the back of the MCP. The other set (② as shown below) is for the milling variant of the control system.

If your control system is a milling variant of the control system, replace the pre-inserted labeling strips with the milling-specific ones.

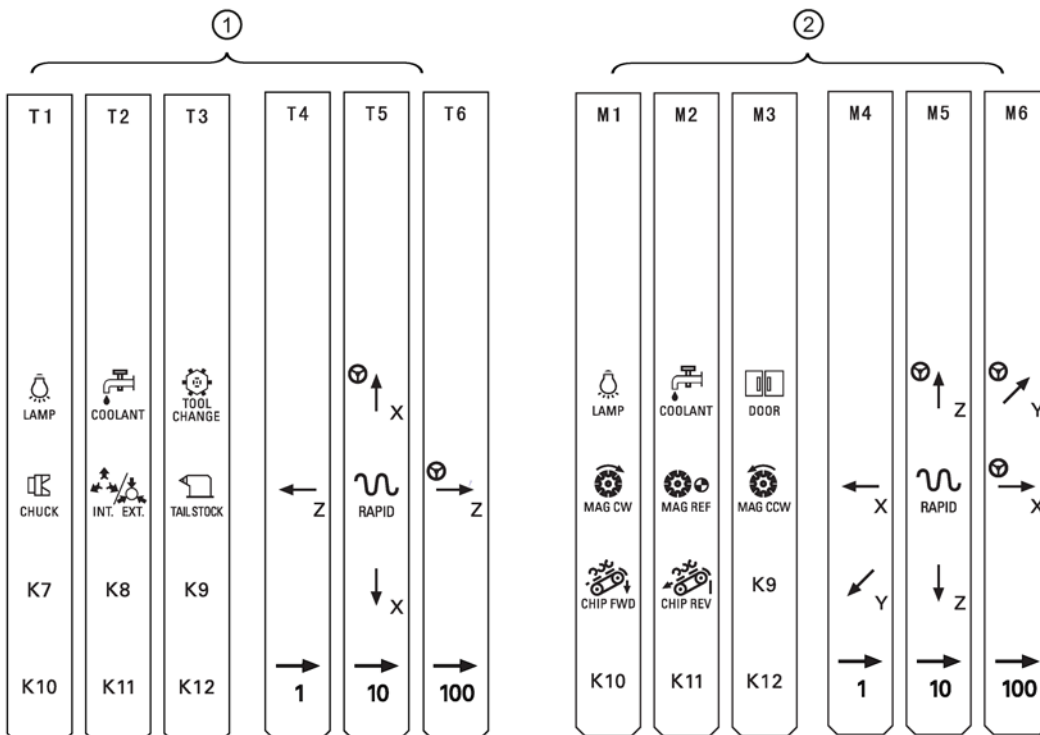


If the pre-defined labeling strips cannot meet your needs, proceed as follows to make customized labeling strips by using the A4-sized blank plastic sheet in the MCP package:

1. Open the "Symbols for MCP customized key_808D" file in the "examples\SINUMERIK_808D\MCP" folder on the Toolbox DVD for the control system on your computer.
2. Copy the desired symbols of keys from the file and then paste them to the desired locations for key labels in the "Strip_template_808D" file.
3. Print the final labeling strip template file on the blank plastic sheet.
4. Replace the pre-inserted labeling strips from the MCP with the customized ones.

2.3 Coordinate systems

As a rule, a coordinate system is formed from three mutually perpendicular coordinate axes. The positive directions of the coordinate axes are defined using the Cartesian coordinate system. The coordinate system is related to the workpiece and programming takes place independently of whether the tool or the workpiece is being traversed. When programming, it is always assumed that the tool traverses relative to the coordinate system of the workpiece, which is intended to be stationary.

The figure below illustrates how to determine the axis directions.

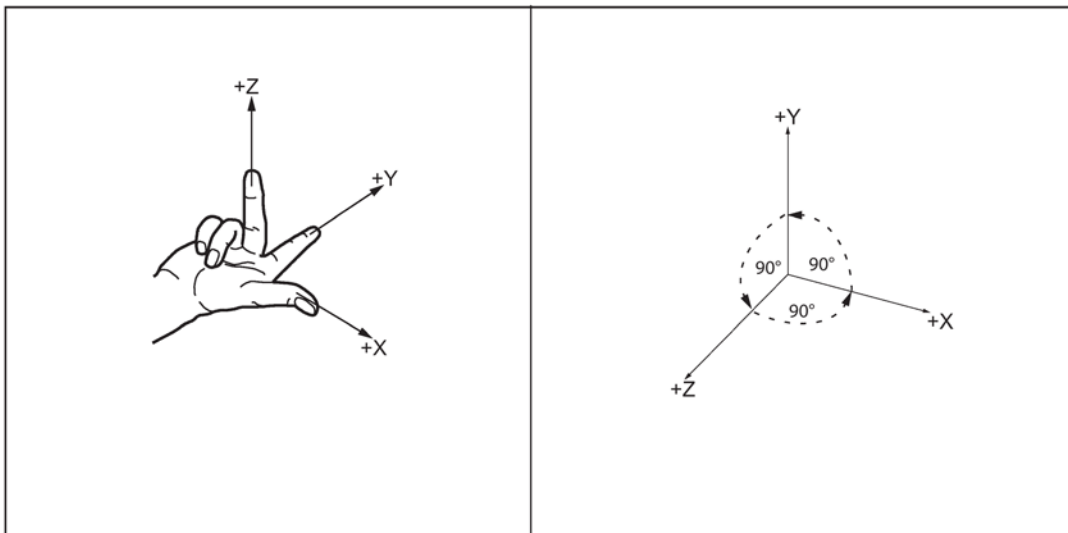


Machine coordinate system (MCS)

The orientation of the coordinate system relative to the machine depends on the respective machine types. It can be rotated in different positions.

The directions of the axes follow the Cartesian coordinate system.

The figure below shows an example of the machine coordinate system of a flat-body turning machine with a front tool holder.

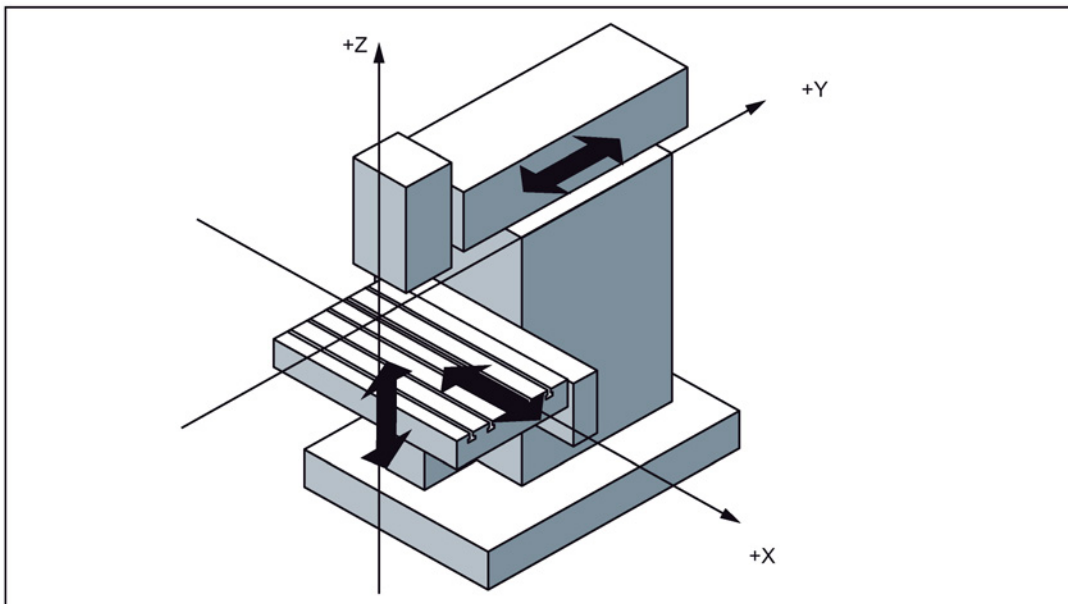

The origin of this coordinate system is the **machine zero**, defined by the machine manufacturer.


The traversing range of the **machine axes** can be in the negative range.

Workpiece coordinate system (WCS)


To describe the geometry of a workpiece in the workpiece program, a right-handed, right-angled coordinate system is also used.

Generally, X0/Y0 of the WCS is set at the center, edge or corner of the workpiece while Z0 is set on the top surface of the workpiece.

See the following illustrations for X0/Y0 at the center, edge and corner of the workpiece respectively.

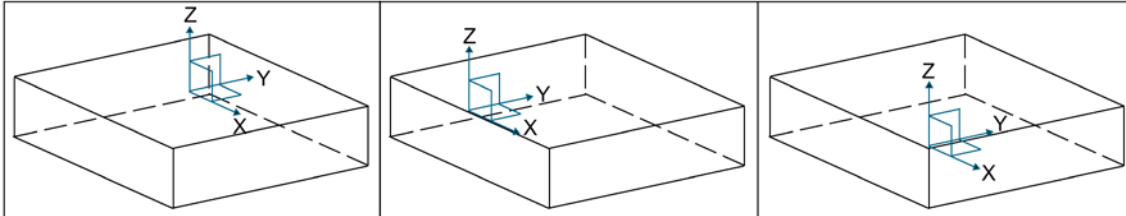

The figure below shows an example of the workpiece coordinate system.

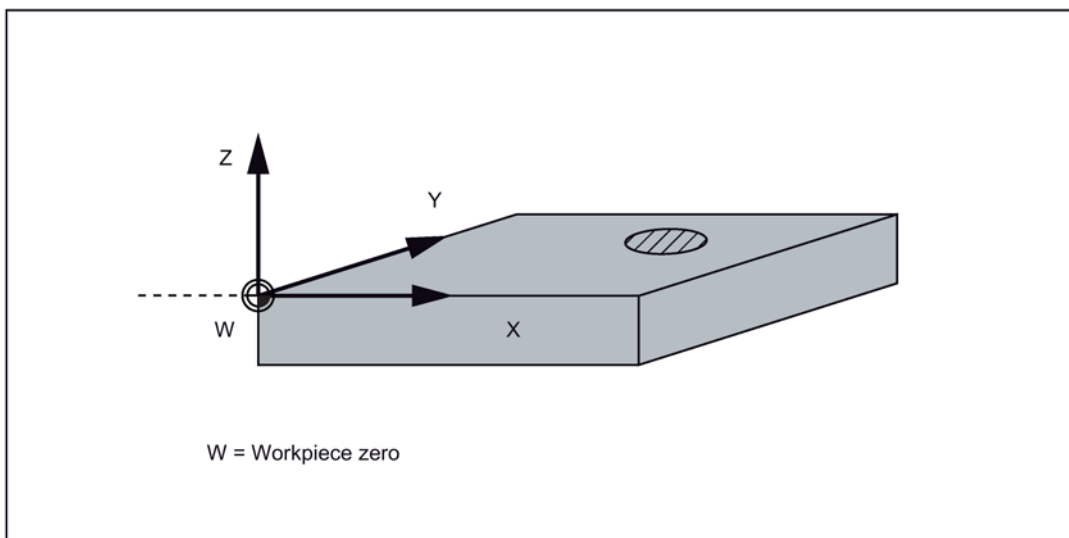

Relative coordinate system (REL)

In addition to the machine and workpiece coordinate systems, this control system provides a relative coordinate system.

This coordinate system can clear the current coordinate values at any position and has no influence on workpiece machining or the position of WCS. All axis movements are displayed relative to this position.

2.4 Protection levels

Overview

The control system provides a concept of protection levels for enabling data areas. Different protection levels control different access rights.

The control system delivered by Siemens is set by default to the lowest protection level 7 (without password). If the password is no longer known, the control system must be reinitialized with the default machine/drive data. All passwords are then reset to default passwords for this software release.

Note

Before you boot the control system with default machine/drive data, make sure that you have backed up your machine/drive data; otherwise, all data are lost after rebooting with default machine/drive data.

Protection level	Locked by	Area
0	Siemens password	Siemens, reserved
1	Manufacturer password	Machine manufacturers
2	Reserved	-
3-6	End user password (Default password: "CUSTOMER")	End users
7	No password	End users

Protection level 1

Protection level 1 requires a manufacturer password. With this password entry, you can perform the following operations:

- Entering or changing part of the machine data and drive data
- Conducting NC and drive commissioning

Protection level 3-6

Protection level 3-6 requires an end user password. With this password entry, you can perform the following operations:

- Entering or changing part of the machine data
- Editing programs
- Setting offset values
- Measuring tools

Protection level 7

If you have not set the password or protection level interface signal, the system sets the protection level to 7 automatically. With this password entry, you can perform the following operations:

- Editing programs
- Setting offset values
- Measuring tools


You can also set protection level 7 through the PLC user interfaces. For more information, see the SINUMERIK 808D ADVANCED Commissioning Manual.

In the menus listed below the input and modification of data depends on the set protection level:

- Tool offsets
- Work offsets
- Setting data
- Program creation/program correction

The number of machine data and drive data which can be read or modified depends on the protection level. You can set the protection level for these function areas with the display machine data (**USER_CLASS...**).


Setting the password

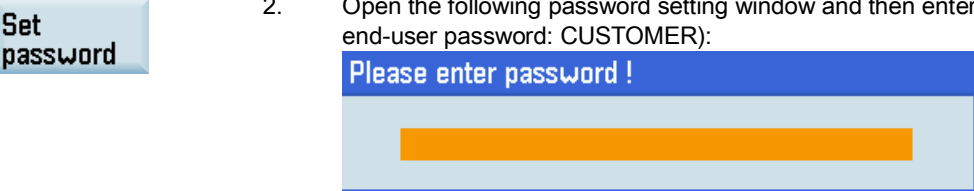1. Select the system data operating area.
 + 
2. Open the following password setting window and then enter the desired password (default end-user password: CUSTOMER):

3. Confirm the input.


Changing/deleting the password

 Note

To avoid unauthorized access to the controller, you must change the Siemens default passwords to your own ones.



Change
password

1. Select the system data operating area.
2. Press this softkey to open the following window and enter a new password following the rules given below:

Change password

Please enter new password:

Please confirm password:

- ✓ At least 8 characters
- ✓ No more than 32 characters
- ✓ At least one uppercase letter
- ✓ At least one lowercase letter
- ✓ At least one number
- Confirm the password

Note:

If you desire to delete the existing password, proceed directly to Step 5.



3. When the green check marks appear next to the first five entries for password creation rules, press this key to move the cursor to the input field for password confirmation. Enter the new password again and the check mark for the last entry is visible.

Change password

Please enter new password:

Please confirm password:

- ✓ At least 8 characters
- ✓ No more than 32 characters
- ✓ At least one uppercase letter
- ✓ At least one lowercase letter
- ✓ At least one number
- ✓ Confirm the password

✓
Accept

Delete
password

4. Press this softkey to activate the new password. Note that if the new password don't meet all the specified rules, this soft key is unavailable.
5. If you desire to delete the existing password, directly press this softkey.

3 Common notices for machining operations

 
To ensure the safety and correctness of machining, you must observe the following notices during machining operations:

- Reference point approach is required only for machine tools equipped with incremental encoders.
- Before running the spindle manually, make sure you have activated the tool.
- Before executing M functions, make sure all the axes are in safe positions.
- During handwheel assignment, make sure there is no obstacle when moving the tool to avoid tool collision.
- To guarantee the safety and correctness of machining, you must verify the tool setup result.
- You must distinguish the direction of tool wear compensation clearly before entering the tool wear offsets.
- Before machining the workpiece on the machine, make sure the following preconditions are met:
 - The PRT mode and the dry run feedrate are deactivated.
 - The feedrate override is 0%.
 - The safety door is closed.
- After changing important data, it is recommended to carry out an internal data backup immediately.

4 Switching on and referencing

Operating sequence


1. Turn on the power supply for the machine tool.



2. Release all emergency stop buttons on the machine. By default, the control system is in reference point approach (REF.POINT) mode after startup.



- If a machine axis is equipped with an absolute encoder, the axis is referenced automatically after the control system starts and therefore reference point approach is unnecessary. The circle symbol (lower-left figure) next to the axis identifier indicates that the axis is already referenced.
- If a machine axis is equipped with an incremental encoder, the axis is not referenced after the control system starts. The circle symbol (lower-right figure) next to the axis identifier indicates that the axis has not been referenced. Proceed to Step 3.

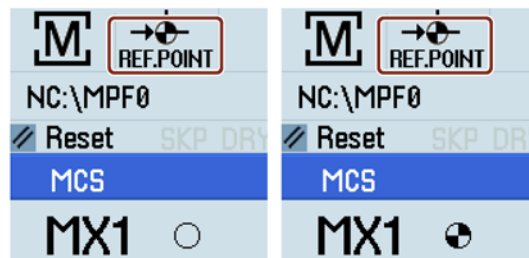

3. Use the corresponding axis traversing keys to traverse the axes until the circle with a dot symbol appears next to the axis identifier.



Note

For a machine axis equipped with absolute encoder, with MD34330 set to 0 (default value is 1), the axis traverses to the reference point position when reference point approach is initiated (manually when an axis traversing key is pressed in "REF.POINT" mode or automatically via the part program instruction G74). Note that MD34330 is accessible only with the manufacturer password. For more information, see the SINUMERIK 808D ADVANCED Parameter Manual.

5 Setting the user interface language

 
Note

The default user interface language is dependent on the PPU type. For a PPU with Chinese keys, the default language is Chinese after power-on; otherwise it's English. If you desire to change it, proceed through the following operating sequence; otherwise, skip this chapter and proceed to the next chapter for setting up tools.

Operating sequence



1. Select the system data operating area.



2. Open the user interface language selection window.



3. Use the cursor keys to select the desired language.



4. Press this softkey to confirm your selection and the system is automatically restarted to activate the selected language.

6 Setting up tools

6.1 Creating a tool

Note

The control system supports a maximum of 64 tools and 128 cutting edges. You can create a maximum of nine cutting edges for each tool. Before executing a part program, you must first create the desired tool in the tool list and proceed with the tool setting operations.

Operating sequence




1. Select the offset operating area.



2. Open the tool list window.



3. Open the lower-level menu for tool type selection.

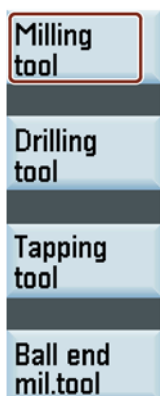

4. Select a tool type (for example, a milling tool) with the corresponding softkey.

5. Enter the tool number in the following window:

New milling tool

Tool No.:

	Identifier
	Milling tool



6. Press this softkey to confirm your settings. The following window shows the information of the new tool created. Set the desired tool data in this window.

Tool list					
Type	T	D	H	Geometry	
				Length	Radius
	1	① 1	② 1	0.000	0.000

- Column ① indicates the tool offset number in Siemens dialect mode.
- Column ② indicates the tool offset number visible only in ISO dialect mode.

Note:

The H number in column ② is equal to the tool number in column T by default. In case of two or more tool offsets for a tool, the H number is 0.

- If D = 1, by default H = T.
- If D ≠ 1, by default H = 0.

You can change the H number as required, but changing to a number same as an existing one (except 0) is not permitted.

7. Press this key to confirm your settings.



6.2 Creating/changing a cutting edge

Note

Before creating or changing cutting edges, you must first create a tool (Page 21).

Operating sequence



1. Select the offset operating area.
2. Open the tool list window.
3. Select the tool to which you desire to add a cutting edge.
4. Open the menu items for cutting edge settings.
5. Press this softkey to create a new cutting edge for the selected tool. The control system automatically adds the new cutting edge to the tool list. Now you can enter different lengths and radii for each cutting edge.

Tool list					
Type	T	D	H	Geometry	
				Length	Radius
	1	1	1	0.000	0.000
		2	0	0.000	0.000

Note:

When you add a new cutting edge, the default H number is 0.

H number cannot be changed to be the same as an existing one (except 0).

6. You can also press the corresponding softkey to reset or delete a cutting edge.



6.3 Activating the tool and the spindle

Note

A tool in the tool list is not active until you activate it in "MDA" mode or the "T, S, M" window.

Operating sequence



1. Select the machining operating area.
2. Switch to "JOG" mode.
3. Open the "T, S, M" window.
4. Enter the desired tool number (for example, 1) in the "T, S, M" window.

T,S,M		
Tool change	1	D1
Spindle speed	1000	rpm
Spindle M Function	SPOS	50.000 °
Activate W0		
Other M function		
Press 'CYCLE START' to activate above functions.		
T,S,M	Set REL	Meas. work.
		Meas. tool



5. Press this key to move the cursor to the input field for the spindle speed, and enter the desired speed, for example, 1000.



6. Press this key again to move the cursor to the input field for the spindle direction.



7. Use this key to select the spindle direction, for example, "M3".



8. Press this key on the MCP to activate the tool and the spindle.



 
9. Press this key on the MCP to stop spindle rotation.



10. Press this softkey to return to the main screen of the machining operating area.

Note

You can alternatively activate the spindle using the following keys on the MCP:



For more information, see Section "Running the spindle manually (Page 294)".

6.4 Assigning the handwheel

If the machine manufacturer has assigned the handwheel for the control system, you can skip this section and directly measure the tool (Page 27) after activating the tool and the spindle (Page 23).

This control system provides the following two methods for assigning the handwheel:

- Assigning the handwheel through the MCP (Page 25)
- Assigning the handwheel through the PPU (Page 25)

Note

Make sure there is no obstacle when moving the tool to avoid tool collision.

6.4.1 Assigning the handwheel through the MCP

Precondition

MD14512[16].7 = 0 (factory default)


Operating sequence



1. Select the machining operating area.



2. Press this key on the MCP to control the axis movement with external handwheels.

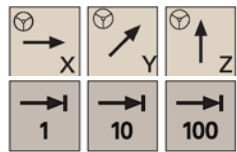

3. Press the desired axis traversing keys to assign the handwheel.
4. Press the increment keys on the MCP to select the required override increment.
 - 1: The override increment is 0.001 mm.
 - 10: The override increment is 0.010 mm.
 - 100: The override increment is 0.100 mm.



5. Rotate the handwheel to make the selected axis approach the workpiece.
6. Cut the surface of the workpiece to verify the handwheel assignment.
7. Press this softkey to close the window for handwheel assignment.



8. Press this key to return to the main screen of the machining operating area.

6.4.2 Assigning the handwheel through the PPU

Precondition

Set MD14512[16].7 = 80 (default value: 0). With this setting, you can only assign the handwheel through the PPU.

Operating sequence (activating the handwheel control function on the PPU)

If this function is already active, skip the steps below and proceed directly to the operating sequence for assigning the handwheel through the PPU.



1. Select the system data operating area.



2. Open the machine data window.



3. Press this softkey to open the basic machine data list.



4. Press this softkey to open the search field and enter the machine data "14512".



5. Confirm your entry with this softkey. Then the system starts searching automatically.



6. Move the cursor to the input field for 14512[16].



7. Enter the value "80".
8. Confirm your entry.



9. Press this vertical softkey to activate the value change. Note that the control system restarts to accept the new value.

Operating sequence (assigning the handwheel through the PPU)



1. Select the machining operating area.



2. Press this key on the MCP.




3. Press this key to open the extended menu.




4. Open the handwheel assignment window.



5. Select the handwheel to be assigned with the cursor keys in the following window. You can assign a maximum of two handwheels.

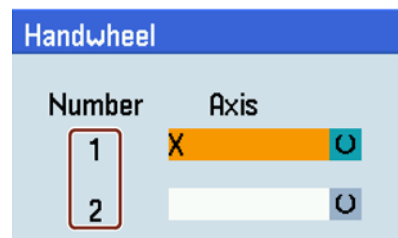

 6. Press the desired vertical softkey (<X> ... <MZ1>) or this key for the handwheel assignment. The handwheel symbol which appears to the left of the selected axis (for example, the X-axis) indicates that you have assigned the handwheel to the selected axis.



7. Press the increment keys on the MCP to select the required override increment.

- 1: The override increment is 0.001 mm.
- 10: The override increment is 0.010 mm.
- 100: The override increment is 0.100 mm.

8. Rotate the handwheel to make the selected axis approach the workpiece.

9. Machine a surface to verify the handwheel assignment.

10. Press this softkey to close the window for handwheel assignment.





11. Press this key to return to the main screen of the machining operating area.

6.5 Measuring the tool manually

Note

- You must first create a tool (Page 21) and activate it (Page 23) before measuring the tool.
- This section takes the milling tool measurement for example. If you have created other types of tools, proceed through the following steps to finish the measurement of all the tools. This will make the tool change process easier.

Operating sequence



1. Select the machining operating area.



2. Switch to "JOG" mode.



3. Open the tool measurement window.



4. Open the manual tool measurement window.



5. Press the axis traversing keys to move the infeed axes to the desired positions above the workpiece.



6. Switch to handwheel control mode.



7. Press this key to set the workpiece or a fixed point as the reference point.

Note:


You can define a fixed point as desired, for example, the workbench.



8. Select a suitable override feedrate, and then use the handwheel to move the tool to scratch the required workpiece edge (see the left illustration shown below) or the edge of the setting block, if it is used (see the right illustration shown below).



9. Enter the distance between the tool tip and the reference point in the "Z0" field, for example, "0". (This value is the thickness of a setting block if it is used.)

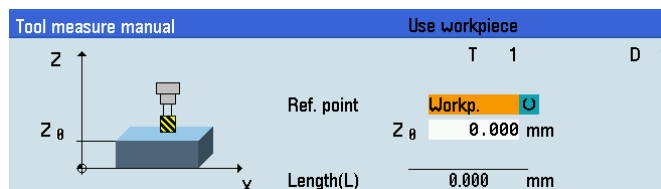

Set length

Diameter



10. Save the tool length value in the Z axis. The tool diameter, radius, and cutting edge position are all taken in to account.


11. Press this vertical softkey to open the window for measuring the tool diameter.

12. Press the axis traversing keys to move the tool to approach the workpiece in the X direction.

13. Switch to handwheel control mode.

14. Select a suitable override feedrate, and then use the handwheel to move the tool to scratch the required workpiece edge (or the edge of the setting block, if it is used).

15. Enter the distance to the workpiece edge in the X and Y directions in the "X0" and "Y0" fields respectively, for example, enter "0" at "X0" and "0" at "Y0". (This is the value of the width of a setting block if it is used. Select one of X0/Y0 as required.)

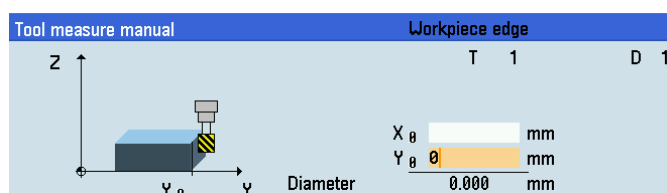

Set diameter

Tool list

16. Save the tool diameter value.

17. Press this softkey and you can see that the compensation data values have been automatically added to the tool data.

6.6 Verifying the tool offset result

To guarantee the safety and correctness of machining, you must verify the tool setup result.

Note

Before verifying the tool setup result, you must have finished all tool setup work as mentioned before.

Operating sequence



1. Select the machining operating area.



2. Switch to "MDA" mode.

Delete file

3. Press this softkey on the PPU.

4. Enter the following test program (or you can create your own program):

T1 D1
G00 X0 Y0 Z5

Alternatively, you can press this softkey to load an existing part program from a system directory.

Load file



5. Press this key to activate the "ROV" function (indicator on: this function is active).

Note:

After the "ROV" function is active, the feedrate override switch can also control the speed of G00.



6. Rotate the feedrate override switch to 0%.

7. Press this key on the MCP.

Increase the feedrate override gradually to avoid accidents caused by fast axis movement. Observe whether the axis moves to the specified position.

For more information on the further softkey functions in "MDA" mode, see Section ""MDA" mode (Page 300)".

7 Creating part programs

7.1 Creating a part program

The control system can store a maximum of 300 part programs which include those created by the control system for certain functions such as MM+, TSM, and so on.



WARNING

Machine malfunction due to use of insecure part programs

Running an insecure part program on your machine may cause unexpected attacks to the machine, which in turn can lead to death, personal injuries, and/or machine damage.

- Make sure that you use part programs that come from trusted sources.

Methods for creating part programs

You can create a part program with one of the following methods:

- Creating on a computer and transferring it to the PPU via USB interface (Page 65)
- Creating on a computer and transferring it to the PPU via Ethernet interface (Page 69)
- Creating directly on the PPU (see below for details)

 
Creating a part program on the PPU



1. Select the program management operating area.



2. Press this softkey to enter the system directory for storing part programs.



3. To directly create a new program file, press this softkey and go to Step 4.

To create a new program directory first, press this softkey and proceed as follows before you go to Step 4:



A. Press this softkey to open the window for creating a new directory.

New directory	
Type:	Directory DIR
Name:	

B. Enter a desired name for the new directory. Note that some special characters (see table at the end of this section) are invalid for the directory name.



 
C. Press this softkey to confirm your entry.



D. Select the new directory with the cursor keys.



E. Press this key on the PPU to open the directory.




4. Press this softkey to open the window for creating a new program.

New G code program

Type: Main program MPF

Name:

5. Enter the name of the new program. You can enter the file name extension ".MPF" (main program) or ".SPF" (subprogram) to define the program type. The control system identifies a program as a main program if you do not enter any file name extension. The character length of a program name is limited to 24 English characters or 12 Chinese characters. Note that some special characters (see table at the end of this section) are invalid for the program name.
6. Press this softkey to confirm your entry. The part program editor window opens automatically. Now you can edit the program text in the window. The control system saves your editing automatically.

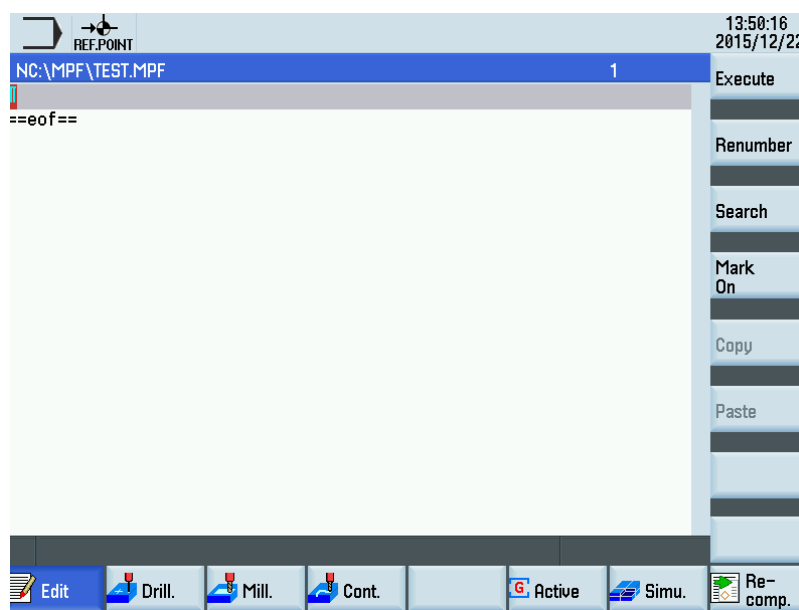

Special characters invalid for program or directory names


The control system does not support the use of the following special characters in program or directory names:

/	<	>	?	:	#	(	)	[	]	\$	!	-
+	^	\	*		;	&	%	@	=	~	`	Space

7.2 Editing the part program

7.2.1 Using a standard program structure

Using a standard program structure provides an easy way of part programming and a clear view of the machining sequences. Siemens recommends that you use the following program structure:

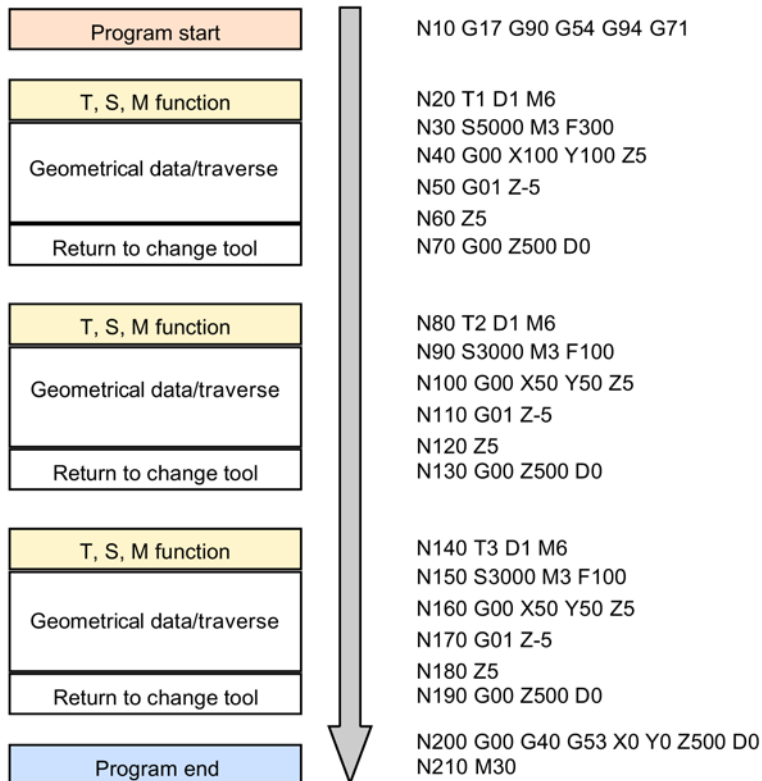

7.2.2 Editing a part program

Methods for editing part programs

You can edit a part program with one of the following methods:

- Editing on a computer and transferring it to the PPU via USB interface (Page 65)
- Editing on a computer and transferring it to the PPU via Ethernet interface (Page 69)
- Editing directly on the PPU (see below for details)

Editing an internal part program on the PPU

You can edit an internal part program only when it is not being executed. Note that any modification to the part program in the program editor window is stored immediately.

Note:

Steps 1 to 4: Search for a program file

Steps 5 to 9: Edit the selected program in the open program editor window



1. Select the program management operating area.



2. Press this softkey to enter the system directory for storing part programs.



3. Select the desired program file/directory in one of the following methods:

- Navigate to the program/directory with the cursor keys

- Open the search dialog box and enter the desired search term.

Note:

If you search for a program, the file name extension must be entered in the first input field of the dialog box below.

Search

Name:

Contained text:

☐ Include subordinate folders

☐ Case-sensitive

Search in:

/_N_MPF_DIR/

- On the PPU, press the alphabetic or numeric key that contains the first character of the desired program/directory name. The control system automatically highlights the first program/directory whose name starts with that character. If necessary, press the key continuously until you find the desired program/directory.




4. Press this key to open either the selected program in the program editor or the selected directory. In the latter case, perform Step 3 and then Step 4 until the selected program is opened in the program editor.

5. Edit the program text in the program editor window using the following keys on the PPU:



6. When necessary, select the following vertical softkeys to complete more program editing operations.

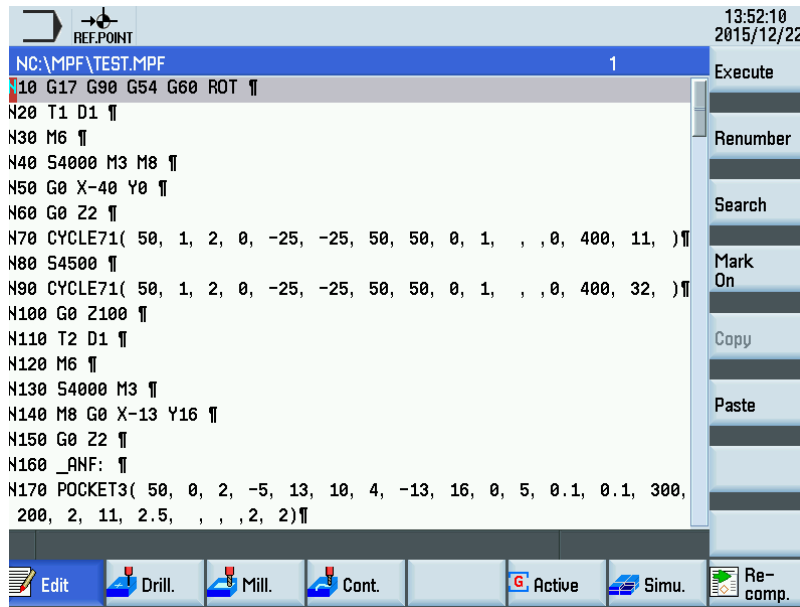

- **Renumbering program blocks**

Renumber

With this softkey, you can modify the block numbering (Nxx) of a program opened in the program editor window. After you press this softkey, the block number is inserted at the beginning of the program block in ascending order and is increased by an increment of 10 (for example, N10, N20, N30).

- **Searching in programs**

Search

Pressing this softkey opens the search dialog box. You can use the search function to quickly arrive at points where you would like to make changes, for example, in very large programs. You can search with specified text or line number by selecting the corresponding softkey as follows:




- **Copying/deleting/pasting program blocks**

A. Press this softkey in the open program editor window to insert a marker.

Mark On

B. Select the desired program blocks with the cursor.

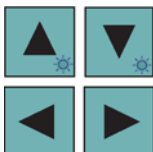

C. Press this softkey to copy the selection to the buffer memory.

Copy

- OR -

Press this key to delete the selected program blocks and to copy them into the buffer memory.

DEL



D. Place the cursor on the desired insertion point in the program and press this softkey. The content of the buffer memory is pasted.



7. If you want to program cycles, press the corresponding softkey to open the desired cycle programming window. For more information, see Section "Cycles (Page 152)".



8. If you want to program contours, press this softkey to open the contour programming window. For more information, see Section "Free contour programming (Page 312)".



9. Press this key to return to the program management operating area after finishing editing.



Note:

When you are in the main screen of the program management operating area, you can select to make the following operations between programs:

- Searching for programs
- Copying/cutting/pasting programs
- Deleting/restoring programs
- Renaming programs

For more information, see Section "Program management operating area (Page 287)".

Editing an external part program on the PPU

You can edit an external part program directly on the PPU. Note that the program can be edited only when it is not being executed.

Note:

Steps 1 to 3: Search for a program file

Steps 4 to 7: Edit the selected program in the open program editor window



1. Select the program management operating area.



2. Press the desired softkey to enter the target program directory.



3. Follow the above steps 3 and 4 for editing an internal program to search for and open the desired program file.

4. Edit the program text in the program editor window using the following keys on the PPU:



5. When necessary, select the following vertical softkeys to complete more program editing operations.

- **Renumbering program blocks**

With this softkey, you can modify the block numbering (Nxx) of a program opened in the program editor window. After you press this softkey, the block number is inserted at the beginning of the program block in ascending order and is increased by an increment of 10 (for example, N10, N20, N30).

Renumber

- **Searching and replacing in programs**

Pressing this softkey opens the search dialog box. You can use the search function to quickly arrive at points where you would like to make changes, for example, in very large programs.

Search

You can search with specified text or line number by selecting the corresponding softkey as follows:

Text

Line
no.

If more than one search result is found, you can also use the following softkey to check the remaining results one by one:

Continue
search

You can search and replace with specified text by using the following softkey:

Search &
replace

If more than one search result is found, you can also use the following softkey to replace the remaining results one by one:


Replace

 
 
 
- **Copying/deleting/pasting program blocks**

A. Press this softkey in the open program editor window to insert a marker.

Mark
On

B. Select the desired program blocks with the cursor.

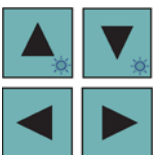



C. Press this softkey to copy the selection to the buffer memory.

- OR -

Press this key/softkey to delete the selected program blocks and to copy them into the buffer memory.

D. Place the cursor on the desired insertion point in the program and press this softkey. The content of the buffer memory is pasted.

- **Cutting a row of program blocks**

With this softkey, you can delete the entire program row where the cursor is placed and copy into the buffer memory. Then you can move the cursor to the desired position and press the following softkey to paste the cut program row at the current cursor position:



- **Undoing/redoin operations**


Pressing this softkey allows you to revoke your last operation.

Pressing this softkey allows you to restore your last operation that is revoked.

6. Save the program file after finishing editing through the following softkey operations:



If you switch to any other operating area after finishing editing without saving, a message appears to remind you to save the file, for example:

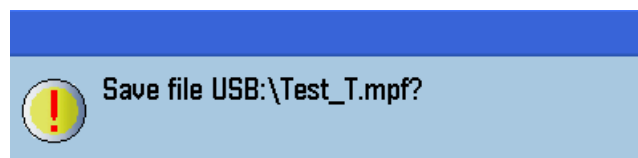

In this case, you may press either of the following softkeys as desired:



Pressing this softkey aborts the editing results and system switches to the desired operating area.

Pressing this softkey saves the editing results before the system switches to the desired operating area.



7. Press this key to return to the program management operating area.

Note:

When you are in the main screen of the program management operating area, you can select to make the following operations between programs:

- Searching for programs
- Copying/cutting/pasting programs
- Deleting programs
- Renaming programs

For more information, see Section "Program management operating area (Page 287)".

Note

When you perform editing operations such as renumbering, searching, and saving of an external program file larger than 4 MB, a message appears reminding you that it will take a long time to complete the operations.

To ensure that the program editor works properly, you are recommended to edit an external program file smaller than 200 MB.

7.2.3 Understanding frequently used programming instructions


7.2.3.1 Inch or metric dimensions (G70/G71)

Description	Programming example
G71: With G71 at the program start, both the geometrical data and the feedrates are evaluated as metric units.	N10 G17 G90 G54 G71 N20 T1 D1 M6 N30 S5000 M3 G94 F300 N40 G00 X100 Y100 Z5 N50 G01 Z-5 N60 Z5 N70 G00 Z500 D0
G70: With G70 at the program start, the geometrical data is evaluated as inches, but the feedrates are not affected and remain as metric units.	N10 G17 G90 G54 G70 N20 T1 D1 M6 N30 S5000 M3 G94 F300 N40 G00 X3.93 Y3.93 Z5 N50 G01 Z-0.787 N60 Z0.196 N70 G00 Z19.68 D0

For more information, see Section "Dimensions in metric units and inches: G71, G70, G710, G700 (Page 80)".


7.2.3.2 Definition of work offset (G54 to G59, G507 to G532, G500, G90/G91)

Description	Illustration	Programming example
G500: All absolute path data corresponds to the current position. The position values are written in the G500 (basic) zero offset.		N10 G17 G90 G500 G71 N20 T1 D1 M6 N30 S5000 M3 G94 F300 N40 G00 X50 Y50 Z5 N50 G01 Z-20 N60 Z5 N70 G00 Z500 D0
G54 to G59 and G507 to G532: With G500 = 0, the offset for the workpiece can be stored in the workpiece offsets G54 to G59 and G507 to G532.		N10 G17 G90 G54 G71 N20 T1 D1 M6 N30 S5000 M3 G94 F300 N40 G00 X0 Y0 Z5 N50 G01 Z-20 N60 Z5 N70 G00 Z500 D0

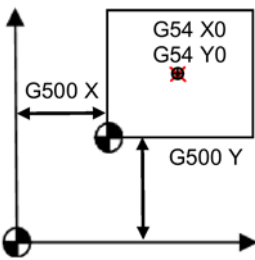Description	Illustration	Programming example
G500 + G54: With G500 ≠ 0 activated, the value in G500 is added to the value in G54.		<pre> N10 G17 G90 G500 G71 N20 T1 D1 M6 N30 S5000 M3 G94 F300 N40 G00 G54 X20 Y20 Z5 N50 G01 Z-20 N60 Z5 N70 G00 G53 Z500 D0 </pre>
G90: With G90 (absolute positioning) at the program start, the geometrical data refers to the zero of the coordinate system currently active in the program, usually with G54, G500, or G500 + G54.	-	<pre> N10 G17 G90 G54 G71 N20 T1 D1 M6 N30 S5000 M3 G94 F300 N40 G00 X100 Y100 Z5 N50 G01 Z-20 N60 Z5 N70 G00 Z500 D0 </pre>
G91: With G91 (incremental positioning), you can add numerical value of path information (the incremental positioning with the current axis position as the start point) in the program. Subsequently, switch to absolute positioning with G90.	-	<pre> N10 G17 G90 G54 G70 N20 T1 D1 M6 N30 S5000 M3 G94 F300 N40 G00 X3.93 Y3.93 Z0.196 N50 G01 G91 Z-0.787 N60 Z0.196 N70 G00 G90 Z19.68 D0 </pre>

For more information, see Sections "Workpiece coordinate system - settable work offset: G54 to G59, G507 to G532, G500, G53, G153 (Page 87)" and "Absolute/incremental dimensioning: G90, G91, AC, IC (Page 79)".

7.2.3.3 Rapid traverse (G00)

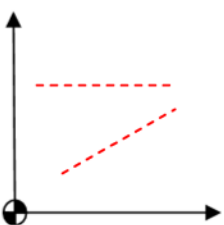Description	Illustration	Programming example
G00: When G00 is active in the program, the axis will traverse at the maximum axis speed in a straight line.	 Straight line in any direction	<pre> N10 G17 G90 G54 G71 N20 T1 D1 M6 N30 S5000 M3 G94 F300 N40 G00 X50 Y50 Z5 N50 G01 Z-5 N60 Z5 N70 G00 Z500 D0 </pre>

For more information, see Section "Linear interpolation with rapid traverse: G0 (Page 90)".

7.2.3.4 Tool and traverse (T, D, M6, F, G94/G95, S, M3/M4, G01)

Description	Programming example
T, D: A new tool can be selected with the "T" command, and the "D" command is used to activate the tool length offset. M6: M6 can be used for automatic tool change on the machine. G94/G95, F: The feedrate is defined with "F". G94 F defines feedrate in terms of time (mm/min) and G95 F defines feedrate in terms of spindle revolutions (mm/rev). S, M3/M4: The spindle speed is defined with "S". The spindle direction is defined with M3(clockwise) and M4 (counter-clockwise). G01: When G01 is active in the program, the axis traverses at the programmed feedrate (as defined by G94 F or G95 F) in a straight line.	N10 G17 G90 G54 G71 N20 T1 D1 M6 N30 S5000 M3 G94 F300 N40 G00 X50 Y50 Z5 N50 G01 Z-5 N60 Z5 N70 G00 Z500 D0


For more information, see sections as follows:

- Tool T (Page 114)
- Tool compensation number D (Page 115)
- Feedrate F (Page 91)
- Spindle speed S, directions of rotation (Page 108)
- Linear interpolation with feedrate: G1 (Page 91)

7.2.3.5 Tool radius compensation (G40, G41/G42)

The tool radius compensation can be activated (G41/G42) or deactivated (G40) in contour programming.


- G41: tool radius compensation to the left of the contour
- G42: tool radius compensation to the right of the contour
- G40: tool radius compensation off

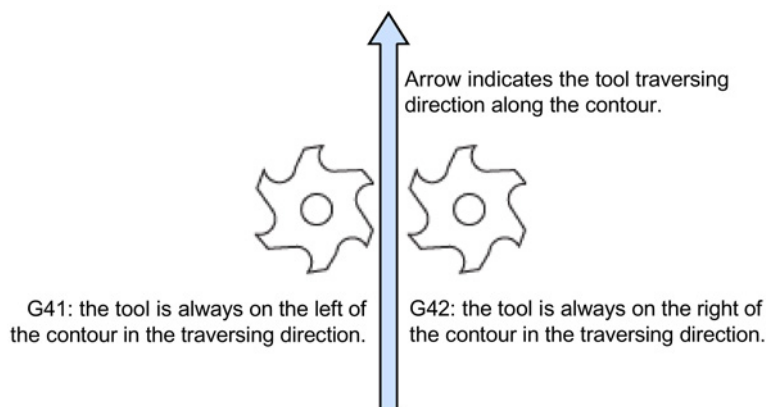

When traversing circle contours with cutter radius compensation, it must be decided whether the feedrate should act at the circle contour of the workpiece (CFC) or the path defined by the cutter center point (CFTCP).

When using the feedrate at the circle contour defined by the CFC command, the feedrate is constant at the contour, which however may cause increase in the feedrate of the tool. This increase could damage the tool if excessive material is encountered at the contour. Therefore, CFC is commonly used for finish cutting of contours.

The CFTCP command ensures a constant feedrate of the tool, but different feedrates at the contour. This may cause deviations in surface finish.

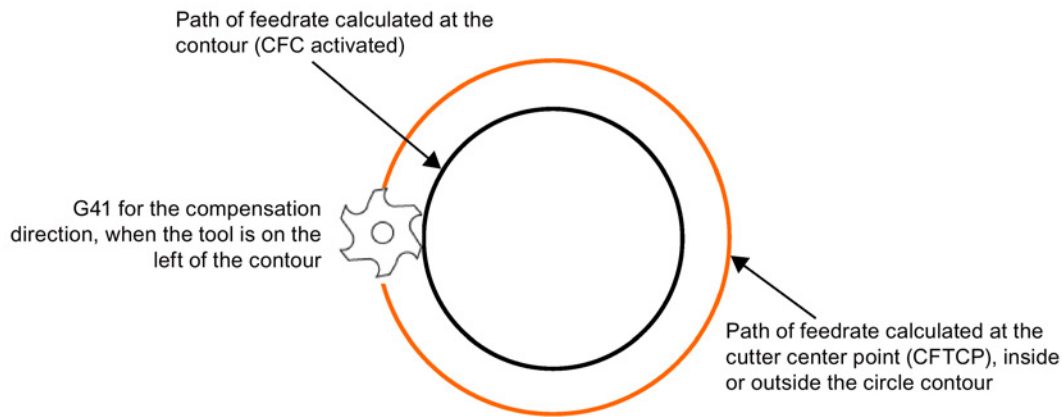

These two commands may cause the cutter to traverse fast around a corner or slowly at the contour.

For more information, see Sections "Tool radius compensation OFF: G40 (Page 120)" and "Selecting the tool radius compensation: G41, G42 (Page 117)".

7.2.3.6 Milling circles and arcs (G02/G03)

The following gives an example of machining arc with specified program code:

```

N10 G17 G90 G500 G71
N20 T1 D1 M6
N30 S5000 M3 G94 F300
N40 G00 X-20 Y-20 Z5
N50 G01 Z-5
N60 G41 X0 Y0
N70 Y50
N80 X100
N90 G02 X125 Y15 I-12 J-35
N100 G01 Y0
N110 X0
N120 G40 X-20 Y-20
N130 G00 Z500 D0

```

* Note that N90 block as above can also be written as "N90 G02 X125 Y15 CR=37".


When milling circles and arcs, you must define the circle center point and the distance between the start point, end point, and the center point in the relative coordinate system.

When using the XY coordinate system, the interpolation parameters I and J are available.

There are two common ways of defining circles and arcs:

- G02/G03 X... Y... I... J...
- G02/G03 X... Y... CR=...

Use positive value in CR with arcs $\leq 180^\circ$, and negative value with arcs $> 180^\circ$.

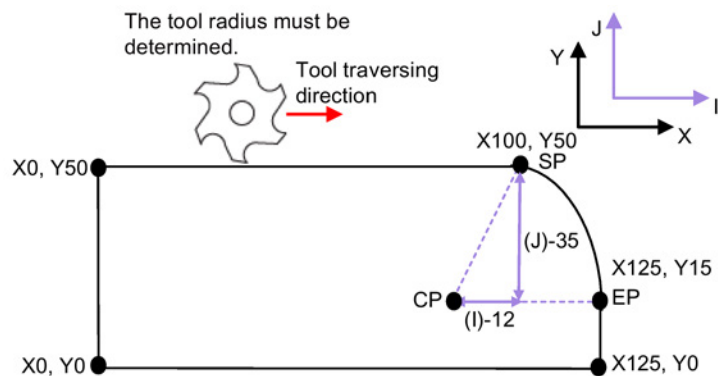

- SP Start point of circle
- CP Center point of circle
- EP End point of circle
- I Incremental distance from SP to CP in X axis
- J Incremental distance from SP to CP in Y axis
- G2 Traversing direction of the circle (clockwise)
- G3 Traversing direction of the circle (counter-clockwise)

For more information, see Section "Circular interpolation: G2, G3 (Page 92)".

7.2.3.7 Fixed point approach (G74/G75)

Description	Programming example
G74: By using G74, reference point can be approached automatically.	N10 G17 G90 G500 G71 N20 T1 D1 M6 N30 S5000 M3 G94 F300 N40 G00 X50 Y50 Z5 N50 G01 Z-5 N60 Z5 N70 G74 Z=0 ;reference point
G75: By using G75, a fixed point on the machine defined by the manufacturer can be approached automatically.	N10 G17 G90 G500 G71 N20 T1 D1 m6 N30 S5000 M3 G94 F300 N40 G00 X50 Y50 Z5 N50 G01 Z-5 N60 Z5 N70 G74 Z=0 ;reference point N80 G75 X=0 ;fixed point

For more information, see Section "Fixed point approach (Page 103)".

7.2.3.8 Spindle control

Description	Programming example
M3: Spindle accelerates to the programmed speed in clockwise direction.	N10 G17 G90 G500 G71 N20 T1 D1 M6 N30 S5000 M3 G94 F300
M4: Spindle accelerates to the programmed speed in counter-clockwise direction.	N40 G00 X50 Y50 Z5 N50 G01 Z-5 N60 M5
M5: Spindle decelerates to stop.	N70 Z5 M4 N80 M5
M19: Sets the spindle to a specific angular position.	N90 M19 N100 G00 Z500 D0

For more information, see Section "Spindle movements (Page 108)".

7.2.3.9 Setting dwell time in the program (G04)

Description	Programming example
G04: G04 can be used to pause the tool movements during machining process. G04 F5: program dwells for 5 seconds This makes the workpiece surface much smoother.	N10 G17 G90 G500 G71 N20 T1 D1 M6 N30 S5000 M3 G94 F300 N40 G00 X50 Y50 Z5 N50 G01 Z-5 N60 G04 F5 N70 Z5 M4 N80 M5 N90 M19 N100 G00 Z500 D0

For more information, see Section "Dwell time: G4 (Page 107)".

8 Program simulation

Simulation before machining

Before automatic machining, you need to perform the simulation to check whether the tool moves in the right way. During simulation, the current program is calculated in its entirety and the result displayed in graphic form. The result of programming is verified without traversing the machine axes. Incorrectly programmed machining steps are detected at an early stage and incorrect machining on the workpiece prevented.

You can choose one of the following methods for simulation:

- Simulation prior to machining of the workpiece (Page 42)
- Simultaneous recording prior to machining of the workpiece (Page 44)

Simulation during machining

If the view of the work space is blocked by coolant, for example, while the workpiece is being machined, you can track the program execution on the screen. For more information, see Section "Simultaneous recording during machining of the workpiece (Page 47)".

8.1 Simulation prior to machining of the workpiece

Before machining the workpiece on the machine, you have the option of performing a quick run-through in order to graphically display how the program is executed. This provides a simple way of checking the result of the programming.

Operating sequence

Note that the following Steps 1 to 3 describe how to open a desired program file on the PPU. If you are already in the program editor window, you can go to Step 4 directly.



1. Select the program management operating area.



2. Enter the system program directory and position the cursor on the program to be simulated.



3. Press this key and the program is opened in the program editor window.



4. Switch to "AUTO" mode.




5. Press this softkey to open the program simulation window, and the program control mode PRT is automatically activated.



6. Press this key to start the simulation for the selected program.

The program execution is displayed graphically on the screen. The machine axes do not move.

7. You can also select the vertical softkeys as required in the simulation window as follows:

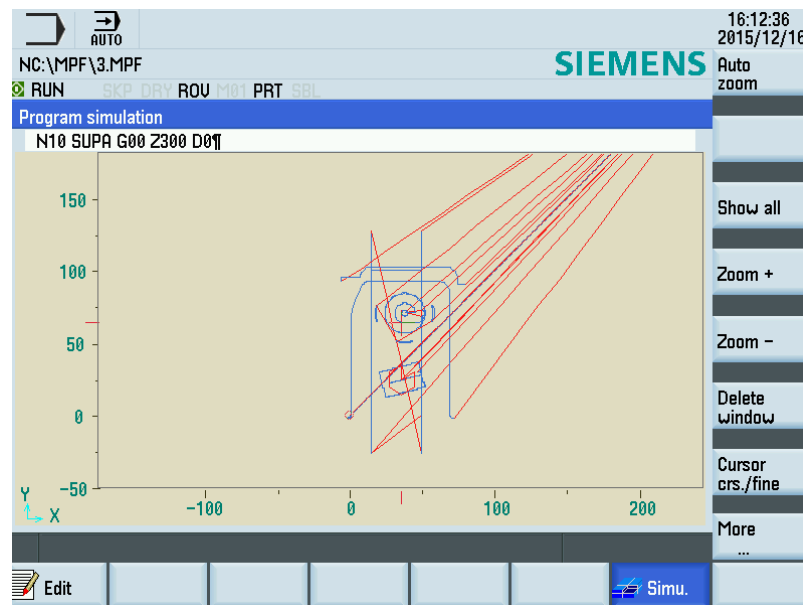

Scales the entire simulation track automatically to adapt to the size of the window



Opens the lower-level menu for the following block display options:

- Display all G17 blocks
- Display all G18 blocks
- Display all G19 blocks



Zooms in the screen from the cursor position



Zooms out the screen from the cursor position



Deletes all the simulation tracks recorded up till now



Makes the cursor move in large or small steps



Enables the material removal simulation of a defined blank



Selects whether to show the blocks or not



8. Press this key on the MCP if you wish to stop the simulation.

- OR -



Press this key on the MCP to cancel the simulation.



9. Press this key on the MCP to restart or continue the simulation.



10. After you finish the simulation, you can press this softkey to return to the program editor window.

8.2 Simultaneous recording prior to machining of the workpiece

Before machining the workpiece on the machine, you can graphically display the execution of the program on the screen to monitor the result of the programming.

Operating sequence



1. Select the program management operating area.



2. Enter the target program directory and position the cursor on the desired program.

3. Press this softkey and the system automatically changes to "AUTO" mode in the machining operating area.



4. Press this softkey to open the lower-level menu for program control.



5. Press this softkey to activate the PRT mode, and the program is executed without axis movement.

**Dry run
feedrate**

You can additionally press this softkey to replace the programmed feedrate with a dry run feedrate. For more information about setting the dry run feedrate, see Section "Dry run feedrate (Page 52)".

**Simult
record**

6. Press this softkey to open the simultaneous recording window.

**CYCLE
START**

7. Press this key to start the recording. The program execution is displayed graphically on the screen. The machine axes do not move.

**CYCLE
STOP**

8. Press this key on the MCP if you wish to stop the recording.
- OR -

RESET

Press this key on the MCP to cancel the recording.

**CYCLE
START**

9. Press this key on the MCP to restart or continue the recording.

Note

You must deactivate the PRT mode and the dry run feedrate activated in Steps 4 and 5 above before machining the workpiece on the machine; otherwise the machining cannot be performed due to the standstill of the axes and the spindle.

For more information about the softkeys in the simultaneous recording window, see Section "Simulation prior to machining of the workpiece (Page 42)".

9 Machining the workpiece

9.1 Executing a part program

Before starting a program, make sure that both the control system and the machine are set up, and the part program is verified with simulation and test. Observe the relevant safety notes of the machine manufacturer.

**PROGRAM
MANAGER**

1. Select the program management operating area.

▲ **▼**

2. Select the desired program directory.
3. Select the program that you desire to execute.

Execute

4. Press this softkey. For some directories, press the following softkey instead:

**Ext. exe-
cution**

The system automatically changes to "AUTO" mode in the machining operating area after you press the softkey.

**NC Prog.
cntrl**

5. If desired, you can use this softkey to specify how you want the program to be executed (for more information, see Section "Program control functions (Page 52)").



6. Make sure the feedrate override is 0%. Press this key on the MCP to close the safety door. If this function is not available, close the door on the machine manually.



7. Press this key on the MCP to start the machining of the program.



8. Turn the feedrate override switch slowly to the desired value.
Pressing this key stops the execution of a part program. The program currently running is aborted. On the next program start, the machining starts from the beginning.



Pressing this key suspends the execution of a part program. The axes stop running while the spindle continues running. Press the following key again, and the program continues to run.



Note

To ensure the shortest machining time, do not perform the HMI operations during program running, for example, creating a new program or editing an external program on the PPU.

9.2 Executing specified blocks

If you would only like to perform a certain section of a program on the machine, then you do not need to start the program from the beginning. You can start the program from a specified program block in the following cases:

- After you stop or interrupt the program execution
- When you need to specify a target position, e.g. during remachining

Operating sequence

Proceed as follows to start machining from the last interruption point in the program:



1. Select the machining operating area.



2. Switch to "AUTO" mode.



3. Press this softkey to open the block search window.



4. Press this softkey to load the interruption point, and the cursor moves to the beginning of the target block which is interrupted last time.



5. Press one of the following softkeys to set the condition for the block search:
 - The program will continue from the line before the target block. The same calculations of the basic conditions (e.g. tool and cutting edge numbers, M functions, feedrate and spindle speed) in the previous blocks are carried out as during normal program operation, but the axes do not move.



- The program will continue from the target block containing the interruption point. The same calculations of the basic conditions in the previous blocks are carried out as during normal program operation, but the axes do not move.

**Without
calculat.**

- Block search without calculation of the basic conditions. All settings required for execution have to be programmed from the target block (e.g. feedrate, spindle speed, etc.).

For the block search to contour/end point, make sure you set MD11450 bit 2 to 1 to suppress the output of the auxiliary functions. Note that MD11450 is visible only with the manufacturer password.

6. Make sure the feedrate override is 0%.
7. Press this key on the MCP, and then an alarm 010208 appears for your confirmation whether to continue.



010208 Continue program with NC start 16:07

8. Press this key again to execute the program.



9. Turn the feedrate override switch on the MCP slowly to the desired value.

NOTICE

Damage to workpiece or machine tools

For the machining in ISO mode, you must program the desired feedrate from the target block after a block search without calculation. Otherwise, the axis will traverse at the maximum speed with G0 after you execute the program, which may cause damage to the workpiece or the machine tools.

9.3 Correcting a part program

As soon as a syntax error in the part program is detected by the control system, program execution is interrupted and the syntax error is displayed in the alarm line. In this case, you can correct the error directly in the machining operating area with the program correction function. When making program changes, the control system must be brought into the reset state.

Note

The program correction function is not available for program execution from external.

Operating sequence

Prerequisite: A part program is loaded in "AUTO" mode in the machining operating area.



1. Press this key on the MCP to place the program in the reset mode.



2. Press this softkey to activate the block editing window.



3. Make the necessary corrections. Any changes to the program will be stored immediately.
4. After you finish the program correction, press this softkey to switch back to the block display window.



5. Press this key on the MCP to restart the machining of the program.

9.4 Simultaneous recording during machining of the workpiece

You can follow machining of the workpiece on the screen while the program is being executed on the machine.

Operating sequence



1. Select the program management operating area.

Execute

2. Enter the target program directory and position the cursor on the desired program.
3. Press this softkey and the system automatically changes to "AUTO" mode in the machining operating area.



4. Press this softkey to open the simultaneous recording window.



5. Press this key to start the recording. The machining of the workpiece is started and graphically displayed on the screen.

9.5 Entering the tool wear offsets

Note

You must distinguish the direction of tool wear compensation clearly.

Two methods are available for entering the tool wear offsets: absolute input and incremental input (default: absolute input).

Operating sequence for absolute input



1. Select the offset operating area.



2. Open the tool wear window.



3. Use the cursor keys to select the required tools and their edges.

4. Enter the desired tool length wear parameter and the tool radius wear parameter (range of value in mm: -9.999 to 9.999).

Positive value: the tool compensates in a direction of moving away from the workpiece.

Negative value: the tool compensates in a direction of approaching the workpiece.

Note:

If there is already a non-zero offset value in the input field (for example, the existing tool length offset value is "0.1") and you desire to increase the offset value, then you can either directly enter the sum of the existing offset value and the increment, or call the pocket calculator to work out the tool wear offset (proceed through Steps 6 to 9).


5. Press this key or move the cursor to activate the compensation.




Tool wear < Absolute input >				
Type	T	D	Wear	
			Length	Radius
	1	1	0.200	0.000
		2	0.000	0.000




6. If you desire to use the pocket calculator, position the cursor on the desired input field and press this key. Then the pocket calculator is opened:

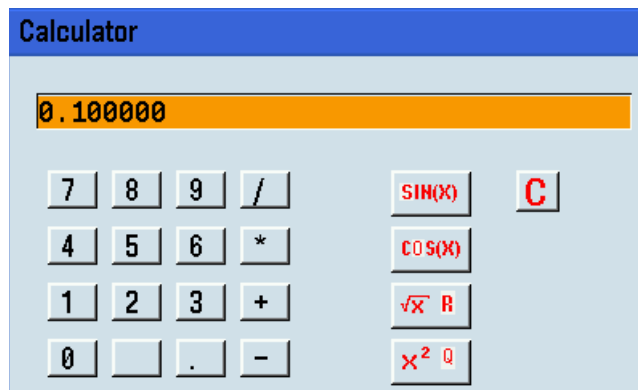

7. Enter the desired arithmetic statement in the input line of the pocket calculator.

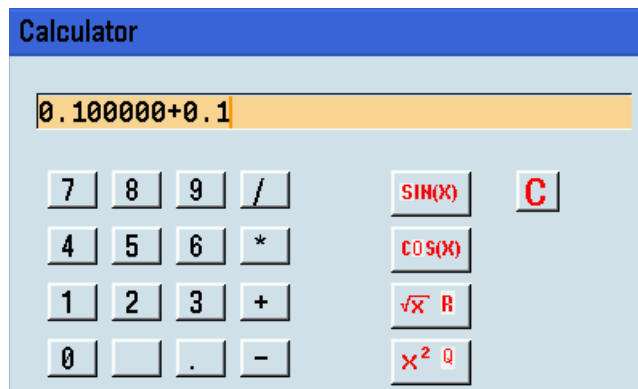

8. Press this key and the calculation result is displayed in the pocket calculator:

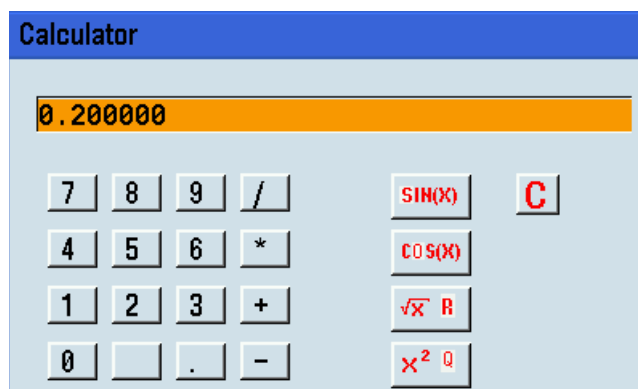

9. Press this softkey to enter the result in the input field at the current cursor position and close the pocket calculator automatically.



Tool wear < Absolute input >				
Type	T	D	Wear	
			Length	Radius
	1	1	0.200	0.000
		2	0.000	0.000

Note:

For more information about how to use the pocket calculator, see Section "Pocket calculator (Page 76)".

Operating sequence for incremental input



1. Select the offset operating area.




2. Open the tool wear window.



3. Position the cursor bar on the input field to be modified.

Tool wear < Absolute input >				
Type	T	D	Wear	
			Length	Radius
	1	1	0.100	0.000
		2	0.000	0.000

 

4. Switch to incremental input.

5. Enter the desired increment value, for example, 0.1.
 - Positive value: the tool compensates in a direction of moving away from the workpiece.
 - Negative value: the tool compensates in a direction of approaching the workpiece.

Note:

Alternatively, you can call the pocket calculator to work out the increment value (see Steps 7 to 10).




6. Press this key or move the cursor to activate the compensation. Then the value displayed in the input field becomes the sum of the original value and the increment value.


Tool wear < * Incremental input >				
Type	T	D	Wear	
			Length	Radius
	1	1	0.200	0.000
		2	0.000	0.000



7. If you desire to use the pocket calculator, press this key.

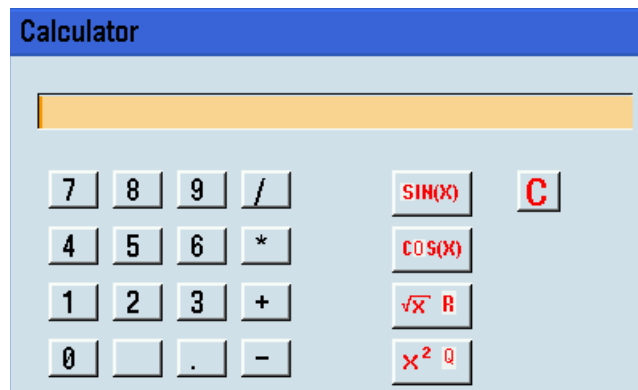

8. Enter the desired arithmetic statement in the input line of the pocket calculator.
 9. Press this key and the calculation result (for example, 0.1) is displayed in the pocket calculator:

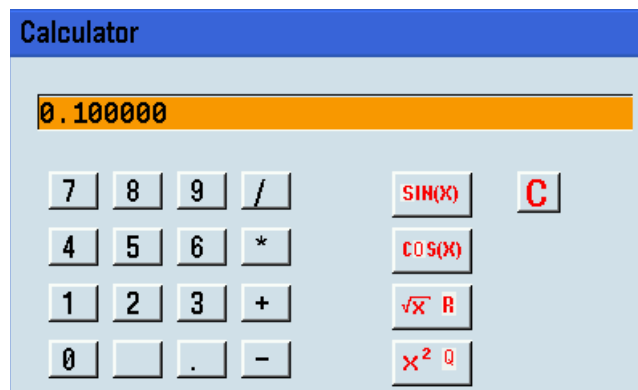

10. Press this softkey to add the calculation result to the value in the input field at the current cursor position and close the pocket calculator automatically.



Tool wear < * Incremental input >				
Type	T	D	Wear	
			Length	Radius
	1	1	0.200	0.000
		2	0.000	0.000

Note:

For more information about how to use the pocket calculator, see Section "Pocket calculator (Page 76)".

10 Other common operations

10.1 Program control functions

You can perform further program control operations through the following operation:



10.1.1 Program test

Program test

With this softkey activated, the part program is executed with no axis or spindle movement. In this way, you can check the programmed axis positions and auxiliary function outputs of a part program. This softkey functions the same as the following key on the MCP:



10.1.2 Dry run feedrate

Dry run feedrate

With this softkey activated, all traversing motions are performed with the dry run feedrate defined in SD42100 DRY_RUN_FEED. You can set the dry run feedrate in the JOG data setting window through the following operation:



10.1.3 Conditional stop

Condit. stop

With this softkey activated, the processing of the program stops at the end of every block containing M01. In this way, you can check the result already obtained during the machining of a workpiece. This softkey functions the same as the following key on the MCP:



Note that in order to continue executing the program, press the following key again:



10.1.4 Skip block

Skip

It is possible to skip program blocks, which are not to be executed every time the program runs.

With this softkey activated, the program blocks identified with a slash in front of the block number (e.g. "/N100") are skipped during machining. Several consecutive blocks can be skipped.

10.1.5 Single block mode

SBL fine

With this softkey activated, the system can interrupt the machining of the workpiece after each program block. In this way, you can control the machining result block-by-block and check individual machining steps. This softkey functions the same as the following key on the MCP:



The program is advanced to the next block via the following key:



However, for the thread blocks (G33), a stop is performed at the end of the current thread block only with dry run feedrate activated.

10.1.6 Rapid traverse override

ROV
active

With this softkey activated, the traversing speed of the axes in the rapid traverse mode (G00) can be controlled via the feedrate override switch on the MCP.

This softkey functions the same as the following key on the MCP:



It is recommended that you keep this function activated for easy feedrate control during machining.

10.1.7 Auxiliary function lock

Auxiliary
func. OFF

With this softkey activated, the part program is executed with the spindle disabled and all auxiliary functions (see below) suppressed.

Auxiliary function	Address
Tool selection	T
Tool offset	D, DL
Feedrate	F
Spindle speed	S
M functions	M
H functions	H

10.2 Calibrating the tool probe

Preconditions

- The machine manufacturer must have connected the probe to the control system. For more information, see the SINUMERIK 808D ADVANCED Function Manual.
- You must first enter the radius or diameter of the tool for probe calibration.

Operating sequences

Setting the probe data



1. Select the machining operating area.



2. Switch to "JOG" mode.



3. Open the lower-level menu for tool measurement.



4. Open the auto tool measurement window.



5. Press this vertical softkey to open the probe data setting window, which shows the coordinates of the probe. Enter the values in the input fields as required (see table below for the parameter descriptions). See the machine coordinate system for all position values.

Probe data

Abs. position P5 ①	0.000 mm	Feedrate ⑥	100.000 mm/min
Center point:X ②	6.000 mm	Probe plane ⑦	G17 
Center point:Y ③	0.000 mm	Spindle speed ⑧	100.000 rpm
Diameter ④	12.000 mm	Dir. of rotation ⑨	M4 
Thickness ⑤	6.000 mm	Safety distance ⑩	2.000 mm

- ① Absolute position of the probe in Z direction
- ②/③ The measured probe center (the machine coordinate)
- ④ The diameter of the probe (the measured value will be shown after calibrating)
- ⑤ The thickness of the probe
- ⑥ The measurement feedrate in "JOG" mode (this parameter is used to create the measuring program)
- ⑦ G17, G18 and G19 for selection
- ⑧ Spindle speed in r.p.m.
- ⑨ Direction of rotation of the spindle: M3, M4, or M5
- ⑩ Safety distance between the measuring surface of the probe and the tool

Calibrating the probe



1. Select the machining operating area.



2. Switch to "JOG" mode.



 
3. Open the lower-level menu for tool measurement.



4. Open the auto tool measurement window.



5. Press this vertical softkey to enter the probe calibration screen.



6. You can use this vertical softkey to choose whether to calibrate the tool length and diameter, or to calibrate the tool length only.
7. Move the tool until it presses down on the measuring surface of the probe. Then the calibration process is triggered automatically.

Note:

When calibrating the probe, make sure the tool is approximately aligned with the center of the measuring surface of the probe.



During the automatic measurement, a dial gauge symbol () displays, which indicates that the measuring process is active.

10.3 Measuring the tool with a probe (auto)

Preconditions

- The machine manufacturer must parameterize special measuring functions for tool probe measuring. For more information, see the SINUMERIK 808D/SINUMERIK 808D ADVANCED Function Manual.
- You must first enter the cutting edge position and calibrate the probe (Page 53) before the actual measurement.

Operating sequence



1. Select the machining operating area.




2. Switch to "JOG" mode.




3. Open the lower-level menu for tool measurement.



4. Open the auto tool measurement window. The tool length in the Z direction is measured by default.

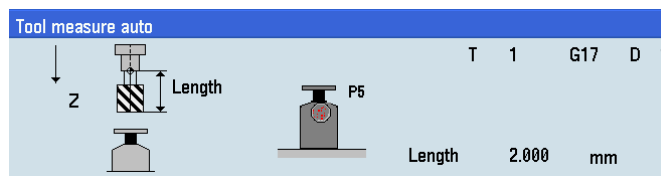

5. Move the tool until it presses down on the edge of the probe. Then the tool length is calculated and entered in the tool list. Note that if several axes move simultaneously, no offset data can be calculated.
6. Press this vertical softkey to measure the tool diameter in the X and Y planes.

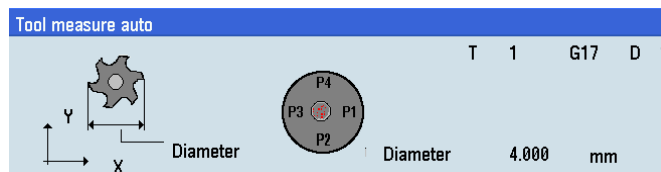


7. Move the tool until it presses down on the edge of the probe. The tool diameter or radius is calculated and entered in the tool list. Note that if several axes move simultaneously, no offset data can be calculated.

10.4 Setting up the workpiece

10.4.1 Measuring the workpiece

Overview

You must select the relevant offset panel (for example, G54) and the axis you want to determine for the offset first.

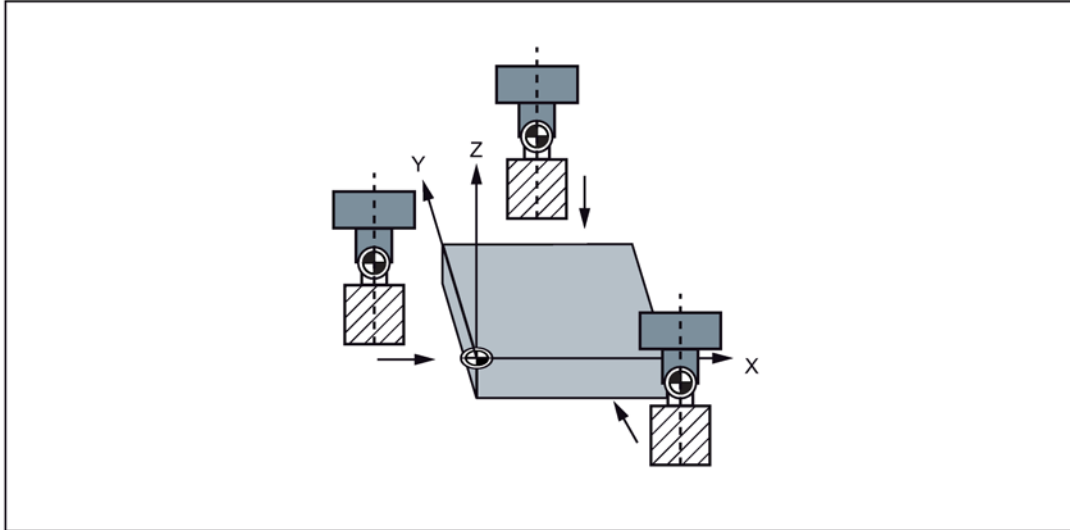

Before measuring, you can start the spindle by following the steps in Section "Activating the tool and the spindle (Page 23)".

Operating sequence

Workpiece edge measurement



1. Select the machining operating area.



2. Switch to "JOG" mode.



3. Open the window for workpiece measurement.



4. Press this vertical softkey to open the window for measurement at the workpiece edge.



 
5. Press this softkey to measure in the X direction.



6. Traverse the tool, which has been measured previously, to approach the workpiece in the X direction.



7. Switch to handwheel control mode.



8. Select a suitable override feedrate, and then use the handwheel to move the tool to scratch the required workpiece edge.




9. Select the offset plane to save in and the measuring direction (for example, "G54" and "-").
10. Enter the distance (for example, "0") in the following window. Press this key or move the cursor to confirm your input.

Workpiece measurement, edge		Distance to work zero	
	Basic offset	0.000 mm	Save in G54
	Radius	0.000 mm	Measuring dir. -
	Offset	X ₀ 0.000 mm	Distance 0.000 mm



11. Press this vertical softkey. The workpiece offset of the X axis is calculated automatically and displayed in the offset field.
12. Repeat the above operations to measure and set the workpiece offsets in axes Y and Z respectively.

 Rectangular workpiece measurement




1. Select the machining operating area.
2. Switch to "JOG" mode.
3. Open the lower-level menu for workpiece measurement.
4. Open the window for measurement of a rectangular workpiece.

Workp. meas., center of rect.		Work offset	
	Work offset	G54	
	Offset	X ₀ 0.000 mm	
		Y ₀ 0.000 mm	



 5. Traverse the tool, which has been measured previously, in the direction of the orange arrow P1 shown in the measuring window, in order to scratch the workpiece edge with the tool tip.
6. Press this softkey to save the tool position P1 in the coordinate system. To cancel the record, press the softkey again.
7. Repeat Steps 5 and 6 to save the other three positions: P2, P3 and P4.
8. Save the workpiece offsets in axes X and Y after measuring all four positions.




Circular workpiece measurement




1. Select the machining operating area.
2. Switch to "JOG" mode.



3. Open the lower-level menu for workpiece measurement.
4. Open the window for measurement of a circular workpiece.
5. Traverse the tool, which has been measured previously, in the direction of the orange arrow P1 shown in the measuring window, in order to scratch the workpiece edge with the tool tip.

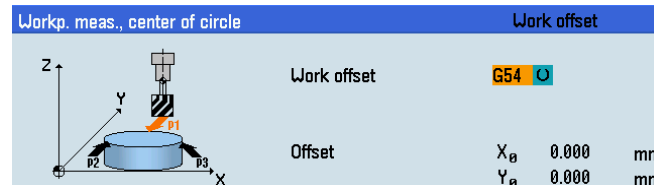

 6. Press the softkey to save the tool position P1 in the coordinate system. To cancel the record, press the softkey again.



7. Repeat Steps 5 and 6 to save the other two positions: P2 and P3.
8. Save the workpiece offsets in axes X and Y after measuring all three positions.

10.4.2 Entering/modifying workpiece offsets

Operating sequence

In case of any problems found when testing the tool offset result, you can proceed through the following steps to make tiny adjustment of values:



1. Select the offset operating area.



2. Open the list of workpiece offsets. The list contains the values of the basic offset of the programmed workpiece offset and the active scaling factors, the mirror status display and the total of all active workpiece offsets.



3. Use the cursor keys to position the cursor bar in the input fields to be modified and enter the values.

	X	mm	Y	mm	Z	mm	X	↶	Y	↶	Z	↶
G500	0.000000		0.000000		0.000000		0.000		0.000		0.000	
G54	0.000000		0.000000		0.000000		0.000		0.000		0.000	
G55	0.000000		0.000000		0.000000		0.000		0.000		0.000	
G56	0.000000		0.000000		0.000000		0.000		0.000		0.000	
G57	0.000000		0.000000		0.000000		0.000		0.000		0.000	
G58	0.000000		0.000000		0.000000		0.000		0.000		0.000	
G59	0.000000		0.000000		0.000000		0.000		0.000		0.000	
Program	0.000000		0.000000		0.000000		0.000		0.000		0.000	
Scale	1.000000		1.000000		1.000000							
Mirror	0		0		0							
Total	0.000000		0.000000		0.000000		0.000		0.000		0.000	

Note that the displayed work offset quantity may be different depending on the setting of machine data MM_NUM_USER_FRAMES 28080.

For more information about settable workpiece offset, see Section "Workpiece coordinate system - settable work offset: G54 to G59, G507 to G532, G500, G53, G153 (Page 87)".



4. Confirm your entries. The changes to the workpiece offsets are activated immediately.

10.5 Entering/modifying the setting data

Entering/modifying the setting data

Operating sequence



1. Select the offset operating area.



2. Open the setting data window.



3. Open the window for setting the general data.



4. Position the cursor bar in the input fields to be modified and enter the values (see table below for the parameter description).



5. Use this key or move the cursor to confirm your entries.

Parameters in the setting data window

Setting data		
Spindle data		
Minimum:	①	0.000 rpm
Maximum:	②	1000.000 rpm
Start angle		
Start angle for thread:	③	0.000 °

- ①/② A limitation of the spindle speed in the maximum (G26)/minimum (G25) fields can only be performed within the limit values defined in the machine data.
- ③ For thread cutting, a start position for the spindle is displayed as the start angle. A multiple thread can be cut by changing the angle when the thread cutting operation is repeated.

Write protection

MD212 can set the write protection for parameters in the setting data window. You can modify the parameters only when your access level is higher than or equal to the setting value of MD212.

Setting the time counter

Operating sequence



1. Select the offset operating area.



2. Open the setting data window.

Time counter



3. Open the time counter window.
4. Position the cursor bar in the input fields to be modified and enter the values (see table below for the parameter description).
5. Use this key or move the cursor to confirm your entries.

Parameters in the window for timers and workpiece counters

Times / Counter		
Parts in total	①	0
Parts required	②	0
Part count	③	0
Run time	④	0000 H 00 M 00 s
Cycle time	⑤	0000 H 00 M 00 s
Cutting time	⑥	0000 H 00 M 00 s
Setup time	⑦	0008 H 32 M
Power on time	⑧	0002 H 29 M

- ① The total number of workpieces produced (total actual)
- ② The number of workpieces required (workpiece setpoint)
- ③ The number of all workpieces produced since the starting time
- ④ The total run time of NC programs in "AUTO" mode and the run time of all programs between NC start and end of program/RESET. The timer is set to zero with each power-up of the control system.
- ⑤ The run time of the selected NC program in seconds
The default value is 0 each time a new NC program starts up. You can set MD27860 to ensure that this value will be deleted even if there is a jump to the beginning of the program with GOTOs or in the event of ASUPs (used for tool change in "JOG" and "MM+" modes) and PROG_EVENTS starting.
- ⑥ Processing time in seconds
- ⑦ The time since the last system power-up with default values ("cold restart") in minutes
- ⑧ The time since the last normal system power-up ("warm restart") in minutes

Write protection

MD9020 can set the write protection for the parameters in the window for workpiece counters. You can modify the parameters only when your access level is higher than or equal to the setting value of MD9020.

Note

- Parameters ④ to ⑧ are read-only.
- The timer is automatically reset to zero in case of a control power-up with default values.

Setting the working area limitation

Operating sequence



1. Select the offset operating area.



2. Open the setting data window.



3. Open the working area limitation window.



4. Position the cursor on the input field to be modified and enter the required value.



5. Position the cursor on the checkbox for value activation located after the input field.



6. Press this key to activate or deactivate your input in Step 4.


Parameters in the window for working area limitation

Working area limitation					
Axis	Minimum	Active	Maximum	Active	Unit
① MX1	② -100000000.000	③ ☐ U	④ 100000000.000	⑤ ☐ U	⑥ mm
MY1	-100000000.000	☐ U	100000000.000	☐ U	mm
MZ1	-100000000.000	☐ U	100000000.000	☐ U	mm
MSP1	-100000000.000	☐ U	100000000.000	☐ U	°

- ① Displays the axes that exist in the machine coordinate system (MCS), workpiece coordinate system (WCS), or relative coordinate system (REL)
- ②/④ The minimum/maximum traversing distance specified for the axes
- ③/⑤ Activates or deactivates the entered minimum/maximum value
- ⑥ Unit for the traversing distance

Modifying miscellaneous setting data

 Operating sequence



1. Select the system data operating area.



2. Open the window for machine data.



3. Open the window for the expert list.

General
MD

Channel
MD

Axis
MD

Search

Continue
search



4. Select a group of setting data you desire to modify.

5. Press these softkeys to search for your desired setting data with the data number/name.

Alternatively, you can position the cursor on the input field to be modified and enter the desired value.

To switch to the desired axis when modifying the axis-specific setting data, press the corresponding softkey:

Axis +

Axis -



6. Press this key or move the cursor to confirm your entries.

10.6 Setting R parameters

Functionality

The "R variables" start screen lists the R parameters that exist within the control system. You can set or query these global parameters in any program as required.

Operating sequence



1. Select the offset operating area.

R
var.

2. Open the list of R parameters.



3. Press the cursor keys to navigate in the list, and enter the values in the input fields to be modified.

Search

Note:

You can search for your desired R variable with this softkey. By default, the function searches the R number.

Show R
name

You can press this softkey to activate the option of searching by R name. Define the R name as desired, if necessary.



4. Press this key or move the cursor to confirm your entries.

For more information about R parameters, see Section "Arithmetic parameter R (Page 125)".

10.7 Setting user data

Functionality

The "User data" start screen lists the user data that exist within the control system. You can set or query these global parameters in any program as required.

Operating sequence



1. Select the offset operating area.



2. Open the list of user data.



3. Use the cursor keys to navigate in the list, and enter the values in the input fields to be modified.



Note:

You can search for your desired user data with this softkey.



You can press this softkey to continue searching your desired user data.

 


4. Use this key or move the cursor to confirm your entries.

10.8 Setting the date and time


By default, the system date and time remain the factory settings. You can proceed through the following operating sequence to change the date and time as required.

Operating sequence



1. Select the system data operating area.

 2. Open the date and time setting window through the following softkey operations:



3. Enter the date and time in the specified format.

Current	2015/05/19	11:02:16
Format	YYYY/MM/DD	HH:MM:SS
New	2015 / 05 / 19	11 : 05 : 35



4. Press this softkey to confirm your settings.

Note

 
The settings of date and time are effective for 30 days if the control system is powered off for a long time at 25 °C surrounding air temperature.

10.9 Configuring the operating area after startup


The machining operating area is displayed by default after the startup of the control system. Alternatively, you can select another operating area which you desire to enter after the system starts up.

Operating sequence


1. Select the system data operating area.



 2. Open the window for setting the startup operating area through the following softkey operations:



3. Use the cursor keys to select the desired operating area in the following window:

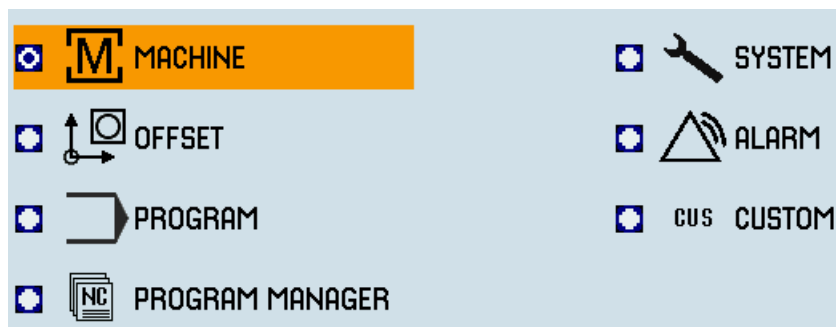

Change
start ar.

4. Press this softkey to confirm your setting, and the configured operating system will display after the control system restarts.

10.10 Executing/transferring a part program from external

Note

You're recommended to use the Notepad editor with ANSI character encoding to create/edit part program files on the computer. Program files in other encoding formats (for example, Unicode) may cause unexpected errors after being imported into the control system.

10.10.1 Executing/transferring through the USB interface

The USB interface on the front of the PPU can be used to connect to a USB device, for example:

- An external USB memory stick, to transfer data between the USB stick and the control system
- An external USB keyboard which functions as an external NC keyboard

10.10.1.1 Executing from external (through USB interface)

Prerequisite: A USB memory stick (which includes the part program to be executed) is inserted in the front USB interface of the PPU.

Proceed as follows to execute a part program from external through the USB interface:

1. Select the program management operating area.





2. Press this softkey to enter the USB directory, and select the program file you desire to execute.
3. To directly execute the program, press this softkey. The system automatically switches to "AUTO" mode in the machining operating area. The program is transferred to the buffer memory on the control system and then displayed in the following window:

Block display	Current program :EXAMPLE.MPF
N5 G17 G90 G54 G71	↑
N10 T1 D1	↑
N15 S5000 M3 G95 F0.3	↑
N20 G00 X100 Z2	↑
N25 G01 Z-5	↑
N30 X105	↑
N35 G00 SUPA X300 Z50 D0	↑



You can also press this key on the PPU to view the program blocks first before executing. Then press the following softkey to execute:



4. If desired, you can use this softkey to specify how you want the program to be executed. For more information of the program control, refer to Section "Program control functions (Page 52)" .



5. Press this key to execute the program. The program is reloaded continuously.



Either at the end of the program or after pressing this key, the program is automatically removed from the control system.

Note

The USB directory is automatically identified if a USB stick is inserted.

Do not remove the USB stick during the external program execution through the USB interface.

10.10.1.2 Transferring from external (through USB interface)

Prerequisite: A USB memory stick (which includes the part program to be transferred) is inserted in the front USB interface of the PPU.

 
Proceed as follows to transfer a part program from external through the USB interface:



1. Select the program management operating area.



2. Press this softkey to enter the USB directory.



3. Select the program file you desire to transfer.
4. Press this softkey to copy the file to the buffer memory on the control system.



5. Enter the program directory.



6. Press this softkey to paste the copied file into the program directory.

10.10.2 Executing/transferring through the Ethernet connection

10.10.2.1 Configuring the network drive

A connected network drive allows you to access a shared directory on your computer from the control system. The network drive functions based on the Ethernet connection between the control system and a computer. The following Ethernet connections are possible:

- Direct connection: connecting the control system directly to a computer
- Network connection: integrating the control system into an existing Ethernet network

Establishing a direct connection

Proceed as follows to establish a direct connection:



1. Connect the control system with the computer using an Ethernet cable.
2. Select the system data operating area.
3. Press the extension key.

4. Enter the main screen of the service control options through the following softkey operations:



5. Press this softkey to set up a direct connection between the control system and the computer.

The following dialog box pops up on the screen:

Link set up	
IP address:	169.254.11.22
Subnet mask:	255.255.0.0

 
Establishing a network connection

Proceed as follows to establish a network connection:



1. Connect the control system with the local network using an Ethernet cable.
2. Select the system data operating area on the PPU.
3. Press the extension key.

4. Enter the main screen of the service control options through the following softkey operations:



Service
network

Direct
connect.

5. Press this softkey to enter the window for the network configuration.

Note: make sure this vertical softkey is not selected.

6. Configure the network as required in the following window:

Network configuration	
Local data	
Protocol:	TCP / IP
DHCP:	Yes 
Cmpt. name:	NONAME_NCU
IP address:	176 16 202 200
Subnet mask:	255 255 255 0
Gateway:	

You can configure the DHCP with this key.

Note: if you select "No" for DHCP, you must enter the IP address (which must belong to the same network as that of your computer) and subnet mask manually.



Save

7. Press this softkey to save the configuration. If you select "Yes" for DHCP, you also need to restart the control system to activate the network configuration.

Creating and connecting a network drive

Proceed as follows to create and connect a network drive:



Netwo.
drive

Configure
net.drive



1. Share a directory on your local disk on your computer.
2. Select the program management operating area.
3. Press this softkey to go to the network drive directory.
4. Press this softkey to go to the window for configuring the network drives.
5. Press this key to select a drive identifier: N1, N2, or N3.



6. Move the cursor to the following input fields:

User:	
	Windows login
Password:	
	Windows password (Case-sensitive. Toggle with ALT+L)
Path:	
	Example: //Server/Share name

- ①: Enter the user name of your Windows account
- ②: Enter the logon password (case sensitive) of your Windows account
- ③: Enter the IP address of the server and the share name of the shared directory on your computer. Example: //140.231.196.90/808D



7. Press this softkey to confirm and the configured network drive appears on the screen as follows. The drive icon is yellow if the network drive is connected successfully; otherwise, the icon is gray.

 N1://140.231.196.90/808D



You can delete a selected network drive using this softkey.

Note

After you properly configure all the settings for the direct connection between the control system and the network drive, if the network drive connection is still invalid, contact your Windows system administrator for possible problems with your operating system configuration.

10.10.2.2 Executing from external (through Ethernet connection)

Prerequisites:

- An Ethernet connection has been established between the control system and the computer.
- A network drive (which includes the part program to be executed) has been created and connected.

Proceed as follows to execute a part program from external through the Ethernet connection:



1. Select the program management operating area.



2. Press this softkey to view the network drive(s) created.



3. Select the desired network drive (which includes the part program to be executed) and press this key to open it.
4. Select the program file you desire to execute.

Execute

5. Press this softkey and the system automatically switches to "AUTO" mode in the machining operating area. The program is transferred to the buffer memory on the control system and then displayed in the following window:

```

Block display      Current program :EXAMPLE.MPF
N5 G17 G90 G54 G71 1
N10 T1 D1 1
N15 S5000 M3 G95 F0.3 1
N20 G00 X100 Z2 1
N25 G01 Z-5 1
N30 X105 1
N35 G00 SUPA X300 Z50 D0 1
  
```

NC Prog. cntrl

6. If desired, you can use this softkey to specify how you want the program to be executed. For more information of the program control, refer to Section "Program control functions (Page 52)".

CYCLE START

7. Press this key to execute the program. The program is reloaded continuously.

RESET

Either at the end of the program or after pressing this key, the program is automatically removed from the control system.

10.10.2.3 Transferring from external (through Ethernet connection)

Prerequisites:

- An Ethernet connection has been established between the control system and the computer.
- A network drive (which includes the part program to be transferred) has been created and connected.

Proceed as follows to transfer a part program from external through the Ethernet connection:

PROGRAM MANAGER

1. Select the program management operating area.

Netwo. drive

2. Press this softkey to view the network drive(s) created.

INPUT

3. Select the desired network drive (which includes the part program to be transferred) and press this key to open it.

Copy

4. Select the program file you desire to transfer.
5. Press this softkey to copy the file to the buffer memory on the control system.

NC NC

6. Enter the program directory.

Paste

7. Press this softkey to paste the copied file into the program directory.


10.10.3 Configuring the firewall

Configuring the firewall

Secure access and communication is achieved through the security function of the integrated firewall. You can open the window for firewall configuration through the following operations:



Configurable ports are listed in the following window:

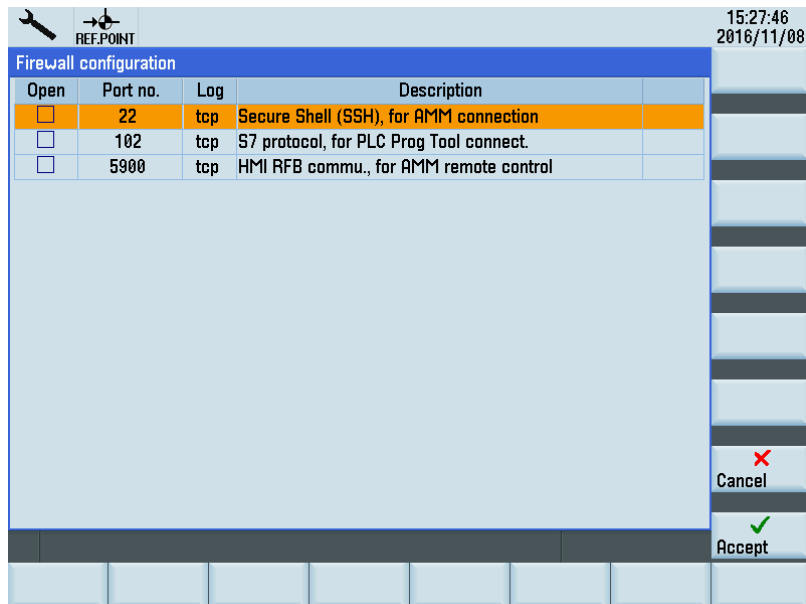

The ports are disabled by default and can be enabled when necessary. To change the port status, select the relevant port using the cursor keys and press either of the following keys to enable or disable the port:



! WARNING

Network security risks due to improper firewall configuration

Improper firewall configuration may cause network security risks, for example, data leakage, virus invasion, and hacker attack. This may lead to incorrect parameterization or machine malfunction, which in turn can result in death, severe injuries and/or property damage.

- Do not use the control system inside a network infrastructure without an additional security product.
- Make sure that you disable the unnecessary ports in the firewall configuration.

Note

After you disable a communication port, the existing connection established earlier via this port will not be disabled until you manually disconnect it or the control system restarts/powers off. Therefore, it is recommended that you disconnect the established connections or restart the control system after disabling the ports.

 
10.11 Extending/deactivating the CNC lock function

To extend/deactivate the CNC lock function, you must import the corresponding activation/deactivation file (.clc format) provided by the machine manufacturer into the control system. The file can be imported either directly via an Ethernet connection (network drive) or alternatively via a storage medium (for example, USB memory stick). The control system must be in the reset state for the import.

Importing the activation/deactivation file

Proceed through the following steps to import the file:

- To import the file via USB, store the file in a USB memory stick and insert the USB memory stick into the USB interface at the front of the PPU.
 - To import the file via Ethernet, store the file in a shared folder (network drive) on your computer and connect the network drive via Ethernet connection.
- Select the system data operating area.



- Press this key to view the extended softkeys.
- Open the license key dialog box through the following softkey operations:




- Press this softkey to open the file opening dialog box.
- Select the target directory (USB or network drive) and press this key to open it.
- Locate the desired activation/deactivation file and press this softkey to import.




After the file is imported successfully, you can check the CNC lock status on the HMI screen, for example:

- CNC lock function extended (with a new lock date):

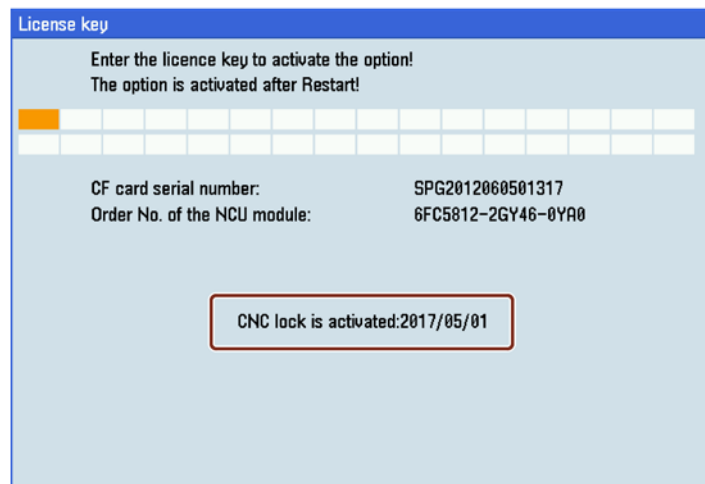

- CNC lock function deactivated (with no lock date):

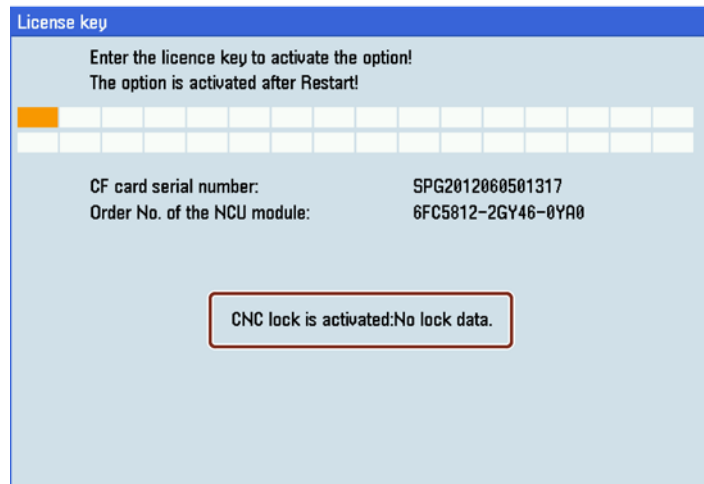

Note

If an error occurs when importing the activation file, an error-specific alarm will be issued. The state of the CNC lock function remains unchanged.

Note

We recommend that you create a complete commissioning archive over all control system components after deactivating the CNC lock function. If necessary, this commissioning archive can be used to recommission the control system without re-deactivating the CNC lock function.

Faulty settings of date

If a date earlier than the actual date is set for activated CNC lock function, alarm 8065 is issued after NC restart and then NC start is disabled. In this case, you must correct the date and perform an NC restart again to clear the alarm.

If during the correcting, a future date is set inadvertently, alarm 8066 is issued. Provided no NC restart has been performed, the date can still be corrected. After NC restart, a date set in the future is considered as being an actual date and can no longer be reset.

NOTICE

Shorter service life

After NC restart, a future date set earlier than the lock date reduces the service life until the lock date. If a date equal to or later than the lock date is set, alarm 8064 is issued and the NC start disabled.

Make sure you set the date correctly prior to NC restart.

10.12 Data backup

10.12.1 Internal data backup

You can save the NC and PLC data of the volatile memory to the permanent memory of the control system.

Note

 
After changing important data, it is recommended to carry out an internal data backup immediately.

Backing up data internally

Prerequisite:

- A valid system password has been set on the control system.
- There is no program currently being executed.

Proceed through the following steps to save data:



1. Select the system data operating area.



2. Press this softkey to open the window for data saving.



3. Press this softkey to start saving. Do not carry out any operator actions while the data back-up is running.

Loading internally backed up data

There are two methods to load the saved data.

Method 1:



1. Press this key while the control system is booting.



2. Use the cursor keys to select "Reload saved user data" in the setup menu.
3. Press this key to confirm.

Method 2:



1. Select the system data operating area.



 

2. Press this softkey.



3. Enter the NC startup screen.




4. Use the cursor keys to select the third startup mode as follows:

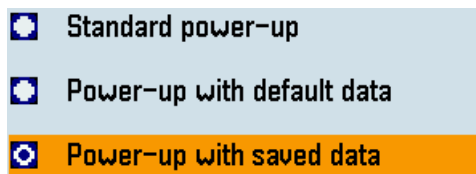

5. Press this softkey to confirm. The control system restarts with the saved data.

Note

 The following message is displayed on the screen after the control system starts up successfully with the saved data:




You must enter the password again after you have powered up the control system with the saved data.

10.12.2 External data backup

10.12.2.1 External data backup in a data archive

You can perform a complete data backup of the control system by creating a startup archive.

 Backing up data externally in a data archive



1. Select the system data operating area.

2. Press this softkey to open the window for creating or restoring a startup archive.


There are three options for creating a data archive. Note that options ① and ③ are visible only with the manufacturer password.



- ① Creates a data archive for series machine commissioning
- ② Creates a data archive for a complete system backup
- ③ Backs up the complete system data on the system CompactFlash Card (CF card)



3. Select option ② and press this softkey to confirm, and the dialog box for saving the archive file opens.

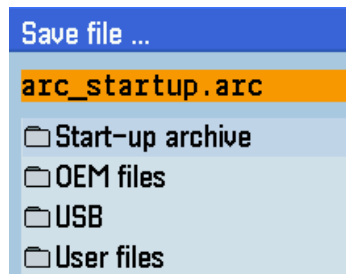

The name of the data archive is "arc_startup.arc" by default. You can also use your favorite name. The file name extension ".arc" must be entered.



4. Select your desired directory and press this key to open it.



Note that you can press this key on the PPU to toggle between the file name input field and the directory selection area.



5. Press this softkey to confirm and the archive information dialog box opens.



 
6. Specify the properties of the archive and press this softkey. The control system starts creation of the startup archive.

Note

Do not remove the USB stick in the process of data backup if you choose USB as the target directory.

Pressing <CTRL + S> when you are in any operating area creates a startup archive on the connected USB stick. In addition, it automatically saves the action log to the USB stick.

Restoring a startup archive



1. Select the system data operating area.



2. Press this softkey to open the startup archive window.



3. Select the following option and press this softkey to restore the startup archive:

Restore start-up archive



4. Select the backup path to locate the archive file and press this softkey to confirm.



5. Press this softkey to confirm the archive information.



6. Press this softkey to continue and start restoring the startup archive. The control system restarts to complete restoring the archive.

10.12.2.2 External data backup of separate files

In the program management operating area, program files or directories can be copied into another directory or onto a different drive by means of copying and pasting operations.

Operating sequence



1. Select the program management operating area.



2. Enter the program directory.



3. Select the program file or directory to be backed up.
4. Press this softkey to copy the file to the clipboard.



5. Select a desired directory or drive as the data target.
Backs up the files in the folder for storing the user cycles on the control system. This folder is visible with the manufacturer password.



Backs up the files onto a USB stick.



Backs up the files onto a computer. This requires a connected network drive on the control system. For more information, see section "Configuring the network drive (Page 66)".



Backs up the files in the folder for storing the manufacturer files on the control system. This folder is visible with the manufacturer password.



Backs up the files in the folder for storing end user files on the control system.

6. Press this softkey to paste the copied data into the current directory.


Paste

For more information about data backup, refer to the SINUMERIK 808D ADVANCED Diagnostics Manual.

10.13 Pocket calculator



You can activate the calculator function by pressing this key on the PPU when you position the cursor on the desired input field to calculate the cycle relevant parameters, contour parameters, tool parameters, workpiece offsets, R parameters, etc.

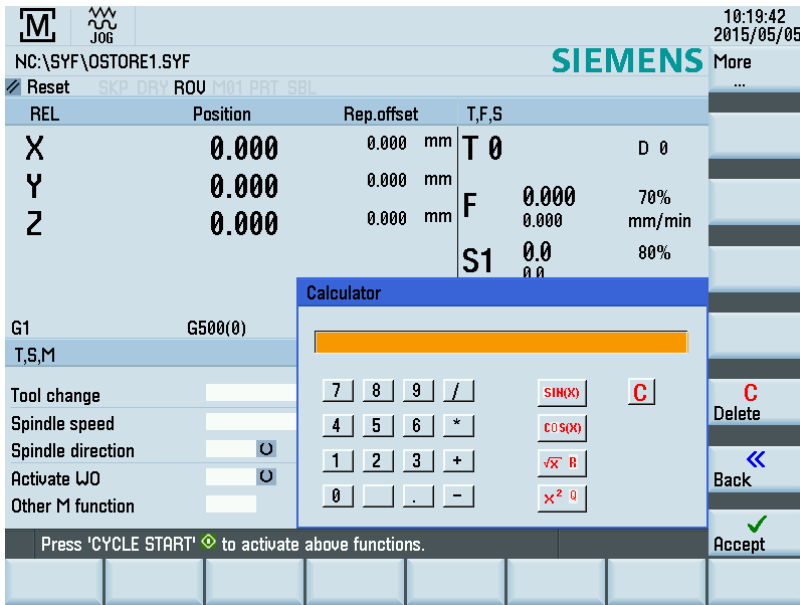

For calculating, the four basic arithmetic operations are available, as well as the functions "sine", "cosine", "squaring" and "square root". A bracket function is provided to calculate nested terms. The bracket depth is unlimited.

If the input field is already occupied by a value, the function will accept this value into the input line of the pocket calculator.

Delete

Pressing this softkey empties the input line of the calculator.



After inputting a desired arithmetic statement in the input line of the calculator, pressing this key starts the calculation. The result is displayed in the pocket calculator.

Accept

Selecting this softkey enters the result in the input field at the current cursor position and closes the pocket calculator automatically.

Back

Pressing this softkey aborts the calculation result (if any) and exits the pocket calculator.

Characters that may be entered

- + , - , * , / Basic arithmetic operations
- S Sine function
- The X value (in degrees) in front of the input cursor is replaced by the sin(X) value.

- O Cosine function
The X value (in degrees) in front of the input cursor is replaced by the cos(X) value.
- Q Square function
The X value in front of the input cursor is replaced by the X² value.
- R Square root function
The X value in front of the input cursor is replaced by the $\sqrt{X}$ value.
- () Bracket function (X+Y)*Z

Calculation examples

Task	Input -> Result
100 + (67*3)	100+67*3 -> 301
sin(45_)	45 S -> 0.707107
cos(45_)	45 O -> 0.707107
4 ²	4 Q -> 16
$\sqrt{4}$	4 R -> 2
(34+3*2)*10	(34+3*2)*10 -> 400

To calculate auxiliary points on a contour, the pocket calculator offers the following functions:

- Calculating the tangential transition between a circle sector and a straight line
- Moving a point in the plane
- Converting polar coordinates to Cartesian coordinates
- Adding the second end point of a straight line/straight line contour section given from an angular relation

11 Programming principles

11.1 Fundamentals of programming

11.1.1 Program names

Each program must have a program name. The program name must follow the conventions below:

- Use a maximum of 24 letters or 12 Chinese characters for a program name (the character length of the file extension excluded)
- Separate the file extension only with a decimal point
- Enter the file extension ".SPF" if the current default program type is MPF (main program) and you desire to create a subprogram
- Enter the file extension ".MPF" if the current default program type is SPF (subprogram) and you desire to create a main program
- Do not enter the file extension if you desire to take the current default program type
- Avoid using special characters for program names.

Example

New G code program

Type: **Main program MPF**

Name: **PROGRAM1**

11.1.2 Program structure

Structure and content

The NC program consists of a sequence of **blocks** (see the table below). Each block represents a machining step. Instructions are written in the blocks in the form of **words**. The last block in the execution sequence contains a special word for the end of the program, for example, **M2**.

The following table shows you an example of the NC program structure.

Block	Word	Word	Word	...	; Comment
Block	N10	G0	X20	...	; First block
Block	N20	G2	Z37	...	; Second block
Block	N30	G91	...	...	; ...
Block	N40	...	...	...	
Block	N50	M2			; End of program

11.2 Programming instructions

11.2.1 Programming dimensions

In this section you will find descriptions of the commands, with which you can directly program dimensions taken from a drawing. This has the advantage that no extensive calculations have to be made for NC programming.

Note

The commands described in this section stand in most cases at the start of an NC program. The way, in which these functions are combined, is not intended to be a patent remedy. For example, the choice of working plane may be made at another point in the NC program. The real purpose of this and the following sections is to illustrate the conventional structure of an NC program.

Overview of typical dimensions

The basis of most NC programs is a drawing with concrete dimensions.

When implementing in a NC program, it is helpful to take over exactly the dimensions of a workpiece drawing into the machining program. These can be:

- Absolute dimension, G90 modally effective applies for all axes in the block, up to revocation by G91 in a following block.
- Absolute dimension, X=AC(value) only this value applies only for the stated axis and is not influenced by G90/G91. This is possible for all axes and also for SPOS, SPOSA spindle positionings, and interpolation parameters I, J, K.
- Absolute dimension, X=DC(value) directly approaching the position by the shortest route, only this value applies only for the stated rotary axis and is not influenced by G90/G91. This is also possible for SPOS, SPOSA spindle positionings.
- Absolute dimension, X=ACP(value) approaching the position in positive direction, only this value is set only for the rotary axis, the range of which is set to 0... < 360 degrees in the machine data.
- Absolute dimension, X=ACN(value) approaching the position in negative direction, only this value is set only for the rotary axis, the range of which is set to 0... < 360 degrees in the machine data.
- Incremental dimension, G91 modally effective applies for all axes in the block, until it is revoked by G90 in a following block.
- Incremental dimension, X=IC(value) only this value applies exclusively for the stated axis and is not influenced by G90/G91. This is possible for all axes and also for SPOS, SPOSA spindle positionings, and interpolation parameters I, J, K.
- Inch dimension, G70 applies for all linear axes in the block, until revoked by G71 in a following block.
- Metric dimension, G71 applies for all linear axes in the block, until revoked by G70 in a following block.
- Inch dimension as G70, however, G700 applies also for feedrate and length-related setting data.
- Metric dimension as G71, however, G710 applies also for feedrate and length-related setting data.
- Diameter programming, DIAMON on
- Diameter programming, DIAMOF off

Diameter programming, DIAM90 for traversing blocks with G90. Radius programming for traversing blocks with G91.

11.2.2 Plane selection: G17 to G19

Functionality

To assign, for example, **tool radius and tool length compensations**, a plane with two axes is selected from the three axes X, Y and Z. In this plane, you can activate a tool radius compensation.

For drill and cutter, the length compensation (length1) is assigned to the axis standing vertically on the selected plane. It is also possible to use a 3-dimensional length compensation for special cases.


Another influence of plane selection is described with the appropriate functions (e.g. Section "Support for the contour definition programming").

The individual planes are also used to define the **direction of rotation of the circle for the circular interpolation** CW or CCW. In the plane in which the circle is traversed, the abscissa and the ordinate are designed and thus also the direction of rotation of the circle. Circles can also be traversed in a plane other than that of the currently active G17 to G19 plane (For more information, see Section "Circular interpolation (Page 92)").

The following plane and axis assignments are possible:

G function	Plane (abscissa/ordinate)	Vertical axis on plane (length compensation axis when drilling/milling)
G17	X/Y	Z
G18	Z/X	Y
G19	Y/Z	X

See the following illustration for planes and axes when drilling/milling:

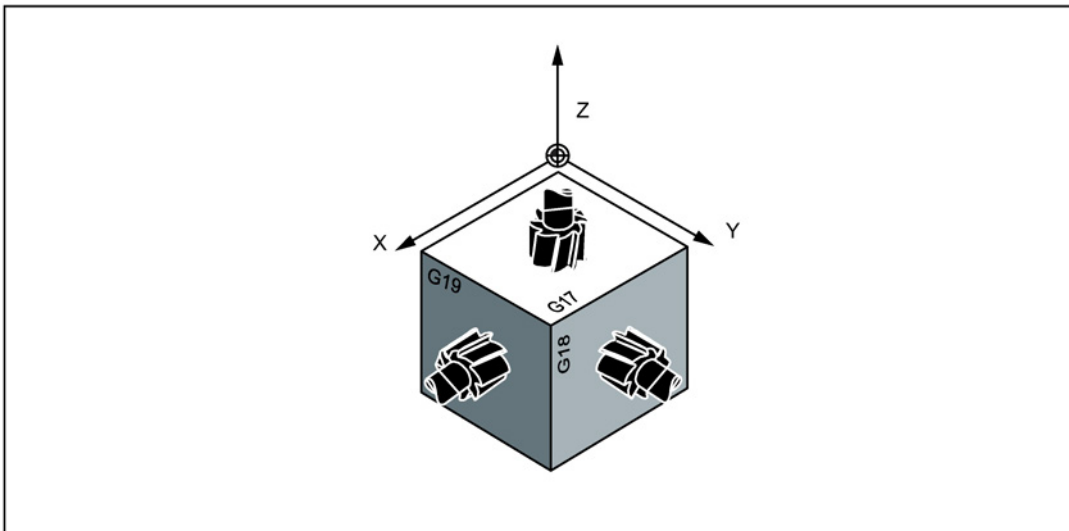

Programming example

```
N10 G17 T... D... M... ; X/Y plane selected
N20 ... X... Y... Z... ; tool length compensation (length1) in Z axis
```

11.2.3 Absolute/incremental dimensioning: G90, G91, AC, IC

Functionality

With the instructions G90/G91, the written positional data X, Y, Z... are evaluated as a coordinate point (G90) or as an axis position to traverse to (G91). G90/G91 applies to all axes.

Irrespective of G90/G91, certain positional data can be specified for certain blocks in absolute/incremental dimensions using AC/IC.

These instructions do **not determine the path** by which the end points are reached; this is provided by a G group (G0, G1, G2 and G3.... For more information, see Sections "Linear interpolation (Page 90)" and "Circular interpolation (Page 92)").

Programming


G90 ; Absolute dimension data

G91 ; Incremental dimension data

X=AC(...) ; Absolute dimensioning for a certain axis (here: X axis), non-modal

X=IC(...) ; Incremental dimensioning for a certain axis (here: X axis), non-modal

See the following illustration for different dimensioning types in the drawing:

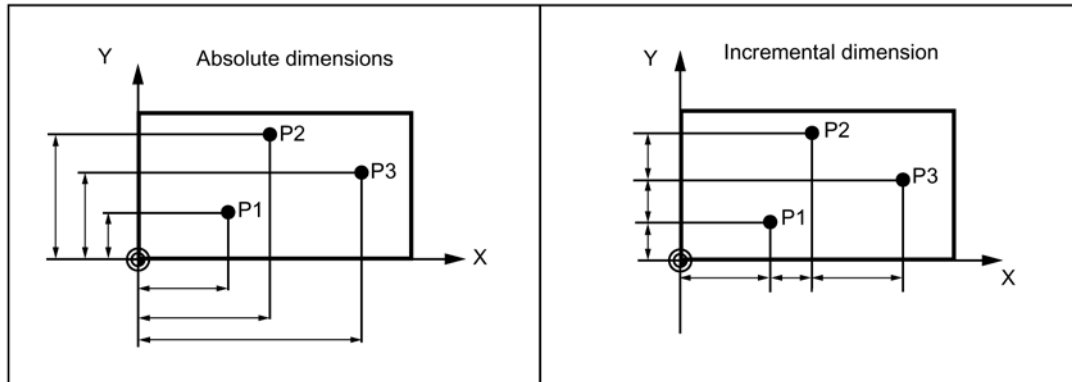

Absolute dimensioning G90

With absolute dimensioning, the dimensioning data refers to the **zero of the coordinate system currently active** (workpiece or current workpiece coordinate system or machine coordinate system). This is dependent on which offsets are currently active: programmable, settable, or no offsets.

Upon program start, G90 is active for **all axes** and remains active until it is deselected in a subsequent block by G91 (incremental dimensioning data) (modally active).

Incremental dimensioning G91

With incremental dimensioning, the numerical value of the path information corresponds to the **axis path to be traversed**. The leading sign indicates the **traversing direction**.

G91 applies to all axes and can be deselected in a subsequent block via G90 (absolute dimensioning).

Specification with =AC(...), =IC(...)

After the end point coordinate, write an equality sign. The value must be specified in round brackets.

Absolute dimensions are also possible for circle center points using =AC(...). Otherwise, the reference point for the circle center is the circle starting point.

Programming example

```
N10 G90 X20 Z90 ; Absolute dimensions
N20 X75 Z=IC(-32) ; X-dimensions remain absolute, incremental Z dimension
N180 G91 X40 Z20 ; Switch-over to incremental dimensioning
N190 X-12 Z=AC(17) ; X-remains incremental dimensioning, Z-absolute
```

11.2.4 Dimensions in metric units and inches: G71, G70, G710, G700

Functionality

If workpiece dimensions that deviate from the base system settings of the control system are present (inch or mm), the dimensions can be entered directly in the program. The required conversion into the base system is performed by the control system.

Programming

G70 ; Inch dimensions

G71 ' Metric dimensions

G700 ; Inch dimensions, also for feedrate F

G710 ; Metric dimensions, also for feedrate F

Programming example

```
N10 G70 X10 Z30      ; Inch dimensions
N20 X40 Z50          ;G70 continues to act
N80 G71 X19 Z17.3    ; metric dimensioning from this point on
```

Information

Depending on the **default setting** you have selected, the control system interprets all geometric values as either metric or inch dimensions. Tool offsets and settable work offsets including their display are also to be understood as geometrical values; this also applies to the feedrate F in mm/min or inch/min. The default setting can be set via machine data.

All examples listed in this manual are based on a **metric default setting**.

G70 or G71 evaluates all geometric parameters that directly refer to the **workpiece**, either as inches or metric units, for example:

- Positional data X, Y, Z, ... for G0,G1,G2,G3,G33, CIP, CT
- Interpolation parameters I, J, K (also thread pitch)
- Circle radius CR
- **Programmable** work offset (TRANS, ATRANS)
- Polar radius RP

All remaining geometric parameters that are not direct workpiece parameters, such as feedrates, tool offsets, and **settable** work offsets, are not affected by **G70/G71**.

G700/G710 however, also affects the feedrate F (inch/min, inch/rev. or mm/min, mm/rev.).

11.2.5 Polar coordinates, pole definition: G110, G111, G112

Functionality

In addition to the common specification in Cartesian coordinates (X, Y, Z), the points of a workpiece can be specified using the polar coordinates.

Polar coordinates are also helpful if a workpiece or a part of it is dimensioned from a central point (pole) with specification of the radius and the angle.

Plane

The polar coordinates refer to the plane activated with G17 to G19. In addition, the third axis standing vertically on this plane can be specified. When doing so, spatial specifications can be programmed as cylinder coordinates.

Polar radius RP=...


The polar radius specifies the distance of the point to the pole. It is stored and must only be written in blocks in which it changes, after changing the pole or when switching the plane.

Polar angle AP=...

The angle is always referred to the horizontal axis (abscissa) of the plane (for example, with G17: X axis). Positive or negative angle specifications are possible.

The polar angle remains stored and must only be written in blocks in which it changes, after changing the pole or when switching the plane.

See the following illustration for polar radius and polar angle with definition of the positive direction in different planes:

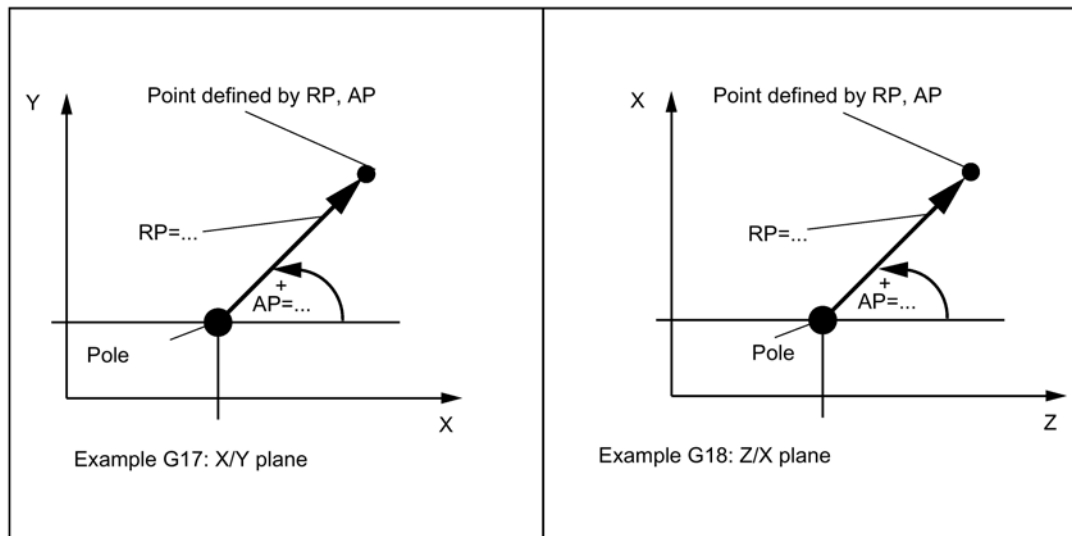

Pole definition, programming

- G110 Pole specification relative to the setpoint position last programmed (in the plane, e.g. with G17: X/Y)
- G111 ; Pole specification relative to the origin of the current workpiece coordinate system (in the plane, e.g. with G17: X/Y)
- G112 ; Pole specification, relative to the last valid pole; preserve plane

Note

Pole specifications

- Pole definitions can also be performed using polar coordinates. This makes sense if a pole already exists.
- If no pole is defined, the origin of the current workpiece coordinate system will act as the pole.

Programming example

```

N10 G17 ; X/Y plane
N20 G0 X0 Y0
N30 G111 X20 Y10 ; Pole coordinates in the current workpiece coordinate system
N40 G1 RP=50 AP=30 F1000
N50 G110 X-10 Y20
N60 G1 RP=30 AP=45 F1000
N70 G112 X40 Y20 ; New pole, relative to the last pole as a polar coordinate
N80 G1 RP=30 AP=135 ; Polar coordinate
M30

```

Traversing with polar coordinates

The positions programmed using polar coordinates can also be traversed as positions specified with Cartesian coordinates as follows:

- G0 - linear interpolation with rapid traverse
- G1 - linear interpolation with feedrate
- G2 - circular interpolation CW
- G3 - circular interpolation CCW

(See also Sections "Linear interpolation (Page 90)" and "Circular interpolation (Page 92)".)

11.2.6 Programmable work offset: TRANS, ATRANS

Functionality

The programmable work offset can be used:

- for recurring shapes/arrangements in various positions on the workpiece
- when selecting a new reference point for the dimensioning
- as a stock allowance when roughing

This results in the current workpiece coordinate system. The rewritten dimensions use this as a reference.

The offset is possible in all axes.

Programming


TRANS X... Y... Z... ; programmable offset, deletes old instructions for offsetting, rotation, scaling factor, mirroring

ATrans X... Y... Z... ; programmable offset, additive to existing instructions

TRANS ; without values: clears old instructions for offset, rotation, scaling factor, mirroring

The instructions which contain TRANS or ATRANS each require a separate block.

See the following illustration for the example for programmable offset:

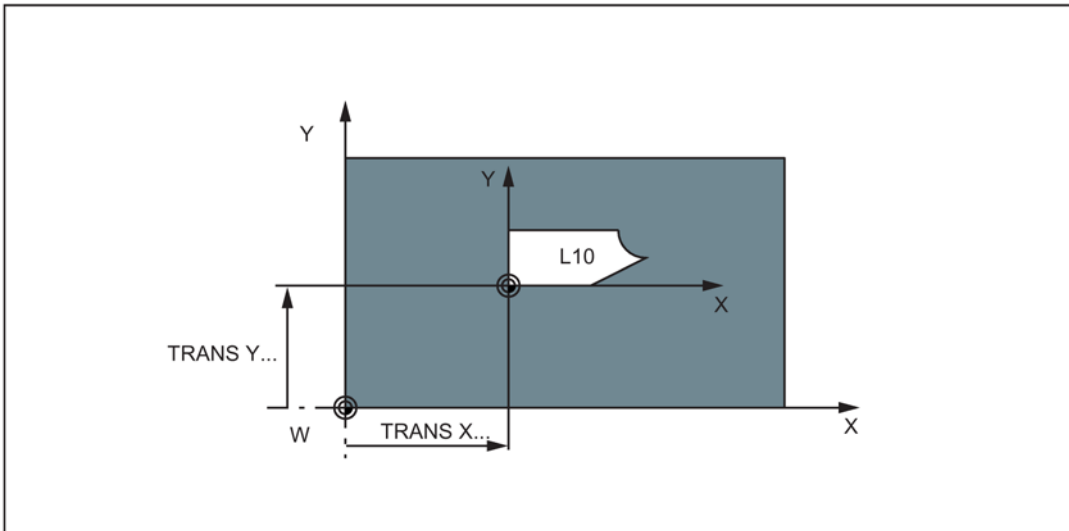

Programming example

```
N20 TRANS X20 Y15 ; Programmable offset
N30 L10 ; Subroutine call; contains the geometry to be offset
N70 TRANS ; Offset cleared
```

Subroutine call - see Section "Subroutine technique (Page 131)".

11.2.7 Programmable rotation: ROT, AROT

Functionality

The rotation is performed in the current plane G17 or G18 or G19 using the value of RPL=... specified in degrees.

Programming


ROT RPL=... ; Programmable rotation, deletes old instructions for offsetting, rotation, scaling factor, mirroring

AROT RPL=... ; Programmable rotation, additive to existing instructions


ROT ; Without values: clears old instructions for offset, rotation, scaling factor, mirroring

The instructions which contain ROT or AROT each require a separate block.

See the following illustration for definition of the positive direction of the angle of rotation in the individual planes:

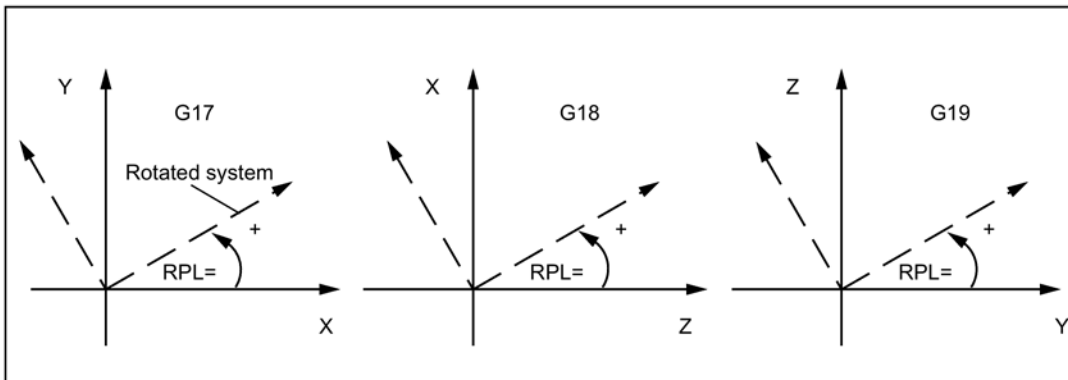

See the following illustration for programming example for programmable offset and rotation:

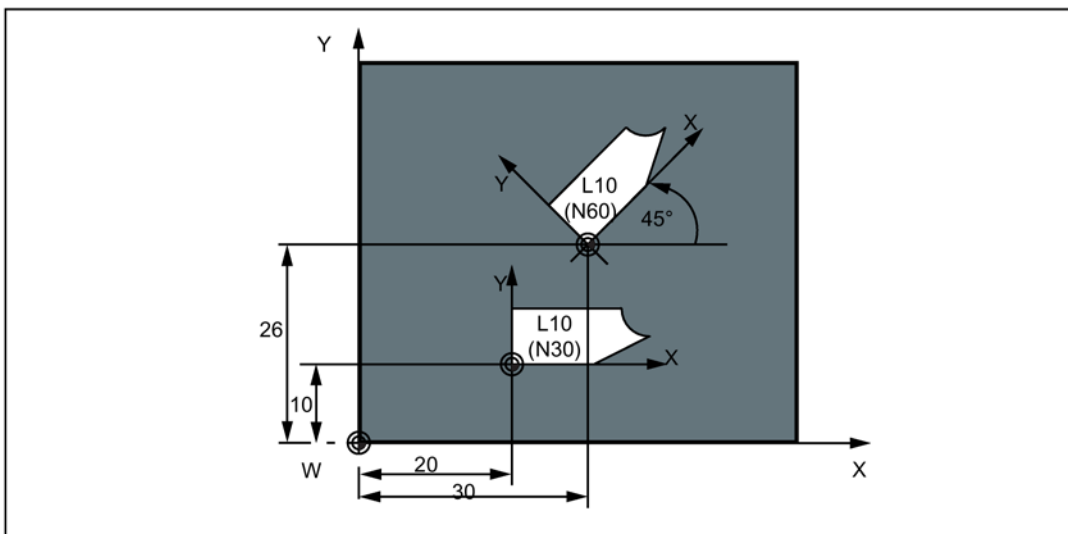

Programming example

```
N10 G17 ... ; X/Y plane
N20 TRANS X20 Y10 ; Programmable offset
N30 L10 ; Subroutine call; contains the geometry to be offset
N40 TRANS X30 Y26 ; New offset
N50 AROT RPL=45 ; Additive 45 degree rotation
N60 L10 ; Subroutine call
N70 TRANS ; Offset and rotation cleared
```

Subroutine call - see Section "Subroutine technique (Page 131)".

11.2.8 Programmable scale factor: SCALE, ASCALE

Functionality

A scale factor can be programmed for all axes with SCALE/ASCALE. The path is enlarged or reduced by this factor in the axis specified. The currently set coordinate system is used as the reference for the scale change.

Programming

SCALE X... Y... Z... ; Programmable scaling factor, clears the old instructions for offset, rotation, scaling factor, mirroring

ASCALE X... Y... Z... ; Programmable scaling factor, additive to existing instructions

SCALE ; Without values: clears the old instructions for offset, rotation, scaling factor, mirroring


The instructions which contain SCALE or ASCALE each require a separate block.

Note

For circles, the same factor should be used in both axes.

If ATRANS is programmed with SCALE/ASCALE active, these offset values are also scaled.

See the following illustration for example for scaling and offset:

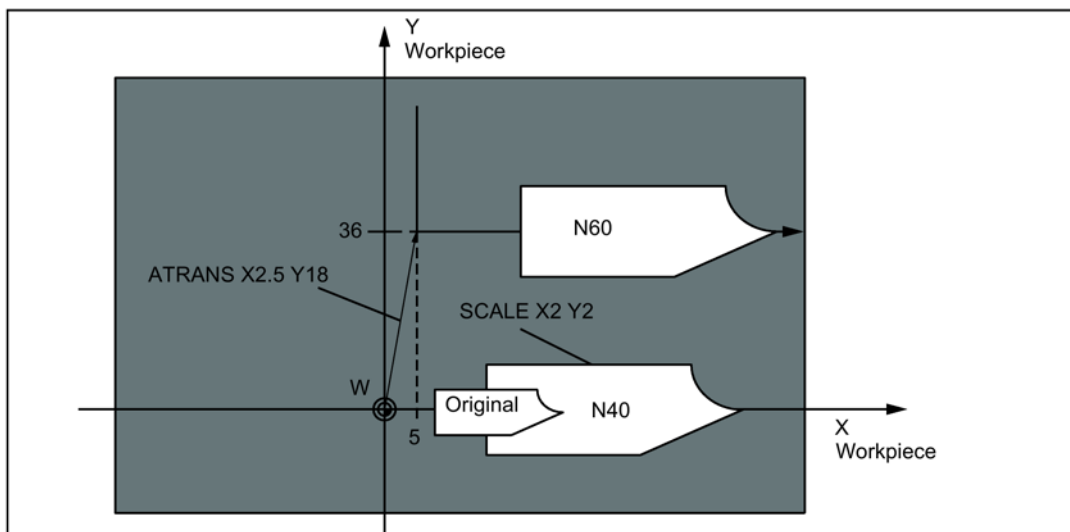

Programming example

```
N10 G17 ; X/Y plane
N20 L10 ; Programmed contour original
N30 SCALE X2 Y2 ; Contour in X and Y enlarged two times
N40 L10
N50 ATRANS X2.5 Y18 ; Offset values are also scaled
N60 L10
```

Subroutine call - see Section "Subroutine technique (Page 131)".

11.2.9 Programmable mirroring: MIRROR, AMIRROR

Functionality

MIRROR and AMIRROR can be used to mirror workpiece shapes on coordinate axes. All traversing motions of axes for which mirroring is programmed are reversed in their direction.

Programming

MIRROR X0 Y0 Z0 ; Programmable mirroring, clears old instructions for offset, rotation, scaling factor, mirroring

AMIRROR X0 Y0 Z0 ; Programmable mirroring, additive to existing instructions

MIRROR ; Without values: clears old instructions for offset, rotation, scaling factor, mirroring


The instructions that contain MIRROR or AMIRROR each require a separate block. The axis value has no influence. A value, however, must be specified.

Note

Any active tool radius compensation (G41/G42) is reversed automatically when mirroring.

The direction of rotation of the circle G2/G3 is also reversed automatically when mirroring.

See the following illustration for example for mirroring with the tool position shown:

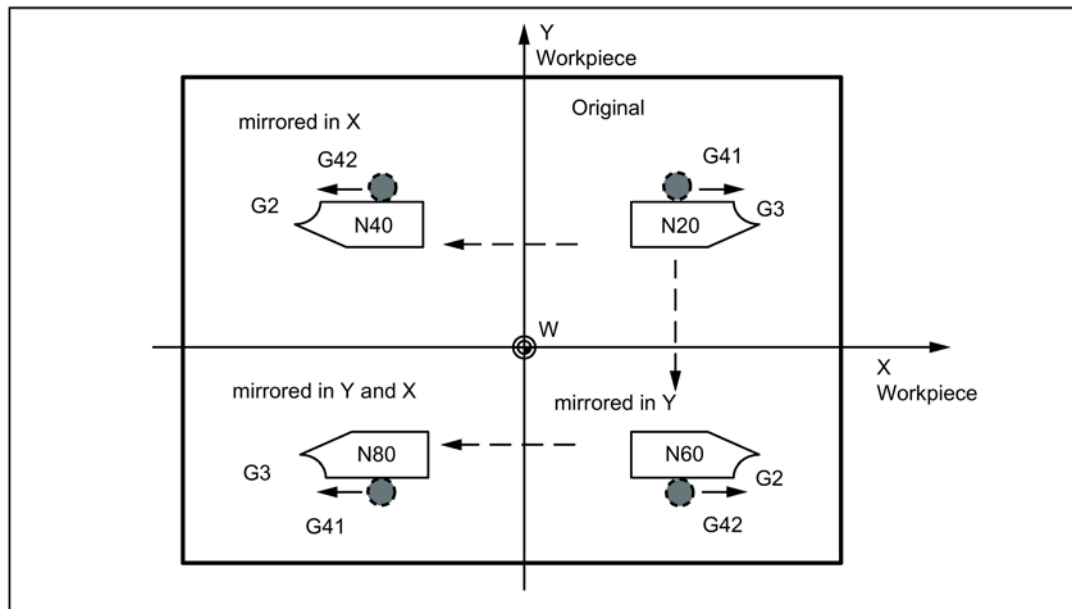

Programming example

Mirroring in different coordinate axes with influence on an active tool radius compensation and G2/G3:

```
...  
N10 G17 ; X/Y plane, Z standing vertically on it  
N20 L10 ; Programmed contour with G41  
N30 MIRROR X0 ; Direction changed in X  
N40 L10 ; Mirrored contour  
N50 MIRROR Y0 ; Direction changed in Y  
N60 L10  
N70 AMIRROR X0 ; Mirroring once more, but now in X  
N80 L10 ; Twice-mirrored contour  
N90 MIRROR ; Mirroring off
```

Subroutine call - see Section "Subroutine technique (Page 131)".

11.2.10 Workpiece coordinate system - settable work offset: G54 to G59, G507 to G532, G500, G53, G153

Functionality

The settable work offset specifies the position of the **workpiece zero** on the machine (offset of the workpiece zero with respect to the machine zero). This offset is determined upon clamping of the workpiece into the machine and must be entered in the corresponding data field by the operator. The value is activated by the program by selection from six possible groupings: G54 to G59.

Note

Workpiece clamping at an angle is possible by entering the angles of rotation around the machine axes. These rotation portions are activated with the work offset G54 to G59.

For control system with PPU16x.3, you can use the following machine data to expand the quantity of workpiece offsets:

MM_NUM_USER_FRAMES 28080 (Default 7)


This parameter ranges from 5 to 33, which corresponds to the workpiece offset quantity. For example, if this parameter is set to 33, the settable workpiece offsets will be G54 to G59 and G507 to G532.

Note that MD28080 is visible only with the manufacturer password.


Programming

G54 to G59	; 1st to 6th settable work offset
G507 to G532	; 7th to 33rd settable work offset
G500	; Settable work offset OFF - modal
G53	; Settable work offset OFF, non-modal, also suppresses programmable offset
G153	; Settable work offset OFF, non-modal; additionally suppresses base frame

See the following illustration for settable work offset:

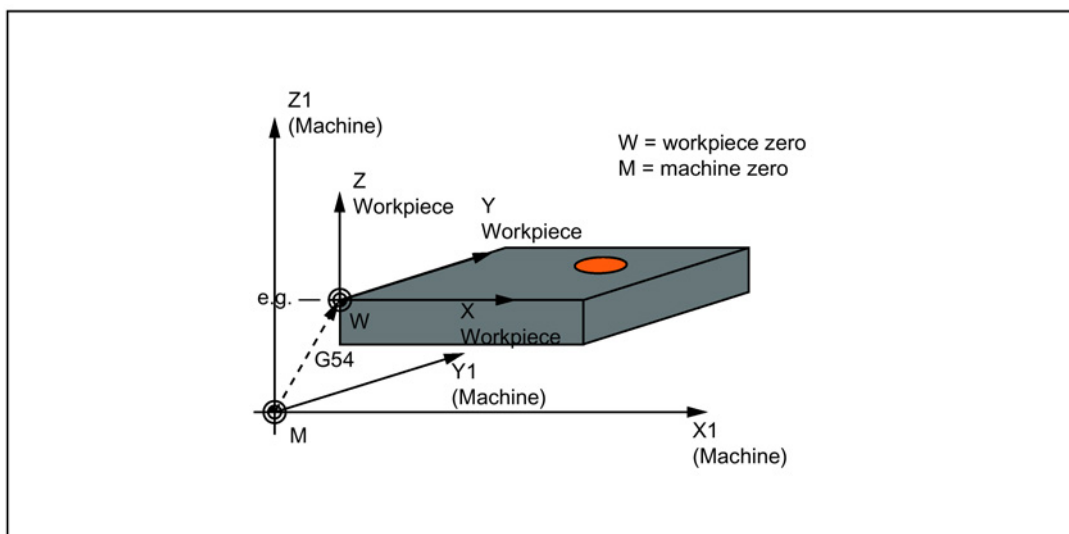

See the following illustration for various workpiece clamping positions when drilling/milling:

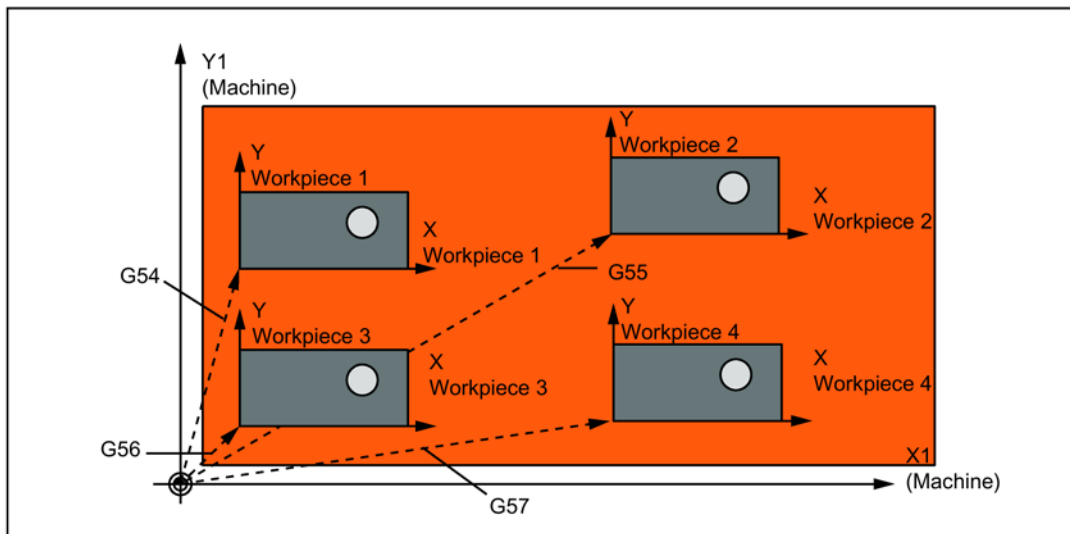

Programming example

```

N10 G54           ; Call first settable work offset
N20 L47           ; Machining of workpiece 1, here using L47
N30 G55           ; Call second settable work offset
N40 L47           ; Machining of workpiece 2, here using L47
N50 G56           ; Call third settable work offset
N60 L47           ; Machining of workpiece 3, here using L47
N70 G57           ; Call fourth settable work offset
N80 L47           ; Machining of workpiece 4, here using L47
N90 G500 G0 X     ; Deactivate settable work offset

```

Subroutine call - see Section "Subroutine technique (Page 131)".

11.2.11 NC block compression (COMPON, COMPCURV, COMPCAD)

Functionality

CAD/CAM systems normally produce linear blocks, which meet the configured accuracy specifications. In the case of complex contours, a large volume of data and short path sections can result. The short path sections restrict the processing rate.

By using a compressor function, the contour, specified by using linear blocks, is approached using polynomial blocks. This has the following advantages:

- Reduction of the number of required part program blocks for describing the workpiece contour
- Continuous block transitions
- Higher maximum path velocities

The following compressor functions are available:

- **COMPON**
The block transitions are only constant in the velocity, while acceleration of the participating axes can be in jumps at block transitions.
- **COMPCURV**
Block transitions have continuous acceleration. This ensures both smooth velocity and acceleration of all axes at block transitions.
- **COMPCAD**
The compression that uses a lot of computation time and memory space is optimized regarding surface quality and speed. COMPCAD should only be used if measures to improve the surface cannot be taken by the CAD/CAM program in advance.

COMPOF terminates the compressor function.

Syntax

COMPON
COMPCURV
COMPCAD
COMPOF

Meaning

COMPON: Command to activate the compressor function COMPON.
Effective: Modal

COMPCURV: Command to activate the compressor function COMPCURV.
Effective: Modal

COMPCAD: Command to activate the compressor function COMPCAD.
Effective: Modal

COMPOF : Command to deactivate the currently active compressor function.

Supplementary conditions

- The NC block compression is generally executed for linear blocks (G1).
- Only blocks that comply with a simple syntax are compressed:
N... G1X... Y... Z... F... ;comment
All other blocks are executed unchanged (no compression).
- Motion blocks with extended addresses such as C=100 or A=AC(100) are also condensed.
- The position values do not have to be programmed directly, but can also be indirectly specified using parameter assignments, e.g. X=R1*(R2+R3).
- If the option "orientation transformation" is available, then NC blocks in which the tool orientation (and where relevant, also the tool rotation) is programmed using direction vectors can also be compressed.
- It is interrupted by any other type of NC instruction, e.g., an auxiliary function output.

Examples

Example 1: COMPON

Program code	Comment
N10 COMPON	; Compressor function COMPON on.
N11 G1 X0.37 Y2.9 F600	; G1 before end point and feed.
N12 X16.87 Y-.698	
N13 X16.865 Y-.72	
N14 X16.91 Y-.799	
...	
N1037 COMPOF	; Compressor function off.
...	

Example 2: COMPCAD

Program code	Comment
G00 X30 Y6 Z40	
G1 F10000 G642	; Blending function G642 on.
S0FT	; Jerk limiting S0FT on.
COMPCAD	; Compressor function COMPCAD on.
STOPFIFO	
N24050 Z32.499	
N24051 X41.365 Z32.500	
N24052 X43.115 Z32.497	
N24053 X43.365 Z32.477	
N24054 X43.556 Z32.449	
N24055 X43.818 Z32.387	
N24056 X44.076 Z32.300	
...	
COMPOF	; Compressor function off.
G00 Z50	
M30	

11.3 Linear interpolation

11.3.1 Linear interpolation with rapid traverse: G0

Functionality

The rapid traverse movement G0 is used for rapid positioning of the tool, but not for **direct workpiece machining**.

All the axes can be traversed simultaneously - on a straight path.

For each axis, the maximum speed (rapid traverse) is defined in machine data. If only one axis traverses, it uses its rapid traverse. If two or three axes are traversed simultaneously, the path velocity (e.g. the resulting velocity at the tool tip) must be selected such that the **maximum possible path velocity** with consideration of all axes involved results.

A programmed feedrate (F word) has no meaning for G0. G0 remains active until canceled by another instruction from this G group (G1, G2, G3...).


Programming

G0 X... Y... Z...	; Cartesian coordinates
G0 AP=... RP=...	; Polar coordinates
G0 AP=... RP=... Z...	; Cylindrical coordinates (3-dimensional)

Note

Another option for linear programming is available with the angle specification ANG=... (For more information, see Section "Contour definition programming (Page 109)").

See the illustration for linear interpolation with rapid traverse from point P1 to P2:

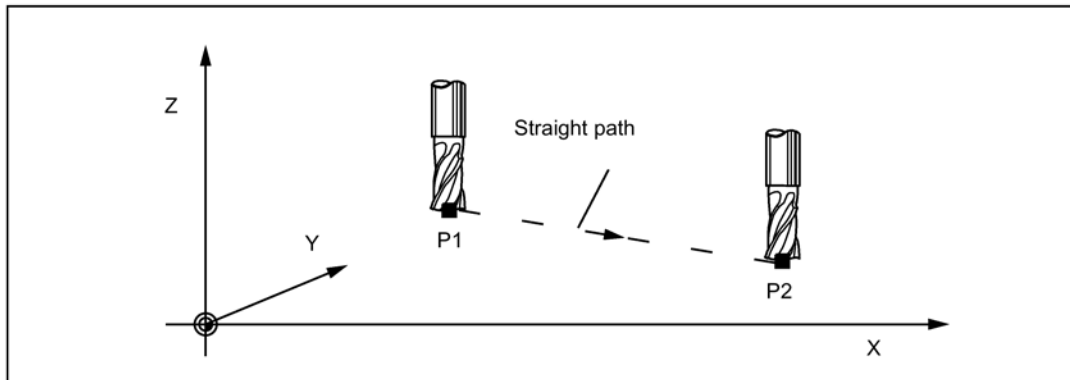

Programming example

N10 G0 X100 Y150 Z65	; Cartesian coordinate
...	
N50 G0 RP=16.78 AP=45	; Polar coordinate

Information

Another group of G functions exists for movement to the position (see Section "Exact stop/continuous-path control mode: G9, G60, G64 (Page 105)").

For G60 exact stop, a window with various precision values can be selected with another G group. For exact stop, an alternative instruction with non-modal effectiveness exists: G9.

You should consider these options for adaptation to your positioning tasks.

11.3.2 Feederate F

Functionality

The feed F is the **path velocity** and represents the value of the geometric sum of the velocity components of all axes involved. The individual axis velocities therefore result from the portion of the axis path in the overall distance to be traversed.

The feedrate F is effective for the interpolation types G1, G2, G3, CIP, and CT and is retained until a new F word is written.

Programming

F...

Note

For integer values, the decimal point is not required, e.g. F300.

Unit of measure for F with G94, G95

The dimension unit for the F word is determined by G functions:

- G94: F as the feedrate in **mm/min**
- G95: Feedrate F in mm/spindle revolutions
(only meaningful when the spindle is running)

Note

This unit of measure applies to metric dimensions. According to Section "Metric and inch dimensioning", settings with inch dimensioning are also possible.

Programming example

N10 G94 F310	; Feedrate in mm/min
N110 S200 M3	; Spindle rotation
N120 G95 F15.5	; Feedrate in mm/revolution

Note

Write a new F word if you change G94 - G95.

11.3.3 Linear interpolation with feedrate: G1

Functionality

The tool moves from the starting point to the end point along a straight path. The **path velocity** is determined by the programmed **F word**.

All axes can be traversed simultaneously.

G1 remains active until canceled by another instruction from this G group (G0, G2, G3...).


Programming

G1 X... Y... Z... F...	; Cartesian coordinates
G1 AP=... RP=... F...	; Polar coordinates
G1 AP=... RP=... Z... F...	; cylindrical coordinates (3-dimensional)

Note

Another option for linear programming is available with the angle specification ANG=... (see Section "Contour definition programming (Page 109)").

See the illustration for linear interpolation in three axes using the example of a slot:

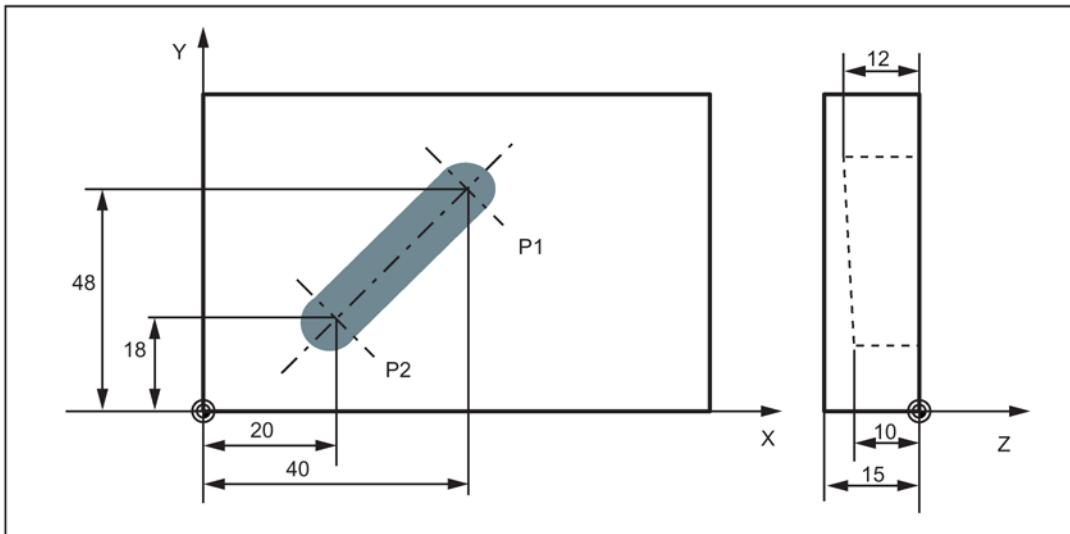

Programming example

```
N05 G0 G90 X40 Y48 Z2 S500 M3
N10 G1 Z-12 F100
N15 X20 Y18 Z-10
N20 G0 Z100
N25 X-20 Y80
N30 M2
```

```
; The tool traverses in rapid traverse on P1,
; three axes concurrently, spindle speed = 500 rpm,
; clockwise
; Infeed on Z-12, feed 100 mm/min
; Tool travels on a straight line in space on P2
; Retraction in rapid traverse
; End of program
```

To machine a workpiece, spindle speed S ... and direction M3/M4 are required (see Section "Spindle movements (Page 108)").

11.4 Circular interpolation


11.4.1 Circular interpolation: G2, G3

Functionality

The tool moves from the starting point to the end point along a circular path. The direction is determined by the G function:


G2: clockwise

G3: counter-clockwise

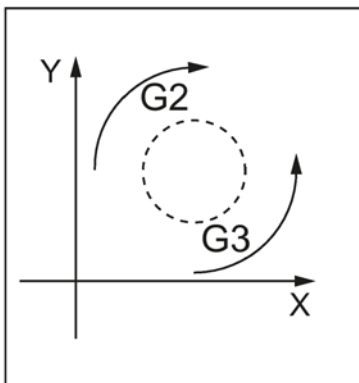

The description of the desired circle can be given in various ways:

See the following illustration for possibilities of circle programming with G2/G3 using the example of the axes X/Y and G2:

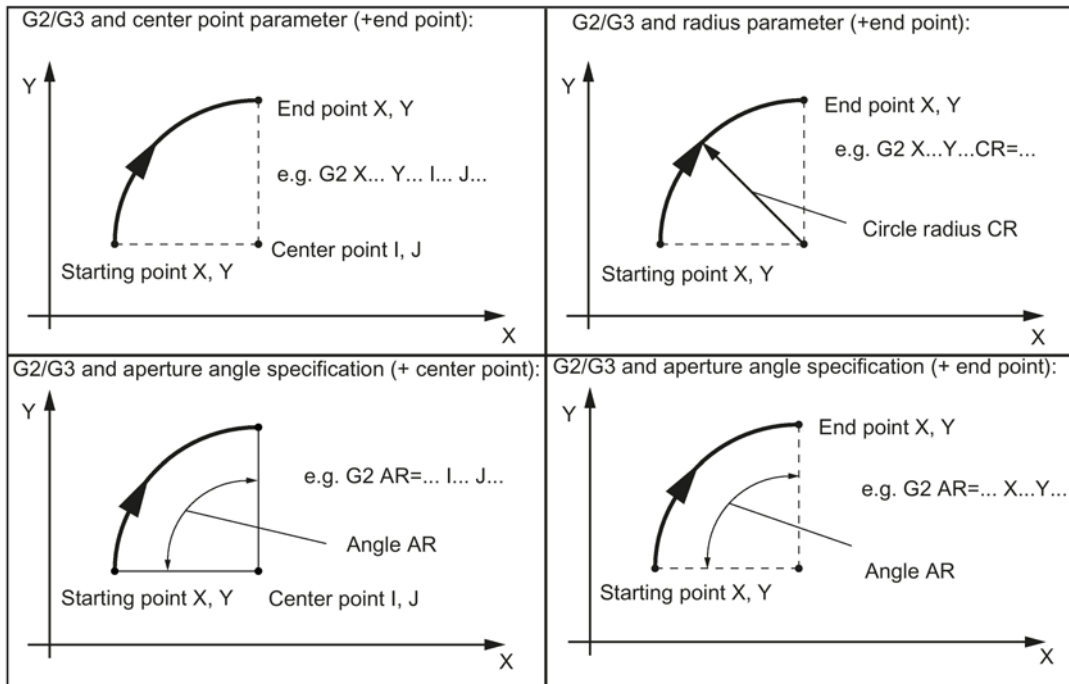

G2/G3 remains active until canceled by another instruction from this G group (G0, G1, ...).

The **path velocity** is determined by the programmed **F word**.

Programming

G2/G3 X... Y... I... J...	; End point and center point
G2/G3 CR=... X... Y...	; Circle radius and end point
G2/G3 AR=... I... J...	; Opening angle and center point
G2/G3 AR=... X... Y...	; Opening angle and end point
G2/G3 AP=... RP=...	; Polar coordinates, circle around the pole

Note

Other circle programming instructions:

- CT - circle with tangential connection
- CIP - circle via intermediate point (see following sections)

Input tolerances for the circle


Circles are only accepted by the control system with a certain dimensional tolerance. The circle radius at the starting and end points are compared here. If the difference is within the tolerance, the center point is exactly set internally. Otherwise, an alarm message is issued.

Information


Full circles in a block are only possible if the center point and the end point are specified.

For circles with radius specification, the arithmetic sign of CR=... is used to select the correct circle. It is possible to program two circles with the same starting and end points, as well as with the same radius and the same direction. The negative sign in front of CR=-... determines the circle whose circle segment is greater than a semi-circle; otherwise, the circle with the circle segment is less than or equal to the semi-circle and determined as follows:

See the following illustration for selection of the circle from two possible circles with radius specification:

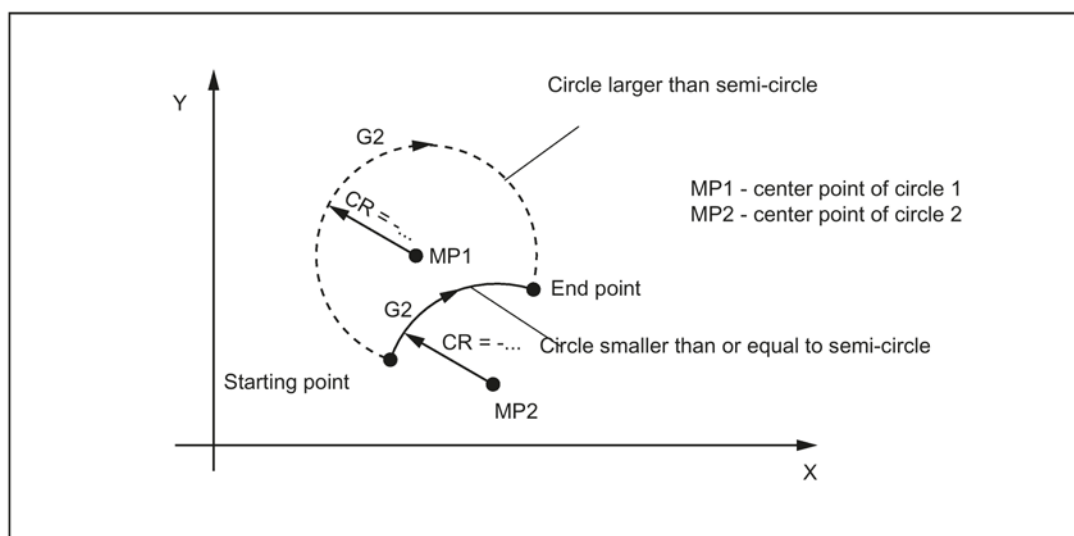

Programming example: Definition of center point and end point

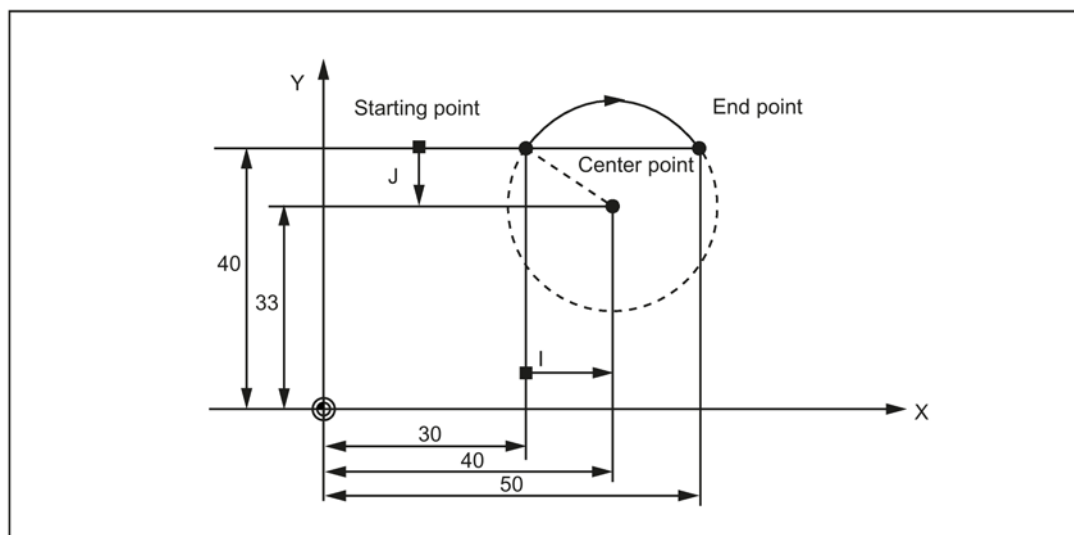


```
N5 G90 X30 Y40 ; Starting point circle for N10
N10 G2 X50 Y40 I10 J-7 ; End point and center point
```

Note

Center point values refer to the circle starting point!


Programming example: End point and radius specification

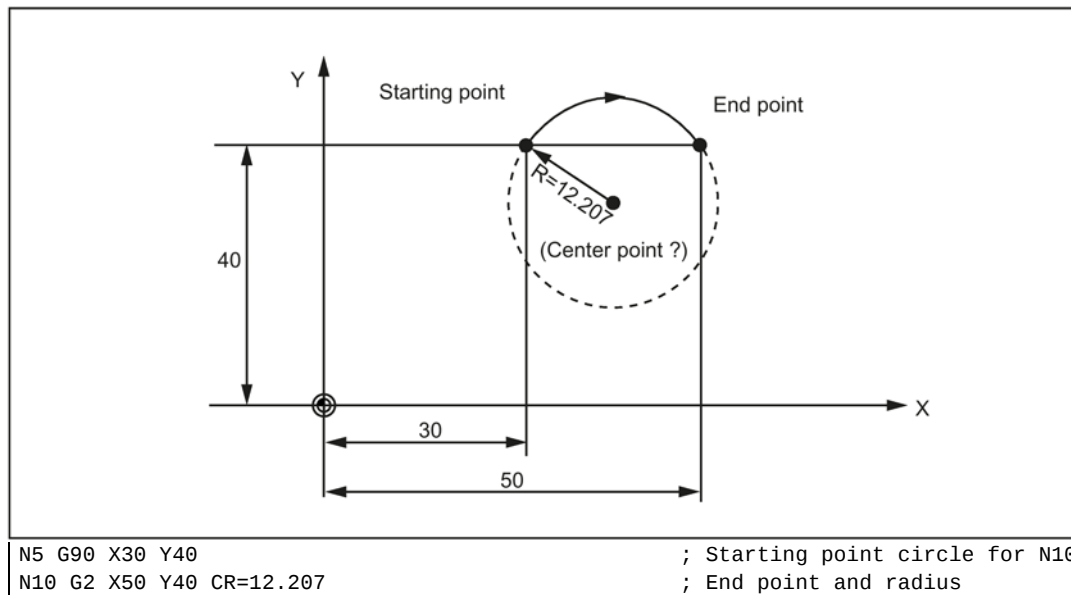


Note

With a negative leading sign for the value with CR=..., a circular segment larger than a semi-circle is selected.

Programming example: Definition of end point and aperture angle

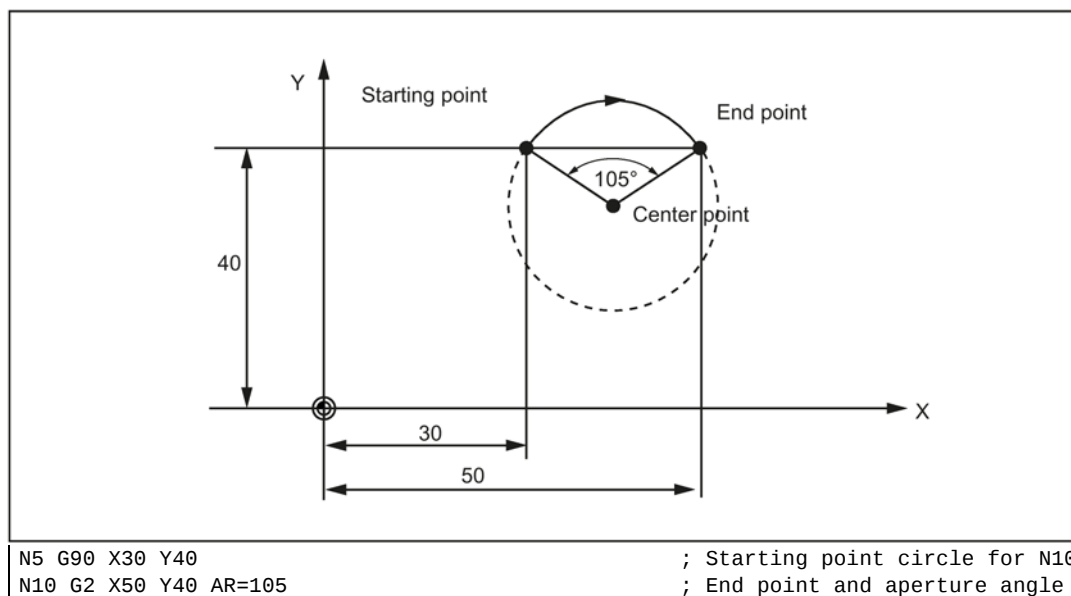

Programming example: Definition of center point and aperture angle

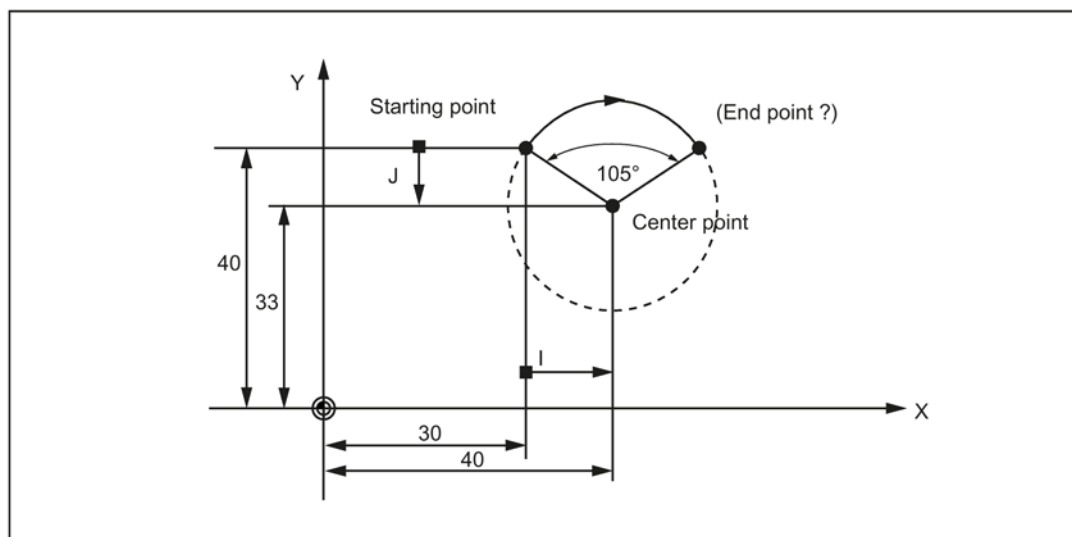


```
N5 G90 X30 Y40 ; Starting point circle for N10
N10 G2 I10 J-7 AR=105 ; Center point and aperture angle
```

Note

Center point values refer to the circle starting point!

Programming example: Polar coordinates

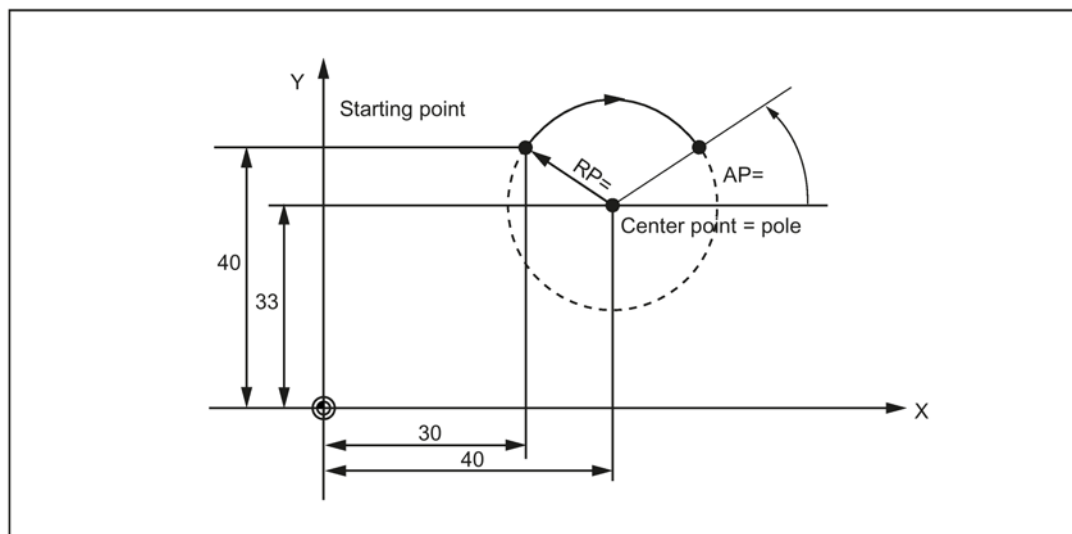

```
N1 G17 ; X/Y plane
N5 G90 G0 X30 Y40 ; Starting point circle for N10
N10 G111 X40 Y33 ; Pole = circle center
N20 G2 RP=12.207 AP=21 ; Polar specifications
```

11.4.2 Circular interpolation via intermediate point: CIP

Functionality

If you know **three contour points** of the circle, instead of center point or radius or aperture angle, then it is advantageous to use the CIP function.

The direction of the circle results here from the position of the intermediate point (between starting and end points). The intermediate point is written according to the following axis assignment:

I1=... for the X axis,

J1=... for the Y axis,


K1=... for the Z axis.

CIP remains active until canceled by another instruction from this G group (G0, G1, G2, ...).

Note

The configured dimensional data G90 or G91 applies to the end point **and** the intermediate point.

See the following illustration for circle with end point and intermediate point specification using the example of G90:

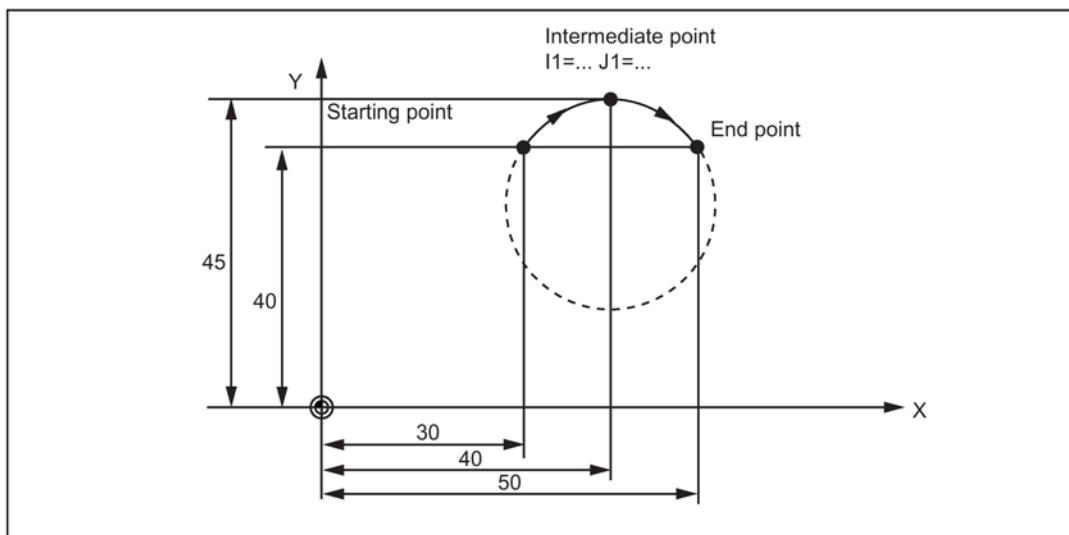

Programming example

```
N5 G90 X30 Y40 ;Starting point circle for N10
N10 CIP X50 Y40 I1=40 J1=45 ; End point and intermediate point
```


11.4.3 Circle with tangential transition: CT

Functionality

With CT and the programmed end point in the current plane G17 through G19, a circle is generated which is connected tangentially to the previous path segment (circle or straight line) in this plane.

This defines the radius and center point of the circle from the geometric relationships of the previous path section and the programmed circle end point.

See the following illustration for circle with tangential transition to the previous path section:

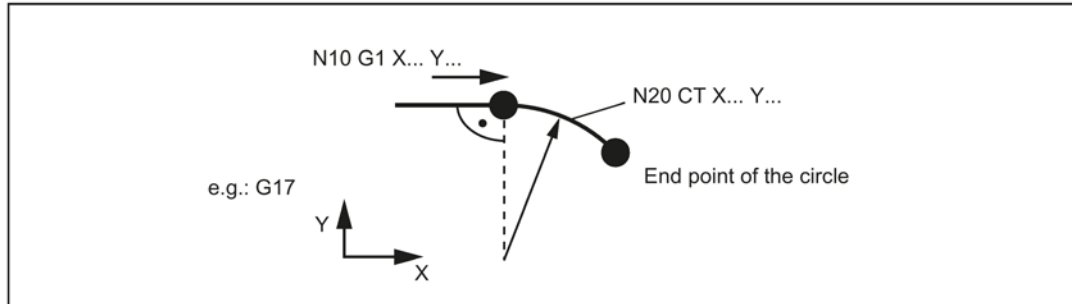

Programming example

```
N10 G1 X20 F300 ; Straight line
N20 CT X... Y... ; Circle with tangential connection
```

11.4.4 Helix interpolation: G2/G3, TURN

Functionality

With helix interpolation, two movements are overlaid:


- Circular movement in the G17, G18 or G19 plane
 - Linear movement of the axis standing vertically on this plane.
- The number of additional full-circle passes is programmed with TURN=. These are added to the actual circle programming.

The helix interpolation can preferably be used for the milling of threads or of lubricating grooves in cylinders.

Programming

```
G2/G3 X... Y... I... J... TURN=... ; Center and end points
G2/G3 CR=... X... Y... TURN=... ; Circle radius and end point
G2/G3 AR=... I... J... TURN=... ; Opening angle and center point
G2/G3 AR=... X... Y... TURN=... ; Opening angle and end point
G2/G3 AP=... RP=... TURN=... ; Polar coordinates, circle around the pole
```

See the following illustration for helical interpolation:

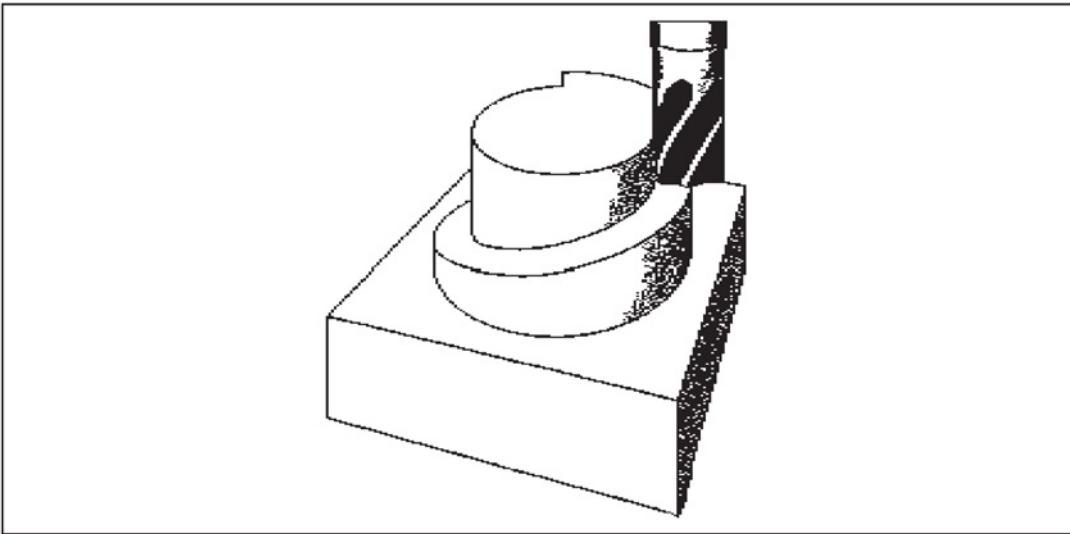

Programming example

```
N10 G17 ; X/Y plane, Z standing vertically on it
N20 G0 Z50
N30 G1 X0 Y50 F300 ; Approach starting point
N40 G3 X0 Y0 Z33 I0 J-25 TURN= 3 ; Helix
M30
```

11.4.5 Feedrate override for circles: CFTCP, CFC

Functionality

For activated **tool radius compensation** (G41/G42) and **circle programming**, it is imperative to correct the feedrate at the cutter center point if the **programmed F value** is to act at the circle contour.

Internal and external machining of a circle and the current tool radius are taken into account automatically if the tool radius compensation is enabled.


This feedrate correction (override) is not necessary for linear paths. The path velocities at the cutter center point and at the programmed contour are identical.

If you wish the programmed feedrate always to act at the cutter center point path, then disable the feedrate override. The modally acting G group that contains CFTCP/CFC (G functions) is provided for switching.

Programming

CFTCP ; Feedrate override OFF (the programmed feedrate acts at the milling cutter center point)
CFC ; Feedrate override with circle ON

See the following illustration for feedrate override G901 with internal/external machining:

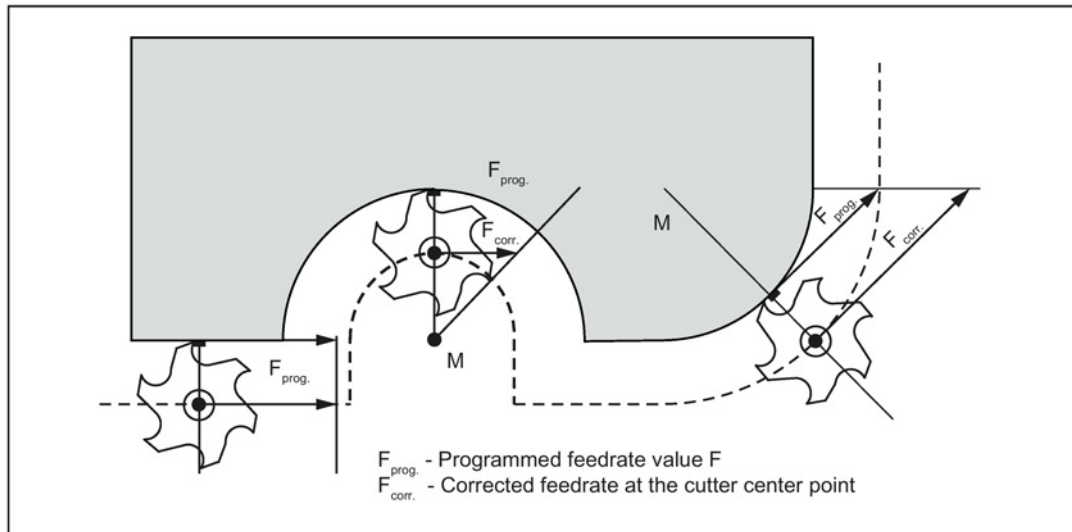

Corrected feedrate

- External machining:

$$F_{corr} = F_{prog} \cdot (r_{cont} + r_{tool}) / r_{cont}$$

- Internal machining:

$$F_{corr} = F_{prog} \cdot (r_{cont} - r_{tool}) / r_{cont}$$

r_{cont} : Radius of the circle contour

r_{tool} : Tool radius

Programming example

```

N10 G42 G1 X30 Y40 F1000      ; Tool radius compensation ON
N20 CFC F350                  ; Feedrate override with circle ON
N30 G2 X50 Y40 I10 J-7 F350   ; Feed value acts on contour
N40 G3 X70 Y40 I10 J6 F300    ; Feed value acts on contour
N50 CFTCP                     ; Feedrate override OFF, programmed feedrate value acts at the
                                milling cutter center point
N60 M30
  
```

11.5 Thread cutting

11.5.1 Thread cutting with constant lead: G33

Functionality

This requires a spindle with position measuring system.

The function G33 can be used to machine threads with constant lead of the following type: If an appropriate tool is used, tapping with compensating chuck is possible.

The compensating chuck compensates the resulting path differences to a certain limited degree.

The drilling depth is specified by specifying one of the axes X, Y or Z; the thread pitch is specified via the relevant I, J or K.

G33 remains active until canceled by another instruction from this G group (G0, G1, G2, G3...).


Right-hand or left-hand thread

Right-hand or left-hand thread is set with the rotation direction of the spindle (M3 right (CW), M4 left (CCW) - see Section "Spindle movements (Page 108)"). To do this, the rotation value must be programmed under address S or a rotation speed must be set.

Note

A complete cycle of tapping with compensating chuck is provided by the standard cycle CYCLE840.

See the following illustration for tapping using G33:

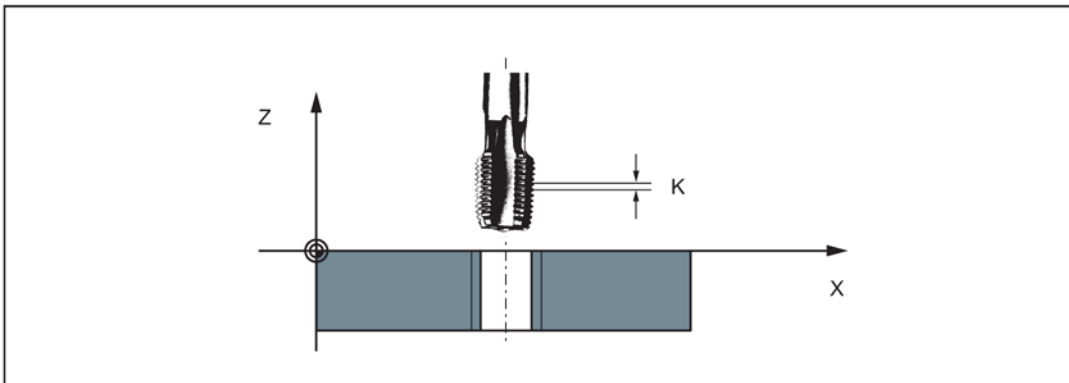

Programming example

```
N10 G54 G0 G90 X10 Y10 Z5 S600 M3      ; metric thread 5,  
                                         ; pitch as per table: 0.8 mm/rev., hole already  
                                         ; premachined  
N20 G33 Z-25 K0.8 M4                  ; Approach starting point, clockwise spindle rota-  
                                         ; tion  
N40 Z5 K0.8 M4                        ; Tapping, end point -25 mm  
N50 G0 X30 Y30 Z20                    ; Retraction, counter-clockwise spindle rotation  
N60 M30
```

Axis velocity

With G33 threads, the velocity of the axis for the thread lengths is determined on the basis of the spindle speed and the thread pitch. The **feedrate F is not relevant**. It is, however, stored. However, the maximum axis velocity (rapid traverse) defined in the machine data cannot be exceeded. This will result in an alarm.

Note

Override switch

- The spindle speed override switch must remain unchanged for thread machining.
- The feedrate override switch has no meaning in this block.

11.5.2 Tapping with compensating chuck: G63

Functionality

G63 can be used for tapping with compensating chuck. The programmed feedrate F must match with the spindle speed S (programmed under the address "S" or specified speed) and with the thread pitch of the drill:

$$F [\text{mm/min}] = S [\text{rpm}] \times \text{thread pitch} [\text{mm/rev.}]$$

The compensating chuck compensates the resulting path differences to a certain limited degree.

The drill is retracted using G63, too, but with the spindle rotating in the opposite direction M3 <-> M4.

G63 is non-modal. In the block after G63, the previous G command of the "Interpolation type" group (G0, G1, G2, ...) is active again.


Right-hand or left-hand thread

Right-hand or left-hand thread is set with the rotation direction of the spindle (M3 right (CW), M4 left (CCW) - see Section "Spindle movements (Page 108)").

Note

The standard cycle CYCLE840 provides a complete tapping cycle with compensating chuck (but with G33 and the relevant prerequisites).

See the following illustration for tapping using G63:

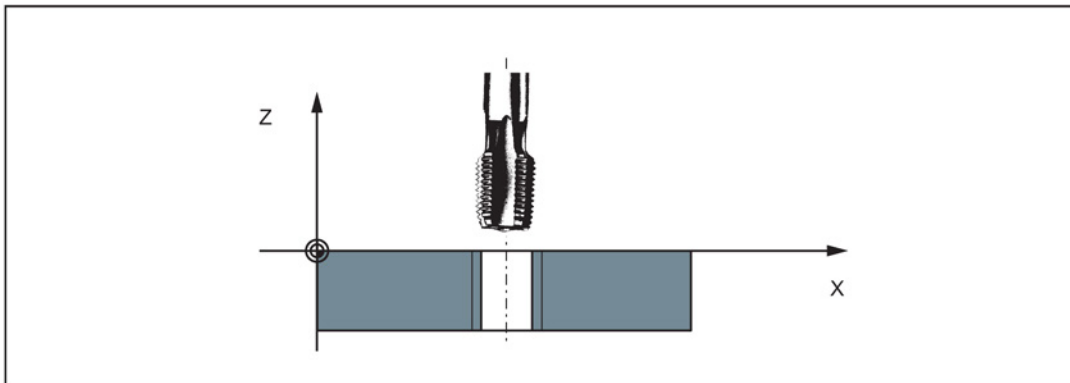

Programming example

```
N10 G54 G0 G90 X10 Y10 Z5 S600 M3      ; metric thread 5,  
                                         ; lead as per table: 0.8 mm/rev., hole already  
                                         ; premachined  
N20 G63 Z-25 F480                      ; Approach starting point, clockwise spindle rota-  
                                         ; tion  
N40 G63 Z5 M4                          ; Tapping, end point -25 mm  
N50 X30 Y30 Z20                        ; Retraction, counter-clockwise spindle rotation  
M30
```

11.5.3 Thread interpolation: G331, G332

Functionality

This requires a position-controlled spindle with a position measuring system.

By using G331/G332, the threads can be tapped **without** compensating chuck if the dynamic properties of the spindle and axis allow it.

If, however, a compensating chuck is used, the path differences to be compensated by the compensating chuck are reduced. This allows tapping at higher spindle speeds.

Drilling is done using G331, retraction is done using G332.

The drilling depth is specified by specifying one of the axes X, Y or Z; the thread pitch is specified via the relevant I, J or K.

For G332, the same lead is programmed as for G331. Reversal of the spindle direction of rotation occurs automatically.

The spindle speed is programmed with S and without M3/M4.

Before tapping the thread using G331/G332, the spindle must be switched to the position-controlled mode with SPOS=....

Right-hand or left-hand thread

The **sign of the** thread lead determines the direction of spindle rotation:


Positive: right-hand (as with M3)

Negative: left-hand (as with M4)

Note

A complete thread tapping cycle with thread interpolation is provided with the standard cycle CYCLE84.

See the following illustration for tapping using G331/G332:

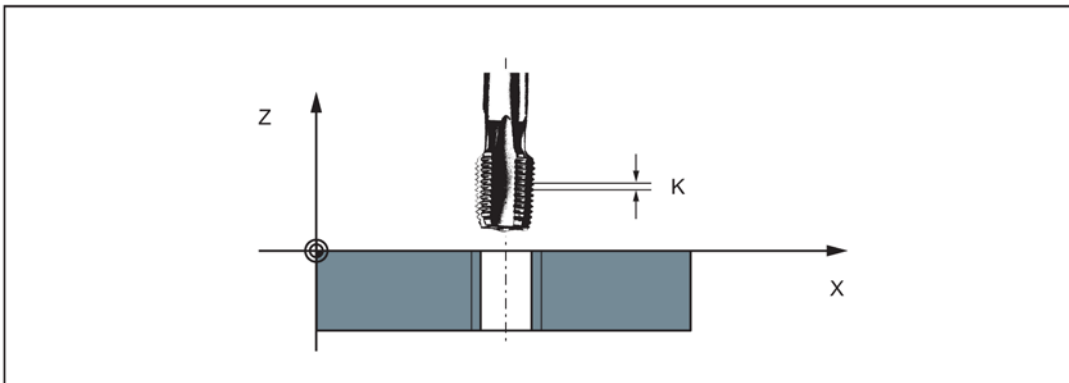

Axis velocity

When programming with G331/G332, you can determine the axis velocity based on the spindle speed and the thread lead. However, the maximum axis velocity (rapid traverse) defined in the machine data cannot be exceeded; otherwise, alarms will appear.

Programming example

```
metric thread M5,  
lead: 0.8 mm/rev., hole already premachined:  
N5 G54 G0 G90 X10 Y10 Z5  
N10 SPOS=0  
N20 G331 Z-25 K0.8 S600  
  
N40 G332 Z5 K0.8  
N50 G0 X30 Y30 Z20  
N60 M30
```

; Approach starting point
; Spindle in position control
; Tapping, K positive = clockwise
of the spindle, end point Z=-25 mm
; Retraction

11.6 Fixed point approach

11.6.1 Fixed point approach: G75

Functionality

By using G75, a fixed point on the machine, e.g. tool change point, can be approached. The position is stored permanently in the machine data for all axes. A maximum of four fixed points can be defined for each axis.

No offset is effective. The speed of each axis is its rapid traverse.

G75 requires a separate block and is non-modal. The machine axis identifier must be programmed!

In the block after G75, the previous G command of the "Interpolation type" group (G0, G1, G2, ...) is active again.

Programming

G75 FP=<n> X=0 Y=0 Z=0

Note

FPn references with axis machine data MD30600 \$MA_FIX_POINT_POS[n-1]. If no FP has been programmed, then the first fixed point will be selected.

Command	Significance
G75	Fixed point approach
FP=<n>	Fixed point that is to be approached. The fixed point number is specified: <n> Value range of <n>: 1, 2, 3, 4 MD30610\$NUM_FIX_POINT_POS should be set if fixed point number 3 or 4 is to be used. If no fixed point is specified, fixed point 1 is approached automatically.
X=0 Y=0 Z=0	Machine axes to be traversed to the fixed point. Here, specify the axes with value "0" with which the fixed point is to be approached simultaneously. Each axis is traversed with the maximum axial velocity.

Programming example

```

N05 G75 FP=1 Z=0           ; Approach fixed point 1 in Z
N10 G75 FP=2 X=0 Y=0       ; Approach fixed point 2 in X and Y, e.g. to
                             change a tool
N30 M30                   ; End of program

```

Note

The programmed position values for X, Y, Z (any value, here = 0) are ignored, but must still be written.

11.6.2 Reference point approach: G74

Functionality

The reference point can be approached in the NC program with G74. The direction and speed of each axis are stored in machine data.

G74 requires a separate block and is non-modal. The machine axis identifier must be programmed!

In the block after G74, the previous G command of the "Interpolation type" group (G0, G1, G2, ...) is active again.

Programming example

```

N10 G74 X=0 Y=0 Z=0

```

Note

The programmed position values for X, Y, Z (any value, here = 0) are ignored, but must still be written.

11.7 Acceleration control and exact stop/continuous path

11.7.1 Acceleration pattern: BRISK, SOFT


BRISK

The axes of the machine change their velocities using the maximum permissible acceleration value until reaching the final velocity. BRISK allows time-optimized working. The set velocity is reached in a short time. However, jumps are present in the acceleration pattern.

SOFT

The axes of the machine accelerate along a non-linear, constant characteristic until reaching the final velocity. With this jerk-free acceleration, SOFT allows for reduced machine load. The same behavior can also be applied to braking procedures.

See the following illustration for basic course of the path velocity when using BRISK/SOFT:

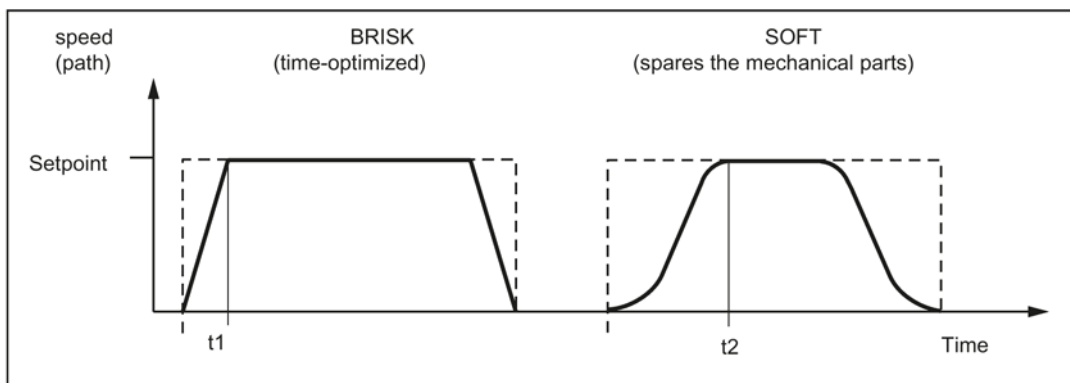

Programming

BRISK ; Jerking path acceleration
SOFT ; Jerk-limited path acceleration

Programming example

```
N10 SOFT G1 X30 Z84 F650 ; Jerk-limited path acceleration  
N90 BRISK X87 Z104 ; Continuing with jerking path acceleration
```

11.7.2 Exact stop/continuous-path control mode: G9, G60, G64

Functionality

G functions are provided for optimum adaptation to different requirements to set the traversing behavior at the block boundaries and for block advancing. For example, you would like to quickly position with the axes or to machine contours over multiple blocks.

Programming

G60 ; Exact stop modally effective
G64 ; Continuous-path mode
G9 ; Exact stop non-modally effective
G601 ; Exact stop window fine
G602 ; Exact stop window coarse

Exact stop G60, G9


If the exact stop function (G60 or G9) is active, the velocity for reaching the exact end position at the end of a block is decelerated to zero.

Another modal G group can be used here to set when the traversing movement of this block is considered ended and the next block is started.

- G601: Exact stop window fine
Block advance takes place when all axes have reached the "Exact stop window fine" (value in the machine data).
- G602: Exact stop window coarse
Block advance takes place when all axes have reached the "Exact stop window coarse" (value in the machine data).

The selection of the exact stop window has a significant influence on the total time if many positioning operations are executed. Fine adjustments require more time.

See the following illustration for exact stop window coarse or fine, in effect for G60/G9:

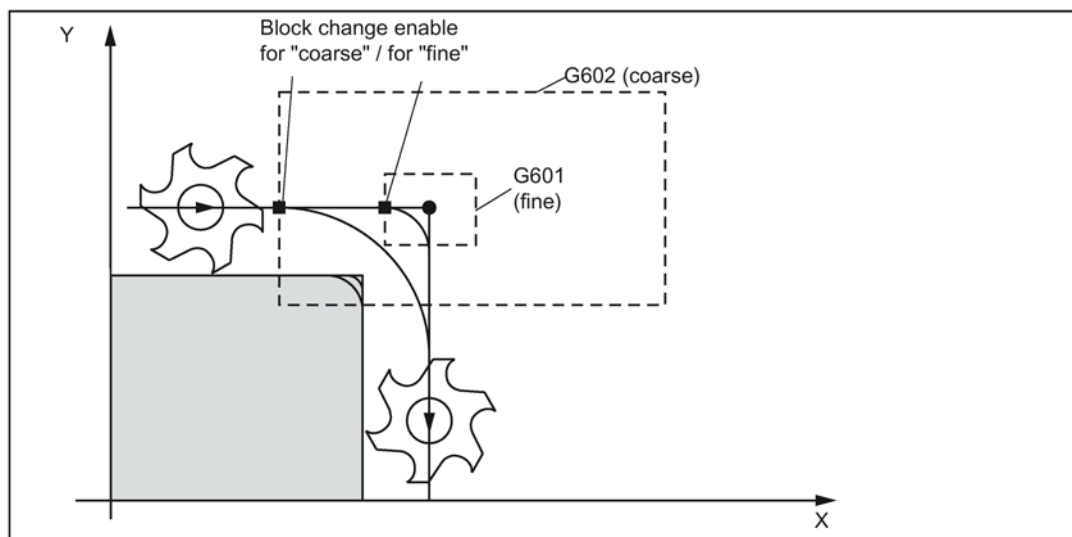

Programming example

```
N5 G602 ; Exact stop window coarse
N10 G0 G60 X20 ; Exact stop modal
N20 X30 Y30 ; G60 continues to act
N30 G1 G601 X50 Y50 F100 ; Exact stop window fine
N40 G64 X70 Y60 ; Switching over to continuous-path mode
N50 G0 X90 Y90
N60 G0 G9 X95 ; Exact stop acts only in this block
N70 G0 X100 Y100 ; Again continuous-path mode
M30
```

Note

The G9 command only generates exact stop for the block in which it is programmed; G60, however, is effective until it is canceled by G64.

Continuous-path control mode G64

The objective of the continuous-path control mode is to avoid deceleration at the block boundaries and to switch **to the next block with a path velocity as constant as possible** (in the case of tangential transitions). The function works with **look-ahead velocity control** over several blocks.

For non-tangential transitions (corners), the velocity can be reduced rapidly enough so that the axes are subject to a relatively high velocity change over a short period of time. This may lead to a significant jerk (acceleration change). The size of the jerk can be limited by activating the SOFT function.


Programming example

```
N10 G64 G1 X10 Y20 F1000 ; Continuous-path mode
N20 X30 Y30 ; Continuous-path control mode continues to be active
N30 G60 Z50 ; Switching over to exact stop
M30
```

Look-ahead velocity control:

In the continuous-path control mode with G64, the control system determines the velocity control for several NC blocks in advance automatically. This enables acceleration and deceleration across multiple blocks with approximately tangential transitions. For paths that consist of short travels in the NC blocks, higher velocities can be achieved than without look ahead.

See the following illustration for comparison of the G60 and G64 velocity behavior:

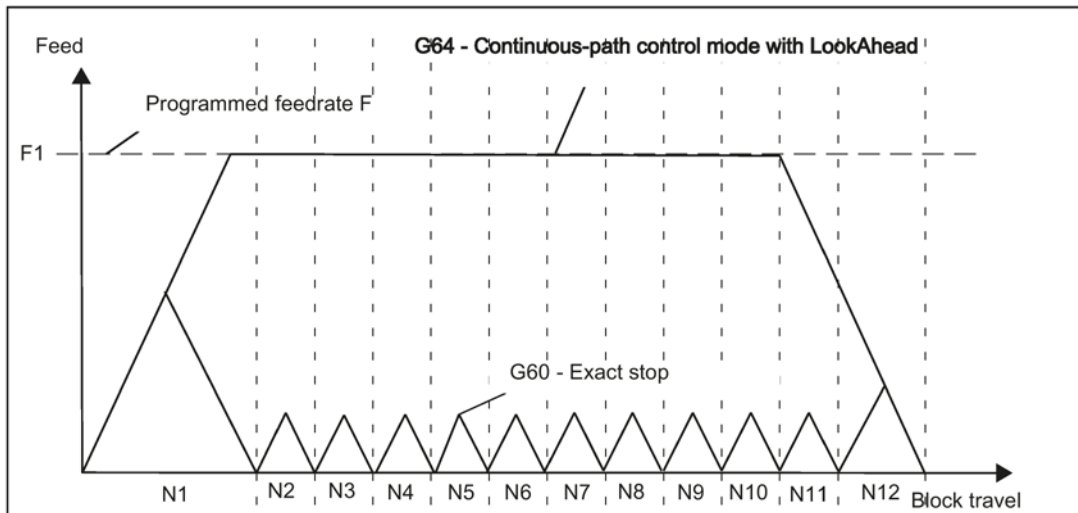

11.7.3 Dwell time: G4

Functionality

Between two NC blocks, you can interrupt the machining for a defined time by inserting a **separate block** with G4; e.g. for relief cutting.

The words with F... or S... are only used in this block for the specified time. Any previously programmed feedrate F or a spindle speed S remain valid.

Programming

```
G4 F... ; Dwell time in seconds
G4 S... ; Dwell time in spindle revolutions
```

Programming example

```
N5 G1 F200 Z-50 S300 M3 ; Feed F; spindle speed S
N10 G4 F2.5 ; Dwell time 2.5 seconds
N20 Z70
N30 G4 S30 ; Dwelling 30 revolutions of the spindle, corresponds at S=300
; rpm and 100% speed override to: t=0.1 min
N40 X60 ; Feed and spindle speed remain effective
M30
```

Note

G4 S.. is only possible if a controlled spindle is available (if the speed specifications are also programmed via S...).

11.8 Spindle movements

11.8.1 Gear stages

Function

Up to 5 gear stages can be configured for a spindle for speed/torque adaptation. The selection of a gear stage takes place in the program via M commands (see Section "Miscellaneous function M (Page 123)"):

- M40: Automatic gear stage selection
- M41 to M45: Gear stage 1 to 5

11.8.2 Spindle speed S, directions of rotation

Functionality

The spindle speed is programmed in revolutions per minute under the address S provided that the machine possesses a controlled spindle.

The direction of rotation and the start or end of the movement are specified via M commands (also see Section "Miscellaneous function M (Page 123)").

M3: Spindle clockwise

M4: Spindle counter-clockwise

M5: Spindle stop

Note

For integer S values, the decimal point can be omitted, e.g. S270.

Information

If you write M3 or M4 in a **block with axis movements**, the M commands become active **before** the axis movements.

Default setting: The axis movements only start once the spindle has accelerated to speed (M3, M4). M5 is also issued before the axis movement. However, there is no waiting for spindle standstill. The axis movements begin before spindle standstill.

The spindle is stopped at program end or with RESET.

At program start, spindle speed zero (S0) is in effect.

Note

Other settings can be configured via machine data.

Programming example

N10 G1 X70 Z20 F300 S270 M3	; Before the axis traversing X, Z the spindle accelerates to 270 rpm, clockwise
N80 S450	; Speed change
N170 G0 Z180 M5	; Z movement, spindle comes to a stop

11.8.3 Spindle positioning: SPOS

Functionality

Requirement: The spindle must be technically designed for position control.

With the function SPOS= you can position the spindle in a specific **angular position**. The spindle is held in the position through position control.

The **speed** of the positioning procedure is defined in machine data.

With SPOS=*value* from the M3/M4 movement, the respective **direction of rotation** is maintained until the end of the positioning. When positioning from standstill, the position is approached via the shortest path. The direction results from the respective start and end position.

Exception: First movement of the spindle, i.e. if the measuring system is not yet synchronized. In this case, the direction is specified in machine data.

Other movement specifications for the spindle are possible with SPOS=ACP(...), SPOS=ACN(...), ... as for rotary axes.

The spindle movement takes place parallel to any other axis movements in the same block. This block is ended when both movements are finished.

Programming

SPOS=...	; Absolute position: 0 ... <360 degrees
SPOS=ACP(...)	; Absolute dimensions, approach position in positive direction
SPOS=ACN(...)	; Absolute dimensions, approach position in negative direction
SPOS=IC(...)	; Incremental dimensions, leading sign determines the traversal direction
SPOS=DC(...)	; Absolute dimensions, approach position directly (on the shortest path)

Programming example

N10 SPOS=14.3	; Spindle position 14.3 degrees
N80 G0 X89 Z300 SPOS=25.6	; Positioning spindle with axis movements
	; This block is ended when all movements have finished
N81 X200 Z300	; The N81 block only begins once the spindle position from N80 is reached

11.9 Contour programming support

11.9.1 Contour definition programming

Functionality

If the end points for the contour are not directly specified in the machining drawing, it is also possible to use an angle specification ANG=... to determine the straight line. In a contour corner, you can insert the elements chamfer or rounding. The respective instruction CHR= ... or RND=... is written in the block, which leads to the corner.

The blueprint programming can be used in blocks with **G0** or **G1** (linear contours).

Theoretically, any number of straight line blocks can be connected and a rounding or a chamfer can be inserted between them. Every straight line must be clearly identified by point values and/or angle values.

Programming

ANG=...	; Angle specification for defining a straight line
RND=...	; Insert rounding, value: Radius of chamfer
CHR=...	; Insert chamfer, value: Side length of the chamfer

Information

The blueprint programming function is executed in the current plane G17 to G19. It is not possible to change the plane during blueprint programming.

If radius and chamfer are programmed in one block, only the radius is inserted regardless of the programming sequence.

Angle ANG

If only one end point coordinate of the plane is known for a straight line or for contours across multiple blocks the cumulative end point, an angle parameter can be used for uniquely defining the straight line path. The angle is always referred to the abscissa of the current plane G17 to G19, e.g. for G17 on the X axis. Positive angles are aligned counter-clockwise.

See the following specification of an angle for determination of a straight line using the example of the G17 plane:

Contour	Programming
	End point in N20 not always known <pre> N10 G1 X1 Y1 N20 X2 ANG=... or: N10 G1 X1 Y1 N20 Y2 ANG=... </pre> The values are only examples.

See the following illustration for multiple block contours using the example of the G17 plane:

Contour	Programming
	End point in N20 unknown <pre> N10 G1 X1 Y1 N20 ANG=30 N30 X3 Y3 ANG=60 N40 M30 </pre>
	End point in N20 unknown, insert rounding: <pre> N10 G1 X1 Y1 N20 ANG=30 RND=0.1 N30 X3 Y3 ANG=60 N40 M30 </pre> analog Inserting a chamfer: <pre> N10 G1 X1 Y1 N20 ANG=30 CHR=0.1 N30 X3 Y3 ANG=60 </pre>
	End point in N20 known Inserting a rounding: <pre> N10 G1 X1 Y1 N20 X2 Y2 RND=0.5 N30 X3 Y3 </pre> analog Inserting a chamfer: <pre> N10 G1 X1 Y1 N20 X2 Y2 CHR=0.2 N30 X3 Y3 </pre>
	End point in N20 unknown Inserting a rounding: <pre> N10 G1 X1 Y1 N20 ANG=30 RND=0.3 N30 X3 Y3 ANG=60 RND=0.3 N40 X4 Y4 </pre> analog Inserting a chamfer: <pre> N10 G1 X1 Y1 N20 ANG=30 CHR=0.3 N30 X3 Y3 ANG=60 CHR=0.3 N40 X2 Y4 N50 M30 </pre>

11.9.2 Rounding, chamfer

Functionality

You can insert the chamfer (CHF or CHR) or rounding (RND) elements into a contour corner. If you wish to round several contour corners sequentially by the same method, use "Modal rounding" (RNDM).

You can program the feedrate for the chamfer/rounding with FRC (non-modal) or FRCM (modal). If FRC/FRCM is not programmed, the normal feedrate F is applied.

Programming

CHF=... ; Insert chamfer, value: Length of chamfer
CHR=... ; Insert chamfer, value: Side length of the chamfer
RND=... ; Insert rounding, value: Radius of chamfer
RNDM=... ; Modal rounding:
Value >0: Radius of chamfer, modal rounding ON
This rounding is inserted in all contour corners.
Value = 0: Modal rounding OFF...
FRC=... ; Non-modal feedrate for chamfer/rounding
Value >0, feedrate in mm/min (G94) or mm/rev. (G95)
FRCM=... ; Modal feedrate for chamfer/rounding:
Value >0: Feedrate in mm/min (G94) or mm/rev. (G95),
Modal feedrate for chamfer/rounding ON
Value = 0: Modal feedrate for chamfer/rounding OFF
Feedrate F applies to the chamfer/rounding.

Information

The chamfer/rounding functions are executed in the current planes G17 to G19.

The appropriate instruction CHF= ... or CHR=... or RND=... or RNDM=... is written in the block with axis movements leading to the corner.

The programmed value for chamfer and rounding is automatically reduced if the contour length of an involved block is insufficient.


No chamfer/rounding is inserted, if more than three blocks in the connection are programmed that do not contain any information for traversing in the plane or a plane change is carried out.

F, FRC, FRCM are not active when a chamfer is traversed with G0.


If the feedrate F is active for chamfer/rounding, it is by default the value from the block which leads away from the corner. Other settings can be configured via machine data.

Chamfer CHF or CHR

A linear contour element is inserted between **linear and circle contours** in any combination. The edge is broken. See the following illustration for inserting a chamfer with CHF using the example: Between two straight lines.

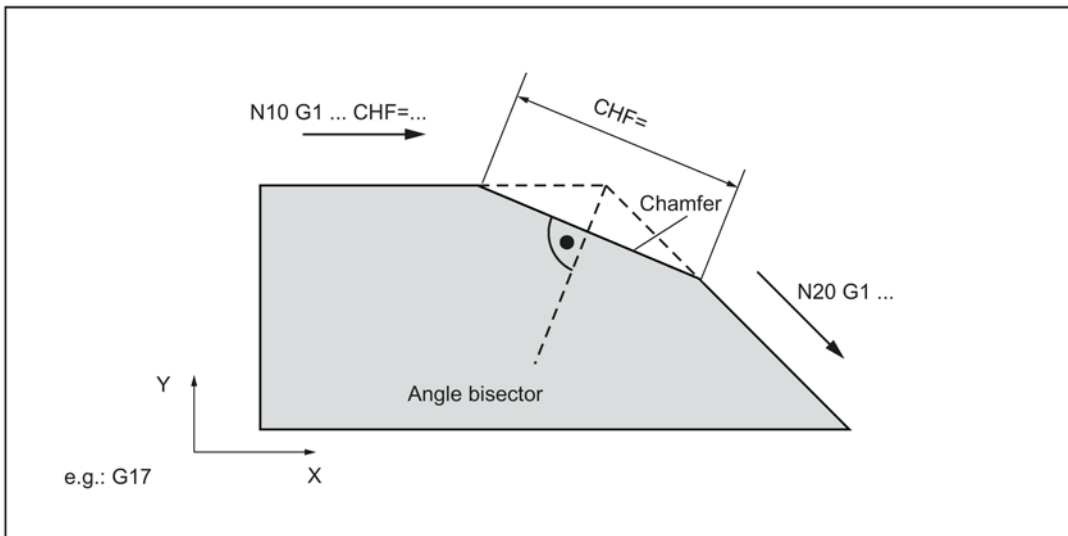

See the following illustration for inserting a chamfer with CHR using the example: Between two straight lines.

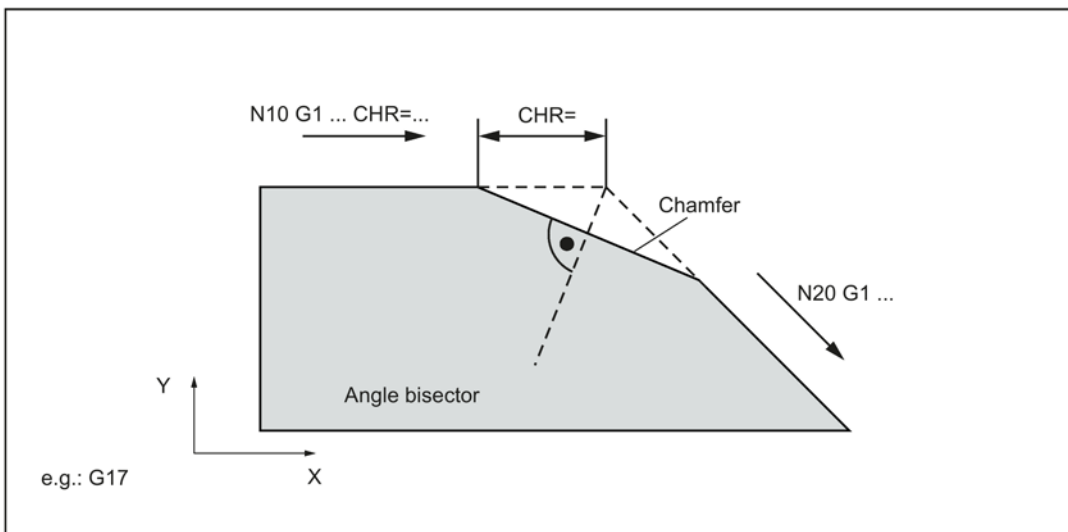


Programming examples of chamfer

N5 G17 G94 F300 G0 X100 Y100	
N10 G1 X85 CHF=5	; Insert chamfer with chamfer length of 5 mm
N20 X70 Y70	
N30 G0 X60 Y60	
N100 G1 X50 CHR=7	; Insert chamfer with leg length of 7 mm
N110 X40 Y40	
N200 G1 FRC=200 X30 CHR=4	; Insert chamfer with feedrate FRC
N210 X20 Y20	
M30	

Rounding RND or RNDM

A circle contour element can be inserted with tangential connection between the **linear and circle contours** in any combination.

See the following examples for inserting roundings:

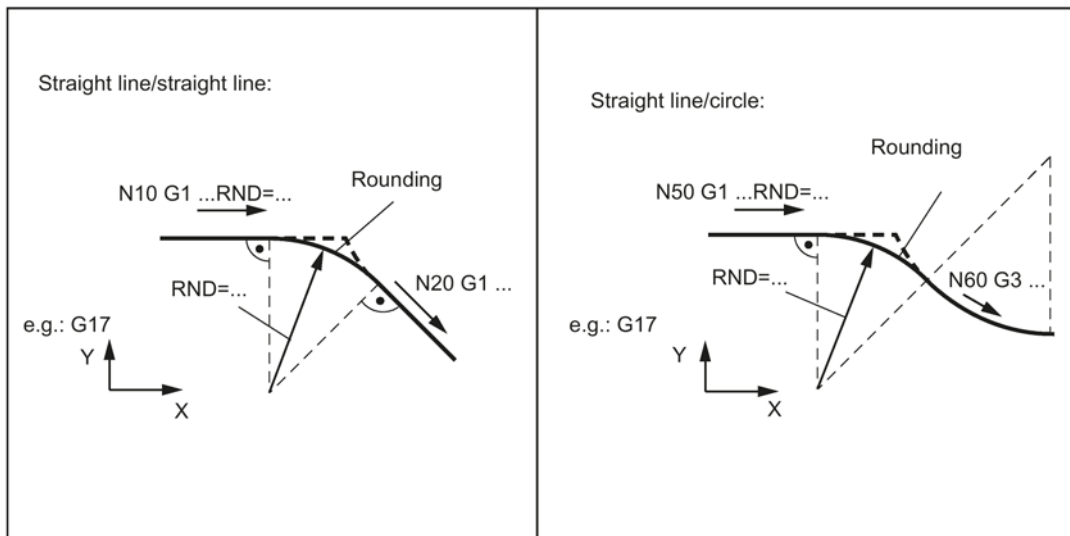

Programming examples for rounding

```
N10 G17 G94 F300 G0 X100 Y100
N20 G1 X85 RND=8
N30 X70 Y70
N40 G0 X60 Y60
N50 G1 X50 FRCM= 200 RNDM=7.3
N60 G3 X40 Y40 CR=20
N70 G1 X30 Y30 RNDM=0
N80 X20 Y20
N90 M30
```

; Insert 1 rounding with radius 8 mm, feedrate F

; Modal rounding, radius 7.3 mm with special feedrate FRCM (modal)
; continue inserting this rounding - to N70
; Modal rounding OFF

11.10 Tool and tool offset

11.10.1 General Information


Functionality

When creating programs for machining workpieces, it is not necessary to take into account the tool length or the tool radius. You program the workpiece dimensions directly, for example following the drawing.


You enter the tool data separately in a special data section.

Simply call the required tool with its offset data in the program and enable the tool radius compensation if necessary. The control system performs the required path compensations based on the data to create the described workpiece.

See the following illustration for machining of a workpiece with different tool radius:

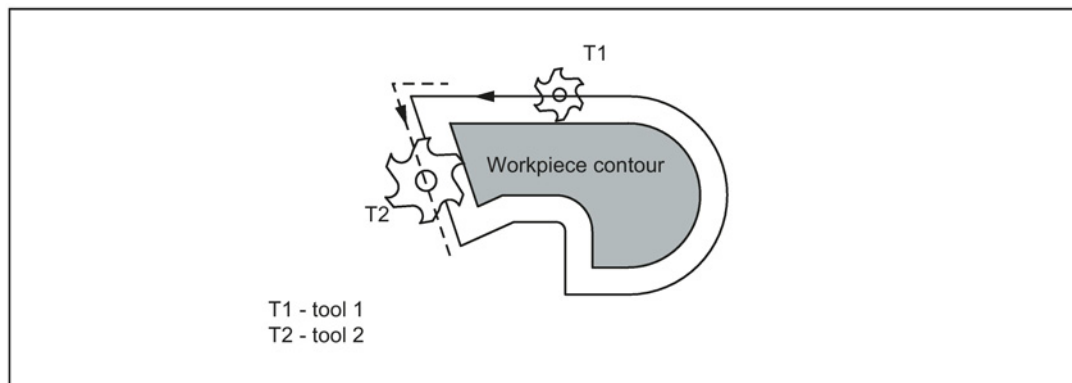

See the following illustration for approaching the workpiece position Z0 - different length compensations:

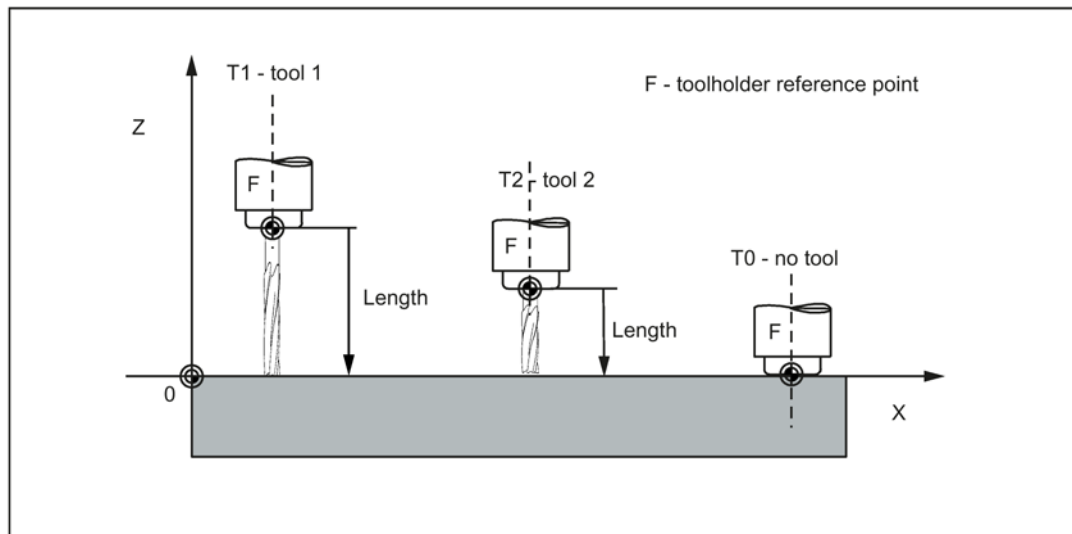

11.10.2 Tool T

Functionality

The tool selection takes place when the T word is programmed. Whether this is a **tool change** or only a **preselection**, is defined in the machine data:

- The tool change (tool call) is performed either directly using the T word or
- The change takes place after the preselection with the T word by an additional instruction **M6** (see also Section "Miscellaneous function M (Page 123)").

Note

If a certain tool is activated, it remains stored as an active tool even beyond the end of the program and after turning off/turning on the control system.

If you change a tool manually, input the change in the control system so that the control system knows the correct tool. For example, you can start a block with the new T word in MDA mode.

Programming

T... ; Tool number: 1 ... 32 000, T0 - no tool

The control system can store a maximum of 64 tools.

Programming example

```
; Tool change without M6:
N10 T1 ; Tool 1
N70 T588 ; Tool 588
; Tool change with M6:
N10 T14 ; Preselect tool 14
N15 M6 ; Perform tool change; thereafter, T14 is active
```

11.10.3 Tool compensation number D

Functionality

It is possible to assign 1 to 9 data fields with different tool offset blocks (for multiple cutting edges) to a specific tool. If a special cutting tool is required, it can be programmed with D and the corresponding number.

If no D word is written, D1 takes effect **automatically**.


When **D0** is programmed, offsets for the tool have no **effect**.

Programming

D... ; Tool offset number: 1 ... 9,
D0: No compensations active!

A maximum of 64 data fields (D numbers) for tool offset blocks can be stored in the control system simultaneously:

See the following illustration for examples for assigning tool compensation numbers/tool:

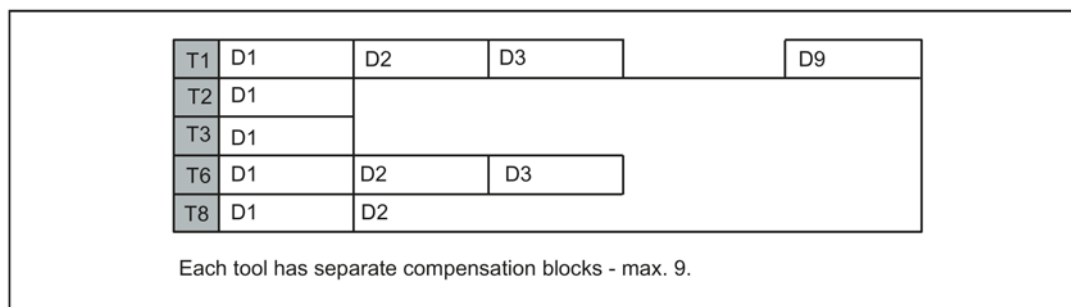

Information

The **tool length compensations** are effective **immediately** once the tool is active - if no D number has been programmed - with the values of D1.

The offset is applied with the first programmed traverse of the respective length offset axis. Observe any active G17 to G19.

A **tool radius compensation** must also be activated by G41/G42.

Programming example

Tool change **without M6 command** (only with T):

```
N5 G17                ; Determines the length offset axis (here Z axis)
N10 T1                ; Tool 1 is activated with the associated D1
N11 G0 Z...           ; For G17, Z is length offset axis, the length offset compensation is
                        ; overlaid here
N50 T4 D2             ; Load tool 4, D2 from T4 is active
...
N70 G0 Z... D1        ; D1 for tool 4 active, only cutting edge changed
```

Tool change using the M6 command:

```
N5 G17                ; Determines the length offset axis (here Z axis)
N10 T1                ; Tool preselection
...
N15 M6                ; Tool change, T1 is active with the appropriate D1
N16 G0 Z...           ; For G17, Z is length offset axis, the length offset compensation is
                        ; overlaid here
...
N20 G0 Z... D2        ; D2 for tool 1 is active; for G17, Z is length offset axis, the differ-
                        ; ence of the D1->D2 length offset is overlaid here
N50 T4                ; T4 tool preselection; note: T1 with D2 is still active !
...
N55 D3 M6             ; Tool change, T4 is active with the appropriate D3
...
```

Contents of a compensation memory


Enter the following in the offset memory:

- Geometrical dimensions: length, radius.
They consist of several components (geometry, wear). The control system computes the components to a certain dimension (e.g. overall length 1, total radius). The respective overall dimension becomes effective when the compensation memory is activated.
How these values are calculated in the axes is determined by the tool type and the commands G17, G18, G19 (see following illustrations).
- Tool type
The tool type (drill, cutter) defines which geometry data are necessary and how they are taken into account.


Tool special cases

For the tool types 'cutter' and 'drill', the parameters for length 2 and length 3 are only required for special cases (e.g. multi-dimensional length offset for an angle head construction).


See the following illustration for effect of the tool length compensation - 3D (special case):

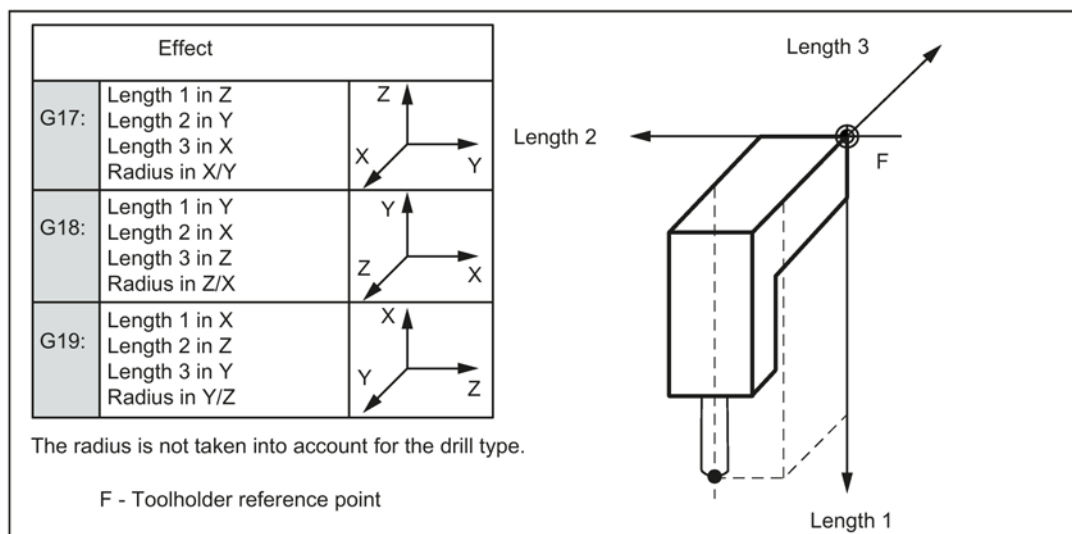

See the following illustration for effect of the offsets with the tool type 'drill':

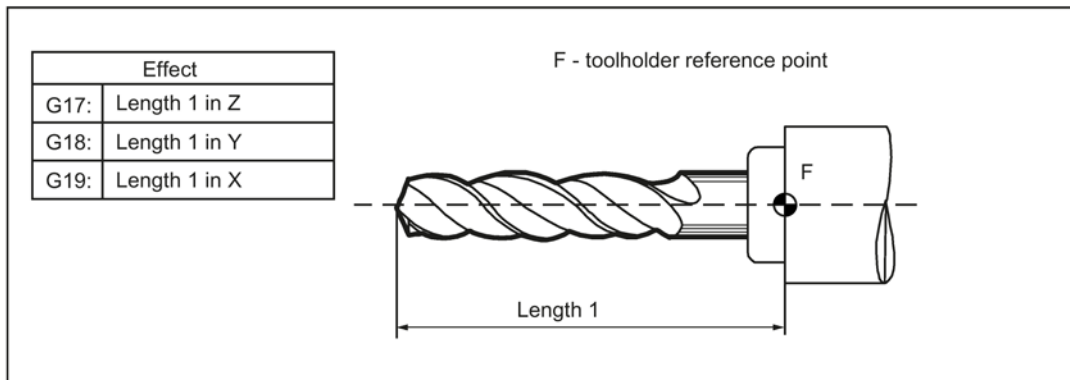

See the following illustration for effect of the offsets with the tool type 'cutter':

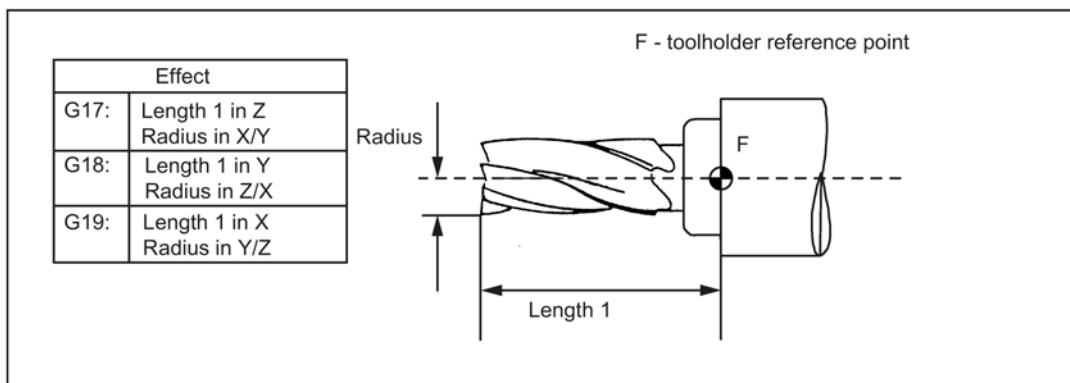


11.10.4 Selecting the tool radius compensation: G41, G42

Functionality

The control system is working with tool radius compensation in the selected plane G17 to G19.

A tool with a corresponding D number must be active. The tool radius compensation is activated by G41/G42. The control system automatically calculates the required equidistant tool paths for the programmed contour for the respective current tool radius.

See the following illustration for tool radius compensation:

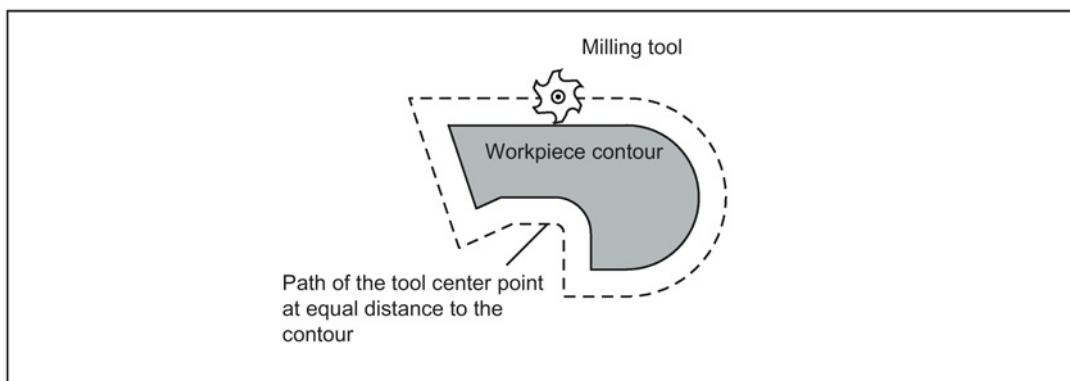

Programming


G41 X... Y... ; Tool radius compensation left of contour
G42 X... Y... ; Tool radius compensation right of contour

Note

The selection can only be made for linear interpolation (G0, G1).

Program both axes of the plane (e.g. with G17: X, Y). If you only specify one axis, the second axis is automatically completed with the last programmed value.

See the following illustration for compensation to the right/left of the contour:

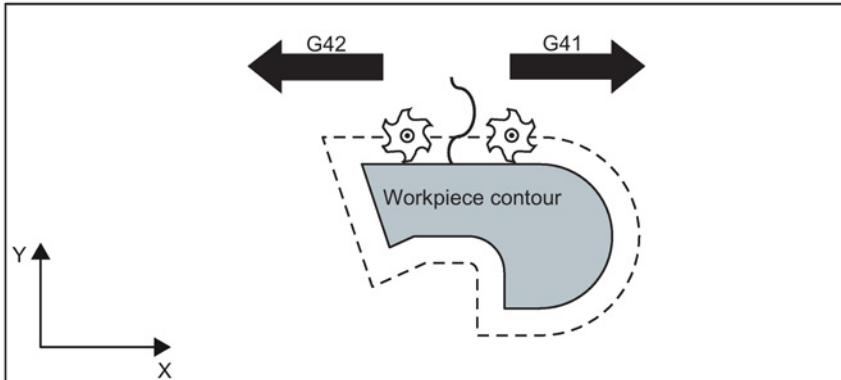


Starting the compensation

The tool travels in a straight line directly to the contour and is positioned perpendicular to the path tangent at the starting point of the contour.

Select the starting point such that a collision-free travel is ensured.

See the following illustration for start of the tool radius compensation with G42 as example:

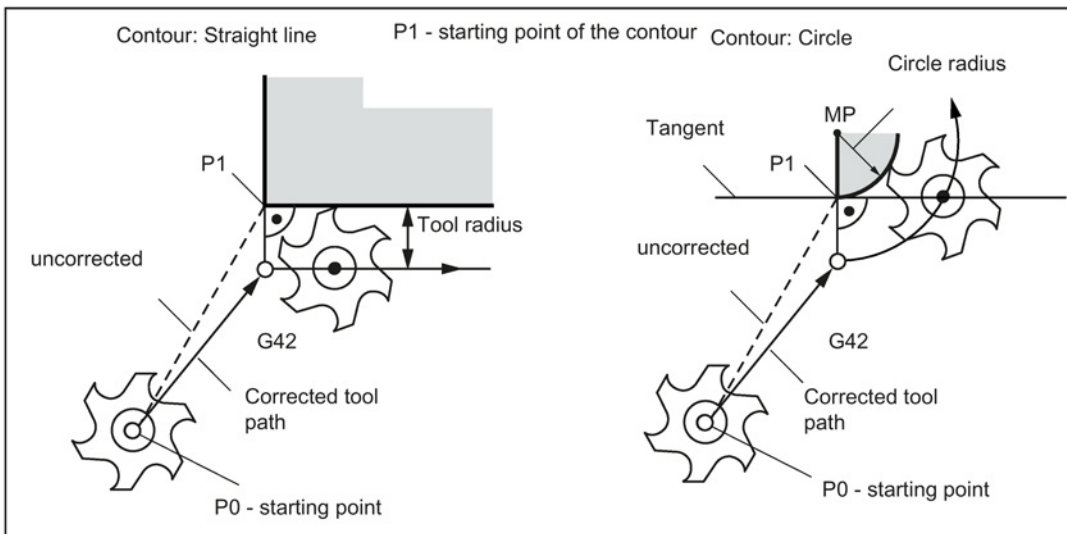

The tool tip goes around the left of the workpiece when the tool runs clockwise using G41; the tool tip goes around the right of the workpiece when the tool runs counter-clockwise using G42.

Information

As a rule, the block with G41/G42 is followed by a block with workpiece contour description. If, however, the block with G41/G42 is followed by blocks without contour description, a maximum of five such blocks (for example, M commands and infeed motions) are allowed; otherwise, the compensation will be interrupted.

Programming example

```
N10 T1
N20 G17 D2 F300           ; Correction number 2, feed 300 mm/min
N30 X0 Y0                 ; P0 - starting point
N40 G1 G42 X11 Y11        ; Selection to the right of contour, P1
N50 X20 Y20               ; Starting contour, circle or straight line
N60 M30                   ; End of program
```

After the selection, it is also possible to execute blocks that contain infeed motions or M outputs:

```
N10 T1
N20 G17 D2 F300           ; Correction number 2, feed 300 mm/min
N30 G0 X0 Y0              ; P0 - starting point
N40 G1 G42 X11 Y11        ; Selecting right of contour, P1
N50 Z20                   ; Infeed movement
N60 M08                   ; M command coolant on
N70 X20 Y20               ; Starting contour, circle or straight line
N80 M30                   ; End of program
```

11.10.5 Corner behavior: G450, G451

Functionality


By using the functions G450 and G451, you can set the behavior for a non-continuous transition from one contour element to another contour element (corner behavior) when G41/G42 is active.

The internal and external corners are detected by the control system itself. For internal corners, the intersection of the equidistant paths is always approached.


Programming

```
G450           ; Transition circle
G451           ; Point of intersection
```

See the following illustration for corner behavior at an external corner:

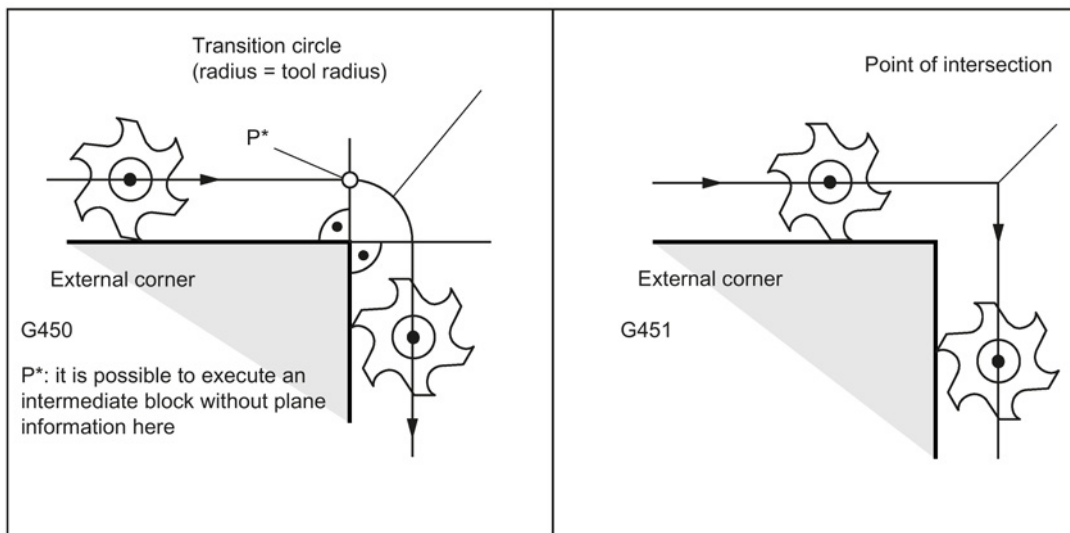

See the following illustration for corner behavior at an internal corner:

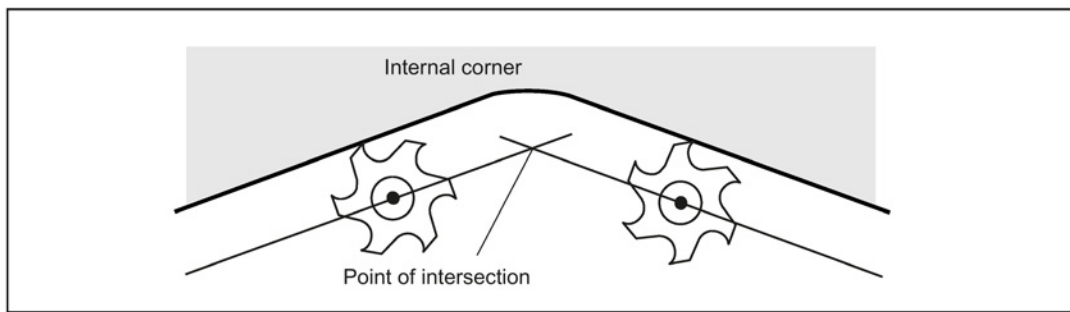

Transition circle G450

The tool center point travels around the workpiece external corner in an arc with the tool radius.

In view of the data, for example, as far as the feedrate value is concerned, the transition circle belongs to the next block containing traversing movements.


Point of intersection G451

For a G451 intersection of the equidistant paths, the point (intersection) that results from the center point paths of the tool (circle or straight line) is approached.

With acute contour angles and active point of intersection, depending on the tool radius, unnecessary idle motions could result for the tool.

In this case, the control system switches to transition circle for this block automatically if a certain set angle value (100°) is reached.

See the following illustration for acute contour angle and switching to transition circle:

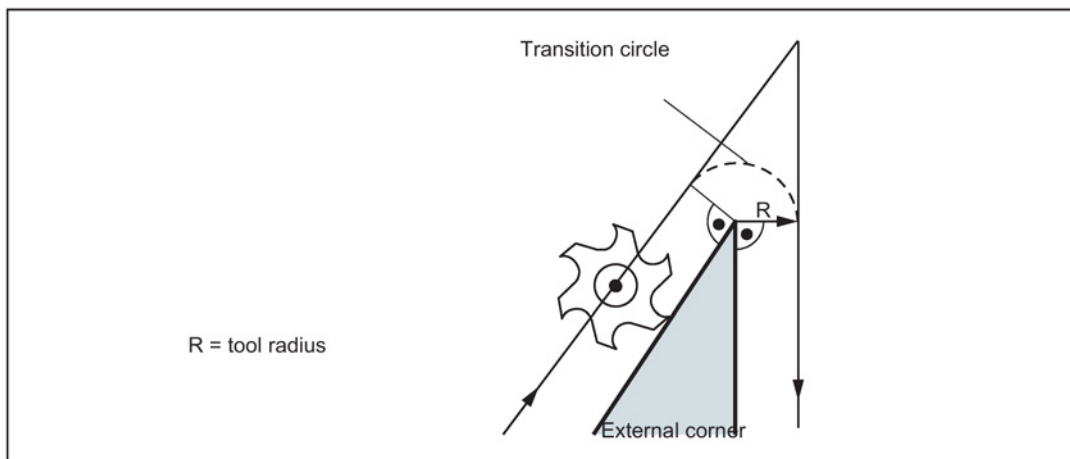

11.10.6 Tool radius compensation OFF: G40

Functionality

The compensation mode (G41/G42) is deselected with G40. G40 is also the activation position at the beginning of the program.

The tool ends the **block in front of G40** in the normal position (compensation vector vertically to the tangent at the end point);

If G40 is active, the reference point is the tool center point. Subsequently, when deselected, the tool tip approaches the programmed point.

Always select the end point of the G40 block such that collision-free traversing is guaranteed!

Programming


G40 X... Y... ; Tool radius compensation OFF

Note

The compensation mode can only be deselected with linear interpolation (G0, G1).

Program both axes of the plane (e.g. with G17: X, Y). If you only specify one axis, the second axis is automatically completed with the last programmed value.

See the following illustration for quitting the tool radius compensation:

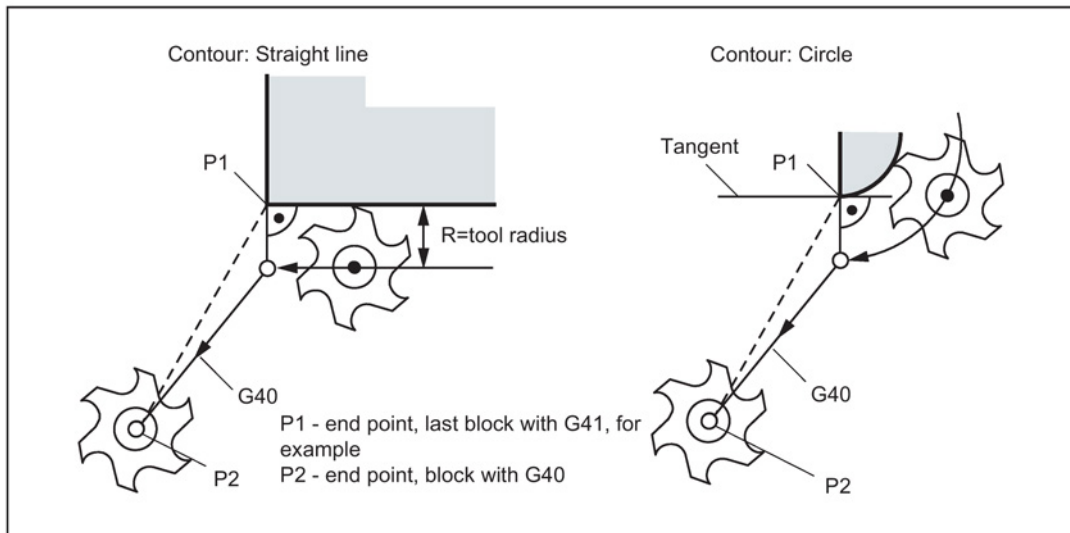

Programming example

```
N10 G0 X20 Y20 T1 D1 M3 S500
N20 G41 G1 X10 Y10 F100
N30 G2 X20 Y20 CR=20 ; Last block on the contour, circle or straight line, P1
N40 G40 G1 X10 Y10 ; Switch off tool radius compensation, P2
N50 M30
```

11.10.7 Special cases of the tool radius compensation

Repetition of the compensation

The same compensation (e.g. G41 -> G41) can be programmed once more without writing G40 between these commands.

The last block in front of the new compensation call ends with the normal position of the compensation vector at the end point. The new compensation is carried out as a compensation start (behavior as described for change in compensation direction).


Changing the offset number

The offset number D can be changed in the compensation mode. A modified tool radius is active with effect from the block in which the new D number is programmed. Its complete modification is only achieved at the end of the block. In other words: The modification is traversed continuously over the entire block, also for circular interpolation.

Change of the compensation direction

The compensation direction G41 <-> G42 can be changed without writing G40.

The last block with the old compensation direction ends with the normal position of the compensation vector at the end point. The new compensation direction is executed as a compensation start (default setting at starting point).

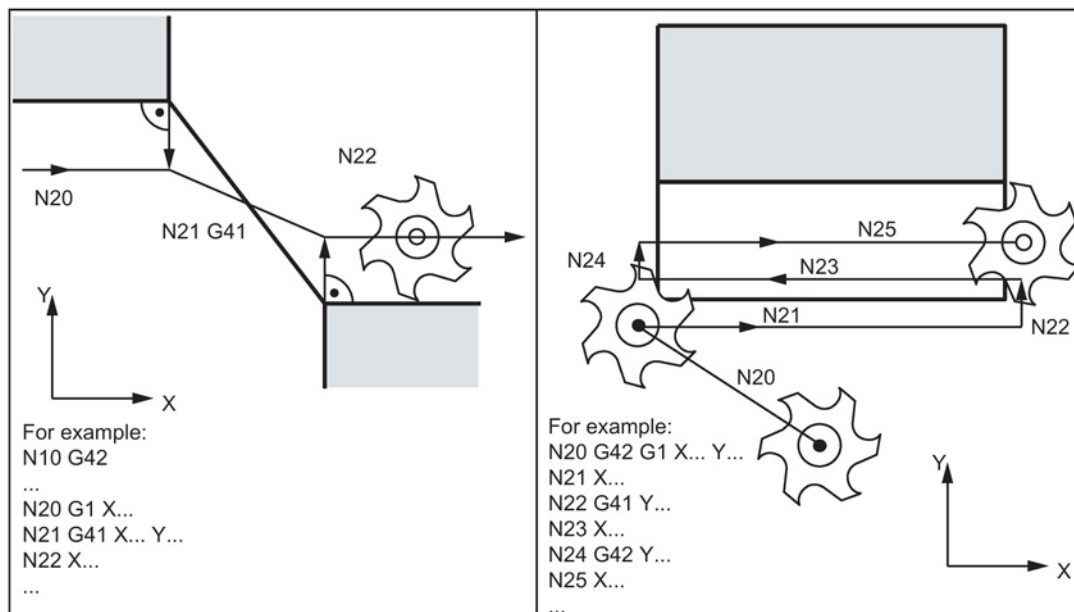

Cancellation of compensation by M2

If compensation mode is canceled using M2 (end of program) without writing the command G40, the last block with coordinates of the plane (G17 to G19) will end in the normal position of the compensation vector. **No** compensating movement is executed. The program ends with this tool position.

Critical machining cases

When programming, pay special attention to cases where the contour travel is smaller than the tool radius;

Such cases should be avoided.

Also check over multiple blocks that the contour contains no "bottlenecks".


When carrying out a test/dry run, use the largest tool radius you are offered.

Acute contour angles

If very sharp outside corners occur in the contour with active G451 intersection, the control system automatically switches to transition circle. This prevents long idle motions.

11.10.8 Example of tool radius compensation

See the following illustration for example of tool radius compensation:

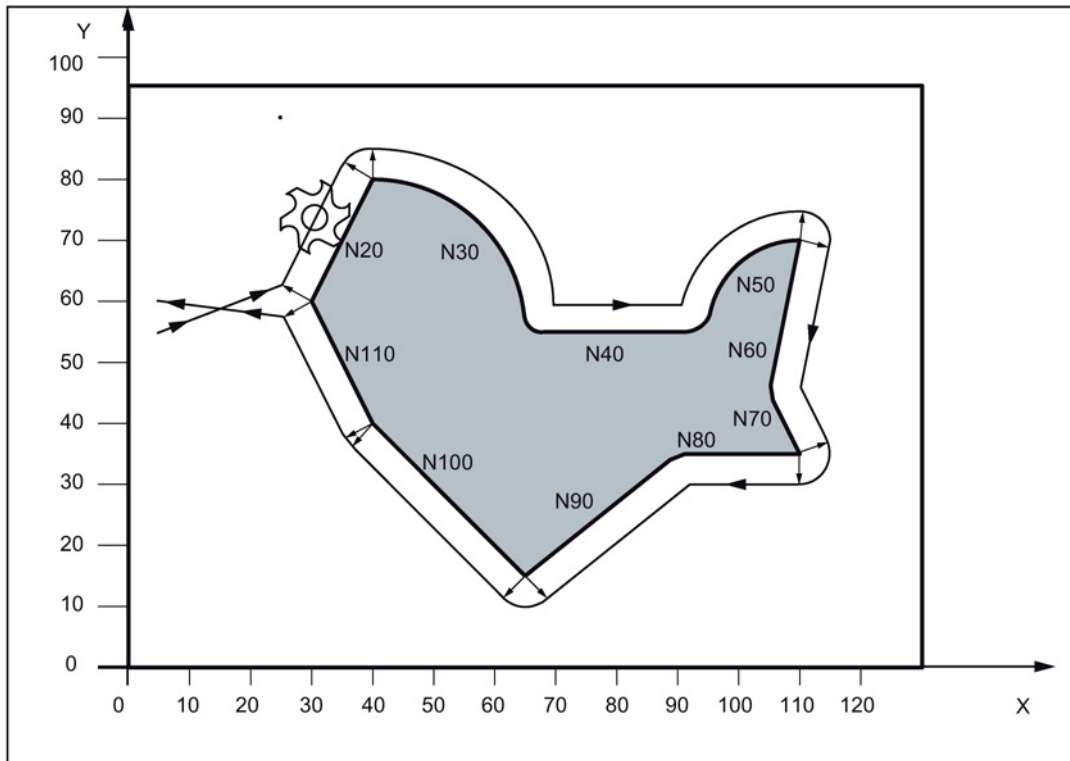

Programming example

```
N1 T1 ; Tool 1 with offset D1
N5 G0 G17 G90 X5 Y55 Z50 ; Approach starting point
N6 G1 Z0 F200 S80 M3
N10 G41 G450 X30 Y60 F400 ; Compensation to the left of the contour, transition circle
N20 X40 Y80
N30 G2 X65 Y55 I0 J-25
N40 G1 X95
N50 G2 X110 Y70 I15 J0
N60 G1 X105 Y45
N70 X110 Y35
N80 X90
N90 X65 Y15
N100 X40 Y40
N110 X30 Y60
N120 G40 X5 Y60 ; Terminate compensation mode
N130 G0 Z50 M2
```

11.11 Miscellaneous function M

Functionality

The miscellaneous function M initiates switching operations, such as "Coolant ON/OFF" and other functions.

A small part of M functions have already been assigned a fixed functionality by the CNC manufacturer. The functions not yet assigned fixed functions are reserved for free use of the machine manufacturer.

Note

An overview of the M miscellaneous functions used and reserved in the control system can be found in Section "List of instructions (Page 333)".

Programming

M... ;Max. 5 M functions per block

Effect

Activation in blocks with axis movements:

If the functions **M0, M1, M2** are contained in a block with traversing movements of the axes, these M functions become effective **after the traversing movements**.

The functions M3, M4 and M5 are output to the internal interface (PLC) before the traversing movements. The axis movements only begin once the controlled spindle has ramped up for M3, M4. For M5, however, the spindle standstill is not waited for. The axis movements already begin before the spindle stops (default setting).

The remaining M functions are output to the PLC with the traversing movements.

If you would like to program an M function directly before or after an axis movement, insert a separate block with this M function.

Note

The M function interrupts the G64 continuous path mode and generates exact stop:

Programming example

```
N10 S1000
N20 X10 M3 G1 F100           ;M function in the block with axis movement, spindle acceler-
                              ;ates before the X axis movement
N30 M78 M67 M10 M12 M37     ;Max. 5 M functions in the block
M30
```

Note

In addition to the M and H functions, T, D and S functions can also be transferred to PLC (Programmable Logic Controller). In all, a maximum of 10 such function outputs are possible in a block.

11.12 H function

Functionality

With H functions, floating point data (REAL data type - as with arithmetic parameters, see Section "Arithmetic parameter R (Page 125)") can be transferred from the program to the PLC.

The meaning of the values for a given H function is defined by the machine manufacturer.

Programming

H0=... to H9999=... ;Max. 3 H functions per block

Programming example

```
N10 H1=1.987 H2=978.123 H3=4   ;3 H functions in block
N20 G0 X71.3 H99=-8978.234     ;With axis movements in block
N30 H5                         ;Corresponds to H0=5.0
```

Note

In addition to the M and H functions, T, D and S functions can also be transferred to the PLC (Programmable Logic Controller). In all, a maximum of 10 function outputs of this type are possible in a part program block.

11.13 Arithmetic parameters, LUD and PLC variables

11.13.1 Arithmetic parameter R

Functionality

The arithmetic parameters are used if an NC program is not only to be valid for values assigned once, or if you must calculate values. The required values can be calculated or set by the control system during program execution.

Another possibility consists of setting the arithmetic parameter values by operator inputs. If values have been assigned to the arithmetic parameters, they can be assigned to other variable-setting NC addresses in the program.

Programming

R0=... to R499=... ;Assign values to the arithmetic parameters
R[R0]=... ;Indirect programming: Assign a value to the arithmetic parameter R, whose number can be found, e.g. in R0
X=R0 ;Assign arithmetic parameters to the NC addresses, e.g. for the X axis

Note

On the control system with PPU15x.3, the quantity of R parameters is 300, namely R0 to R299; on the control system with PPU16x.3, the quantity of R parameters is 500, namely R0 to R499.

Value assignments

You can assign values in the following range to the R parameters:

±(0.000 0001 ... 9999 9999)
(8 decimal places, arithmetic sign, and decimal point)

The decimal point can be omitted for integer values. A plus sign can always be omitted.

Example:

R0=3.5678 R1=-37.3 R2=2 R3=-7 R4=-45678.123

Use the **exponential notation** to assign an extended range of numbers:

± (10⁻³⁰⁰ ... 10⁺³⁰⁰)

The value of the exponent is written after the **EX** characters; maximum total number of characters: 10 (including leading signs and decimal point)

Range of values for EX: -300 to +300

Example:

R0=-0.1EX-5	;Meaning: R0 = -0.000 001
R1=1.874EX8	;Meaning: R1 = 187 400 000

Note

There can be several assignments in one block incl. assignments of arithmetic expressions.

Assignments to other addresses

The flexibility of an NC program lies in assigning these arithmetic parameters or expressions with arithmetic parameters to other NC addresses. Values, arithmetic expressions and arithmetic parameters can be assigned to all addresses; **Exception: addresses N, G, and L.**

When assigning, write the "=" sign after the address character. It is also possible to have an assignment with a minus sign.

A separate block is required for assignments to axis addresses (traversing instructions).

Example:

| N10 G0 X=R2 ;Assignment to X axis

Arithmetic operations/arithmetic functions

When operators/arithmetic functions are used, it is imperative to use the conventional mathematical notation. Machining priorities are set using the round brackets. Otherwise, multiplication and division take precedence over addition and subtraction.

Degrees are used for the trigonometric functions.

Permitted arithmetic functions: see Section "List of instructions (Page 333)"

Programming example: Calculating with R parameters

N10 R1= R1+1	;The new R1 is calculated from the old R1 plus 1
N20 R1=R2+R3 R4=R5-R6 R7=R8*R9 R10=R11/R12	
N30 R13=SIN(25.3)	;R13 equals sine of 25.3 degrees
N40 R14=R1*R2+R3	; Multiplication and division take precedence over addition or subtraction R14=(R1*R2)+R3
N50 R14=R3+R2*R1	;Result, the same as block N40
N60 R15=SQRT(R1*R1+R2*R2)	;Meaning:
N70 R1= -R1	;The new R1 is the negative old R1

Programming example: Assign R parameters to the axes

R1=40 R2=10 R3=-20 R4=-45 R5=-30	
N10 G1 G90 X=R1 Z=R2 F300	;Separate blocks (traversing blocks)
N20 Z=R3	
N30 X=-R4	
N40 Z= SIN(25.3)-R5	;With arithmetic operations
M30	

Programming example: Indirect programming

N10 R1=5	;Assigning R1 directly value 5 (integer)
N20 G0 X R[R1]=27.123	;Indirectly assign R5 the value 27.123
M30	

11.13.2 Local User Data (LUD)

Functionality

The operator/programmer (user) can define his/her own variable in the program from various data types (LUD = Local User Data). These variables are only available in the program in which they were defined. The definition takes place immediately at the start of the program and can also be associated with a value assignment at the same time. Otherwise the starting value is zero.

The name of a variable can be defined by the programmer. The naming is subject to the following rules:

- A maximum of 31 characters can be used.
- It is imperative to use letters for the first two characters; the remaining characters can be either letters, underscore or digits.
- Do not use a name already used in the control system (NC addresses, keywords, names of programs, subroutines, etc.).

Programming/data types

DEF BOOL varname1	;Boolean type, values: TRUE (=1), FALSE (=0)
DEF CHAR varname2	;Char type, 1 ASCII code character: "a", "b", ...
	;Numerical code value: 0 ... 255
DEF INT varname3	;Integer type, integer values, 32 bit value range:
	;-2 147 483 648 through +2 147 483 647 (decimal)
DEF REAL varname4	;Real type, natural number (like arithmetic parameter R),
	;Value range: ±(0.000 0001 ... 9999 9999)
	;(8 decimal places, arithmetic sign and decimal point) or
	;Exponential notation: ± (10 to power of -300 ... 10 to power of +300)
DEF STRING[string length] varname41	; STRING type, [string length]: Maximum number of characters

Each data type requires its own program line. However, several variables of the same type can be defined in one line.

Example:

```
| DEF INT PVAR1, PVAR2, PVAR3=12, PVAR4           ;4 type INT variables
```

Example for STRING type with assignment:

```
| DEF STRING[12] PVAR="Hello"                     ; Define variable PVAR with a maximum of 12 char-
                                                    ;acters and assign string "Hello"
```

Fields

In addition to the individual variables, one or two-dimensional fields of variables of these data types can also be defined:

```
| DEF INT PVAR5[n]                               ;One-dimensional field, type INT, n: integer
| DEF INT PVAR6[n,m]                             ;Two-dimensional field, type INT, n, m: integer
```

Example:

```
| DEF INT PVAR7[3]                               ;Field with 3 elements of the type INT
```

Within the program, the individual field elements can be reached via the field index and can be treated like individual variables. The field index runs from 0 to a small number of the elements.

Example:

```
| N10 PVAR7[2]=24                                ;The third field element (with index 2) is assigned the value
                                                    ;24.
```

Value assignment for field with SET instruction:

```
| N20 PVAR5[2]=SET(1,2,3)                        ;After the 3rd field element, different values are assigned.
```

Value assignment for field with REP instruction:

```
| N20 PVAR7[4]=REP(2)                            ;After field element [4] - all are assigned the same value,
                                                    ;here 2.
```

11.13.3 Reading and writing PLC variables

Functionality

To allow rapid data exchange between NC and PLC, a special data area exists in the PLC user interface with a length of 512 bytes. In this area, PLC data are compatible in data type and position offset. In the NC program, these compatible PLC variables can be read or written.

To this end, special system variables are provided:

```
$A_DBB[n]           ;Data byte (8-bit value)
$A_DBW[n]           ;Data word (16-bit value)
$A_DBD[n]           ;Data double-word (32-bit value)
$A_DBR[n]           ;REAL data (32-bit value)
```

"n" stands here for the position offset (start of data area to start of variable) in bytes

Programming example

```
| R1=$A_DBR[4]           ;Reading a REAL value, offset 4 (starts at byte 4 of range)
```

Note

The reading of variables generates a preprocessing stop (internal STOPRE).

Note

Writing of PLC tags is generally limited to a maximum of three tags (elements).

Where PLC tags are to be written in rapid succession, one element will be required per write operation.

If more write operations are to be executed than there are elements available, then block transfer will be required (a preprocessing stop may need to be triggered).

Example:

```
$A_DBB[1]=1 $A_DBB[2]=2 $A_DBB[3]=3
STOPRE
$A_DBB[4]=4
```

11.14 Program jumps

11.14.1 Unconditional program jumps

Functionality

NC programs process their blocks in the sequence in which they were arranged when they were written.

The processing sequence can be changed by introducing program jumps.

The jump destination can be a block with a **label** or with a **block number**. This block must be located within the program.

The unconditional jump instruction requires a separate block.


Programming

GOTOF label ;Jump forward (in the direction of the last block of the program)

GOTOB label ;Jump backwards (in the direction of the first block of the program)

Label ;Selected string for the label (jump label) or block number

See the following illustration for an example of unconditional jumps:

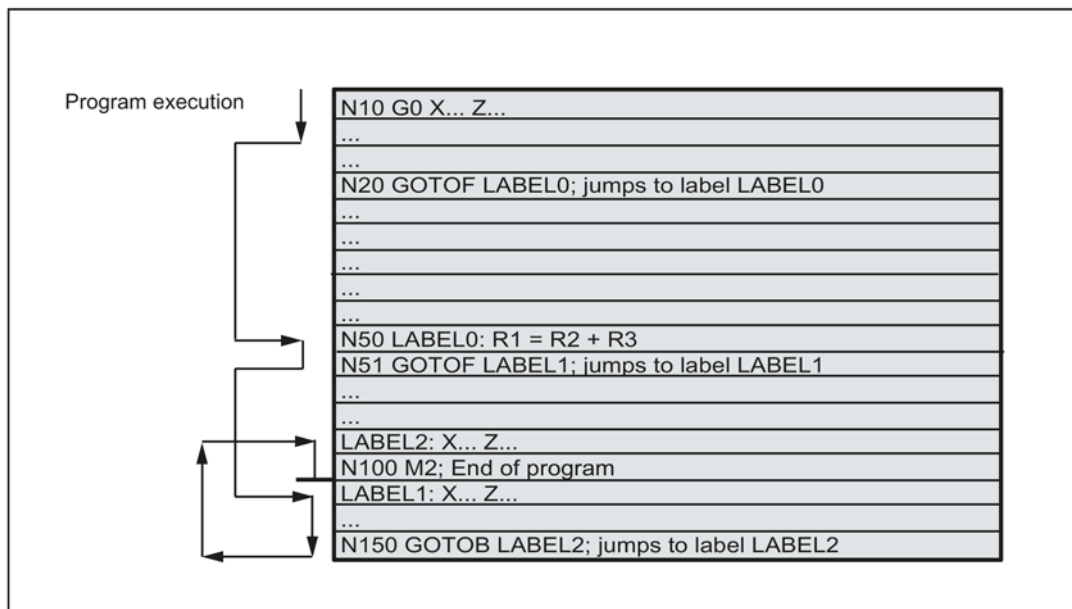

11.14.2 Conditional program jumps

Functionality

Jump conditions are formulated after the **IF instruction**. If the jump condition (**value not zero**) is satisfied, the jump takes place.

The jump destination can be a block with a **label** or with a **block number**. This block must be located within the program.

Conditional jump instructions require a separate block. Several conditional jump instructions can be located in the same block.

By using conditional program jumps, you can also considerably shorten the program, if necessary.

Programming

IF condition GOTOF label	;Jump forward
IF condition GOTOB label	;Jump backwards
GOTOF	;Jump direction forward (in the direction of the last block of the program)
GOTOB	;Jump direction backwards (in the direction of the first block of the program)
Label	;Selected string for the label (jump label) or block number
IF	;Introduction of the jump condition
Condition	;Arithmetic parameter, arithmetic expression for formulating the condition

Comparison operations

Operators	Meaning
= =	Equal to
< >	Not equal to
>	greater than
<	less than
> =	greater than or equal to
< =	less than or equal to

The comparison operations support formulating of a jump condition. Arithmetic expressions can also be compared.

The result of comparison operations is "satisfied" or "not satisfied." "Not satisfied" sets the value to zero.

Programming example for comparison operators

```
R1>1           ;R1 greater than 1
1 < R1         ;1 less than R1
R1<R2+R3       ;R1 less than R2 plus R3
R6>=SIN( R7*R7) ; R6 greater than or equal to SIN (R7) squared
```

Programming example

```
N10 IF R1 GOTOF LABEL1           ;If R1 is not null then go to the block having LABEL1
G0 X30 Y30
N90 LABEL1: G0 X50 Y30
N100 IF R1>1 GOTOF LABEL2        ;If R1 is greater than 1 then go to the block having LABEL2
G0 X40 Y40
N150 LABEL2: G0 X60 Y60
G0 X70 Y70
N800 LABEL3: G0 X80 Y80
G0 X100 Y100
N1000 IF R45==R7+1 GOTOB LABEL3   ;If R45 is equal to R7 plus 1 then go to the block having LABEL3
M30
Several conditional jumps in the block:
N10 MC1: G0 X20 Y20
N15 G0 X0 Y0
N20 IF R1==1 GOTOB MC1 IF R1==2 GOTOF MA2
N30 G0 X10 Y10
N50 MA2: G0 X50 Y50
N60 M30
```

Note

The jump is executed for the first fulfilled condition.

11.14.3 Program example for jumps

Task

Approaching points on a circle segment:

Existing conditions:

Start angle: 30° in R1

Circle radius: 32 mm in R2


Position spacing: 10° in R3

Number of points: 11 in R4

Position of circle center in Z: 50 mm in R5

Position of circle center in X: 20 mm in R6

See the following illustration for linear approach of points on a circle segment:

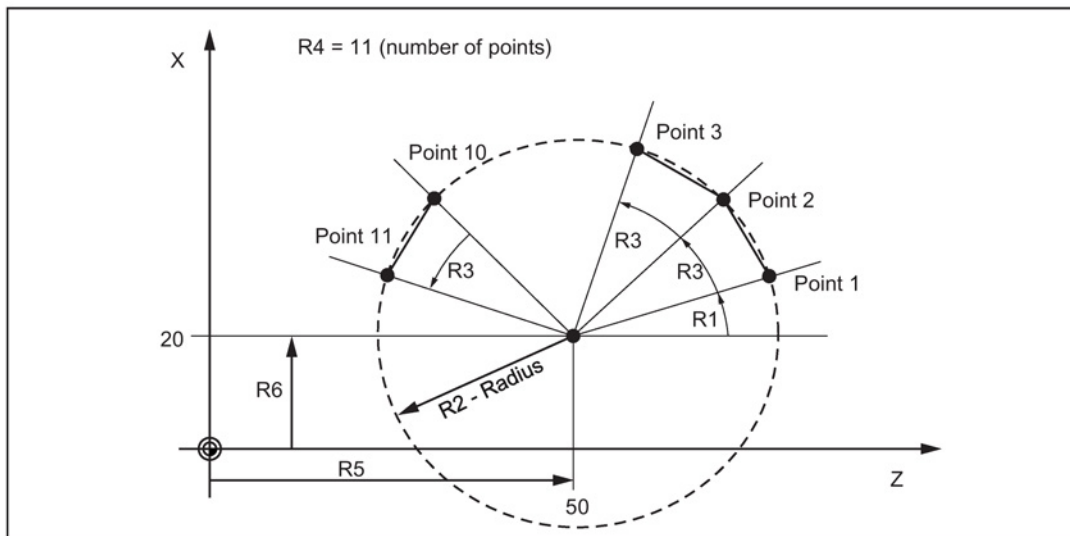

Programming example

```
N10 R1=30 R2=32 R3=10 R4=11 R5=50 R6=20 ;Assignment of initial values
N20 MC1: G0 Z=R2*COS (R1)+R5 X=R2*SIN(R1)+R6 ;Calculation and assignment to axis addresses
N30 R1=R1+R3 R4= R4-1
N40 IF R4 > 0 GOTOB MC1
N50 M2
```

Explanation

In block N10, the starting conditions are assigned to the corresponding arithmetic parameters. The calculation of the coordinates in X and Z and the processing takes place in N20.

In block N30, R1 is incremented by the clearance angle R3, and R4 is decremented by 1.

If $R4 > 0$, N20 is executed again; otherwise, N50 with End of program.

11.14.4 Jump destination for program jumps

Functionality

A **label** or a **block number** serve to mark blocks as jump destinations for program jumps. Program jumps can be used to branch to the program sequence.

Labels can be freely selected, but must contain a minimum of 2 and a maximum of 8 letters or numbers of which the **first two characters must be letters** or underscore characters.

Labels that are in the block that serves as the jump destination are **ended by a colon**. They are always at the start of a block. If a block number is also present, the label is located **after the block number**.

Labels must be unique within a program.

Programming example

N10 LABEL1: G1 X20 F100	;LABEL1 is the label, jump destination
N20 G0 X10 Y10	
TR789: G0 X10 Z20	;TR789 is the label, jump destination
N30 G0 X30 Z30	- No block number existing
N100 G0 X40 Z40	;Block number can be jump target
M30	

11.15 Subroutine technique

11.15.1 General information


Application

Basically, there is no difference between a main program and a subroutine.

Frequently recurring machining sequences are stored in subroutines, e.g. certain contour shapes. These subroutines are called at the appropriate locations in the main program and then executed.

One form of a subroutine is the **machining cycle**. The machining cycles contain generally valid machining cases (e.g. drilling, tapping, groove cutting, etc.). By assigning values via included transfer parameters, you can adapt the subroutine to your specific application.

See the following illustration for example for using a subroutine for a workpiece four times:

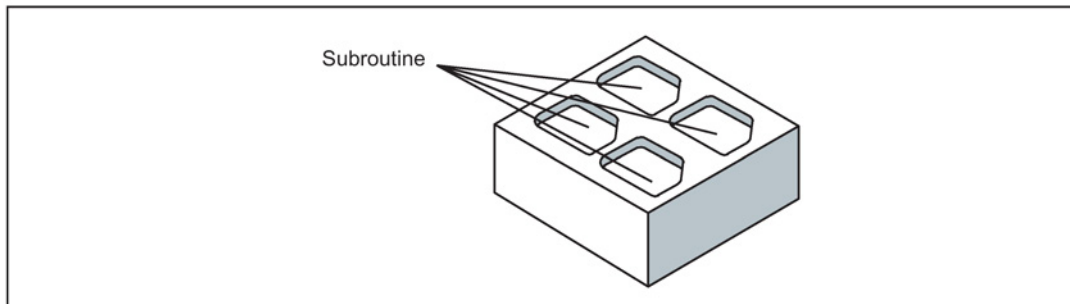

Set-up

The structure of a subroutine is identical to that of a main program (see Section "Program structure (Page 78)"). Like main programs, subroutines contain **M2 - end of program** in the last block of the program sequence. This means a return to the program level where the subroutine was called from.


End of program

The end instruction **RET** can also be used instead of the M2 program end in the subroutine.

RET must be programmed in a separate block.

The RET instruction is used when G64 continuous-path mode is not to be interrupted by a return. With M2, G64 is interrupted and exact stop is initiated.

See the following illustration for example of sequence when calling a subroutine twice:

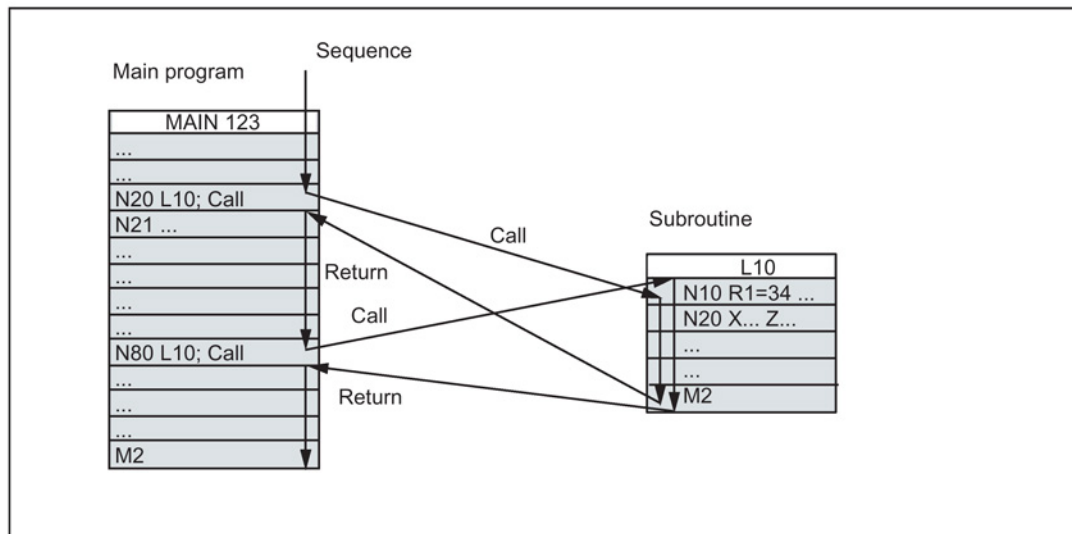

Subroutine name

The program is given a unique name allowing it to be selected from several subroutines. When you create the program, the program name may be freely selected, provided the following conventions are observed.

The same rules apply as for the names of main programs.

Example: **LRAHMEN7**

It is also possible to use the address word **L...** in subroutines. The value can have 7 decimal places (integers only).

Note

With address L, leading zeros are meaningful for differentiation.

Example: **L128** is not **L0128** or **L00128**.

These are three different subroutines.

Note

The subroutine name **LL6** is reserved for tool change.

Subroutine call

Subroutines are called in a program (main or subroutine) with their names. To do this, a separate block is required.

Example:

```

N10 L785                ; Call subroutine L785
N20 LRAHMEN7            ; Call subroutine LRAHMEN7
  
```

Program repetition P...

If a subroutine is to be executed several times in succession, write the number of times it is to be executed in the block of the call after the subroutine name under the **address P**. A maximum of **9,999 cycles** are possible (P1 ... P9999).

Example:


```

N10 L785 P3             ; Call subroutine L785, 3 cycles
  
```

Nesting depth

Subroutines can also be called from a subroutine, not only from a main program. In total, up to **8 program levels** are available for this type of nested call, including the main program level.

See the following illustration for execution with 8 program levels:

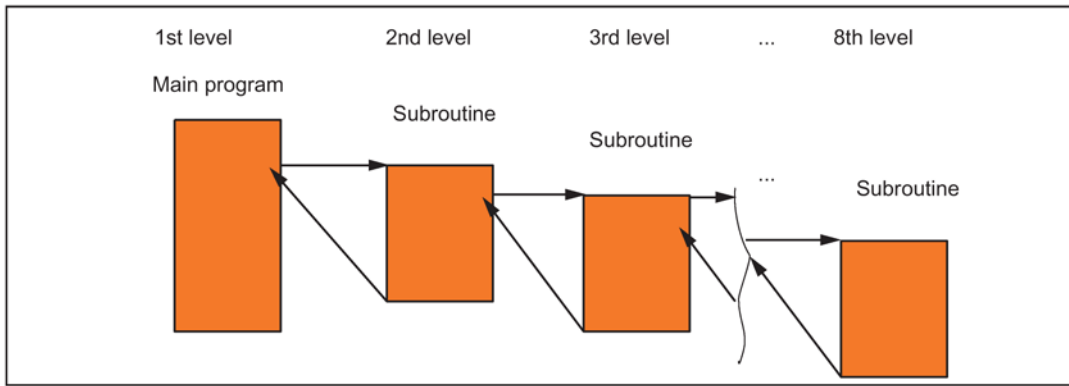

Information

Modal G functions can be changed in the subroutine, e.g. G90 -> G91. When returning to the calling program, ensure that all modal functions are set the way you need them to be.

Please make sure that the values of your arithmetic parameters used in upper program levels are not inadvertently changed in lower program levels.

When working with SIEMENS cycles, up to 4 program levels are needed.

11.15.2 Calling machining cycles

Functionality

Cycles are technology subroutines realizing a certain machining process generally, for example, drilling or milling. Adaptation to the particular problem is performed directly via supply parameters/values when calling the respective cycle.

Programming example

```

N10 DEF REAL RTP, RFP, SDIS, DP, DTB
N20 G18 X100 Z100 G0
N30 M3 S100 F100
N40 G17 X0
N50 CYCLE83(110, 90, 0, -80, 0, -10, 0, 0, 0, 0, 1, 0) ; Call of cycle 83, transfer values directly,
                                                         separate block
N60 G0 X100 Z100
N70 RTP=100 RFP= 95.5 SDIS=1, DP=-5, DTB=3           ; Set transfer parameters for cycle 82
N80 CYCLE82(RTP, RFP, SDIS, DP, , DTB)               ; Call of cycle 82, separate block
N90 M30

```

11.15.3 Modal subroutine call

Functionality

The subroutine in the block containing MCALL is called automatically after each successive block containing a **path motion**. The call acts until the next MCALL is called.

The modal call of the subroutine which contains MCALL or quitting of the call requires a separate block.

MCALL is advantageous, for example, when producing drill patterns.

Programming example

Application example: Drilling a row of holes

```

N10 MCALL CYCLE82(100, 0, 1, -10, 2) ; Drilling cycle 82
N20 HOLES1(1, 2, 45, 2, 2, 1)       ; Cycle for row of holes; after each approach
                                     of the hole position, CYCLE82(...) will be
                                     called with the transfer parameters
N30 MCALL                             ; Modal call of CYCLE82(...) completed
N40 M30

```

11.15.4 Executing internal and external subroutines (CALL, EXTCALL)

Function

- With the CALL command, you can reload and execute programs stored in the NC directory.
- With the EXTCALL command, you can reload and execute programs stored on an external USB memory stick.

Machine data and setting data

The following machine data is used for the EXTCALL command:

- MD18362 \$MN_MM_EXT_PROG_NUM
Number of program levels that can be processed simultaneously from external
- SD42700 \$SC_EXT_PROGRAM_PATH
Program path for external subroutine call

Note

When using SD42700 \$SC_EXT_PROGRAM_PATH, all subprograms called with EXTCALL are searched under this path.

Programming

- CALL "<://NC:/MPF.DIR/program name>"
- EXTCALL
 - Programming with path specification in SD42700 EXT_PROGRAM_PATH
("<program name>")
 - Programming without path specification in SD42700 EXT_PROGRAM_PATH
("<path\program name>")

Parameter

- **For internal subroutines**

CALL	; Keyword for subroutine call
<Path/program name>	; Constant/variable of STRING type
Example: CALL "//NC:/MPF.DIR/Program1.MPF"	

- **For external subroutines**

- Programming with path specification in SD42700 EXT_PROGRAM_PATH

EXTCALL	; Keyword for subroutine call
<program name>	; Constant/variable of STRING type
Example: EXTCALL ("Program2.MPF")	

- Programming without path specification in SD42700 EXT_PROGRAM_PATH

EXTCALL	; Keyword for subroutine call
<Path\program name>	; Constant/variable of STRING type
Example: EXTCALL ("USB:\EXTERNE_UP\Program2.MPF")	

Note

Internal and external subroutines must not contain jump statements such as GOTOF, GOTOB, CASE, FOR, LOOP, WHILE, or REPEAT.

IF-ELSE-ENDIF constructions are possible.

Subroutine calls and nested CALL and EXTCALL calls may be used.

RESET, POWER ON

RESET and POWER ON can cause the interruption of internal and external subroutine calls.

Examples

- **Calling an internal subroutine**

The "Main.mpf" main program stored on the USB memory stick is selected for execution:

N10 G4 F0.5	
N20 MSG("CALL Milling")	
N30 CALL "//NC:/MPF.DIR/BOHRUNG.SPF"	
N40 M30	

The "BOHRUNG.SPF" subprogram stored in the NC directory is to be reloaded:

N10 G01 X10 Y20 Z30 F1000	
N20 G91 X10 Y10 Z10	
N30 M30	

- **Calling an external subroutine**

The "Main.mpf" main program stored in the NC directory is selected for execution:

N10 G0 X10 Y10	
N20 EXTCALL ("USB:\BOHRUNG.SPF") *	
N30 G0 X20 Y20	
N40 M30	

* If you have set SD 42700 as "USB:\", you only need to enter EXTCALL ("BOHRUNG.SPF") alternatively.

The "BOHRUNG.SPF" subprogram stored on the USB memory stick is to be reloaded:

N10 G01 X10 Y20 Z30 F1000	
N20 G91 X10 Y10 Z10	
N30 M30	

11.16 Timers and workpiece counters

11.16.1 Runtime timer

Functionality

The timers are prepared as system variables (\$A...) that can be used for monitoring the technological processes in the program or only in the display.

These timers are read-only. There are timers that are always active. Others can be deactivated via machine data.

Timers that are always active

- **\$AN_SETUP_TIME**

Time since the last control power up with default values (in minutes)

It is automatically reset in the case of a system power-up with default values.

- **\$AN_POWERON_TIME**

Time since the last control power up (in minutes)

It is reset to zero automatically after each power-up of the control system.

Timers that are activated via machine data

The following timers are activated via machine data (default setting).

Each active run-time measurement is automatically interrupted in the stopped program state or for feedrate-override-zero.

The behavior of the activated timers for active dry run feedrate and program testing can be specified using machine data.

- **\$AC_OPERATING_TIME**

Total execution time in seconds of NC programs in "AUTO" mode

In "AUTO" mode, the runtimes of all programs between program start and end are summed up. The timer is zeroed after each power-up of the control system.

- **\$AC_CYCLE_TIME**

Runtime of the selected NC program (in seconds)

The runtime between program start and end is measured in the selected NC program. The timer is reset with the start of a new NC program.

- **\$AC_CUTTING_TIME**

Tool action time (in seconds)

The runtime of the path axes is measured in all NC programs between program start and end without rapid traverse active and with the tool active (default setting).

The measurement is interrupted when a dwell time is active.

The timer is automatically set to zero after each power-up of the control system.

Programming example

```
N10 IF $AC_CUTTING_TIME>=R10 GOTOF WZZEIT           ; Tool operation time limit value?
G0 X20 Y20
N80 WZZEIT:G0 X30 Y30
N90 MSG("Tool action time: Limit value reached")
N100 M0
M30
```

Display

The content of the active system variables is visible in the window opened through the following key operations:



Window display:

Times / Counter		
Parts in total	①	0
Parts required	②	0
Part count	③	0
Run time	④	0000 H 00 M 00 S
Cycle time	⑤	0000 H 00 M 00 S
Cutting time	⑥	0000 H 00 M 00 S
Setup time	⑦	0008 H 32 M
Power on time	⑧	0002 H 29 M

① = \$AC_TOTAL_PARTS

② = \$AC_REQUIRED_PARTS

③ = \$AC_ACTUAL_PARTS

⑤ = \$AC_CYCLE_TIME

⑥ = \$AC_CUTTING_TIME

⑦ = \$AN_SETUP_TIME

\$AC_SPECIAL_PARTS is not available for display.

④ = \$AC_OPERATING_TIME

⑧ = \$AN_POWERON_TIME

You can also view the time counter information through the following operating area:



11.16.2 Workpiece counter

Functionality

The "Workpiece counter" function provides counters for counting workpieces.

These counters exist as system variables with write and read access from the program or via operator input (observe the protection level for writing!). For more information about write protection, see Section "Entering/modifying the setting data (Page 59)".

Machine data can be used to control counter activation, counter reset timing and the counting algorithm.

Counters

- **\$AC_REQUIRED_PARTS**

Number of workpieces required (workpiece setpoint)

In this counter you can define the number of workpieces at which the actual workpiece counter \$AC_ACTUAL_PARTS is reset to zero.

The generation of the display alarm 21800 "Workpiece setpoint reached" can be activated via machine data.

- **\$AC_TOTAL_PARTS**

Total number of workpieces produced (total actual)

The counter specifies the total number of all workpieces produced since the start time.

The counter is set to zero automatically upon every booting of the control system.

- **\$AC_ACTUAL_PARTS**

Number of actual workpieces (actual)

This counter registers the number of all workpieces produced since the starting time. When the workpiece setpoint is reached (\$AC_REQUIRED_PARTS, value greater than zero), the counter is automatically zeroed.

• **\$AC_SPECIAL_PARTS**

Number of workpieces specified by the user

This counter allows users to make a workpiece counting in accordance with their own definition. Alarm output can be defined for the case of identity with \$AC_REQUIRED_PARTS (workpiece target). Users must reset the counter themselves.

Programming example

```
N10 IF $AC_TOTAL_PARTS==R15 GOTOF SIST ; Count reached?
G0 X20 Y20
N80 SIST: G0 X30 Y30
N90 MSG("Workpiece setpoint reached")
N100 M0
```

Display

The content of the active system variables is visible on the window opened through the following key operations:



Window display:

Times / Counter		
Parts in total	①	0
Parts required	②	0
Part count	③	0
Run time	④	0000 H 00 M 00 s
Cycle time	⑤	0000 H 00 M 00 s
Cutting time	⑥	0000 H 00 M 00 s
Setup time	⑦	0008 H 32 M
Power on time	⑧	0002 H 29 M

- ① = \$AC_TOTAL_PARTS
- ② = \$AC_REQUIRED_PARTS
- ③ = \$AC_ACTUAL_PARTS
- ⑤ = \$AC_CYCLE_TIME
- ⑥ = \$AC_CUTTING_TIME
- ⑦ = \$AN_SETUP_TIME

\$AC_SPECIAL_PARTS is not available for display.

- ④ = \$AC_OPERATING_TIME
- ⑧ = \$AN_POWERON_TIME

You can also select whether to activate the workpiece counter function through the following operating area:



11.17 Smooth approach and retraction

Functionality


The function "Smooth approach and retraction" (SPR) is intended to approach the beginning of a contour tangentially ("smooth"), to a large degree independently of the position of the starting point. The control system will calculate the intermediate points and generate the required traversing blocks. This function is used preferably in conjunction with the tool radius compensation (TRC). The G41 and G42 commands determine the approach/retraction direction to the left or right of the contour.

The approach/retraction path (straight line, quarter or semi-circle) is selected using a group of G commands. To parameterize this path (circle radius, length, approach straight line), special addresses can be used; this also applies to the feedrate of the infeed motion. The infeed motion can additionally be controlled via another G group.

Programming

G147 ; Approach with a straight line
G148 ; Retraction with a straight line
G247 ; Approach with a quadrant
G248 ; Retraction with a quadrant
G347 ; Approach with a semi-circle
G348 ; Retraction with a semi-circle
G340 ; Approach and retraction in space (basic setting)
G341 ; Approach and retraction in the plane
DISR=... ; Approach and retraction with straight lines (G147/G148): Distance of the cutter edge from the start or end point of the contour
; Approach and retraction along circles (G247, G347/G248, G348): Radius of the tool center point path
DISCL=... ; Distance of the end point for the fast infeed motion from the machining plane (safety clearance)
FAD=... ; Speed of the slow infeed motion
The programmed value acts according to the active command of the G group 15 (feed: G94, G95)

See the following illustration for approaching along a straight line using the example of G42 or retraction using G41 and completion with G40:

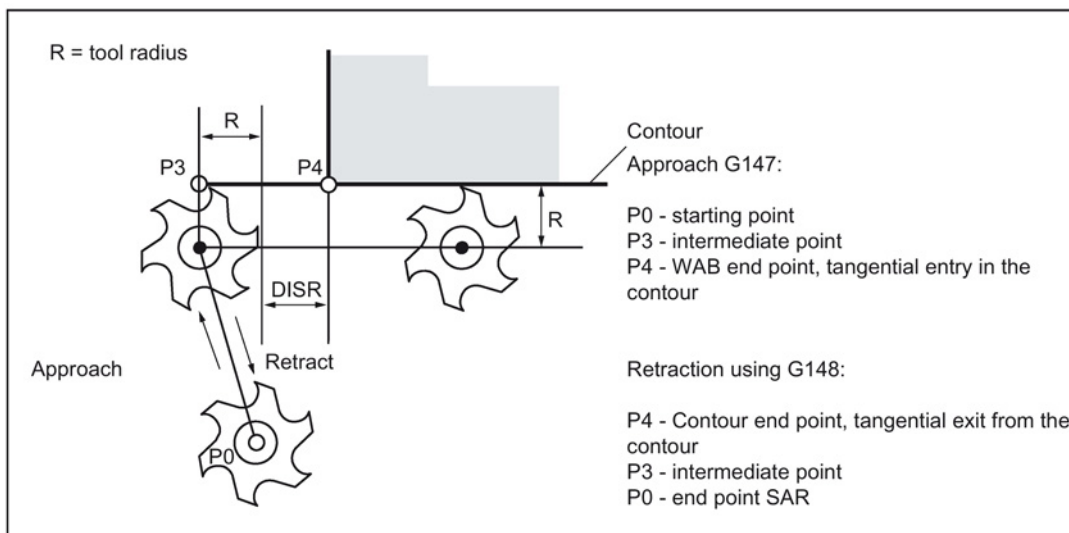


Programming example: Approach/retraction along a straight line in a plane

```

N10 T1 G17 ; Activate tool, X/Y plane
N20 G0 X20 Y20 ; Approach P0
N30 G42 G147 DISR=8 F600 X4 Y4 ; Approach, point P4 programmed
N40 G1 X40 ; Continue in the contour
N50 Y12
N100 G41 G1 X15 Y15
N110 X4 Y4 ; P4 - contour end point
N120 G40 G148 DISR=8 F700 X8 Y8 ; Retraction, point P0 programmed
M30

```

See the following illustration for approaching along a quadrant using the example of G42 or retraction using G41 and completion with G40:

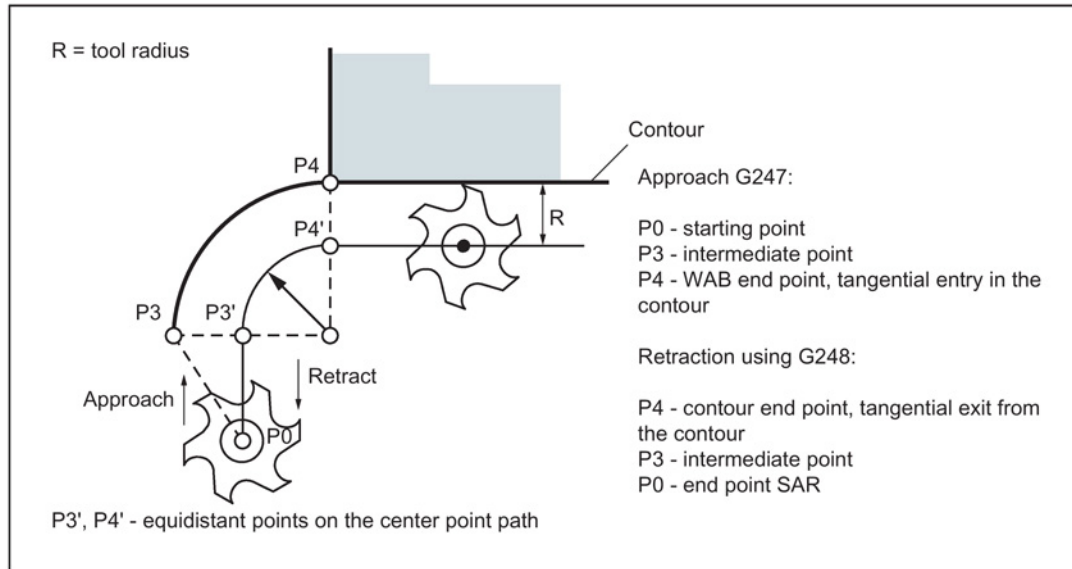


Programming example: Approach/retraction along a quarter in a plane

```

N10 T1 D1 G17 ; Activate tool, X/Y plane
N20 G0 X20 Y20 ; Approach P0
N30 G42 G247 DISR=20 F600 X4 Y4 ; Approach, point P4 programmed
N40 G1 X40 ; Continue in the contour
N50 Y12
N60 G41 G1 X15 Y15
N70 X4 Y4 ; P4 - contour end point
N80 G40 G248 DISR=20 F700 X8 Y8 ; Retraction, point P0 programmed
N90 M30

```

See the following illustration for approaching along a semi-circle using the example of G42 or retraction using G41 and completion with G40:

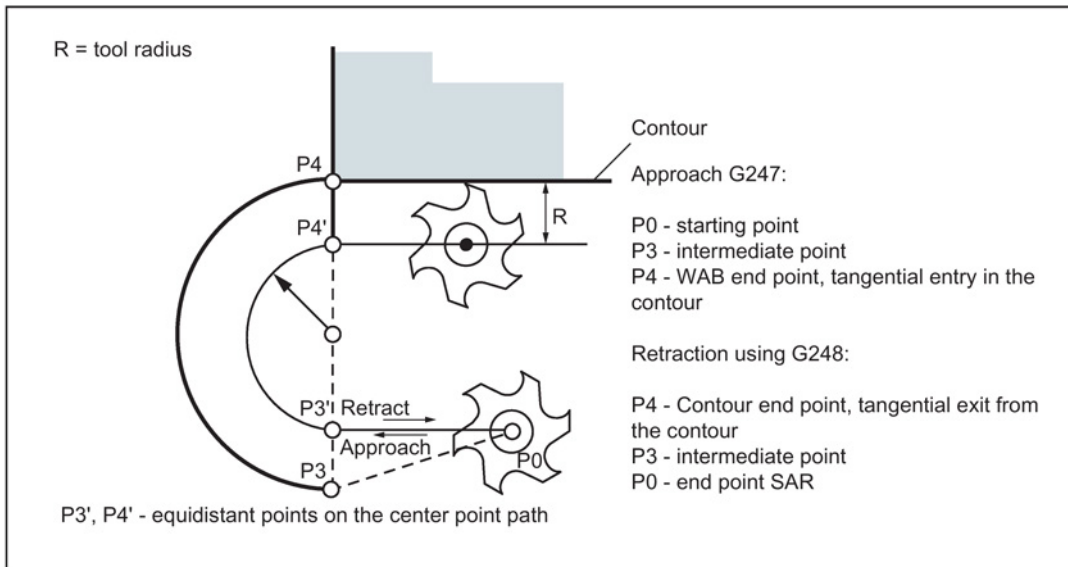

Note

Make sure that a positive radius is entered for the tool radius. Otherwise, the directions for G41, G42 will be changed.

Controlling the infeed motion using DISCL and G340, G341


DISCL=... specifies the distance of point P2 from the machining plane (see following figure).

In the case DISCL=0, the following will apply:

- With G340: The whole approach motion consists only of two blocks (P1, P2 and P3 are identical). The approach contour is generated from P3 to P4.
- With G341: The whole approach motion consists only of three blocks (P2 and P3 are identical). If P0 and P4 are located in the same plane, only two blocks will result (there will be no infeed motion from P1 to P3).

It is monitored that the point defined by DISCL lies between P1 and P3, i.e. with all motions that possess a component which runs vertically to the machining plane, this component must have the same sign. If a reversal of the direction is detected, a tolerance of 0.01 mm is permitted.

See the following sequence of the approach motion dependent on G340/G341 (example with G17):

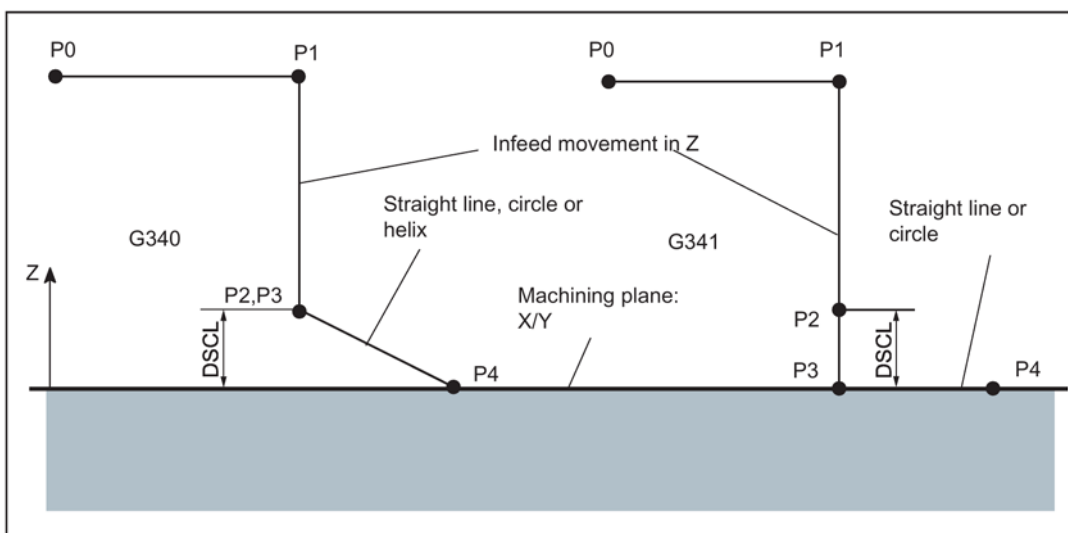

Programming example: Approach along a semi-circle with infeed

```
N10 T1 D1 G17 G90 G94 ; Activate tool, X/Y plane
N20 G0 X0 Y0 Z30 ; Approach P0
N30 G41 G347 G340 DISCL=3 DISR=13 Z=0 F500 ; Approach along a semi-circle with radius: 13 mm,
; Safety clearance to the plane: 3 mm
N40 G1 X40 Y-10
N50 G40 X20 Y20
N60 M30
```

alternatively N30/N40:

```
N30 G41 G347 G340 DISCL=3 DISR=13 X40 Y-10 Z0 F500
```

or

```
N30 G41 G347 G340 DISCL=3 DISR=13 F500
```

```
N40 G1 X40 Y-10 Z0
```

Explanation with regard to N30/N40:

By using G0 (from N20), the point P1 (starting point of the semi-circle, corrected by the tool radius) is approached in the plane Z=30, then lowering to the depth (P2, P3) with Z=3 (DISCL). The contour is reached at point X40 Y-10 in the depth Z=0 (P4) along a helix curve at a feedrate of 500 mm/min.

Approach and retraction velocities

- Velocity of the previous block (e.g. G0):
All motions from P0 up to P2 are executed at this speed, i.e. the motion parallel to the machining plane and the part of the infeed motion up to the safety clearance DISCL.
- Programmed feedrate F:
This feedrate is active from P3 or P2 if FAD is not programmed. If no F word is programmed in the SAR block, the velocity of the previous block will act.
- Programming using FAD:
Specify the feedrate for
 - G341: Infeed motion vertically to the machining plane from P2 to P3
 - G340: from point P2 or P3 to P4If FAD is not programmed, this part of the contour is traversed at the speed which is active modally from the preceding block, in the event that no F command defining the speed is programmed in the SAR block.
- **During retraction**, the roles of the modally effective feedrate from the previous block and the feedrate programmed in the SAR block are changed, i.e. the actual retraction contour is traversed using the old feedrate, and a new velocity programmed using the F word will apply correspondingly from P2 to P0.

Programming example: Approach along a quadrant, infeed using G341 and FAD

```
N10 T1 D1 G17 G90 G94 ; Activate tool, X/Y plane
N20 G0 X0 Y0 Z30 ; Approach P0
N30 G41 G341 G247 DISCL=5 DISR=13 FAD=500 X40 Y-10 Z=0 F800
N40 G1 X50
N50 G40 G1 X20 Y20
N60 M30
```

Explanation with regard to N30:

By using G0 (from N20), the point P1 (starting point of the quadrant, corrected by the tool radius) is approached in the plane Z=30, then lowering to the depth (P2) with Z=5 (DISCL). Using a feedrate of FAD=500 mm/min, it is lowered to a depth of Z=0 (P3) (G341). Then, the contour is approached at point X40,Y-10 along a quadrant in the plane (P4) using F=800 mm/min.

Intermediate blocks

A maximum of five blocks **without** moving the geometry axes can be inserted between an SAR block and the next traversing block.

Information

Programming when retracting:


- With an SAR block with a geometry axis programmed, the contour ends at P2. The positions on the axes that constitute the machining plane result from the retraction contour. The axis component perpendicular to this is defined by DISCL. With DISCL=0, the motion will run completely in the plane.
- If in the SAR block only the axis is programmed vertically to the machining plane, the contour will end at P1. The positions of the remaining axes will result, as described above. If the SAR block is also the TRC disable block, an additional path from P1 to P0 is inserted such that no motion results at the end of the contour when disabling the TRC.
- If only one axis on the machining plane is programmed, the missing second axis is modally added from its last position in the previous block.

11.18 Cylinder surface transformation (TRACYL)

Functionality

- The TRACYL cylinder surface transformation function can be used to machine:
 - Longitudinal grooves on cylindrical bodies
 - Transverse grooves on cylindrical objects
 - Grooves with any path on cylindrical bodies

The path of the grooves is programmed with reference to the unwrapped, level surface of the cylinder.

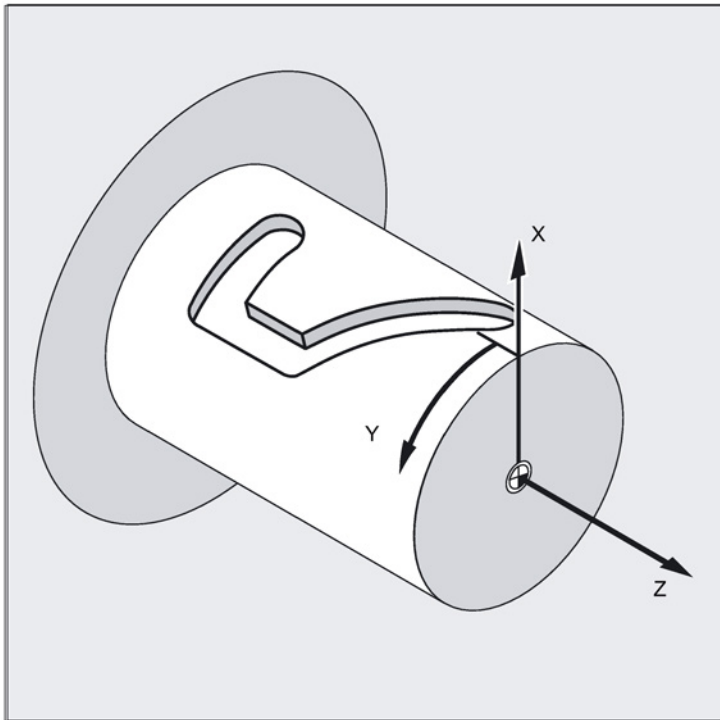

- The control system transforms the programmed traversing movements in the Cartesian coordinate X, Y, Z system into the traversing movements of the real machine axes. The main spindle functions here as the machine rotary axis.
- TRACYL must be configured using special machine data. The rotary axis position at which the value Y=0 is also defined here.

TRACYL transformation types

There are three forms of cylinder surface coordinate transformation:

- TRACYL without groove wall offset (TRAFO_TYPE_n=512)
- TRACYL with groove wall offset: (TRAFO_TYPE_n=513)
- TRACYL with additional linear axis and groove wall offset: (TRAFO_TYPE_n=514)
The groove wall offset is parameterized with TRACYL using the third parameter.

For cylinder peripheral curve transformation with groove side compensation, the axis used for compensation should be positioned at zero ($y=0$), so that the groove centric to the programmed groove center line is finished.

Axis utilization

The following axes cannot be used as a positioning axis or a reciprocating axis:

- The geometry axis in the peripheral direction of the cylinder peripheral surface (Y axis)
- The additional linear axis for groove side compensation (Z axis).

Programming

TRACYL(d) or TRACYL(d, n) or for transformation type 514

TRACYL(d, n, groove side offset)

TRAFOOF

Rotary axis

The rotary axis cannot be programmed as it is occupied by a geometry axis and thus cannot be programmed directly as channel axis.

Meaning

TRACYL(d)	Activates the first TRACYL function specified in the channel machine data. d is the parameter for the working diameter.
TRACYL (d, n)	Activates the n-th TRACYL function specified in the channel machine data. The maximum for n is 2, TRACYL(d,1) corresponds to TRACYL(d).
D	Value for the working diameter. The working diameter is double the distance between the tool tip and the turning center. This diameter must always be specified and be larger than 1.
n	Optional 2nd parameter for the TRACYL data block 1 (preselected) or 2.
Slot side compensation	Optional 3rd parameter whose value for TRACYL is preselected using the mode for machine data. Value range: 0: Transformation type 514 without groove wall offset as previous 1: Transformation type 514 with groove wall offset
TRAFOOF	Transformation OFF (BCS and MCS are once again identical).
OFFN	Offset contour normal: Distance of the groove side from the programmed reference contour.

Note

An active TRACYL transformation is likewise deactivated if one of the other transformations is activated in the relevant channel (e.g. TRANSMIT).

OFFN address


Distance from the groove side wall to the programmed path.

The groove center line is generally programmed. OFFN defines the (half) groove width for activated milling cutter radius compensation (G41, G42).

Programming: OFFN=... ; distance in mm

Note

Set OFFN=0 once the groove has been completed. OFFN is also used outside of TRACYL - for offset programming in combination with G41, G42.

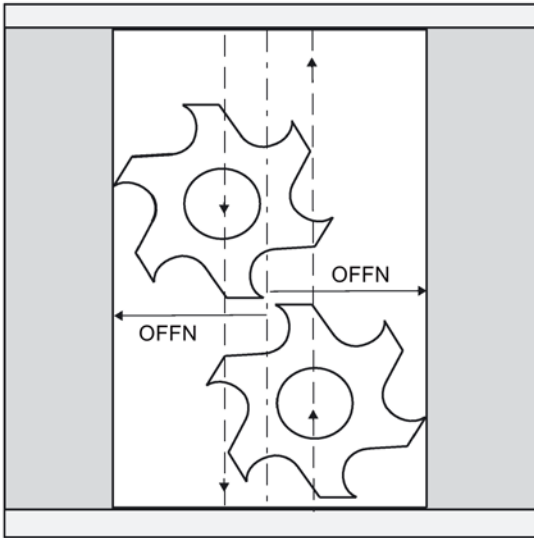


Example: Tool definition

The following example is suitable for testing the parameterization of the TRACYL cylinder transformation:

Program code	Comment
Tool parameters	Meaning
Number (DP)	
\$TC_DP1[1,1]=120	Tool type (Milling tool)
\$TC_DP2[1,1]=0	Cutting edge position (Only for turning tools)
Program code	Comment
Geometry	Length compensation
\$TC_DP3[1,1]=8.	Length offset vector (Calculation acc. to type and plane)
\$TC_DP4[1,1]=9.	
\$TC_DP5[1,1]=7.	
Program code	Comment
Geometry	Radius
\$TC_DP6[1,1]=6.	Tool radius
\$TC_DP7[1,1]=0	Slot width b for slotting saw, rounding radius for milling tools
\$TC_DP8[1,1]=0	Projection k (For slotting saw only)
\$TC_DP9[1,1]=0	
\$TC_DP10[1,1]=0	
\$TC_DP11[1,1]=0	Angle for taper milling tools
Program code	Comment
Wear	Length and radius compensation
\$TC_DP12[1,1]=0	Remaining parameters to \$TC_DP24=0 (Tool base dimension/adapter)

Example: Making a hook-shaped groove

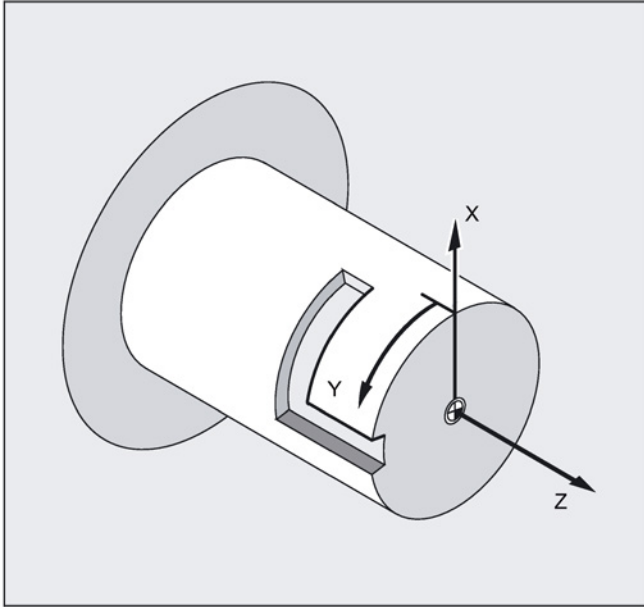

Activate cylinder surface transformation:

Required tool: T1 milling tool, radius=3 mm, edge position=8

Program code	Comment
N10 T1 D1 G54 G90 G94 F1000	; Tool selection, clamping compensation
N20 SPOS=0	; Approach the starting position
N30 SETMS(2)	; Set the second spindle as the main spindle
N40 M3 S2000	; Run the spindle
N50 DIAMOF	; Change the diameter dimensioning to radius dimensioning
N60 G0 X23 Z105	
N70 TRACYL (20)	; Activate cylinder surface ;transformation
N80 G19	; Plane selection

Machining a hook-shaped groove:

Program code	Comment
N90 G1 Y0 Z-10	; Approach starting position
N100 G42 OFFN=-4.5	; Tool radius compensation right of contour on
N110 X19 F500	
N120 Z-25	
N130 Y30	
N140 OFFN=-3.5	
N150 Y0	
N160 Z-10	
N170 X25	
N180 TRAF00F	
N190 DIAMON	; Diameter dimensioning
N200 G40	; Tool radius compensation off
N210 G0 X80 Z100	; Retraction in rapid traverse
N220 M30	; End of program


Description

Without groove wall offset (transformation type 512)

The controller transforms the programmed traversing movements of the cylinder coordinate system to the traversing movements of the real machine axes:

- Rotary axis
- Infeed axis perpendicular to rotary axis
- Longitudinal axis parallel to rotary axis

The linear axes are positioned perpendicular to one another. The infeed axis cuts the rotary axis.

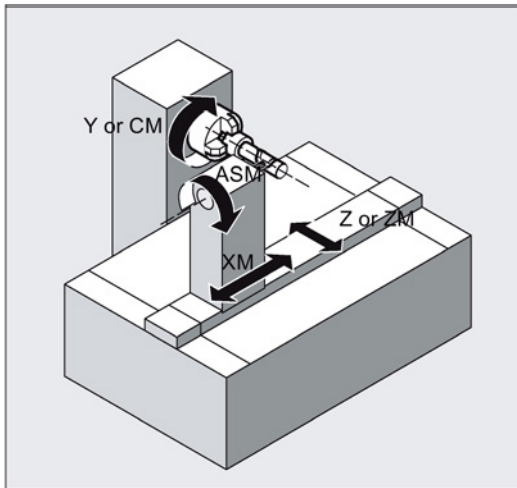


With groove wall offset (transformation type 513)

Kinematics as above, but an additional longitudinal axis parallels to the peripheral direction.

The linear axes are positioned perpendicular to one another.


The velocity control makes allowance for the limits defined for the rotations.

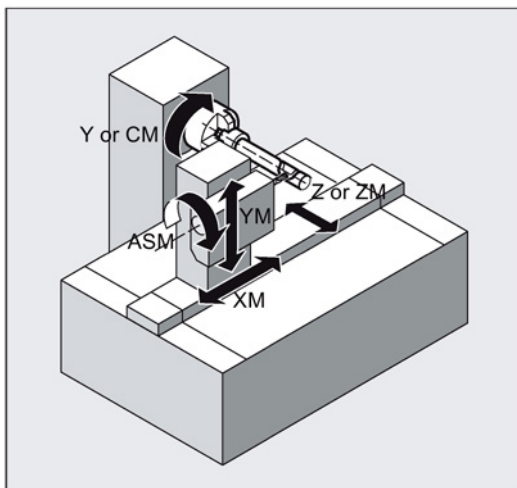

Groove traversing-section

In the case of axis configuration 1, longitudinal grooves along the rotary axis are subject to parallel limits only if the groove width corresponds exactly to the tool radius.

Grooves in parallel to the periphery (transverse grooves) are not parallel at the beginning and end.

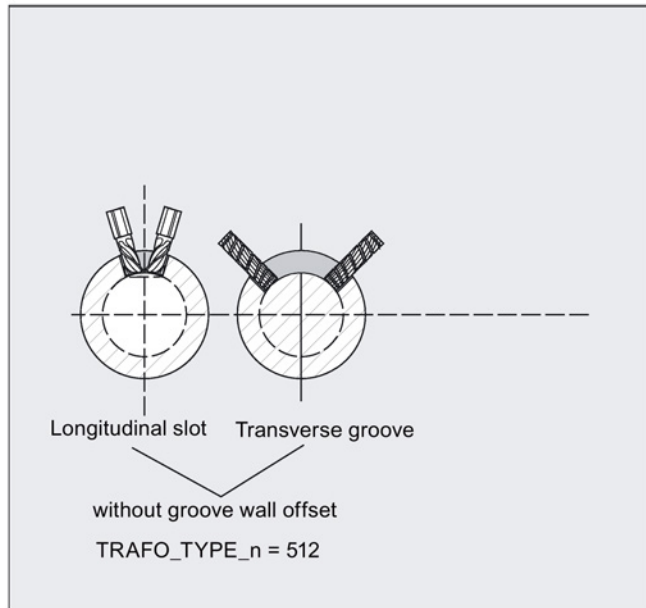

With additional linear axis and groove wall offset (transformation type 514)

On a machine with a second linear axis, this transformation variant makes use of redundancy in order to perform improved tool compensation. The following conditions then apply to the second linear axis:

- A smaller working area
- The second linear axis should not be used for traversing the part program.

Certain machine data settings are assumed for the part program and the assignment of the corresponding axes in the BCS or MCS.


For more information, see the SINUMERIK 808D ADVANCED Function Manual.

Offset contour normal OFFN (transformation type 513)

To mill grooves with TRACYL, the following is programmed:

- Groove center line in the part program
- Half the groove width programmed using OFFN.

To avoid damage to the groove side OFFN acts only when the tool radius compensation is active. Furthermore, OFFN should also be $\geq$ the tool radius to avoid damage occurring to the opposite side of the groove.

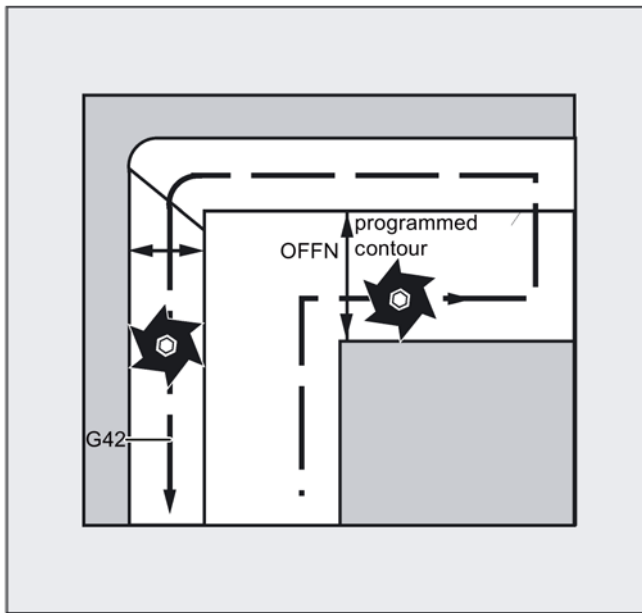

A part program for milling a groove generally comprises the following steps:

1. Selecting a tool
2. Select TRACYL
3. Select suitable coordinate offset (frame)
4. Positioning
5. Program OFFN
6. Select TRC
7. Approach block (position TRC and approach groove side)
8. Groove center line contour
9. Deselect TRC
10. Retraction block (retract TRC and move away from groove side)
11. Positioning
12. Deselect OFFN
13. TRAFOOF
14. Re-select original coordinate shift (frame)

Special features

- TRC selection:
TRC is not programmed in relation to the groove side, but relative to the programmed groove center line. To prevent the tool traveling to the left of the groove side, G42 is entered (instead of G41). You avoid this if in OFFN, the groove width is entered with a negative sign.
- OFFN acts differently with TRACYL than it does without TRACYL. As, even without TRACYL, OFFN is included when TRC is active, OFFN should be reset to zero after TRAFOOF.
- It is possible to change OFFN within a part program. This could be used to shift the groove center line from the center (see diagram).
- Guiding grooves:
TRACYL does not create the same groove for guiding grooves as it would be with a tool with the diameter producing the width of the groove. It is basically not possible to create the same groove side geometry with a smaller cylindrical tool as it is with a larger one. TRACYL minimizes the error. To avoid problems of accuracy, the tool radius should only be slightly smaller than half the groove width.

Note

OFFN and TRC

With TRAFO_TYPE_n = 512, the value is effective under OFFN as an allowance for TRC. With TRAFO_TYPE_n = 513, half the groove width is programmed in OFFN. The contour is retracted with OFFN-TRC.

11.19 Coupled motion (TRAILON, TRAILOF)

Functionality


When a defined leading axis is moved, the coupled-motion axes assigned to it traverse through the distances described by the leading axis, allowing for a coupling factor.

Together, the leading axis and all the coupled-motion axes assigned to it form a coupled axis group.

A coupled axis group can consist of any desired combinations of linear and rotary axes. A spindle, however, can form a coupled axis group with a spindle only. A simulated axis can also be defined as a leading axis.

Application examples

- Traversal of an axis by means of a simulated axis. The leading axis is a simulated axis and the coupled-motion axis a real axis. In this way, the real axis can be traversed as a function of the coupling factor.
- Two-sided machining with a coupled axis group: leading axis Z, coupled-motion axis W.

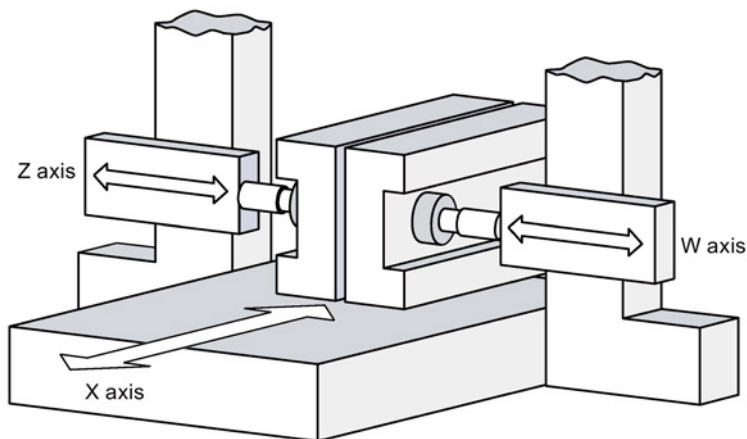

Memory configuration

Memory space reserved in dynamic NC memory for generic coupling is defined in machine data:

MD18450 \$MN_MM_NUM_CP_MODULES (maximum allowed number of CP coupling modules)

MD18452 \$MN_MM_NUM_CP_MODUL_LEAD (maximum allowed number of CP master values)

Note that MD18450 and MD18452 are visible only with the manufacturer password.

For more information about memory configuration, see the SINUMERIK 808D ADVANCED Function Manual.

Programming

TRAILON(<coupled-motion axis>,<leading axis>,<coupling factor>)

TRAILOF(<coupled-motion axis>,<leading axis>)

TRAILOF(<coupled-motion axis>)

Meaning

TRAILON	Command for activating and defining a coupled axis group Effectiveness: modal
<coupled-motion axis>	Parameter 1: Axis name of the coupled-motion axis Note: A coupled-motion axis can neither be assigned simultaneously to over one leading axis, nor act as the leading axis for other coupled-motion axes.
<leading axis>	Parameter 2: Axis name of the leading axis

<coupling factor>	Parameter 3: Coupling factor The coupling factor specifies the desired relationship between the paths of the coupled-motion axis and the leading axis: <coupling factor> = path of coupled-motion axis/path of leading axis. Type: REAL Default: 1 The input of a negative value causes the leading axis and the coupled-motion axis to traverse in opposite direction. If a coupling factor is not programmed, then coupling factor 1 automatically applies.
TRAILOF	Command for deactivating a coupled axis group Effectiveness: modal Programming TRAILOF with 2 parameters deactivates the coupling to the specified leading axis: TRAILOF(<coupled-motion axis>,<leading axis>) Programming TRAILOF without specifying a leading axis produces the same result: TRAILOF(<coupled-motion axis>)

Note

The motion of a coupled-motion axis is executed in the machine coordinate system (MCS) or in a coordinate system derived from a kinematic transformation of the MCS.

The maximum number of coupled axis groups is limited to four.


Note

When the "coupled-motion" function is used for spindles, the speed of the leading axis is limited to MD35130 (maximum speed in the speed control mode); the speed of the coupled-motion axis is limited to MD35135 (maximum speed in the position control mode). The default value 0 of MD35135 indicates that 90% of the value of MD35130 becomes the maximum speed in the position control mode. As a result, when the coupling factor is greater than 0.9, the coupled-motion axis cannot reach the set speed due to speed limit specified in MD35130.

- In this case, set MD35135 to an appropriate value to reach the desired speed of the coupled-motion axis.

Programming example

The workpiece is to be machined on two sides with the axis configuration shown in the diagram. To do this, you create a coupled axis group.

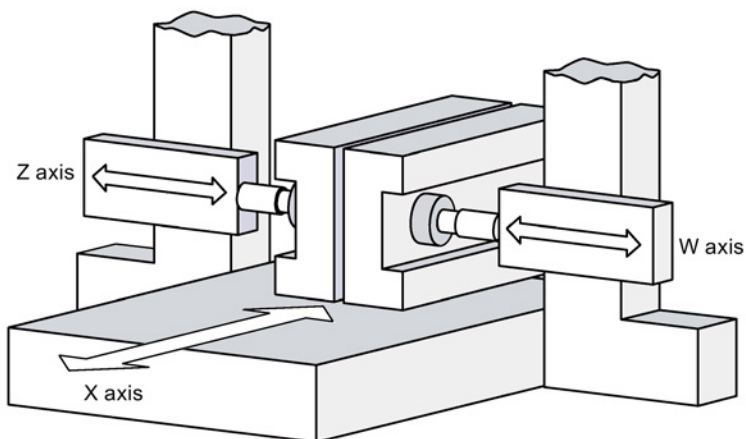

Program code	Comment
...	
N100 TRAILON(W,Z,-1)	; Activation of coupled axis group, Negative coupling factor: coupled-motion axis traverses in the opposite direction from leading axis.
N110 G0 Z10	; Infeed of Z and W axes in opposite axis directions.
...	
TRAILOF(W,Z)	; Deactivation of coupled axis group.

Further information

Coupled-motion axes

A coupled-motion axis can be programmed with the full range of available motion commands (G0, G1, G2, G3, etc.). The coupled-motion axis traverses not only the independently defined paths, but also those derived from its leading axes on the basis of coupling factors.

Dynamics limit

If a coupled axis group is activated in the part program, the dynamic response of all coupled-motion axes is taken into account during traversing of the leading axis to avoid overloading the coupled-motion axes.

Coupling status

The coupling status of an axis can be checked in the part program with the system variable: \$AA_COUP_ACT[<axis>].

Value	Meaning
0	Coupled motion inactive
8	Coupled motion active

Display of distance-to-go of the coupled-motion axis for modulo rotary axes

If the leading and coupled-motion axes are modulo rotary axes, the traversing movements in the leading axis add up from $n \cdot 360^\circ$ ($n = 1, 2, 3 \dots$) in the distance-to-go display of the coupled-motion axis until the coupling is switched off.

Example: Program section with TRAILON and leading axis B and coupled-motion axis C

Program code	Comment
TRAILON(C, B, 1)	; Activate coupling
G0 B0	; Start positioning
	; Distance-to-go display at block start:
G91 B360	; B=360, C=360
G91 B720	; B=720, C=1080
G91 B360	; B=360, C=1440

12 Cycles

12.1 Overview of cycles

Cycles are generally applicable technology subroutines that can be used to carry out a specific machining process, such as drilling of a thread (tapping) or milling of a pocket. These cycles are adapted to individual tasks by parameter assignment.

Drilling cycle, drilling pattern cycles and milling cycles

You can carry out the following standard cycles by using the control system:

- **Drilling cycles**
 - CYCLE81: Drilling, centering
 - CYCLE82: Drilling, counterboring
 - CYCLE83: Deep-hole drilling
 - CYCLE84: Rigid tapping
 - CYCLE840: Tapping with compensating chuck
 - CYCLE85: Reaming 1
 - CYCLE86: Boring
- **Drilling pattern cycles**
 - HOLES1: Row of holes
 - HOLES2: Circle of holes
 - CYCLE802: Arbitrary positions

- **Milling cycles**
 - CYCLE71: Face milling
 - CYCLE72: Contour milling
 - CYCLE76: Milling the rectangular spigot
 - CYCLE77: Circular spigot milling
 - LONGHOLE: Elongated hole
 - SLOT1: Groove milling pattern on a circle
 - SLOT2: Circumferential groove milling pattern
 - POCKET3: Rectangular pocket milling (with any milling tool)
 - POCKET4: Circular pocket milling (with any milling tool)
 - CYCLE90: Thread milling
 - CYCLE832: High speed settings

12.2 Programming cycles

Call and return conditions


The G functions effective prior to the cycle call and the programmable offsets remain active beyond the cycle.

The machining level (G17, G18, G19) must be defined before calling the cycle. A cycle operates in the current plane with:

- First axis of the plane (abscissa)
- Second axis of the plane (ordinate)
- Drilling axis/infeed axis, third axis, standing vertically to the plane (vertical infeed axis)

With drilling cycles, the drilling operation is carried out in the axis standing vertically to the current plane. In milling, the depth infeed is carried out in this axis.

See the following illustrations for plane and axis assignment:

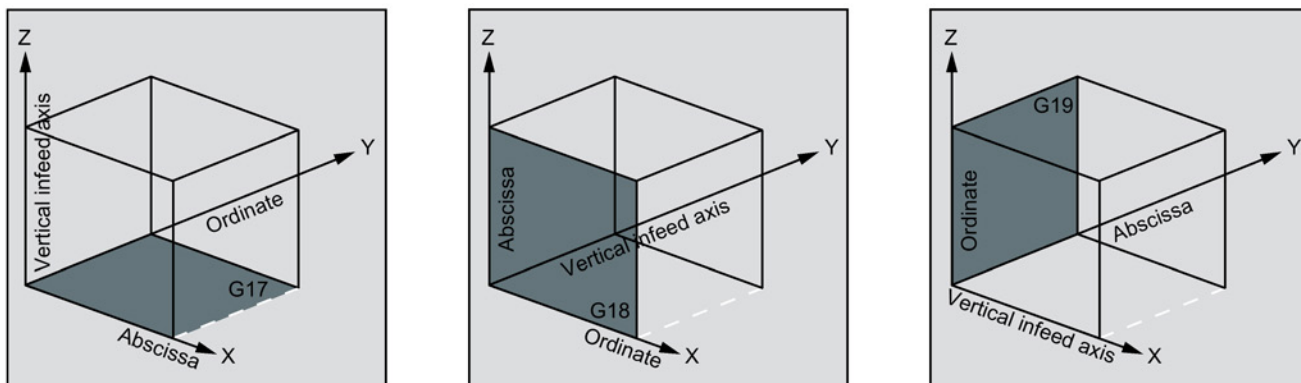

Command	Plane (abscissa/ordinate)	Vertical infeed axis
G17	X/Y	Z
G18	Z/X	Y
G19	Y/Z	X

Messages output during execution of a cycle

Messages that refer to the state of machining are displayed on the screen of the control system during program execution.

These messages do not interrupt the program execution and continue to be displayed on the screen until the next message appears.

The message texts and their meaning are listed together with the cycle to which they refer.

Block display during execution of a cycle

During the cycle execution, the cursor is always located on the program blocks of the cycle.

Cycle call and parameter list

The defining parameters for the cycles can be transferred via the parameter list when the cycle is called.

Note

Cycle calls must always be programmed in a separate block.

Basic instructions with regard to the assignment of standard cycle parameters

Each defining parameter of a cycle has a certain data type. The parameter being used must be specified when the cycle is called. In this parameter list, the following parameters can be transferred:

- R parameters (only numerical values)
- Constants

If R parameters are used in the parameter list, values must first be assigned to them in the program to be called. Proceed through either of the following methods to call the cycles:

- using an incomplete parameter list
- omitting parameters

If you want to exclude the last transfer parameters that have to be written in a call, you can prematurely terminate the parameter list with ")". If any parameters are to be omitted within the list, a comma "... ,..." must be written as a placeholder.

No plausibility checks are made for parameter values with a limited range of values unless an error response has been specifically described for a cycle.

If when calling the cycle the parameter list contains more entries than parameters are defined in the cycle, the general NC alarm 12340 "Too many parameters" is displayed and the cycle is not executed.

Note

Axis-specific and channel-specific machine data of the spindle must be configured.

Cycle call

The individual methods for writing a cycle are shown in the programming examples provided for the individual cycles.

Simulation of cycles

Programs with cycle calls can be tested first in simulation.

During simulation, the traversing movements of the cycle are visualized on the screen.

12.3 Graphical cycle programming in the program editor

The program editor in the control system provides cycle programming. You can enter machining parameters in the cycle and call the cycle in the program.

Function

The cycle support consists of three components:

- Cycle selection
- Input screens for parameter assignment
- Help display per cycle

Operating the cycle support

To add a cycle call to the program, proceed as described below:



1. Select the desired operating area.



2. Select a cycle type with the corresponding horizontal softkey to open the lower-level vertical softkey bar until the desired input screen form with the help display appears on the screen.



3. Enter the values directly (numerical values) or indirectly (R parameters, for example, R27, or expressions consisting of R parameters, for example, R27 + 10).
If numerical values are entered, then the control system automatically performs a check to see whether the value lies within the permitted range.



4. Use this key to select values for some parameters that may have only a few values for selection.



5. For drilling cycles, it is also possible to call a cycle modally with this key. To deselect the modal call, move the cursor to the next blank line of the program and press the softkey below:



6. Press this softkey to confirm your input. To cancel the input, press the softkey below:



Recompiling

Recompiling of program codes serves to make modifications to an existing program using the cycle support.



Position the cursor on the program line for the cycle to be modified and press this softkey. This reopens the input screen of parameter assignment for the cycle, and you can modify and accept the parameter values.

12.4 Drilling cycles

12.4.1 General information

Drilling cycles are motional sequences specified according to DIN 66025 for drilling, boring, tapping, etc.

They are called in the form of a subroutine with a defined name and a parameter list.


The drilling cycles can be modal, that is, they are executed at the end of each block containing motion commands. Further cycles created by the user can also be called modally.

There are two types of parameters:

- Geometrical parameters
- Machining parameters

The geometrical parameters are identical for all drilling cycles, drilling pattern cycles and milling cycles. They define the reference and retraction planes, the safety clearance and the absolute or relative final drilling depth. Geometrical parameters are assigned once during the first drilling cycle CYCLE81.

See the following illustration for drilling, centering - CYCLE81:

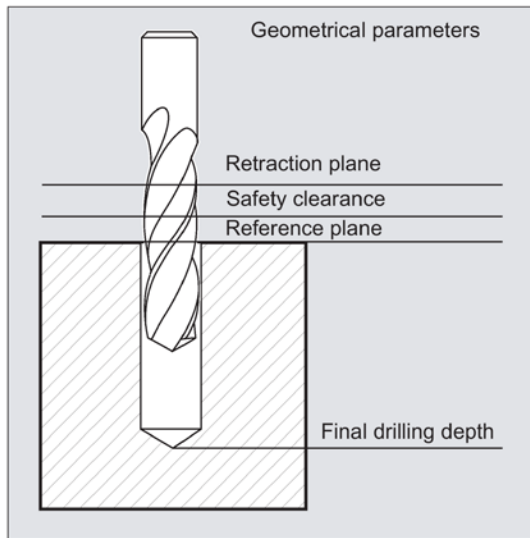

The machining parameters have a different meaning and effect in the individual cycles. They are therefore programmed in each cycle separately.

12.4.2 Requirements

Call and return conditions

Drilling cycles are programmed independently of the actual axis names. The drilling position must be approached in the higher-level program before the cycle is called.

The required values for feedrate, spindle speed and direction of spindle rotation must be programmed in the part program if there are no defining parameters in the drilling cycle.


The G functions and the current data record active before the cycle was called remain active beyond the cycle.

Plane definition

In the case of drilling cycles, it is generally assumed that the current workpiece coordinate system in which the machining operation is to be performed is to be defined by selecting plane G17, G18 or G19 and activating a programmable offset. The drilling axis is always the axis of this coordinate system which stands vertically to the current plane.

A tool length compensation must be selected before the cycle is called. Its effect is always perpendicular to the selected plane and remains active even after the end of the cycle.

See the following illustration for length compensation:

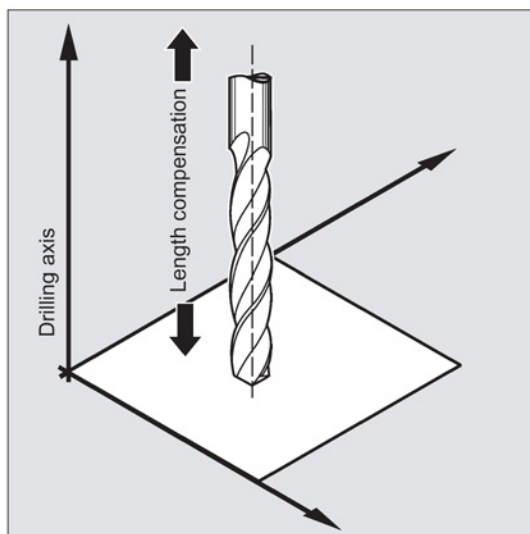

Dwell time programming

The parameters for dwell times in the drilling cycles are always assigned to the F word and must therefore be assigned with values in seconds. Any deviations from this procedure must be expressly stated.

12.4.3 Drilling, centering - CYCLE81

Programming

CYCLE81 (RTP, RFP, SDIS, DP, DPR)

Parameters

Parameter	Data type	Description
RTP	REAL	Retraction plane (absolute)
RFP	REAL	Reference plane (absolute)
SDIS	REAL	Safety clearance (enter without sign)
DP	REAL	Final drilling depth (absolute)
DPR	REAL	Final drilling depth relative to the reference plane (enter without sign)

Function

The tool drills at the programmed spindle speed and feedrate to the entered final drilling depth.

Sequence

Position reached prior to cycle start:

The drilling position is the position in the two axes of the selected plane.

The cycle creates the following sequence of motions:

- Approaching the position of safety distance relative to the reference plane with G0
- Traversing to the final drilling depth with the feedrate (G1) programmed prior to the cycle call
- Retracting to the retraction plane with G0

Explanation of the parameters

RFP and RTP (reference plane and retraction plane)

Normally, reference plane (RFP) and retraction plane (RTP) have different values. The cycle assumes that the retraction plane precedes the reference plane. This means that the distance from the retraction plane to the final drilling depth is larger than the distance from the reference plane to the final drilling depth.

SDIS (safety clearance)


The safety clearance (SDIS) acts with reference to the reference plane. This is brought forward by the safety clearance.

The direction in which the safety clearance is active is automatically determined by the cycle.

DP and DPR (final drilling depth)

The final drilling depth can be specified either absolute (DP) or relative (DPR) to the reference plane.

With relative specification, the cycle will calculate the resulting depth automatically using the positions of reference and retraction planes.

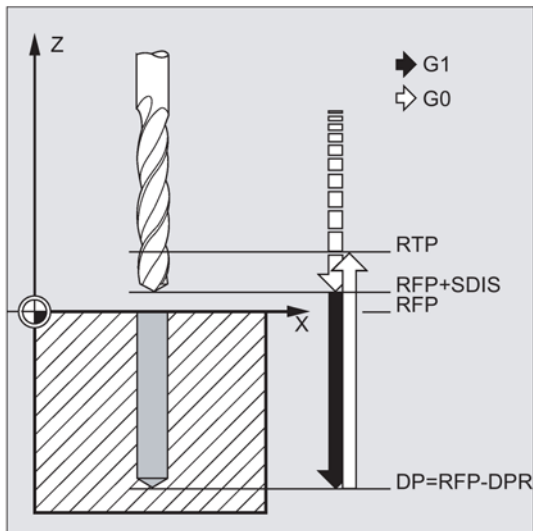


Note

If a value is entered both for DP and for DPR, the final drilling depth is derived from DPR. If this differs from the absolute depth programmed via DP, the message "Depth: Corresponding to value for relative depth" is output in the dialog line.

If the values for reference and retraction planes are identical, a relative depth specification is not permitted. The error message 61101 "Reference plane defined incorrectly" is output and the cycle is not executed. This error message is also output if the retraction plane is located after the reference plane, i.e. its distance to the final drilling depth is smaller.

Programming example: Drilling_centering

This program produces three drill holes using the CYCLE81 drilling cycle. The drilling axis is always the Z axis.

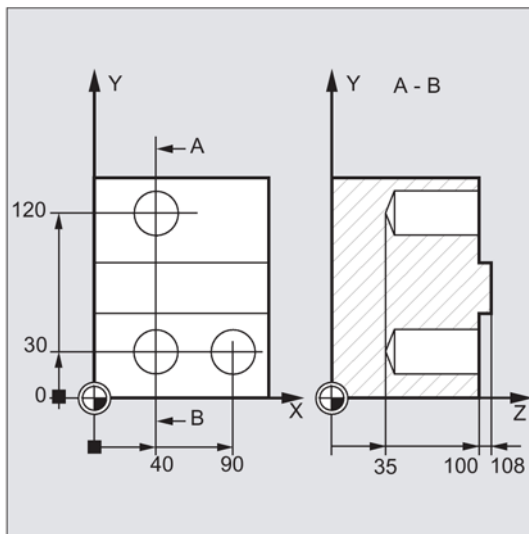

```

N10 G0 G17 G90 F200 S300 M3
N20 D3 T3 Z110
N30 X40 Y120
N40 CYCLE81(110, 100, 2, 35,)

N50 Y30
N60 CYCLE81(110, 102, , 35,)
N70 G0 G90 F180 S300 M03
N80 X90
N90 CYCLE81(110, 100, 2, 65,)
N100 M02

```

```

; Specification of technology values
; Approach retraction plane
; Approach of the first drilling position
; Cycle call with absolute final drilling
depth, safety clearance and incomplete
parameter list
; Approach next drilling position
; Cycle call without safety clearance
; Specification of technology values
; Approach next position
; Cycle call with relative final drilling
depth and safety clearance
; End of program

```

12.4.4 Drilling, counterboring - CYCLE82

Programming

CYCLE82 (RTP, RFP, SDIS, DP, DPR, DTB)

Parameters

Parameter	Data type	Description
RTP	REAL	Retraction plane (absolute)
RFP	REAL	Reference plane (absolute)
SDIS	REAL	Safety clearance (enter without sign)
DP	REAL	Final drilling depth (absolute)
DPR	REAL	Final drilling depth relative to the reference plane (enter without sign)
DTB	REAL	Dwell time at final drilling depth (chip breaking)

Function

The tool drills at the programmed spindle speed and feedrate to the entered final drilling depth. A dwell time can be allowed to elapse when the final drilling depth has been reached.

Sequence

Position reached prior to cycle start:


The drilling position is the position in the two axes of the selected plane.

The cycle creates the following sequence of motions:

- Approaching the position of safety distance relative to the reference plane with G0
- Traversing to the final drilling depth with the feedrate (G1) programmed prior to the cycle call
- Dwell time at final drilling depth
- Retraction to the retraction plane with G0

Explanation of the parameters

For more information about the parameters RTP, RFP, SDIS, DP, DPR, see Section "Drilling, centering - CYCLE81 (Page 157)".

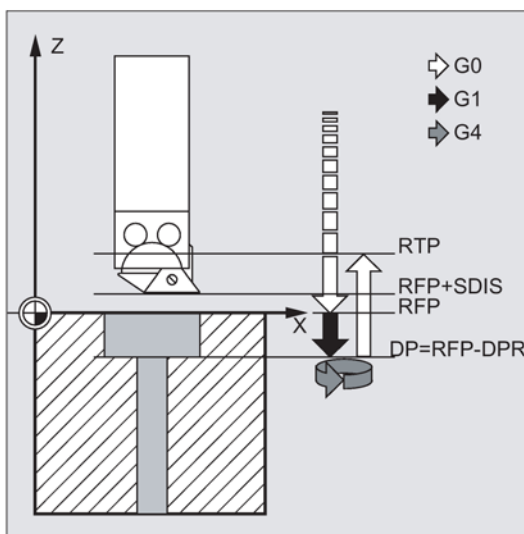


DTB (dwell time)

The dwell time to the final drilling depth (chip breakage) is programmed under DTB in seconds.

Programming example 1: Drilling_counterboring

The program machines a single hole of a depth of 27 mm at position X24 Y15 in the XY plane with cycle CYCLE82.

The dwell time programmed is 2 s, the safety clearance in the drilling axis Z is 4 mm.

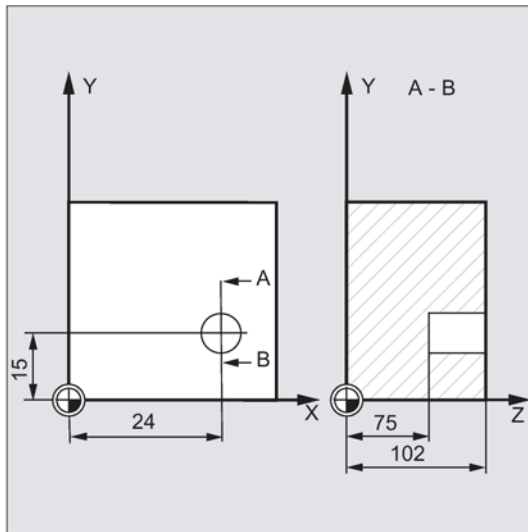

```
N10 G0 G17 G90 F200 S300 M3
N20 D1 T10 Z110
N30 X24 Y15
N40 CYCLE82 (110, 102, 4, 75, , 2)
N50 M02
```

```
; Specification of technology values
; Approach retraction plane
; Approach drilling position
; Cycle call with absolute final drilling
depth and safety clearance
; End of program
```

Programming example 2: Drilling_counterboring

Proceed through the following steps:



1. Select the desired operating area.




2. Open the vertical softkey bar for available drilling cycles.



3. Press this softkey from the vertical softkey bar.



4. Press this softkey to open the window for CYCLE82. Parameterize the cycle as desired.

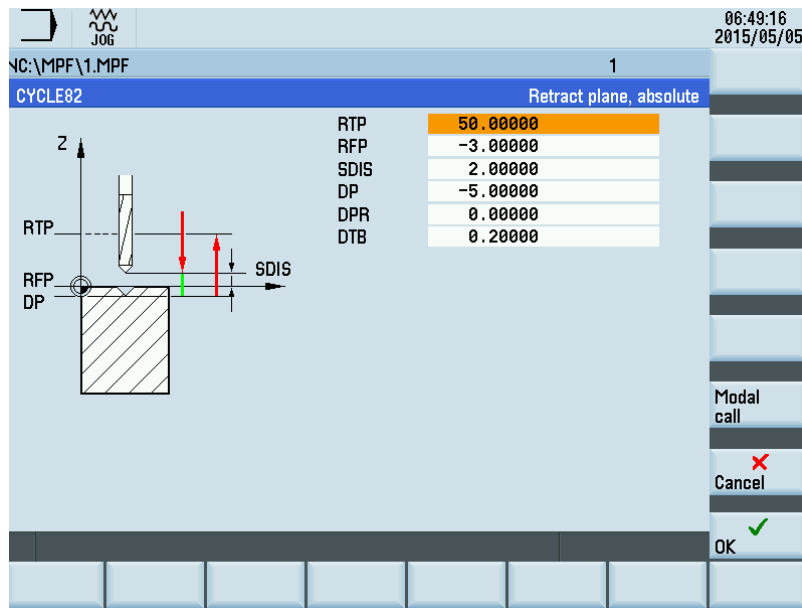

5. Confirm your settings with this softkey. The cycle is then automatically transferred to the program editor as a separate block.

```
NC:\MPF\1.MPF
CYCLE82( 5, 0, 2, -20, 0, 0.5)
==eof==
```

12.4.5 Deep-hole drilling - CYCLE83

Programming

CYCLE83 (RTP, RFP, SDIS, DP, DPR, FDEP, FDPR, DAM, DTB, DTS, FRF, VARI, AXN, MDEP, VRT, DTD, DIS1)

Parameters

Parameter	Data type	Description
RTP	REAL	Retraction plane (absolute)
RFP	REAL	Reference plane (absolute)
SDIS	REAL	Safety clearance (enter without sign)
DP	REAL	Final drilling depth (absolute)
DPR	REAL	Final drilling depth relative to the reference plane (enter without sign)
FDEP	REAL	First drilling depth (absolute)
FDPR	REAL	First drilling depth relative to the reference plane (enter without sign)
DAM	REAL	Amount of degression (enter without sign) Values: >0: degression as value <0: degression factor =0: no degression
DTB	REAL	Dwell time at drilling depth (chip breakage) Values: >0: in seconds <0: in revolutions

Parameter	Data type	Description
DTS	REAL	Dwell time at starting point and for chip removal Values: >0: in seconds <0: in revolutions
FRF	REAL	Feedrate factor for the first drilling depth (enter without sign) Range of values: 0.001 ... 1
VARI	INT	Machining type: Chip breakage=0, Chip removal=1
AXN	INT	Tool axis (values: 1 = 1st geometrical axis; 2 = 2nd geometrical axis; 3 = 3rd geometrical axis)
MDEP	REAL	Minimum drilling depth (only in connection with degression factor)
VRT	REAL	Variable return path with chip breakage (VARI=0) Values: >0: if traction value =0: retraction value 1mm set
DTD	REAL	Dwell time at final drilling depth Values: >0: in seconds <0: in revolutions =0: value same as DTB
DIS1	REAL	Programmable limit distance for reinsertion in the drill hole (for chip removal VARI=1) Values: >0: programmable value applies =0: automatic calculation

Function

The tool drills at the programmed spindle speed and feedrate to the entered final drilling depth.

Deep hole drilling is performed with a depth infeed of a maximum definable depth executed several times, increasing gradually until the final drilling depth is reached.

The drill can either be retracted to the reference plane + safety clearance after every infeed depth for swarf removal or retracted in each case by 1 mm for chip breaking.

Sequence

Position reached prior to cycle start:


The drilling position is the position in the two axes of the selected plane.

The cycle creates the following sequence:

Deep hole drilling with chip removal (VARI=1)


- Approaching the position of safety distance relative to the reference plane with G0
- Traversing to the first drilling depth with G1, the feedrate for which is derived from the feedrate defined with the program call which is subject to parameter FRF (feedrate factor)
- Dwell time at final drilling depth (parameter DTB)
- Retracting to the reference plane brought forward by the safety clearance for swarf removal with G0
- Dwell time at the starting point (parameter DTS)
- Approach of the drilling depth last reached, reduced by anticipation distance with G0
- Traversing to the next drilling depth with G1 (sequence of motions is continued until the final drilling depth is reached)
- Retracting to the retraction plane with G0

See the following illustration for parameters for CYCLE83:

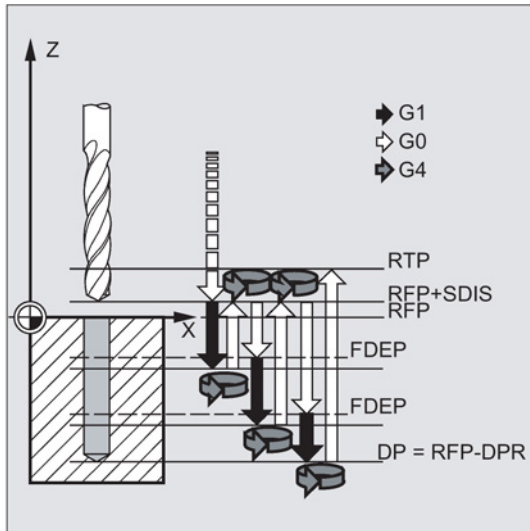

Deep-hole drilling with chip breakage (VARI=0)

- Approach of the reference plane brought forward by the safety clearance by using G0
- Traversing to the first drilling depth with G1, the feedrate for which is derived from the feedrate defined with the program call which is subject to parameter FRF (feedrate factor)
- Dwell time at final drilling depth (parameter DTB)
- Retraction by 1 mm from the current drilling depth with G1 and the feedrate programmed in the calling program (for chip breaking)
- Traversing to the next drilling depth with G1 and the programmed feedrate (sequence of motions is continued until the final drilling depth is reached)
- Retraction to the retraction plane with G0

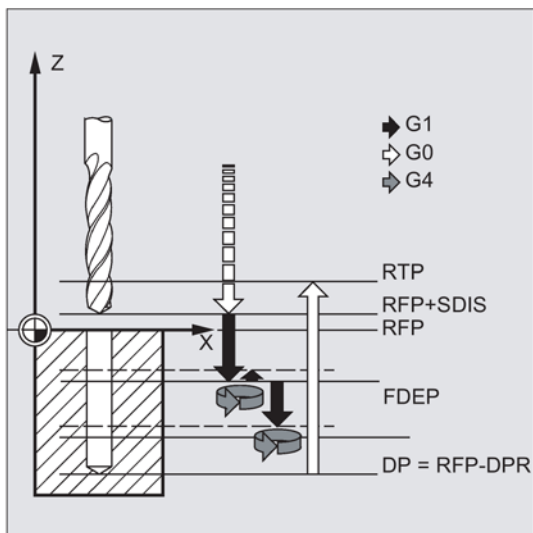

Explanation of the parameters

For more information about the parameters RTP, RFP, SDIS, DP, DPR, see Section "Drilling, centering - CYCLE81 (Page 157)".

Interrelation of the DP (or DPR), FDEP (or FDPR) and DAM parameters

The intermediate drilling depth is calculated in the cycle on the basis of final drilling depth, first drilling depth and amount of degression as follows:

- In the first step, the depth parameterized with the first drilling depth is traversed as long as it does not exceed the total drilling depth
- From the second drilling depth on, the drilling stroke is obtained by subtracting the amount of degression from the stroke of the last drilling depth, provided that the latter is greater than the programmed amount of degression
- The next drilling strokes correspond to the amount of degression, as long as the remaining depth is greater than twice the amount of degression
- The last two drilling strokes are divided and traversed equally and are therefore always greater than half of the amount of degression
- If the value for the first drilling depth is incompatible with the total depth, the error message 61107 "First drilling depth defined incorrectly" is output and the cycle is not executed

The FDPR parameter has the same effect in the cycle as the DPR parameter. If the values for the reference and retraction planes are identical, the first drilling depth can be defined as a relative value.

If the first drilling depth is programmed larger than the final drilling depth, the final drilling depth is never exceeded. The cycle will reduce the first drilling depth automatically as far as the final drilling depth is reached when drilling only once, and will therefore drill only once.

DTB (dwell time)

The dwell time to the final drilling depth (chip breakage) is programmed under DTB in seconds.

DTS (dwell time)

The dwell time at the starting point is only performed if VARI=1 (chip removal).

FRF (feedrate factor)

With this parameter, you can specify a reduction factor for the active feedrate which only applies to the approach to the first drilling depth in the cycle.

VARI (machining type)

If parameter VARI=0 is set, the drill retracts 1 mm after reaching each drilling depth for chip breakage. If VARI=1 (for chip removal), the drill traverses in each case to the reference plane shifted by the amount of the safety clearance.

Note

The anticipation distance is calculated internally in the cycle as follows:

- If the drilling depth is 30 mm, the value of the anticipation distance is always 0.6 mm.
 - For larger drilling depths, the formula $\text{drilling depth} / 50$ is used (maximum value 7 mm).
-

AXN (tool axis)

By programming the drilling axis via AXN, it is possible to omit the switchover from plane G18 to G17 when the deep-hole drilling cycle is used on turning machines.

The identifiers have the following meanings:

AXN=1	First axis of the current plane
AXN=2	Second axis of the current plane
AXN=3	Third axis of the current plane

For example, to machine a center hole (in Z) in the G18 plane, you program:

G18

AXN=1

MDEP (minimum drilling depth)

You can define a minimum drilling depth for drill stroke calculations based on a degression factor. If the calculated drilling stroke becomes shorter than the minimum drilling depth, the remaining depth is machined in strokes equaling the length of the minimum drilling depth.

VRT (variable retraction value for chip breakage with VARI=0)

You can program the retraction path for chip breaking.

DTD (dwell time at final drilling depth)

The dwell time at final drilling depth can be entered in seconds or revolutions.

DIS1 (programmable limit distance for VARI=1)


The limit distance after re-insertion in the hole can be programmed.

The limit distance is calculated within the cycle as follows:

- Up to a drilling depth of 30 mm, the value is set to 0.6 mm.
- For larger drilling depths, the limit distance is the result of $(RFP + SDIS - \text{current depth}) / 50$. If this calculated value > 7 , a limit of 7 mm, maximum, is applied.

Programming example 1: Deep-hole drilling

This program executes the cycle CYCLE83 at the positions X80 Y120 and X80 Y60 in the XY plane. The first drill hole is drilled with a dwell time zero and machining type chip breaking. The final drilling depth and the first drilling depth are entered as absolute values. In the second cycle call, a dwell time of 1 s is programmed. Machining type chip removal is selected, the final drilling depth is relative to the reference plane. The drilling axis in both cases is the Z axis.

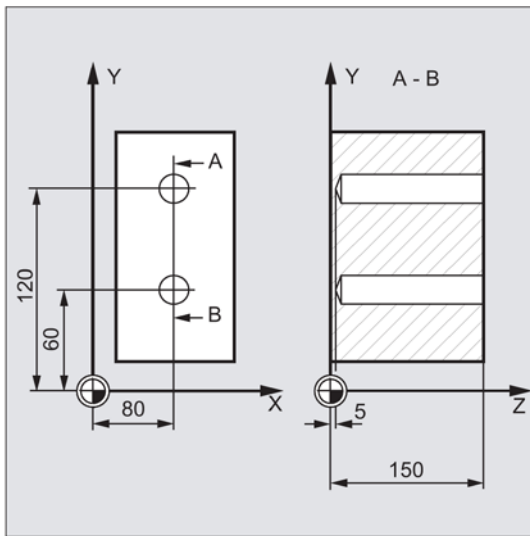

```
N10 G0 G17 G90 F50 S500 M4 ; Specification of technology values
N20 D1 T12 ; Approach retraction plane
N30 Z155
N40 X80 Y120 ; Approach first drilling position
N50 CYCLE83(20,0,3,-15,, -6,,1,1,1,1,0,3,4,3,1,2) ; Call of cycle; depth parameters with absolute values
N60 X80 Y60 ; Approach next drilling position
N70 CYCLE83(20,0,3,-15,, -6,,1,1,1,1,0,3,4,3,1,2) ; Cycle call with relative data for final drilling depth and first drilling depth; the safety clearance is 1 mm and the feedrate factor is 0.5
N80 M02 ; End of program
```

Programming example 2: Deep-hole drilling

Proceed through the following steps:




1. Select the desired operating area.



2. Open the vertical softkey bar for available drilling cycles.



3. Press this softkey to open the window for CYCLE83. Parameterize the cycle as desired.

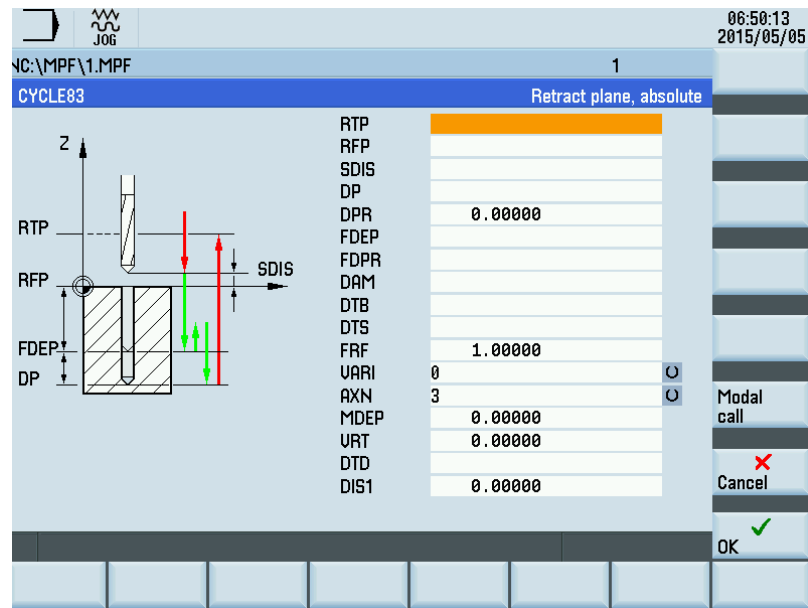

4. Confirm your settings with this softkey. The cycle is then automatically transferred to the program editor as a separate block.



```
NC:\MPF\1.MPF
CYCLE83( , , , 0, , , , 1, 0, 3, 0, 0, , 0)
==eof==
```

12.4.6 Rigid tapping - CYCLE84

Programming

CYCLE84 (RTP, RFP, SDIS, DP, DPR, DTB, SDAC, MPIT, PIT, POSS, SST, SST1, AXN, 0, 0, VARI, DAM, VRT)

Parameters

Parameter	Data type	Description
RTP	REAL	Retraction plane (absolute)
RFP	REAL	Reference plane (absolute)
SDIS	REAL	Safety clearance (enter without sign)
DP	REAL	Final drilling depth (absolute)
DPR	REAL	Final drilling depth relative to the reference plane (enter without sign)
DTB	REAL	Dwell time at final drilling depth (chip breakage)
SDAC	INT	Direction of rotation after end of cycle Values: 3, 4 or 5 (for M3, M4 or M5)
MPIT	REAL	Thread lead as a thread size (signed): Range of values 3 (for M3) to 48 (for M48); the sign determines the direction of rotation in the thread
PIT	REAL	Thread lead as a value (signed) Range of values: 0.001 mm to 2000.000 mm; the sign determines the direction of rotation in the thread
POSS	REAL	Spindle position for oriented spindle stop in the cycle (in degrees)
SST	REAL	Speed for tapping
SST1	REAL	Speed for retraction

Parameter	Data type	Description
AXN	INT	Tool axis (values ¹⁾ : 1 = 1st axis of the current plane; 2 = 2nd axis of the current plane; 3 = 3rd axis of the current plane)
PSYS	INT	Internal parameter; only the default value 0 is possible
PSYS	INT	Internal parameter; only the default value 0 is possible
VARI	INT	Machining type (values: 0 = Tapping in one pass; 1 = Deep-hole tapping with chip breakage; 2 = Deep-hole tapping with chip removal)
DAM	REAL	Incremental drilling depth value range: 0 ≤ Max. value
VRT	REAL	Variable return path with chip breakage value range: 0 ≤ Max. value

¹⁾ The definition of the 1st, 2nd, and 3rd axes depends upon the current plane selected.

Function

The tool drills at the programmed spindle speed and feedrate to the entered final thread depth.

CYCLE84 can be used to make tapped holes without compensating chuck. For tapping with compensating chuck, a separate cycle CYCLE840 is provided.

Note

CYCLE84 can be used if the spindle to be used for the boring operation is technically able to be operated in the position-controlled spindle operation.

Sequence

Position reached prior to cycle start:


The drilling position is the position in the two axes of the selected plane.

The cycle creates the following sequence of motions:

- Approaching the position of safety distance relative to the reference plane with G0
- Oriented spindle stop (value in the parameter POSS) and switching the spindle to axis mode
- Tapping to final drilling depth and speed SST
- Dwell time at thread depth (parameter DTB)
- Retraction to the reference plane brought forward by the safety clearance, speed SST1 and direction reversal
- Retraction to the retraction plane with G0; spindle mode is reinitiated by reprogramming the spindle speed active before the cycle was called and the direction of rotation programmed under SDAC

Explanation of the parameters

For more information about the parameters RTP, RFP, SDIS, DP, DPR, see Section "Drilling, centering - CYCLE81 (Page 157)".

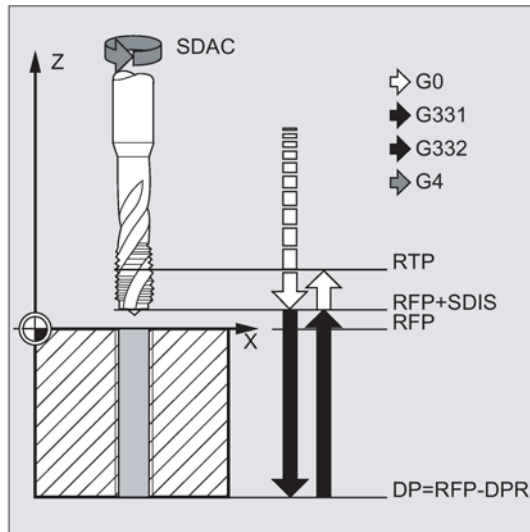

DTB (dwell time)

The dwell time must be programmed in seconds. When tapping blind holes, it is recommended that you omit the dwell time.

SDAC (direction of rotation after end of cycle)

Under SDAC, the direction of rotation after end of cycle is programmed.

For tapping, the direction is changed automatically by the cycle.

MPIT and PIT (thread lead as a thread size and as a value)

The value for the thread lead can be defined either as the thread size (for metric threads between M3 and M48 only) or as a value (distance from one thread turn to the next as a numerical value). Any parameters not required are omitted in the call or assigned the value zero.

RH or LH threads are defined by the sign of the lead parameters:

- Positive value → right (same as M3)
- Negative value → left (same as M4)

If the two lead parameters have conflicting values, alarm 61001 "Thread lead wrong" is generated by the cycle and cycle execution is aborted.

POSS (spindle position)

Before tapping, the spindle is stopped with orientation in the cycle by using the command SPOS and switched to position control.

The spindle position for this spindle stop is programmed under POSS.

SST (speed)

Parameter SST contains the spindle speed for the tapping block with G331.

SST1 (retraction speed)

The speed for retraction from the tapped hole is programmed under SST1.

If this parameter is assigned the value zero, retraction is carried out at the speed programmed under SST.

AXN (tool axis)

The identifiers have the following meanings:

AXN=1	1st axis of the current plane
AXN=2	2nd axis of the current plane
AXN=3	3rd axis of the current plane

For example, to machine a center hole (in Z) in the G17 plane, you program:

G17

AXN=3

Deep-hole tapping: VARI, DAM, VRT

With the VARI parameter, it is possible to distinguish between simple tapping (VARI = 0) and deep-hole tapping (VARI ≠ 0).

In conjunction with deep-hole tapping, it is possible to choose between chip breaking (retraction by variable distance from current drilling depth, parameter VRT, VARI = 1) and chip removal (withdrawal from reference plane VARI = 2). These functions work analogously to the normal deep-hole drilling cycle CYCLE83.

The incremental drilling depth for one pass is specified via parameter DAM. The cycle internally calculates the intermediate depth as follows:


- The programmed incremental drilling depth is executed in each step until the rest up to the final drilling depth is less than ($\leq$) $2 \times \text{DAM}$
- The remaining drilling depth is halved and executed in two steps. Thus, the minimum drilling depth is not smaller than $\text{DAM} / 2$.

Note

The direction of rotation when tapping in the cycle is always reversed automatically.

Programming example 1: Rigid tapping

A thread is tapped without compensating chuck at position X30 Y35 in the XY plane; the tapping axis is the Z axis. No dwell time is programmed; the depth is programmed as a relative value. The parameters for the direction of rotation and for the lead must be assigned values. A metric thread M5 is tapped.

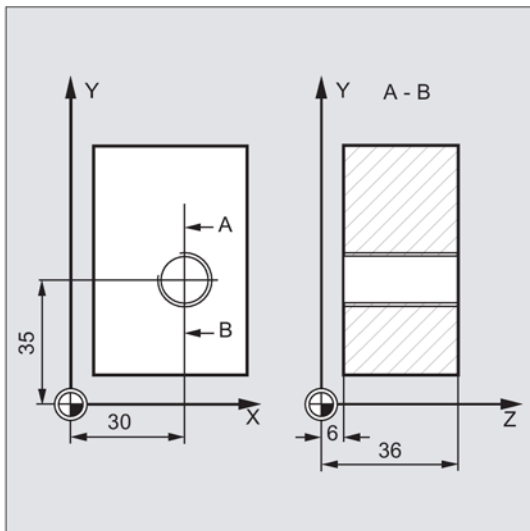

```
N10 G0 G90 T11 D1
N20 G17 X30 Y35 Z40
N30 CYCLE84(20,0,3,-15,,1,3,6,,0,500,500,3,0,0,0,5,0)
N40 M02
```

```
; Specification of technology values
; Approach drilling position
Cycle call; parameter PIT has been omitted; no value is entered for the absolute depth or the dwell time; spindle stop at 90 degrees; speed for tapping is 200, speed for retraction is 500
; End of program
```

Programming example 2: Rigid tapping

Proceed through the following steps:



1. Select the desired operating area.



2. Open the vertical softkey bar for available drilling cycles.



3. Press this softkey from the vertical softkey bar.



4. Press this softkey to open the window for CYCLE84. Parameterize the cycle as desired.



5. Confirm your settings with this softkey. The cycle is then automatically transferred to the program editor as a separate block.

```
NC:\MPF\1.MPF 2
CYCLE84( 5, , 2, -18, 0, 0.5, 3, 12, , 0, 200, 200, 3, 0, 0, 0, , 0)
//
==eof==
```

12.4.7 Tapping with compensating chuck - CYCLE840

Programming

CYCLE840 (RTP, RFP, SDIS, DP, DPR, DTB, SDR, SDAC, ENC, MPIT, PIT, AXN)

Parameters

Parameter	Data type	Description
RTP	REAL	Retraction plane (absolute)
RFP	REAL	Reference plane (absolute)
SDIS	REAL	Safety clearance (enter without sign)
DP	REAL	Final drilling depth (absolute)

Parameter	Data type	Description
DPR	REAL	Final drilling depth relative to the reference plane (enter without sign)
DTB	REAL	Waiting time for spindle reversing
SDR	INT	Direction of rotation for retraction Values: 0 (automatic direction reversal), 3 or 4 (for M3 or M4)
SDAC	INT	Direction of rotation after end of cycle Values: 3, 4 or 5 (for M3, M4 or M5)
ENC	INT	Tapping with/without encoder Values: 0 = with encoder, 1 = without encoder
MPIT	REAL	Thread lead as a thread size (signed): Range of values 3 (for M3) to 48 (for M48)
PST	REAL	Thread lead as a value (signed) Range of values: 0.001 ... 2000.000 mm
AXN	INT	Tool axis (values ¹⁾ : 1 = 1st axis of the current plane; 2 = 2nd axis of the current plane; 3 = 3rd axis of the current plane)

¹⁾ The definition of the 1st, 2nd, and 3rd axes depends upon the current plane selected.

Function

The tool drills at the programmed spindle speed and feedrate to the entered final thread depth.

This cycle is used to program tapping with the compensating chuck:

- Without encoder
- With encoder


Sequence

Tapping with compensating chuck without encoder

Position reached prior to cycle start:

The drilling position is the position in the two axes of the selected plane.

The cycle creates the following sequence of motions:

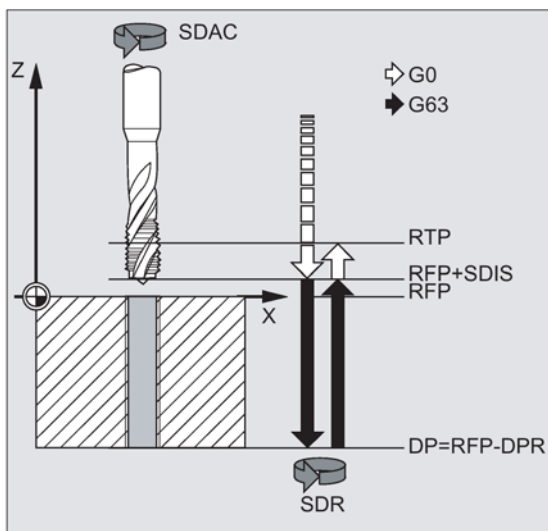

- Approaching the position of safety distance relative to the reference plane with G0
- Tapping to the final drilling depth

- Waiting time for spindle reversing (parameter DTB)
- Retraction to the reference plane brought forward by the safety clearance
- Retraction to the retraction plane with G0


Sequence of operations

Tapping with compensating chuck with encoder

Position reached prior to cycle start:

The drilling position is the position in the two axes of the selected plane.

The cycle creates the following sequence of motions:

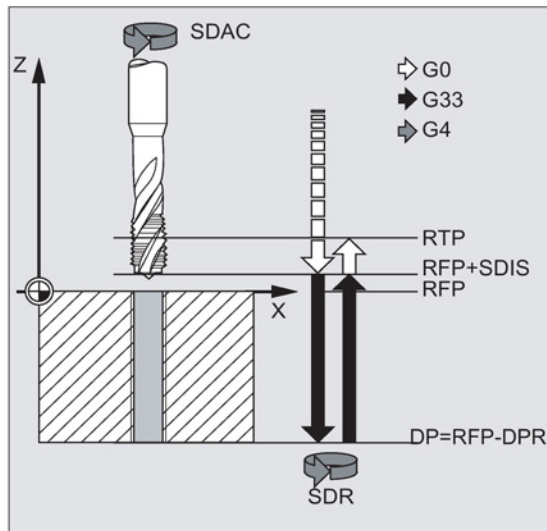

- Approach of the reference plane brought forward by the safety clearance by using G0
- Tapping to the final drilling depth
- Waiting time for spindle reversing (parameter DTB)
- Retraction to the reference plane brought forward by the safety clearance
- Retraction to the retraction plane with G0

Explanation of the parameters

For more information about the parameters RTP, RFP, SDIS, DP, DPR, see Section "Drilling, centering - CYCLE81 (Page 157)".

DTB (waiting time for spindle reversing)

The waiting time must be programmed in seconds. It is only effective in tapping without encoder.

SDR (direction of rotation for retraction)

SDR=0 must be set if the spindle direction is to reverse automatically.

If the machine data is defined such that no encoder is set (in this case, machine data MD30200 \$MA_NUM_ENCS is 0), the parameter must be assigned the value 3 or 4 for the direction of rotation; otherwise, alarm 61202 "No spindle direction programmed" is output and the cycle is aborted.

SDAC (direction of rotation)

Because the cycle can also be called modally (see Section "Graphical cycle programming in the program editor (Page 154)"), it requires a direction of rotation for tapping further threaded holes. This is programmed in parameter SDAC and corresponds to the direction of rotation programmed before the first call in the higher-level program. If SDR=0, the value assigned to SDAC has no meaning in the cycle and can be omitted in the parameterization.

ENC (tapping)

If tapping is to be performed without encoder although an encoder exists, parameter ENC must be assigned value 1.

If, however, no encoder is installed and the parameter is assigned the value 0, it is ignored in the cycle.

MPIT and PIT (thread lead as a thread size and as a value)

The parameter for the lead is only relevant if tapping is performed with encoder. The cycle calculates the feedrate from the spindle speed and the lead.

The value for the thread lead can be defined either as the thread size (for metric threads between M3 and M48 only) or as a value (distance from one thread turn to the next as a numerical value). Any parameters not required are omitted in the call or assigned the value zero.

If the two lead parameters have conflicting values, alarm 61001 "Thread lead wrong" is generated by the cycle and cycle execution is aborted.

Note

Depending on the settings in machine data MD30200 \$MA_NUM_ENCS, the cycle selects whether tapping is to be performed with or without encoder.

The direction of rotation for the spindle must be programmed with M3 or M4.

In thread blocks with G63, the values of the feedrate override switch and spindle speed override switch are frozen to 100%.


A longer compensating chuck is usually required for tapping without encoder.

AXN (tool axis)

The following figure presents the options for the drilling axes to be selected.

With G17:

- AXN=1; Corresponds to X
- AXN=2; Corresponds to Y
- AXN=3; Corresponds to Z

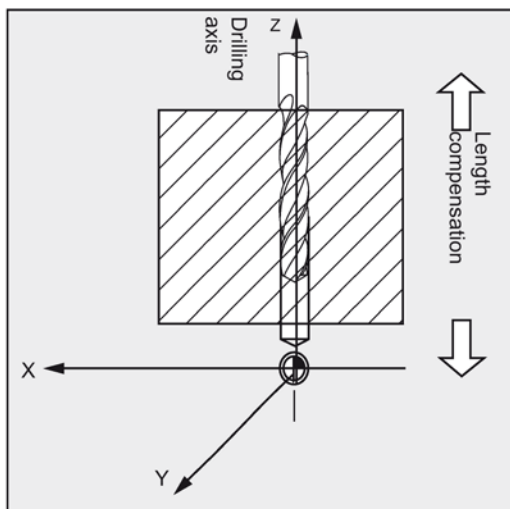

Using AXN (number of the drilling axis) to program the drilling axis enables the drilling axis to be directly programmed.

AXN=1	1st axis of the current plane
AXN=2	2nd axis of the current plane
AXN=3	3rd axis of the current plane


For example, to machine a hole in the G17 plane with Z axis, you program:

G17

AXN=3

Programming example: Tapping without encoder

In this program, a thread is tapped without encoder at position X35 Y35 in the XY plane; the tapping axis is the Z axis. The parameters SDR and SDAC for the direction of rotation must be assigned; parameter ENC is assigned the value 1, the value for the depth is the absolute value. Lead parameter PIT can be omitted. A compensating chuck is used in machining.

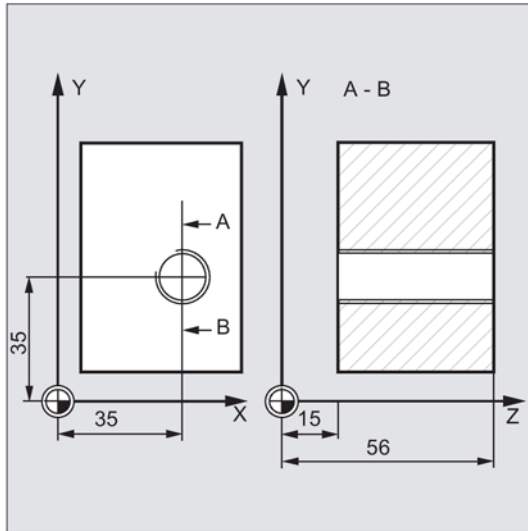

```

N10 G90 G0 T11 D1 S500 M3
N20 G17 X35 Y35 Z60
N30 G1 F200
N40 CYCLE840(20,0,3,-15,,1,4,3,1,6,,3)

N50 M02

```


```

; Specification of technology values
; Approach drilling position
; Setting the path feedrate
Cycle call, waiting time for spindle
reversing 1 s, direction of rotation for
retraction M4, direction of rotation
after cycle M3, no safety clearance,
parameters MPIT and PIT have been omitted
; End of program

```

Programming example: Tapping with encoder

In this program, a thread is tapped with encoder at position X35 Y35 in the XY plane. The drilling axis is the Z axis. The lead parameter must be defined, automatic reversal of the direction of rotation is programmed. A compensating chuck is used in machining.

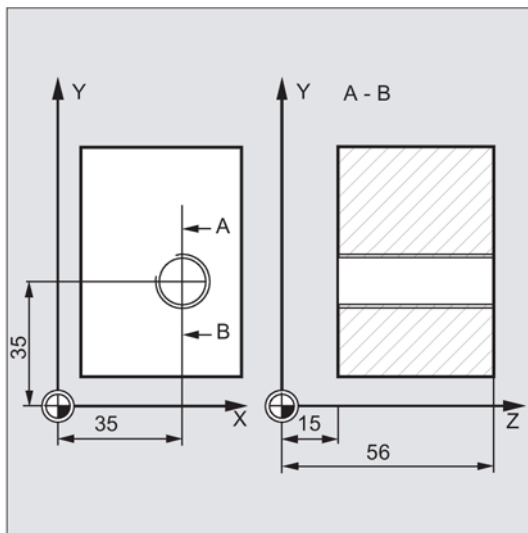

```

N10 G90 G0 T11 D1 S500 M4
N20 G17 X35 Y35 Z60
N30 CYCLE840(20,0,3,-15,,1,3,4,1,6,,3)
N40 M02

```

```

; Specification of technology values
; Approach drilling position
; Cycle call, without safety clearance,
with absolute depth specification
; End of program

```

12.4.8 Reaming 1 - CYCLE85

Programming

CYCLE85 (RTP, RFP, SDIS, DP, DPR, DTB, FFR, RFF)

Parameters

Parameter	Data type	Description
RTP	REAL	Retraction plane (absolute)
RFP	REAL	Reference plane (absolute)
SDIS	REAL	Safety clearance (enter without sign)
DP	REAL	Final drilling depth (absolute)
DPR	REAL	Final drilling depth relative to the reference plane (enter without sign)
DTB	REAL	Dwell time at final drilling depth (chip breakage)
FFR	REAL	Feedrate
RFF	REAL	Retraction feedrate

Function

The tool drills at the programmed spindle speed and feedrate velocity to the entered final drilling depth.

The inward and outward movement is performed at the feedrate assigned to FFR and RFF respectively.

Sequence

Position reached prior to cycle start:


The drilling position is the position in the two axes of the selected plane.

The cycle creates the following sequence of motions:

- Approaching the position of safety distance relative to the reference plane with G0
- Traversing to the final drilling depth with G1 and at the feedrate programmed under the parameter FFR
- Dwell time at final drilling depth
- Retracting to a position of safety distance relative to the reference plane with G1 and the retraction feedrate defined by the parameter RFF
- Retracting to the retraction plane with G0

Explanation of the parameters

For more information about the parameters RTP, RFP, SDIS, DP, DPR, see Section "Drilling, centering - CYCLE81 (Page 157)".

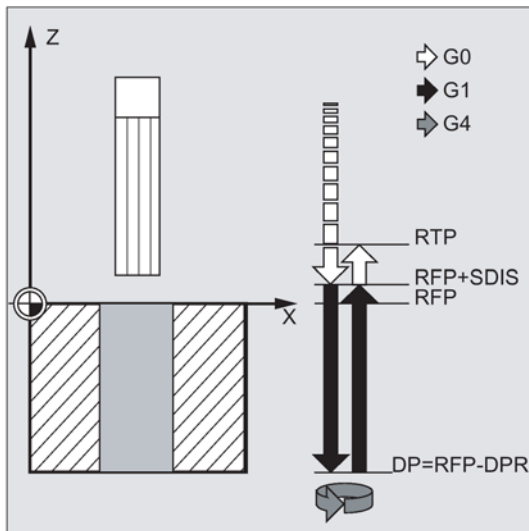

DTB (dwell time)

The dwell time to the final drilling depth is programmed under DTB in seconds.

FFR (feedrate)


The feedrate value programmed under FFR is active in drilling.

RFF (retraction feedrate)

The feedrate value programmed under RFF is active when retracting from the hole to the reference plane + safety clearance.

Programming example: First drilling

CYCLE85 is called at position Z70 X50 in the ZX plane. The drilling axis is the Y axis. The value for the final drilling depth in the cycle call is programmed as a relative value; no dwell time is programmed. The workpiece upper edge is at Y102.

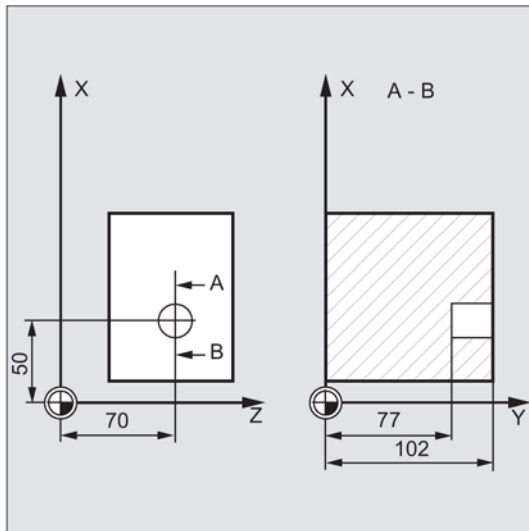

```

N10 T11 D1
G1 F200 M3 S200
N20 G18 Z70 X50 Y105
N30 CYCLE85(105, 102, 2, , 25, , 300, 450)
N40 M02

```

```

; Approach drilling position
; Cycle call, no dwell time programmed
; End of program

```

12.4.9 Boring - CYCLE86

Programming

CYCLE86 (RTP, RFP, SDIS, DP, DPR, DTB, SDIR, RPA, RPO, RPAP, POSS)

Parameters

Parameter	Data type	Description
RTP	REAL	Retraction plane (absolute)
RFP	REAL	Reference plane (absolute)
SDIS	REAL	Safety clearance (enter without sign)
DP	REAL	Final drilling depth (absolute)
DPR	REAL	Final drilling depth relative to the reference plane (enter without sign)
DTB	REAL	Dwell time at final drilling depth (chip breakage)
SDIR	INT	Direction of rotation Values: 3 (for M3), 4 (for M4)
RPA	REAL	Retraction path along the first axis of the plane (incremental, enter with sign)
RPO	REAL	Retraction path along the second axis of the plane (incremental, enter with sign)
RPAP	REAL	Retraction path along the drilling axis (incremental, enter with sign)
POSS	REAL	Spindle position for oriented spindle stop in the cycle (in degrees)

Function

The cycle supports boring of holes with a boring bar.

The tool drills at the programmed spindle speed and feedrate velocity up to the entered drilling depth.

With drilling 2, oriented spindle stop is activated once the drilling depth has been reached. Then, the programmed retraction positions are approached in rapid traverse, and from there the retraction plane is approached.

Sequence

Position reached prior to cycle start:


The drilling position is the position in the two axes of the selected plane.

The cycle creates the following sequence of motions:

- Approaching the position of safety distance relative to the reference plane with G0
- Traversing to final drilling depth with G1 and the feedrate programmed prior to the cycle call
- Dwell time to final drilling depth
- Oriented spindle stop at the spindle position programmed under POSS
- Traverse retraction path in up to three axes with G0
- Retracting in the drilling axis to the position of safety distance relative to the reference plane with G0
- Retracting to the retraction plane with G0 (initial drilling position in both axes of the plane)

Explanation of the parameters

For more information about the parameters RTP, RFP, SDIS, DP, DPR, see Section "Drilling, centering - CYCLE81 (Page 157)".

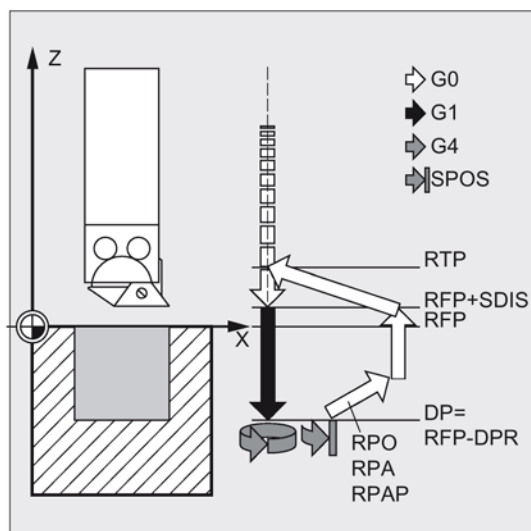

DTB (dwell time)

The dwell time to the final drilling depth (chip breakage) is programmed under DTB in seconds.

SDIR (direction of rotation)

With this parameter, you determine the direction of rotation with which boring is performed in the cycle. If values other than 3 or 4 (M3/M4) are generated, alarm 61102 "No spindle direction programmed" is generated and the cycle is not executed.

RPA (retraction path along the first axis)

Use this parameter to define a retraction movement along the first axis (abscissa), which is executed after the final drilling depth has been reached and oriented spindle stop has been performed.

RPO (retraction path along the second axis)

Use this parameter to define a retraction movement along the second axis (ordinate), which is executed after the final drilling depth has been reached and oriented spindle stop has been performed.

RPAP (retraction path along the drilling axis)

You use this parameter to define a retraction movement along the drilling axis, which is executed after the final drilling axis has been reached and oriented spindle stop has been performed.

POSS (spindle position)


Use POSS to program the spindle position for the oriented spindle stop in degrees, which is performed after the final drilling depth has been reached.

Note

It is possible to stop the active spindle with orientation. The angular value is programmed using a transfer parameter. CYCLE86 can be used only if the spindle to be used for the drilling operation is technically able to execute the SPOS command.

Programming example: Second drilling

CYCLE86 is called at position X70 Y50 in the XY plane. The drilling axis is the Z axis. The final drilling depth is programmed as an absolute value; no safety clearance is specified. The dwell time at the final drilling depth is 2 sec. The top edge of the workpiece is positioned at Z110. In the cycle, the spindle is to rotate with M3 and to stop at 45 degrees.

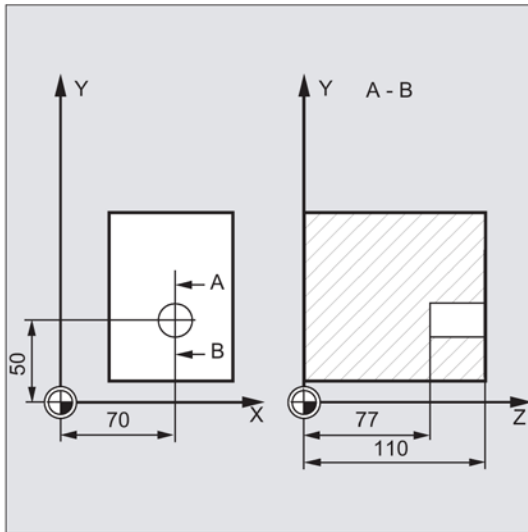

```
N10 G0 G17 G90 F200 S300 M3
N20 T11 D1 Z112
N30 X70 Y50
N40 CYCLE86(112, 110, , 77, 0, 2, 3, -1, -1, 1, 45)
N50 M02
```

```
; Specification of technology values
; Approach retraction plane
; Approach drilling position
; Cycle call with absolute drilling depth
; End of program
```

12.5 Drilling pattern cycles

The drilling pattern cycles only describe the geometry of an arrangement of drilling holes in the plane. The link to a drilling process is established via the modal call of this drilling cycle before the drilling pattern cycle is programmed.

12.5.1 Requirements

Drilling pattern cycles without drilling cycle call

Drilling pattern cycles can also be used for other applications without prior modal call of a drilling cycle because the drilling pattern cycles can be parameterized without reference to the drilling cycle used.

If there was no modal call of the subroutine prior to calling the drilling pattern cycle, error message 62100 "No drilling cycle active" appears.

To acknowledge the error message, press the following key:



To continue the program execution, press the following key:



The drilling pattern cycle will then approach each of the positions calculated from the input data one after the other without calling a subroutine at these points.

Behavior when quantity parameter is zero

The number of holes in a drilling pattern must be parameterized. If the value of the quantity parameter is zero when the cycle is called (or if this parameter is omitted from the parameter list), alarm 61103 "Number of holes is zero" is issued and the cycle is aborted.

Checks in case of limited ranges of input values

Generally, there are no plausibility checks for defining parameters in the drilling pattern cycles.

12.5.2 Row of holes - HOLES1

Programming

HOLES1 (SPCA, SPCO, STA1, FDIS, DBH, NUM)

Parameters




Parameter	Data type	Description
SPCA	REAL	First axis of the plane (abscissa) of a reference point on the straight line (absolute)
SPCO	REAL	Second axis of the plane (ordinate) of this reference point (absolute)
STA1	REAL	Angle to the first axis of the plane (abscissa) Range of values: $-180 < STA1 \leq 180$ degrees
FDIS	REAL	Distance from the first hole to the reference point (enter without sign)
DBH	REAL	Distance between the holes (enter without sign)
NUM	INT	Number of holes

Function


This cycle can be used to produce a row of holes, i.e. a number of holes arranged along a straight line, or a grid of holes. The type of hole is determined by the drilling cycle that has already been called modally.

Sequence

To avoid unnecessary travel, the cycle calculates whether the row of holes is machined starting from the first hole or the last hole from the actual position of the plane axes and the geometry of the row of holes. The drilling positions are then approached one after the other at rapid traverse.

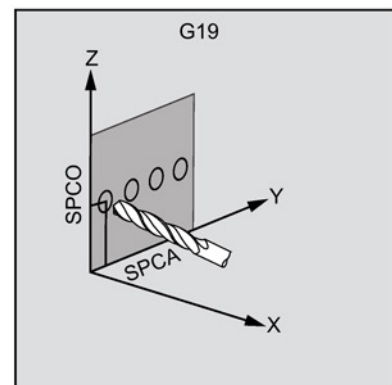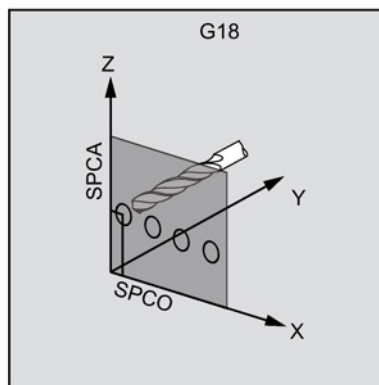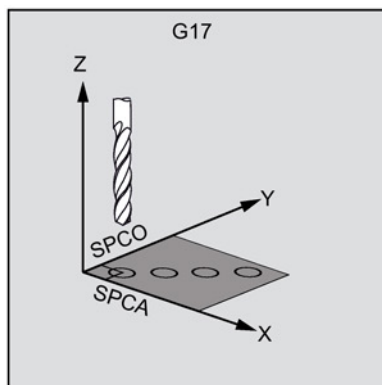

Explanation of the parameters

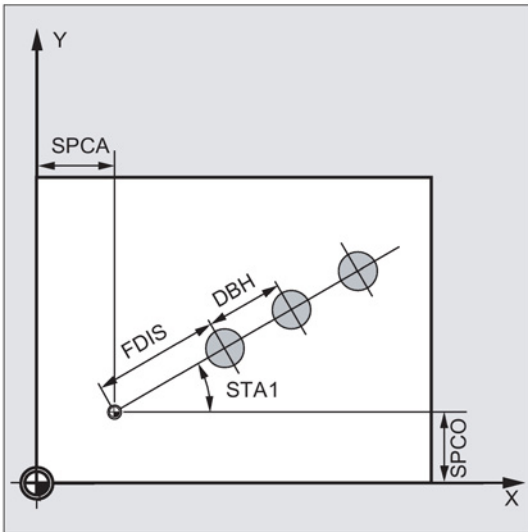

SPCA and SPCO (reference point on the first axis of the plane and of the second axis of the plane)

One point along the straight line of the row of holes is defined as the reference point for determining the spacing between the holes. The distance to the first hole FDIS is defined from this point.

STA1 (angle)

The straight line can be arranged in any position in the plane. It is specified both by the point defined by SPCA and SPCO and by the angle contained by the straight line and the first axis of the workpiece coordinate system that is active when the cycle is called. The angle is entered under STA1 in degrees.

FDIS and DBH (distance)


The distance of the first hole and the reference point defined under SPCA and SPCO is programmed with FDIS. The parameter DBH contains the distance between any two holes.

NUM (number)

The NUM parameter is used to define the number of holes.

Programming example: Row of holes

Use this program to machine a row of holes consisting of five tapped holes arranged parallel to the Z axis of the ZX plane and which have a distance of 20 mm one to another. The starting point of the row of holes is at Z20 and X30 whereby the first hole has a distance of 10 mm from this point. The geometry of the row of holes is described by the cycle HOLES1. First, drilling is carried out using CYCLE82, and then tapping is performed using CYCLE84 (tapping without compensating chuck). The holes are 80 mm in depth (difference between reference plane and final drilling depth).

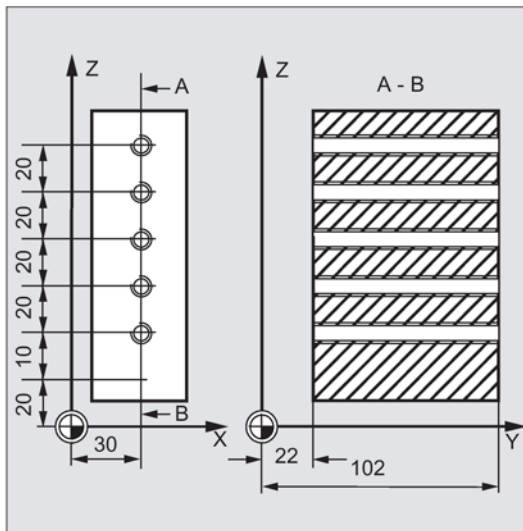

```

N10 G90 F30 S500 M3 T10 D1
N20 G17 G90 X20 Z105 Y30
N30 MCALL CYCLE82(105, 102, 2, 22, 0, 1)
N40 HOLES1(20, 30, 0, 10, 20, 5)

N50 MCALL
...
N60 G90 G0 X30 Z110 Y105
N70 MCALL CYCLE84(105, 102, 2, 22, 0, , 3, , 4.2, ,300, )
N80 HOLES1(20, 30, 0, 10, 20, 5)

N90 MCALL
N100 M02

```

```


; Specification of the technological
; values for the machining step
; Approach start position
; Modal call of drilling cycle
; Call of row-of-holes cycle; the cycle
; starts with the first hole; only the
; drill positions are approached in this
; cycle
; Deselect modal call
; Change tool
; Approach position next to 5th hole
; Modal call of the tapping cycle
; Call of row of holes cycle starting
; with the fifth hole in the row
; Deselect modal call
; End of program

```

Programming example: Grid of holes

Use this program to machine a grid of holes consisting of five rows with five holes each, which are arranged in the XY plane, with a spacing of 10 mm between them. The starting point of the grid is at X30 Y20.

The example uses R parameters as transfer parameters for the cycle.

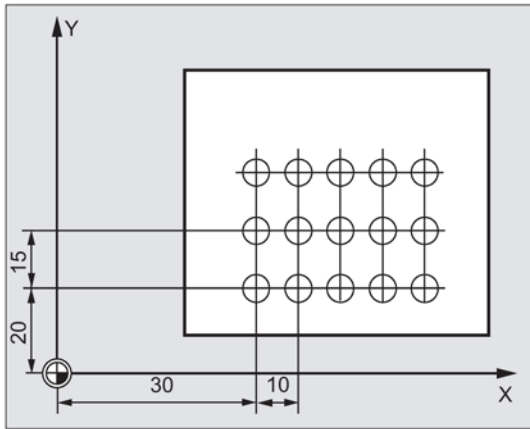

```
R10=102 ; Reference plane
R11=105 ; Retraction plane
R12=2 ; Safety clearance
R13=75 ; Drilling depth
R14=30 ; Reference point for the row of holes in the first axis of
R15=20 the plane
R16=0 ; Reference point for the row of holes in the second axis of
R17=10 the plane
R18=10 ; Starting angle
R19=5 ; Distance from first hole to reference point
R20=5 ; Distance between the holes
R21=0 ; Number of holes per row
R22=10 ; Number of rows
; Row counter
; Distance between the rows
; Specification of the technological values
N10 G90 F300 S500 M3 T10 D1
N20 G17 G0 X=R14 Y=R15 Z105 ; Approach starting position
N30 MCALL CYCLE82(R11, R10, R12, R13, ; Modal call of drilling cycle
0, 1)
N40 LABEL1: ; Call of row of holes cycle
N41 HOLES1(R14, R15, R16, R17, R18,
R19)
N50 R15=R15+R22 ; Calculate y value for the next line
N60 R21=R21+1 ; Increment line counter
N70 IF R21<R20 GOTOB LABEL1 ; Return to LABEL1 if the condition is fulfilled
N80 MCALL ; Deselect modal call
N90 G90 G0 X30 Y20 Z105 ; Approach starting position
N100 M02 ; End of program
```

12.5.3 Circle of holes - HOLES2

Programming

HOLES2 (CPA, CPO, RAD, STA1, INDA, NUM)

Parameters


Parameter	Data type	Description
CPA	REAL	Center point of circle of holes (absolute), first axis of the plane
CPO	REAL	Center point of circle of holes (absolute), second axis of the plane
RAD	REAL	Radius of circle of holes (enter without sign)

Parameter	Data type	Description
STA1	REAL	Starting angle Range of values: $-180 < STA1 \leq 180$ degrees
INDA	REAL	Incrementing angle
NUM	INT	Number of holes

Function


Use this cycle to machine a circle of holes. The machining plane must be defined before the cycle is called.

The type of hole is determined through the drilling cycle that has already been called modally.

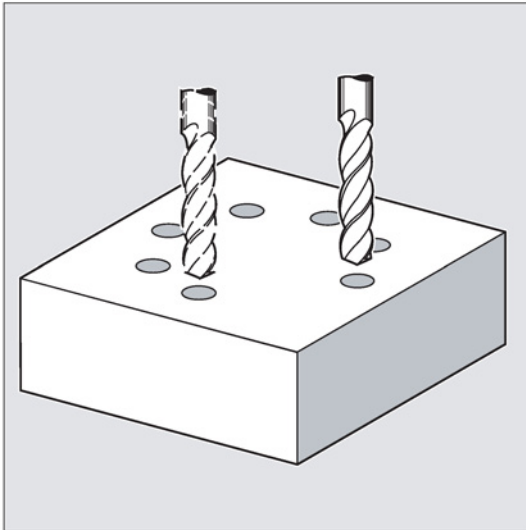


Sequence

In the cycle, the drilling positions are approached one after the other in the plane with G0.

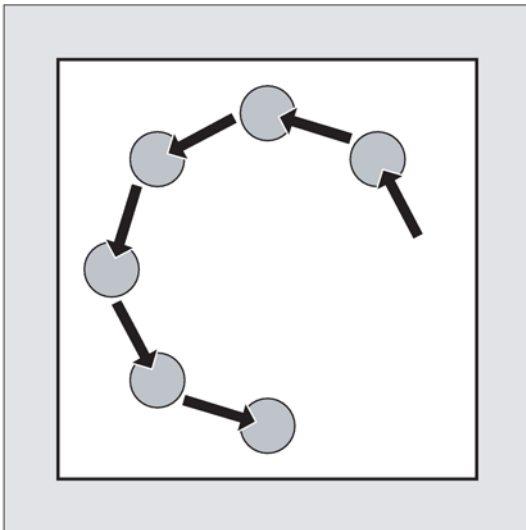

Explanation of the parameters

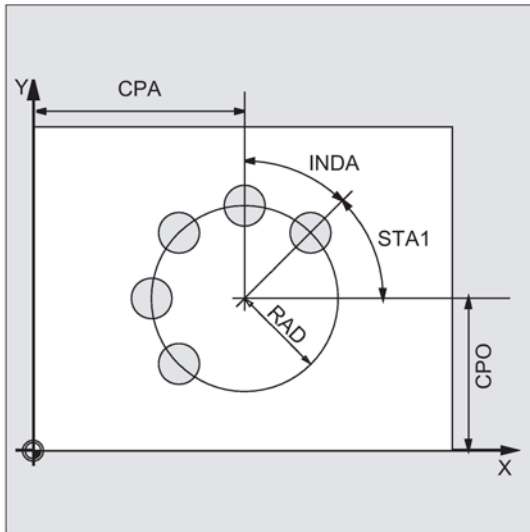

CPA, CPO and RAD (center point position and radius)

The position of the circle of holes in the machining plane is defined via center point (parameters CPA and CPO) and radius (parameter RAD). Only positive values are permitted for the radius.

STA1 and INDA (starting and incremental angle)

These parameters define the arrangement of the holes on the circle of holes.

The STA1 parameter defines the angle of rotation between the positive direction of the first axis (abscissa) in the workpiece coordinate system active before the cycle was called and the first hole. The INDA parameter contains the angle of rotation from one hole to the next.


If the INDA parameter is assigned the value zero, the indexing angle is calculated internally from the number of holes which are positioned equally in a circle.

NUM (number)

The NUM parameter defines the number of holes.

Programming example 1: Circle of holes

The program uses CYCLE82 to produce four holes having a depth of 30 mm. The final drilling depth is specified as a relative value to the reference plane. The circle is defined by the center point X70 Y60 and the radius 42 mm in the XY plane. The starting angle is 33 degrees. The safety clearance in drilling axis Z is 2 mm.

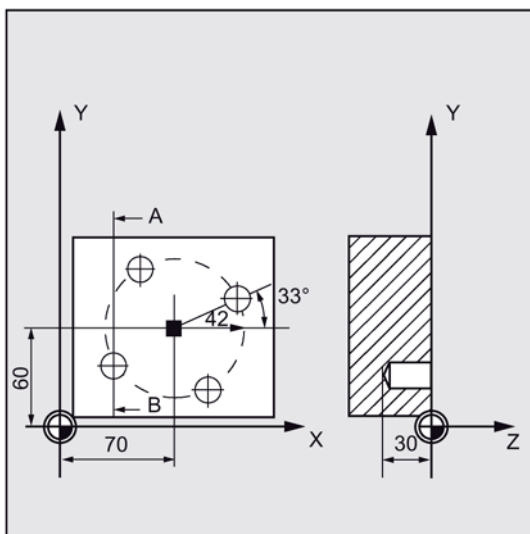

```

N10 G90 F140 S170 M3 T10 D1
N20 G17 G0 X50 Y45 Z2
N30 MCALL CYCLE82(2, 0, 2, , 30, 0)
N40 HOLES2 (70, 60, 42, 33, 0, 4)

N50 MCALL
N60 M02

```

```

; Specification of technology values
; Approach starting position
; Modal call of the drilling cycle, with-
out dwell time, DP is not programmed
; Call of the circle-of-holes cycle; the
incremental angle is calculated in the
cycle since the parameter INDA has been
omitted
; Deselect modal call
; End of program

```

Programming example 1: Circle of holes

Proceed through the following steps:



1. Select the desired operating area.




2. Open the vertical softkey bar for available drilling cycles.



3. Press this softkey from the vertical softkey bar.



4. Press this softkey to open the window for this cycle. Parameterize the cycle as desired.

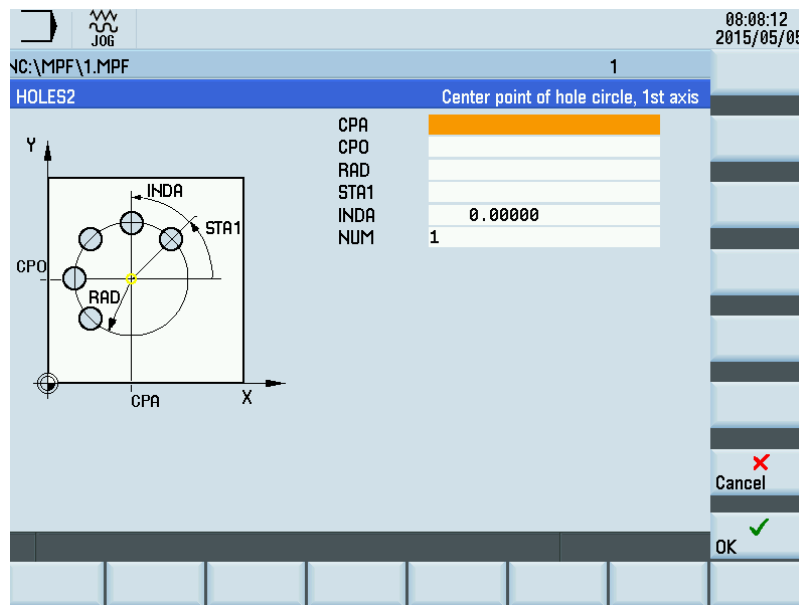

5. Confirm your settings with this softkey. The cycle is then automatically transferred to the program editor as a separate block.

```

NC:\MPF\1.MPF
HOLES2( , , , 0, 1)
==eof==

```

12.5.4 Arbitrary positions - CYCLE802

Programming


CYCLE802 (111111111, 111111111, X0, Y0, X1, Y1, X2, Y2, X3, Y3, X4, Y4)

Parameters

Parameter	Data type	Description
PSYS	INT	Internal parameter, only the default value 111111111 is possible
PSYS	INT	Internal parameter, only the default value 111111111 is possible
X0	REAL	First position in the X axis
Y0	REAL	First position in the Y axis
X1	REAL	Second position in the X axis
Y1	REAL	Second position in the Y axis
X2	REAL	Third position in the X axis
Y2	REAL	Third position in the Y axis
X3	REAL	Fourth position in the X axis
Y3	REAL	Fourth position in the Y axis
X4	REAL	Fifth position in the X axis
Y4	REAL	Fifth position in the Y axis

Function

This cycle allows you to freely program positions, i.e., rectangular or polar. Individual positions are approached in the order in which you program them.

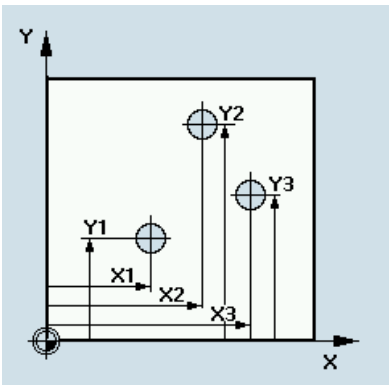

Sequence

The drilling tool in the program traverses all programmed positions in the order in which you program them. Machining of the positions always starts at the reference point. If the position pattern consists of only one position, the tool is retracted to the retraction plane after machining.

Explanation of the parameters

X0, Y0...X4, Y4

All positions will be programmed absolutely.

Programming example:

Drilling in G17 at the Positions

```
X20 Y20  
X40 Y25  
X30 Y40  
N10 G90 G17 ; Absolute dimension data X/Y plane
```

N20 T10	; Selects the tool
N30 M06	; Tool change
S800 M3	; Spindle speed clockwise rotation of the spindle
M08 F140	; Feedrate Coolant on
G0 X0 Y0 Z20	; Approach starting position
MCALL CYCLE82 (2, 0, 2, -5, 5, 0)	; Modal call of the drilling
N40 CYCLE802 (11111111, 11111111, 20, 20, 40, 25, 30, 40)	; call cycle positions
N50 MCALL	; Deselect modal call
N60 M30	; End of the program

12.6 Milling cycles

12.6.1 Requirements

Call and return conditions

Milling cycles are programmed independently of the particular axis name.

Before you call the milling cycles, a tool compensation must be activated.

The appropriate values for feedrate, spindle speed and direction of rotation of spindle must be programmed in the part program if the appropriate parameters are not provided in the milling cycle.


The center point coordinates for the milling pattern or the pocket to be machined are programmed in a rectangular coordinate system.

The G functions active prior to the cycle call and the current programmable frame remain active beyond the cycle.

Plane definition

Milling cycles generally assume that the current workpiece coordinate system has been defined by selecting a plane (G17, G18 or G19) and activating a programmable frame (if necessary). The infeed axis is always the third axis of this coordinate system.

See the following illustration for plane and axis assignment:

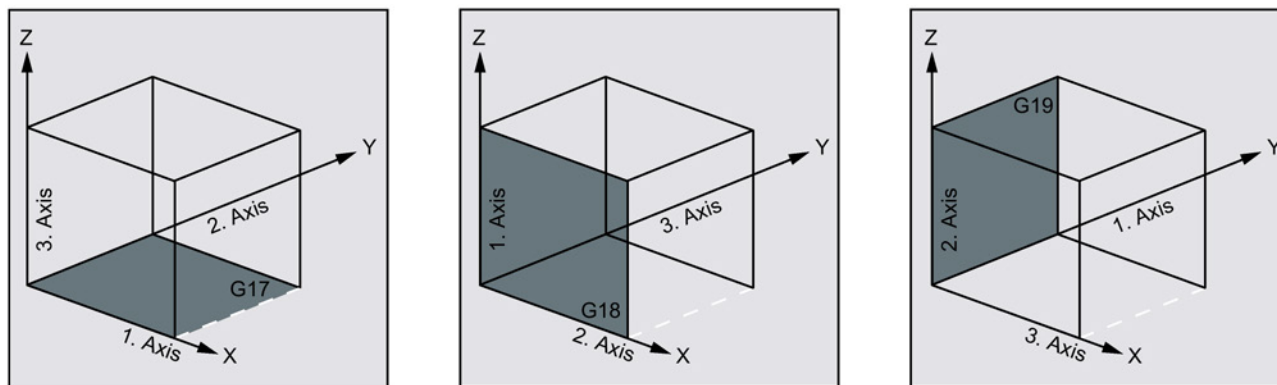

Messages with regard to the machining state

During the execution of the milling cycles, various messages that refer to the machining status are displayed on the screen. The following messages are possible:

- "Elongated hole <No.>(first figure) being machined"
- "Slot <No.>(other figure) being machined"
- "Circumferential slot <No.>(last figure) being machined"

In each case, <No.> stands for the number of the figure that is currently being machined.

These messages do not interrupt the program execution and continue to be displayed until the next message is displayed or the cycle is completed.

12.6.2 Face milling - CYCLE71

Programming

CYCLE71 (_RTP, _RFP, _SDIS, _DP, _PA, _PO, _LENG, _WID, _STA, _MID, _MIDA, _FDP, _FALD, _FFP1, _VARI, _FDP1)

Parameters


Parameter	Data type	Description
_RTP	REAL	Retraction plane (absolute)
_RFP	REAL	Reference plane (absolute)
_SDIS	REAL	Safety clearance (to be added to the reference plane; enter without sign)
_DP	REAL	Depth (absolute)
_PA	REAL	Starting point (absolute), first axis of the plane
_PO	REAL	Starting point (absolute), second axis of the plane
_LENG	REAL	Rectangle length along the first axis, incremental. The corner from which the dimension starts results from the sign.
_WID	REAL	Rectangle length along the second axis, incremental. The corner from which the dimension starts results from the sign.
_STA	REAL	Angle between the longitudinal axis of the rectangle and the first axis of the plane (abscissa, enter without sign). Range of values: $0^\circ \leq STA < 180^\circ$
_MID	REAL	Maximum infeed depth (enter without sign)
_MIDA	REAL	Maximum infeed width during solid machining in the plane as a value (enter without sign)
_FDP	REAL	Retraction travel in the finishing direction (incremental, enter without sign)
_FALD	REAL	Finishing allowance in depth (incremental, enter without sign)
_FFP1	REAL	Feedrate for surface machining
_VARI	INT	Machining type (enter without sign) UNITS DIGIT Values: 1 roughing, 2 finishing TENS DIGIT: Values: 1: parallel to the first axis of the plane, in one direction, 2: parallel to the second axis of the plane, in one direction, 3: parallel to the first axis of the plane, with alternating direction 4: parallel to the second axis of the plane, with alternating direction
_FDP1	REAL	Overrun travel in the direction of the plane infeed (incremental, enter without sign)

Function

Use CYCLE71 to mill any rectangular surface. The cycle differentiates between roughing (machining the surface in several steps until reaching the final machining allowance) and finishing (milling the end face in one step). The maximum infeed in width and depth can be specified.

The cycle operates without cutter radius compensation. The depth infeed is performed in the open.

See the following illustration for possible face milling strategies:

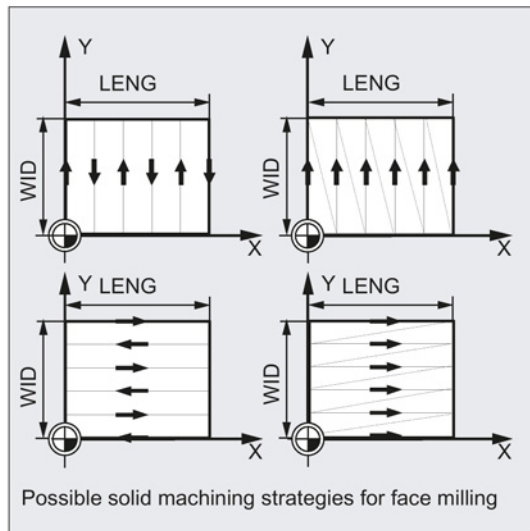

Sequence

Position reached prior to cycle start:

Starting position is any position from which the infeed point can be approached at the height of the retraction plane without collision.

The cycle creates the following sequence of motions:

- G0 is applied to approach the infeed point at the current position level. The reference plane, brought forward by the safety distance, is then also approached with G0 to this position. Then, also with G0, feeding to the machining plane. G0 is possible since infeed in the open is possible.

There are several roughing strategies (paraxial in one direction or back and forth).

- Sequence of motions when roughing:

Face milling can be performed in several planes based on the programmed values `_DP`, `_MID` and `_FALD`. Machining is carried out from the top downward, i.e. one plane each is removed and then the next depth infeed is carried out in the open (`_FDP` parameters). The traversing paths for solid machining in the plane depend on the values of the parameters `_LENG`, `_WID`, `_MIDA`, `_FDP`, `_FDP1` and the cutter radius of the active tool.

The first path to be milled is always traversed such that the infeed depth exactly corresponds to `_MIDA`, ensuring that no width infeed larger than the maximum possible width infeed occurs. The tool center point therefore does not always travel exactly on the edge (only if `_MIDA` = cutter radius). The dimension by which the tool traverses outside the edge is always equal to the cutter diameter - `_MIDA` even if only one surface cut is performed, i. e. area width + overrun is less than `_MIDA`. The other paths for width infeed are calculated internally so as to produce a uniform path width ($\leq$ `_MIDA`).

- Sequence of motions when finishing:

When finishing, the surface is milled in the plane once. This means that the finishing allowance when roughing has to be selected also such that the residual depth can be removed with the finishing tool in one step.


After each surface milling pass in the plane, the tool will retract. The retraction travel is programmed under the parameter `_FDP`.

Machining in one direction stops at the final machining allowance + safety distance and the next starting point is approached in rapid traverse.

When roughing in one direction, the tool will retract by the calculated infeed depth + safety clearance. The depth infeed is performed at the same point as in roughing.

After finishing has been completed, the tool retracts from the last position reached to the retraction plane `_RTP`.

See the following illustration for milling movement:

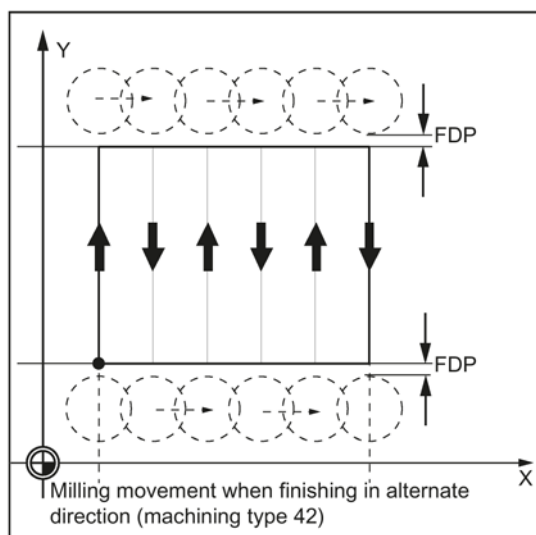


_FDP (retraction travel)

Use this parameter to define the dimension for the retraction travel in the plane. This parameter should reasonably always have a value greater than zero.

_FDP1 (overrun travel)

Use this parameter to specify an overrun travel in the direction of the plane infeed ($_MIDA$). Thus, it is possible to compensate the difference between the current cutter radius and the tool nose radius (e.g. cutter radius or cutting tips arranged at an angle). The last milling cutter center point path therefore always results as $_LENG$ (or $_WID$) + $_FDP1$ - tool radius (from the compensation table).

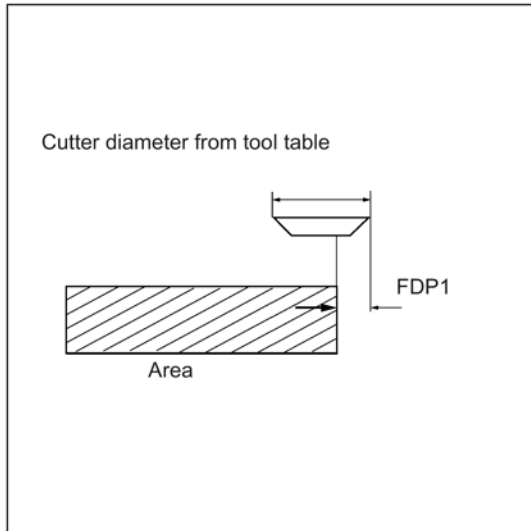

_FALD (finishing allowance)

When roughing, a finishing allowance in the depth is taken into account which is programmed under this parameter.

The residual material remained as the finishing allowance must always be specified for finishing to ensure that the tool can be retracted and then fed to the starting point of the next cut without collision.

If > 0 , the parameter is ignored for finishing.

_VARI (machining type)

Use the parameter $_VARI$ to define the machining type.

Possible values are:

- Units digit:
 - 1=roughing to finishing allowance
 - 2=finishing
- Tens digit:
 - 1=parallel to the first axis of the plane; unidirectional
 - 2=parallel to the second axis of the plane; unidirectional
 - 3=parallel to the first axis of the plane; with alternating direction
 - 4=parallel to the second axis of the plane; with alternating direction

If a different value is programmed for the parameter $_VARI$, the cycle is aborted after output of alarm 61002 "Machining type defined incorrectly".

Note

A tool compensation must be programmed before the cycle is called. Otherwise, the cycle is aborted and alarm 61000 "No tool compensation active" is output.

Programming example: Face milling

Parameters for the cycle call:

Parameter	Description	Value
_RTP	Retraction plane	10 mm
_RFP	Reference plane	0 mm
_SDIS	Safety clearance	2 mm
_DP	Milling depth	-11 mm
_PA	Starting point of the rectangle	X = 100 mm
_PO	Starting point of the rectangle	Y = 100 mm
_LENG	Rectangle dimensions	X = +60 mm
_WID	Rectangle dimensions	Y = +40 mm
_STA	Angle of rotation in the plane	10 degrees
_MID	Maximum infeed depth	6 mm
_MIDA	Maximum infeed width	10 mm
_FDP	Retraction at the end of the milling path	5 mm
_FALD	Finishing allowance in depth	No finishing allowance
_FFP1	Feedrate in the plane	4000 mm/min
_VARI	Machining type	31 (Roughing parallel to the X axis with alternating direction)
_FDP1	Overrun on last cut as determined by the cutting edge geometry	2 mm

A milling cutter with 10 mm radius is used.

```
N10 T2 D2
N20 G17 G0 G90 G54 G94 F2000 X0 Y0 Z20 ; Approach start position
N30 CYCLE71(10, 0, 2, -11, 100, 100, 60, 40, 10, 6, 10, 5, ; Cycle call
0, 4000, 31, 2)
N40 G0 G90 X0 Y0
N50 M02 ; End of program
```

12.6.3 Contour milling - CYCLE72

Programming

CYCLE72 (_KNAME, _RTP, _RFP, _SDIS, _DP, _MID, _FAL, _FALD, _FFP1, _FFD, _VARI, _RL, _AS1, _LP1, _FF3, _AS2, _LP2)

Parameters

Parameter	Data type	Description
_KNAME	STRING	Name of contour subroutine
_RTP	REAL	Retraction plane (absolute)
_RFP	REAL	Reference plane (absolute)
_SDIS	REAL	Safety clearance (to be added to the reference plane; enter without sign)
_DP	REAL	Depth (absolute)
_MID	REAL	Maximum infeed depth (incremental; enter without sign)
_FAL	REAL	Finishing allowance at the edge contour (enter without sign)
_FALD	REAL	Finishing allowance at the base (incremental, enter without sign)
_FFP1	REAL	Feedrate for surface machining
_FFD	REAL	Feedrate for depth infeed (enter without sign)

Parameter	Data type	Description
_VARI	INT	Machining type (enter without sign) UNITS DIGIT Values: 1: roughing, 2: finishing TENS DIGIT: Values: 0: intermediate travel with G0, 1 intermediate travel with G1 HUNDREDS DIGIT Values: 0: Retraction at the end of contour to _RTP 1: Retraction at the end of contour to _RFP + _SDIS 2: Retraction by _SDIS at the end of contour 3: No retraction at the end of contour
_RL	INT	Traveling around the contour either centrally, to the right or to the left (with G40, G41 or G42; enter without sign) Values: 40: G40 (approach and return, straight line only) 41: G41 42: G42
_AS1	INT	Specification of the approach direction/path: (enter without sign) UNITS DIGIT: Values: 1: Straight tangential line 2: Quadrant 3: Semi-circle TENS DIGIT: Values: 0: Approach to the contour in the plane 1: Approach to the contour in a spatial path
_LP1	REAL	Length of the approach travel (with straight-line) or radius of the approach arc (with circle) (enter without sign)
The following parameters can be selected as options:		
_FF3	REAL	Retraction feedrate and feedrate for intermediate positions in the plane (in the open)
_AS2	INT	Specification of the retraction direction/path: (enter without sign) UNITS DIGIT: Values: 1: Straight tangential line 2: Quadrant 3: Semi-circle TENS DIGIT: Values: 0: Retraction from the contour in the plane 1: Retraction from the contour in a spatial path
_LP2	REAL	Length of the retraction travel (with straight-line) or radius of the retraction arc (with circle) (enter without sign)


Function

Use CYCLE72 to mill along any contour defined in a subroutine. The cycle operates with or without cutter radius compensation.


It is not imperative that the contour is closed. Internal or external machining is defined via the position of the cutter radius compensation (centrally, left or right to the contour).

The contour must be programmed in the direction as it is to be milled and must consist of a minimum of two contour blocks (start and end point), since the contour subroutine is called directly internally in the cycle.

See the following illustration for path milling 1:

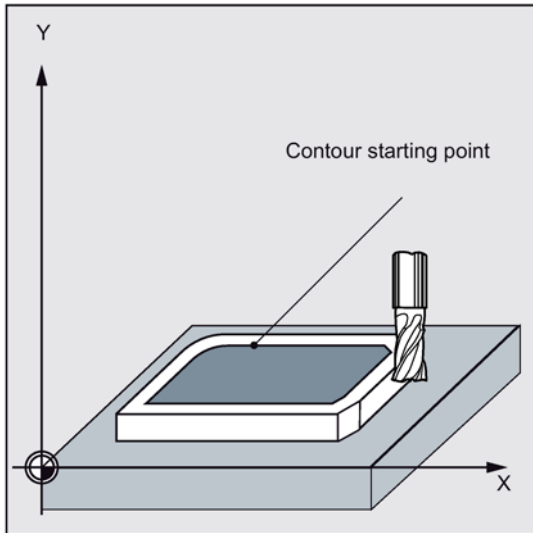

See the following illustration for path milling 2:

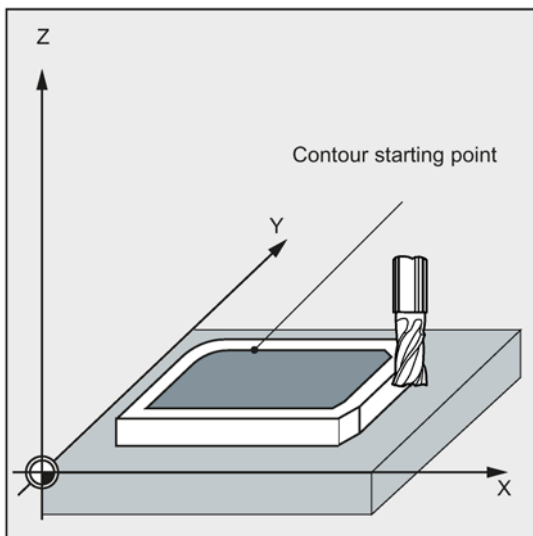

Functions of the cycle

- Selection of roughing (single-pass traversing parallel to contour, taking into account a finishing allowance, if necessary at several depths until the finishing allowance is reached) and finishing (single-pass traversing along the final contour if necessary at several depths)
- Smooth approach to and retraction from the contour either tangentially or radially (quadrant or semi-circle)
- Programmable depth infeeds
- Intermediate motions either at rapid traverse rate or at feedrate

Sequence

Position reached prior to cycle start:

Starting position is any position from which the contour starting point can be approached at the height of the retraction plane without collision.

The cycle generates the following sequence of motions when roughing:

The depth infeeds are distributed equally with the maximum possible value of the specified parameters.

- Traversing to the starting point for first milling with G0/G1 (and FF3). This point is calculated internally in the control system and depends on the following factors:
 - Contour starting point (first point in the subroutine),
 - Direction of the contour at the starting point,
 - Approach mode and its parameters
 - Tool radiusThe cutter radius compensation is activated in this block.
- Depth infeed to the first or next machining depth plus programmed safety clearance with G0/G1. The first machining depth results from the following data:
 - Total depth
 - Finishing allowance
 - The maximum possible depth infeed
- Approach of the contour vertically with depth infeed _FFD and then in the plane at the programmed feedrate _FFP1 or 3D with the feedrate programmed under _FAD according to the programming for smooth approach
- Milling along the contour with G40/G41/G42
- Smooth retraction from the contour with G1 while continuing feed for the surface machining by the retraction amount
- Retraction with G0/G1 (and feedrate for intermediate paths _FF3), depending on the programming
- Retraction to the depth infeed point with G0/G1 (and _FF3).
- This sequence is repeated on the next machining plane up to finishing allowance in the depth.

Upon completion of roughing, the tool stands above the point (calculated internally in the control system) of retraction from the contour at the height of the retraction plane.

The cycle generates the following sequence of motions when finishing:

During finishing, milling is performed at the relevant infeed along the base of the contour until the final dimension is reached.

Smooth approach and retraction of the contour is carried out according to the existing parameters. The appropriate path is calculated internally in the control system.

At the end of the cycle, the tool is positioned at the contour retraction point at the height of the retraction level.

Note

Contour programming


When programming the contour, observe the following:

- No programmable offset may be selected in the subroutine prior to the first programmed position.
 - The first block of the contour subroutine is a straight line block containing G90/G0 or G90/G1 and defines the start of the contour.
 - The starting condition of the contour is the first position in the machining plane which is programmed in the contour subroutine.
 - The cutter radius compensation is selected/deselected by the higher-level cycle; therefore, no G40, G41, G42 is programmed in the contour subroutine.
-

Explanation of the parameters

For an explanation of the parameters `_RTP`, `_RFP`, and `_SDIS`, see Section "Drilling, centering - CYCLE81 (Page 157)".

For an explanation of the parameters `_MID`, `_FAL`, `_FALD`, `_FFP1`, `_FFD`, and `_DP`, see Section "Milling a rectangular pocket - POCKET3 (Page 223)".

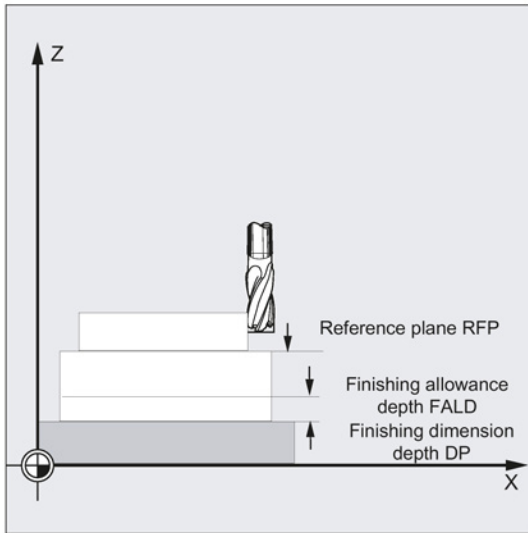

`_KNAME` (name)

The contour to be milled is programmed completely in a subroutine. `_KNAME` defines the name of the contour subroutine.

- Defining the contour as a subroutine

`_KNAME` = name of the subroutine

- If the subroutine already exists, specify a name, and then continue.
- If the subroutine does not yet exist, specify a name and then press the following softkey:

A program with the entered name is created and the program automatically jumps to the contour editor.

**New
file**

- Use the following softkey to confirm your input and return to the screen form for this cycle.

**Tech
interface**

- Defining the contour as a section of the called program

`KNAME` = name of the starting label: name of the end label

Input:

- If the contour is not yet described, specify the name of the starting label and press the following softkey. If the contour is already described (name of starting label: name of end label), directly press the following softkey:

**Attach
contour**

The control system automatically creates starting and end labels from the name entered and the program jumps to the contour editor.

- Use the following softkey to confirm your input and return to the screen form for this cycle:

**Tech
interface**

Examples:

```
_KNAME="CONTOUR_1"
```

```
_KNAME="PIECE245:PIECE245E"
```

The milling contour is the complete program `CONTOUR_1`.

The milling contour is defined as a section in the calling program, which starts from the block containing label `PIECE245` to the block containing label `PIECE245E`.

_LP1, _LP2 (length, radius)

Use the parameter _LP1 to program the approach travel or approach radius (distance from the tool external edge to the contour starting point), and the parameter _LP2 to program the retraction travel or retraction radius (distance from the tool external edge to the contour end point).

Parameters _LP1 and _LP2 must be set to >0. In the case of zero, error 61116 "Approach or retraction path=0" is output.

Note

When using G40, the approach or retraction travel is the distance from the tool center point to the start or end point of the contour.

_VARI (machining type)

Use the parameter _VARI to define the machining type.

If a different value is programmed for the parameter _VARI, the cycle is aborted after output of alarm 61002 "Machining type defined incorrectly".

_RL (bypassing the contour)


With the parameter _RL, you program the traveling around the contour centrally, to the right or to the left with G40, G41 or G42.

_AS1, _AS2 (approach direction/path, retraction direction/path)

Use the parameter _AS1 to program the specification of the approach path and _AS2 to program that of the retraction path. If _AS2 is not programmed, then the behavior of the retraction path is analogous to that of the approach path.

Smooth approach of the contour along a spatial path (helix or straight line) should only be programmed if the tool is not yet being used or is suitable for this type of approach.

See the following illustration for _AS1/_AS2:

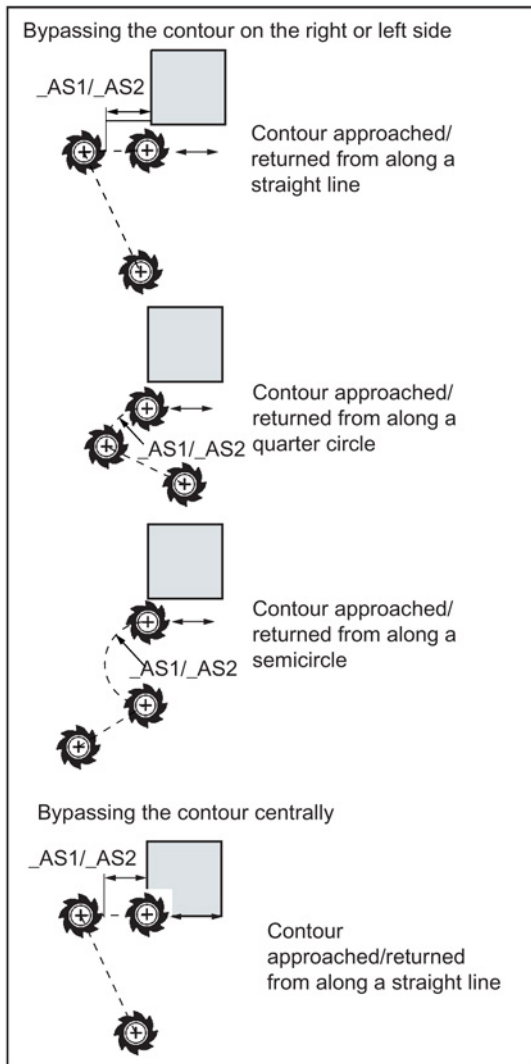

In the case of central (G40), approach and retraction is only possible along a straight line.

_FF3 (retraction feedrate)


Use the parameter `_FF3` to define a retraction feedrate for intermediate positions in the plane (in the open) if the intermediate motions are to be carried out with feedrate (G01). If no feedrate value is programmed, the intermediate motions with G01 are carried out at surface feedrate.

Note

A tool compensation must be programmed before the cycle is called. Otherwise, the cycle is aborted and alarm 61000 "No tool compensation active" is output.

Programming example 1: Milling around a closed contour externally

This program is used to mill the contour shown in the diagram below.

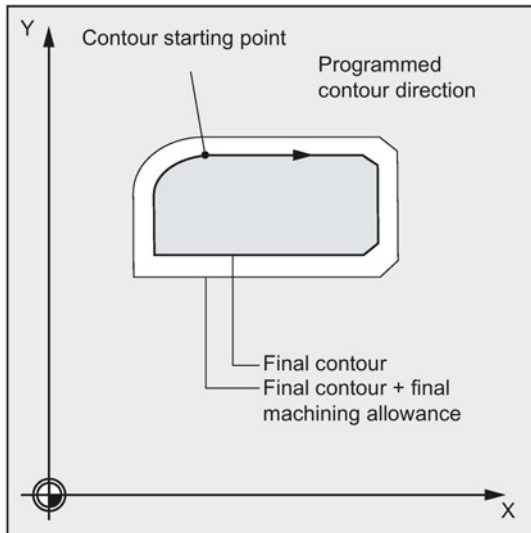

Parameters for the cycle call:

Parameter	Description	Value
_RTP	Retraction plane	250 mm
_RFP	Reference plane	200 mm
_SDIS	Safety clearance	3 mm
_DP	Infeed depth	175 mm
_MID	Maximum infeed depth	10 mm
_FAL	Finishing allowance in the plane	1 mm
_FALD	Finishing allowance in depth	1.5 mm
_FFP1	Feedrate in the plane	800 mm/min
_FFD	Feedrate depth infeed	400 mm/min
_VARI	Machining type	111 (Roughing up to finishing allowance; intermediate paths with G1, for intermediate paths retraction in Z to _RFP + _SDIS)
Parameters for approach:		
_RL	G41 - left of the contour, i.e. external machining	41
_LP1	Approach and retraction in a quadrant in the plane	20 mm radius
_FF3	Retraction feedrate	1000 mm/min

```

N10 T3 D1 ; T3: Milling cutter with radius 7
N20 S500 M3 F3000 ; Program feedrate and spindle speed
N30 G17 G0 G90 X100 Y200 Z250 G94 ; Approach start position
N40 CYCLE72("EX72CONTOUR", 250, 200, 3, 175, 10,1, 1.5, ; Cycle call
800, 400, 111, 41, 2, 20, 1000, 2, 20)
N50 X100 Y200
N60 M2 ; End of program
EX72CONTOUR.SPF ; Subroutine for contour milling (for
example)
N100 G1 G90 X150 Y160 ; Starting point of contour
N110 X230 CHF=10
N120 Y80 CHF=10
N130 X125
N140 Y135
N150 G2 X150 Y160 CR=25
N160 M2

```

Programming example 2: Milling around a closed contour externally

With this program, the same contour is milled as in example 1. The difference is that the contour programming is now in the calling program.

```

N10 T3 D1 ; T3: Milling cutter with radius 7
N20 S500 M3 F3000 ; Program feedrate and spindle speed
N30 G17 G0 G90 X100 Y200 Z250 G94 ; Approach start position
N40 CYCLE72 ( "PIECE245:PIECE245E", 250, 200, 3, 175, 10,1, ; Cycle call
1.5, 800, 400, 11, 41, 2, 20, 1000, 2, 20)
N50 X100 Y200
N60 M2
N70 PIECE245: ; Contour
N80 G1 G90 X150 Y160
N90 X230 CHF=10
N100 Y80 CHF=10
N110 X125
N120 Y135
N130 G2 X150 Y160 CR=25
N140 PIECE245E: ; End of contour
N150 M2

```

Programming example 3

Proceed through the following steps:



1. Select the desired operating area.



2. Open the vertical softkey bar for available milling cycles.



3. Press this softkey to open the window for CYCLE72. Enter a name in the first input field.

4. Press one of the following two softkeys . The program automatically jumps to the program editor screen form.

If you desire to edit and store the contour in a subroutine, press this softkey.



**Attach
contour**

If you desire to edit and store the contour as a section of a main program, press this softkey.

**Tech
interface**

Note:

For more information about programming in the contour editor, see Section "Free contour programming (Page 312)".

5. Press this softkey to return to the screen form for CYCLE72. Parameterize the cycle technology data as desired.

OK

6. Confirm your settings with this softkey. The cycle is then automatically transferred to the program editor.

Note:

The cycle program created as a section of the main program must be stored after the M30 command.

7. If you desire to recompile the cycle, press this softkey.

**Re-
comp.**

12.6.4 Milling a rectangular spigot - CYCLE76

Programming

CYCLE76 (RTP, RFP, SDIS, DP, DPR, LENG, WID, CRAD, PA, PO, STA, MID, FAL, FALD, FFP1, FFD, CDIR, VARI, AP1, AP2)


Parameters

Parameter	Data type	Description
RTP	REAL	Retraction plane (absolute)
RFP	REAL	Reference plane (absolute)
SDIS	REAL	Safety clearance (enter without sign)
DP	REAL	Final drilling depth (absolute)
DPR	REAL	Final drilling depth relative to the reference plane (enter without sign)
LENG	REAL	Spigot length
WID	REAL	Spigot width
CRAD	REAL	Spigot corner radius (enter without sign)
PA	REAL	Reference point, first axis of plane
PO	REAL	Reference point, second axis of plane
STA	REAL	Angle between longitudinal axis and first axis of plane
MID	REAL	Maximum depth infeed (incremental; enter without sign)
FAL	REAL	Final machining allowance at the margin contour (incremental)
FALD	REAL	Finishing allowance at the base (incremental, enter without sign)
FFP1	REAL	Feedrate for surface machining
FFD	REAL	Feedrate for depth infeed
CDIR	INT	Milling direction (enter without sign) Values: 0: Down-cut milling 1: Conventional milling 2: With G2 (independent of spindle direction) 3: With G3

Parameter	Data type	Description
VARI	INT	Machining type Values: 1: Roughing to final machining allowance 2: Finishing (allowance X/Y/Z=0)
AP1	REAL	Length of blank spigot
AP2	REAL	Width of blank spigot

Function

Use this cycle to machine rectangular spigots in the machining plane. For finishing, a face cutter is required. The depth infeed is always carried out in the position upstream of the semi-circle style approach to the contour.

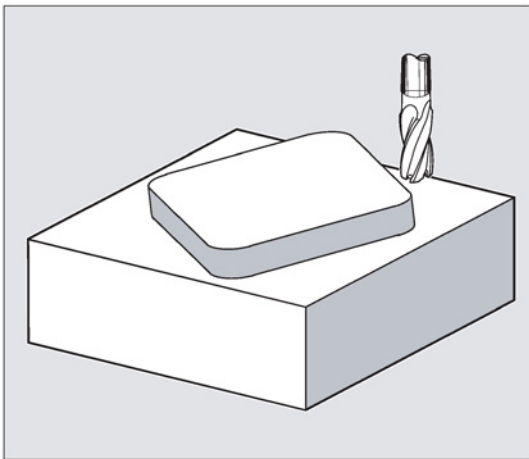


Sequence

Position reached prior to cycle start:

The starting point is a position in the positive range of the abscissa with the approach semi-circle and the programmed raw dimension on the abscissa end taken into account.

Sequence of motions when roughing (VARI=1):

- Approach/retraction from contour:

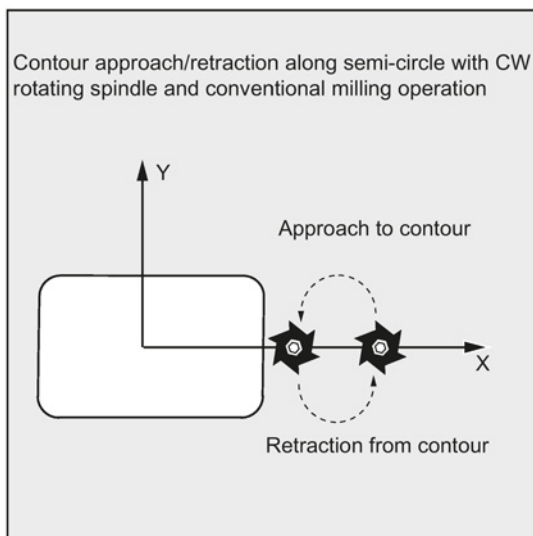

The retraction plane (RTP) is approached at rapid traverse rate to then be able to position to the starting point in the machining plane at this height. The starting point is defined with reference to 0 degrees of the abscissa.

The tool is fed to the safety clearance (SDIS) at rapid traverse with subsequent traversing to the machining depth at feedrate. To approach the spigot contour, the tool travels along a semi-circular path.

The milling direction can be determined either as up-cut milling or down-cut milling with reference to the spindle direction.

If the spigot is bypassed once, the contour is left along a semi-circle in the plane, and the tool is fed to the next machining depth.

The contour is then reapproached along a semi-circle and the spigot traversed once. This process is repeated until the programmed spigot depth is reached. Then, the retraction plane (RTP) is approached at rapid traverse rate.

- Depth infeed:
 - Feeding to the safety clearance
 - Insertion to machining depth

The first machining depth is calculated from the total depth, finishing allowance, and the maximum possible depth infeed.

Sequence of motions when finishing (VARI=2):

Depending on the set parameters FAL and FALD, finishing is either carried out at the surface contour or at the base or both together. The approach strategy corresponds to the motions in the plane as with roughing.

Explanation of the parameters


For an explanation of the parameters RTP, RFP, SDIS, DP, and DPR, see Section "Drilling, centering - CYCLE81 (Page 157)".

For an explanation of the parameters MID, FAL, FALD, FFP1, and FFD, see Section "Milling a rectangular pocket - POCKET3 (Page 223)".

LENG, WID and CRAD (spigot length, spigot width and corner radius)

Use the parameters LENG, WID and CRAD to define the form of a slot in the plane.

The spigot is always dimensioned from the center. The length (LENG) always refers to the abscissa (with a plane angle of 0 degrees).

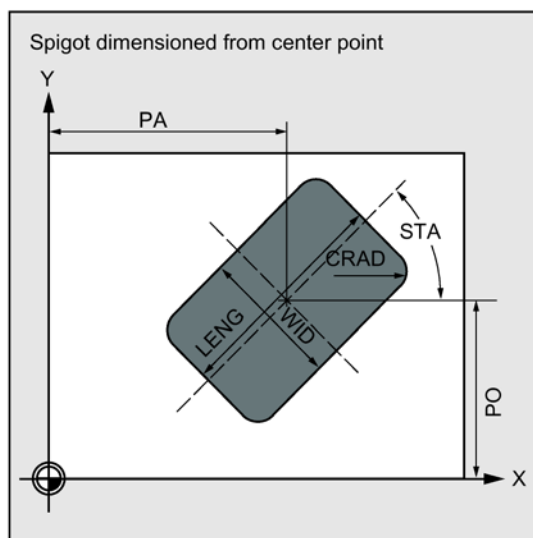

PA, PO (reference point)

Use the parameters PA and PO to define the reference point of the spigot along the abscissa and the ordinate.

This is the spigot center point.

STA (angle)

STA specifies the angle between the first axis of the plane (abscissa) and the longitudinal axis of the spigot.

CDIR (milling direction)

Use this parameter to specify the machining direction for the spigot.

Using the CDIR parameter, the milling direction can be programmed directly with "2 for G2" and "3 for G3", or alternatively with "synchronous milling" or "conventional milling".

Down-cut and up-cut milling are determined internally in the cycle via the direction of rotation of the spindle activated prior to calling the cycle.

Down-cut	Up-cut
M3 → G3	M3 → G2
M4 → G2	M4 → G3

VARI (machining type)

Use the parameter VARI to define the machining type.


Possible values are:

- 1=roughing
- 2=finishing

AP1, AP2 (blank dimensions)

When machining the spigot, it is possible to take into account blank dimensions (e.g. when machining precast parts).

The basic sizes for the length and width (AP1 and AP2) are programmed without sign and their symmetrical positions around the spigot center are computed in the cycle. The internally calculated radius of the approach semi-circle depends on this dimension.

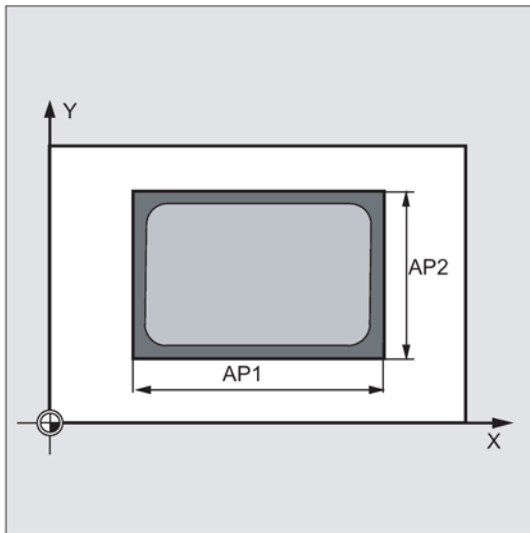

Note

A tool compensation must be programmed before the cycle is called. Otherwise, the cycle is canceled and alarm 61009 "Active tool number=0" is output.


Internally in the cycle, a new current workpiece coordinate system is used which influences the actual value display. The zero point of this coordinate system is to be found in the pocket center point.

At the end of the cycle, the original coordinate system is active again.

Programming example: Spigot

Use this program to machine in the XY plane a spigot that is 60 mm long, 40 mm wide and has 15 mm corner radius. The spigot has an angle of 10 degrees relative to the X axis and is premanufactured with a length allowance of 80 mm and a width allowance of 50 mm.

See the following programming example for rectangular spigot:

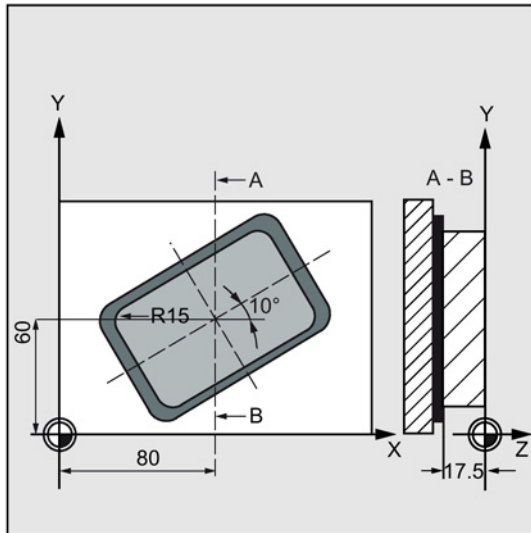

```
N10 G90 G0 G17 X100 Y100 T20 D1 S3000 M3 ; Specification of technology values
N11 M6
N30 CYCLE76 (10, 0, 2, -17.5, , 60, 40, 15, 80, 60, 10, 11, ; Cycle call
, , 900, 800, 0, 1, 80, 50)
N40 M30 ; End of program
```

12.6.5 Milling a circular spigot - CYCLE77

Programming

CYCLE77 (RTP, RFP, SDIS, DP, DPR, PRAD, PA, PO, MID, FAL, FALD, FFP1, FFD, CDIR, VARI, AP1)

Parameters


The following input parameters are always required:

Parameter	Data type	Description
RTP	REAL	Retraction plane (absolute)
RFP	REAL	Reference plane (absolute)
SDIS	REAL	Safety clearance (enter without sign)
DP	REAL	Depth (absolute)
DPR	REAL	Depth relative to the reference plane (enter without sign)
PRAD	REAL	Spigot diameter (enter without sign)
PA	REAL	Reference point, first axis of plane
PO	REAL	Reference point, second axis of plane
MID	REAL	Maximum depth infeed (incremental; enter without sign)
FAL	REAL	Final machining allowance at the margin contour (incremental)
FALD	REAL	Finishing allowance at the base (incremental, enter without sign)
FFP1	REAL	Feedrate for surface machining
FFD	REAL	Feedrate for depth infeed (or spatial infeed)

Parameter	Data type	Description
CDIR	INT	Milling direction (enter without sign) Values: 0: Down-cut milling 1: Conventional milling 2: With G2 (independent of spindle direction) 3: With G3
VARI	INT	Machining type Values: 1: Roughing to final machining allowance 2: Finishing (allowance X/Y/Z=0)
AP1	REAL	Diameter of blank spigot

Function

Use this cycle to machine circular spigots in the machining plane. For finishing, a face cutter is required. The depth infeed is always performed in the position before the semi-circular approach to the contour.

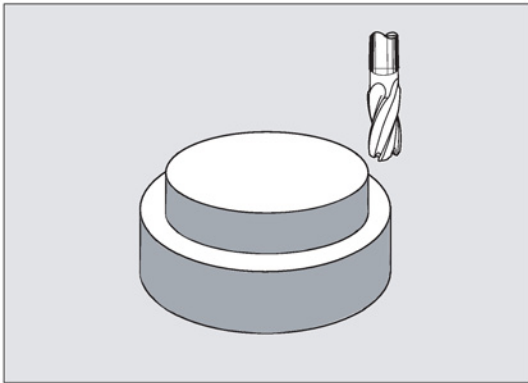


Sequence

Position reached prior to cycle start:

The starting point is a position in the positive range of the abscissa with the approach semi-circle and the programmed raw dimension taken into account.

Sequence of motions when roughing (VARI=1):

- Approach/retraction from contour:

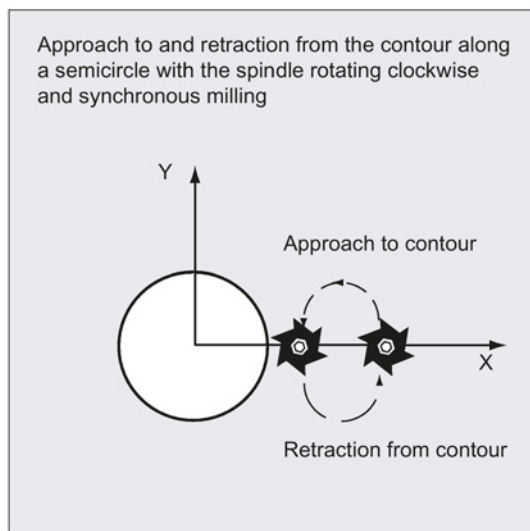

The retraction plane (RTP) is approached at rapid traverse rate to then be able to position at this height to the starting point in the machining plane. The starting point is defined with reference to 0 degrees of the axis of the abscissa.

The tool is fed to the safety clearance (SDIS) at rapid traverse with subsequent traversing to the machining depth at feedrate. To approach the spigot contour, the tool is approached along a semi-circular path using the programmed blank spigot.

The milling direction can be determined either as up-cut milling or down-cut milling with reference to the spindle direction.

If the spigot is bypassed once, the contour is left along a semi-circle in the plane, and the tool is fed to the next machining depth.

The contour is then reapproached along a semi-circle and the spigot traversed once. This process is repeated until the programmed spigot depth is reached.

Then, the retraction plane (RTP) is approached at rapid traverse rate.

- Depth infeed:
 - Feeding to the safety clearance
 - Insertion to machining depth

The first machining depth is calculated from the total depth, finishing allowance, and the maximum possible depth infeed.

Sequence of motions when finishing (VARI=2):

According to the set parameters FAL and FALD, either finishing is carried out at the surface contour or at the base or both together. The approach strategy corresponds to the motions in the plane as with roughing.

Explanation of the parameters

For an explanation of the parameters RTP, RFP, SDIS, DP, and DPR, see Section "Drilling, centering - CYCLE81 (Page 157)".

For an explanation of the parameters MID, FAL, FALD, FFP1, and FFD, see Section "Milling a rectangular pocket - POCKET3 (Page 223)".

PRAD (diameter of spigot)

Enter the diameter without sign.

PA, PO (spigot center point)

Use the parameters PA and PO to define the reference point of the spigot.

CDIR (milling direction)

Use this parameter to specify the machining direction for the spigot. Using the parameter CDIR, the milling direction can be programmed directly with "2 for G2" and "3 for G3", or alternatively with "synchronous milling" or "conventional milling".

Down-cut and up-cut millings are determined internally in the cycle via the direction of rotation of the spindle activated prior to calling the cycle.

Down-cut	Up-cut
M3 → G3	M3 → G2
M4 → G2	M4 → G3

VARI (machining type)

Use the parameter VARI to define the machining type. Possible values are:

- 1=roughing
- 2=finishing

AP1 (diameter of blank spigot)

Use this parameter to define the blank dimension of the spigot (without sign). The internally calculated radius of the approach semi-circle depends on this dimension.

Note


A tool compensation must be programmed before the cycle is called. Otherwise, the cycle is canceled and alarm 61009 "Active tool number=0" is output. Internally in the cycle, a new current workpiece coordinate system is used which influences the actual value display. The zero point of this coordinate system is to be found in the pocket center point.

At the end of the cycle, the original coordinate system is active again.

Programming example: Circular spigot

Machining a spigot from a blank with a diameter of 55 mm and a maximum infeed of 10 mm per cut; specification of a final machining allowance for subsequent finishing of the spigot surface. The whole machining is performed with reverse rotation.

See the following programming example for circular spigot:

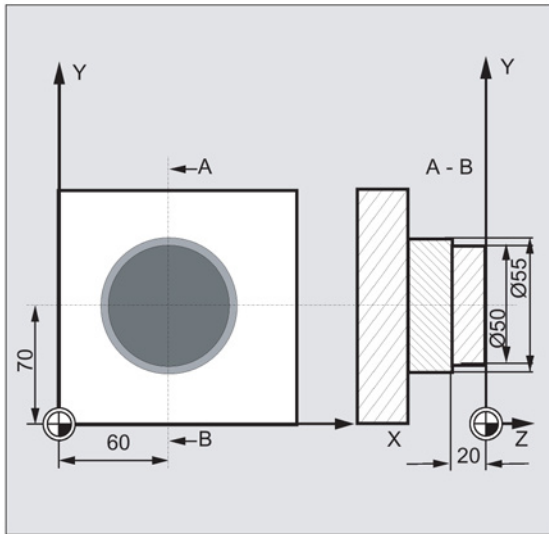

N10 G90 G17 G0 S1800 M3 D1 T1	; Specification of technology values
N11 M6	
N20 CYCLE77 (10, 0, 3, -20, ,50, 60, 70, 10, 0.5, 0, 900, 800, 1, 1, 55)	; Roughing cycle call
N30 D1 T2 M6	; Change tool
N40 S2400 M3	; Specification of technology values
N50 CYCLE77 (10, 0, 3, -20, , 50, 60, 70, 10, 0, 0, 800, 800, 1, 2, 55)	; Call finishing cycle
N40 M30	; End of program

12.6.6 Long holes located on a circle - LONGHOLE

Programming

LONGHOLE (RTP, RFP, SDIS, DP, DPR, NUM, LENG, CPA, CPO, RAD, STA1, INDA, FFD, FFP1, MID)

Parameters

Parameter	Data type	Description
RTP	REAL	Retraction plane (absolute)
RFP	REAL	Reference plane (absolute)
SDIS	REAL	Safety clearance (enter without sign)
DP	REAL	Slot depth (absolute)
DPR	REAL	Slot depth relative to the reference plane (enter without sign)
NUM	INT	Number of slots
LENG	REAL	Slot length (enter without sign)
CPA	REAL	Center point of circle (absolute), first axis of the plane
CPO	REAL	Center point of circle (absolute), second axis of the plane
RAD	REAL	Radius of the circle (enter without sign)
STA1	REAL	Starting angle
INDA	REAL	Incrementing angle
FFD	REAL	Feedrate for depth infeed
FFP1	REAL	Feedrate for surface machining
MID	REAL	Maximum infeed depth for one infeed (enter without sign)

Note


The cycle requires a milling cutter with an "end tooth cutting across center" (DIN844).

Function

Use this cycle to machine long holes located on a circle. The longitudinal axis of the long holes is aligned radially.

In contrast to the slot, the width of the long hole is determined by the tool diameter.


Internally in the cycle, an optimum traversing path of the tool is determined, ruling out unnecessary idle passes. If several depth infeeds are required to machine a slot, the infeed is carried out alternately at the end points. The path to be traversed along the longitudinal axis of the long hole changes its direction after each infeed. The cycle searches for the shortest path when changing to the next long hole.

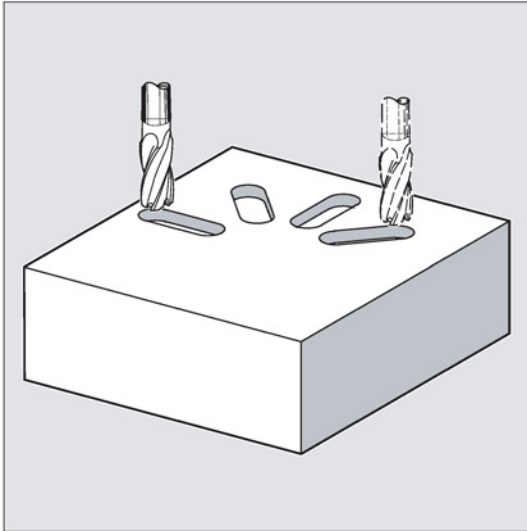**Sequence****Position reached prior to cycle start:**

The starting position is any position from which each of the long holes can be approached without collision.


The cycle creates the following sequence of motions:

- Using G0, the starting position for the cycle is approached. In both axes of the current plane, the next end point of the first slot to be machined is approached at the height of the retraction plane in this applicator, and then the applicator is lowered to the reference plane brought forward by the safety clearance.
- Each long hole is milled in a reciprocating motion. The machining in the plane is performed using G1 and the feedrate programmed under FFP1. The infeed to the next machining depth calculated using G1 internally in the cycle and using feedrate is performed at each reversal point until the final depth is reached.
- Retraction to the retraction plane using G0 and approach to the next long hole on the shortest path.
- After the last long hole has been machined, the tool is moved with G0 to the position in the machining plane, which was reached last and which is specified in the diagram below, and the cycle is ended.

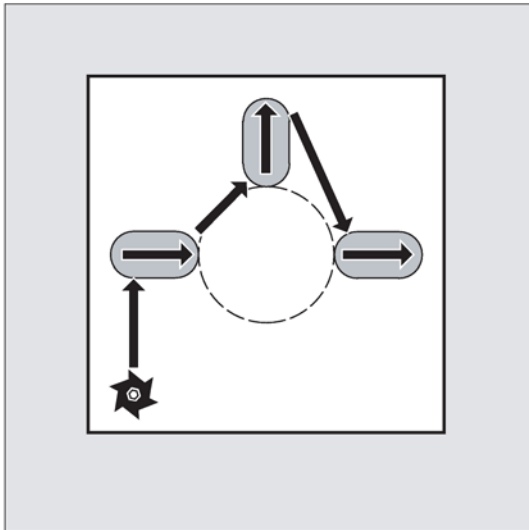

Explanation of the parameters

For an explanation of the parameters RTP, RFP, and SDIS, see Section "Drilling, centering - CYCLE81 (Page 157)".

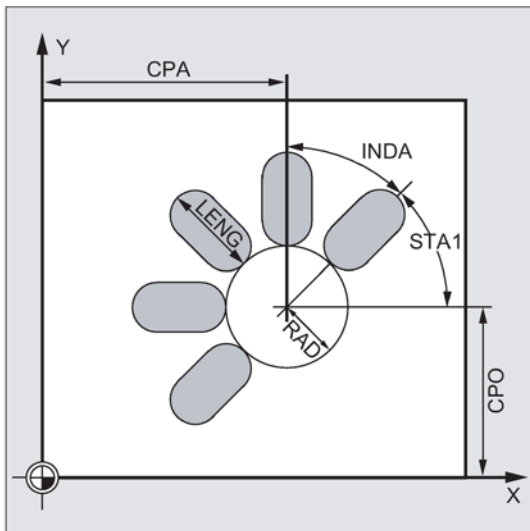

DP and DPR (long hole depth)

The depth of the long hole can be specified either absolute (DP) or relative (DPR) to the reference plane.

With relative specification, the cycle calculates the resulting depth automatically using the positions of reference and retraction planes.

NUM (number)

Use the parameter NUM to specify the number of long holes.

LENG (long hole length)

The length of the long hole is programmed under LENG.

If it is detected in the cycle that this length is smaller than the milling diameter, the cycle is aborted with alarm 61105 "Milling radius is too large".

MID (infeed depth)

Use this parameter to define the maximum infeed depth.

The depth infeed is performed by the cycle in equally-sized infeed steps.

The depth infeed starts from the reference plane brought forward by the safety clearance (depending on `_ZSD[1]`).

The feedrate FFP1 is active for all movements in the plane traversed at feedrate. FFD acts for infeeds vertically to this plane.

You define the position of the circle in the machining plane by the center point (CPA, CPO) and the radius (RAD). Only positive values are permitted for the radius.

The arrangement of the long holes on the circle is defined by these parameters.

Note

If mutual contour violations of the slots result from incorrect values of the parameters that determine the arrangement and the size of the slots, the cycle will not start the machining. The cycle is aborted and the error message 61104 "Contour violation of slots/elongated holes" is output.

After the cycle has been completed, the workpiece coordinate system is in the same position again as it was before the cycle was called.

By using this program, you can machine four slots of the length 30 mm and the relative depth 23 mm (difference between the reference plane and the slot root), which are arranged on a circle with the center point Y40 Z45 and the radius 20 mm in the YZ plane. The starting angle is 45 degrees, and the incremental angle is 90 degrees. The maximum infeed depth is 6 mm, and the safety clearance 1 mm.

```
; Specification of the technological
values
```

```
; Approach starting position
```

```
; Cycle call
```

```
; End of program
```

12.6.7 Slots on a circle - SLOT1

Programming

SLOT1 (RTP, RFP, SDIS, DP, DPR, NUM, LENG, WID, CPA, CPO, RAD, STA1, INDA, FFD, FFP1, MID, CDIR, FAL, VARI, MIDF, FFP2, SSF, FALD, STA2, DP1)

Parameter

Parameter	Data type	Description
RTP	REAL	Retraction plane (absolute)
RFP	REAL	Reference plane (absolute)
SDIS	REAL	Safety clearance (enter without sign)
DP	REAL	Slot depth (absolute)
DPR	REAL	Slot depth relative to the reference plane (enter without sign)
NUM	INT	Number of slots
LENG	REAL	Slot length (enter without sign)
WID	REAL	Slot width (enter without sign)
CPA	REAL	Center point of circle (absolute), first axis of the plane
CPO	REAL	Center point of circle (absolute), second axis of the plane
RAD	REAL	Radius of the circle (enter without sign)
STA1	REAL	Starting angle
INDA	REAL	Incrementing angle
FFD	REAL	Feedrate for depth infeed
FFP1	REAL	Feedrate for surface machining
MID	REAL	Maximum infeed depth for one infeed (enter without sign)
CDIR	INT	Milling direction for machining the slot Values: 2 (for G2), 3 (for G3)
FAL	REAL	Finishing allowance at the slot edge (enter without sign)
VARI	INT	Machining type Values: 0 = complete machining, 1 = roughing, 2 = finishing
MIDF	REAL	Maximum infeed depth for finishing
FFP2	REAL	Feedrate for finishing
SSF	REAL	Speed for finishing
FALD	REAL	Finishing allowance at the slot base (enter without sign)
STA2	REAL	Maximum insertion angle for oscillation movement
DP1	REAL	Insertion depth per revolution for helix (incremental)


Note

The cycle requires a milling cutter with an "end tooth cutting across center" (DIN844).

Function

The cycle SLOT1 is a combined roughing-finishing cycle.

Use this cycle to machine slots arranged on a circle. The longitudinal axis of the slots is aligned radially. In contrast to the long hole, a value is defined for the slot width.

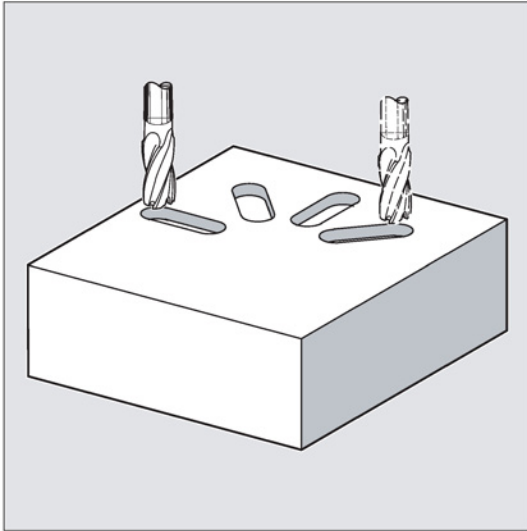


Sequence

Position reached prior to cycle start:

The starting position can be any position from which each of the slots can be approached without collision.


The cycle creates the following sequence of motions:

- Approach of the position at the beginning of the cycle indicated in the SLOT1 sequence illustration with G0.
- Complete machining of a slot is carried out in the following steps:
 - Approach of the reference plane brought forward by the safety clearance by using G0
 - Infeed to the next machining depth with G1 and with feedrate value FFD
 - Solid machining of the slot to the finishing allowance at the slot edge with feedrate value FFP1. Then finishing with feedrate value FFP2 and spindle speed SSF along the contour according to the machining direction programmed under CDIR.
 - The depth infeed is always carried out at the same position in the machining plane until the end depth of the slot is reached.
- Retract tool to the retraction plane and move to the next slot with G0.
- After the last slot has been machined, the tool is moved with G0 to the end position in the machining plane, which is specified in the diagram below, and the cycle is ended.

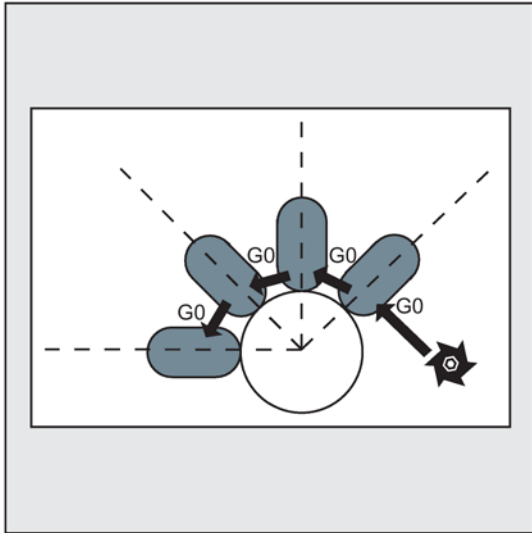

Explanation of the parameters

For an explanation of the parameters RTP, RFP, and SDIS, see Section "Drilling, centering - CYCLE81 (Page 157)".

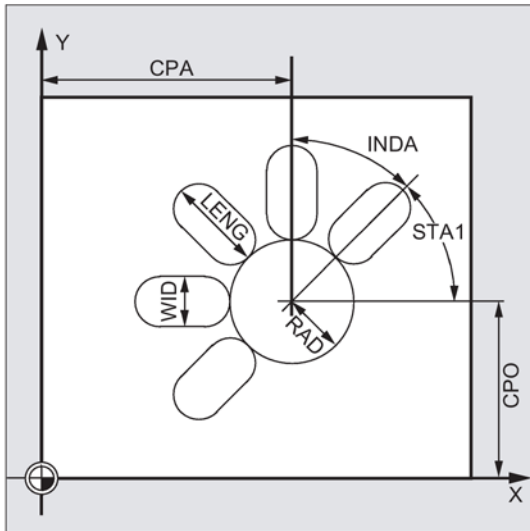

DP and DPR (slot depth)

The slot depth can be specified either absolute (DP) or relative (DPR) to the reference plane.

With relative specification, the cycle calculates the resulting depth automatically using the positions of reference and retraction planes.

NUM (number)

Use the parameter NUM to specify the number of slots.

LENG and WID (slot length and slot width)

Use the parameters LENG and WID to define the form of a slot in the plane. The milling cutter diameter must be smaller than the slot width. Otherwise, alarm 61105 "Cutter radius too large" will be activated and the cycle aborted.

The milling cutter diameter must not be smaller than half of the groove width. This is not checked.

CPA, CPO and RAD (center point and radius)

You define the position of the circle in the machining plane by the center point (CPA, CPO) and the radius (RAD). Only positive values are permitted for the radius.

STA1 and INDA (starting and incremental angle)

The arrangement of the slot on the circle is defined by these parameters.

STA1 defines the angle between the positive direction of the first axis (abscissa) of the workpiece coordinate system active before the cycle was called and the first groove. Parameter INDA contains the angle from one slot to the next.

If INDA=0, the incrementing angle is calculated from the number of slots so that they are arranged equally around the circle.

FFD and FFP1 (feedrate for depth and surface)

The feedrate FFD is active for all infeed movements perpendicular to the machining plane.

The feedrate FFP1 is active for all movements in the plane traversed at feedrate when roughing.

MID (infeed depth)

Use this parameter to define the maximum infeed depth.

The depth infeed is performed by the cycle in equally-sized infeed steps.

Using MID and the total depth, the cycle automatically calculates this infeed which lies between 0.5 x maximum infeed depth and the maximum infeed depth. The minimum possible number of infeed steps is used as the basis. MID=0 means that the cut to slot depth is made with one feed.

The depth infeed commences at the reference plane moved forward by the safety clearance.

CDIR (milling direction)

Use this parameter to specify the machining direction for the groove. Possible values are:

- "2" for G2
- "3" for G3

If the parameter is set to an illegal value, then the message "Wrong milling direction, G3 will be generated" will be displayed in the message line. In this case, the cycle is continued and G3 is automatically generated.

FAL (finishing allowance)

Use this parameter to program a finishing allowance at the slot edge. FAL does not influence the depth infeed.

If the value of FAL is greater than allowed for the specified width and the milling cutter used, FAL is automatically reduced to the maximum possible value. In the case of roughing, milling is performed with a reciprocating movement and depth infeed at both end points of the slot.

VARI, MIDF, FFP2 and SSF (machining type, infeed depth, feedrate and speed)

Use the parameter VARI to define the machining type.

Possible values are:

- 0=complete machining in two parts
 - Solid machining of the slot (SLOT1, SLOT2) to the finishing allowance is performed at the spindle speed programmed before the cycle was called and with feedrate FFP1. Depth infeed is defined with MID.
 - Solid machining of the remaining finishing allowance is carried out at the spindle speed defined via SSF and the feedrate FFP2. Depth infeed is defined with MIDF.
If MIDF=0, the infeed is performed right to the final depth.
 - If FFP2 is not programmed, feedrate FFP1 is active. This also applies analogously if SSF is not specified, i.e. the speed programmed prior to the cycle call will apply.
- 1=Roughing
The groove (SLOT1, SLOT2) is solid-machined up to the finishing allowance at the speed programmed before the cycle call and at the feedrate FFP1. The depth infeed is programmed via MID.
- 2=Finishing
The cycle requires that the slot (SLOT1, SLOT2) is already machined to a residual finishing allowance and that it is only necessary to machine the final finishing allowance. If FFP2 and SSF are not programmed, the feedrate FFP1 or the speed programmed before the cycle call is active. Depth infeed is defined with MIDF.

If a different value is programmed for the parameter VARI, the cycle is aborted after output of alarm 61102 "Machining type defined incorrectly".

FALD (finishing allowance at slot edge)

When roughing, a separate finishing allowance is taken into account at the base.

DP1

Use the parameter DP1 to define the infeed depth when inserting to the helical path.

STA2 (insertion angle)

Use the STA2 parameter to define the radius of the helical path (relative to the tool center point path) or the maximum insertion angle for the reciprocating motion.

- Vertical insertion
The vertical depth infeed always takes place at the same position in the machining plane as long as the slot is reached by the end depth.
- Insertion oscillation on center axis of slot
It means that the milling center point on a straight line oscillating back and forth is inserted at an angle until it has reached the nearest current depth. The maximum insertion angle is programmed under STA2, and the length of the oscillation path is calculated from LENG-WID. The oscillating depth infeed ends at the same point as with vertical depth infeed motions; the starting point in the plane is calculated accordingly. The roughing operation begins in the plane once the current depth is reached. The feedrate is programmed under FFD.


Note

A tool compensation must be programmed before the cycle is called. Otherwise, the cycle is aborted and alarm 61000 "No tool compensation active" is output.

If incorrect values are assigned to the parameters that determine the arrangement and size of the slots and thus cause mutual contour violation of the slots, the cycle is not started. The cycle is aborted and the error message 61104 "Contour violation of slots/elongated holes" is output.

During the cycle, the workpiece coordinate system is rotated and offset. The values in the workpiece coordinate system displayed on the actual value display are such that the longitudinal axis of the slot that has just been machined corresponds to the first axis of the current machining plane.

After the cycle has been completed, the workpiece coordinate system is in the same position again as it was before the cycle was called.

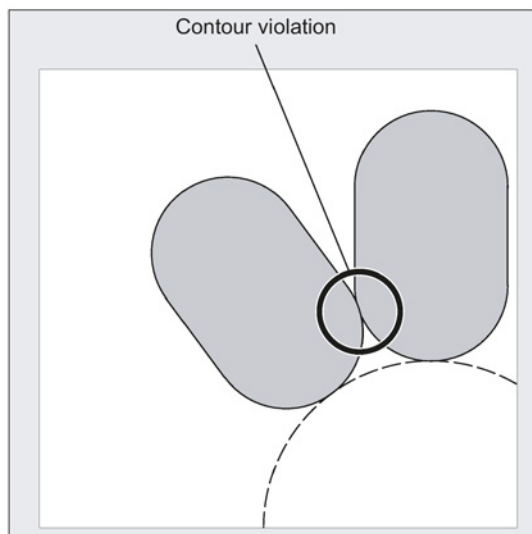


Programming example: Grooves

Four slots are milled.

The slots have the following dimensions: Length 30 mm, width 15 mm and depth 23 mm. The safety clearance is 1 mm, the final machining allowance is 0.5 mm, the milling direction is G2, and the maximum infeed in the depth is 6 mm.

The slot is to be machined completely. Infeed during finishing is to be performed directly to the pocket depth and the same feedrate and speed are to be used.

See the following programming example for grooves:

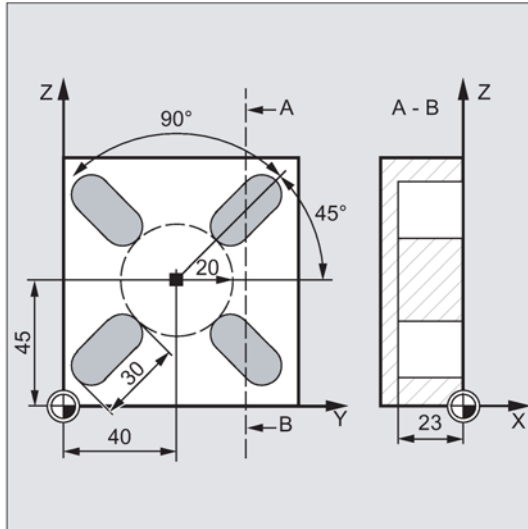

```
N10 G17 G90 T1 D1 S600 M3
N20 G0 X20 Y50 Z5
N30 SLOT1(5, 0, 1, -23, , 4, 30, 15, 40, 45, 20, 45, 90,
100, 320, 6, 2, 0.5, 0, , 0, )
N40 M02
```

```
; Specification of technology values
; Approach starting position
; Cycle call, VARI, MIDF, FFP2 and SSF
parameters omitted
; End of program
```

12.6.8 Circumferential slot - SLOT2

Programming

SLOT2 (RTP, RFP, SDIS, DP, DPR, NUM, AFSL, WID, CPA, CPO, RAD, STA1, INDA, FFD, FFP1, MID, CDIR, FAL, VARI, MIDF, FFP2, SSF, FFCP)

Parameters

Parameter	Data type	Description
RTP	REAL	Retraction plane (absolute)
RFP	REAL	Reference plane (absolute)
SDIS	REAL	Safety clearance (enter without sign)
DP	REAL	Slot depth (absolute)
DPR	REAL	Slot depth relative to the reference plane (enter without sign)
NUM	INT	Number of slots
AFSL	REAL	Angle for the slot length (enter without sign)
WID	REAL	Circumferential slot width (enter without sign)
CPA	REAL	Center point of circle (absolute), first axis of the plane
CPO	REAL	Center point of circle (absolute), second axis of the plane
RAD	REAL	Radius of the circle (enter without sign)
STA1	REAL	Starting angle
INDA	REAL	Incrementing angle
FFD	REAL	Feedrate for depth infeed

Parameter	Data type	Description
FFP1	REAL	Feedrate for surface machining
MID	REAL	Maximum infeed depth for one infeed (enter without sign)
CDIR	INT	Milling direction for machining the circumferential slot Values: 2 (for G2), 3 (for G3)
FAL	REAL	Finishing allowance at the slot edge (enter without sign)
VARI	INT	Machining type Values: 0 = complete machining, 1 = roughing, 2 = finishing
MIDF	REAL	Maximum infeed depth for finishing
FFP2	REAL	Feedrate for finishing
SSF	REAL	Speed for finishing
FFCP	REAL	Feedrate for intermediate positioning on a circular path, in mm/min


Note

The cycle requires a milling cutter with an "end tooth cutting across center" (DIN844).

Function

The cycle SLOT2 is a combined roughing-finishing cycle.


Use this cycle to machine circumferential slots arranged on a circle.

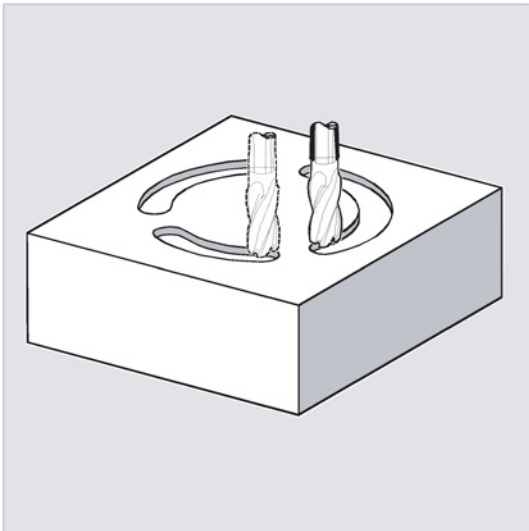

Sequence

Position reached prior to cycle start:

The starting position can be any position from which each of the slots can be approached without collision.

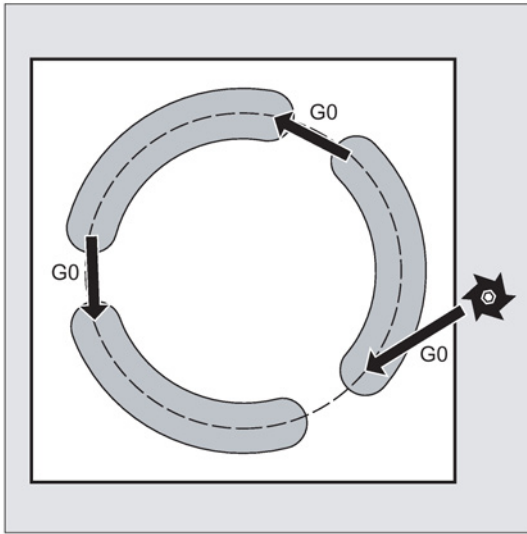


The cycle creates the following sequence of motions:

- G0 is used to approach the position specified in the diagram below at cycle start.
- The steps when machining a circumferential slot are the same as when machining an elongated hole.
- After a circumferential slot is machined completely, the tool is retracted to the retraction plane and the next slot is machined with G0.
- After the last slot has been machined, the tool is moved with G0 to the end position in the machining plane, which is specified in the diagram below, and the cycle is ended.

Explanation of the parameters

For an explanation of the parameters RTP, RFP, and SDIS, see Section "Drilling, centering - CYCLE81 (Page 157)".

For an explanation of the parameters DP, DPR, FFD, FFP1, MID, CDIR, FAL, VARI, MIDF, FFP2, and SSF, see Section "Slots on a circle - SLOT1 (Page 213)".

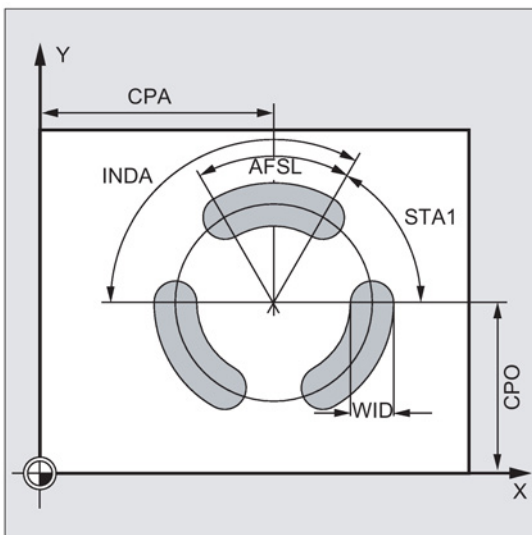

NUM (number)

Use the parameter NUM to specify the number of slots.

AFSL and WID (angle and circumferential slot width)

Use the parameters AFSL and WID to define the form of a slot in the plane. The cycle checks whether the slot width is violated with the active tool. Otherwise, alarm 61105 "Cutter radius too large" will be activated and the cycle aborted.

CPA, CPO and RAD (center point and radius)

You define the position of the circle in the machining plane by the center point (CPA, CPO) and the radius (RAD). Only positive values are permitted for the radius.

FFCP

Use the parameter FFCP to program a special feedrate for intermediate positioning on circular path.

STA1 and INDA (starting and incremental angle)

The arrangement of the circumferential slots on the circle is defined by these parameters.

STA1 defines the angle between the positive direction of the first axis (abscissa) of the workpiece coordinate system active before the cycle was called and the first slot.

The INDA parameter contains the angle from one circumferential slot to the next.

If INDA=0, the incremental angle is calculated from the number of circumferential slots so that they are arranged equally around the circle.

Note


A tool compensation must be programmed before the cycle is called. Otherwise, the cycle is aborted and alarm 61000 "No tool compensation active" is output.

If incorrect values are assigned to the parameters that determine the arrangement and size of the slots and thus cause mutual contour violation of the slots, the cycle is not started.

The cycle is aborted and the error message 61104 "Contour violation of slots/elongated holes" is output.

During the cycle, the workpiece coordinate system is rotated and offset. The actual value display in the workpiece coordinate system is always shown such that the circumferential slot currently being machined starts on the first axis of the current processing level and the zero point of the workpiece coordinate system is in the center of the circle.


After the cycle has been completed, the workpiece coordinate system is in the same position again as it was before the cycle was called.

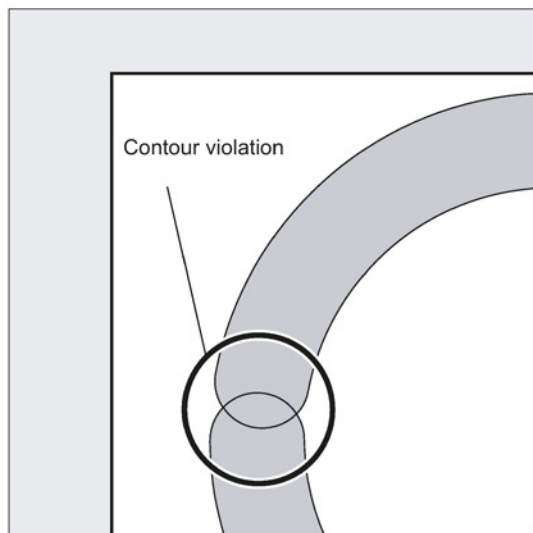

Programming example 1

Use this program to machine three circumferential slots arranged at a circle with center point X60 Y60 and radius 42 mm in the XY plane. The circumferential slots have the following dimensions: width 15 mm, angle for slot length 70 degrees, depth 23 mm. The initial angle is 0 degree, and the incremental angle is 120 degrees. The slot contours are machined to a final machining allowance of 0.5 mm, the safety clearance in infeed axis Z is 2 mm, and the maximum depth infeed is 6 mm. The slots are to be completely machined. Speed and feedrate are to be the same when finishing. The infeed when finishing is to be performed to slot depth.

See the following programming example for circumferential slot:

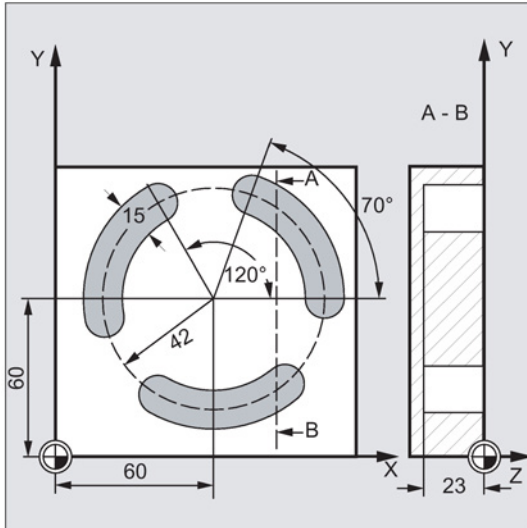

```

N10 G17 G90 T1 D1 S600 M3
N20 G0 X60 Y60 Z5
N30 SLOT2(2, 0, 2, -23, , 3, 70, 15, 60, 60, 42, , 120,
100, 300, 6, 2, 0.5, 0, , 0, )
N40 M02

```

```

; Specification of technology values
; Approach starting position
; Cycle call
Reference plane+SDIS=retraction plane
means: Lowering in the infeed axis with
G0 to reference plane+SDIS no longer
applicable, parameters VAR, MIDF, FFP2
and SSF omitted
; End of program

```

Programming example 2

Proceed through the following steps:



1. Select the desired operating area.




2. Open the vertical softkey bar for available milling cycles.



3. Press this softkey from the vertical softkey bar.



4. Press this softkey to open the window for SLOT2. Parameterize the cycle as desired.

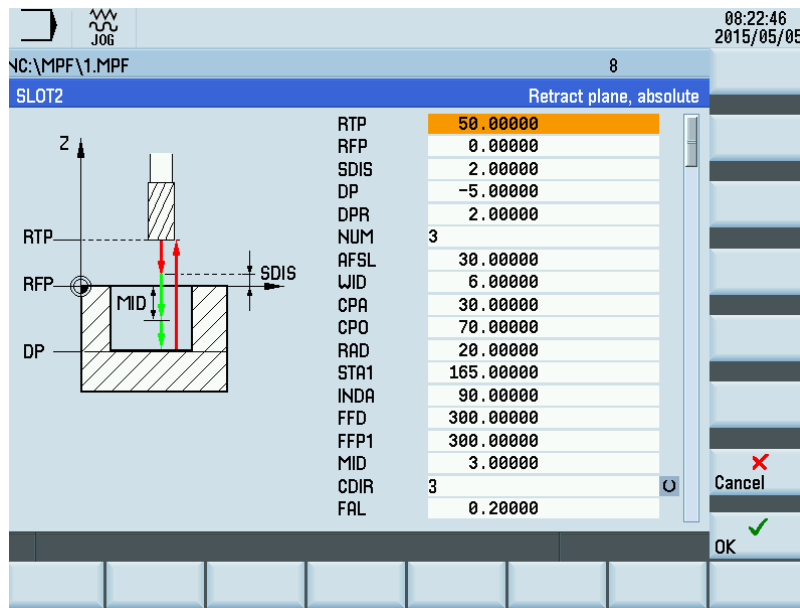

5. Confirm your settings with this softkey. The cycle is then automatically transferred to the program editor.

```
NC:\MPF\1.MPF 2
SLOT2( 50, 0, 2, -5, 2, 3, 30, 6, 30, 70, 20, 165, 90, 300, 300, 3,
3, 0.2, 0, , 0, , )
==eof==
```

12.6.9 Milling a rectangular pocket - POCKET3

Programming

POCKET3(_RTP, _RFP, _SDIS, _DP, _LENG, _WID, _CRAD, _PA, _PO, _STA, _MID, _FAL, _FALD, _FFP1, _FFD, _CDIR, _VARI, _MIDA, _AP1, _AP2, _AD, _RAD1, _DP1)

Parameters

Parameter	Data type	Description
_RTP	REAL	Retraction plane (absolute)
_RFP	REAL	Reference plane (absolute)
_SDIS	REAL	Safety clearance (enter without sign)
_DP	REAL	Pocket depth (absolute)
_LENG	REAL	Pocket length, for dimensioning from the corner with sign
_WID	REAL	Pocket width, for dimensioning from the corner with sign
_CRAD	REAL	Pocket corner radius (enter without sign)
_PA	REAL	Reference point for the pocket (absolute), first axis of the plane
_PO	REAL	Reference point for the pocket (absolute), second axis of the plane
_STA	REAL	Angle between the pocket longitudinal axis and the first axis of the plane (enter without sign); Range of values: $0^\circ \leq STA < 180^\circ$
_MID	REAL	Maximum infeed depth (enter without sign)
_FAL	REAL	Finishing allowance at the pocket edge (enter without sign)
_FALD	REAL	Finishing allowance at the base (enter without sign)
_FFP1	REAL	Feedrate for surface machining
_FFD	REAL	Feedrate for depth infeed


Parameter	Data type	Description
_CDIR	INT	Milling direction: (enter without sign) Values: 0: Down-cut milling (in the spindle direction) 1: Conventional milling 2: With G2 (independent of spindle direction) 3: With G3
_VARI	INT	Machining type UNITS DIGIT Values: 1: roughing, 2: finishing TENS DIGIT: Values: 0: Perpendicular to the pocket center with G0 1: Perpendicular to the pocket center with G1 2: Along a helix 3: Oscillation along the pocket longitudinal axis
The other parameters can be selected as options. They define the insertion strategy and the overlap for solid machining (to be entered without sign):		
_MIDA	REAL	Maximum infeed width as a value in solid machining in the plane
_AP1	REAL	Blank dimension of pocket length
_AP2	REAL	Blank dimension of pocket width
_AD	REAL	Blank pocket depth dimension from reference plane
_RAD1	REAL	Radius of the helical path on insertion (relative to the tool center point path) or maximum insertion angle for reciprocating motion
_DP1	REAL	Insertion depth per 360° revolution on insertion along helical path

Function

The cycle can be used for roughing and finishing. For finishing, a face cutter is required.

The depth infeed will always start at the pocket center point and be performed vertically from there; thus it is practical to predrill at this position.

- The milling direction can be determined either by using a G command (G2/G3) or from the spindle direction as synchronous or up-cut milling.
- For solid machining, the maximum infeed width in the plane can be programmed.
- Finishing allowance also for the pocket base
- There are three different insertion strategies:
 - vertically to the pocket center
 - along a helical path around the pocket center
 - oscillating at the pocket central axis
- Shorter approach paths in the plane for finishing
- Consideration of a blank contour in the plane and a blank dimension at the base (optimum machining of preformed pockets possible).

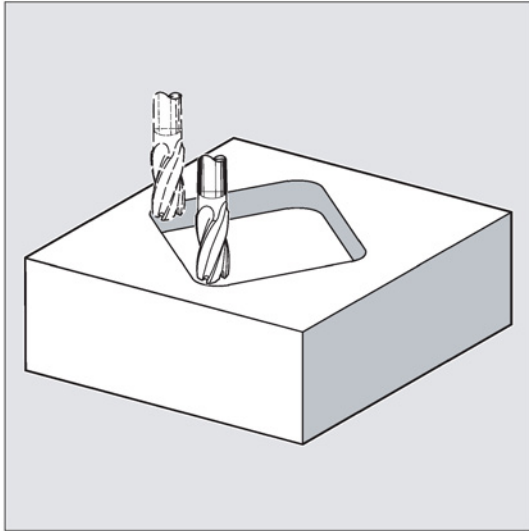


Sequence

Position reached prior to cycle start:

Starting position is any position from which the pocket center point can be approached at the height of the retraction plane without collision.

Sequence of motions when roughing:

With G0, the pocket center point is approached at the retraction level, and then, from this position, with G0, too, the reference plane brought forward by the safety clearance is approached. The machining of the pocket is then carried out according to the selected insertion strategy, taking into account the programmed blank dimensions.

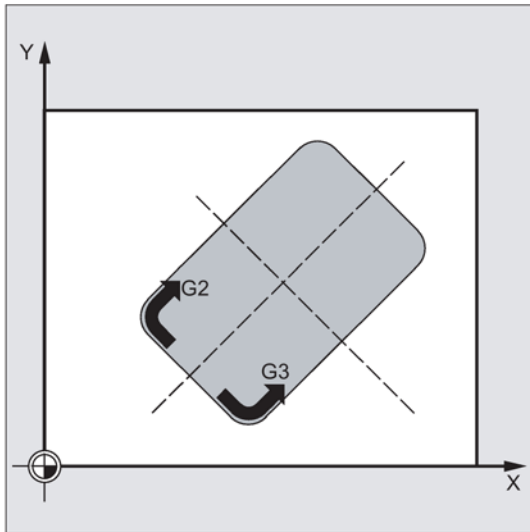

Sequence of motions when finishing:

Finishing is performed in the order from the edge until the finishing allowance on the base is reached, and then the base is finished. If one of the finishing allowances is equal to zero, this part of the finishing process is skipped.

- Finishing on the edge

While finishing on the edge, the tool traverses around the pocket contour only once.

For finishing on the edge, the path includes one quadrant reaching the corner radius. The radius of this path is normally 2 mm or, if "less space" is provided, equals to the difference between the corner radius and the mill radius.

If the final machining allowance on the edge is larger than 2 mm, the approach radius is increased accordingly.

The depth infeed is performed with G0 in the open towards the pocket center, and the starting point of the approach path is also reached with G0.

- Finishing on the base

During finishing on the base, the machine performs G0 towards the pocket center until reaching a distance equal to pocket depth + finishing allowance + safety clearance. From this point onwards, the tool is always fed in **vertically** at the depth (since a tool with a front cutting edge is used for base finishing).


The base surface of the pocket is machined once.

Insertion strategies

- Inserting vertically to the pocket center means that the current infeed depth calculated internally in the cycle ($\leq$ maximum infeed depth programmed under `_MID`) is executed in a block containing G0 or G1.
- Insertion at a helical path means that the cutter center point traverses along the helical path determined by the radius `_RAD1` and the depth per revolution `_DP1`. The feedrate is also programmed under `_FFD`. The direction of rotation of this helical path corresponds to the direction of rotation with which the pocket will be machined.
The insertion depth programmed under `_DP1` is taken into account as the maximum depth and is always calculated as an integer number of revolutions of the helical path.
If the current depth required for an infeed (this can be several revolutions on the helical path) is reached, a full circle is still executed to eliminate the inclined path of insertion.
Pocket solid machining then starts in this plane and continues until it reaches the final machining allowance.
The starting point of the described helical path is at the longitudinal axis of the pocket in "plus direction" and is approached with G1.
- Insertion with oscillation to the central axis of the pocket means that the cutter center point is inserted oscillating on a straight line until it reaches the next current depth. The maximum immersion angle is programmed under `_RAD1`, and the length of the oscillation travel is calculated in the cycle. If the current depth is reached, the travel is executed once more without depth infeed in order to eliminate the inclined insertion path. The feedrate is programmed under `_FFD`.

Taking into account the blank dimensions

During solid machining of the pockets, it is possible to take into account blank dimensions (e.g. when machining precast parts).

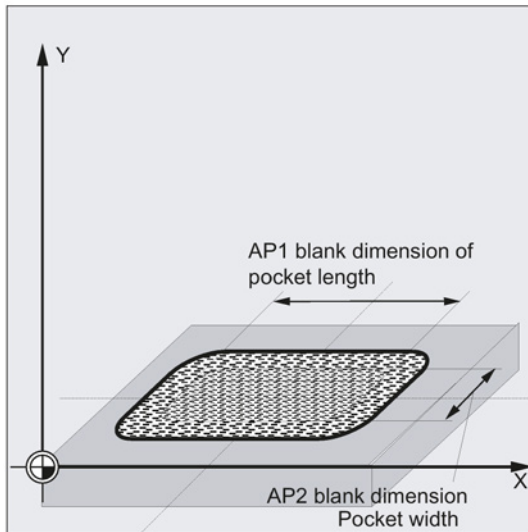

The basic sizes for the length and width (`_AP1` and `_AP2`) are programmed without sign and their symmetrical positions around the pocket center point are computed in the cycle. You define the part of the pocket which is no longer to be machined by solid machining. The blank dimension for the depth (`_AD`) is also programmed without sign and taken into account by the reference plane in the direction of the pocket depth.


The depth infeed (including blank dimensions) is carried out according to the programmed type (helical path, reciprocating, vertically). If the cycle detects that there is space enough in the pocket center because of the given blank contour and the radius of the active tool, the infeed is carried out vertically to the pocket center point as long as it is possible in order not to traverse extensive insertion paths in the open.

Solid machining of the pocket is carried out starting from the top downwards.

Explanation of the parameters

For an explanation of the parameters `_RTP`, `_RFP`, and `_SDIS`, see Section "Drilling, centering - CYCLE81 (Page 157)".

For an explanation of the `_DP` parameter, see Section "Long holes located on a circle - LONGHOLE (Page 209)".

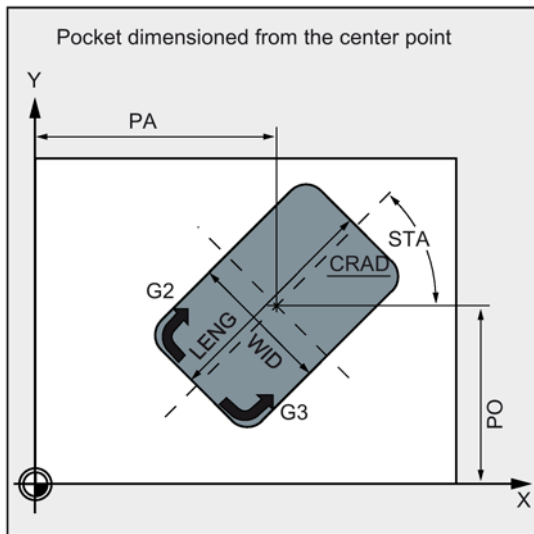

`_LENG`, `_WID` and `_CRAD` (pocket length, pocket width and corner radius)

Use the parameters `_LENG`, `_WID` and `_CRAD` to define the form of a pocket in the plane.

If you cannot traverse the programmed corner radius with the active tool since its radius is larger, then the corner radius of the machine pocket corresponds to the tool radius.

If the milling tool radius is larger than half of the length or width of the pocket, then the cycle will be aborted and alarm 61105 "Cutter radius too large" is output.

`_PA`, `_PO` (reference point)

Use the parameters `_PA` and `_PO` to define the reference point of the pocket in the axes of the plane. This is the pocket center point.

`_STA` (angle)

`_STA` indicates the angle between the first axis of the plane (abscissa) and the longitudinal axis of the pocket.

`_MID` (infeed depth)

Use this parameter to define the maximum infeed depth when roughing.

The depth infeed is performed by the cycle in equally-sized infeed steps.

By using `_MID` and the entire depth, the cycle calculates this infeed automatically. The minimum possible number of infeed steps is used as the basis.

`_MID=0` means that the cut to pocket depth is made with one feed.

`_FAL` (finishing allowance at edge)

The finishing allowance only affects the machining of the pocket in the plane on the edge.

If the final machining allowance $\geq$ tool diameter, the pocket will not necessarily be machined completely. The message "Caution: final machining allowance $\geq$ tool diameter" appears; the cycle, however, is continued.

`_FALD` (finishing allowance at the base)

When roughing, a separate finishing allowance is taken into account at the base.

`_FFD` and `_FFP1` (feedrate for depth and surface)

The feedrate `_FFD` is effective when inserting into the material.

The feedrate `_FFP1` is active for all movements in the plane traversed at feedrate when machining.

_CDIR (milling direction)

Use this parameter to specify the machining direction for the pocket.

Using the parameter _CDIR, the milling direction can be programmed directly with "2 for G2" and "3 for G3", or alternatively with "synchronous milling" or "conventional milling".

Synchronized operation or reverse rotation are determined internally in the cycle via the direction of rotation of the spindle activated prior to calling the cycle.

Down-cut milling	Up-cut milling
M3 → G3	M3 → G2
M4 → G2	M4 → G3

_VARI (machining type)

Use the parameter VARI to define the machining type.

Possible values are:

Units digit:

- 1=roughing
- 2=finishing

Tens digit (infeed):

- 0=vertically to pocket center with G0
- 1=vertically to pocket center with G1
- 2=along a helical path
- 3=oscillating to pocket length axis

If a different value is programmed for the parameter _VARI, the cycle is aborted after output of alarm 61002 "Machining type defined incorrectly".

_MIDA (max. infeed width)

Use this parameter to define the maximum infeed width when solid machining in a plane. Analogously to the known calculation method for the infeed depth (equal distribution of the total depth with maximum possible value) the width is distributed equally, maximally with the value programmed under _MIDA.

If this parameter is not programmed or has value 0, the cycle will internally use 80% of the milling tool diameter as the maximum infeed width.

Note

Applies if the calculated width infeed from edge machining is recalculated when reaching the full pocket in the depth; otherwise the width infeed calculated at the beginning is kept for the whole cycle.

_AP1, _AP2, _AD (blank dimensions)

Use the parameters _AP1, _AP2 and _AD to define the blank dimensions (incremental) of the pocket in the plane and in the depth.

_RAD1 (radius)

Use the _RAD1 parameter to define the radius of the helical path (relative to the tool center point path) or the maximum insertion angle for the reciprocating motion.

_DP1 (insertion depth)

Use the parameter _DP1 to define the infeed depth when inserting to the helical path.

A tool compensation must be programmed before the cycle is called. Otherwise, the cycle is aborted and alarm 61000 "No tool compensation active" is output.

Internally in the cycle, a new current workpiece coordinate system is used which influences the actual value display. The zero point of this coordinate system is to be found in the pocket center point. At the end of the cycle, the original coordinate system is active again.


Programming example: Pocket

Use this program to machine a pocket in the XY plane which is 60 mm in length, 40 mm in width, and which has a corner radius of 8 mm and is 17.5 mm in depth. The pocket has an angle of 0 degrees to the X axis. The final machining allowance of the pocket edges is 0.75 mm, 0.2 mm at the base, the safety clearance in the Z axis, which is added to the reference plane, is 0.5 mm. The center point of the pocket lies at X60 and Y40, the maximum depth infeed is 4 mm.

The machining direction results from the direction of rotation of the spindle in the case of down-cut milling. A milling cutter with 5 mm radius is used.

Merely a rough machining operation is to be carried out.

See the following programming example for rectangular pocket:

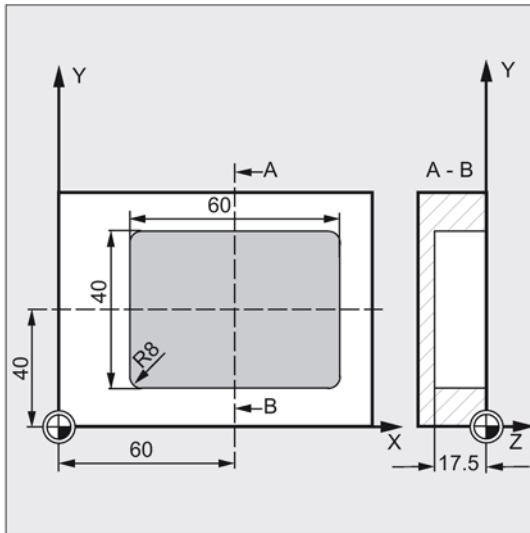

```

N10 G90 T1 D1 S600 M4                                ; Specification of technology values
N20 G17 G0 X60 Y40 Z5                                ; Approach starting position
N30 POCKET3(5, 0, 0.5, -17.5, 60, 40, 8, 60, 40, 0, 4,  ; Cycle call
    0.75, 0.2, 1000, 750, 0, 11, 5, , , , , )
N40 M02                                                ; End of program

```

12.6.10 Milling a circular pocket - POCKET4

Programming

POCKET4 (_RTP, _RFP, _SDIS, _DP, _PRAD, _PA, _PO, _MID, _FAL, _FALD, _FFP1, _FFD, _CDIR, _VARI, _MIDA, _AP1, _AD, _RAD1, _DP1)

Parameters

Parameter	Data type	Description
_RTP	REAL	Retraction plane (absolute)
_RFP	REAL	Reference plane (absolute)
_SDIS	REAL	Safety clearance (to be added to the reference plane; enter without sign)
_DP	REAL	Pocket depth (absolute)
_PRAD	REAL	Pocket radius
_PA	REAL	Pocket center point, abscissa
_PO	REAL	Pocket center point, ordinate
_MID	REAL	Maximum infeed depth (enter without sign)
_FAL	REAL	Finishing allowance at the pocket edge (enter without sign)
_FALD	REAL	Finishing allowance at the base (enter without sign)
_FFP1	REAL	Feedrate for surface machining
_FFD	REAL	Feedrate for depth infeed

Parameter	Data type	Description
_CDIR	INT	Milling direction: (enter without sign) Values: 0: Down-cut milling (in the spindle direction) 1: Conventional milling 2: With G2 (independent of spindle direction) 3: With G3
_VARI	INT	Machining type UNITS DIGIT Values: 1: roughing, 2: finishing TENS DIGIT: Values: 0: Perpendicular to the pocket center with G0 1: Perpendicular to the pocket center with G1 2: Along a helix
The other parameters can be selected as options. They define the insertion strategy and the overlap for solid machining (to be entered without sign):		
_MIDA	REAL	Maximum infeed width as a value in solid machining in the plane
_AP1	REAL	Pocket radius blank dimension
_AD	REAL	Blank pocket depth dimension from reference plane
_RAD1	REAL	Radius of the helical path during insertion (relative to the tool center point path)
_DP1	REAL	Insertion depth per 360° revolution on insertion along helical path

Function

Use this cycle to machine circular pockets in the machining plane. For finishing, a face cutter is required.

The depth infeed always starts at the pocket center point and be performed vertically from there; thus it is practical to predrill at this position.

- The milling direction can be determined either using a G command (G2/G3) or from the spindle direction as synchronous or up-cut milling.
- For solid machining, the maximum infeed width in the plane can be programmed.
- Finishing allowance also for the pocket base.
- Two different insertion strategies:
 - vertically to the pocket center
 - along a helical path around the pocket center
- Shorter approach paths in the plane for finishing
- Consideration of a blank contour in the plane and a blank dimension at the base (optimum machining of preformed pockets possible).
- _MIDA is recalculated during edge machining.

Sequence

Position reached prior to cycle start:

Starting position is any position from which the pocket center point can be approached at the height of the retraction plane without collision.

Motion sequence when roughing (_VARI=X1):

With G0, the pocket center point is approached at the retraction level, and then, from this position, with G0, too, the reference plane brought forward by the safety clearance is approached. The machining of the pocket is then carried out according to the selected insertion strategy, taking into account the programmed blank dimensions.

Sequence of motions when finishing:

Finishing is performed in the order from the edge until the finishing allowance on the base is reached, and then the base is finished. If one of the finishing allowances is equal to zero, this part of the finishing process is skipped.

- **Finishing on the edge**

While finishing on the edge, the tool traverses around the pocket contour only once.

For finishing on the edge, the path includes one quadrant reaching the pocket radius. The radius of this path is 2 mm as the maximum or, if "less space" is provided, equals to the difference between the pocket radius and the milling radius.

The depth infeed is performed with G0 in the open towards the pocket center, and the starting point of the approach path is also reached with G0.

- **Finishing on the base**

During finishing on the base, the machine performs G0 towards the pocket center until reaching a distance equal to pocket depth + finishing allowance + safety clearance. From this point onwards, the tool is always fed in **vertically** at the depth (since a tool with a front cutting edge is used for base finishing).

The base surface of the pocket is machined once.

Insertion strategies

For more information, see Section "Milling a rectangular pocket - POCKET3 (Page 223)".

Taking into account the blank dimensions


During solid machining of the pockets, it is possible to take into account blank dimensions (e.g. when machining precast parts).

With circular pockets, the blank dimension _AP1 is also a circle (with a smaller radius than the pocket radius).

Explanation of the parameters

For an explanation of the parameters _RTP, _RFP, and _SDIS, see Section "Drilling, centering - CYCLE81 (Page 157)".

For an explanation of the parameters _DP, _MID, _FAL, _FALD, _FFP1, _FFD, _CDIR, _MIDA, _AP1, _AD, _RAD1, and _DP1, see Section "Milling a rectangular pocket - POCKET3 (Page 223)".

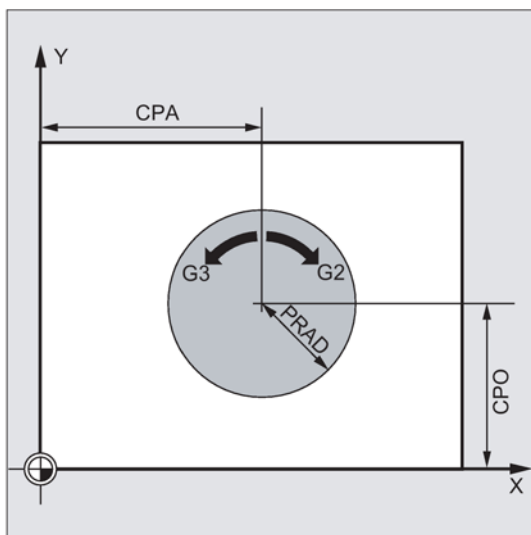

_PRAD (pocket radius)

The form of the circular pocket is determined solely by its radius.

If this is smaller than the tool radius of the active tool, then the cycle is aborted and alarm 61105 "Cutter radius too large" is output.

_PA, _PO (pocket center point)

Use the parameters _PA and _PO to define the pocket center point. Circular pockets are always dimensioned across the center.

_VARI (machining type)

Use the parameter _VARI to define the machining type.

Possible values are:

Units digit:

- 1=roughing
- 2=finishing

Tens digit (infeed):

- 0=vertically to pocket center with G0
- 1=vertically to pocket center with G1
- 2=along a helical path

If a different value is programmed for the parameter _VARI, the cycle is aborted after output of alarm 61002 "Machining type defined incorrectly".

Note

A tool compensation must be programmed before the cycle is called. Otherwise, the cycle is aborted and alarm 61000 "No tool compensation active" is output.


Internally in the cycle, a new current workpiece coordinate system is used which influences the actual value display. The zero point of this coordinate system is to be found in the pocket center point.

At the end of the cycle, the original coordinate system is active again.

Programming example: Circular pocket

With this program, you can machine a circular pocket in the YZ plane. The center point is determined by Y50 Z50. The infeed axis for the depth infeed is the X axis. Neither finishing dimension nor safety clearance is specified. The pocket is machined with down-cut milling. Infeed is performed along a helical path.

A milling cutter with 10 mm radius is used. See the following programming example for circular pocket:

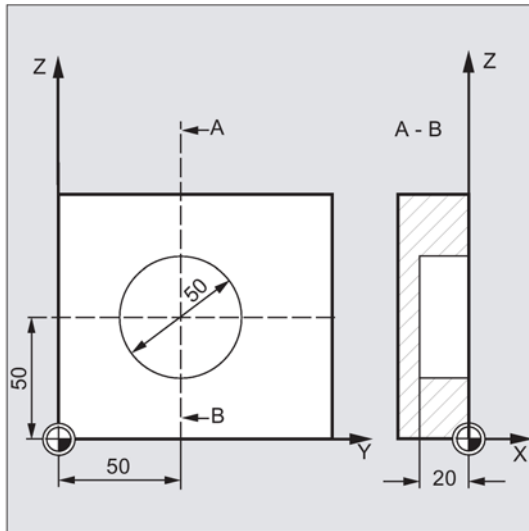

```
N10 G17 G90 G0 S650 M3 T1 D1
N20 X50 Y50
N30 POCKET4(3, 0, 0, -20, 25, 50, 60, 6, 0, 0, 200, 100, 1,
21, 0, 0, 0, 2, 3)
N40 M02
```

```
; Specification of technology values
; Approach starting position
; Cycle call
Parameters FAL and FALD are omitted
; End of program
```

12.6.11 Thread milling - CYCLE90

Programming


CYCLE90 (RTP, RFP, SDIS, DP, DPR, DIATH, KDIAM, PIT, FFR, CDIR, TYPTH, CPA, CPO)

Parameters

Parameter	Data type	Description
RTP	REAL	Retraction plane (absolute)
RFP	REAL	Reference plane (absolute)
SDIS	REAL	Safety clearance (enter without sign)
DP	REAL	Final drilling depth (absolute)
DPR	REAL	Final drilling depth relative to the reference plane (enter without sign)
DIATH	REAL	Nominal diameter, outer diameter of the thread
KDIAM	REAL	Core diameter, internal diameter of the thread
PST	REAL	Thread pitch; value range: 0.001 ... 2000.000 mm
FFR	REAL	Feedrate for thread milling (enter without sign)
CDIR	INT	Direction of rotation for thread milling Values: 2 (for thread milling with G2), 3 (for thread milling with G3)
TYPTH	INT	Thread type Values: 0=internal thread, 1=external thread
CPA	REAL	Center point of circle, abscissa (absolute)
CPO	REAL	Center point of circle, ordinate (absolute)

Function

By using the cycle CYCLE90, you can produce internal or external threads. The path when milling threads is based on a helix interpolation. All three geometry axes of the current plane, which you define before calling the cycle, are involved in this motion.

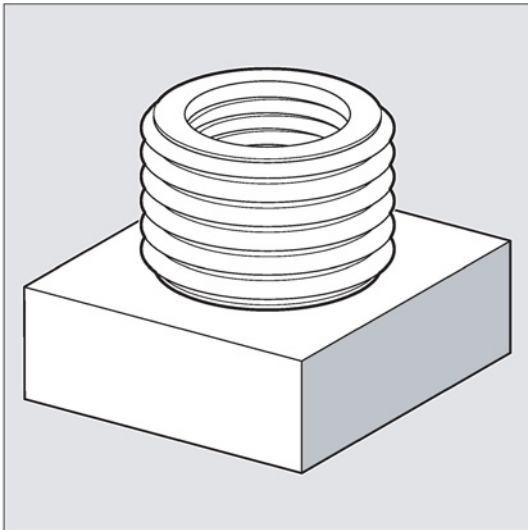


Sequence for external thread

Position reached prior to cycle start:

The starting position is any position from which the starting position at the outside diameter of the thread at the height of the retraction plane can be reached without collision.

This start position for thread milling with G2 lies between the positive abscissa and the positive ordinate in the current level (i.e. in the first quadrant of the coordinate system). For thread milling with G3, the start position lies between the positive abscissa and the negative ordinate (namely in the fourth quadrant of the coordinate system).

The distance from the thread diameter depends on the size of the thread and the tool radius used.

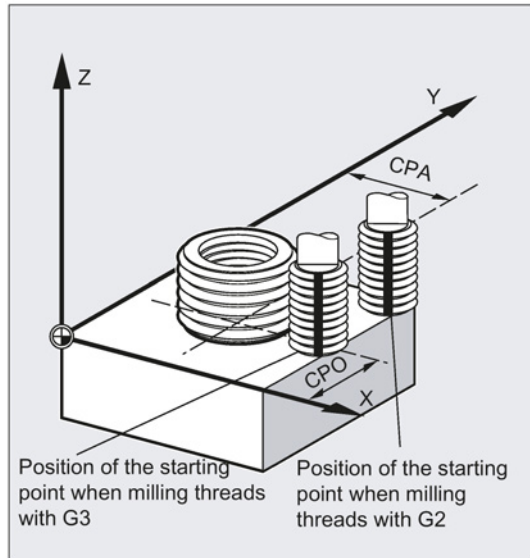

The cycle creates the following sequence of motions:

- Positioning on the starting point using G0 at the height of the retraction plane in the applicate of the current plane
- Infeed to the reference plane brought forward by the safety clearance for swarf removal, using G0
- Approach motion to the thread diameter along a circle path opposite to the direction G2/G3 programmed under CDIR
- Thread milling along a helix path using G2/G3 and the feedrate value FFR
- Retraction motion along a circle path in the opposite direction of rotation G2/G3 at the reduced feedrate FFR
- Retraction to the retraction plane along the applicate using G0

Sequence for internal thread

Position reached prior to cycle start:

The starting position is any position from which the center point of the thread at the height of the retraction plane can be reached without collision.

The cycle creates the following sequence of motions:

- Positioning on the center point using G0 at the height of the retraction plane in the applicate of the current plane
- Infeed to the reference plane brought forward by the safety clearance for swarf removal, using G0
- Approach to an approach circle calculated internally in the cycle using G1 and the reduced feedrate FFR
- Approach motion to the thread diameter along a circle path according to the direction G2/G3 programmed under CDIR
- Thread milling along a helix path using G2/G3 and the feedrate value FFR
- Retraction motion along a circle path in the same direction of rotation at the reduced feedrate FFR
- Retraction to the center point of the thread using G0
- Retraction to the retraction plane along the applicate using G0

Thread from bottom to top

For technological reasons, it can also be reasonable to machine a thread from bottom to top. In this case, the retraction plane RTP will be behind the thread depth DP.

This machining is possible, but the depth specifications must be programmed as absolute values and the retraction plane must be approached before calling the cycle or a position after the retraction plane must be approached.

Programming example (thread from bottom to top)

A thread with a pitch of 3 mm is to start from -20 and to be milled to 0. The retraction plane is at 8.

```
N10 G17 X100 Y100 S300 M3 T1 D1 F1000
N20 Z8
N30 CYCLE90 (8, -20, 0, -60, 0, 46, 40, 3, 800, 3, 0, 50,
50)
N40 M2
```

The hole must have a depth of at least -21.5 (half pitch in excess).

Overshooting in the direction of the thread length

For thread milling, the travel-in and travel-out movements occur along all three axes concerned. This means that the travel-out movement includes a further step in the vertical axis, beyond the programmed thread depth.

The overshoot is calculated as follows:

$$\Delta z = \frac{p}{4} * \frac{2 * WR + RDIFF}{DIATH}$$

Δz : Overshoot, internal

p: Pitch

WR: Tool radius


DIATH: External diameter of the thread

RDIFF: Radius difference for travel-out circle

For internal threads, $RDIFF = DIATH/2 - WR$; for external threads, $RDIFF = DIATH/2 + WR$.

Explanation of the parameters

For an explanation of the parameters RTP, RFP, SDIS, DP, and DPR, see Section "Drilling, centering - CYCLE81 (Page 157)".

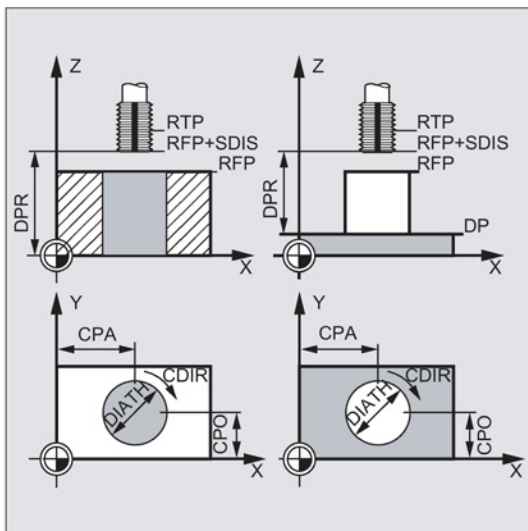

DIATH, KDIAM, and PIT (nominal diameter, core diameter, and thread pitch)

These parameters are used to determine the thread data nominal diameter, core diameter, and pitch. The parameter DIATH is the external, and KDIAM is the internal diameter of the thread. The travel-in/travel-out movements are created internally in the cycle, based on these parameters.

FFR (feedrate)

The value of the parameter FFR is specified as the current feedrate value for thread milling. It is effective when thread milling on a helical path.

This value will be reduced in the cycle for the travel-in/travel-out movements. The retraction is performed outside the helix path using G0.

CDIR (direction of rotation)

This parameter is used to specify the value for the machining direction of the thread.

If the parameter has an illegal value, the following message will appear:

"Wrong milling direction; G3 is generated".

In this case, the cycle is continued and G3 is automatically generated.

TYPTH (thread type)

The parameter TYPTH is used to define whether you want to machine an external or an internal thread.

CPA and CPO (center point)

These parameters are used to define the center point of the drill hole or of the spigot on which the thread will be produced.

Note

The cutter radius is calculated internally in the cycle. Therefore, a tool compensation must be programmed before calling the cycle. Otherwise, the alarm 61000 "No tool compensation active" appears and the cycle is aborted.


If the tool radius=0 or negative, the cycle is also aborted and this alarm is issued.

With internal threads, the tool radius is monitored and alarm 61105 "Cutter radius too large" is output, and the cycle is aborted.

Programming example: Internal thread

By using this program, you can mill an internal thread at point X60 Y50 of the G17 plane.

See the following programming example for internal thread:

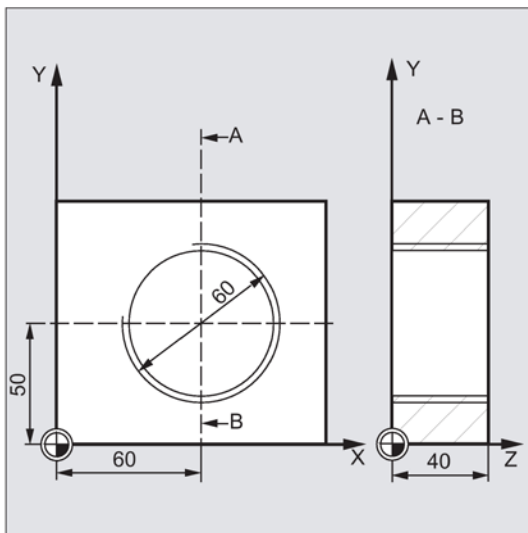

```
DEF REAL RTP=48, RFP=40, SDIS=5, DP=0, DPR=40, DIATH=60,
KDIAM=50
DEF REAL PIT=2, FFR=500, CPA=60, CPO=50
DEF INT CDIR=2, TYPTH=0
N10 G90 G0 G17 X0 Y0 Z80 S200 M3
N20 T5 D1
N30 CYCLE90 (RTP, RFP, SDIS, DP, DPR, DIATH, KDIAM, PIT,
FFR, CDIR, TYPTH, CPA, CPO)
N40 G0 G90 Z100
N50 M02
```

; Definition of the variable with value assignments

; Approach starting position
; Specification of technology values
; Cycle call

; Approach position after cycle
; End of program

12.6.12 High speed settings - CYCLE832

Programming

CYCLE832 (TOL, TOLM, 1)

Parameters

Parameter	Data type	Description
TOL	REAL	Tolerance of machining axes
TOLM	INT	Machining type selection 0: Deselect 1: Finishing 2: Semi-finishing 3: Roughing
PSYS	INT	Internal parameter, only the default value 1 is possible

Function

Use CYCLE832 to machine free-form surfaces that involve high requirements for velocity, precision and surface quality.

This cycle function groups together the important G codes, machine data and setting data that are required for high-speed cutting machining.

Advanced Surface is automatically activated when you work with CYCLE832.

Note

Advanced Surface function is only supported by control system with PPU161.3.

Explanation of the parameters

TOLM (Machining types)

This parameter determines which technological machining type is to be used.

Corresponding to the appropriate G commands, the four machining types are assigned to technology G group 59:

Machining type	Technology G group 59	Explanation
Deselect	DYNNORM	Machining without AS
Finishing	DYNFINISH	Milling with AS
Semi-finishing	DYNSEMIFIN	Milling with AS
Roughing	DYNROUGH	Milling with AS

TOL (Tolerance)

This refers to the tolerance of axes involved in machining. The tolerance value is written to the relevant machine or setting data depending on the G codes.

Using CYCLE832, the NC program is very precisely harmonized across the various machining strategies:

- When roughing, using smoothing of the contour, the emphasis is on speed.
- When finishing, the emphasis is on accuracy.

In both cases, specifying a tolerance ensures that the machining contour is maintained in order to achieve the desired surface quality. Generally, a higher tolerance is selected for roughing than for finishing.

Note

The jerk also affects cutting speed and quality. If the default jerk setting cannot satisfy the cutting requirement, you can set the jerk to a lower value. Jerk-limited velocity control is selected using the G code SOFT. A lower jerk value improves surface quality but it reduces cutting efficiency.

Programming example 1

```

N10 T1 D1;
N20 G54;
N30 M3 S1200;
N40 CYCLE832 (0.05, 3, 1);
N60 EXTCALL ("USB:\ CAM_ROUGH.SPF");
N70 CYCLE832 (0.005, 1, 1);
N90 EXTCALL ("USB:\ CAM_FINISH.SPF");
N100 M30

```

Tolerance value 0.05 [3] = roughing, [1] is fixed.
 Execute programs stored on an external USB memory stick
 Tolerance value 0.005 [1] = finishing, [1] is fixed.
 Execute programs stored on an external USB memory stick

Programming example 2

The cycle can be found and parameterized from the main screen of the milling cycles.




1. Select the desired operating area.



2. Open the vertical softkey bar for available milling cycles.



3. Press this softkey to open the window for this cycle. Parameterize the cycle as desired.

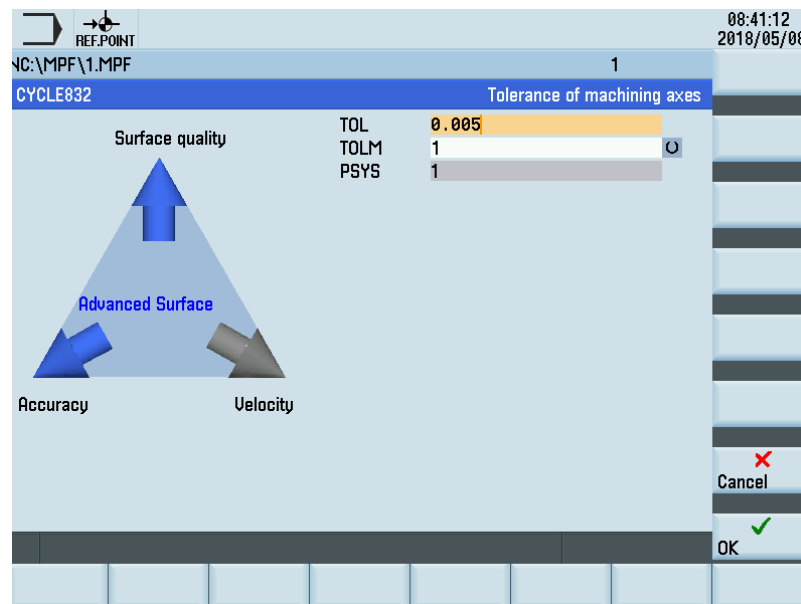

5. Confirm your settings with this softkey. The cycle is then automatically transferred to the program editor as a separate block.

```

NC:\MPF\1.MPF
CYCLE832(0.005, 1, 1)
==eof==

```

12.7 Error messages and error handling

12.7.1 General Information

If error conditions are detected in the cycles, an alarm is generated and the execution of the cycle is aborted.

Furthermore, the cycles display their messages in the message line of the control system. These messages do not interrupt the program execution.

The errors with their reactions and the messages in the message line of the control system are described in conjunction with the individual cycles.

12.7.2 Error handling in the cycles

If error conditions are detected in the cycles, an alarm is generated and the machining is aborted.

Alarms with numbers between 61000 and 62999 generated in the cycles. This range of numbers, in turn, is divided again with regard to alarm responses and cancel criteria.

The error text that is displayed together with the alarm number gives you more detailed information on the error cause.

Alarm number	Clearing criterion	Alarm response
61000 ... 61999	NC_RESET	Block preparation in the NC is aborted
62000 ... 62999	Clear key	The block preparation is interrupted; the cycle can be continued with the following key after the alarm has been cleared: 

12.7.3 Overview of cycle alarms

The error numbers are classified as follows:

6	_	X	_	_
---	---	---	---	---

- X=0 General cycle alarms
- X=1 Alarms generated by the drilling, drilling pattern and milling cycles

12.7.4 Messages in the cycles

The cycles display their messages in the message line of the control system. These messages do not interrupt the program execution.

Messages provide information with regard to a certain behavior of the cycles and with regard to the progress of machining and are usually kept beyond a machining step or until the end of the cycle. An example of messages is as follows:

"Depth: according to the value for the relative depth" from all drilling cycles.

13 Machining typical milling parts

13.1 Operations before programming

Operating sequence


1. Turn on the power supply for the machine tool. Proceed with the operations for the reference point approach, if the machine axis is equipped with an incremental encoder (see Chapter "Switching on and referencing (Page 20)").
2. Create the required tools (see Section "Creating a tool (Page 21)").

3. Activate the tools and the spindle (see Section "Activating the tool and the spindle (Page 23)").
4. Proceed with the handwheel assignment operations if the machine manufacturer has not assigned the handwheel for the control system (see Chapter "Assigning the handwheel (Page 24)").
5. Proceed with the tool setting operations to finish measuring all the tools (see Section "Measuring the tool manually (Page 27)").
6. Verify the tool offset result to guarantee the safety and correctness of machining (see Section "Verifying the tool offset result (Page 28)").

13.2 Programming (Example 1)

Machining requirements

Workpiece drawing (unit: mm)

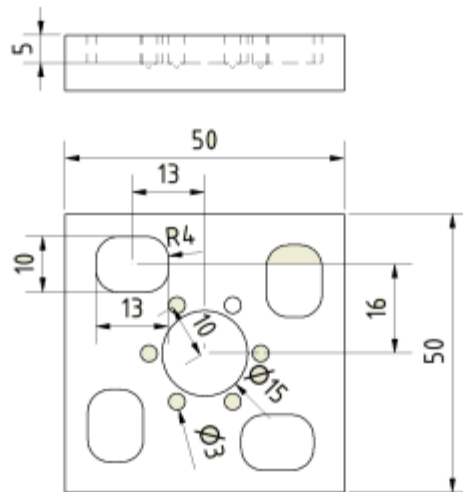

Technical requirements

- The arc transition must be smooth, without lapping.
- The cutting trace must be even.
- The sharp edges must be rounded.

Blank data

Blank material: Cube aluminum

Blank length: 100 mm

Blank width: 80 mm

Blank height: 60 mm (machining length: 46 mm; clamping length: 10 mm)

Required tool

Tool type	Tool number		Tool diameter (mm)	Roughing		Finishing	
	DIN	ISO		Speed	Feedrate	Speed	Feedrate
Face milling tool	T1D1	T1H1	50	1500	600	2500	600
End milling tool	T2D1	T2H2	8	4000	600	4500	600
Drilling tool	T3D1	T3H3	3	5000	100	5000	100

Note

Cut the workpiece manually after machining is over.

 
Operating sequence for programming in Siemens mode



1. Select the program management operating area.




2. Press this softkey to enter the system directory for storing part programs.



3. Press this softkey and enter the name of the new program.




4. Press this softkey to confirm your entry. The part program editor window opens automatically.

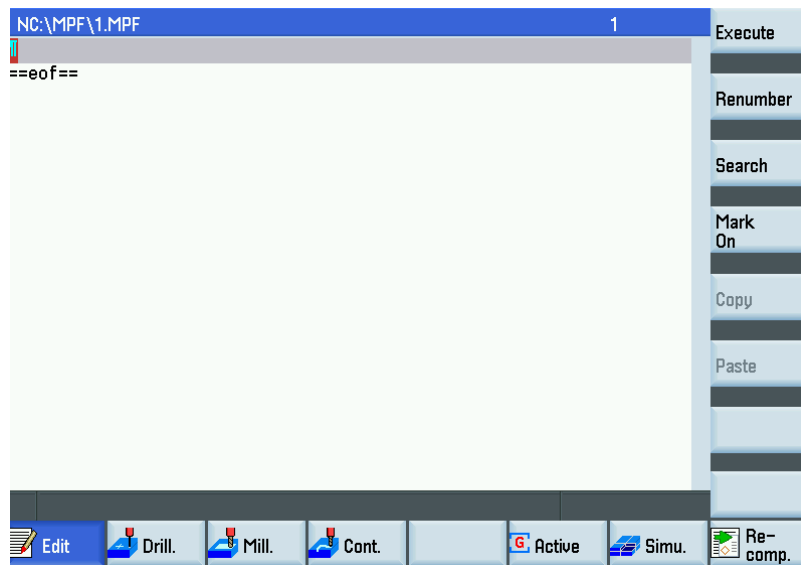


5. Enter the following program in the window. The control system saves your editing automatically.



 6. Open the window for CYCLE71 through the following softkey operations:



Enter the desired parameters as follows:

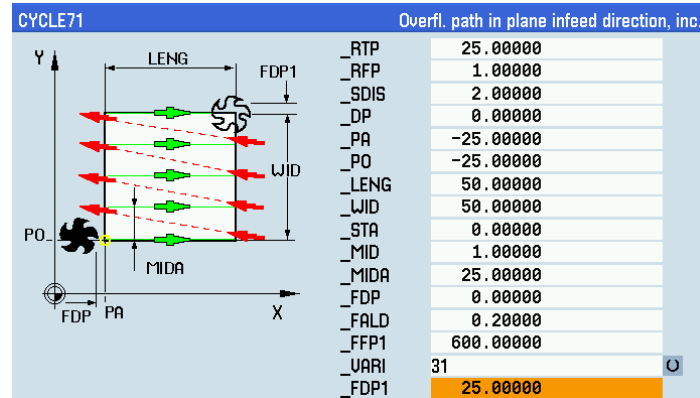

7. Press this softkey to confirm your input and open the cycle programming window.
Enter the following program block:
S2500
8. Press this softkey to return to the program editor window.
9. Move the cursor to "C" in the line for CYCLE71 with the cursor keys and press this softkey to insert a marker.
10. Use the cursor keys to select the entire program block for CYCLE71. Press this softkey to copy the selection to the buffer memory.
11. Place the cursor on the end-of-block character after "S4500" with the cursor keys and press this key to enter a new line.
12. Paste the content of the buffer memory into the new line.
13. Press this softkey to open the window for CYCLE71 again. Change the values of "FDP" and "FALD" to "25" and "0" respectively.
14. Move the cursor to the input field of "VARI" and press this key to change the value to "12".
15. Press this softkey to accept the change.
16. Place the cursor on the end-of-block character of CYCLE71 the with cursor keys and press this key on the MCP to enter a new line.
Continue to enter the following program blocks and press this key again:
G0 Z100 M9
T2 D1
M6
S4000 M3 M8
G0 Z100
_ANF:
17. Open the window for POCKET3 through the following softkey operations:



Enter the desired parameters as follows:

POCKET3		Pitch of helical insertion
_WID	10.00000	
_CRAD	4.00000	
_PA	-13.00000	
_PO	16.00000	
_STA	0.00000	
_MID	1.50000	
_FAL	0.10000	
_FALD	0.10000	
_FFP1	600.00000	
_FFD	50.00000	
_CDIR	2	U
_VARI	11	U
_MIDA	2.50000	
_AP1		
_AP2		
_AD		
_RAD1	2.00000	
_DP1	2.00000	



18. Press this softkey to confirm your input and open the cycle programming window.
Enter the following program blocks:

```
AROT Z90
_END:
REPEAT _ANF _END P=3
ROT
S4500 M3
_ANF1:
```

19. Proceed through the steps described earlier to copy the entire program block for POCKET3 and paste it in the line after the above program blocks.
20. Press this softkey to open the window for POCKET3 again. Change the values of "MID", "FFP1", "FFD" and "VARI" to "5", "400", "200" and "2" respectively.



21. Press this softkey to accept the change and open the cycle programming window.



22. Press this key to enter a new line.
Continue to enter the following program blocks and then press this key again:

```
AROT Z90
_END1:
REPEAT _ANF1 _END1 P=3
ROT
G0 Z100
```

23. Open the window for POCKET4 through the following softkey operations:



Enter the desired parameters as follows:

POCKET4		Pitch of helical insertion
_RFP	0.00000	
_SDIS	2.00000	
_DP	-5.00000	
_PRAD	7.50000	
_PA	0.00000	
_PO	0.00000	
_MID	1.50000	
_FAL	0.10000	
_FALD	0.10000	
_FFP1	600.00000	
_FFD	50.00000	
_CDIR	2	
_VARI	1	
_MIDA	2.00000	
_AP1		
_AD		
_RAD1	3.00000	
_DP1	1.00000	



24. Press this softkey to confirm your input and open the cycle programming window.

 
Enter the following program block:

S4500 M3

25. Proceed through the steps described earlier to copy the entire program block for POCKET4 and paste it in the line after the above blocks.



26. Press this softkey to open the window for POCKET4 again. Change the values of "MID", "FFP1", "FFD" and "VARI" to "5", "400", "200" and "2" respectively.



27. Press this softkey to accept the change and open the cycle programming window.



28. Press this key to enter a new line.

Continue to enter the following program blocks and then press this key again:

G0 Z100 M8

T3 D1

M6

S5000 M3 M8

G0 X0 Y0

29. Open the window for CYCLE81 through the following softkey operations:



Enter the desired parameters as follows:

CYCLE81		Final drilling depth relative to reference plane
RTP	50.00000	
RFP	0.00000	
SDIS	2.00000	
DP	-5.00000	
DPR	0.00000	



30. Press this softkey to call this cycle modally.



31. Confirm your input and open the cycle programming window.

32. Open the window for HOLES2 through the following softkey operations:



Enter the desired parameters as follows:

HOLES2		Number of holes
CPA	0.00000	
CPO	0.00000	
RAD	10.00000	
STA1	0.00000	
INDA	60.00000	
NUM	6	



33. Press this softkey to confirm your input and open the cycle programming window.

Enter the following blocks:

MCALL

G0 Z100 M9

M05

M30

Then you can proceed with the operations for "program simulation and execution (Page 284)".

Screenshots of the complete program

Screen 1:

```

NC:\MPF\1.MPF 1
17 G90 G54 G64 ROT 1
1 D1 1
16 1
30 Z100 1
51500 M3 M8 1
CYCLE71( 25.00000, 1.00000, 2.00000, 0.00000, -25.00000, -25.00000,
50.00000, 50.00000, 0.00000, 1.00000, 25.00000, 0.00000, 0.20000, 60
3.00000, 31, 25.00000) 1
32500 1
CYCLE71( 25.00000, 1.00000, 2.00000, 0.00000, -25.00000, -25.00000,
50.00000, 50.00000, 0.00000, 1.00000, 25.00000, 25.00000, 0.00000, 6
30.00000, 12, 25.00000) 1
30 Z100 M9 1
12 D1 1
16 1
34000 M3 M8 1
30 Z100 1
_ANF: 1
  
```

Screen 2:

```

NC:\MPF\1.MPF 15
POCKET3( 25.00000, 0.00000, 2.00000, -5.00000, 13.00000, 10.00000, 4
.00000, -13.00000, 16.00000, 0.00000, 1.50000, 0.10000, 0.10000, 600
.00000, 50.00000, 2, 11, 2.50000, , , 2.00000, 2.00000) 1
AROT Z90 1
_END: 1
REPEAT _ANF _END P=3 1
ROT 1
54500 M3 1
_ANF1: 1
POCKET3( 25.00000, 0.00000, 2.00000, -5.00000, 13.00000, 10.00000, 4
.00000, -13.00000, 16.00000, 0.00000, 5.00000, 0.10000, 0.10000, 400
.00000, 200.00000, 2, 2, 2.50000, , , 2.00000, 2.00000) 1
AROT Z90 1
_END1: 1
REPEAT _ANF1 _END1 P=3 1
ROT 1
30 Z100 1
POCKET4( 25.00000, 0.00000, 2.00000, -5.00000, 7.50000, 0.00000, 0.0
  
```

Operating sequence for programming in ISO mode



1. Select the system data operating area.

ISO mode

2. Press this softkey and the system prompts the following window:



After the new configuration is applied,
an NCK/PLC/HMI restart will be triggered!

OK

3. Press this softkey and control system automatically starts the mode change from Siemens mode to ISO mode.



4. Select the program management operating area.

NC NC


5. Press this softkey to enter the system directory for storing part programs.

New

6. Press this softkey and enter the name of the new program.

OK

7. Press this softkey to confirm your entry. The part program editor window opens automatically.

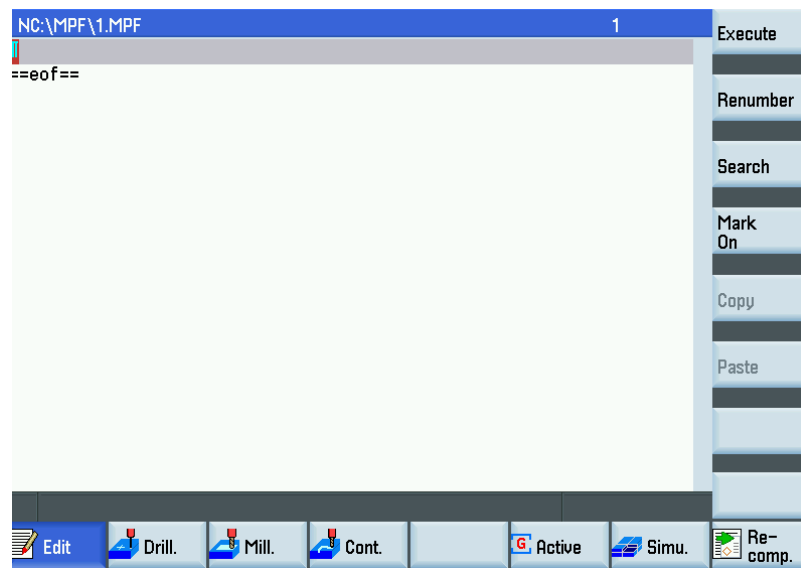

8. Enter the following main program:

```
G291
G17 G54 G90 G40 G69
T1
M6
G0 Z100 G43 H1 M8
M3 S1500
X-60 Y25
Z3
G1 Z0.2 F600
X50
Y-25
X-60
Y25
M3 S2500
G1 Z0. F600
X50
Y-25
X-60
G0 Z100 M9
M05
G69
T2
M6
M3 S4000
G0 Z100 G43 H2 M8
X-13 Y16
SSA
G68 X0 Y0 R90
SSA
G68 X0 Y0 R180
SSA
G68 X0 Y0 R270
SSA
G69
G0 Z100
X0 Y0
Z3
```

```

G1 Z-2 F50
G1 G41 X7.5 Y0 F600
G3 I-7.5
G1 G40 X0 Y0
G1 Z-4 F50
G1 G41 X7.5 Y0 F600
G3 I-7.5
G1 G40 X0 Y0
G1 Z-5 F50
G1 G41 X7.5 Y0 F600
G3 I-7.5
G1 G40 X0 Y0
G0 Z100 M9
T3
M6
M3 S5000
G0 Z100 G43 H3
Z10
G80
G81 X10 Y0 Z-5 F100
X5 Y8.66
X-5
X-10 Y0
X-5 Y-8.66
X5
G80 G0 Z100
M05
M30

```

9. Open the window for creating a new program through the following key operations:



10. Enter the name of the subprogram with the file name extension, "SSA.SPF" in this example.

New G code program	
Type:	Main program MPF
Name:	SSA.SPF



11. Press this softkey to confirm your entry. The part program editor window opens automatically. Enter the following subprogram:


```
G0 Z100
X-13 Y16
Z2
G1 Z-2 F50
G1 G41 X-13 Y21 D1 F600
X-19.5
Y11
X-6.5
Y21
X-13.5
G1 G40 Y16
G1 Z-4 F50
G1 G41 X-13 Y21 D1 F600
X-19.5
Y11
X-6.5
Y21
X-13.5
G1 G40 Y16
G1 Z-5 F50
G1 G41 X-13 Y21 D1 F600
X-19.5
Y11
X-6.5
Y21
X-13.5
G1 G40 Y16
G0 Z10
M17
```

Then you can proceed with the operations for "program simulation and execution (Page 284)".

13.3 Programming (Example 2)

Machining requirements

Workpiece drawing (unit: mm)

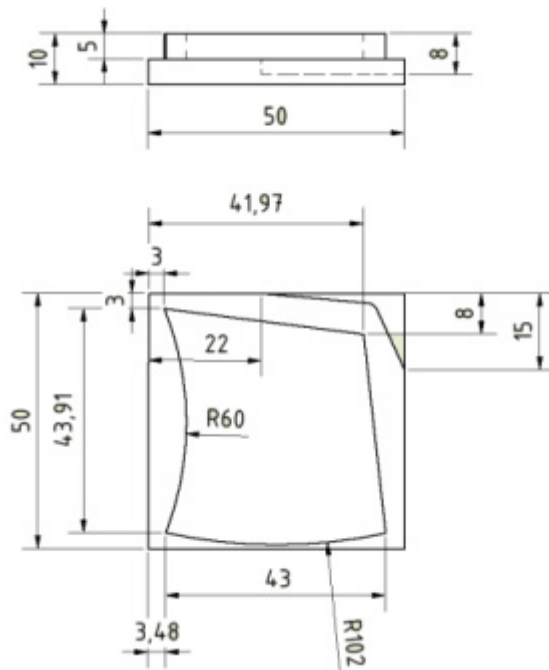

Technical requirements

- The arc transition must be smooth, without lapping.
- The cutting trace must be even.
- The sharp edges must be rounded.

Blank data

Blank material: Cube aluminum

Blank length: 100 mm

Blank width: 80 mm

Blank height: 60 mm (machining length: 46 mm; clamping length: 10 mm)

Required tool

Tool type	Tool number		Tool diameter (mm)	Roughing		Finishing	
	DIN	ISO		Speed	Feedrate	Speed	Feedrate
Face milling tool	T1D1	T1H1	50	1500	600	2500	600
End milling tool	T2D1	T2H2	10	4000	600	4000	600

Note

Cut the workpiece manually after machining is over.

 
Operating sequence for programming in Siemens mode



1. Select the program management operating area.




2. Press this softkey to enter the system directory for storing part programs.



3. Press this softkey and enter the name of the new program.



4. Press this softkey to confirm your entry. The part program editor window opens automatically.

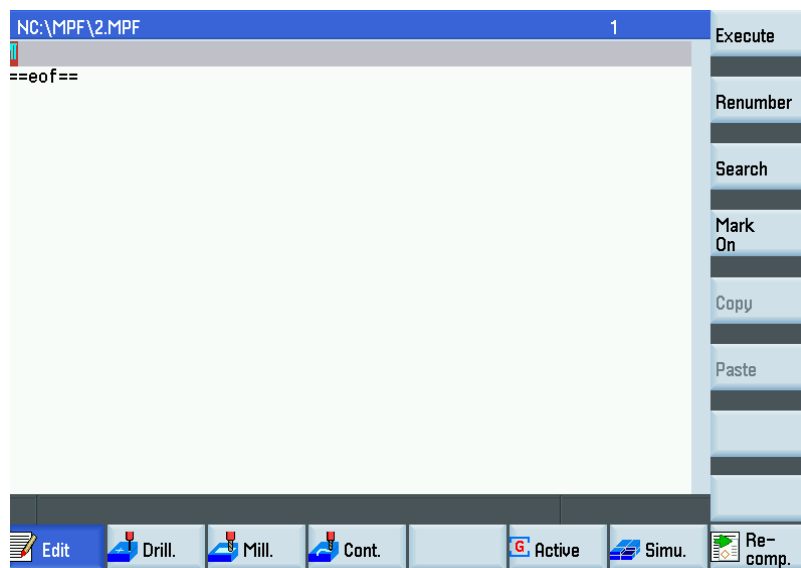


5. Enter the following program in the window. The control system saves your editing automatically.




6. Open the window for CYCLE71 through the following softkey operations:



Enter the desired parameters as follows:

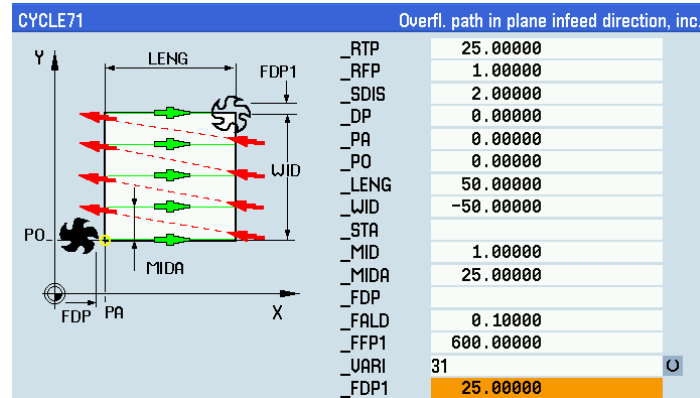

7. Press this softkey to confirm your input and open the cycle programming window.
Enter the following program block:
S2500 M3
8. Press this softkey to return to the program editor window.
9. Move the cursor to "C" in the line for CYCLE71 with the cursor keys and press this softkey to insert a marker.
10. Use the cursor keys to select the entire program block for CYCLE71. Press this softkey to copy the selection to the buffer memory.
11. Place the cursor on the end-of-block character after "S4000 M3" with cursor keys and press this key to enter a new line.
12. Paste the content of the buffer memory into the new line.
13. Press this softkey to open the window for CYCLE71 again. Change the values of "FALD" and "FFP1" to "0" and "400" respectively.
14. Move the cursor to the input field for "VARI" and press this key to change the value to "32".
15. Press this softkey to accept the change.
16. Place the cursor on the end-of-block character of CYCLE71 with cursor keys and press this key on the MCP to enter a new line.
Continue to enter the following program blocks and press this key again:
G0 Z100 M9
X60 Y0
T2 D1
M6
S3500 M3 M8
17. Open the window for CYCLE72 through the following softkey operations:

 

Attach
contour

Tech
interface

Enter the name of the contour subroutine in "KNAME", for example, "CON1".

18. Press this softkey to open the program editor window again and enter the program blocks for the external contour:

```
G1 X41.97 Y-8
X46.48 Y-46.91
G2 X3.48 CR=102
G3 X3 Y-3 CR=60
G1 X41.97 Y-8
M2
```

19. Press this softkey to return to the window for CYCLE72 and enter the desired parameters as follows:

CYCLE72		Length of retract: straight path or circle radius
_KNAME	CON1: CON1_E	
_RTP	25.00000	
_RFP	0.00000	
_SDIS	2.00000	
_DP	-5.00000	
_MID	1.00000	
_FAL	0.10000	
_FALD	0.10000	
_FFP1	600.00000	
_FFD	50.00000	
_VARI	11	U
_RL	41	U
_AS1	2	U
_LP1	8.00000	
_FF3	300.00000	
_AS2	1	U
_LP2	8.00000	

OK

20. Press this softkey to confirm your input and open the cycle programming window.

Enter the following program block:

```
M3 S4000
```

21. Proceed through the steps described earlier to copy the entire program block for CYCLE72 and paste it in the line after the above program blocks.

Re-
comp.

22. Press this softkey to open the window for CYCLE72 again. Change the values of "MID" and "VARI" to "5" and "112" respectively.

OK

23. Press this softkey to confirm your input and open the cycle programming window.

Enter the following program blocks:

```
G0 Z100
S4000 M3
G0 X60 Y-15
G0 Z2
G1 F300 Z-8
G42 G1 Y-15 X50
G1 X44 Y-2 RND=2
G1 Y0 X 22
G40 Y10
G0 Z100 M9
M05
M30
```

Then you can proceed with the operations for "program simulation and execution (Page 284)".

Screenshots of the complete program

Screen 1:

```

NC:\MPF\2.MPF 1
17 G90 G64 G54 〰
T1 D1 〰
16 〰
S1500 M3 M8 〰
30 Z100 〰
CYCLE71( 25.00000, 1.00000, 2.00000, 0.00000, 0.00000, 0.00000, 50.0
0000, -50.00000, , 1.00000, 25.00000, , 0.10000, 600.00000, 31, 25.0
0000) 〰
S2500 M3 〰
CYCLE71( 25.00000, 1.00000, 2.00000, 0.00000, 0.00000, 0.00000, 50.0
0000, -50.00000, , 1.00000, 25.00000, , 0.00000, 400.00000, 32, 25.0
0000) 〰
30 Z100 M9 〰
X60 Y0 〰
T2 D1 〰
16 〰
S3500 M3 M8 〰
CYCLE72( "CON1: CON1_E", 25.00000, 0.00000, 2.00000, -5.00000, 1.0000

```

Screen 2:

```

NC:\MPF\2.MPF 14
, 0.10000, 0.10000, 600.00000, 50.00000, 11, 41, 2, 8.00000, 300.00
000, 1, 8.00000) 〰
13 S4000 〰
CYCLE72( "CON1: CON1_E", 25.00000, 0.00000, 2.00000, -5.00000, 5.0000
0, 0.10000, 0.10000, 600.00000, 50.00000, 112, 41, 2, 8.00000, 300.0
0000, 1, 8.00000) 〰
〰
30 Z100 〰
S4000 M3 〰
30 X60 Y-15 〰
30 Z2 〰
31 F300 Z-8 〰
342 G1 Y-15 X50 〰
31 X44 Y-2 RND=2 〰
31 Y0 X 22 〰
340 Y10 〰
30 Z100 M9 〰
105 〰

```

Screen 3:

```

NC:\MPF\2.MPF 29
30 〰
〰
; *****CONTOUR***** 〰
CON1: 〰
31 X41.97 Y-8 〰
X46.48 Y-46.91 〰
32 X3.48 CR=102 〰
33 X3 Y-3 CR=60 〰
31 X41.97 Y-8 〰
12; /* end of contour */ 〰
CON1_E: 〰
==eof==

```

Operating sequence for programming in ISO mode



ISO mode

1. Select the system data operating area.
2. Press this softkey and the system prompts the following window:



**After the new configuration is applied,
an NCK/PLC/HMI restart will be triggered!**



3. Press this softkey and control system automatically starts the mode change from Siemens mode to ISO mode.



4. Select the program management operating area.




5. Press this softkey to enter the system directory for storing part programs.

New

OK

6. Press this softkey and enter the name of the new program.
7. Press this softkey to confirm your entry. The part program editor window opens automatically.

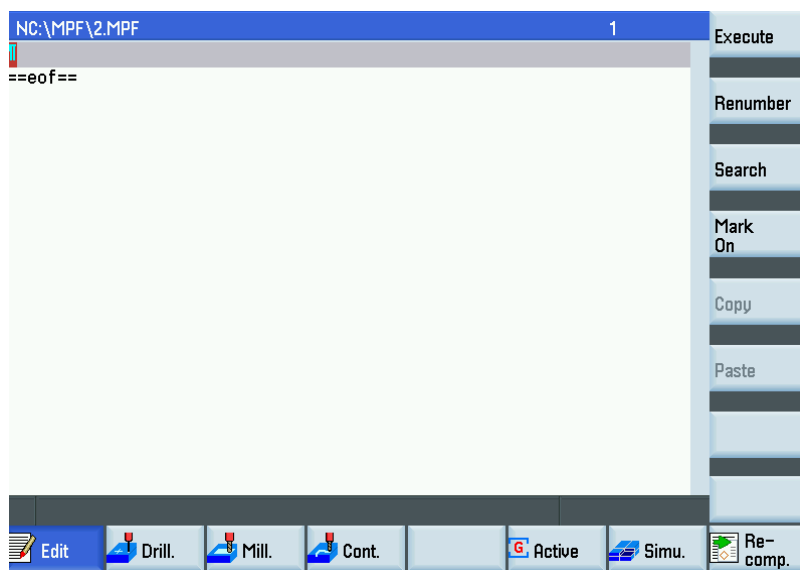

8. Enter the following main program:

```
G291
G17 G90 G64 G54
T1
M6
G43 H1 G0 Z100 M8
S1500 M3
G0 Z100
X-30 Y0
Z3
G1 Z0.2 F600
X80
Y-50
X-30
Y0
M3 S2500
G1 Z0. F600
X80
Y-50
X-30
```

G0 Z100 M9
 M05
 T2
 M6
 G43 H2 G0 Z100
 M3 S4000
 SSC
 G0 Z100
 S4000 M3
 G0 X60 Y-15
 G0 Z2
 G1 Z-8 F600
 G42 G1 Y-15 X50
 G1 X44 Y-2
 G1 Y0 X 22
 G40 Y10
 G0 Z100 M9
 M05
 M30

9. Open the window for creating a new program through the following key operations:



10. Enter the name of the subprogram with the file name extension, "SSC.SPF" in this example.

New G code program	
Type:	Main program MPF
Name:	SSC.SPF



11. Press this softkey to confirm your entry. The part program editor window opens automatically. Enter the following subprogram:


```
G0 Z100
X40 Y5
Z3
G1 Z-2 F50
G1 G41 X41.97 Y-8
X46.48 Y-46.91
G2 X3.48 CR=102
G3 X3 Y-3 CR=60
G1 X41.97 Y-8
G1 G40 X40 Y5
G1 Z-4 F50
G1 G41 X41.97 Y-8
X46.48 Y-46.91
G2 X3.48 CR=102
G3 X3 Y-3 CR=60
G1 X41.97 Y-8
G1 G40 X40 Y5
G1 Z-5 F50
G1 G41 X41.97 Y-8
X46.48 Y-46.91
G2 X3.48 CR=102
G3 X3 Y-3 CR=60
G1 X41.97 Y-8
G1 G40 X40 Y5
M17
```

Then you can proceed with the operations for "program simulation and execution (Page 284)".

13.4 Programming (Example 3)

Machining requirements

Workpiece drawing (unit: mm)

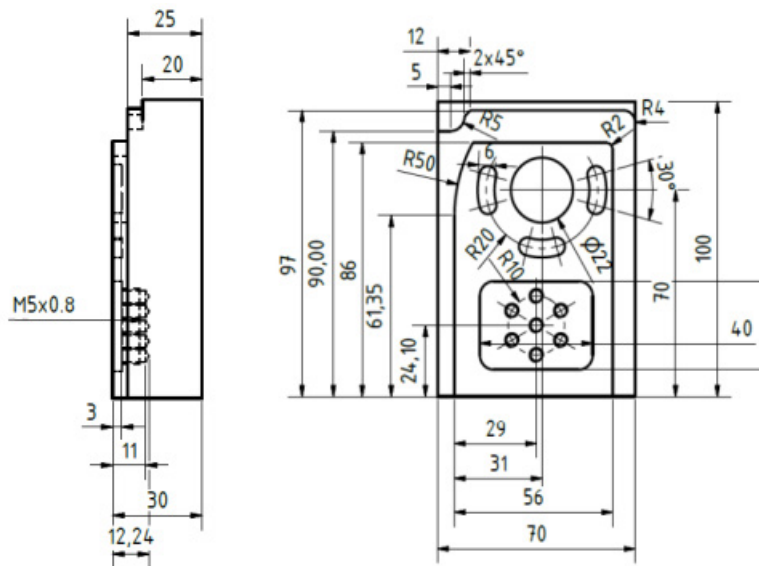

Technical requirements

- The arc transition must be smooth, without lapping.
- The cutting trace must be even.
- The sharp edges must be rounded.

Blank data

Blank material: Cube aluminum

Blank length: 100 mm

Blank width: 80 mm

Blank height: 60 mm (machining length: 46 mm; clamping length: 10 mm)

Required tool

Tool type	Tool number		Tool diameter (mm)	Roughing		Finishing	
	DIN	ISO		Speed	Feedrate	Speed	Feedrate
Face milling tool	T1D1	T1H1	50	1500	600	2500	600
End milling tool	T2D1	T2H2	12	3500	600	4000	600
End milling tool	T3D1	T3H3	10	4000	600	4000	600
End milling tool	T4D1	T4H4	16	4000	300	4500	400
End milling tool	T5D1	T5H5	5	5000	300	5000	300
Drilling tool	T6D1	T6H6	10	4000	100	4000	100
Drilling tool	T7D1	T7H7	5	4000	100	4000	100
Tapping tool	T8D1	T8H8	6	500	400	500	400

Note

Cut the workpiece manually after machining is over.

 
Operating sequence for programming in Siemens mode



1. Select the program management operating area.




2. Press this softkey to enter the system directory for storing part programs.



3. Press this softkey and enter the name of the new program.




4. Press this softkey to confirm your entry. The part program editor window opens automatically.

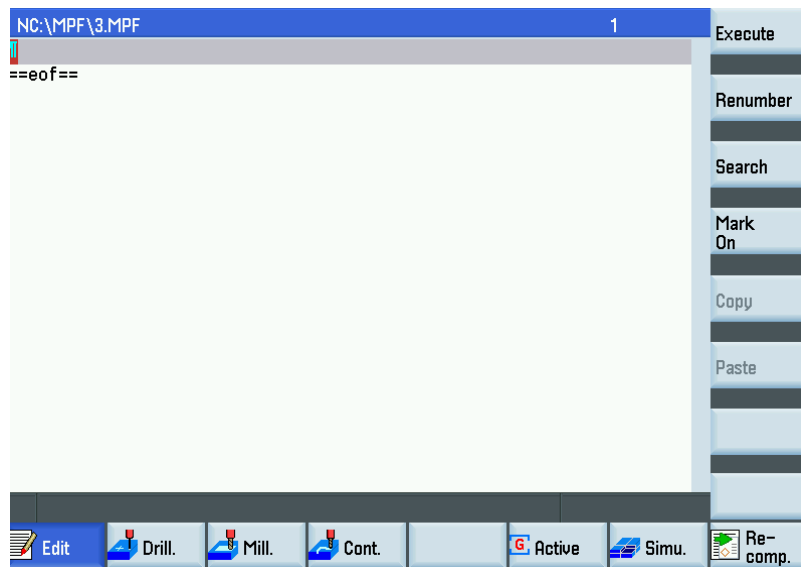

5. Enter the following program blocks in the window. The control system saves your editing automatically.



 6. Open the window for CYCLE71 through the following softkey operations:



Enter the desired parameters as follows:

CYCLE71		Overfl. path in plane infeed direction, inc.
_RTP	25.00000	
_RFP	1.00000	
_SDIS	2.00000	
_DP	0.00000	
_PA	0.00000	
_PO	0.00000	
_LENG	70.00000	
_WID	100.00000	
_STA	0.00000	
_MID	1.00000	
_MIDA	25.00000	
_FDP	0.00000	
_FALD	0.20000	
_FFP1	600.00000	
_VARI	31	
_FDP1	25.00000	



7. Press this softkey to confirm your input and open the cycle programming window.
Continue to enter the following program block:
S2500 M3
8. Press this softkey to return to the program editor window.
9. Move the cursor to "C" in the line for CYCLE71 with the cursor keys and press this softkey to insert a marker.
10. Use the cursor keys to select the entire program block for CYCLE71. Press this softkey to copy the selection to the buffer memory.
11. Place the cursor in the last empty line and press this softkey to paste the content of the buffer memory into the empty line.
12. Press this softkey to open the window for CYCLE71 again. Change the values of "FALD" and "FFP1" to "0" and "400" respectively.
13. Move the cursor to the input field of "VARI" and press this key to change the value to "32".
14. Press this softkey to accept the change.



15. Continue to enter the following program blocks and then press this key again:

```
G0 Z100 M9
T3 D1
M6
G0 Z100
S4000 M3 M8
G00 X-6 Y92
G00 Z2
G01 F300 Z-10
G41 Y90
G01 X10 RND=6
G01 Y97 CHR=1
G01 X70 RND=4
G01 Y90
G01 G40 X80
G00 Z100 M9
T4 D1
M6
G0 Z100
S4000 M3 M8
```

16. Open the window for POCKET4 through the following softkey operations:



Enter the desired parameters as follows:

POCKET4		Pitch of helical insertion
_RFP	0.00000	
_SDIS	2.00000	
_DP	-5.00000	
_PRAD	11.00000	
_PA	38.00000	
_PO	70.00000	
_MID	2.50000	
_FAL	0.20000	
_FALD	0.20000	
_FFP1	300.00000	
_FFD	250.00000	
_CDIR	0	
_VARI	21	
_MIDA	10.00000	
_AP1	0.00000	
_AD	5.00000	
_RAD1	2.00000	
_DP1	0.50000	



17. Press this softkey to confirm your input and open the cycle programming window.

Continue to enter the following block:

```
S4500 M3
```

18. Proceed through the steps described earlier to copy the entire program block for POCKET4 and paste it in the line after the above program blocks.



19. Press this softkey to open the window for POCKET4. Change the values of "FFP1", "FFD" and "VARI" to "400", "100" and "22" respectively.



20. Press this softkey to accept the changes and open the cycle programming window.



21. Press this key to enter a new line.
Continue to enter the following program blocks and then press this key again:
- ```
G0 Z100 M9
T5 D1
M6
G0 Z100
M3 S5000 M8
```

22. Open the window for SLOT2 through the following softkey operations:



Enter the desired parameters as follows:

| SLOT2 |            | Feed for intermediate pos. on circ. path |
|-------|------------|------------------------------------------|
| NUM   | 3          |                                          |
| AFSL  | 30.00000   |                                          |
| WID   | 6.00000    |                                          |
| CPA   | 38.00000   |                                          |
| CPO   | 70.00000   |                                          |
| RAD   | 20.00000   |                                          |
| STA1  | 165.00000  |                                          |
| INDA  | 90.00000   |                                          |
| FFD   | 300.00000  |                                          |
| FFP1  | 300.00000  |                                          |
| MID   | 1.00000    |                                          |
| CDIR  | 3          |                                          |
| FAL   | 0.20000    |                                          |
| UARI  | 0          |                                          |
| MIDF  | 5.00000    |                                          |
| FFP2  | 400.00000  |                                          |
| SSF   | 3000.00000 |                                          |
| FFCP  | 200.00000  |                                          |

 


23. Press this softkey to confirm your input and open the cycle programming window.  
Continue to enter the following blocks:
- ```
G0 Z100 M9
T2 D1
M6
G0 Z100
X-5 Y0
S3500 M3 M8
```



24. Press this key to enter a new line.

25. Open the window for CYCLE72 through the following softkey operations:



26. Enter the name of the contour subroutine in "KNAME", for example, "CON1".
27. Press this softkey to open the program editor window again and enter the program blocks for the external contour:
- ```
G17 G90 DIAMOF
G1 X7 Y-5
G1 Y61.35
G2 X13.499 Y86 I=AC(57) J=AC(61.35)
G1 X63 RND=2
Y0
X2
M2
```



28. Press this softkey to return to the window for CYCLE72 and enter the desired parameters as follows:

| CYCLE72 |              | Length of retract: straight path or circle radius |   |
|---------|--------------|---------------------------------------------------|---|
| _KNAME  | CON1: CON1_E |                                                   |   |
| _RTP    | 25.00000     |                                                   |   |
| _RFP    | 0.00000      |                                                   |   |
| _SDIS   | 2.00000      |                                                   |   |
| _DP     | -5.00000     |                                                   |   |
| _MID    | 1.00000      |                                                   |   |
| _FAL    | 0.20000      |                                                   |   |
| _FALD   | 0.10000      |                                                   |   |
| _FFP1   | 600.00000    |                                                   |   |
| _FFD    | 50.00000     |                                                   |   |
| _VARI   | 111          |                                                   | U |
| _RL     | 41           |                                                   | U |
| _AS1    | 12           |                                                   | U |
| _LP1    | 3.00000      |                                                   |   |
| _FF3    | 300.00000    |                                                   |   |
| _AS2    | 12           |                                                   | U |
| _LP2    | 3.00000      |                                                   |   |



29. Press this softkey to confirm your input and open the cycle programming window.  
Enter the following program blocks:

S4000 M3

30. Proceed through the steps described earlier to copy the entire program block for CYCLE72 and paste it in the line after the above blocks.



31. Press this softkey to open the window for CYCLE72 again. Change the values of "MID", "FAL", "FALD" and "VARI" to "5", "0", "0" and "112" respectively.



32. Press this softkey to confirm your input and open the cycle programming window.  
Enter the following program blocks:

G0 Z100

S3500 M3

33. Press this key to enter a new line.



34. Open the window for POCKET3 through the following softkey operations:



35. Enter the desired parameters as follows:

| POCKET3 |           | Pitch of helical insertion |   |
|---------|-----------|----------------------------|---|
| _LJID   | 30.00000  |                            |   |
| _CRAD   | 6.00000   |                            |   |
| _PA     | 36.00000  |                            |   |
| _PO     | 24.10000  |                            |   |
| _STA    | 0.00000   |                            |   |
| _MID    | 3.00000   |                            |   |
| _FAL    | 0.10000   |                            |   |
| _FALD   | 0.10000   |                            |   |
| _FFP1   | 300.00000 |                            |   |
| _FFD    | 300.00000 |                            |   |
| _CDIR   | 0         |                            | U |
| _VARI   | 11        |                            | U |
| _MIDA   | 12.00000  |                            |   |
| _AP1    | 8.00000   |                            |   |
| _AP2    | 3.00000   |                            |   |
| _AD     | 15.00000  |                            |   |
| _RAD1   | 0.00000   |                            |   |
| _DP1    | 2.00000   |                            |   |



36. Press this softkey to confirm your input and open the cycle programming window.  
Enter the following program blocks:

S4000 M3



37. Proceed through the steps described earlier to copy the entire program block for POCKET3 and paste it in the line after the above program blocks.
38. Press this softkey to open the window for POCKET3 again. Move the cursor to the input field for "VARI" and change its value to "12".

39. Press this softkey to accept the change and open the cycle programming window.

40. Place the cursor on the end-of-block character of POCKET3 with the cursor keys and press this key to enter a new line.


Continue to enter the following program blocks and then press this key again:

G0 Z150 M9  
T6 D1  
M6  
G0 Z100  
S4000 M3  
G00 Z50 X36 Y24.1

41. Open the window for CYCLE82 through the following softkey operations:



Enter the desired parameters as follows:

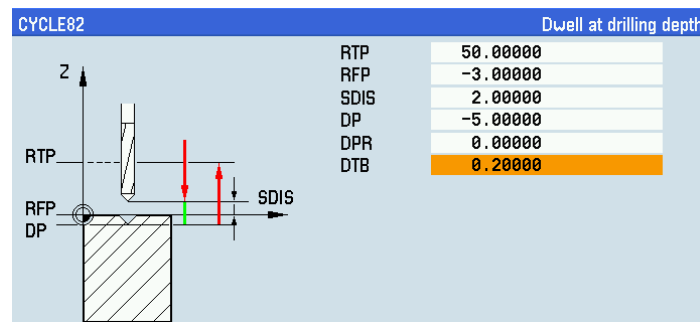

42. Press this softkey to call this cycle modally.

43. Press this softkey to confirm your input.

44. Open the window for HOLES2 through the following softkey operations:



Enter the desired parameters as follows:

| HOLES2 |          | Number of holes |
|--------|----------|-----------------|
| CPA    | 36.00000 |                 |
| CPO    | 24.10000 |                 |
| RAD    | 10.00000 |                 |
| STA1   | 90.00000 |                 |
| INDA   | 60.00000 |                 |
| NUM    | 6        |                 |



45. Press this softkey to confirm your input and open the cycle programming window. Continue to enter the following program blocks:

```
X36 Y24.1
MCALL
G0 Z100 M9
T7 D1
M715 M6
G0 Z100
S4000 M3 M8
```



46. Press this softkey to return to the window of available drilling cycles.



47. Open the window for CYCLE83 and enter the desired parameters as follows:

| CYCLE83 |           | Lead distance at reinsertion, incr. |
|---------|-----------|-------------------------------------|
| RTP     | 50.00000  |                                     |
| RFP     | -3.00000  |                                     |
| SDIS    | 1.00000   |                                     |
| DP      | -12.00000 |                                     |
| DPR     | 0.00000   |                                     |
| FDEP    | -5.00000  |                                     |
| FDPR    | 0.00000   |                                     |
| DAM     | 0.70000   |                                     |
| DTB     | 0.50000   |                                     |
| DTS     | 1.00000   |                                     |
| FRF     | 1.00000   |                                     |
| VARI    | 0         |                                     |
| AXN     | 3         |                                     |
| MDEP    | 1.40000   |                                     |
| URT     | 0.60000   |                                     |
| DTD     | 1.60000   |                                     |
| DIS1    | 5.00000   |                                     |



48. Press this softkey to call this cycle modally.



49. Confirm your input and open the cycle programming window.



50. Proceed through the steps described earlier to copy the entire program blocks for HOLES2 and paste it in the line after the above program blocks.



51. Press this key to enter a new line.  
Continue to enter the following program blocks and then press this key again:

```
X36 Y24.1
MCALL
G0 Z100 M9
T8 D1
M6
G0 Z100
S500 M3 M8
```

52. Open the window for CYCLE84 through the following softkey operations:



Enter the desired parameters as follows:

| CYCLE84 |      | Retraction distance, for chip breaking |   |
|---------|------|----------------------------------------|---|
|         | RTP  | 50.00000                               |   |
|         | RFP  | -3.00000                               |   |
|         | SDIS | 2.00000                                |   |
|         | DP   |                                        |   |
|         | DPR  | 6.00000                                |   |
|         | DTB  | 0.70000                                |   |
|         | SDAC | 5                                      | U |
|         | MPIT |                                        |   |
|         | PIT  | 2.00000                                |   |
|         | POSS | 5.00000                                |   |
|         | SST  | 5.00000                                |   |
|         | SST1 | 5.00000                                |   |
|         | AXN  | 3                                      | U |
|         | PSYS | 0                                      |   |
|         | PSYS | 0                                      |   |
|         | UARI | 0                                      | U |
|         | DAM  | 5.00000                                |   |
|         | URT  | 1.40000                                |   |

Modal  
call

53. Press this softkey to call this cycle modally.



54. Confirm your input and open the cycle programming window.

55. Proceed through the steps described earlier to copy the entire program blocks for HOLES2 and paste it in the line after the above program blocks.

56. Place the cursor on the end-of-block character of HOLES2 with the scursor keys and press this key to enter a new line.



Continue to enter the following program blocks:

```
X36 Y24.1
MCALL
G0 Z100
M9
M05
M30
```

Then you can proceed with the operations for "program simulation and execution (Page 284)".

## Screenshots of the complete program

Screen 1:

```

NC:\MPF\3. 1
17 G90 G54 G64 G94
T1 D1
16
30 Z100
S1500 M3 M8
CYCLE71(25.00000, 1.00000, 2.00000, 0.00000, 0.00000, 0.00000, 70.0
0000, 100.00000, 0.00000, 1.00000, 25.00000, 0.00000, 0.20000, 600.0
0000, 31, 25.00000)
S2500 M3
CYCLE71(25.00000, 1.00000, 2.00000, 0.00000, 0.00000, 0.00000, 70.0
0000, 100.00000, 0.00000, 1.00000, 25.00000, 0.00000, 0.00000, 400.0
0000, 32, 25.00000)
30 Z100 M9
T3 D1
16
30 Z100
S4000 M3 M8
300 X-6 Y92

```

Screen 2:

```

NC:\MPF\3. 15
300 Z2
301 F300 Z-10
341 Y90
301 X10 RND=6
301 Y97 CHR=1
301 X70 RND=4
301 Y90
301 G40 X80
300 Z100 M9
T4 D1
16
30 Z100
S4000 M3 M8
POCKET4(25.00000, 0.00000, 2.00000, -5.00000, 11.00000, 38.00000, 7
0.00000, 2.50000, 0.20000, 0.20000, 300.00000, 250.00000, 0, 21, 10.
00000, 0.00000, 5.00000, 2.00000, 0.50000)
S4500 M3
POCKET4(25.00000, 0.00000, 2.00000, -5.00000, 11.00000, 38.00000, 7

```

Screen 3:

```

NC:\MPF\3. 30
1.00000, 2.50000, 0.20000, 0.20000, 400.00000, 100.00000, 0, 22, 10.
00000, 0.00000, 5.00000, 2.00000, 0.50000)
30 Z100 M9
T5 D1
16
30 Z100
T3 S5000 M8
SLOT2(25.00000, 0.00000, 2.00000, -3.00000, 0.00000, 3, 30.00000, 6
.00000, 38.00000, 70.00000, 20.00000, 165.00000, 90.00000, 300.00000
, 300.00000, 1.00000, 3, 0.20000, 0, 5.00000, 400.00000, 3000.00000,
200.00000)
30 Z100 M9
T2 D1
16
30 Z100
<-5 Y0
S3500 M3 M8
CYCLE72("CON1: CON1_E", 25.00000, 0.00000, 2.00000, -5.00000, 1.0000

```

Screen 4:

```

NC:\MPF\3. 43
1. 0.20000, 0.10000, 600.00000, 50.00000, 111, 41, 12, 3.00000, 300.
00000, 12, 3.00000)
S4000 M3
CYCLE72("CON1: CON1_E", 25.00000, 0.00000, 2.00000, -5.00000, 5.0000
0, 0.00000, 0.00000, 600.00000, 50.00000, 112, 41, 12, 3.00000, 300.
00000, 12, 3.00000)
30 Z100
S3500 M3
POCKET3(50, 0, 1, -3, 40, 30, 6, 36, 24.1, 0, 3, 0.1, 0.1, 300, 300
, 0, 11, 12, 8, 3, 15, 0, 2)
S4000 M3
POCKET3(50, 0, 1, -3, 40, 30, 6, 36, 24.1, 0, 3, 0.1, 0.1, 300, 300
, 0, 12, 12, 8, 3, 15, 0, 2)
30 Z150 M9
T6 D1
16
30 Z100
S4000 M3

```

Screen 5:

```

NC:\MPF\3. 56
300 Z50 X36 Y24.1
1CALL CYCLE82(50.00000, -3.00000, 2.00000, -5.00000, 0.00000, 0.200
00)
40LES2(36, 24.1, 10, 90, 60, 6)
<36 Y24.1
1CALL
30 Z100 M9
T7 D1
1715 M6
30 Z100
S4000 M3 M8
1CALL CYCLE83(50, -3, 1, -12, 0, -5, 0, 0.7, 0.5, 1, 1, 0, 3, 1.4,
3.6, 1.6, 5)
40LES2(36, 24.1, 10, 90, 60, 6)
<36 Y24.1
1CALL
30 Z100 M9
T8 D1

```

Screen 6:

```

NC:\MPF\3. 72
16
30 Z100
S500 M3 M8
1CALL CYCLE84(50, -3, 2, , 6, 0.7, 5, , 2, 5, 5, 3, 0, 0, 5, 1.4)
40LES2(36, 24.1, 10, 90, 60, 6)
<36 Y24.1
1CALL
30 Z100
19
105
130
; *****CONTOUR*****
CON1:
317 G90 DIAMOF
31 X7 Y-5
31 Y61.35
32 X13.499 Y86 I=AC(57) J=AC(61.35)

```


## Screen 7:



## Operating sequence for programming in ISO mode



1. Select the system data operating area.
2. Press this softkey and the system prompts the following window:

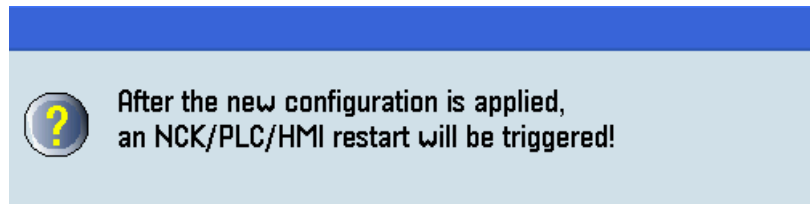


3. Press this softkey and control system automatically starts the mode change from Siemens mode to ISO mode.



4. Select the program management operating area.



 
5. Press this softkey to enter the system directory for storing part programs.



6. Press this softkey and enter the name of the new program.



7. Press this softkey to confirm your entry. The part program editor window opens automatically.

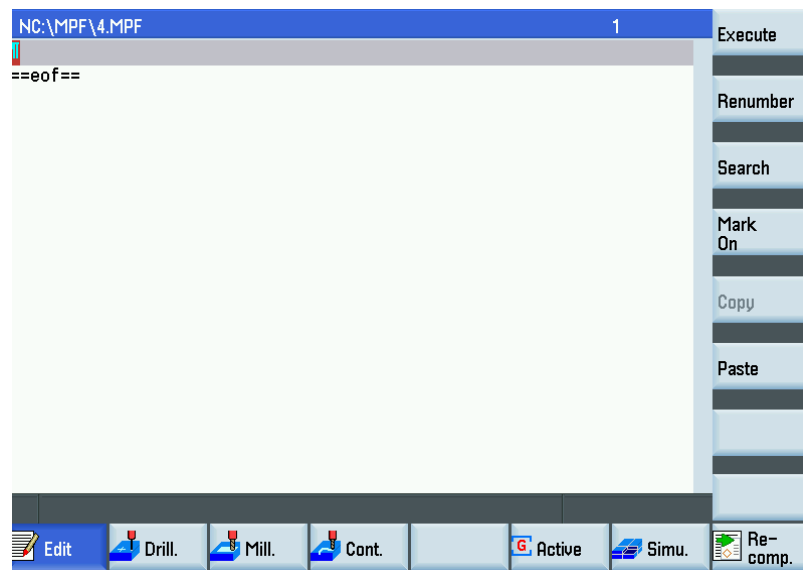

8. Enter the following main program:

```
G291
G17 G90 G54 G40 G69
T1
M6
G43 H1 G0 Z100
S1500 M3 M8
X-30 Y25
Z3
G1 Z0.2 F50
X90 F600
Y75
X-30
Y25
S2500 M3
N150 G1 Z0 F50
X90 F600
Y75
X-30
G0 Z100 M9
M05
T3
M6
G43 H3 G0 Z100
S4000 M3 M8
G00 X-6 Y92
G00 Z2
G01 Z-10 F50
G41 X-1 Y90 F600
G1 X4
```

G3 X10 Y96 CR=6  
 G2 X12 Y98 CR=2  
 G1 X66  
 G2 X70 Y94 CR=4  
 G1 Y90  
 G01 G40 X80  
 G00 Z100 M9  
 M05  
 T4  
 M6  
 G43 H4 G0 Z100  
 S4000 M3 M8  
 X35 Y70  
 Z3  
 G1 Z-3 F50  
 G1 G41 X46 F600  
 G3 I-11  
 G1 G40 X35  
 G0 Z100 M9  
 M05  
 T5  
 M6  
 G43 H5 G0 Z100  
 M3 S5000 M8  
 G0 Z100 M9  
 SSG  
 G68 X35 Y70 R-90  
 SSG  
 G68 X35 Y70 R-180  
 SSG  
 G69  
 T2  
 M6  
 G43 H2 G0 Z100  
 X-5 Y0  
 S4000 M3 M8  
 SSH  
 G0 Z100  
 S4000 M3  
 X35 Y24.1  
 Z3  
 G1 Z-3 F50  
 G1 G41 X55 F600  
 Y39.1  
 X15  
 Y8.9

X55  
 Y24.1  
 G1 G40 X35  
 G0 Z150 M9  
 T6  
 M6  
 G43 H6 G0 Z100  
 S4000 M3  
 G00 Z50  
 X36 Y24.1  
 F100  
 G81 X35 Y24.1 R2 Z-4.5 F100  
 X43.66 Y29.1  
 X35 Y34.1  
 X26.34 Y29.1  
 Y19.1  
 X35 Y14.1  
 X43.66 Y19.1  
 G80 G0 Z100 M9  
 T7  
 M6  
 G43 H7 G0 Z100  
 S4000 M3 M8  
 X36 Y24.1  
 G83 X36 Y24.1 Z-14 R2 Q2 F100  
 X43.66 Y29.1  
 X35 Y34.1  
 X26.34 Y29.1  
 Y19.1  
 X35 Y14.1  
 X43.66 Y19.1  
 G0 G80 Z100 M9  
 T8  
 M6  
 G43 H8 G0 Z100  
 S500 M3 M8  
 X36 Y24.1  
 G84 X36 Y24.1 Z-14 R2 F400  
 X43.66 Y29.1  
 X35 Y34.1  
 X26.34 Y29.1  
 Y19.1  
 X35 Y14.1  
 X43.66 Y19.1  
 G0 G80 Z100 M9  
 M9  
 M05  
 M30

9. Open the window for creating a new program through the following key operations:



10. Enter the name of the subprogram with the file name extension, "SSG.SPF" in this example.

| New G code program |                  |
|--------------------|------------------|
| Type:              | Main program MPF |
| Name:              | SSG.SPF          |



11. Press this softkey to confirm your entry. The part program editor window opens automatically. Enter the following program blocks for "SSG":

```
G0 Z100
X54.319 Y75.176
Z3
G1 Z-3 F50
G1 G41 X57.216 Y75.953 F600
G3 X51.421 Y74.4 CR=3
G2 Y65.6 CR=17
G3 X57.216 Y64.047 CR=3
G3 Y75.953 CR=23
G1 G40 X54.319 Y75.176
G0 Z100
M17
```

12. Proceed as described above to create the other subprogram "SSH".

Subprogram "SSH":


```
G0 Z100
X35 Y-15
Z3
G1 Z-5 F50
G1 G41 Y0 F600
X7
G1 Y61.35
G2 X13.499 Y86 CR=50
G1 X61
G2 X63 Y84 CR=2
G1 Y0
X33
G1 G40 X35 Y-15
M17
```

Then you can proceed with the operations for "program simulation and execution (Page 284)".

## 13.5 Programming (Example 4)

### Machining requirements

Workpiece drawing (unit: mm)

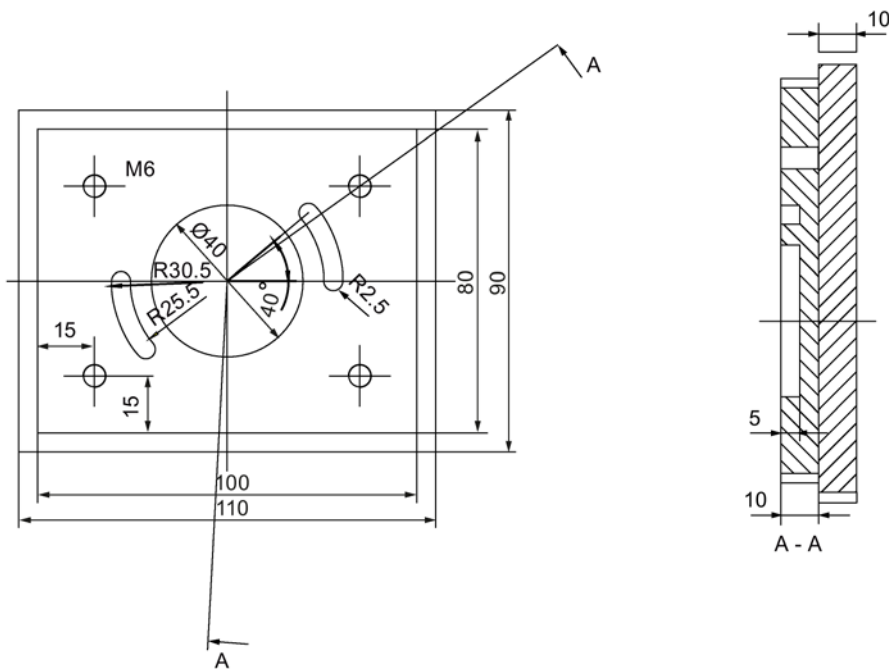

### Technical requirements

- The arc transition must be smooth, without lapping.
- The cutting trace must be even.
- The sharp edges must be rounded.

### Blank data

Blank material: Cube aluminum

Blank length: 100 mm

Blank width: 80 mm

Blank height: 60 mm (machining length: 46 mm; clamping length: 10 mm)

### Required tool

| Tool type         | Tool number |      | Tool diameter<br>(mm) | Roughing |          | Finishing |          |
|-------------------|-------------|------|-----------------------|----------|----------|-----------|----------|
|                   | DIN         | ISO  |                       | Speed    | Feedrate | Speed     | Feedrate |
| Face milling tool | T1D1        | T1H1 | 50                    | 1500     | 600      | 2500      | 600      |
| End milling tool  | T2D1        | T2H2 | 12                    | 4000     | 600      | 4000      | 600      |
| End milling tool  | T3D1        | T3H3 | 4                     | 4000     | 600      | 4000      | 600      |
| Drilling tool     | T4D1        | T4H4 | 5                     | 1200     | 100      | 1200      | 100      |
| Tapping tool      | T5D1        | T5H5 | 6                     | 600      | 600      | 600       | 600      |

### Note

Cut the workpiece manually after machining is over.

## Operating sequence for programming in Siemens mode



1. Select the program management operating area.




2. Press this softkey to enter the system directory for storing part programs.



3. Press this softkey and enter the name of the new program.



4. Press this softkey to confirm your entry. The part program editor window opens automatically.

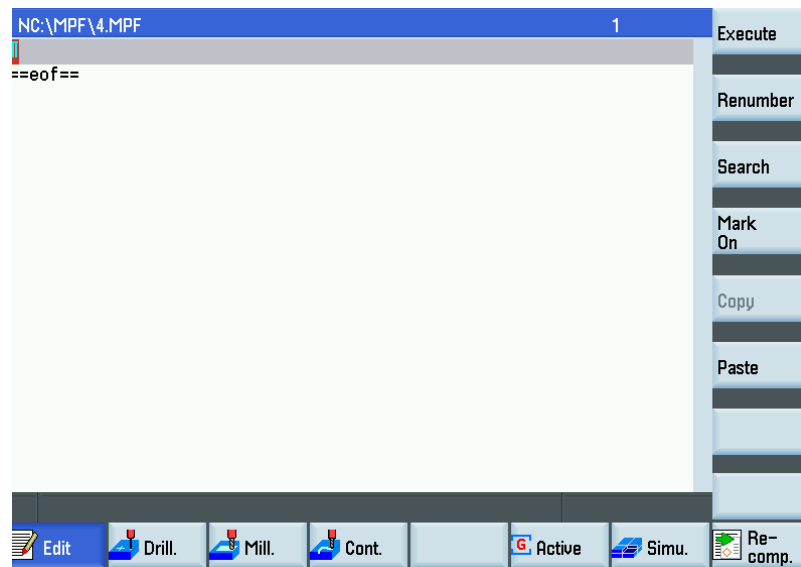

5. Enter the following program in the window. The control system saves your editing automatically.



6. Open the window for CYCLE71 through the following softkey operations:




Enter the desired parameters as follows:

| CYCLE71 |           | Overfl. path in plane infeed direction, inc. |
|---------|-----------|----------------------------------------------|
| _RTP    | 25.00000  |                                              |
| _RFP    | 1.00000   |                                              |
| _SDIS   | 2.00000   |                                              |
| _DP     | 0.00000   |                                              |
| _PA     | -55.00000 |                                              |
| _PO     | -45.00000 |                                              |
| _LENG   | 110.00000 |                                              |
| _WID    | 90.00000  |                                              |
| _STA    | 0.00000   |                                              |
| _MID    | 1.00000   |                                              |
| _MIDA   | 25.00000  |                                              |
| _FDP    | 0.00000   |                                              |
| _FALD   | 0.20000   |                                              |
| _FFP1   | 600.00000 |                                              |
| _VARI   | 31        |                                              |
| _FDP1   | 25.00000  |                                              |



 7. Press this softkey to confirm your input and open the cycle programming window.  
Continue to enter the following program block:  
S2500 M3
8. Press this softkey to return to the program editor window.
9. Move the cursor to "C" in the line for CYCLE71 with the cursor keys and press this softkey to insert a marker.
10. Use the cursor keys to select the entire program block for CYCLE71. Press this softkey to copy the selection to the buffer memory.
11. Place the cursor in the last empty line and press this softkey to paste the content of the buffer memory into the empty line.
12. Press this softkey to open the window for CYCLE71 again. Change the values of "FALD" and "FFP1" to "0" and "400" respectively.
13. Move the cursor to the input field of "VARI" and press this key to change the value to "32".
14. Press this softkey to accept the change.
15. Continue to enter the following program blocks and then press this key again:  
G0 Z100 M9  
T2 D1  
M6  
G0 Z100  
S4000 M3 M8
16. Open the window for CYCLE76 through the following softkey operations:



Enter the desired parameters as follows:

| CYCLE76 |           | Blank spigot width |
|---------|-----------|--------------------|
| SDIS    | 2.00000   |                    |
| DP      | -10.00000 |                    |
| DPR     |           |                    |
| LENG    | 100.00000 |                    |
| WID     | 80.00000  |                    |
| CRAD    | 0.00000   |                    |
| PA      | 0.00000   |                    |
| PO      | 0.00000   |                    |
| STA     |           |                    |
| MID     | 1.00000   |                    |
| FAL     | 0.20000   |                    |
| FALD    | 0.10000   |                    |
| FFP1    | 600.00000 |                    |
| FFD     | 50.00000  |                    |
| CDIR    | 2         |                    |
| VARI    | 1         |                    |
| AP1     | 110.00000 |                    |
| AP2     | 90.00000  |                    |

 


17. Press this softkey to confirm your input and open the cycle programming window.



18. Press this softkey to return to the window of available milling cycles.

19. Open the window for POCKET4 through the following softkey operations:



Enter the desired parameters as follows:

| POCKET4 |           | Pitch of helical insertion |
|---------|-----------|----------------------------|
| _RFP    | 0.00000   |                            |
| _SDIS   | 2.00000   |                            |
| _DP     | -5.00000  |                            |
| _PRAD   | 20.00000  |                            |
| _PA     | 0.00000   |                            |
| _PO     | 0.00000   |                            |
| _MID    | 1.00000   |                            |
| _FAL    | 0.20000   |                            |
| _FALD   | 0.10000   |                            |
| _FFP1   | 600.00000 |                            |
| _FFD    | 50.00000  |                            |
| _CDIR   | 2         |                            |
| _VARI   | 21        |                            |
| _MIDA   | 5.00000   |                            |
| _AP1    |           |                            |
| _AD     |           |                            |
| _RAD1   | 2.00000   |                            |
| _DP1    | 2.00000   |                            |



20. Press this softkey to confirm your input and open the cycle programming window.

Continue to enter the following blocks:

G0 Z100

S5000 M3



21. Press this key to enter a new line.

22. Proceed through the steps described earlier to copy the entire program block for CYCLE76 and paste it in the line after the above blocks.

23. Press this softkey to open the window for CYCLE76. Change the values of "CRAD", "MID", "FFD", "VARI", "AP1" and "AP2" to "0.2", "100", "2", "100" and "80" respectively.





24. Press this softkey to accept the changes and open the cycle programming window.



25. Proceed through the steps described earlier to copy the entire program block for POCKET4 and paste it in the line after the above blocks.

26. Press this softkey to open the window for POCKET4. Change the values of "MID", "FFD" and "VARI" to "5", "100" and "12" respectively.



27. Press this softkey to accept the changes and open the cycle programming window.



28. Press this key and continue to enter the following program blocks and then press this key again:

G0 Z100 M9  
T3 D1  
M6  
S4000 M3 M8

29. Open the window for SLOT2 through the following softkey operations:



Enter the desired parameters as follows:

| SLOT2 |            | Feed for intermediate pos. on circ. path |
|-------|------------|------------------------------------------|
| NUM   | 2          |                                          |
| AFSL  | 40.00000   |                                          |
| WID   | 5.00000    |                                          |
| CPA   | 0.00000    |                                          |
| CPO   | 0.00000    |                                          |
| RAD   | 28.00000   |                                          |
| STA1  | 0.00000    |                                          |
| INDA  | 180.00000  |                                          |
| FFD   | 50.00000   |                                          |
| FFP1  | 400.00000  |                                          |
| MID   | 1.00000    |                                          |
| CDIR  | 2          |                                          |
| FAL   | 0.10000    |                                          |
| VARI  | 2          |                                          |
| MIDF  | 5.00000    |                                          |
| FFP2  | 500.00000  |                                          |
| SSF   | 5000.00000 |                                          |
| FFCP  | 500.00000  |                                          |



30. Press this softkey to confirm your input and open the cycle programming window.

Continue to enter the following blocks:

G0 Z100 M9  
T4 D1  
M6  
S1200 M3 M8

31. Press this key to enter a new line.



32. Open the window for CYCLE83 through the following softkey operations:



Enter the desired parameters as follows:

| CYCLE83      |           | Lead distance at reinsertion, incr. |
|--------------|-----------|-------------------------------------|
| <b>MCALL</b> |           |                                     |
| RTP          | 25.00000  |                                     |
| RFP          | 0.00000   |                                     |
| SDIS         | 2.00000   |                                     |
| DP           | -15.00000 |                                     |
| DPR          | 0.00000   |                                     |
| FDEP         | -5.00000  |                                     |
| FDPR         | 5.00000   |                                     |
| DAM          | 1.00000   |                                     |
| DTB          | 0.10000   |                                     |
| DTS          |           |                                     |
| FRF          | 1.00000   |                                     |
| UARI         | 1         | <input type="button" value="U"/>    |
| AXN          | 3         | <input type="button" value="U"/>    |
| MDEP         | 2.00000   |                                     |
| VRT          | 1.00000   |                                     |
| DTD          | 0.10000   |                                     |
| DIS1         | 1.00000   |                                     |

Modal  
call

33. Press this softkey to call this cycle modally.

OK ☒

34. Confirm your input and open the cycle programming window.  
Continue to enter the following blocks:

X-35 Y-25  
X35 Y-25  
X-35 Y25  
X35 Y25  
MCALL  
G0 Z100 M9  
T5 D1  
M6

35. Press this key to enter a new line.



36. Open the window for CYCLE84 through the following softkey operations:

Thread → Rigid tapping

Enter the desired parameters as follows:

| CYCLE84      |           | Retraction distance, for chip breaking |
|--------------|-----------|----------------------------------------|
| <b>MCALL</b> |           |                                        |
| RTP          | 20.00000  |                                        |
| RFP          | 0.00000   |                                        |
| SDIS         | 2.00000   |                                        |
| DP           | -10.00000 |                                        |
| DPR          | 0.00000   |                                        |
| DTB          | 0.10000   |                                        |
| SDAC         | 5         | <input type="button" value="U"/>       |
| MPIT         |           |                                        |
| PIT          | 1.00000   |                                        |
| POSS         | 0.00000   |                                        |
| SST          | 600.00000 |                                        |
| SST1         | 800.00000 |                                        |
| AXN          | 3         | <input type="button" value="U"/>       |
| PSYS         | 0         |                                        |
| PSYS         | 0         |                                        |
| UARI         | 1         | <input type="button" value="U"/>       |
| DAM          | 3.00000   |                                        |
| VRT          | 1.00000   |                                        |



37. Press this softkey to confirm your input and open the cycle programming window.  
Enter the following blocks:  
X-35 Y-25  
X35 Y-25  
X-35 Y25  
X35 Y25  
MCALL  
G0 Z100 M9  
M05  
M30  
Then you can proceed with the operations for "program simulation and execution  
(Page 284)".

### Screenshots of the complete program

Screen 1:

```
NC:\MPF\4.MPF 1
17 G54 G90 G40 G94
T1 D1
16
30 Z100
51500 M3 M8
CYCLE71(25.00000, 1.00000, 2.00000, 0.00000, -55.00000, -45.00000,
110.00000, 90.00000, 0.00000, 1.00000, 25.00000, 0.00000, 0.20000, 6
30.00000, 31, 25.00000)
52500 M3
CYCLE71(25.00000, 1.00000, 2.00000, 0.00000, -55.00000, -45.00000,
110.00000, 90.00000, 0.00000, 1.00000, 25.00000, 0.00000, 0.00000, 4
30.00000, 32, 25.00000)
30 Z100 M9
T2 D1
16
30 Z100
54000 M3 M8
CYCLE76(25.00000, 0.00000, 2.00000, -10.00000, , 100.00000, 80.00000,
```

Screen 2:

```
NC:\MPF\4.MPF 14
, 0.00000, 0.00000, 0.00000, , 1.00000, 0.20000, 0.10000, 600.00000
50.00000, 2, 1, 110.00000, 90.00000)
POCKET4(25.00000, 0.00000, 2.00000, -5.00000, 20.00000, 0.00000, 0.
00000, 1.00000, 0.20000, 0.10000, 600.00000, 50.00000, 2, 21, 5.0000
0, , , 2.00000, 2.00000)
30 Z100
55000 M3
CYCLE76(25.00000, 0.00000, 2.00000, -10.00000, , 100.00000, 80.0000
0, 0.20000, 0.00000, 0.00000, , 10.00000, 0.20000, 0.10000, 600.0000
0, 100.00000, 2, 2, 100.00000, 80.00000)
POCKET4(25.00000, 0.00000, 2.00000, -5.00000, 20.00000, 0.00000, 0.
00000, 5.00000, 0.20000, 0.10000, 600.00000, 100.00000, 2, 12, 5.000
00, , , 2.00000, 2.00000)
30 Z100 M9
T3 D1
16
54000 M3 M8
510T2(25.00000, 0.00000, 2.00000, -5.00000, , 2, 40.00000, 5.00000,
```

Screen 3:

```
NC:\MPF\4.MPF 24
0.00000, 0.00000, 20.00000, 0.00000, 180.00000, 50.00000, 400.00000
1.00, 2, 0.10000, 2, 5.00000, 500.00000, 5000.00000, 500.00000)
30 Z100 M9
T4 D1
16
51200 M3 M8
1CALL CYCLE83(25.00000, 0.00000, 2.00000, -15.00000, 0.00000, -5.00
000, 5.00000, 1.00000, 0.10000, , 1.00000, 1, 3, 2.00000, 1.00000, 0
.10000, 1.00000)
<-35 Y-25
<35 Y-25
<-35 Y25
<35 Y25
1CALL
30 Z100 M9
T5 D1
16
1CALL CYCLE84(20.00000, 0.00000, 2.00000, -10.00000, 0.00000, 0.100
```

Screen 4:

```
NC:\MPF\4.MPF 38
0, 5, , 1.00000, 0.00000, 600.00000, 800.00000, 3, 0, 0, 1, 3.00000
, 1.00000)
K-35 Y-25
K35 Y-25
K-35 Y25
K35 Y25
1CALL
30 Z100 M9
M05
M30
==eof==
```

## Operating sequence for programming in ISO mode



ISO mode

1. Select the system data operating area.
2. Press this softkey and the system prompts the following window:



After the new configuration is applied,  
an NCK/PLC/HMI restart will be triggered!



 
3. Press this softkey and control system automatically starts the mode change from Siemens mode to ISO mode.



4. Select the program management operating area.




5. Press this softkey to enter the system directory for storing part programs.



6. Press this softkey and enter the name of the new program.



7. Press this softkey to confirm your entry. The part program editor window opens automatically.

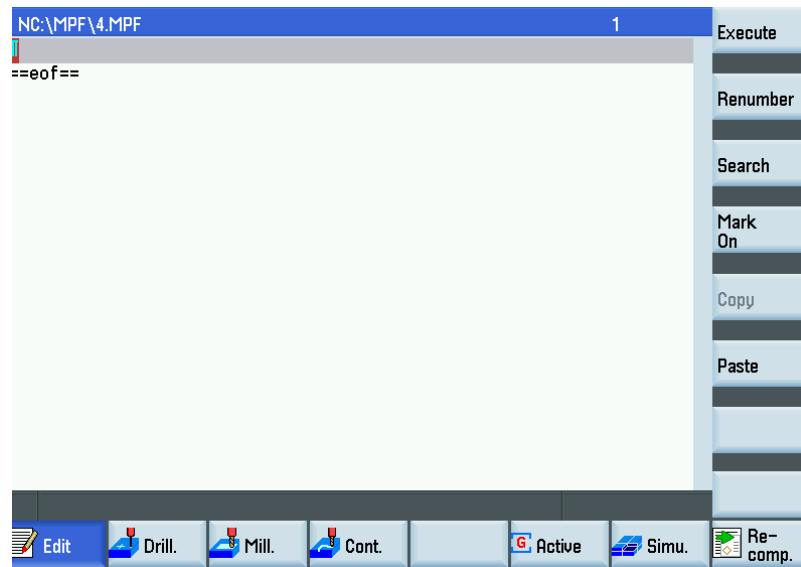

8. Enter the following main program:

```
G291
G17 G90 G64 G54
T1
M6
G43 H1 G0 Z100 M8
S1500 M3
G0 Z100
X-90 Y20
Z3
G1 Z0.2 F600
X90
Y-20
X-90
Y20
M3 S2500
G1 Z0. F600
X90
Y-20
X-90
G0 Z100 M9
M05
T2
M6
G43 H2 G0 Z100 M8
M3 S3500
SSD
SSE
G0 Z100 M9
M05
T3
M6
G43 H3 G0 Z100 M8
M3 S4000
X22.5 Y0
SSF
G68 X0 Y0 R180
SSF
G0 Z100 M9
M05
```

T4  
 M6  
 G43 H4 G0 Z100 M8  
 M3 S3000  
 Z50  
 G81 X35 Y25 Z-15 R2 F100  
 X-35  
 Y-25  
 X35  
 G0 G80 Z100 M9  
 M05  
 T5  
 M6  
 G43 H5 G0 Z100 M8  
 M3 S1000  
 Z50  
 G84 X35 Y25 Z-15 R2 F1000  
 X-35  
 Y-25  
 X35  
 G0 G80 Z100 M9  
 M05  
 M30

9. Open the window for creating a new program through the following key operations:



10. Enter the name of the subprogram with the file name extension, "SSD.SPF" in this example.

| New G code program |                  |
|--------------------|------------------|
| Type:              | Main program MPF |
| Name:              | SSD.SPF          |



11. Press this softkey to confirm your entry. The part program editor window opens automatically. Enter the following program blocks for "SSD":

G0 Z100  
 X0 Y-60  
 Z3  
 G1 Z-2 F50  
 G1 G41 Y-40 F600  
 X-50  
 Y40  
 X50  
 Y-40  
 X-5  
 G1 G40 X0 Y-60

```

G1 Z-4 F50
G1 G41 Y-40 F600
X-50
Y40
X50
Y-40
X-5
G1 G40 X0 Y-60
G1 Z-6 F50
G1 G41 Y-40 F600
X-50
Y40
X50
Y-40
X-5
G1 G40 X0 Y-60
G1 Z-8 F50
G1 G41 Y-40 F600
X-50
Y40
X50
Y-40
X-5
G1 G40 X0 Y-60
G1 Z-10 F50
G1 G41 Y-40 F600
X-50
Y40
X50
Y-40
X-5
G1 G40 X0 Y-60
G0 Z100
M17

```

12. Proceed as described above to create the other two subprograms: "SSE" and "SSF".

Subprogram "SSE":

G0 Z100  
X0 Y0  
Z3  
G1 Z-2 F50  
G1 G41 X15 F600  
G2 I-15  
G1 G40 X0 Y0  
G1 Z-4 F50  
G1 G41 X15 F600  
G2 I-15  
G1 G40 X0 Y0  
G1 Z-5 F50  
G1 G41 X15 F600  
G2 I-15  
G1 G40 X0 Y0  
G0 Z100  
M17

Subprogram "SSF":

G0 Z100  
X22.5 Y0  
Z3  
G1 Z-2.5 F50  
G1 G41 X28 Y0 F600  
G3 X17.678 Y17.678 CR=28  
G3 X14.142 Y14.142 CR=2.5  
G2 X23 Y0 CR=23  
G3 X28 CR=2.5  
G1 G40 X25.5 Y0  
G1 Z-5 F50  
G1 G41 X28 Y0 F600  
G3 X17.678 Y17.678 CR=28  
G3 X14.142 Y14.142 CR=2.5  
G2 X23 Y0 CR=23  
G3 X28 CR=2.5  
G1 G40 X25.5 Y0  
G0 Z100  
M17

Then you can proceed with the operations for "program simulation and execution (Page 284)".

## 13.6 Program simulation and execution



1. Switch to "AUTO" mode.



2. Press this softkey to open the program simulation window, and the program control mode PRT is automatically activated.



3. Press this key to start the simulation for the the selected part program.



4. After you finish the simulation, you can press this softkey to return to the program editor window.



5. Press this softkey and the system automatically changes to "AUTO" mode in the machining operating area.

6. Make sure the following preconditions are met before start machining:

- These two softkeys have been deactivated.



- The feedrate override is 0%.
- The safety door is closed and the coolant is switched on.



7. Make sure the safety door is closed and the coolant is switched on.  
Press this key to start workpiece machining.

## A Appendix

### A.1 Operating area overview

#### A.1.1 Machining operating area



Pressing this key on the PPU allows you to open the window for the machining operating area. You can perform reference point approach, tool setting operations, as well as program start, stop, control, block search, and real-time simulation, etc. in this operating area.

The machining operating area has different window displays and softkey functions in the following operating modes:

- "JOG" mode (Page 293)
- "AUTO" mode (Page 299)
- "MDA" mode (Page 300)

#### A.1.2 Program editing operating area

##### Softkey functions



Pressing this key on the PPU allows you to open the program editor with the last opened part program. If no program is ever opened in the program editor, pressing this key switches to the program management operating area.



- ① Displays and edits the program blocks
- ② Programs drilling cycles and adds to the current program
- ③ Programs turning cycles and adds to the current program
- ④ Opens the contour editor for free contour programming
- ⑤ Calls the dialog box of common programming instructions
- ⑥ Opens the program simulation window to check the programming results before machining
- ⑦ Recompiles the current cycle or contour selected with cursor by reopening the previous programming window
- ⑧ Executes the current program
- ⑨ Automatically assigns block numbers (Nxx) to all blocks
- ⑩ Opens the block search dialog box
- ⑪ Inserts a marker at the cursor position for copying/deleting the program blocks selected with the cursor
- ⑫ Copies the selected program blocks to the buffer memory
- ⑬ Pastes the copied program blocks at the current cursor position

### A.1.3 Offset operating area


When working with the CNC, you need to set up the machine and the tools, etc. as follows:

- Create the tools and cutting edges.
- Enter/modify the tool and work offsets.
- Enter the setting data.

#### Softkey functions



Pressing this key on the PPU allows you to open the following window:

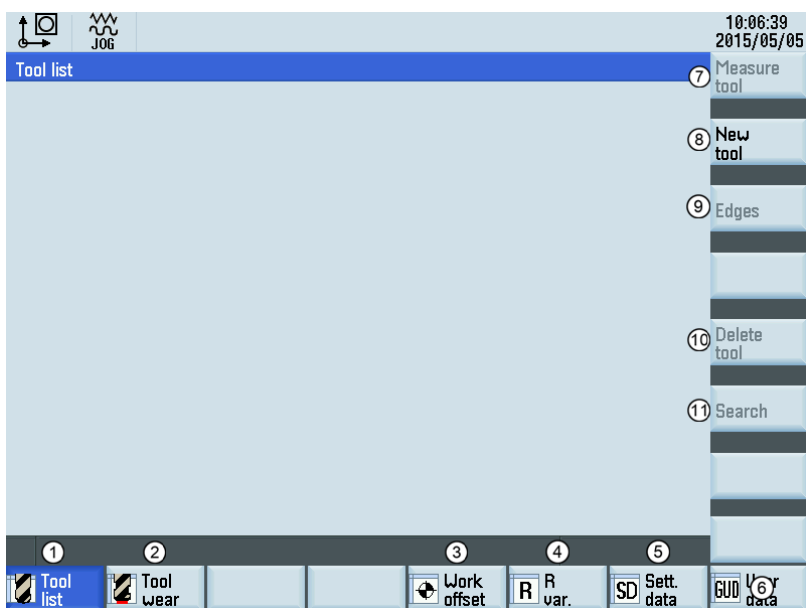


| Softkey | Function                                               | See also                                                                                                                                              |
|---------|--------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------|
| ①       | Displays and modifies the tool offsets                 | <ul style="list-style-type: none"> <li>"Creating a tool (Page 21)"</li> <li>"Creating/changing a cutting edge (Page 22)"</li> </ul>                   |
| ②       | Displays and modifies the tool wear data               | "Entering the tool wear offsets (Page 48)"                                                                                                            |
| ③       | Displays and modifies the workpiece offsets            | "Entering/modifying workpiece offsets (Page 58)"                                                                                                      |
| ④       | Displays and modifies the R variables                  | "Setting R parameters (Page 62)"                                                                                                                      |
| ⑤       | Configures and displays lists of setting data          | "Entering/modifying the setting data (Page 59)"                                                                                                       |
| ⑥       | Displays the defined user data                         | "Setting user data (Page 63)"                                                                                                                         |
| ⑦       | Measures the tool manually or automatically            | <ul style="list-style-type: none"> <li>"Measuring the tool manually (Page 27)"</li> <li>"Measuring the tool with a probe (auto) (Page 55)"</li> </ul> |
| ⑧       | Creates a new tool                                     | "Creating a tool (Page 21)"                                                                                                                           |
| ⑨       | Opens a lower-level menu for cutting edge settings     | "Creating/changing a cutting edge (Page 22)"                                                                                                          |
| ⑩       | Removes the currently selected tool from the tool list | -                                                                                                                                                     |
| ⑪       | Searches for your desired tool with the tool number    | -                                                                                                                                                     |

## A.1.4 Program management operating area

### Softkey functions



Pressing this key on the PPU allows you to open the following window:

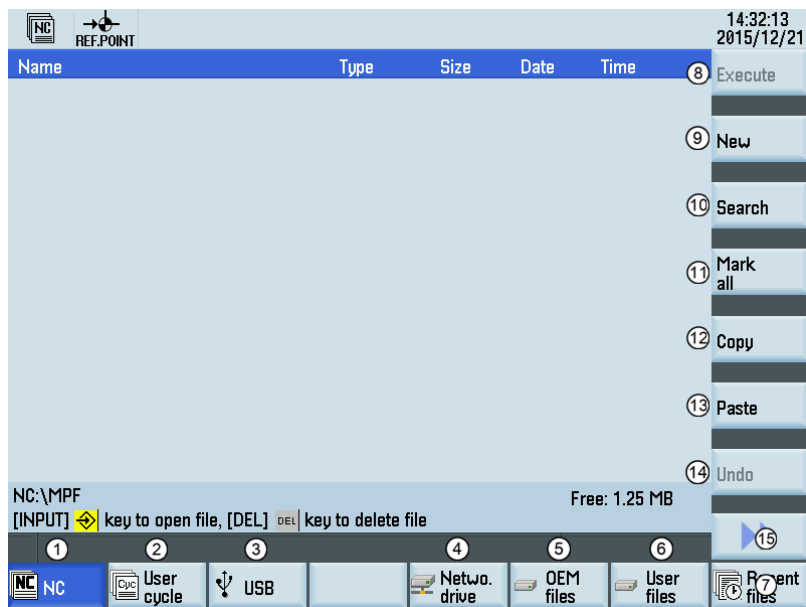

- ① Stores the NC programs for subsequent operations
- ② Manages and transfers the manufacturer cycles
- ③ Reads in/out files via the USB drive and executes part programs from the external storage media
- ④ Reads in/out files via the Ethernet interface and executes part programs from a computer
- ⑤ Backs up manufacturer files
- ⑥ Backs up user files
- ⑦ Shows the recently accessed files
- ⑧ Executes the selected file. No editing is allowed in the execution process.
- ⑨ Creates new files or directories
- ⑩ Searches for files
- ⑪ Selects all files for the subsequent operations
- ⑫ Copies the selected file(s) to the clipboard
- ⑬ Pastes the selected file(s) from the clipboard to the current directory
- ⑭ Restores the deleted file(s)
- ⑮ Opens the lower-level menu for more options:
  - Rename the part programs
  - Cut the part programs

Note: Softkeys ② and ⑤ are visible only with the manufacturer password.

### Searching for programs



1. Select the program management operating area.



2. Select the storage directory in which you wish to perform the search.

**Note:**

The following two folders are visible only with the manufacturer password:



3. Press this vertical softkey to open the search window.
4. Enter the complete name with extension of the program file to be searched in the first input field in the search window. To narrow your search, you can enter the desired text in the second field.
5. Use this key to choose whether to include subordinate folders or observe upper/lower case.
6. Press this softkey to start the search.



### Copying, cutting, and pasting programs



1. Select the program management operating area.
2. Open the desired directory.
3. Select the program file that you would like to copy or cut.



4. Perform either of the following operations as desired:

- Press this softkey to copy the selected file:



- Press the following softkeys to cut the selected file:



5. Select the target directory with the horizontal softkeys.
6. Press this softkey to paste the file from the clipboard to the current directory.



## Deleting/restoring programs




1. Select the program management operating area.



2. Open the desired directory.
3. Select the program file that you would like to delete.



4. Press this key, and the following message appears on the screen:

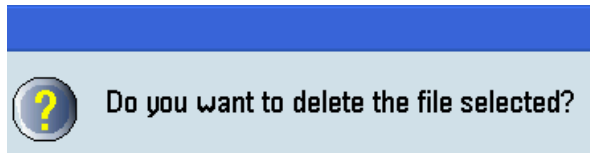

5. Press this softkey to confirm the deletion.



6. If you want to restore the last deleted file(s), press this softkey.

## Renaming programs



1. Select the program management operating area.



2. Open the desired directory.
3. Select the program file that you would like to rename.



4. Press the extension softkey.



5. Press this vertical softkey to open the window for renaming.



6. Enter a desired new name with the extension in the input field.
7. Press this softkey to confirm your entry.

## Viewing and executing recent programs



1. Select the program management operating area.



2. Press this softkey to open the list of recent files. Note that even the deleted files are also displayed in the list.



3. Select the program file that you would like to execute.

Execute

 
4. Press this vertical softkey to start executing the selected program.

Clear history


To clear the current file list, press this softkey.

## A.1.5 System data operating area

### Softkey functions



Pressing this key combination allows you to enter the system data operating area. This operating area includes functions required for parameterizing and analyzing the NCK, the PLC, and the drive. The start screen displays the machine configuration data and softkeys available. Depending on the functions selected, the horizontal and the vertical softkey bars vary.

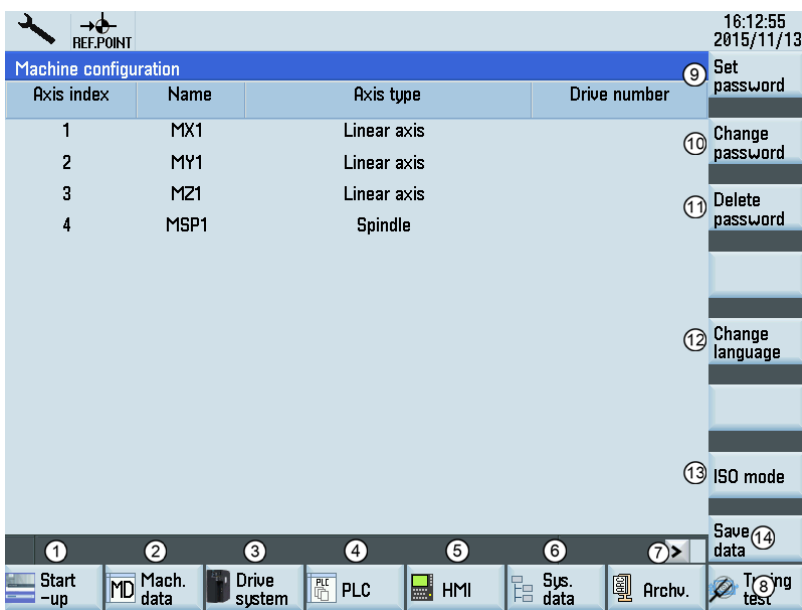

- ① Sets the NC, PLC and HMI start up modes
- ② Sets the system machine data
- ③ Configures the connected drives and motors
- ④ Provides PLC commissioning and diagnostics
- ⑤ Sets the system date and time and adjusts the brightness of the screen
- ⑥ Backs up and restores system data
- ⑦ Creates and restores startup archives, data archive
- ⑧ Performs the axis optimization
- ⑨ Enters the corresponding password (manufacturer password, and end user password) for different access levels
- ⑩ Changes the password as per the corresponding access levels
- ⑪ Deletes the current password
- ⑫ Selects the user interface language. Note that the HMI is automatically restarted when a new language is selected.
- ⑬ Switches to the ISO programming mode
- ⑭ Saves the contents of the volatile memory into a non-volatile memory area



An extended horizontal softkey bar can be accessed via this key on the PPU. Two extended horizontal softkeys are provided:



Views the service information




Defines the maintenance planner

## A.1.6 Alarm operating area

### Softkey functions




Press this key on the PPU to enter the alarm operating area. You can check the NC and drive alarms using the softkeys. PLC alarms are not sorted.

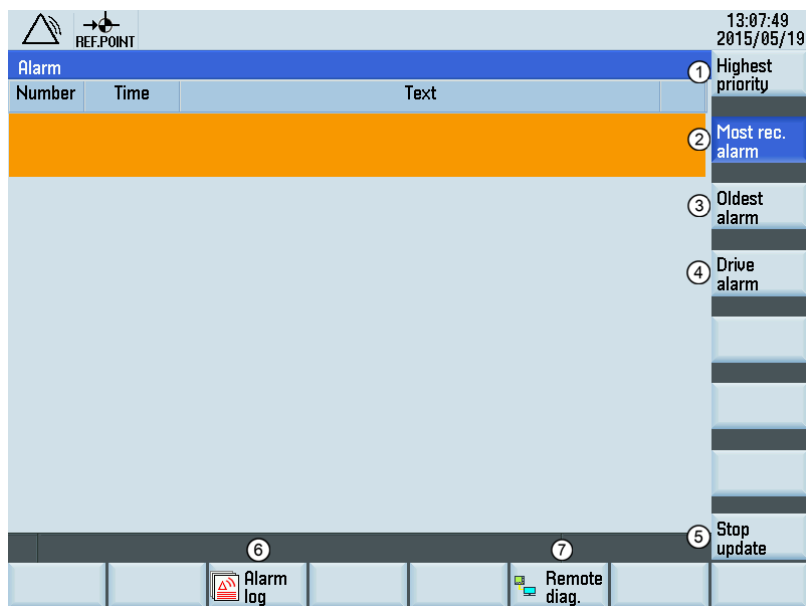

- ① Displays all alarms sorted by their priorities. The highest priority alarm is at the beginning of the list.
- ② Displays the alarms sorted by the time of their occurrence. The most recent alarm stands at the beginning of the list.
- ③ Displays the alarms sorted by the time of their occurrence. The oldest alarm stands at the beginning of the list.
- ④ Displays the alarms on the drives.
- ⑤ Stops/starts updating of pending alarms
- ⑥ Views and manages the alarm log
- ⑦ Configures the access right for the remote control through the Ethernet connection. For more information about the softkey function, see the SINUMERIK 808D ADVANCED Commissioning Manual.

## A.2 Operating mode overview



### A.2.1 "JOG" mode

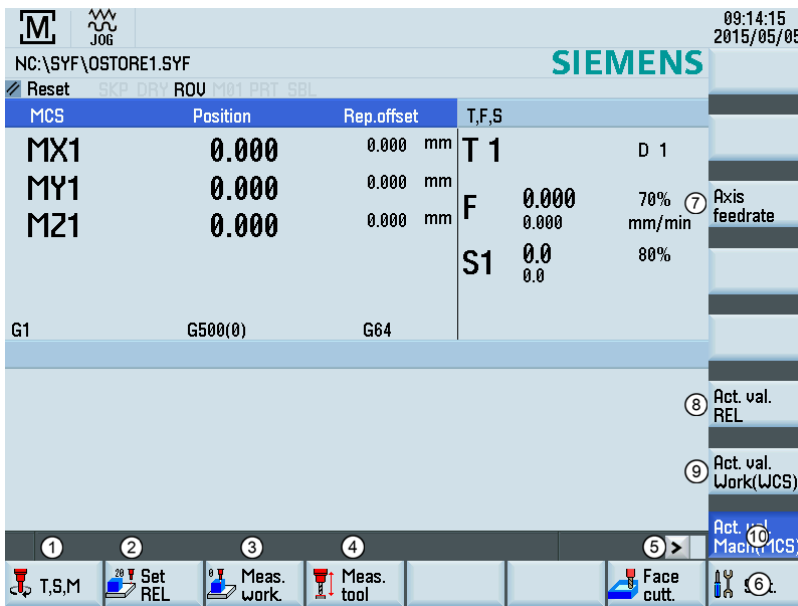

- ① Opens the "T, S, M" window where you can activate tools, set spindle speed and direction (see Section "Activating the tool and the spindle (Page 23)"), and select a G code or other M functions for activating the settable work offset.
- ② Switches the display to the relative coordinate system. You can set the reference point in this coordinate system. For more information, see Section "Setting the relative coordinate system (REL) (Page 296)".
- ③ Opens the workpiece measurement window where you determine the work offset data. For more information about this window, see Section "Measuring the workpiece (Page 56)".
- ④ Opens the tool measurement window where you determine the tool offset data. For more information about this window, see Sections "Measuring the tool manually (Page 27)", "Measuring the tool with a probe (auto) (Page 55)" and "Calibrating the tool probe (Page 53)".
- ⑤ Opens the face cutting window where you specify parameters for machining the end face or peripheral surface of a blank without creating a special part program. For more information about this window, see Section "Face milling (Page 297)".
- ⑥ Opens the settings window where you can set JOG feedrate and variable increment values.
- ⑦ Displays the axis feedrate in the selected coordinate system.
- ⑧ Displays the axis position data in the relative coordinate system.
- ⑨ Displays the axis position data in the workpiece coordinate system.
- ⑩ Displays the axis position data in the machine coordinate system.

#### Display of variable increments

  The HMI displays the variable increment if it is defined in the standard subroutine program:

|                                                                                     |                                                               |
|-------------------------------------------------------------------------------------|---------------------------------------------------------------|
|  | Value ≤ five digits: displays the complete value              |
|  | Value > five digits: displays the first four digits plus ".." |

## Parameters in the "JOG" window

 
| MCS | Position | Rep.offset | T,F,S                         |
|-----|----------|------------|-------------------------------|
| MX1 | 0.000    | 0.000 mm   | T 1 ④ D 1                     |
| MY1 | 0.000    | 0.000 mm   | F 0.000 ⑤ 70%<br>0.000 mm/min |
| MZ1 | 0.000    | 0.000 mm   | S1 0.0 ⑥ 80%<br>0.0           |
| ①   | ②        | ③          |                               |

- ① Displays the axes that exist in the machine coordinate system (MCS), workpiece coordinate system (WCS), or relative coordinate system (REL). If you traverse an axis in the positive (+) or negative (-) direction, a plus or minus sign appears in the relevant field. If the axis is already in the required position, no sign is displayed.
- ② Displays the current position of the axes in the selected coordinate system.
- ③ Displays the distance traversed by each axis in "JOG" mode from the interruption point in the condition of program interruption. For more information about program interruption, see Section "Executing a part program (Page 45)".
- ④ Displays the currently active tool number T with the current tool offset number D.
- ⑤ Displays the actual axis feedrate and the setpoint (mm/min or mm/rev).
- ⑥ Displays the actual value and the setpoint of the spindle speed (r.p.m.).

### A.2.1.1 Running the spindle manually

#### Note

Before running the spindle manually, make sure you have activated the tool.



You can run the spindle manually using these keys on the MCP in "JOG" mode. The spindle speed is selected via MD14512[19].4 as follows:

- MD14512[19].4 = 0 (default): the spindle runs with the speed set in MD32020.
- MD14512[19].4 = 1: the spindle runs with the speed set last time. In this case, if the spindle runs for the first time after the control system powers on, then you must specify a spindle speed in "MDA" mode or the "T, S, M" window.

#### Operating sequence



1. Select the machining operating area.



2. Switch to "JOG" mode.



3. Press this key on the MCP to rotate the spindle counter-clockwise.

| T,F,S |                 |               |
|-------|-----------------|---------------|
| T 1   |                 | D 1           |
| F     | 0.000<br>0.000  | 80%<br>mm/min |
| S1    | -50.0<br>-100.0 | 50%           |



4. Press this key on the MCP to stop the spindle rotation.

| T,F,S |                |               |
|-------|----------------|---------------|
| T 1   |                | D 1           |
| F     | 0.000<br>0.000 | 80%<br>mm/min |
| S1    | 0.0<br>0.0     | 50%           |



5. Press this key on the MCP to rotate the spindle clockwise.

| T,F,S |                |               |
|-------|----------------|---------------|
| T 1   |                | D 1           |
| F     | 0.000<br>0.000 | 80%<br>mm/min |
| S1    | 50.0<br>100.0  | 50%           |



10. Use this softkey to return to the screen of the machining operating area.

### A.2.1.2 Executing M functions

#### Note

Before executing M functions, make sure all the axes are in safe positions.

#### Operating sequence



1. Select the machining operating area.



2. Switch to "JOG" mode.



3. Open the "T, S, M" window.



4. Press this key to move the cursor to the input field for M functions, and enter the desired value, for example, "8".



5. Press this key on the MCP to activate the coolant function. Now you can see the corresponding status indicator is on, which indicates the coolant supply is switched on.



- Press this key on the MCP to stop the coolant function.



- Use this softkey to return to the main screen of the machining operating area.

### A.2.1.3 Setting the relative coordinate system (REL)

#### Operating sequence



- Select machining operating area.



- Switch to "JOG" mode.



- Press this softkey to switch the display to the relative coordinate system.



- Use the cursor keys to select the input field, and then enter the new position value of the reference point in the relative coordinate system.

| REL | Position | Rep.offset |
|-----|----------|------------|
| X   | -0.018   | 0.000 mm   |
| Y   | 4.843    | 0.000 mm   |
| Z   | -3.6     | 0.000 mm   |



- Use this key to activate the values after each entry.  
You can use the corresponding vertical softkeys to set the reference point to zero.



Sets the X axis to zero



Sets the Y axis to zero



Sets the Z axis to zero



Sets the spindle to zero



Sets all axes to zero

## A.2.1.4 Face milling

### Functionality

Use this function to prepare a blank for the subsequent machining without creating a special part program.

### Operating sequence



1. Select the desired operating area.



2. Switch to "JOG" mode.




3. Open the face milling window.



4. Move the cursor keys to navigate in the list and enter the desired values for the selected parameters (see table below for the parameter descriptions).



5. Confirm your entries with the appropriate key.

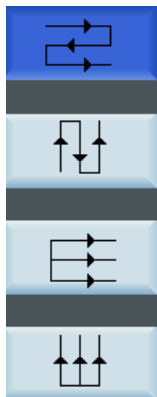

6. Select the cutting path of the tool during machining.



7. Use this softkey to confirm your settings. The system now automatically creates the part program.



8. Press this key on the MCP to run the part program.

## Parameters for face milling

| Face milling |         | Finish. allowance depth |               |     |   |
|--------------|---------|-------------------------|---------------|-----|---|
| 1.2          |         | ① T                     | 1             | ② D | 1 |
| 1.1          |         | ③ Work offset           | G54           |     |   |
| 1.0          |         | ④ RTP                   | 5.000 mm      |     |   |
| 0.9          |         | ⑤ SDIS                  | 10.000 mm     |     |   |
| 0.9          |         | ⑥ F                     | 50.000 mm/min |     |   |
|              |         | ⑦ S                     | 500.000 rpm   |     |   |
|              |         | ⑧ Direction:            | M3            |     |   |
|              |         | ⑨ Mach.                 | Roughing      |     |   |
|              |         | ⑩ { X0                  | 1.000 abs     |     |   |
|              |         | Y0                      | 1.000 abs     |     |   |
|              | Z0      | 1.000 abs               |               |     |   |
|              | ⑪ { X1  | 0.100 inc               |               |     |   |
|              | Y1      | 0.100 inc               |               |     |   |
|              | Z1      | 0.100 inc               |               |     |   |
|              | ⑫ { DXY | 0.100 inc               |               |     |   |
|              | DZ      | 0.100 inc               |               |     |   |
|              | ⑬ UZ    | 0.500 inc               |               |     |   |

- ① Tool number
- ② Tool offset number
- ③ Work offset to be activated
- ④ Retraction plane
- ⑤ Safety distance
- ⑥ Path feedrate
- ⑦ Spindle speed

- ⑧ Direction of spindle rotation
- ⑨ Machining type selection: roughing or finishing
- ⑩ X\Y\Z position of the blank
- ⑪ Cutting dimension in the X\Y\Z direction, specified in increments
- ⑫ Cutting length in the X\Y\Z direction, specified in increments relative to the workpiece edge
- ⑬ Stock allowance in the Z direction

## A.2.1.5 Setting the JOG data

### Operating sequence



1. Select the desired operating area.



2. Switch to "JOG" mode.



3. Press this horizontal softkey to open the following window:

| Settings                          |                 |
|-----------------------------------|-----------------|
| JOG - Feedrate                    | 0.000 mm/min    |
| Variable increment                | 0 inc           |
| Jog spindle speed                 | 0.000 rpm       |
| Dry run feedrate                  | 5000.000 mm/min |
| Spindle speed limitation with G96 | 100.000 rpm     |



Switch  
mm > inch

OK

Cancel

4. Enter values in the input fields and confirm your entries.
5. If necessary, press this vertical softkey to switch between the metric and inch dimension systems.

Press this softkey to confirm your change.

Press this softkey to exit.


## A.2.2 "AUTO" mode

### Overview

The machine must have been set up for "AUTO" mode according to the specifications of the machine manufacturer. You can perform such operations as program start, stop, control, block search, and real-time simulation and recording, etc.

### Softkey functions

Pressing this key in the machining operating area switches to "AUTO" mode.

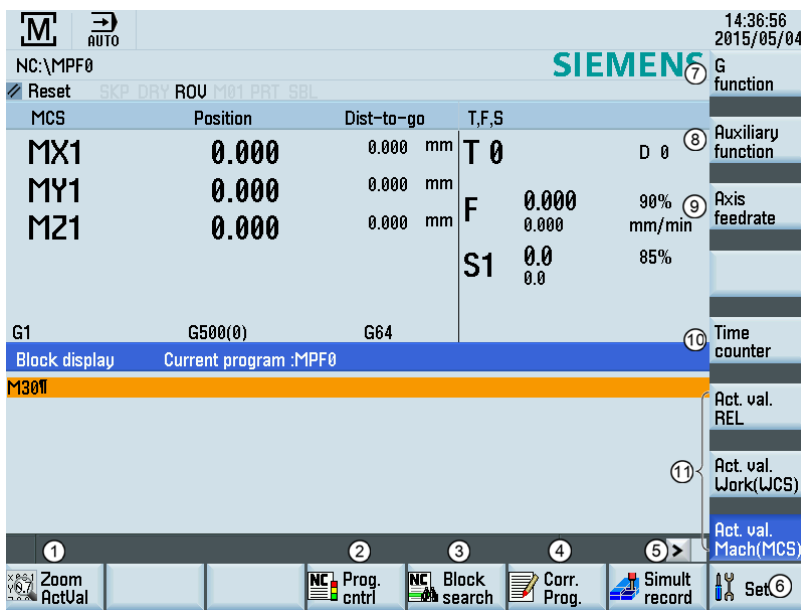

- ① Zooms in the actual value window
- ② Performs the program test, dry run, conditional stop, block skipping, and auxiliary function lock
- ③ Finds the desired block location
- ④ Corrects a wrong program block. Any changes will be stored immediately.
- ⑤ Activates the simulation function
- ⑥ Sets the frequently used setting data
- ⑦ Displays important G functions
- ⑧ Displays currently active auxiliary and M functions
- ⑨ Displays the axis feedrate in the selected coordinate system
- ⑩ Displays the information of part machining time (part timer) and part counter
- ⑪ Switches over the coordinate system in the actual value window



An extended horizontal softkey bar can be accessed via this key on the PPU. The following extended horizontal softkey is provided:

### Handwheel

Assigns and activates the handwheel or contour handwheel. For more information, refer to Section "Assigning the handwheel through the MCP (Page 25)" and Appendix "Activating the contour handwheel via the NC program (Page 302)".

### Parameters

| MCS                                      | Position | Dist-to-go |
|------------------------------------------|----------|------------|
| MX1                                      | 0.000    | 0.000 mm   |
| MY1                                      | 0.000    | 0.000 mm   |
| MZ1                                      | 0.000    | 0.000 mm   |
| ①                                        | ②        | ③          |
| G1                                       | G500(0)  | G64        |
| Block display      Current program :MPF0 |          |            |
| M30                                      |          |            |
| ④                                        |          |            |

- ① Displays the axes that exist in the machine coordinate system (MCS), workpiece coordinate system (WCS), or relative coordinate system (REL).
- ② Displays the current position of the axes in the selected coordinate system.
- ③ Displays the remaining distance for the axes to traverse.
- ④ Displays seven subsequent blocks of the currently active part program. The display of one block is limited to the width of the window.

## A.2.3 "MDA" mode

### Basic softkey functions in "MDA" mode

#### G function

This window displays important G functions whereby each G function is assigned to a group and has a fixed position in the window. To close the window, press this softkey once again.



To display additional G functions, use the corresponding keys.

#### Auxiliary function

This window displays the auxiliary and M functions currently active. To close the window, press this softkey once again.

 Save  
file

This softkey opens the file saving window where you can specify a name and a storage medium for the program displayed in the MDA window. To save your program, either enter a new program name in the input field or select an existing program for overwriting.

**Note:**

If you do not save with this softkey, the program edited in "MDA" mode is actually a temporary file.

 Delete  
file

Pressing this softkey deletes all the blocks displayed in the MDA window.

 Load  
file

This softkey opens a window where you can select an existing program file from a system directory to load into the MDA buffer.

For the explanation of other softkeys in this mode, see Section ""JOG" mode (Page 293)".

### Notes on part programs in "MDA" mode

Observe the following notes when creating, executing or editing part programs in "MDA" mode:

- **Programs ended with M2/M30/M17**

When a part program which is ended with M2/M30/M17 runs to the end in "MDA" mode, the cursor automatically returns to the beginning of the program and the entire program becomes editable.

- **Programs not ended with M2/M30/M17**

When a part program which is not ended with M2/M30/M17 runs to the end in "MDA" mode, a new empty line automatically appears at the end of the program and the cursor stops at the beginning of the new line. In this case, only this new block line is editable and then executable. All program blocks before the new line, however, are not editable unless you press the following key:



Note that if you do not enter any programming instruction in the new line, pressing the above key deletes the new line and the cursor automatically goes back to the beginning of the program.

- **Programs stopped under other circumstances**

In one of the following cases, the program execution stops and the program is not editable unless you press the above key:

- When a program exception occurs
- When the program runs to M0/M1
- When you press the following key:



## A.3 Activating the contour handwheel via the NC program

The contour handwheel function can help you with the first cutting test after you create a new NC program. When you have activated this function, you can control the feedrate of path and synchronized axes via a handwheel in "AUTO" or "MDA" mode. This section only introduces how to activate the contour handwheel via the NC program. For how to activate this function via the PLC interfaces, see the SINUMERIK 808D ADVANCED Function Manual.

### Preconditions

- You must not select fixed feedrate, dry-run feedrate, thread cutting, or tapping.

---

#### Note

If you have not programmed the feedrate in the previous blocks, the control system prompts an alarm which indicates the absence of feedrate.

---

- The axes have been referenced. For more information about how to reference the axes, see Chapter "Switching on and referencing (Page 20)".
- The option of "Contour handwheel" is activated with a license key. For more information about how to activate an option, see the SINUMERIK 808D ADVANCED Commissioning Manual.
- You have assigned the handwheel to the first geometric axis and activated it. For more information, see Section "Assigning the handwheel through the MCP (Page 25)".

### Activating the contour handwheel in "AUTO" mode

- Open the desired NC program in the part program editor window. For more information about how to create or edit a part program, see Chapter "Creating part programs (Page 29)".
- Enter the mandatory instructions "G1" (or "G2"/"G3"), "G94", "G60" and "FD=0" in the blocks. The blocks are saved automatically. See the following example:

```
G1 G60 G94 X20 Y20 Z40 F1200
X60 F1200
X200 Y200 Z300 FD=0
X0 Y0 Z0
M30
```

#### Note:

- "FD" and "F" cannot appear in the same NC block; otherwise, the control system prompts an alarm which interrupts the contour handwheel function.
- When the block runs to "FD=0", you can control the feedrate of path and synchronized axes via a handwheel in "AUTO" mode.

**Execute**

- Press this softkey to execute the program. The system automatically switches to "AUTO" mode in the machining area.

### Activating the contour handwheel in "MDA" mode



- Select the desired operating area.



- Switch to "MDA" mode.

3. Enter the mandatory instructions "G1" (or "G2"/"G3"), "G94", "G60" and "FD=0" in the blocks. The blocks are saved automatically. See the following example:

```
G1 G60 G94 X20 Y20 Z40 F1200
X60 F120
X200 Y200 Z300 FD=0
X0 Y0 Z0
M30
```



You can alternatively load an existing part program from a system directory by pressing this softkey if desired and enter "FD=0", "G94" and "G60" in the blocks.

**Note:**

"FD" and "F" cannot appear in the same NC block; otherwise, the control system prompts an alarm which interrupts the contour handwheel function.



4. Press this key on the MCP. When the block runs to "FD=0", you can control the feedrate of path and synchronized axes via a handwheel in "MDA" mode.

### Traversing direction of axes

The axis traversing direction depends on the rotation direction of the contour handwheel:

- Clockwise → results in traversing in the programmed direction  
If the block-change criterion is reached, the program advances to the next block (response identical to G60).
- Counterclockwise → results in traversing in a direction opposite to the programmed direction  
Here, the axes can only traverse to the appropriate block start. Pulses are not collected if the handwheel continues to rotate.

---

### Note

When the axes move against the programmed direction, the program reaches the beginning of each block and no further operation is available.

---


## A.4 The help system

The control system provides comprehensive online help. Whenever necessary, you can call the help system from any operating area.

### The help system



Press this key or the key combination <ALT> + <H> to call the help system from any operating area. If a context-sensitive help exists, window "①" opens; otherwise, window "③" opens.

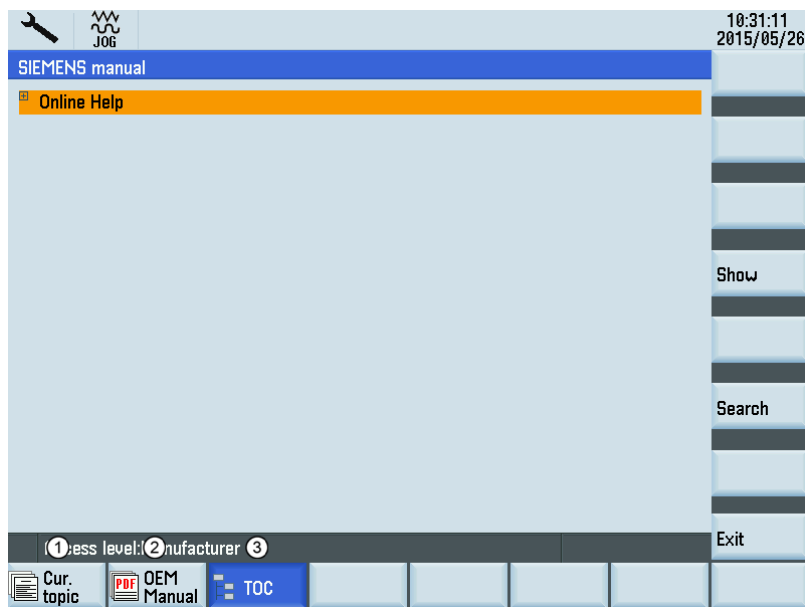

- ① Calls the context-sensitive help for the current topic:
  - Current operating window
  - NC/V70 alarms selected in the alarm specific operation area
  - Machine data or setting data selected
  - V70 data selected
- ② Calls the machine manufacturer-developed PDF manual
- ③ Displays all available help information:
  - Siemens help manuals
  - Machine manufacturer-developed help manuals, if any
  - All available NC/V70 alarms
  - All available V70 parameters
  - All available machine data or setting data

### Softkeys in window "①"

|                                                                                     |                                                     |
|-------------------------------------------------------------------------------------|-----------------------------------------------------|
|  | Navigates upwards through the hierarchical topics   |
|  | Navigates downwards through the hierarchical topics |

|                        |                                                                                                                                                                                                                 |
|------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Go to topic</b>     | <p>Selects cross references</p> <p>A cross reference is marked by the characters "&gt; ... &lt;".</p> <p><b>Note:</b></p> <p>This softkey is displayed only if the current page contains a cross reference.</p> |
| <b>Show</b>            | <p>Opens the selected topic in the current topic relevant window</p> <p>Functions the same as pressing the following key:</p>                                                                                   |
|                        |                                                                                                                                |
| <b>Search</b>          | Searches for a term in the current topic                                                                                                                                                                        |
| <b>Continue search</b> | Continues search for the next term that matches the search criteria                                                                                                                                             |
| <b>Exit</b>            | Exits the help system                                                                                                                                                                                           |

#### Softkeys in window "②"

|                        |                                                                     |
|------------------------|---------------------------------------------------------------------|
| <b>Zoom +</b>          | Zooms in the current view                                           |
| <b>Zoom -</b>          | Zooms out the current view                                          |
| <b>Zoom width</b>      | Zooms the current view to page width                                |
| <b>Go to</b>           | Jumps to the desired page                                           |
| <b>Search</b>          | Searches for a term in the current topic                            |
| <b>Continue search</b> | Continues search for the next term that matches the search criteria |
| <b>Exit</b>            | Exits the help system                                               |

#### Keys for window "③"

|                                                                                     |                               |
|-------------------------------------------------------------------------------------|-------------------------------|
|  | Expands hierarchical topics   |
|  | Collapses hierarchical topics |

|                                                                                   |                                                                                                                                                                                          |
|-----------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  | Navigates upwards through the hierarchical topics                                                                                                                                        |
|  | Navigates downwards through the hierarchical topics                                                                                                                                      |
| <b>Go to topic</b>                                                                | Selects cross references<br>A cross reference is marked by the characters "> ... <<" .<br><b>Note:</b><br>This softkey is displayed only if the current page contains a cross reference. |
| <b>Show</b>                                                                       | Opens the selected topic in the current topic relevant window<br>Functions the same as pressing the following key:                                                                       |
|                                                                                   |                                                                                                         |
| <b>Search</b>                                                                     | Searches for a term in the current topic                                                                                                                                                 |
| <b>Continue search</b>                                                            | Continues search for the next term that matches the search criteria                                                                                                                      |
| <b>Exit</b>                                                                       | Exits the help system                                                                                                                                                                    |

## A.5 Operation wizard

The operation wizard provides step-by-step guides on basic commissioning and operation procedures.

### Operating sequence

1. Call the operation wizard through the following key operations:



→ **Operation assistant**

**Operation assistant**

**Guide the user through the first steps of the machine operation.**

**Assistant**

**Switch on the machine and approach the reference point**

Create a new tool and measure the tool

Measure the workpiece

Create a part program

Simulate the program

2. Select a step of the machining operation with the cursor keys.



Start  
assistant


Next

Previous

Exit



3. Press this softkey to start the onboard assistant.
4. Press this softkey to enter the next page.
5. Press this softkey to enter the previous page.
6. Press either key to return to the main screen of the operation wizard.
7. Press one of the following five operating area keys to exit the main screen of the operation wizard.

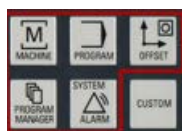

## A.6 Editing Chinese characters

The program editor and PLC alarm text editor both allow you to edit the simplified Chinese characters on the Chinese variant of the HMI.

### Editing simplified Chinese characters

Press the following key combination to switch the editor on or off:




Press this key to toggle between different input methods.

Press the numeric keys (1 to 9) on the PPU to select the desired characters.

Example of editing simplified Chinese



Structure of editor

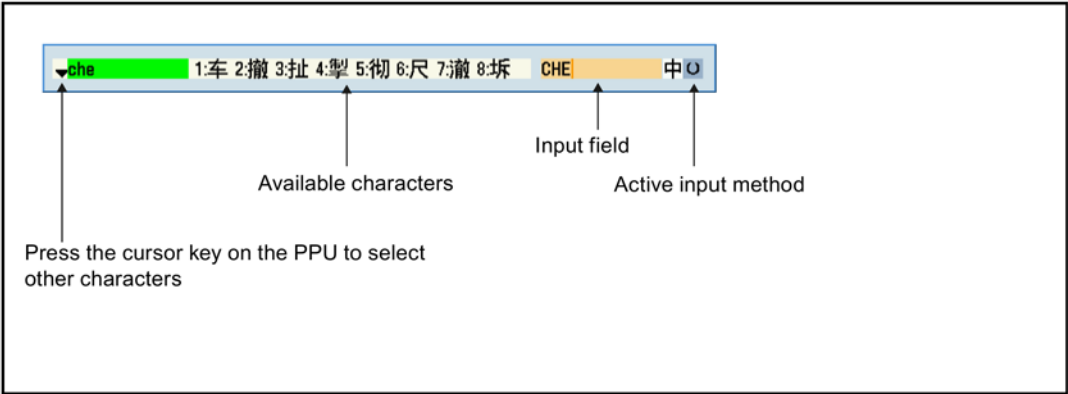

A.7 Calculating contour elements

Function

You can use the calculator to calculate the contour elements in the respective input screens.

Calculating a point in a circle



1. Activate the calculator when you position the cursor on the desired input field.



2. Open the lower-level menu for contour elements selection.




3. Select the desired calculation function.

G2/G3

Press this softkey to define the direction of rotation of the circle.

4. Enter the circle center, the angle of the tangent and the circle radius in the following window:

Calculate a point in a circle

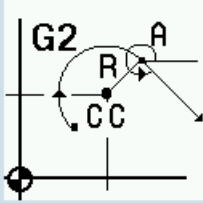

CC abscissa

CC ordinate

Angle A

Radius R


Radius programming

  
 Accept

5. Press this softkey to calculate the abscissa and ordinate values of the point.  
 The abscissa is the first axis, and the ordinate is the second axis of the plane. The abscissa value is displayed in the input field from which the calculator function has been called, and the value of the ordinate is displayed in the next input field. If the function is called from the part program editor, the coordinates are saved with the axis names of the selected basic plane.

### Example


Calculating the point of intersection between the circle sector ① and the straight line ② in plane G17:

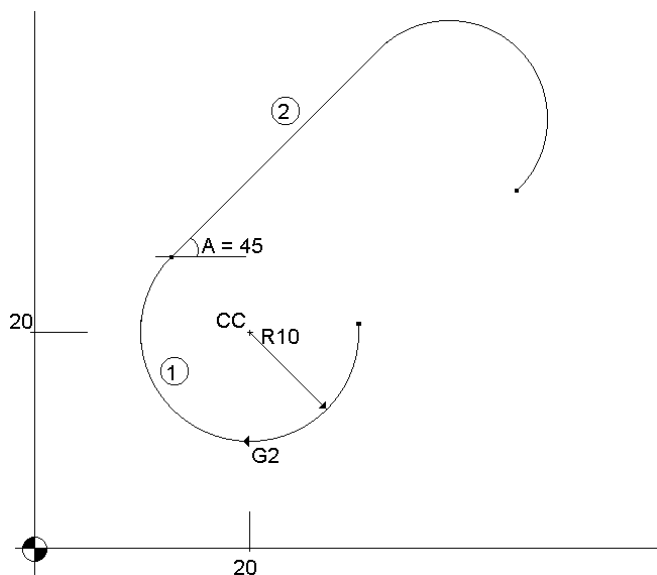

### Given:

- Radius: 10
- Circle center point CC: Y=20, X=20
- Connection angle for straight lines: 45°

Calculate a point in a circle

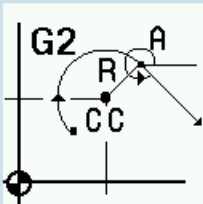


|             |    |
|-------------|----|
| CC abscissa | 20 |
| CC ordinate | 20 |
| Angle A     | 45 |
| Radius R    | 10 |

Radius programming

Result: Y=27.071, X=12.928

The result appears on the input screen.

### Calculating a point in a plane

 

1. Activate the calculator when you position the cursor on the desired input field.

2. Open the lower-level menu for contour elements selection.

3. Select the desired calculation function.


4. Enter the following coordinates or angles in the respective input fields:

- Coordinates of the given point (PP)
- Slope angle of the straight line (A1)
- Distance of the new point with reference to PP
- Slope angle of the connecting straight line (A2) with reference to A1

5. Press this softkey to calculate the abscissa and ordinate values of the point.

The abscissa is the first axis, and the ordinate is the second axis of the plane. The abscissa value is displayed in the input field from which the calculator function has been called, and the value of the ordinate is displayed in the next input field. If the function is called from the part program editor, the coordinates are saved with the axis names of the selected basic plane.

### Calculating the Cartesian coordinates

 

1. Activate the calculator when you position the cursor on the desired input field.

2. Open the lower-level menu for contour elements selection.

3. Select the desired calculation function.

This function converts the given polar coordinates into Cartesian coordinates.

4. Enter the reference point, the vector length and the slope angle in the respective input fields.



5. Press this softkey to calculate the Cartesian coordinates.  
The abscissa value is displayed in the input field from which the calculator function has been called, and the value of the ordinate is displayed in the next input field. If the function is called from the part program editor, the coordinates are saved with the axis names of the selected basic plane.


#### Calculating the end point



 
1. Activate the calculator when you position the cursor on the desired input field.



2. Open the lower-level menu for contour elements selection.



 3. Select the desired calculation function.  
This function calculates the missing end point of the straight line/straight line contour section whereby the second straight line stands vertically on the first straight line.  
Press this softkey to define the given end point when the ordinate value is given.



Press this softkey to define the given end point when the abscissa value is given.



Press this softkey to define the second straight line which is rotated counter-clockwise by 90 degrees against the first straight line.



Press this softkey to define the second straight line which is rotated clockwise by 90 degrees against the first straight line.

4. Enter the PP coordinates, angle A, EP abscissa / ordinate, and L length in the respective input fields. The following values of the straight line are known:

Straight line 1: Starting point and slope angle

Straight line 2: Length and one end point in the Cartesian coordinate system

5. Press this softkey to calculate the missing end point.

The abscissa value is displayed in the input field from which the calculator function has been called, and the value of the ordinate is displayed in the next input field. If the function is called from the part program editor, the coordinates are saved with the axis names of the selected basic plane.



#### Example

The following drawing must be supplemented by the value of the center circle point in order to be able to calculate the point of intersection between the circle sector of the straight lines.





4. Press this softkey to open the contour editor window.

5. Initially, you define a contour starting point (see Section "Defining a start point (Page 314)").
6. The contour is then programmed step by step (see Section "Programming example for milling application (Page 323)").

## Recompile




When the program edited in the contour editor is opened in the program editor, if you position the editor cursor in a command line of the contour program and then press this softkey, the main screen of the contour editor opens and you can recompile the existing contour.

## Note

When recompiling, only the contour elements that were generated in the contour editor are created again. Any changes you made directly in the program text are lost; however, you can subsequently insert and edit user-defined texts, which will not be lost.

## Softkey functions

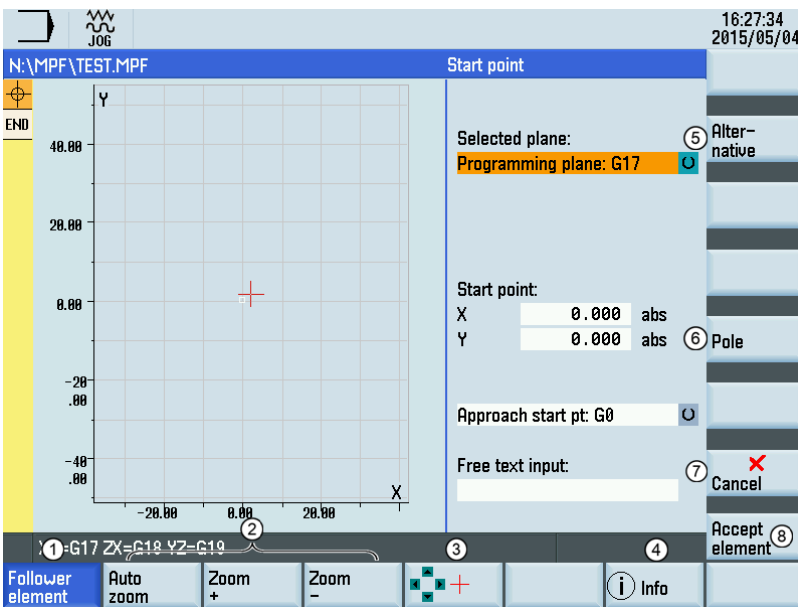

- ① An element was selected using the cursor keys. This softkey enlarges the image section of the selected element.
- ② Zooms the graphic in/out/automatically
- ③ When you select this softkey, you can move the red cross-hair with the cursor keys and choose a picture detail to display. When you deactivate this softkey, the input focus is positioned in the contour chain again.
- ④ If you press this softkey, help graphics are displayed in addition to the relevant parameter. Pressing the softkey again exits the help mode.
- ⑤ Press this softkey to toggle between the selections. This softkey functions the same as pressing the following key:



- ⑥ Defines a pole for contour programming in polar coordinates. The pole can only be entered in absolute Cartesian coordinates.
- ⑦ Exits the contour editor and returns to the program editor window, without transferring the last edited values to the main program
- ⑧ Saves the settings for the start point

## A.8.1 Defining a start point

When entering a contour, begin at a position which you already know and enter it as the starting point.

### Operating sequence



1. Select the program management operating area.



2. Enter the system program directory.



3. Select the desired program file, and press this key to open it in the program editor.



4. Press this softkey to open the contour editor window.



5. Use the cursor keys on the PPU to switch between different input fields.



6. Press this softkey or the following key to toggle between the selections and enter the desired values as required.



You can alternatively press this key to make your selection.



You can also define a pole for contour programming in polar coordinates by pressing this softkey.

The pole can also be defined or redefined at a later time. The programming of the polar coordinates always refers to the pole that was defined last.



7. Save the settings for the start point.




Pressing this softkey cancels the settings and exits the contour editor.

## A.8.2 Programming contour element

### Functionality



Once you have defined the contour start point, press this softkey and you can begin programming the individual contour elements from the main screen shown below:

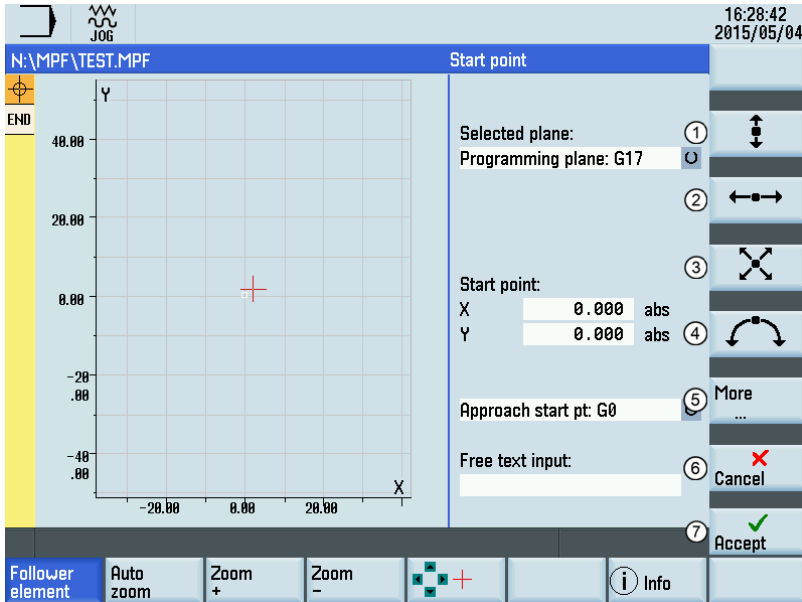

- ① Opens the window for programming a vertical straight line (in Z direction)
- ② Opens the window for programming a horizontal straight line (in Y direction)
- ③ Opens the window for programming an oblique line in the Y/Z direction. The end point of the line is entered using coordinates or an angle.
- ④ Opens the window for programming a circular arc with any direction of rotation
- ⑤ Opens the lower-level menu for more programming options:
  - Specify a pole
  - Close the contour
- ⑥ Returns to the program editor without transferring the last edited values to the system
- ⑦ Returns to the program editor with the last edited values transferred to the system

### Further softkey functions

 
The following softkeys are available in corresponding contour element window for programming the contour elements on the basis of pre-assigned parameters.

#### Tangent to preceding element



This softkey presets the angle  $\alpha_2$  to a value of 0. The contour element has a tangential transition to the preceding element, i.e. the angle to the preceding element ( $\alpha_2$ ) is set to 0 degree.

#### Displaying all parameters



Press this softkey to display a selection list of all the parameters for the selected contour element. If you leave any parameter input fields blank, the control assumes that you do not know the right values and attempts to calculate these from the settings of the other parameters. The contour is always machined in the programmed direction.

### Input switchover

Alter-native

This softkey is displayed only in cases where the cursor is positioned on an input field with several switchover settings.

### Selecting dialog

Dialog select

Some parameter configurations can produce several different contour characteristics. In such cases, you will be asked to select a dialog. By clicking this softkey, you can display the available selection options in the graphic display area. Select this softkey to make the correct selection (green line).

Accept

Confirm your choice with this softkey.

### Changing a selected dialog

Change selection

If you want to change an existing dialog selection, you must select the contour element in which the dialog was originally chosen. Both alternatives are displayed again when you select this softkey.

### Clearing a parameter input field

Delete value

You can delete the value in the selected parameter input field with this softkey or the following key:

DEL

### Saving a contour element

Accept element

If you have entered the available data for a contour element or selected a desired dialog, pressing this softkey allows you to store the contour element and return to the main screen. You can then program the next contour element.

### Appending a contour element

Use the cursor keys to select the element in front of the end marker.

Use the softkeys to select the contour element of your choice and enter the values you know in the input screen for that element.

Confirm your inputs with the following softkey:

Accept element

### Selecting a contour element



Position the cursor on the desired contour element in the contour chain, and select it using this key.

The parameters for the selected element will then be displayed. The name of the element appears at the top of the parameterization window.

If the contour element can be represented geometrically, it is highlighted accordingly in the graphic display area, i.e. the color of the contour element changes from white to black.

### Modifying a contour element



You can use the cursor keys to select a programmed contour element in the contour chain. Press this key to display the parameter input fields. The parameters can now be edited.

### Inserting a contour element

Use the cursor keys in the contour chain to select the contour element in front of the position for the new element.

Then select the contour element to be inserted from the softkey bar.

After you have configured the parameters for the new contour element, confirm the insert operation by pressing the following softkey:



Subsequent contour elements are updated automatically according to the new contour status.

### Deleting a contour element



Use the cursor keys to select the element you wish to delete. The selected contour symbol and associated contour element in the programming graphic are highlighted in red. Then press this softkey and confirm the query.

### Closing the contour



By pressing this softkey, you can close the contour from the actual position with a straight line to the starting point.

### Undoing an input



By selecting this softkey you can return to the main screen **without** transferring the last edited values to the system.


### Contour symbol colors

The meaning of the symbol colors in the contour chain on the left of the main screen is as follows:

| Icon         | Significance                                                                           |
|--------------|----------------------------------------------------------------------------------------|
| Selected     | Symbol color black on a red background → Element is defined geometrically              |
|              | Symbol color black on a light yellow background → Element is not defined geometrically |
| Not selected | Symbol color black on a gray background → Element is defined geometrically             |
|              | Symbol color white on a gray background → Element is not defined geometrically         |

## A.8.3 Parameters for contour elements

### Parameters for programming straight lines

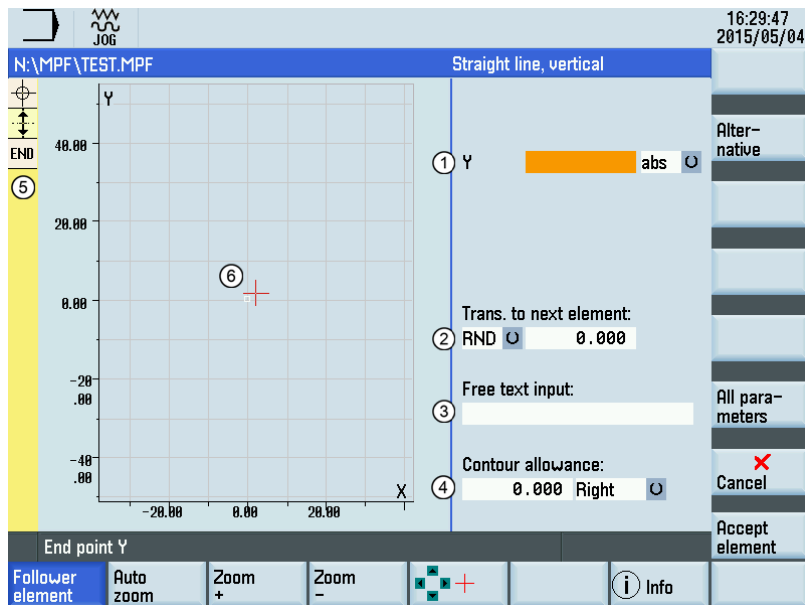

- ① Absolute (abs)/incremental (inc) end position in X or Y direction
- ② Transition element to the next contour is a chamfer (CHR) or a radius (RND). CHR=0 or RND=0 means no transition element.
- ③ Input field for supplementary comments, such as F1000 feedrate values, H or M functions. If comments are entered as text, they must always be started with a semicolon ";".
- ④ You can specify a side-based parallel contour allowance. It is displayed as an allowance in the graphics window.
- ⑤ The contour chain which displays the start point and programmed contour elements. The current position in the chain is color-highlighted.
- ⑥ The graphics window which displays the progress of the contour as you configure the parameters for the contour elements.

#### All parameters

The following additional parameters are displayed after you press this softkey:

| Parameter  | Description                          |
|------------|--------------------------------------|
| L          | Length of the straight line          |
| $\alpha 1$ | Pitch angle with reference to Y axis |

## Parameters for programming circular arcs

- ① Direction of rotation of the circular arc: clockwise or counter-clockwise
- ② Radius of circle
- ③ Absolute (abs)/incremental (inc) end positions in X and Y directions
- ④ Absolute (abs)/incremental (inc) positions of circle center point in Y (I) and X (K) directions
- ⑤ The contour chain which displays the start point and programmed contour elements. The current position in the chain is color-highlighted.
- ⑥ The graphics window which displays the progress of the contour as you configure the parameters for the contour elements.

### All parameters

The following additional parameters are displayed after you press this softkey:

| Parameter  | Description                                                     |
|------------|-----------------------------------------------------------------|
| $\alpha 1$ | Starting angle with reference to Y axis                         |
| $\alpha 2$ | Angle to preceding element; tangential transition: $\alpha 2=0$ |
| $\beta 1$  | End angle with reference to Y axis                              |
| $\beta 2$  | Angle of aperture of circle                                     |

### Machine manufacturer

The names of the identifiers (X or Y ...) are defined in the machine data where they can also be changed.

### Transition to next element


A transition element can be used whenever there is a point of intersection between two neighboring elements; this can be calculated from the input values.

You can choose to insert either a radius (RND), a chamfer (CHR) or an undercut as the transition element between any two contour elements. The transition is always appended to the end of a contour element. You select transition elements in the parameter input screen for the relevant contour element.

### Radius or chamfer at the start or the end of a turning contour:

In simple turning contours a chamfer or radius must often be appended at the start and end of the contour.

A chamfer or radius terminates an axis-parallel contour section on the blank:

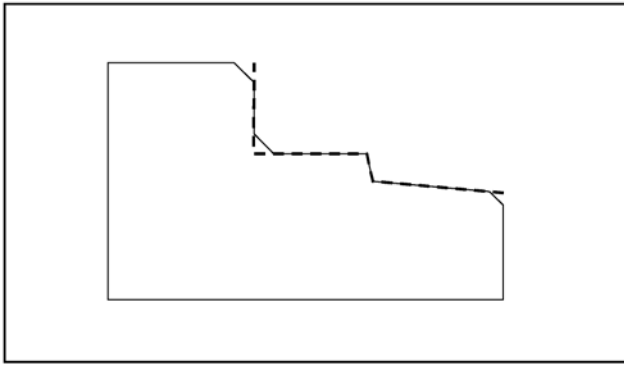

You select the direction of transition for the contour start in the starting point screen. You can choose between chamfer and radius. The value is defined in the same manner as for the transition elements.

In addition, four directions can be selected in a single selection field. You select the direction of the transition element for the contour end in the end screen. This selection is always proposed, even if preceding elements were assigned no transition.

### Contour chain

Once you complete or cancel the programming of a contour element, you can navigate around the contour chain (left on the main screen) using the cursor keys. The current position in the chain is color-highlighted.

The elements of the contour and pole, if applicable, are displayed in the sequence in which they were programmed.

You can select an existing contour element with the following key and reassign its parameters:



A new contour element is inserted after the cursor when you select one of the contour elements on the vertical softkey bar; the input focus is then switched to the parameter input on the right of the graphic display. Programming always continues after the element selected in the contour chain.

You can delete the selected element from the chain by selecting the following softkey:

**Delete  
element**

### Graphics window

The graphics window displays the progress of the contour chain as you configure the parameters for the contour elements. The element you have selected is displayed in black in the graphics window.

The contour is displayed to the extent it can be interpreted by the control on the basis of parameter inputs. If the contour is still not displayed in the programming graphic, further values must be entered. Check the contour elements you have already programmed, if required. You may have forgotten to enter all of the known data.

The coordinate system scaling is automatically adapted to changes in the complete contour.

The position of the coordinate system is displayed in the graphics window.

An element was selected using the cursor keys.

Pressing the following softkey allows you to enlarge the image section of the selected element:

**Follower  
element**

## A.8.4 Specifying contour elements in polar coordinates

### Functionality

The description about defining the coordinates of contour elements applies to the specification of positional data in the Cartesian coordinate system. Alternatively, you have the option to define positions using polar coordinates.

When programming contours, you can define a pole at any time prior to using polar coordinates for the first time. Programmed polar coordinates subsequently refer to this pole. The pole is modal and can be re-defined at any time. It is always entered in absolute Cartesian coordinates. The contour calculator converts values entered as polar coordinates into Cartesian coordinates. Positions can be programmed in polar coordinates only **after** a pole has been specified. The pole input does not generate a code for the NC program.

### Pole

The polar coordinates are valid in the level selected with G17 to G19.



The pole is a contour element that can be edited, which itself does not contribute to the contour. It can be entered when the starting point of the contour is defined or anywhere within the contour. The pole cannot be created before the starting point of the contour.



This softkey allows you to specify a pole and can only be entered in absolute Cartesian coordinates. This softkey is also present in the starting point screen. This enables the pole to be entered at the start of a contour, so that the first contour element can be entered in polar coordinates.

### Further notes

If the straight line that was generated with close contour is linked to the start element of the contour with a radius or chamfer, the radius or chamfer must be specified explicitly as follows:

- Close contour, enter radius/chamfer, and accept element. The result then corresponds exactly to what would occur if the closing element were to be entered with the radius or chamfer.  
Close contour can only be used for entering contour elements in **polar coordinates** if the starting point of the contour was set to polar and the **same pole** is still valid when the contour is closed.

### Input switchover: Cartesian/polar

The following contour elements can be entered optionally in polar coordinates only after a pole has been defined, whether this was done at the outset or later in the process:

- Circular arcs
- Straight lines (horizontal, vertical, any direction)

To switchover between Cartesian and polar coordinates, additional toggle fields are displayed in the programming windows for the contour elements of oblique lines and circular arcs.

A toggle field is not displayed if no pole exists. Input fields and display fields are then only available for Cartesian values.

### Absolute/incremental input

Absolute and incremental polar coordinates can be input for "polar/Cartesian". The input fields and display fields are labeled **inc** and **abs**.

Absolute polar coordinates are defined by an absolute distance to the pole that is always positive and an angle in the range of 0° ... +/- 360°. When absolute dimensions are specified, the angular reference is based on a horizontal axis of the working plane, e.g. X axis with G17. The positive direction of rotation runs counter-clockwise.

If there are several input poles, the definitive pole is always the **last pole** before the input or edited element.

Incremental polar coordinates relate to both the definitive pole and the end point of the preceding element.


For an incremental input, **the absolute distance** to the pole is calculated using the absolute distance from the end point of the preceding element to the pole plus the length increment that was entered.

The increment can be positive or negative.

**The absolute angle** is calculated accordingly using the absolute polar angle of the preceding element plus the angular increment. It is not necessary here for the preceding element to have been entered as polar.

In contour programming, the contour calculator converts the Cartesian coordinates of the preceding end point using the definitive pole into polar coordinates. This also applies if the preceding element has been given in polar coordinates, since this could relate to another pole if a pole has been inserted in the meantime.

### Pole change example

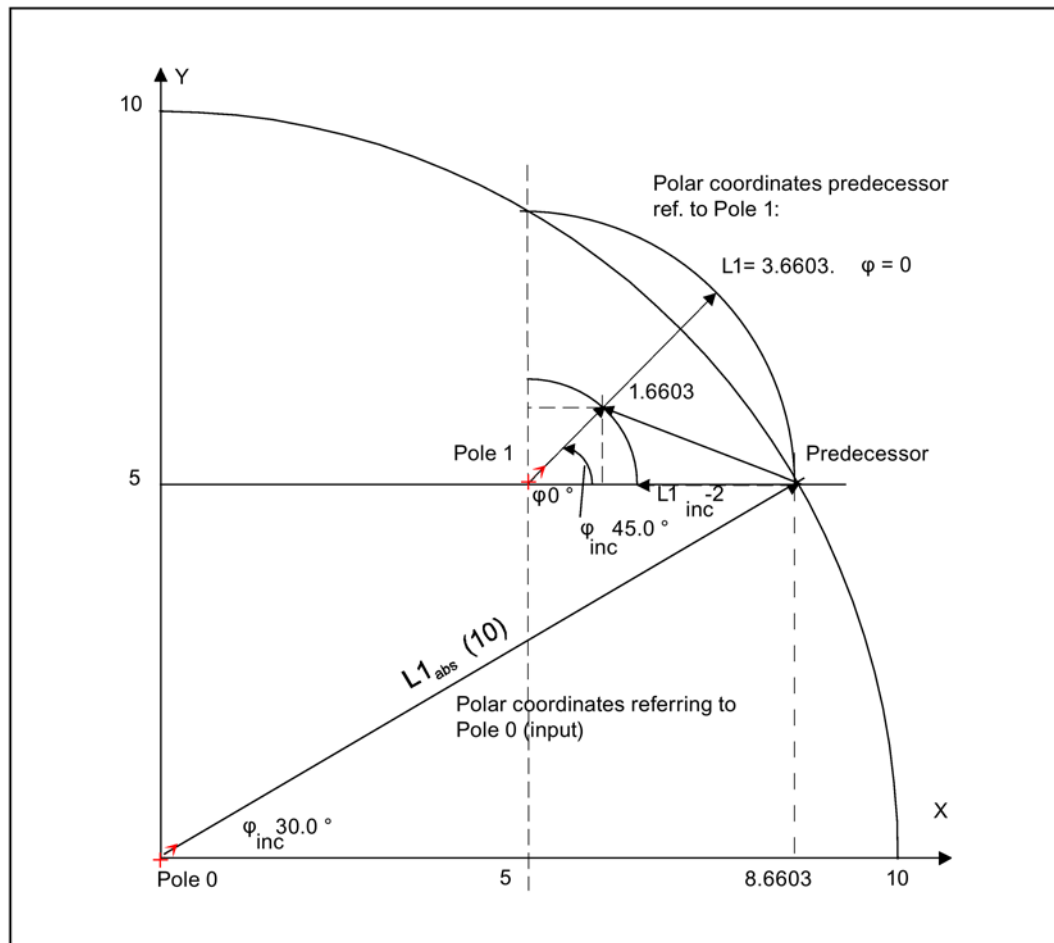

**Pole:** Xpole = 0.0, Ypole = 0.0, (Pole 0)

End point:

L1abs = 10.0

$\phi_{abs} = 30.0^\circ$

Calculated Cart. Coordinates

Xabs = 8.6603

Yabs = 5.0

**New pole:**

Xpole1 = 5.0

Ypole1 = 5.0

(Pole 1)

Calculated polar coord. Predecessor

L1abs = 3.6603

$\phi_{abs} = 0.0^\circ$

**Next point:**

L1inc = -2.0

$\phi_{inc} = 45.0^\circ$

Absolute polar coordinates for current element

L1abs = 1.6603

$\phi_{abs} = 45.0^\circ$

Calculate Cartesian coordinates

Xabs = 1.1740

Yabs = 1.1740

## A.8.5 Cycle support

### Functionality

The technologies below are provided with the additional support in the form of pre-defined cycles, which then must be parameterized.

- Drilling
- Milling

For more information, see Chapter "Cycles (Page 152)".


## A.8.6 Programming example for milling application

### Example 1

The following diagram shows a programming example for the "Free contour programming" function.

Starting point: X=5.67 abs., Y=0 abs., machining plane G17

The contour is programmed in a counter-clockwise direction.

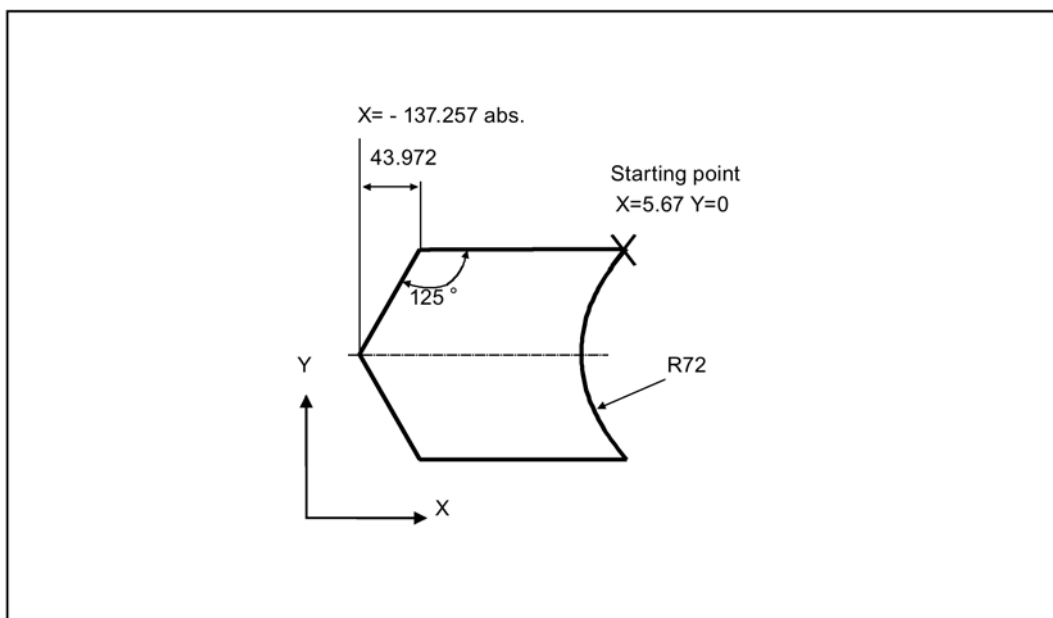

Operating sequence:



1. Select the program management operating area.



2. Enter the system program directory.



3. Select a program with the cursor keys and press this key to open the program in the program editor.



4. Press this softkey to open the contour editor.

Accept  
element



Accept  
element



Accept  
element



Accept  
element



Accept  
element




Dialog  
select

Accept  
element

5. Define a start point with the following parameters and press this softkey to confirm.
  - Programming plane: G17
  - X: 5.67 abs.
  - Y: 0
6. Press this softkey to select a contour element of straight horizontal line.
7. Enter the parameters for this element and press this softkey to confirm.
  - X: -93.285 abs.
8. Press this softkey to select a contour element of straight line in any direction.
9. Enter the parameters for this element and press this softkey to confirm.
  - X: -43.972 inc.
  - $\alpha 1$ : -125 °
10. Press this softkey to select a contour element of straight line in any direction.
11. Enter the parameters for this element and press this softkey to confirm.
  - X: 43.972 inc.
  - $\alpha 1$ : -55 °
12. Press this softkey to select a contour element of straight horizontal line.
13. Enter the parameters for this element and press this softkey to confirm.
  - X: 5.67 abs.
14. Press this softkey to select a contour element of circular arc.
15. Enter the parameters for this element and press this softkey to select the desired contour characteristics.
  - Direction of rotation: clockwise
  - R: 72
  - X: 5.67 abs.
  - Y: 0 abs.
16. Press this softkey to confirm.


Now you can see the programmed contour in the graphics window:

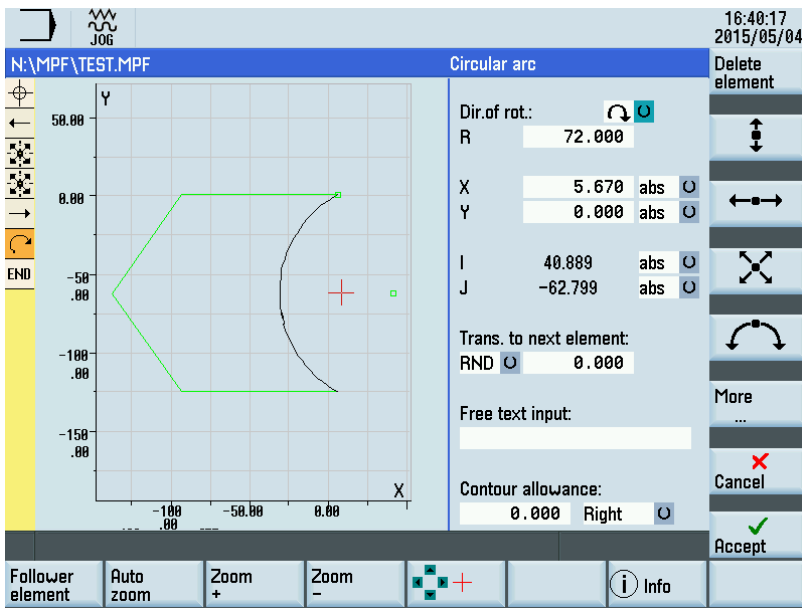

## Example 2

Starting point: X=0 abs., Y=0 abs., machining plane G17

The contour is programmed in the clockwise direction with dialog selection.

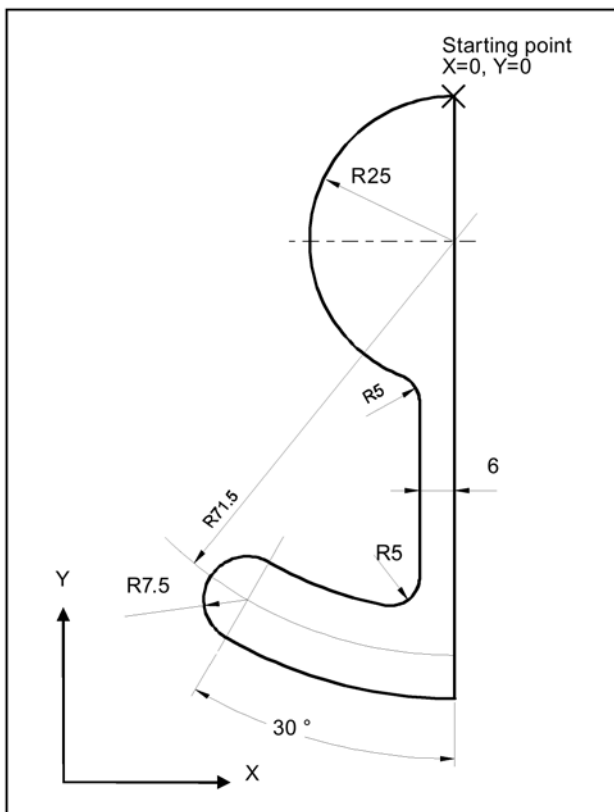

Operating sequence:



1. Select the program management operating area.



2. Enter the system program directory.



3. Select a program with cursor keys and press this key to open the program in the program editor.



4. Press this softkey to open the contour editor.



5. Define a start point with the following parameters and press this softkey to confirm.
  - Programming plane: G17
  - X: 0
  - Y: 0



6. Press this softkey to select a contour element of straight vertical line.



7. Enter the parameters for this element and press this softkey to confirm.
  - Y: -104 abs.



8. Press this softkey to select a contour element of circular arc.



9. Enter the parameters for this element and press this softkey to select the desired contour characteristics.
  - Direction of rotation: clockwise
  - R: 79
  - I: 0 abs.
  - $\beta_2$ : 30 °



10. Press this softkey to confirm.



11. Press this softkey to select a contour element of circular arc.



12. Enter the parameters for this element and press this softkey to select the desired contour characteristics.
  - Direction of rotation: clockwise
  - R: 7.5
  - $\beta_2$ : 180 °



13. Press this softkey to confirm.



14. Press this softkey to select a contour element of circular arc.

Dialog  
select

15. Enter the parameters for this element and press this softkey to select the desired contour characteristics.

- Direction of rotation: counter-clockwise
- R: 64
- X: -6 abs.
- I: 0 abs.
- RND: 5

Accept  
element

16. Press this softkey to confirm.



17. Press this softkey to select a contour element of straight vertical line.

Accept  
element

18. Enter the parameters for this element and press this softkey to confirm.

- $\alpha$ 1:90 °
- RND: 5



19. Press this softkey to select a contour element of circular arc.

Dialog  
select


20. Enter the parameters for this element and press this softkey to select the desired contour characteristics.

- Direction of rotation: clockwise
- R: 25
- X: 0 abs.
- Y: 0 abs.
- I: 0 abs.


Accept  
element

21. Press this softkey to confirm.

Now you can see the programmed contour in the graphics window:

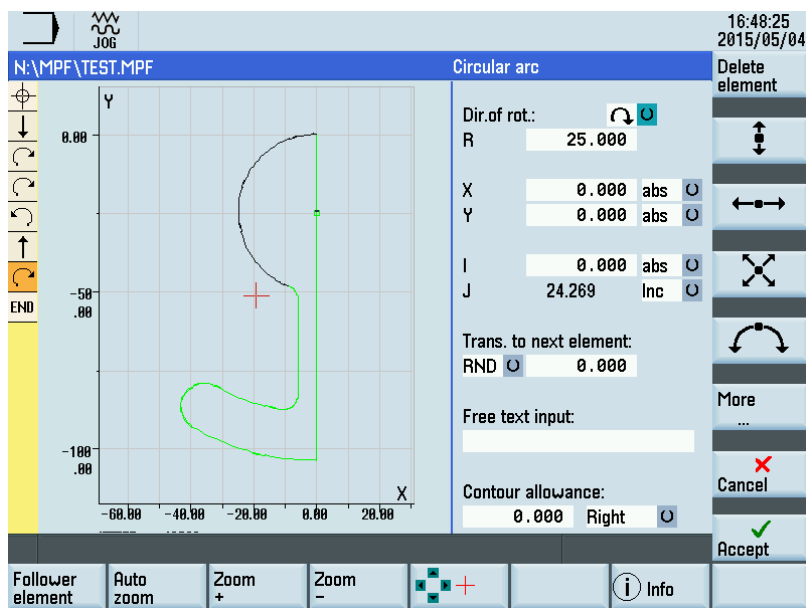

The contour is programmed in a clockwise direction.

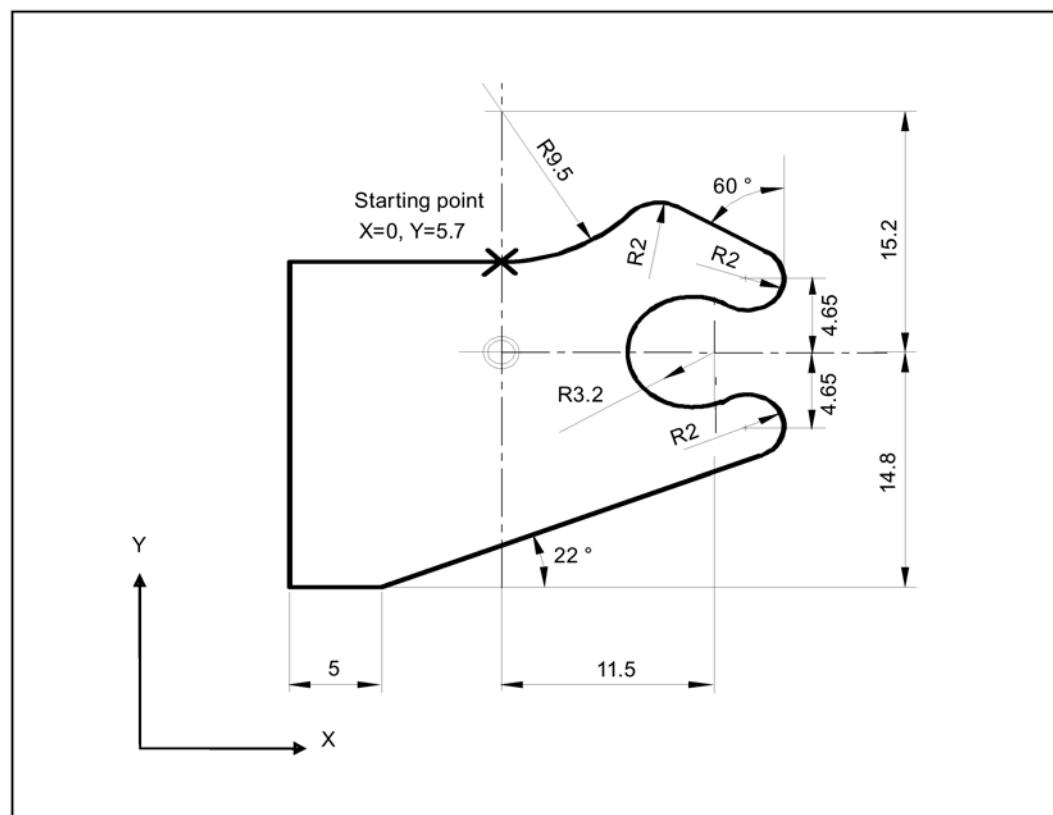

Operating sequence:



1. Select the program management operating area.



2. Enter the system program directory.



3. Select a program with cursor keys and press this key to open the program in the program editor.



4. Press this softkey to open the contour editor.



5. Define a start point with the following parameters and press this softkey to confirm.
  - Programming plane: G17
  - X: 0 abs.
  - Y: 5.7 abs.



6. Press this softkey to select a contour element of circular arc.

Dialog  
select

7. Enter the parameters for this element and press this softkey to select the desired contour characteristics.

- Direction of rotation: counter-clockwise
- R: 9.5
- I: 0 abs.
- RND: 2

Accept  
element

8. Press this softkey to confirm.



9. Press this softkey to select a contour element of straight line in any direction.

Accept  
element

10. Enter the parameters for this element and press this softkey to confirm.

- $\alpha_1$ :  $-30^\circ$



11. Press this softkey to select a contour element of circular arc.

Tangent.  
trans.

12. Enter the parameters for this element and press this softkey to select the desired contour characteristics.

- Direction of rotation: clockwise
- R: 2
- J: 4.65 abs.

Accept  
element

13. Press this softkey to confirm.



14. Press this softkey to select a contour element of circular arc.

Tangent.  
trans.

15. Enter the parameters for this element and press these softkeys to select the desired contour characteristics.

- Direction of rotation: counter-clockwise
- R: 3.2
- I: 11.5 abs.
- J: 0 abs.

Dialog  
select

16. Press this softkey to confirm.

Accept  
element



17. Press this softkey to select a contour element of circular arc.

Tangent.  
trans.

18. Enter the parameters for this element and press these softkeys to select the desired contour characteristics.

- Direction of rotation: clockwise
- R: 2
- J: -4.65 abs.

Dialog  
select

19. Press this softkey to confirm.

Accept  
element



Tangent.  
trans.

Accept  
element



Dialog  
select

Accept  
element




Accept  
element



Accept  
element

20. Press this softkey to select a contour element of straight line in any direction.
21. Enter the parameters for this element and press this softkey to select the desired contour characteristics.
  - $\alpha 1$ :  $-158^\circ$
  - Y:  $-14.8$  abs.
  - $\alpha 2$ :  $0^\circ$
22. Press this softkey to confirm.
23. Press this softkey to select a contour element of straight horizontal line.
24. Enter the parameters for this element and press this softkey to select the desired contour characteristics.
  - L: 5
25. Press this softkey to confirm.
26. Press this softkey to select a contour element of straight vertical line.
27. Enter the parameters for this element and press this softkey to confirm.
  - Y:  $5.7$  abs.
28. Press this softkey to select a contour element of straight horizontal line.
29. Enter the parameters for this element and press this softkey to confirm.
  - X:  $0$  abs.

Now you can see the programmed contour in the graphics window:

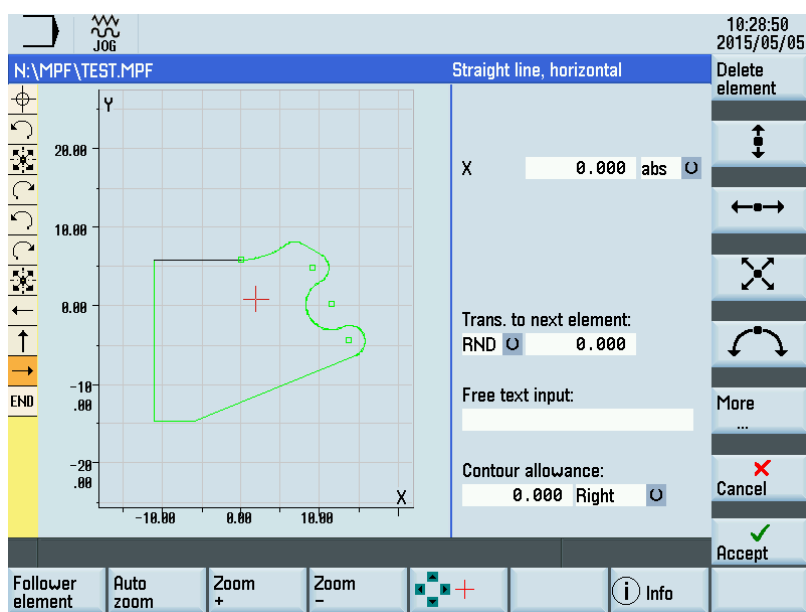

## A.9 Word structure and address

### Functionality/structure

A word is a block element and mainly constitutes a control command. The word consists of the following two parts:

- **Address characters:** generally a letter
- **Numerical value:** a sequence of digits which with certain addresses can be added by a sign put in front of the address, and a decimal point.  
A positive sign (+) can be omitted.

The following picture shows an example of the word structure.

|              |                                    |                                              |                      |
|--------------|------------------------------------|----------------------------------------------|----------------------|
|              | Word                               | Word                                         | Word                 |
|              | Address   Value                    | Address   Value                              | Address   Value      |
| Example:     | G1                                 | X -20.1                                      | F300                 |
| Explanation: | Traverse with Linear interpolation | Path or end-position for the X axis: -20.1mm | Feedrate: 300 mm/min |

### Several address characters

A word can also contain several address letters. In this case, however, the numerical value must be assigned via the intermediate character "=".

Example: **CR=5.23**

Additionally, it is also possible to call G functions using a symbolic name. For more information, see Section "List of instructions (Page 333)".

Example: **SCALE**; Enable scaling factor

### Extended address

With the following addresses, the address is extended by 1 to 4 digits to obtain a higher number of addresses. In this case, the value must be assigned using an equality sign "=".

|         |                                                              |
|---------|--------------------------------------------------------------|
| R       | Arithmetic parameters                                        |
| H       | H function                                                   |
| I, J, K | Interpolation parameters/intermediate point                  |
| M       | Special function M, affecting the spindle with other options |
| S       | Spindle speed                                                |

Examples: **R10=6.234 H5=12.1 I1=32.67 M2=5 S1=400**

## A.10 Character set

The following characters are used for programming. They are interpreted in accordance with the relevant definitions.

### Letters, digits

A, B, C, D, E, F, G, H, I, J, K, L, M, N, O, P, Q, R, S, T, U, V, W, X, Y, Z  
0, 1, 2, 3, 4, 5, 6, 7, 8, 9

No distinction is made between lowercase and uppercase letters.

## Printable special characters

|   |                              |    |                                 |
|---|------------------------------|----|---------------------------------|
| ( | Open parenthesis             | "  | Inverted commas                 |
| ) | Close parenthesis            | _  | Underscore (belongs to letters) |
| [ | Open square bracket          | .  | Decimal point                   |
| ] | Close square bracket         | ,  | Comma, separator                |
| < | less than                    | ;  | Comment start                   |
| > | greater than                 | %  | Reserved; do not use            |
| : | Main block, end of label     | &  | Reserved; do not use            |
| = | Assignment, part of equation | '  | Reserved; do not use            |
| / | skip                         | \$ | System variable identifiers     |
| * | Multiplication               | ?  | Reserved; do not use            |
| + | Addition and positive sign   | !  | Reserved; do not use            |
| - | Subtraction, minus sign      |    |                                 |

## Non-printable special characters

|               |                                |
|---------------|--------------------------------|
| LF            | End-of-block character         |
| Blank         | Separator between words; blank |
| Tab character | Reserved; do not use           |

## A.11 Block format


### Functionality

A block should contain all data required to execute a machining step.

Generally, a block consists of several **words** and is always completed with the **end-of-block character** "LF" (Linefeed). When writing a block, this character is automatically generated when pressing the linefeed key on an externally connected keyboard or pressing the following key on the PPU:



See the following block structure diagram:

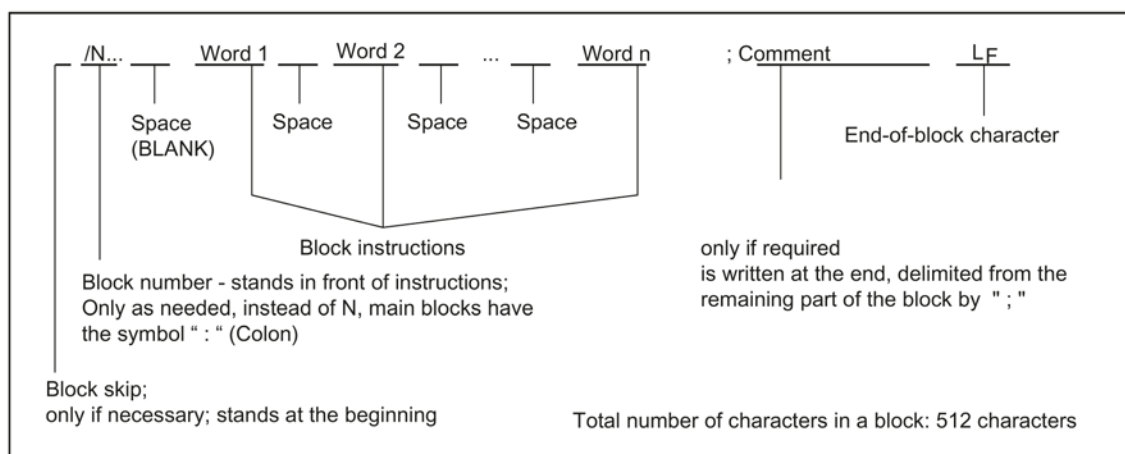

### Word order

If there are several instructions in a block, the following order is recommended:

N... G... X... Z... F... S... T... D... M... H...

### Note regarding block numbers

First select the block numbers in steps of 5 or 10. Thus, you can later insert blocks and nevertheless observe the ascending order of block numbers.

### Block skip

Blocks of a program, which are to be executed not with each program run, can be **marked** by a slash / in front of the block number.

The block skip itself is activated via **Operation** (program control: "SKP") or by the programmable controller (signal). A section can be skipped by several blocks in succession using "/".

If a block must be skipped during program execution, all program blocks marked with "/" are not executed. All instructions contained in the blocks concerned will not be considered. The program is continued with the next block without marking.

### Comment, remark

The instructions in the blocks of a program can be explained using comments (remarks). A comment always starts with a semicolon ";" and ends with end-of-block.

Comments are displayed together with the contents of the remaining block in the current block display.

### Messages

Messages are programmed in a separate block. A message is displayed in a special field and remains active until a block with a new message is executed or until the end of the program is reached. Up to **65** characters can be displayed in message texts.

A message without message text cancels a previous message.

MSG ("THIS IS THE MESSAGE TEXT")

### Programming example

```
N10 ; G&S company, order no. 12A71
N20 ; Pump part 17, drawing no.: 123 677
N30 ; Program created by H. Adam, Dept. TV 4
N40 MSG("DRAWING NO.: 123677")
:50 G54 F4.7 S220 D2 M3 ;Main block
N60 G0 G90 X100 Z200
N70 G1 Z185.6
N80 X112
/N90 X118 Z180 ; Block can be suppressed
N100 X118 Z120
N110 G0 G90 X200
N120 M2 ; End of program
```

## A.12 List of instructions

The functions marked with an asterisk (\*) are active at the start of the program in the CNC milling variant, unless otherwise they are programmed or the machine manufacturer has preserved the default settings for the "milling" technology.

| Address | Significance       | Value assignments              | Information                                                                                                                                                                                                             | Programming |
|---------|--------------------|--------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------|
| D       | Tool offset number | 0 ... 9, only integer, no sign | Contains compensation data for a particular tool T... ; D0 indicates no compensation for the tool, one tool activates 1~9 numbers, that is, one tool carries at most nine different compensation data at the same time. | D...        |
| F       | Feedrate           | 0.001 ... 99 999.999           | Path velocity of a tool/workpiece; unit: mm/min or mm/revolution depending on G94 or G95                                                                                                                                | F...        |

| Address         | Significance                                                                                                                                     | Value assignments                                             | Information                                                                                                                                                                                                                                                         | Programming                                                                                                                                                                                                                                                                                                                                                              |
|-----------------|--------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| F               | Dwell time (in block with G4)                                                                                                                    | 0.001 ... 99 999.999                                          | Dwell time in seconds                                                                                                                                                                                                                                               | G4 F...; separate block                                                                                                                                                                                                                                                                                                                                                  |
| G               | G function (preparatory function)                                                                                                                | Only integer, specified values                                | The G functions are divided into G groups. Only one G function from one group can be written in one block. A G function can either be modal (until canceled by another function from the same group), or non-modal (only effective for the block it is written in). | G...<br>or symbolic name, e.g.: CIP                                                                                                                                                                                                                                                                                                                                      |
| <b>G group:</b> |                                                                                                                                                  |                                                               |                                                                                                                                                                                                                                                                     |                                                                                                                                                                                                                                                                                                                                                                          |
| G0              | Linear interpolation at rapid traverse rate                                                                                                      | 1: Motion commands (type of interpolation), modally effective |                                                                                                                                                                                                                                                                     | G0 X... Y... Z... ; Cartesian in polar coordinates:<br>G0 AP=... RP=...<br>or with additional axis:<br>G0 AP=... RP=... Z... ; e.g.: with G17 axis Z                                                                                                                                                                                                                     |
| G1 *            | Linear interpolation at feedrate                                                                                                                 |                                                               |                                                                                                                                                                                                                                                                     | G1 X... Y... Z... F...<br>in polar coordinates:<br>G1 AP=... RP=... F...<br>or with additional axis:<br>G1 AP=... RP=... Z... F... ;<br>e.g.: with G17 axis Z                                                                                                                                                                                                            |
| G2              | Circular interpolation in clockwise direction (in conjunction with a third axis and TURN=... also helix interpolation -> see under TURN)         |                                                               |                                                                                                                                                                                                                                                                     | G2 X... Y... I... J... F... ; End point and center point<br>G2 X... Y... CR=... F... ; Radius and end point<br>G2 AR=... I... J... F... ; Aperture angle and center point<br>G2 AR=... X... Y... F... ; Aperture angle and end point in polar coordinates:<br>G2 AP=... RP=... F...<br>or with additional axis:<br>G2 AP=... RP=... Z... F... ;<br>e.g.: with G17 axis Z |
| G3              | Circular interpolation in counter-clockwise direction (in conjunction with a third axis and TURN=... also helix interpolation -> see under TURN) |                                                               |                                                                                                                                                                                                                                                                     | G3 ... ; otherwise as for G2                                                                                                                                                                                                                                                                                                                                             |
| CIP             | Circular interpolation through intermediate point                                                                                                |                                                               |                                                                                                                                                                                                                                                                     | CIP X... Y... Z... I1=... J1=...<br>K1=... F...                                                                                                                                                                                                                                                                                                                          |
| CT              | Circular interpolation; tangential transition                                                                                                    |                                                               |                                                                                                                                                                                                                                                                     | N10 ...<br>N20 CT X... Y... F... ;circle, tangential transition to the previous path segment                                                                                                                                                                                                                                                                             |
| G33             | Thread cutting, tapping with constant pitch                                                                                                      |                                                               |                                                                                                                                                                                                                                                                     | S... M... ;Spindle speed, direction G33 Z... K...; Thread drilling <b>with</b> compensating chuck, e.g. in Z axis                                                                                                                                                                                                                                                        |

| Address | Significance                        | Value assignments | Information                   | Programming                                                                                                                                                                                                                           |
|---------|-------------------------------------|-------------------|-------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| G331    | Thread interpolation                |                   |                               | N10 SPOS=... ; Spindle in position control<br>N20 G331 Z... K... S... ; tapping <b>without</b> compensating chuck e.g. in Z axis; RH or LH thread is defined via the sign of the pitch (e.g. K+):<br>+ : as with M3<br>- : as with M4 |
| G332    | Thread interpolation - retraction   |                   |                               | G332 Z... K... ; <b>Rigid tapping</b> , e.g. in Z axis, <b>retraction motion</b> ; sign of pitch as for G331                                                                                                                          |
| G4      | Dwell time                          |                   | 2: Special motions, non-modal | G4 F...; separate block, F: Time in seconds<br>or<br>G4 S.... ; separate block, S: in spindle revolutions                                                                                                                             |
| G63     | Tapping with compensating chuck     |                   |                               | G63 Z... F... S... M...                                                                                                                                                                                                               |
| G74     | Reference point approach            |                   |                               | G74 X=0 Y=0 Z=0; separate block, (machine axis identifier!)                                                                                                                                                                           |
| G75     | Fixed point approach                |                   |                               | G75 X=0 Y=0 Z=0; separate block, (machine axis identifier!)                                                                                                                                                                           |
| G147    | SAR - Approach with a straight line |                   |                               | G147 G41 DISR=... DISCL=... FAD=... F... X... Y... Z...                                                                                                                                                                               |
| G148    | SAR - Retract with a straight line  |                   |                               | G148 G40 DISR=... DISCL=... FAD=... F... X... Y... Z...                                                                                                                                                                               |
| G247    | SAR - Approach with a quadrant      |                   |                               | G247 G41 DISR=... DISCL=... FAD=... F... X... Y... Z...                                                                                                                                                                               |
| G248    | SAR - Retract with a quadrant       |                   |                               | G248 G40 DISR=... DISCL=... FAD=... F... X... Y... Z...                                                                                                                                                                               |
| G347    | SAR - Approach with a semicircle    |                   |                               | G347 G41 DISR=... DISCL=... FAD=... F... X... Y... Z...                                                                                                                                                                               |
| G348    | SAR - Retract with a semicircle     |                   |                               | G348 G40 DISR=... DISCL=... FAD=... F... X... Y... Z...                                                                                                                                                                               |
| TRANS   | Translation, programmable           |                   | 3: Write memory, non-modal    | TRANS X... Y... Z...; separate block                                                                                                                                                                                                  |
| ROT     | Rotation, programmable              |                   |                               | ROT RPL=... ; rotation in the current plane G17 to G19, separate block                                                                                                                                                                |
| SCALE   | Programmable scaling factor         |                   |                               | SCALE X... Y... Z... ; scaling factor in the direction of the specified axis, separate block                                                                                                                                          |
| MIRROR  | Programmable mirroring              |                   |                               | MIRROR X0; coordinate axis whose direction is changed, separate block                                                                                                                                                                 |
| ATRANS  | Additive translation, programming   |                   |                               | ATRANS X... Y... Z... ; separate block                                                                                                                                                                                                |
| AROT    | Additive programmable rotation      |                   |                               | AROT RPL=... ; rotation in the current plane G17 to G19, separate block                                                                                                                                                               |

| Address | Significance                                                                       | Value assignments | Information                                        | Programming                                                                                                                  |
|---------|------------------------------------------------------------------------------------|-------------------|----------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------|
| ASCALE  | Additive programmable scaling factor                                               |                   |                                                    | ASCALE X... Y... Z...; scaling factor in the direction of the specified axis, separate block                                 |
| AMIRROR | Additive programmable mirroring                                                    |                   |                                                    | AMIRROR X0 ; coordinate axis whose direction is changed, separate block                                                      |
| G110    | Pole specification relative to the last programmed setpoint position               |                   |                                                    | G110 X... Y... ; Pole specification, Cartesian, e.g.: for G17 G110 RP=... AP=... ; Pole specification, polar, separate block |
| G111    | Pole specification relative to origin of current workpiece coordinate system       |                   |                                                    | G111 X... Y... ; Pole specification, Cartesian, e.g.: for G17 G111 RP=... AP=... ; Pole specification, polar, separate block |
| G112    | Pole specification, relative to the last valid POLE                                |                   |                                                    | G112 X... Y... ; Pole specification, Cartesian, e.g.: for G17 G112 RP=... AP=... ; Pole specification, polar, separate block |
| G17 *   | X/Y plane                                                                          |                   | 6: Plane selection, modally effective              | G17 .... ; Vertical axis on this plane is tool length                                                                        |
| G18     | Z/X plane                                                                          |                   |                                                    |                                                                                                                              |
| G19     | Y/Z plane                                                                          |                   |                                                    | Compensation axis                                                                                                            |
| G40 *   | Tool radius compensation OFF                                                       |                   | 7: Tool radius compensation, modally effective     |                                                                                                                              |
| G41     | Tool radius compensation left of contour                                           |                   |                                                    |                                                                                                                              |
| G42     | Tool radius compensation right of contour                                          |                   |                                                    |                                                                                                                              |
| G500 *  | Settable work offset OFF                                                           |                   | 8: Settable work offset, modally effective         |                                                                                                                              |
| G54     | 1. Settable work offset                                                            |                   |                                                    |                                                                                                                              |
| G55     | 2. Settable work offset                                                            |                   |                                                    |                                                                                                                              |
| G56     | 3. Settable work offset                                                            |                   |                                                    |                                                                                                                              |
| G57     | 4. Settable work offset                                                            |                   |                                                    |                                                                                                                              |
| G58     | 5. Settable work offset                                                            |                   |                                                    |                                                                                                                              |
| G59     | 6. Settable work offset                                                            |                   |                                                    |                                                                                                                              |
| G53     | Non-modal skipping of the settable work offset                                     |                   | 9: Suppression of settable work offset, non-modal  |                                                                                                                              |
| G153    | Non-modal skipping of the settable work offset including base frame                |                   |                                                    |                                                                                                                              |
| G60 *   | Exact stop                                                                         |                   | 10: Approach behavior, modally effective           |                                                                                                                              |
| G64     | Continuous-path mode                                                               |                   |                                                    |                                                                                                                              |
| G62     | Corner deceleration at inside corners when tool radius offset is active (G41, G42) |                   | Only in conjunction with continuous-path mode      | G62 Z... G1                                                                                                                  |
| G9      | Non-modal exact stop                                                               |                   | 11: Exact stop, non-modal                          |                                                                                                                              |
| G601 *  | Exact stop window, fine, with G60, G9                                              |                   | 12: Exact stop window, modally effective           |                                                                                                                              |
| G602    | Exact stop window, coarse, with G60, G9                                            |                   |                                                    |                                                                                                                              |
| G621    | Corner deceleration at all corners                                                 |                   | Only in conjunction with continuous-path mode.     | G621 AIDS=...                                                                                                                |
| G70     | Inch dimension data input                                                          |                   | 13: Inch/metric dimension input, modally effective |                                                                                                                              |
| G71 *   | Metric dimension data input                                                        |                   |                                                    |                                                                                                                              |

| Address                  | Significance                                     | Value assignments                                                                                                                    | Information                                                                                            | Programming                                                       |
|--------------------------|--------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------|
| G700                     | Inch dimension data input; also for feedrate F   |                                                                                                                                      |                                                                                                        |                                                                   |
| G710                     | Metric dimension data input; also for feedrate F |                                                                                                                                      |                                                                                                        |                                                                   |
| G90 *                    | Absolute dimension data input                    |                                                                                                                                      | 14: Absolute/incremental dimension, modally effective                                                  |                                                                   |
| G91                      | Incremental dimension data input                 |                                                                                                                                      |                                                                                                        |                                                                   |
| G94 *                    | Feed F in mm/min                                 |                                                                                                                                      | 15: Feedrate/spindle, modally effective                                                                |                                                                   |
| G95                      | Feedrate F in mm/spindle revolutions             |                                                                                                                                      |                                                                                                        |                                                                   |
| CFC *                    | Feedrate override with circle ON                 |                                                                                                                                      | 16: Feed override, modally effective                                                                   |                                                                   |
| CFTCP                    | Feedrate override OFF                            |                                                                                                                                      |                                                                                                        |                                                                   |
| G450 *                   | Transition circle                                |                                                                                                                                      | 18: Behavior at corners when working with tool radius compensation, modally effective                  |                                                                   |
| G451                     | Point of intersection                            |                                                                                                                                      |                                                                                                        |                                                                   |
| BRISK *                  | Jerking path acceleration                        |                                                                                                                                      | 21: Acceleration profile, modally effective                                                            |                                                                   |
| SOFT                     | Jerk-limited path acceleration                   |                                                                                                                                      |                                                                                                        |                                                                   |
| FFWOF *                  | Feedforward control OFF                          |                                                                                                                                      | 24: Feedforward control, modally effective                                                             |                                                                   |
| FFWON                    | Feedforward control ON                           |                                                                                                                                      |                                                                                                        |                                                                   |
| EXTCALL                  | Execute external subprogram                      |                                                                                                                                      |                                                                                                        | Reload program from HMI in "Execution from external source" mode. |
| G340 *                   | Approach and retraction in space (SAR)           |                                                                                                                                      | 44: Path segmentation with SAR, modally effective                                                      |                                                                   |
| G341                     | Approach and retraction in the plane (SAR)       |                                                                                                                                      |                                                                                                        |                                                                   |
| G290 *                   | SIEMENS mode                                     |                                                                                                                                      | 47: External NC languages, modally effective                                                           |                                                                   |
| G291                     | External mode                                    |                                                                                                                                      |                                                                                                        |                                                                   |
| H<br>H0=<br>to<br>H9999= | H function                                       | $\pm 0.0000001 \dots 9999\ 9999$<br>(8 decimal places)<br>or with specification of an exponent:<br>$\pm (10^{-300} \dots 10^{+300})$ | Value transfer to the PLC; meaning defined by the machine manufacturer                                 | H0=... H9999=...<br>e.g.: H7=23.456                               |
| I                        | Interpolation parameters                         | $\pm 0.001 \dots 99\ 999.999$<br>Thread:<br>0.001 ... 2000.000                                                                       | Belongs to the X axis; meaning dependent on G2, G3 -> circle center or G33, G331, G332 -> thread pitch | See G2, G3, G33, G331 and G332                                    |
| J                        | Interpolation parameters                         | $\pm 0.001 \dots 99\ 999.999$<br>Thread:<br>0.001 ... 2000.000                                                                       | Belongs to the Y axis; otherwise, as with I                                                            | See G2, G3, G33, G331, and G332                                   |
| K                        | Interpolation parameters                         | $\pm 0.001 \dots 99\ 999.999$<br>Thread:<br>0.001 ... 2000.000                                                                       | Belongs to the Z axis; otherwise, as with I                                                            | See G2, G3, G33, G331, and G332                                   |
| I1=                      | Intermediate point for circular interpolation    | $\pm 0.001 \dots 99\ 999.999$                                                                                                        | Belongs to the X axis; specification for circular interpolation with CIP                               | See CIP                                                           |
| J1=                      | Intermediate point for circular interpolation    | $\pm 0.001 \dots 99\ 999.999$                                                                                                        | Belongs to the Y axis; specification for circular interpolation with CIP                               | See CIP                                                           |
| K1=                      | Intermediate point for circular interpolation    | $\pm 0.001 \dots 99\ 999.999$                                                                                                        | Belongs to the Z axis; specification for circular interpolation with CIP                               | See CIP                                                           |

| Address    | Significance                                            | Value assignments                     | Information                                                                                                                                                                                                                             | Programming          |
|------------|---------------------------------------------------------|---------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------|
| L          | Subroutine; name and call                               | 7 decimals; integer only, no sign     | Instead of a free name, it is also possible to select L1 ...L9999999; this also calls the subroutine (UP) in a separate block. Please note: L0001 is not always equal to L1. The name "LL6" is reserved for the tool change subroutine. | L781; separate block |
| M          | Additional function                                     | 0 ... 99 only integer, no sign        | For example, for initiating switching actions, such as "coolant ON", maximum five M functions per block.                                                                                                                                | M...                 |
| M0         | Programmed stop                                         |                                       | The machining is stopped at the end of a block containing M0; to continue, press the following key:<br>                                                |                      |
| M1         | Optional stop                                           |                                       | As with M0, but the stop is only performed if a special signal (Program control: "M01") is present.                                                                                                                                     |                      |
| M2         | End of main program with return to beginning of program |                                       | Can be found in the last block of the processing sequence                                                                                                                                                                               |                      |
| M30        | End of program (as M2)                                  |                                       | Can be found in the last block of the processing sequence                                                                                                                                                                               |                      |
| M17        | End of subroutine                                       |                                       | Can be found in the last block of the processing sequence                                                                                                                                                                               |                      |
| M3         | CW rotation of spindle                                  |                                       |                                                                                                                                                                                                                                         |                      |
| M4         | CCW rotation of spindle                                 |                                       |                                                                                                                                                                                                                                         |                      |
| M5         | Spindle stop                                            |                                       |                                                                                                                                                                                                                                         |                      |
| M6         | Tool change                                             |                                       | Only if activated with M6 via the machine control panel; otherwise, change directly using the T command                                                                                                                                 |                      |
| M40        | Automatic gear stage changeover                         |                                       |                                                                                                                                                                                                                                         |                      |
| M41 to M45 | Gear stage 1 to gear stage 5                            |                                       |                                                                                                                                                                                                                                         |                      |
| M19        | Spindle positioned at 0 degree                          |                                       |                                                                                                                                                                                                                                         |                      |
| M70        | Spindle switched to the axis mode                       |                                       |                                                                                                                                                                                                                                         |                      |
| M...       | Remaining M functions                                   |                                       | Functionality is not defined by the control system and can therefore be used by the machine manufacturer freely                                                                                                                         |                      |
| N          | Block number - subblock                                 | 0 ... 9999 9999 only integer, no sign | Can be used to identify blocks with a number; is written at the beginning of a block                                                                                                                                                    | N20 ...              |
| :          | Block number of a main block                            | 0 ... 9999 9999 only integer, no sign | Special block identification, used instead of N... ; such a block should contain all instructions for a complete subsequent machining step.                                                                                             | :20 ...              |

| Address          | Significance                     | Value assignments                                                                                                                         | Information                                                                                                                                                                                                                | Programming                                                                                      |
|------------------|----------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------|
| P                | Number of subrou-<br>tine passes | 1 ... 9999<br>only integer, no sign                                                                                                       | Is used if the subroutine is run<br>several times and is contained<br>in the same block as the call                                                                                                                        | N10 L781 P... ; separate block<br>N10 L871 P3 ; three cycles                                     |
| R0<br>to<br>R299 | Arithmetic parame-<br>ters       | $\pm 0.0000001 \dots$<br>9999 9999<br>(8 decimal places)<br>or with specification<br>of an exponent:<br>$\pm (10^{-300} \dots 10^{+300})$ |                                                                                                                                                                                                                            | R1=7.9431 R2=4<br>with specification of an expo-<br>nent:<br>R1=-1.9876EX9; R1=-1 987<br>600 000 |
|                  | Arithmetic functions             |                                                                                                                                           | In addition to the 4 basic<br>arithmetic functions using the<br>operands + - * / , there are the<br>following arithmetic functions:                                                                                        |                                                                                                  |
| SIN( )           | Sine                             | Degrees                                                                                                                                   |                                                                                                                                                                                                                            | R1=SIN(17.35)                                                                                    |
| COS()            | Cosine                           | Degrees                                                                                                                                   |                                                                                                                                                                                                                            | R2=COS(R3)                                                                                       |
| TAN()            | Tangent                          | Degrees                                                                                                                                   |                                                                                                                                                                                                                            | R4=TAN(R5)                                                                                       |
| ASIN()           | Arc sine                         |                                                                                                                                           |                                                                                                                                                                                                                            | R10=ASIN(0.35) ; R10: 20.487<br>degrees                                                          |
| ACOS()           | Arc cosine                       |                                                                                                                                           |                                                                                                                                                                                                                            | R20=ACOS(R2) ; R20: ...<br>Degrees                                                               |
| ATAN2( , )       | Arctangent2                      |                                                                                                                                           | The angle of the sum vector is<br>calculated from 2 vectors<br>standing vertically one on<br>another. The 2nd vector speci-<br>fied is always used for angle<br>reference.<br>Result in the range: -180 to<br>+180 degrees | R40=ATAN2(30.5,80.1) ; R40:<br>20.8455 degrees                                                   |
| SQRT()           | Square root                      |                                                                                                                                           |                                                                                                                                                                                                                            | R6=SQRT(R7)                                                                                      |
| POT()            | Square                           |                                                                                                                                           |                                                                                                                                                                                                                            | R12=POT(R13)                                                                                     |
| ABS()            | Absolute value                   |                                                                                                                                           |                                                                                                                                                                                                                            | R8=ABS(R9)                                                                                       |
| TRUNC()          | Truncate to integer              |                                                                                                                                           |                                                                                                                                                                                                                            | R10=TRUNC(R11)                                                                                   |
| LN()             | Natural logarithm                |                                                                                                                                           |                                                                                                                                                                                                                            | R12=LN(R9)                                                                                       |
| EXP()            | Exponential function             |                                                                                                                                           |                                                                                                                                                                                                                            | R13=EXP(R1)                                                                                      |
| RET              | Subroutine end                   |                                                                                                                                           | Used instead of M2 - to main-<br>tain the continuous-path con-<br>trol mode                                                                                                                                                | RET ; separate block                                                                             |
| S...             | Spindle speed                    | 0.001 ... 99 999.999                                                                                                                      | Unit of measurement of the<br>spindle speed rpm                                                                                                                                                                            | S...                                                                                             |
| S                | Dwell time<br>in block with G4   | 0.001 ... 99 999.999                                                                                                                      | Dwell time in spindle revolu-<br>tions                                                                                                                                                                                     | G4 S... ; separate block                                                                         |
| T                | Tool number                      | 1 ... 32 000<br>only integer, no sign                                                                                                     | The tool change can be per-<br>formed either directly using<br>the T command or only with<br>M6. This can be set in the<br>machine data.                                                                                   | T...                                                                                             |
| X                | Axis                             | $\pm 0.001 \dots 99$<br>999.999                                                                                                           | Positional data                                                                                                                                                                                                            | X...                                                                                             |
| Y                | Axis                             | $\pm 0.001 \dots 99$<br>999.999                                                                                                           | Positional data                                                                                                                                                                                                            | Y...                                                                                             |
| Z                | Axis                             | $\pm 0.001 \dots 99$<br>999.999                                                                                                           | Positional data                                                                                                                                                                                                            | Z...                                                                                             |

| Address            | Significance                                                                                | Value assignments                                                                          | Information                                                                                                                                                                                                                   | Programming                                                                                                                                                        |
|--------------------|---------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| AC                 | Absolute coordinate                                                                         | -                                                                                          | The dimension can be specified for the end or center point of a certain axis, irrespective of G91.                                                                                                                            | N10 G91 X10 Z=AC(20) ;X - incremental dimension, Z - absolute dimension                                                                                            |
| ACC[ <i>axis</i> ] | Percentage acceleration override                                                            | 1 ... 200, integer                                                                         | Acceleration override for an axis or spindle; specified as a percentage                                                                                                                                                       | N10 ACC[X]=80 ;for the X axis 80%<br>N20 ACC[S]=50;for the spindle: 50%                                                                                            |
| ACP                | Absolute coordinate; approach position in the positive direction (for rotary axis, spindle) | -                                                                                          | It is also possible to specify the dimensions for the end point of a rotary axis with ACP(...) irrespective of G90/G91; also applies to spindle positioning                                                                   | N10 A=ACP(45.3) ;approach absolute position of the A axis in the positive direction<br>N20 SPOS=ACP(33.1) ;position spindle                                        |
| ACN                | Absolute coordinate; approach position in the negative direction (for rotary axis, spindle) | -                                                                                          | It is also possible to specify the dimensions for the end point of a rotary axis with ACN(...) irrespective of G90/G91; also applies to spindle positioning                                                                   | N10 A=ACN(45.3) ;approach absolute position of the A axis in the negative direction<br>N20 SPOS=ACN(33.1) ;position spindle                                        |
| ANG                | Angle for the specification of a straight line for the contour definition                   | ±0.00001 ... 359.99999                                                                     | Specified in degrees; one possibility of specifying a straight line when using G0 or G1 if only one end-point coordinate of the plane is known or if the complete end point is known with contour ranging over several blocks | N10 G1 G17 X... Y....<br>N11 X... <b>ANG=...</b><br>or contour over several blocks:<br>N10 G1 G17 X... Y....<br>N11 <b>ANG=...</b><br>N12 X... Y... <b>ANG=...</b> |
| AP                 | Polar angle                                                                                 | 0 ... ±359.99999                                                                           | Specification in degrees, traversing in polar coordinates, definition of the pole; in addition: Polar radius RP                                                                                                               | See G0, G1, G2; G3, G110, G111, G112                                                                                                                               |
| AR                 | Aperture angle for circular interpolation                                                   | 0.00001 ... 359.99999                                                                      | Specified in degrees; one possibility of defining the circle when using G2/G3                                                                                                                                                 | See G2, G3                                                                                                                                                         |
| CALL               | Indirect cycle call                                                                         | -                                                                                          | Special form of the cycle call; no parameter transfer; the name of the cycle is stored in a variable; only intended for cycle-internal use                                                                                    | N10 CALL VARNAME ; variable name                                                                                                                                   |
| CHF                | Chamfer; general use                                                                        | 0.001 ... 99 999.999                                                                       | Inserts a chamfer of the specified <b>chamfer length</b> between two contour blocks                                                                                                                                           | N10 X... Y.... CHF=...<br>N11 X... Y...                                                                                                                            |
| CHR                | Chamfer; in the contour definition                                                          | 0.001 ... 99 999.999                                                                       | Inserts a chamfer of the specified <b>side length</b> between two contour blocks                                                                                                                                              | N10 X... Y.... CHR=...<br>N11 X... Y...                                                                                                                            |
| CR                 | Radius for circular interpolation                                                           | 0.010 ... 99 999.999<br>Negative sign - for selecting the circle: greater than semi-circle | One possibility of defining a circle when using G2/G3                                                                                                                                                                         | See G2, G3                                                                                                                                                         |
| COMPCAD            | Compressor ON: Optimum surface quality for CAD programs                                     |                                                                                            | Effective: Modal                                                                                                                                                                                                              | COMPCAD; separate block                                                                                                                                            |

| Address                                      | Significance                                             | Value assignments     | Information                                                                                                                                                                  | Programming                                                                                      |
|----------------------------------------------|----------------------------------------------------------|-----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------|
| COMPCUR<br>V                                 | Compressor ON:<br>Polynomials with<br>constant curvature |                       | Effective: Modal                                                                                                                                                             | COMPCURV; separate block                                                                         |
| COMPOF                                       | Compressor OFF                                           |                       | Effective: Modal                                                                                                                                                             | COMPOF; separate block                                                                           |
| COMPON                                       | Compressor ON                                            |                       | Effective: Modal                                                                                                                                                             | COMPON; separate block                                                                           |
| CYCLE...<br>HOLES...<br>POCKET...<br>SLOT... | Machining cycle                                          | Only specified values | Call of machining cycles requires a separate block, the provided transfer parameters must be assigned values, special cycle calls are possible with additional MCALL or CALL |                                                                                                  |
| CYCLE81                                      | Drilling, centering                                      |                       |                                                                                                                                                                              | N5 RTP=110 RFP=100 .... ;<br>Assign with values<br>N10 CYCLE81(RTP, RFP, ...);<br>separate block |
| CYCLE82                                      | Drilling, counterboring                                  |                       |                                                                                                                                                                              | N5 RTP=110 RFP=100 .... ;<br>Assign with values<br>N10 CYCLE82(RTP, RFP, ...);<br>separate block |
| CYCLE83                                      | Deep-hole drilling                                       |                       |                                                                                                                                                                              | N10 CYCLE83(110, 100, ...) ;<br>or transfer values directly;<br>separate block                   |
| CYCLE84                                      | Rigid tapping                                            |                       |                                                                                                                                                                              | N10 CYCLE84(...) ;separate<br>block                                                              |
| CYCLE840                                     | Tapping <b>with</b> compensating chuck                   |                       |                                                                                                                                                                              | N10 CYCLE840(...) ; separate<br>block                                                            |
| CYCLE85                                      | Reaming 1                                                |                       |                                                                                                                                                                              | N10 CYCLE85(...) ; separate<br>block                                                             |
| CYCLE86                                      | Boring                                                   |                       |                                                                                                                                                                              | N10 CYCLE86(...) ; separate<br>block                                                             |
| CYCLE802                                     | Arbitrary positions                                      |                       |                                                                                                                                                                              | N10 CYCLE802(...) ; separate<br>block                                                            |
| HOLES1                                       | Row of holes                                             |                       |                                                                                                                                                                              | N10 HOLES1(...) ; separate<br>block                                                              |
| HOLES2                                       | Circle of holes                                          |                       |                                                                                                                                                                              | N10 HOLES2(...) ; separate<br>block                                                              |
| SLOT1                                        | Mill slot                                                |                       |                                                                                                                                                                              | N10 SLOT1(...) ; separate<br>block                                                               |
| SLOT2                                        | Mill a circumferential slot                              |                       |                                                                                                                                                                              | N10 SLOT2(...) ; separate<br>block                                                               |
| POCKET3                                      | Rectangular pocket                                       |                       |                                                                                                                                                                              | N10 POCKET3(...) ; separate<br>block                                                             |
| POCKET4                                      | Circular pocket                                          |                       |                                                                                                                                                                              | N10 POCKET4(...) ; separate<br>block                                                             |
| CYCLE71                                      | Face milling                                             |                       |                                                                                                                                                                              | N10 CYCLE71(...) ; separate<br>block                                                             |
| CYCLE72                                      | Contour milling                                          |                       |                                                                                                                                                                              | N10 CYCLE72(...) ; separate<br>block                                                             |
| CYCLE76                                      | Milling the rectangular spigot                           |                       |                                                                                                                                                                              | N10 CYCLE76(...) ; separate<br>block                                                             |
| CYCLE77                                      | Circular spigot milling                                  |                       |                                                                                                                                                                              | N10 CYCLE77(...) ; separate<br>block                                                             |

| Address  | Significance                                                               | Value assignments | Information                                                                                                                                                | Programming                                                                                                                                |
|----------|----------------------------------------------------------------------------|-------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------|
| CYCLE90  | Thread milling                                                             |                   |                                                                                                                                                            | N10 CYCLE90(...); separate block                                                                                                           |
| LONGHOLE | Elongated hole                                                             |                   |                                                                                                                                                            | N10 LONGHOLE(...); separate block                                                                                                          |
| CYCLE832 | High speed settings                                                        |                   |                                                                                                                                                            | N10 CYCLE832(...); separate block                                                                                                          |
| DC       | Absolute coordinate; approach position directly (for rotary axis, spindle) | -                 | It is also possible to specify the dimensions for the end point of a rotary axis with DC(...) irrespective of G90/G91; also applies to spindle positioning | N10 A=DC(45.3); Approach absolute position of the A axis directly<br>N20 SPOS=DC(33.1); Position spindle                                   |
| DEF      | Definition instruction                                                     |                   | Defining a user variable of the BOOL, CHAR, INT, REAL, STRING[n] type; define directly at the beginning of the program                                     | DEF INT VARI1=24, VARI2;<br>two variables of the INT type; name defined by the user<br>DEF STRING[12]<br>VARS3="HELLO"; max. 12 characters |
| DISCL    | Approach/retraction distance of infeed motion for machining plane (SAR)    | -                 | Safety clearance for speed switchover for infeed motion; note: G340, G341                                                                                  | See G147, G148, G247, G248, G347, G348                                                                                                     |
| DISR     | Approach/retraction distance or radius (SAR)                               | -                 | G147/G148: Distance of the cutter edge from the starting or end point of the contour<br>G247, G347/G248, G348: Radius of the tool center pointpath         | See G147, G148, G247, G248, G347, G348                                                                                                     |
| FAD      | Velocity for the infeed (SAR)                                              | -                 | Speed takes effect after the safety clearance is reached for the infeed; note: G340, G341                                                                  | See G147, G148, G247, G248, G347, G348                                                                                                     |
| FRC      | Non-modal feedrate for chamfer/rounding                                    | 0, >0             | When FRC=0, feedrate F will act                                                                                                                            | For the unit, see F and G94, G95;<br>for chamfer/rounding, see CHF, CHR, RND                                                               |
| FRCM     | Modal feedrate for chamfer/rounding                                        | 0, >0             | When FRCM=0, feedrate F will act                                                                                                                           | For the unit, see F and G94, G95;<br>for rounding/modal rounding, see RND, RNDM                                                            |
| GOTOB    | GoBack instruction                                                         | -                 | A GoTo operation is performed to a block marked by a label; the jump destination is in the direction of the program start.                                 | N10 LABEL1: ...<br>...<br>N100 GOTOB LABEL1                                                                                                |
| GOTOF    | GoForward instruction                                                      | -                 | A GoTo operation is performed to a block marked by a label; the jump destination is in the direction of the end of the program.                            | N10 GOTOF LABEL2<br>...<br>N130 LABEL2: ...                                                                                                |
| IC       | Coordinate specified using incremental dimensions                          |                   | The dimension can be specified for the end or center point of a certain axis irrespective of G90.                                                          | N10 G90 X10 Z=IC(20); Z - incremental dimension, X - absolute dimension                                                                    |

| Address                                              | Significance                                                                                                              | Value assignments                                                                           | Information                                                                                                                                                                                                                                                                                                                  | Programming                                                                                                                    |
|------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------|
| IF                                                   | Jump condition                                                                                                            | -                                                                                           | If the jump condition is fulfilled, the jump to the block with <i>Label: is performed</i> ; otherwise, next instruction/block; several IF instructions per block are possible<br><b>Relational operators:</b><br>= = equal, <> not equal, > greater than, < less than, >= greater than or equal to, <= less than or equal to | N10 IF R1>5 GOTOF LABEL3 ...<br>N80 LABEL3: ...                                                                                |
| MEAS                                                 | Measuring <b>with</b> deletion of distance-to-go                                                                          | +1<br>-1                                                                                    | =+1: Measuring input 1, rising edge<br>=-1: Measuring input1, falling edge                                                                                                                                                                                                                                                   | N10 MEAS=-1 G1 X... Y... Z... F...                                                                                             |
| MEAW                                                 | Measuring <b>without</b> deletion of distance-to-go                                                                       | +1<br>-1                                                                                    | =+1: Measuring input 1, rising edge<br>=-1: Measuring input1, falling edge                                                                                                                                                                                                                                                   | N10 MEAW=-1 G1 X... Y... Z... F...                                                                                             |
| \$A_DBB[n]<br>\$A_DBW[n]<br>\$A_DBD[n]<br>\$A_DBR[n] | Data byte<br>Data word<br>Data double-word<br>Real data                                                                   |                                                                                             | Reading and writing PLC variables                                                                                                                                                                                                                                                                                            | N10 \$A_DBR[5]=16.3 ; Write Real variables; with offset position 5; (position, type and meaning are agreed between NC and PLC) |
| \$AA_MM[ax is*]                                      | Measurement result for an axis in the <b>machine coordinate system</b>                                                    | -                                                                                           | Ax is: Identifier of an axis (X, Y, Z ...) traversing when measuring                                                                                                                                                                                                                                                         | N10 R1=\$AA_MM[X]                                                                                                              |
| \$AA_MW[ax is]                                       | Measurement result for an axis in the <b>workpiece coordinate system</b>                                                  | -                                                                                           | Ax is: Identifier of an axis (X, Y, Z ...) traversing when measuring                                                                                                                                                                                                                                                         | N10 R2=\$AA_MW[X]                                                                                                              |
| \$A..._TIME                                          | Timer for runtime:<br>\$AN_SETUP_TIME<br>\$AN_POWERON_TIME<br>\$AC_OPERATING_TIME<br>\$AC_CYCLE_TIME<br>\$AC_CUTTING_TIME | 0.0 ... 10 <sup>+300</sup><br>min (value read-only)<br>min (value read-only)<br>s<br>s<br>s | System variable:<br>Time since the control system last booted<br>Time since the control system last booted normally<br>Total runtime of all NC programs<br>Runtime of the NC program (only of the selected program)<br>Tool action time                                                                                      | N10 IF \$AC_CYCLE_TIME==50.5 ...                                                                                               |
| \$AC..._PARTS                                        | Workpiece counter:<br>\$AC_TOTAL_PARTS<br>\$AC_REQUIRED_PARTS<br>\$AC_ACTUAL_PARTS<br>\$AC_SPECIAL_PARTS                  | 0 ... 999 999 999, integer                                                                  | System variable:<br>Total actual count<br>Set number of workpiece<br>Current actual count<br>Count of workpieces - specified by the user                                                                                                                                                                                     | N10 IF \$AC_ACTUAL_PARTS==15 ....                                                                                              |
| \$AC_MEA[1]                                          | Measuring task status                                                                                                     | -                                                                                           | Default condition:<br>0: Default condition, probe did not switch<br>1: Probe switched                                                                                                                                                                                                                                        | N10 IF \$AC_MEA[1]==1 GOTOF .... ; Continue program when probe has switched ...                                                |

| Address               | Significance                                           | Value assignments             | Information                                                                                                                                                                                                           | Programming                                                                                                                                                |
|-----------------------|--------------------------------------------------------|-------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------|
| \$P_TOOLNO            | Number of the active tool T                            | -                             | read-only                                                                                                                                                                                                             | N10 IF \$P_TOOLNO==12 GOTOF ....                                                                                                                           |
| \$P_TOOL              | Active D number of the active tool                     | -                             | read-only                                                                                                                                                                                                             | N10 IF \$P_TOOL==1 GOTOF ....                                                                                                                              |
| MCALL                 | Modal subprogram call                                  | -                             | The subroutine in the block containing MCALL is called automatically after each successive block containing a path motion. The call acts until the next MCALL is called. Application example: Drilling a hole pattern | N10 MCALL CYCLE82(...); Separate block, drilling cycle<br>N20 HOLES1(...); Row of holes<br>N30 MCALL; Separate block, modal call of CYCLE82(...) completed |
| MSG ()                | Signal                                                 | Max. 65 characters            | Message text in inverted commas                                                                                                                                                                                       | N10 MSG("MESSAGE TEXT"); separate block<br>...<br>N150 MSG() ; Clear previous message                                                                      |
| OFFN                  | Dimension specification                                | -                             | Only effective with the tool radius compensation G41, G42 active                                                                                                                                                      | N10 OFFN=12.4                                                                                                                                              |
| RND                   | Rounding                                               | 0.010 ... 99 999.999          | Inserts a rounding with the specified radius value tangentially between two contour blocks, special FRC= ... feed possible                                                                                            | N10 X... Y... <b>RND=4.5</b><br>N11 X... Y...                                                                                                              |
| RNDM                  | Modal rounding                                         | 0.010 ... 99 999.999<br><br>0 | <ul style="list-style-type: none"> <li>Inserts roundings with the specified radius value tangentially at the following contour corners; special feedrate possible: FRCM= ...</li> <li>Modal rounding OFF</li> </ul>   | N10 X... Y... RNDM=.7.3; modal rounding ON<br>N11 X... Y...<br>....<br>N100 <b>RNDM=.0</b> ; modal rounding OFF                                            |
| RP                    | Polar radius                                           | 0.001 ... 99 999.999          | Traversing in polar coordinates, pole specification; in addition: Polar angle AP                                                                                                                                      | See G0, G1, G2; G3, G110, G111, G112                                                                                                                       |
| RPL                   | Angle of rotation with ROT, AROT                       | ±0.00001 ... 359.9999         | Specification in degrees; angle for a programmable rotation in the current plane G17 to G19                                                                                                                           | See ROT, AROT                                                                                                                                              |
| SET( , , , )<br>REP() | Set values for the variable fields                     |                               | SET: Various values, from the specified element up to: according to the number of values<br>REP: the same value, from the specified element up to the end of the field                                                | DEF REAL<br>VAR2[12]=REP(4.5) ; all elements value 4.5<br>N10 R10=SET(1.1,2.3,4.4) ;<br>R10=1.1, R11=2.3, R4=4.4                                           |
| SF                    | Thread starting point when using G33                   | 0.001 ... 359.999             | Specified in degrees; the thread starting point with G33 will be offset by the specified value (not applicable for tapping)                                                                                           | See G33                                                                                                                                                    |
| SPI(n)                | Converts the spindle number n into the axis identifier |                               | n =1,<br>axis identifier: e.g. "SP1" or "C"                                                                                                                                                                           |                                                                                                                                                            |

| Address   | Significance                                                | Value assignments                                                                       | Information                                                                                                                                                            | Programming                                                                                                         |
|-----------|-------------------------------------------------------------|-----------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------|
| SPOS      | Spindle position                                            | 0.0000 ... 359.9999<br>with incremental specification (IC):<br>±0.001 ... 99<br>999.999 | Specified in degrees; the spindle stops at the specified position (to achieve this, the spindle must provide the appropriate technical prerequisites: position control | N10 SPOS=....<br>N10 SPOS=ACP(...)<br>N10 SPOS=ACN(...)<br>N10 SPOS=IC(...)<br>N10 SPOS=DC(...)                     |
| STOPFIFO  | Stops the fast machining step                               | -                                                                                       | Special function; filling of the buffer memory until STARTFIFO, "Buffer memory full" or "End of program" is detected.                                                  | STOPFIFO; separate block, start of filling<br>N10 X...<br>N20 X...                                                  |
| STARTFIFO | Start of fast machining step                                | -                                                                                       | Special function; the buffer memory is filled at the same time.                                                                                                        | N30 X...<br>STARTFIFO ;separate block, end of filling                                                               |
| STOPRE    | Preprocessing stop                                          | -                                                                                       | Special function; the next block is only decoded if the block before STOPRE is completed.                                                                              | STOPRE ; separate block                                                                                             |
| TURN      | Number of additional circle passes with helix interpolation | 0 ... 999                                                                               | In conjunction with circular interpolation G2/G3 in a plane G17 to G19 and infeed motion of the axis vertical to this plane                                            | N10 G0 G17 X20 Y5 Z3<br>N20 G1 Z-5 F50<br>N30 G3 X20 Y5 Z-20 I0 J7.5<br><b>TURN=2</b> ; total of three full circles |
| TRACYL    | Milling of the peripheral surface                           |                                                                                         | Kinematic transformation (available only if configured accordingly)                                                                                                    | TRACYL(20.4); Separate block; Cylinder diameter: 20.4 mm<br>TRACYL(20.4,1) ; also possible                          |
| TRAFOOF   | Disable TRACYL                                              |                                                                                         | Disables kinematic transformation                                                                                                                                      | TRAFOOF ; separate block                                                                                            |
| TRAILON   | Coupled motion ON                                           |                                                                                         | Activates and defines a coupled axis group                                                                                                                             | TRAILON(W,X,1) ; separate block; coupled-motion axis: W, leading axis: X, coupling factor: 1                        |
| TRAILOF   | Coupled motion OFF                                          |                                                                                         | Deactivates a coupled axis group                                                                                                                                       | TRAILOF(W,X) ; separate block                                                                                       |

## Trademarks

All names identified by ® are registered trademarks of Siemens AG. The remaining trademarks in this publication may be trademarks whose use by third parties for their own purposes could violate the rights of the owner.

## Disclaimer of Liability

We have reviewed the contents of this publication to ensure consistency with the hardware and software described. Since variance cannot be precluded entirely, we cannot guarantee full consistency. However, the information in this publication is reviewed regularly and any necessary corrections are included in subsequent editions.

Siemens AG  
Division Digital Factory  
Postfach 48 48  
90026 NÜRNBERG  
GERMANY

Programming and Operating Manual (Milling)  
6FC5398-4DP10-0BA7, 07/2018