

SINUMERIK

SINUMERIK 828D, SINAMICS S120 Alarms

Diagnostics Manual

Introduction	1
Fundamental safety instructions	2
Explanation of the alarms	3
NC alarms	4
Cycle alarms	5
HMI alarms	6
SINAMICS alarms	7
I/O alarms	8
PLC alarms	9
System responses	10
Stop conditions	11
Appendix	A

Valid for
control system
SINUMERIK 828D
Software
CNC software, version 4.95
SINAMICS S120, Version 5.2 SP3

07/2021
6FC5398-8BP40-6BA2

Legal information

Warning notice system

This manual contains notices you have to observe in order to ensure your personal safety, as well as to prevent damage to property. The notices referring to your personal safety are highlighted in the manual by a safety alert symbol, notices referring only to property damage have no safety alert symbol. These notices shown below are graded according to the degree of danger.

DANGER

indicates that death or severe personal injury will result if proper precautions are not taken.
--

WARNING
--

indicates that death or severe personal injury may result if proper precautions are not taken.

CAUTION
--

indicates that minor personal injury can result if proper precautions are not taken.
--

NOTICE

indicates that property damage can result if proper precautions are not taken.
--

If more than one degree of danger is present, the warning notice representing the highest degree of danger will be used. A notice warning of injury to persons with a safety alert symbol may also include a warning relating to property damage.

Qualified Personnel

The product/system described in this documentation may be operated only by **personnel qualified** for the specific task in accordance with the relevant documentation, in particular its warning notices and safety instructions. Qualified personnel are those who, based on their training and experience, are capable of identifying risks and avoiding potential hazards when working with these products/systems.

Proper use of Siemens products

Note the following:

WARNING
--

Siemens products may only be used for the applications described in the catalog and in the relevant technical documentation. If products and components from other manufacturers are used, these must be recommended or approved by Siemens. Proper transport, storage, installation, assembly, commissioning, operation and maintenance are required to ensure that the products operate safely and without any problems. The permissible ambient conditions must be complied with. The information in the relevant documentation must be observed.
--

Trademarks

All names identified by ® are registered trademarks of Siemens AG. The remaining trademarks in this publication may be trademarks whose use by third parties for their own purposes could violate the rights of the owner.

Disclaimer of Liability

We have reviewed the contents of this publication to ensure consistency with the hardware and software described. Since variance cannot be precluded entirely, we cannot guarantee full consistency. However, the information in this publication is reviewed regularly and any necessary corrections are included in subsequent editions.

Table of contents

1	Introduction	5
1.1	About SINUMERIK	5
1.2	About this documentation	6
1.3	Documentation on the internet	8
1.3.1	Documentation overview SINUMERIK 828D	8
1.3.2	Documentation overview SINUMERIK operator components	8
1.4	Feedback on the technical documentation	10
1.5	mySupport documentation	11
1.6	Service and Support.....	12
1.7	Important product information	14
2	Fundamental safety instructions.....	15
2.1	General safety instructions.....	15
2.2	Warranty and liability for application examples	16
2.3	Security information	17
3	Explanation of the alarms.....	19
3.1	Structure of alarm descriptions.....	19
3.2	Alarm number ranges	23
4	NC alarms.....	25
5	Cycle alarms.....	447
6	HMI alarms.....	615
7	SINAMICS alarms	625
8	I/O alarms.....	1237
9	PLC alarms.....	1249
10	System responses	1257
10.1	System reactions to SINUMERIK alarms.....	1257
10.2	Cancel criteria for alarms.....	1259
10.3	System reactions for SINAMICS alarms.....	1260
11	Stop conditions	1265
A	Appendix.....	1275
A.1	List of abbreviations.....	1275
	Index	1281

Introduction

1.1 About SINUMERIK

From simple, standardized CNC machines to premium modular machine designs – the SINUMERIK CNCs offer the right solution for all machine concepts. Whether for individual parts or mass production, simple or complex workpieces – SINUMERIK is the highly dynamic automation solution, integrated for all areas of production. From prototype construction and tool design to mold making, all the way to large-scale series production.

Visit our website for more information SINUMERIK (<https://www.siemens.com/sinumerik>).

1.2 About this documentation

Target group

This publication is intended for:

- Project engineers
- Commissioning engineers
- Machine operator
- Service and maintenance personnel

Purpose

The Diagnostics Manual refers to the alarms / messages from the NC area, HMI, PLC and SINAMICS. It should be used as a reference manual and allows operators at the machine tool:

- To correctly assess special situations when operating the machine.
- To understand the response of the system to the special situation.
- To utilize the options for continued operation following the special situation.
- To follow references to other documentation containing further details.

Benefits

The Diagnostics Manual enables the intended target group to evaluate error and fault indications and to respond accordingly.

With the help of the Diagnostics Manual, the target group has an overview of the various diagnostic options and diagnostic tools.

Standard scope

This documentation only describes the functionality of the standard version. This may differ from the scope of the functionality of the system that is actually supplied. Please refer to the ordering documentation only for the functionality of the supplied drive system.

It may be possible to execute other functions in the system which are not described in this documentation. This does not, however, represent an obligation to supply such functions with a new control or when servicing.

For reasons of clarity, this documentation cannot include all of the detailed information on all product types. Further, this documentation cannot take into consideration every conceivable type of installation, operation and service/maintenance.

The machine manufacturer must document any additions or modifications they make to the product themselves.

Websites of third-party companies

This document may contain hyperlinks to third-party websites. Siemens is not responsible for and shall not be liable for these websites and their content. Siemens has no control over the information which appears on these websites and is not responsible for the content and information provided there. The user bears the risk for their use.

1.3 Documentation on the internet

1.3.1 Documentation overview SINUMERIK 828D

Comprehensive documentation about the functions provided in SINUMERIK 828D Version 4.8 SP4 and higher is provided in the 828D documentation overview (<https://support.industry.siemens.com/cs/ww/en/view/109766724>).



You can display documents or download them in PDF and HTML5 format.

The documentation is divided into the following categories:

- User: Operating
- User: Programming
- Manufacturer/Service: Configuring
- Manufacturer/Service: Commissioning
- Manufacturer/Service: Functions
- Manufacturer/Service: Safety Integrated
- SINUMERIK Integrate/MindApp
- Info & Training

1.3.2 Documentation overview SINUMERIK operator components

Comprehensive documentation about the SINUMERIK operator components is provided in the Documentation overview SINUMERIK operator components (<https://support.industry.siemens.com/cs/document/109783841/technische-dokumentation-zu-sinumerik-bedienkomponenten?dti=0&lc=en-WW>).

You can display documents or download them in PDF and HTML5 format.

The documentation is divided into the following categories:

- Operator Panels
- Machine control panels

- Machine Pushbutton Panel
- Handheld Unit/Mini handheld devices
- Further operator components

An overview of the most important documents, entries and links to SINUMERIK is provided at SINUMERIK Overview - Topic Page (<https://support.industry.siemens.com/cs/document/109766201/sinumerik-an-overview-of-the-most-important-documents-and-links?dti=0&lc=en-WW>).


1.4 Feedback on the technical documentation

If you have any questions, suggestions or corrections regarding the technical documentation which is published in the Siemens Industry Online Support, use the link "Send feedback" link which appears at the end of the entry.

1.5 mySupport documentation

With the "mySupport documentation" web-based system you can compile your own individual documentation based on Siemens content, and adapt it for your own machine documentation.

To start the application, click on the "My Documentation" tile on the mySupport homepage (<https://support.industry.siemens.com/cs/ww/en/my>):

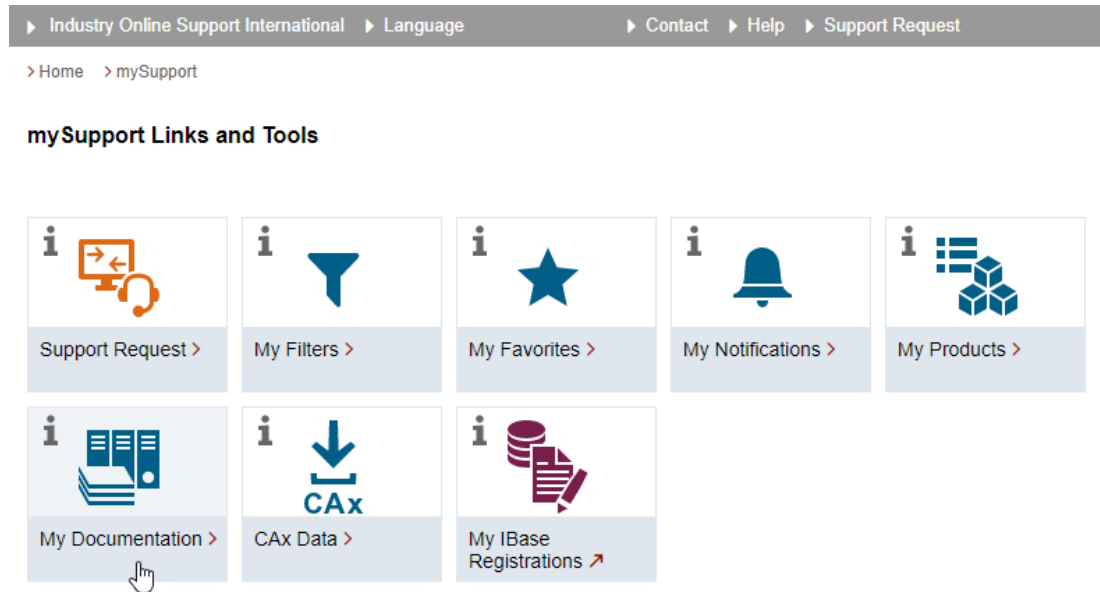

The configured manual can be exported in RTF, PDF or XML format.

Note

Siemens content that supports the mySupport documentation application can be identified by the presence of the "Configure" link.

1.6 Service and Support

Product support

You can find more information about products on the internet:

Product support (<https://support.industry.siemens.com/cs/ww/en/>)

The following is provided at this address:

- Up-to-date product information (product announcements)
- FAQs (frequently asked questions)
- Manuals
- Downloads
- Newsletters with the latest information about your products
- Global forum for information and best practice sharing between users and specialists
- Local contact persons via our Contacts at Siemens database (→ "Contact")
- Information about field services, repairs, spare parts, and much more (→ "Field Service")

Technical support

Country-specific telephone numbers for technical support are provided on the internet at address (<https://support.industry.siemens.com/cs/ww/en/sc/4868>) in the "Contact" area.

If you have any technical questions, please use the online form in the "Support Request" area.

Training

You can find information on SITRAIN at the following address (<https://www.siemens.com/sitrain>).

SITRAIN offers training courses for automation and drives products, systems and solutions from Siemens.

Siemens support on the go





With the award-winning "Siemens Industry Online Support" app, you can access more than 300,000 documents for Siemens Industry products – any time and from anywhere. The app can support you in areas including:

- Resolving problems when implementing a project
- Troubleshooting when faults develop
- Expanding a system or planning a new system

Furthermore, you have access to the Technical Forum and other articles from our experts:

- FAQs
- Application examples
- Manuals
- Certificates
- Product announcements and much more

The "Siemens Industry Online Support" app is available for Apple iOS and Android.

Data matrix code on the nameplate

The data matrix code on the nameplate contains the specific device data. This code can be read with a smartphone and technical information about the device displayed via the "Industry Online Support" mobile app.

1.7 Important product information

Using OpenSSL

This product can contain the following software:

- Software developed by the OpenSSL project for use in the OpenSSL toolkit
- Cryptographic software created by Eric Young.
- Software developed by Eric Young

You can find more information on the internet:

- OpenSSL (<https://www.openssl.org>)
- Cryptsoft (<https://www.cryptsoft.com>)

Compliance with the General Data Protection Regulation

Siemens observes standard data protection principles, in particular the data minimization rules (privacy by design).

For this product, this means:

The product does not process or store any personal data, only technical function data (e.g. time stamps). If the user links this data with other data (e.g. shift plans) or if he/she stores person-related data on the same data medium (e.g. hard disk), thus personalizing this data, he/she must ensure compliance with the applicable data protection stipulations.

Fundamental safety instructions

2.1 General safety instructions



WARNING

Danger to life if the safety instructions and residual risks are not observed

If the safety instructions and residual risks in the associated hardware documentation are not observed, accidents involving severe injuries or death can occur.

- Observe the safety instructions given in the hardware documentation.
- Consider the residual risks for the risk evaluation.



WARNING

Malfunctions of the machine as a result of incorrect or changed parameter settings

As a result of incorrect or changed parameterization, machines can malfunction, which in turn can lead to injuries or death.

- Protect the parameterization against unauthorized access.
- Handle possible malfunctions by taking suitable measures, e.g. emergency stop or emergency off.

2.2 Warranty and liability for application examples

Application examples are not binding and do not claim to be complete regarding configuration, equipment or any eventuality which may arise. Application examples do not represent specific customer solutions, but are only intended to provide support for typical tasks.

As the user you yourself are responsible for ensuring that the products described are operated correctly. Application examples do not relieve you of your responsibility for safe handling when using, installing, operating and maintaining the equipment.

2.3 Security information

Siemens provides products and solutions with industrial security functions that support the secure operation of plants, systems, machines and networks.

In order to protect plants, systems, machines and networks against cyber threats, it is necessary to implement – and continuously maintain – a holistic, state-of-the-art industrial security concept. Siemens' products and solutions constitute one element of such a concept.

Customers are responsible for preventing unauthorized access to their plants, systems, machines and networks. Such systems, machines and components should only be connected to an enterprise network or the internet if and to the extent such a connection is necessary and only when appropriate security measures (e.g. firewalls and/or network segmentation) are in place.

For additional information on industrial security measures that may be implemented, please visit

<https://www.siemens.com/industrialsecurity> (<https://www.siemens.com/industrialsecurity>).

Siemens' products and solutions undergo continuous development to make them more secure. Siemens strongly recommends that product updates are applied as soon as they are available and that the latest product versions are used. Use of product versions that are no longer supported, and failure to apply the latest updates may increase customer's exposure to cyber threats.

To stay informed about product updates, subscribe to the Siemens Industrial Security RSS Feed under

<https://www.siemens.com/industrialsecurity> (<https://new.siemens.com/global/en/products/services/cert.html#Subscriptions>).

Further information is provided on the Internet:

Industrial Security Configuration Manual (<https://support.industry.siemens.com/cs/ww/en/view/108862708>)



WARNING

Unsafe operating states resulting from software manipulation

Software manipulations, e.g. viruses, Trojans, or worms, can cause unsafe operating states in your system that may lead to death, serious injury, and property damage.

- Keep the software up to date.
- Incorporate the automation and drive components into a holistic, state-of-the-art industrial security concept for the installation or machine.
- Make sure that you include all installed products into the holistic industrial security concept.
- Protect files stored on exchangeable storage media from malicious software by with suitable protection measures, e.g. virus scanners.
- On completion of commissioning, check all security-related settings.

Explanation of the alarms

3.1 Structure of alarm descriptions

Overview of alarms

You can find descriptions of the alarms in chapters:

- NC alarms (Page 25)
- Cycle alarms (Page 447)
- HMI alarms (Page 615)
- SINAMICS alarms (Page 625)
- I/O alarms (Page 1237)
- PLC alarms (Page 1249)

In each chapter, the alarm descriptions are sorted according to ascending alarm number. There are gaps in the sequence.

Structure of the SINUMERIK alarm descriptions

The descriptions of the alarms have the following layout:

<Alarm No.> <Alarm text>

Explanation:

Reaction:

Help:

**Continue
program:**

Each alarm is uniquely identified using the <Alarm number> and the <Alarm text>.

The description of the alarms is classified according to the following categories:

- Explanation
- Response
See Chapter: System reactions to SINUMERIK alarms (Page 1257)
- Remedy
See Chapter: Cancel criteria for alarms (Page 1259)
- Program continuation
See Chapter: Cancel criteria for alarms (Page 1259)

SINAMICS alarms

The faults and states detected by the individual components of the drive system are flagged using alarms. These SINAMICS alarms are categorized into faults and alarms.

The differences between faults and alarms are as follows:

Fault	What happens when a fault occurs? • The appropriate fault response is initiated. • Status signal ZSW1.3 is set. • The fault is entered in the fault buffer. How are faults resolved? • Remove the cause of the fault • Acknowledge the fault
Alarm	What happens when an alarm occurs? • Status signal ZSW1.7 is set. • The alarm is entered into the alarm buffer. How are alarms resolved? • Alarms acknowledge themselves. When the cause has been removed, the alarms reset themselves automatically.

Structure of SINAMICS alarm descriptions

The descriptions of the SINAMICS alarms have the following layout:

<Alarm No.> <Location data> <Alarm text>

Message value:

Drive object:

Reaction:

Acknowledgment:

Cause:

Help:

Each alarm is uniquely identified using the <Alarm number> and the <Alarm text>.

The <Location data> is optional display information. Location data can include:

- Axis name and drive number
OR
- Bus and slave number of the PROFINET or PROFIBUS DP component affected

The place holder <Location data> is kept in the alarm description for this optional information.

The description of the SINAMICS alarms is classified according to the following categories:

- **Message value**
The information provided under the message value tells you about the composition of the fault/alarm value.
Example:
Message value: Component number: %1, cause: %2
This fault value or alarm value contains information about the component number and cause. The entries %1 and %2 are place holders, which are filled appropriately in online operation with the commissioning software.
- **Drive object**
For each alarm (fault/alarm) it is specified in which drive object this message can be found. A message can belong to either one, several or all drive objects.
- **Response**
Specifies the default response in the event of a fault.
- **Acknowledgment**
Specifies the default method of acknowledging the fault/alarm after the cause has been removed.
- **Cause**
Describes the possible causes. For the cause of the alarm, the fault/alarm value is essentially prepared in text form.
- **Remedy**
Describes the possible remedies.

A detailed description of the fault responses and acknowledgment can be found in Chapter: System reactions for SINAMICS alarms (Page 1260).

References

You can find additional information about SINAMICS messages in the following manual:
SINAMICS S120/S150 List Manual.

Syntax:

The syntax of the parameter messages can be derived as follows:

In the diagnostic manual, the messages initiated by SINAMICS always start with a "2" followed by a 5-digit number.

In the SINAMICS S120/S150 List Manual, the messages begin with a letter, followed by a 5-digit number:

- "F" (Fault)
- "A" (Alarm)
- "N" (No Report)
- "C" (Safety message)

If you require further information on the alarms, you can find a description in the SINAMICS List Manual by replacing the first number "2" of the message number with the letter "F", "A", "N", or "C".

3.1 Structure of alarm descriptions

Example:

You can find a description of alarm **207016** in the SINAMICS S120/S150 List Manual under fault **F07016**.

You can find a description of alarm **201330** in the SINAMICS S120/S150 List Manual under fault **A01330**.

Synchronization of time and date

Note

Synchronization of time

The SINAMICS drives have no real-time clock. The time of day and date of the SINAMICS clock are synchronized in a 10-second cycle with the SINUMERIK real-time clock.

The result is that after a change of the date and/or the clock of the SINUMERIK real-time clock up to 10 seconds collapses until these changes have been synchronized with the SINAMICS drives.

If in this up period of up to 10 seconds SINAMICS messages occur (number range 200000 - 299999), this SINAMICS messages still receive the outdated date/time stamp. The SINUMERIK alarms (alarm numbers < 200000 and > 300000) triggered as a result of the SINAMICS messages, on the other hand, already receive the new date/ time stamp.

3.2 Alarm number ranges

The following tables show an overview of all reserved number ranges for alarms/messages.

Table 3-1 System error

001.000 - 001.199	System error	The following alarms are system errors: If a system error occurs, contact the Technical Support,
-------------------	--------------	---

Table 3-2 NC alarms/messages

000.000 - 009.999	General alarms	
010.000 - 019.999	Channel alarms	
020.000 - 029.999	Axis / spindle alarms	
	027.000 - 027.999	Alarms for Safety Integrated
030.000 - 099.999	Functional alarms	
	040.000 - 059.999	Reserved
	060.000 - 064.999	Siemens cycle alarms
	065.000 - 069.999	User cycle alarms
	070.000 - 079.999	Compile cycle alarms - Manufacturer and OEM
	080.000 - 084.999	Message texts for SIEMENS cycles
	085.000 - 089.999	Message texts for user cycles
	090.000 - 099.999	Reserved
	100.000 - 129.999	System
	130.000 - 139.000	OEM
	140.000 - 199.999	Reserved

Table 3-3 SINAMICS alarms (faults/alarms)

201.000 - 203.999	Control Unit, closed-loop control
204.000 - 204.999	Reserved
205.000 - 205.999	Power unit
206.000 - 206.899	Infeed
206.900 - 206.999	Brake control modules
207.000 - 207.999	Drive
208.000 - 208.999	Option Board
209.000 - 212.999	Reserved
213.000 - 213.020	Licensing
213.021 - 213.099	Reserved
213.100 - 213.102	Know-how protection
213.103 - 219.999	Reserved
220.000 - 229.999	OEM
230.000 - 230.999	DRIVE-CLiQ component power unit
231.000 - 231.999	DRIVE-CLiQ component encoder 1

3.2 Alarm number ranges

232.000 - 232.999	DRIVE-CLiQ component encoder 2 Note: Faults that occur are automatically output as an alarm if the encoder is parameterized as a direct measuring system and does not intervene in the motor control.
233.000 - 233.999	DRIVE-CLiQ component encoder 3 Note: Faults that occur are automatically output as an alarm if the encoder is parameterized as a direct measuring system and does not intervene in the motor control.
234.000 - 234.999	Voltage Sensing Module (VSM)
235.000 - 235.199	Terminal Module 54F (TM54F)
235.200 - 235.999	Terminal Module 31 (TM31)
236.000 - 236.999	DRIVE-CLiQ Hub Module
237.000 - 237.999	High-frequency Damping Module
240.000 - 240.999	Controller Extension 32 (CX32)
241.000 - 248.999	Reserved
249.000 - 249.999	SINAMICS GM/SM/GL
250.000 - 250.499	Communication Board (COMM BOARD)
250.500 - 259.999	OEM Siemens
260.000 - 265.535	SINAMICS DC MASTER (DC closed-loop control)

Table 3-4 I/O alarms

300.000 - 399.999	I/O alarms
-------------------	------------

Table 3-5 PLC alarms / messages

400.000 - 400.999	General PLC alarms	Alarms and messages are generated by the OEM.
700.000 - 700.247	User alarms	
701.000 - 701.999	Extended user alarms	

NC alarms

0 No (more) alarm(s) present

Explanation:	If the communication (variable service) requests more alarms than currently available in the alarm list, this alarm is communicated as an end-of-file indication.
Reaction:	No alarm reaction.
Remedy:	--
Programm continuation:	Internal

1000 System error %1 %2 %3 %4

Parameters:	%1 = System error number %2 = generic parameter %3 = generic parameter %4 = generic parameter
Explanation:	With this alarm, internal alarm states are displayed that, in conjunction with the transferred error number, provide information on the cause and location of the error.
Reaction:	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	If you experience such a system error, please contact Technical Support. www.siemens.com/sinumerik/help Please supply the following information to ensure quick processing: - Alarm number together with alarm text - Description of the operation/mode before the alarm message - Generate log files using the key combination: <Ctrl> + <Alt> + <D>
Programm continuation:	Switch control OFF - ON.

1001 System error %1 %2 %3 %4

Parameters:	%1 = System error number %2 = generic parameter %3 = generic parameter %4 = generic parameter
Explanation:	With this alarm, internal alarm states are displayed that, in conjunction with the transferred error number, provide information on the cause and location of the error.
Reaction:	Mode group not ready. Channel not ready. Interface signals are set. Alarm display.

Remedy:	If you experience such a system error, please contact Technical Support. www.siemens.com/sinumerik/help Please supply the following information to ensure quick processing: - Alarm number together with alarm text - Description of the operation/mode before the alarm message - Generate log files using the key combination: <Ctrl> + <Alt> + <D>
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

1002	System error %1 %2 %3 %4
Parameters:	%1 = System error number %2 = Reference to error location %3 = generic parameter %4 = generic parameter
Explanation:	With this alarm, internal alarm states are displayed that, in conjunction with the transferred error number, provide information on the cause and location of the error.
Reaction:	Alarm display.
Remedy:	If you experience such a system error, please contact Technical Support. www.siemens.com/sinumerik/help Please supply the following information to ensure quick processing: - Alarm number together with alarm text - Description of the operation/mode before the alarm message - Generate log files using the key combination: <Ctrl> + <Alt> + <D>
Programm continuation:	Clear alarm with the Delete key or NC START.

1004	Alarm reaction to NCK alarm incorrectly configured
Parameters:	%1 = Incorrect alarm number
Explanation:	The alarm reaction configured by the operating system or the compile cycles manufacturer is incorrect.
Reaction:	NC not ready. Channel not ready. Interface signals are set. Alarm display.
Remedy:	If you experience such a system error, please contact Technical Support. www.siemens.com/sinumerik/help Please supply the following information to ensure quick processing: - Alarm number together with alarm text - Description of the operation/mode before the alarm message - Log files, which you generate with the key combination <Ctrl> + <Alt> + <D>
Programm continuation:	Switch control OFF - ON.

1005	Operating system error %1 parameter %2 %3 %4
Parameters:	%1 = Operating system error number %2 = Operating system error parameter 1 %3 = Operating system error parameter 2 %4 = Operating system error parameter 3
Explanation:	This alarm indicates that the operating system has detected a serious error.

Reaction:	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	If you experience such a system error, please contact Technical Support. www.siemens.com/sinumerik/help Please supply the following information to ensure quick processing: - Alarm number together with alarm text - Description of the operation/mode before the alarm message - Generate log files using the key combination: <Ctrl> + <Alt> + <D>
Programm continuation:	Switch control OFF - ON.

1010 [Channel %1:] System error %2 action '%3<ALNX>'

Parameters:	%1 = Channel number %2 = System error number %3 = Action number/action name
Explanation:	With this alarm, internal alarm states are displayed that, in conjunction with the transferred error number, provide information on the cause and location of the error.
Reaction:	NC not ready. Interpreter stop Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	If you experience such a system error, please contact Technical Support. www.siemens.com/sinumerik/help Please supply the following information to ensure quick processing: - Alarm number together with alarm text - Description of the operation/mode before the alarm message - Generate log files using the key combination: <Ctrl> + <Alt> + <D>
Programm continuation:	Switch control OFF - ON.

1011 [Channel %1:] %3 %4 system error %2

Parameters:	%1 = Channel number %2 = System error number %3 = Optional parameter: Block number, label %4 = Optional parameter: Action number,
Explanation:	With this alarm, internal alarm states are displayed that, in conjunction with the transferred error number, provide information on the cause and location of the error.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.

Remedy: If you experience such a system error, please contact Technical Support.
www.siemens.com/sinumerik/help

Please supply the following information to ensure quick processing:

- Alarm number together with alarm text
- Description of the operation/mode before the alarm message
- Generate log files using the key combination: <Ctrl> + <Alt> + <D>

Programm continuation: Clear alarm with the RESET key. Restart part program

1012 [Channel %1:] System error %2 %3 %4

Parameters: %1 = Channel number
%2 = System error number
%3 = Parameter1
%4 = Parameter2

Explanation: With this alarm, internal alarm states are displayed that, in conjunction with the transferred error number, provide information on the cause and location of the error.

Reaction: Alarm display.

Remedy: If you experience such a system error, please contact Technical Support.
www.siemens.com/sinumerik/help

Please supply the following information to ensure quick processing:

- Alarm number together with alarm text
- Description of the operation/mode before the alarm message
- Generate log files using the key combination: <Ctrl> + <Alt> + <D>

Programm continuation: Clear alarm with the Delete key or NC START.

1013 [Channel %1:] System error %2 %3 %4

Parameters: %1 = Channel number
%2 = System error number
%3 = generic parameter
%4 = generic parameter

Explanation: With this alarm, internal alarm states are displayed that, in conjunction with the transferred error number, provide information on the cause and location of the error.

Reaction: Channel not ready.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: If you experience such a system error, please contact Technical Support.
www.siemens.com/sinumerik/help

Please supply the following information to ensure quick processing:

- Alarm number together with alarm text
- Description of the operation/mode before the alarm message
- Generate log files using the key combination: <Ctrl> + <Alt> + <D>

Programm continuation: Clear alarm with the RESET key. Restart part program

1014	[Channel %1:] System error %2 %3 %4
Parameters:	%1 = Channel number %2 = System error number %3 = generic parameter %4 = generic parameter
Explanation:	With this alarm, internal alarm states are displayed that, in conjunction with the transferred error number, provide information on the cause and location of the error.
Reaction:	Mode group not ready. Local alarm reaction. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	If you experience such a system error, please contact Technical Support. www.siemens.com/sinumerik/help Please supply the following information to ensure quick processing: - Alarm number together with alarm text - Description of the operation/mode before the alarm message - Generate log files using the key combination: <Ctrl> + <Alt> + <D>
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.
1015	[Channel %1:] Axis %2 system error %3 %4
Parameters:	%1 = Channel number %2 = Axis number %3 = System error number %4 = generic parameter
Explanation:	With this alarm, internal alarm states are displayed that, in conjunction with the transferred error number, provide information on the cause and location of the error. Especially with parameter %3 (system error number) = 840001 = Problem with tool management, the identification for the axis is not contained in parameter %2, but instead, further information for the diagnostics (= Status of the data management/magazine no./location no./T no.)
Reaction:	Local alarm reaction. Channel not ready. Interface signals are set. Alarm display.
Remedy:	If you experience such a system error, please contact Technical Support. www.siemens.com/sinumerik/help Please supply the following information to ensure quick processing: - Alarm number together with alarm text - Description of the operation/mode before the alarm message - Generate log files using the key combination: <Ctrl> + <Alt> + <D>
Programm continuation:	Clear alarm with the RESET key. Restart part program
1016	[Channel %1:] Axis %2 system error %3 %4
Parameters:	%1 = Channel number %2 = Axis number %3 = System error number %4 = generic parameter
Explanation:	With this alarm, internal alarm states are displayed that, in conjunction with the transferred error number, provide information on the cause and location of the error.

Reaction:	Mode group not ready. Local alarm reaction. Channel not ready. Interface signals are set. Alarm display.
Remedy:	If you experience such a system error, please contact Technical Support. www.siemens.com/sinumerik/help Please supply the following information to ensure quick processing: - Alarm number together with alarm text - Description of the operation/mode before the alarm message - Generate log files using the key combination: <Ctrl> + <Alt> + <D>
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

1017 [Channel %1:] Axis %2 system error %3 %4

Parameters:	%1 = Channel number %2 = Axis number %3 = System error number %4 = generic parameter
Explanation:	With this alarm, internal alarm states are displayed that, in conjunction with the transferred error number, provide information on the cause and location of the error.
Reaction:	Alarm display.
Remedy:	If you experience such a system error, please contact Technical Support. www.siemens.com/sinumerik/help Please supply the following information to ensure quick processing: - Alarm number together with alarm text - Description of the operation/mode before the alarm message - Generate log files using the key combination: <Ctrl> + <Alt> + <D>
Programm continuation:	Clear alarm with the Delete key or NC START.

1018 [Channel %1:] : floating point arithmetic error in task %2 station %3 FPU state %4

Parameters:	%1 = Channel number %2 = Task ID %3 = Station priority %4 = FPU status
Explanation:	The floating point unit of the processor has found a computational error.
Reaction:	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Alarm reaction delay is canceled.
Remedy:	If you experience such a system error, please contact Technical Support. www.siemens.com/sinumerik/help Please supply the following information to ensure quick processing: - Alarm number together with alarm text - Description of the operation/mode before the alarm message - Generate log files using the key combination: <Ctrl> + <Alt> + <D>

Programm continuation: Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

1019 [Channel %1:] Floating point arithmetic error at address %3 task %2 FPU state %4

Parameters: %1 = Channel number
 %2 = Task ID
 %3 = Code address of operation that triggered the error
 %4 = FPU status

Explanation: The floating point unit of the processor has triggered an exception on account of a computational error.

Reaction: NC not ready.
 Mode group not ready, also effective for single axes.
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.
 NC Stop on alarm.
 Alarm reaction delay is canceled.

Remedy: If you experience such a system error, please contact Technical Support.
www.siemens.com/sinumerik/help
 Please supply the following information to ensure quick processing:
 - Alarm number together with alarm text
 - Description of the operation/mode before the alarm message
 - Generate log files using the key combination: <Ctrl> + <Alt> + <D>

Programm continuation: Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

1020 [Channel %1:] Floating-point arithmetic error in CC %2 addresses %3 task, FPU status %4

Parameters: %1 = Channel number
 %2 = CC filename
 %3 = Code address (absolute + incremental) of the operation causing the error
 %4 = FPU status and task ID

Explanation: The floating-point unit of the processor has triggered an exception due to an arithmetic error.
 The arithmetic error was made in a compile cycle.

Reaction: NC not ready.
 Mode group not ready, also effective for single axes.
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.
 NC Stop on alarm.
 Alarm reaction delay is canceled.

Remedy: If you experience such a system error, please contact Technical Support.
www.siemens.com/sinumerik/help
 Please supply the following information to ensure quick processing:
 - Alarm number together with alarm text
 - Description of the operation/mode before the alarm message
 - Generate log files using the key combination: <Ctrl> + <Alt> + <D>

Programm continuation: Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

1160 Assertion failed in %1: %2

Parameters: %1 = String (path with program name)
 %2 = String (line number)

Explanation:	This alarm is purely a development alarm and will not appear in a delivered software version. For an OEM customer, this alarm could indicate that an alarm has occurred in the system software. Handling of the 'assertion' allows error conditions leading to this alarm to be defined in the system software during the development phase. After the development phase, this alarm output is no longer active.
Reaction:	NC not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Alarm reaction delay is canceled.
Remedy:	Check the cause of the error in the specified software component at the specified line number.
Programm continuation:	Clear alarm with the RESET key in all channels. Restart part program.

2000 PLC sign-of-life monitoring

Explanation:	The PLC must give a sign of life within a defined period of time (MD10100 \$MN_PLC_CYCLIC_TIMEOUT). If this does not occur, the alarm is triggered. The sign of life is a counter reading on the internal NC/PLC interface which the PLC causes to count up with the 10 ms time alarm. The NCK also tests cyclically whether the counter reading has changed. The PLC must give a sign of life within a defined period of time. If this does not occur, this alarm is triggered.
Reaction:	NC not ready. Local alarm reaction. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Check monitoring time frame in MD10100 \$MN_PLC_CYCLIC_TIMEOUT (reference value: 100 ms). Establish the cause of the error in the PLC, and eliminate it (analysis of the ISTACK. If monitoring has responded with a loop in the user program rather than with a PLC Stop, there is no ISTACK entry). This alarm is also caused by PLC stop. (PLC stop with programming tool, PLC stop by commissioning switch, PLC stop by alarm) If none of these cases applies, please contact Technical Support. www.siemens.com/sinumerik/help Please supply the following information to ensure quick processing: - Alarm number together with alarm text - Description of the operation/mode before the alarm message - Generate log files using the key combination: <Ctrl> + <Alt> + <D>
Programm continuation:	Switch control OFF - ON.

2001 PLC has not started up

Explanation:	The PLC must give at least 1 sign of life within a period of time defined in MD10120 \$MN_PLC_RUNNINGUP_TIMEOUT. The PLC must give at least 1 sign of life within the defined period of time after Power ON.
---------------------	---

Reaction:	NC not ready. Local alarm reaction. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	- Please inform the authorized personnel/service department. The monitoring time in MD10120 \$MN_PLC_RUNNINGUP_TIMEOUT must be checked and adapted to the 1st OB1 cycle. - Determine the cause of error in the PLC (loop or stop in the user program) and eliminate it. If you experience such a system error, please contact Technical Support. www.siemens.com/sinumerik/help Please supply the following information to ensure quick processing: - Alarm number together with alarm text - Description of the operation/mode before the alarm message - Generate log files using the key combination: <Ctrl> + <Alt> + <D>
Programm continuation:	Switch control OFF - ON.

2110 NCK temperature alarm

Explanation:	The temperature sensor has reached the response threshold.
Reaction:	Alarm display.
Remedy:	In order to reset the sensor, the temperature must be reduced by 7 degrees C.
Programm continuation:	Clear alarm with the Delete key or NC START.

2130 **Note: The standard password is still active for at least one of the access levels: manufacturer, service or user. %1**

Parameters:	%1 = Access level(s)
Explanation:	For reasons of IT security do not use any standard passwords on the machine. Please assign individual passwords to protect the machines from unauthorized modifications.
Reaction:	Alarm display.
Remedy:	Change the password for the corresponding access level (-> "Setup area" -> "Password" -> "Change password").
Programm continuation:	Clear alarm with the Delete key or NC START.

2140 **The actual service switch position forces the SRAM to be cleared at the next Power On (general reset active)**

Explanation:	The initialization switch is currently set to overall reset. This means that the module's SRAM is deleted with the next module reset. The NC data memory is cleared during this operation.
Reaction:	NC not ready. Interface signals are set. Alarm display.
Remedy:	Reset the initialization switch to zero.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

2900 Reboot is delayed**Explanation:** This alarm indicates a delayed reboot.

This alarm only occurs when reboot was carried out by the HMI and MD10088 \$MN_REBOOT_DELAY_TIME was set greater than zero.

The alarm can be suppressed with MD11410 \$MN_SUPPRESS_ALARM_MASK Bit 20.

Reaction: NC not ready.

The NC switches to follow-up mode.

Mode group not ready, also effective for single axes.

Interpreter stop

NC Start disable in this channel.

Interface signals are set.

Alarm display.

NC Stop on alarm.

Alarm reaction delay is canceled.

Remedy: See MD10088 \$MN_REBOOT_DELAY_TIME and MD11410 \$MN_SUPPRESS_ALARM_MASK**Programm continuation:** Switch control OFF - ON.

3000 Emergency stop**Explanation:** The EMERGENCY STOP request is applied to the NCK/PLC interface DB2600 DBX0.1 (Emergency stop).**Reaction:** NC not ready.

Mode group not ready, also effective for single axes.

NC Start disable in this channel.

Interface signals are set.

Alarm display.

NC Stop on alarm.

Alarm reaction delay is canceled.

Remedy: Please inform the authorized personnel/service department. Remove the cause of the emergency stop and acknowledge the emergency stop via the PLC/NCK interface DB2600 DBX0.2 (emergency stop acknowledgment).**Programm continuation:** Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

3001 Internal emergency stop**Explanation:** This alarm is not displayed.**Reaction:** NC not ready.

Local alarm reaction.

Mode group not ready, also effective for single axes.

NC Start disable in this channel.

NC Stop on alarm.

Remedy: No remedy required**Programm continuation:** Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

4000 [Channel %1:] Machine data %2[%3] has gap in axis assignment**Parameters:** %1 = Channel number

%2 = String: MD identifier

Explanation: The assignment of a machine axis to a channel by the MD20070 \$MC_AXCONF_MACHAX_USED must be contiguous. At system power-up (Power On) gaps are detected and displayed as an alarm.

Reaction:	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. The entries for the indices for the machine axes used in the channels must be contiguous in table MD20070 \$MC_AXCONF_MACHAX_USED. Channel axis gaps must be enabled via MD11640 \$MN_ENABLE_CHAN_AX_GAP.
Programm continuation:	Switch control OFF - ON.

4001	[Channel %1:] Axis %2 defined for more than one channel via machine data %3
Parameters:	%1 = Channel number %2 = Index: Machine axis number %3 = String: MD identifier
Explanation:	In the channel-specific MD20070 \$MC_AXCONF_MACHAX_USED [CHn, AXm]=x (n ... channel number, m ... channel axis number, x ... machine axis number), several channels were assigned to a machine axis without having a master channel defined for this axis. There is usually not much point in assigning a machine axis to several channels. In exceptional cases, multiple assignment can be performed if a master channel is defined for this axis. The channel assignment can be performed in accordance with the machining requirements in the NC part program. See also MD
Reaction:	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. In the axis-specific MD30550 \$MA_AXCONF_ASSIGN_MASTER_CHAN [AXm]=n (m ... machine axis number, n ... channel number), a master axis was set for the axes that are supposed to be alternately assigned by the NC program to one or the other channel.
Programm continuation:	Switch control OFF - ON.

4002	[Channel %1:] Machine data %2[%3] assigns an axis not defined in channel
Parameters:	%1 = Channel number %2 = String: MD identifier %3 = Index: MD array index

Explanation:	Only axes that have been activated in the channel by MD20070 \$MC_AXCONF_MACHAX_USED [kx]=m may be declared as geometry axes, transformation axes or orientation axes in MD20050 \$MC_AXCONF_GEOAX_ASSIGN_TAB [gx]=k. This also applies to MD22420 \$MC_FGROUP_DEFAULT_AXES (gx: Geometry axis index, kx: Channel axis index, k: Channel axis no., m: Machine axis no.). Assignment of geometry axes to channel axes MD20050 \$MC_AXCONF_GEOAX_ASSIGN_TAB (includes channel axis no. k): - Geometry axis index: 0, 1st channel: 1, 2nd channel: 1 - Geometry axis index: 1, 1st channel: 2, 2nd channel: 0 - Geometry axis index: 2, 1st channel: 3, 2nd channel: 3 MD20070 \$MC_AXCONF_MACHAX_USED (includes machine axis no. m): - Channel axis index: 0, 1st channel: 1, 2nd channel: 4 - Channel axis index: 1, 1st channel: 2, 2nd channel: 5 - Channel axis index: 2, 1st channel: 3, 2nd channel: 6 - Channel axis index: 3, 1st channel: 7, 2nd channel: 0 - Channel axis index: 4, 1st channel: 8, 2nd channel: 0 - Channel axis index: 5, 1st channel: 0, 2nd channel: 0 - Channel axis index: 6, 1st channel: 0, 2nd channel: 0 - Channel axis index: 7, 1st channel: 0, 2nd channel: 0
Reaction:	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Correct - MD20050 \$MC_AXCONF_GEOAX_ASSIGN_TAB - MD24... \$MC_TRAFO_AXES_IN_... - MD24... \$MC_TRAFO_GEOAX_ASSIGN_TAB_... - MD22420 \$MC_FGROUP_DEFAULT_AXES - and/or MD20070 \$MC_AXCONF_MACHAX_USED.
Programm continuation:	Switch control OFF - ON.

4003 Axis %1 incorrect assignment of master channel in machine data %2

Parameters:	%1 = Axis %2 = String: MD identifier
Explanation:	For some applications, it is useful to operate an axis in several channels (C axis or spindle on single spindle or double carriage machines). The machine axes which are defined through the channel-specific MD20070 \$MC_AXCONF_MACHAX_USED in several channels, must be assigned to a master channel with the axis-specific MD30550 \$MA_AXCONF_ASSIGN_MASTER_CHAN. For axes that are activated in one channel only, the number of this channel or zero must be entered as a master channel.
Reaction:	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Modify MD 20070: \$MC_AXCONF_MACHAX_USED and/or MD30550: \$MA_AXCONF_ASSIGN_MASTER_CHAN.
Programm continuation:	Switch control OFF - ON.

4004	[Channel %1:] Machine data %2 axis %3 defined repeatedly as geometry axis
Parameters:	%1 = Channel number %2 = String: MD identifier %3 = Axis index
Explanation:	An axis may only be defined once as a geometry axis.
Reaction:	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Correct MD20050 \$MC_AXCONF_GEOAX_ASSIGN_TAB.
Programm continuation:	Switch control OFF - ON.
4005	[Channel %1:] Maximum number of axes is exceeded. Limit %2
Parameters:	%1 = Channel number %2 = Upper limit for the number of axes in the channel
Explanation:	MD20070 \$MC_AXCONF_MACHAX_USED defines which machine axes can be used in this channel. This also defines the number of active axes in the channel. This upper limit was exceeded. Note: The channel axis gaps may cause certain indices of MD20070 \$MC_AXCONF_MACHAX_USED to remain unused, and therefore do not count as active channel axes. Example: - CHANDATA(2) - \$MC_AXCONF_MACHAX_USED[0] = 7 - \$MC_AXCONF_MACHAX_USED[1] = 8 - \$MC_AXCONF_MACHAX_USED[2] = 0 - \$MC_AXCONF_MACHAX_USED[3] = 3 - \$MC_AXCONF_MACHAX_USED[4] = 2 - \$MC_AXCONF_MACHAX_USED[5] = 0 - \$MC_AXCONF_MACHAX_USED[6] = 1 - \$MC_AXCONF_MACHAX_USED[7] = 0 This channel uses the five machine axes 1, 2, 3, 8, 7, i.e. it has 5 active channel axes.
Reaction:	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Modify MD20070 \$MC_AXCONF_MACHAX_USED.
Programm continuation:	Switch control OFF - ON.
4006	The maximum number of activatable axes has been exceeded (limit %1)
Parameters:	%1 = Number of axes
Explanation:	The sum of the two option data \$ON_NUM_AXES_IN_SYSTEM and \$ON_NUM_ADD_AXES_IN_SYSTEM must not exceed the maximum number of axes in the system.

Reaction:	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. The sum of the two option data \$ON_NUM_AXES_IN_SYSTEM and \$ON_NUM_ADD_AXES_IN_SYSTEM must not exceed the maximum number of axes (dependent on configuration).
Programm continuation:	Switch control OFF - ON.

4009 Machine data %1%2 contains an illegal value.

Parameters:	%1 = String: MD identifier %2 = String: possibly further specification
Explanation:	A value has been entered which lies above or below the value range or a limit value of a variable, a machine data, or a function.
Reaction:	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Enter correct values.
Programm continuation:	Switch control OFF - ON.

4010 Invalid identifier used in machine data %1[%2]

Parameters:	%1 = String: MD identifier %2 = Index: MD array index
Explanation:	When determining a name in the NCK tables (arrays) for: machine axes, Euler angles, direction vectors, normal vectors, interpolation parameters and intermediate point coordinates, one of the following syntax rules for the identifier to be entered has been violated: - The identifier must be an NC address letter (A, B, C, I, J, K, Q, U, V, W, X, Y, Z), possibly with a numerical extension (1-99) - The identifier must begin with any 2 capital letters but not with \$ (reserved for system variables). - The identifier must not be a keyword of the NC language (e.g. POSA).
Reaction:	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Enter the identifier for user-defined names with correct syntax in the displayed MD. - Machine axes: MD10000 \$MN_AXCONF_MACHAX_NAME_TAB - Euler angles: MD10620 \$MN_EULER_ANGLE_NAME_TAB - Normal vectors: MD10630 \$MN_NORMAL_VECTOR_NAME_TAB - Direction vectors: MD10640 \$MN_DIR_VECTOR_NAME_TAB - Interpolation parameters: MD10650 \$MN_IPO_PARAM_NAME_TAB - Intermediate point coordinates: MD10660 \$MN_INTERMEDIATE_POINT_NAME_TAB
Programm continuation:	Switch control OFF - ON.

4011	[Channel %1:] Invalid identifier used in machine data %2[%3]
Parameters:	%1 = Channel number %2 = String: MD identifier %3 = Index: MD array index
Explanation:	When defining names in the channel-specific tables for geometry axes and channel axes, one of the following syntax rules for the identifier to be entered has been violated: - The identifier must be an NC address letter (A, B, C, I, J, K, U, V, W, X, Y, Z), possibly with a numerical extension. - The identifier must begin with any 2 capital letters but not with \$ (reserved for system variables). - The identifier must not be a keyword of the NC language (e.g. SPOS).
Reaction:	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Enter the identifier for user-defined names with correct syntax in the displayed MD - Geometry axes: MD20060 \$MC_AXCONF_GEOAX_NAME_TAB - Channel axes: MD20080 \$MC_AXCONF_CHANAX_NAME_TAB
Programm continuation:	Switch control OFF - ON.
4012	Invalid identifier used in machine data %1[%2]
Parameters:	%1 = String: MD identifier %2 = Index: MD array
Explanation:	The selected identifier is invalid. Valid identifiers are: - AX1 - AXn: Machine axis identifiers - N1AX1 - NnAXm: Link axis identifiers (NCU + machine axis), only for 'NCU-Link' expansion level! - C1S1 - CnSm: Container axis identifiers (container + container location), only for 'Axis container' expansion level!
Reaction:	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Use a correct identifier.
Programm continuation:	Switch control OFF - ON.
4020	Identifier %1 used several times in machine data %2
Parameters:	%1 = String: Name of identifier %2 = String: MD identifier
Explanation:	When determining a name in the NCK tables (arrays) for: machine axes, Euler angles, direction vectors, normal vectors, interpolation parameters and intermediate point coordinates, an identifier has been used that already exists in the control.
Reaction:	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.

Remedy: Please inform the authorized personnel/service department. Select for the identifier to be entered a character string that is not yet used in the system (max. 15 characters).

Programm continuation: Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

4021 [Channel %1:] Identifier %2 used several times in machine data %3

Parameters: %1 = Channel number
%2 = String: Name of identifier
%3 = String: MD identifier

Explanation: To determine the name in the channel-specific tables for geometry axes and channel axes an identifier already existing in the control has been used.

Reaction: NC not ready.
Mode group not ready, also effective for single axes.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Please inform the authorized personnel/service department. Select for the identifier to be entered a character string that is not yet used in the system (max. 15 characters).

Programm continuation: Switch control OFF - ON.

4030 [Channel %1:] Identifier missing in machine data %2[%3]

Parameters: %1 = Channel number
%2 = String: MD identifier
%3 = Index: MD array index

Explanation: An axis identifier is expected for the displayed MD in accordance with the axis configuration in the MD20070 \$MC_AXCONF_MACHAX_USED and MD20050 \$MC_AXCONF_GEOAX_ASSIGN_TAB.

Reaction: NC not ready.
Mode group not ready, also effective for single axes.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Please inform the authorized personnel/service department.
Check axis configuration and enter the missing identifier into the MD or, should the axis not exist, specify for this channel axis the machine axis 0 in the channel-specific MD20070 \$MC_AXCONF_MACHAX_USED. If this concerns a geometry axis that is not to be used (this applies only for 2-axis machining, e.g. on turning machines), then channel axis 0 must be entered additionally in the channel-specific MD20050 \$MC_AXCONF_GEOAX_ASSIGN_TAB.

Programm continuation: Switch control OFF - ON.

4032 [Channel %1:] Wrong identifier for facing axis in %2

Parameters: %1 = Channel number
%2 = String: MD identifier

Explanation: According to the axis configuration in MD20150 \$MC_GCODE_RESET_VALUES or MD20100 \$MC_DIAMETER_AX_DEF, a facing axis identifier is expected at the specified location.

Reaction:	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Inform the authorized personnel/service department. Add the correct identifier.
Programm continuation:	Switch control OFF - ON.

4040 [Channel %1:] Axis identifier %2 not consistent with machine data %3

Parameters:	%1 = Channel number %2 = String: Axis identifier %3 = String: MD identifier %4 = There are not enough channel axes entered in the MD displayed.
Explanation:	The use of the specified axis identifier in the displayed MD is not consistent the channel's axis configuration stated in the MD20070 \$MC_AXCONF_MACHAX_USED and MD20050 \$MC_AXCONF_GEOAX_ASSIGN_TAB. Only with active "OEM transformation" compile cycle: There are not enough channel axes entered in the MD displayed.
Reaction:	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Check and correct the identifier used in the MD10000 \$MN_AXCONF_MACHAX_NAME_TAB, MD20080 \$MC_AXCONF_CHANAX_NAME_TAB and/or MD20060 \$MC_AXCONF_GEOAX_NAME_TAB. Only with active "OEM transformation" compile cycle: In addition to the specified MD, check and correct MD24110 \$MC_TRAFO_AXES_IN_1[n] of the activated OEM transformation according to the function description.
Programm continuation:	Switch control OFF - ON.

4045 [Channel %1:] Conflict between machine data %2 and machine data %3

Parameters:	%1 = Channel number %2 = String: MD identifier %3 = String: MD identifier
Explanation:	Using the specified machine data %1 leads to a conflict with machine data %2.
Reaction:	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Correct the use of the specified machine data.
Programm continuation:	Switch control OFF - ON.

4050 NC code identifier %1 cannot be reconfigured to %2

Parameters:	%1 = String: Old identifier %2 = String: New identifier
--------------------	--

Explanation:	Renaming of an NC code was not possible for one of the following reasons: - The old identifier does not exist - The new identifier lies in another type range. NC codes/keywords can be reconfigured via machine data as long as the type range is not abandoned. Type 1: "real" G codes: G02, G17, G33, G64, ... Type 2: named G codes: ASPLINE, BRISK, TRANS, ... Type 3: settable addresses: X, Y, A1, A2, I, J, K, ALF, MEAS, ...
Reaction:	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Correct MD10712 \$MN_NC_USER_CODE_CONF_NAME_TAB. The list must be built up as follows: Even address: Identifier to be modified. Following odd address: New identifier e.g.: \$MN_NC_USER_CODE_CONF_NAME_TAB [10] = "ROT" \$MN_NC_USER_CODE_CONF_NAME_TAB [11] = " " clears the ROT function from the control
Programm continuation:	Switch control OFF - ON.

4058 System configuration error (%1, %2)

Parameters:	%1 = File name %2 = Error code
Explanation:	An error occurred while reading in and scaling machine data. The meaning of the error code can be interpreted from the following list: 60 = File not found 70 = Error on opening the file 80 = Invalid signature 81 = File corrupt 82 = Incorrect format
Reaction:	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	- Please notify the authorized service personnel.
Programm continuation:	Switch control OFF - ON.

4059 Error during reading of system configuration (%1, %2)

Parameters:	%1 = MD number %2 = Error code
Explanation:	An error occurred while reading in and scaling machine data.

Reaction:	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	- Please notify the authorized service personnel.
Programm continuation:	Switch control OFF - ON.

4060 **Standard machine data loaded (%1, %2, %3, %4)**

Parameters:	%1 = Identifier 1 %2 = Identifier 2 %3 = Identifier 3 %4 = Identifier 4
Explanation:	The standard MD were loaded because - a cold start was requested or - the MD buffer voltage failed or - an initialization was requested for loading the standard machine data (MD11200 \$MN_INIT_MD).
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. After automatically loading the standard MDs, the individual MDs must be entered or loaded in the relevant system.
Programm continuation:	Clear alarm with the RESET key. Restart part program

4062 **Backup data loaded**

Explanation:	The user data saved on the compact flash card have been loaded into the SRAM.
Reaction:	Alarm display.
Remedy:	Reload the specific machine data again.
Programm continuation:	Clear alarm with the RESET key. Restart part program

4065 **Buffered memory was restored from backup medium (potential loss of data!)**

Explanation:	The user data of the NC and the retentive data of the PLC are stored in a buffered memory area (SRAM). A possible inconsistency was detected in this buffered memory during ramp-up of the control. The buffered memory was initialized with the last backup copy. Consequently, changes that have been made since the last update of the backup copy in the buffered memory have been lost. A possible reason for a data inconsistency could be that the backup time was exceeded. Please note the required ON time of the control specified in your commissioning guide.
Reaction:	NC not ready. NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Restart the control.
Programm continuation:	Switch control OFF - ON.

4070 Normalizing machine data has been changed

Explanation:	The control uses internal physical units (mm, degrees, s, for paths, velocities, acceleration, etc.). During programming or data storage, some of these values are input and output using different units (rev./min, m/s², etc.). The conversion is carried out with the scaling factors that can be entered (system-specific MD array MD10230 \$MN_SCALING_FACTORS_USER_DEF USER_DEF[n] (n ... index number 0 - 10), when the corresponding masking bit is set to "1". If the masking bit is set to "0", scaling takes place with the internal standard factors. The following machine data influence the scaling of other MDs: MD10220: \$MN_SCALING_USER_DEF_MASK MD10230: \$MN_SCALING_FACTORS_USER_DEF MD10240: \$MN_SCALING_SYSTEM_IS_METRIC MD10250: \$MN_SCALING_VALUE_INCH MD30300: \$MA_IS_ROT_AX If these data are modified, the NCK must be powered up again. Only then will the input of dependent data be performed correctly.
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. If the alarm has been displayed after downloading an MD file which is consistent within itself, then the download operation must be repeated with a new NC power-up. (The file contains scaling-dependent machine data in front of the scaling factors).
Programm continuation:	Clear alarm with the Delete key or NC START.

4071 Check the position of the encoder

Explanation:	A machine data has been changed that affects the value of an absolute encoder position. Please check the position values. For absolute encoders: Encoder adjustment has been changed, the machine reference of the axis position may have changed, check the encoder adjustment. Other encoders: The reference point of the axis position has been changed, check the referencing procedure.
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department.
Programm continuation:	Clear alarm with the Delete key or NC START.

4075 Machine data %1 (and maybe others) not changed due to missing permission level %2

Parameters:	%1 = String: MD identifier %2 = Write protection level of the MD
Explanation:	On executing an MD file or when writing machine data from the part program, an attempt has been made to write an item of data with a higher protection level than the access authorization currently set in the control. The item of data in question has not been written and program execution is continued. This alarm is set only when a write access violation is detected for the first time.
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. Set the required access level by means of keyswitch or password entry or delete the machine data concerned from the MD file/part program.
Programm continuation:	Clear alarm with the Delete key or NC START.

4076 %1 Machine data could not be changed with permission level %2

Parameters:	%1 = Number of MDs %2 = Preset access authorization
--------------------	---

Explanation:	On executing a TOA file or when writing data from the part program an attempt has been made to write data with a higher protection level than the access authorization currently set in the control. The data in question have not been written and program execution is continued without hindrance. This alarm is issued on acknowledging alarm 4075. It can be cleared only with Power ON.
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. Set the required access level by means of keyswitch or password entry or delete the machine data concerned from the MD file/part program.
Programm continuation:	Switch control OFF - ON.

4077 New value %1 of MD %2 not set. Requires %3 KB too much %4 memory.

Parameters:	%1 = New value of machine data %2 = Machine data number %3 = Number of bytes requested that exceeded availability %4 = Type of memory
Explanation:	An attempt was made to enter a new value in the specified memory configuration machine data. It was not possible to modify the value, as this would have required more user memory than was available. The third parameter specifies the number of kilobytes by which the maximum user memory would be exceeded. Note: 1 kB = 1024 bytes. 1 MB = 1024 kB. The fourth parameter specifies the type of memory whose limit was exceeded. - "D" stands for dynamic or non-buffered user memory. This is where, for example, the LUD variables are stored and the interpolation buffer size is entered. The capacity of this memory type can be taken from MD18210 \$MN_MM_USER_MEM_DYNAMIC, and is defined by OD19240 \$ON_USER_MEM_DYNAMIC. - "S" stands for static or buffered user memory. Part programs, offset data, R parameters, tool data, etc. are typically stored there. The capacity of this memory type can be taken from MD18230 \$MN_MM_USER_MEM_BUFFERED, and is defined by OD19250 \$ON_USER_MEM_BUFFERED. - "IS" stands for internal static or buffered user memory. This memory type is defined by the current memory configuration and is not settable. A few NCK functions use this memory.
Reaction:	Alarm display.
Remedy:	You can continue without making a change. The alarm has no negative effects. To make the change, you have the following possibilities of eliminating the error. Note that removing the access right depends on the current memory configuration of the NCK: - Try again with a lower value. Observe the change in the value of parameter 3. - If the control model used allows it, enlarge the memory. Note that this is not possible if parameter 4 equals "IS". - If permissible, enlarge the NCK user memory. With the appropriate access authorization, you can change the machine data (see above). An increase in buffered memory is generally subject to charge.
Programm continuation:	Clear alarm with the Delete key or NC START.

4080 Incorrect configuration of indexing axis in MD %1

Parameters:	%1 = String: MD identifier
Explanation:	The assignment of a position table to an indexing axis or the contents of a position table contains an error, or the length of a position table has been parameterized with 0.
Reaction:	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.

Remedy:	Please inform the authorized personnel/service department. 3 MD identifiers are output, depending on the type of error. 1. MD30500 \$MA_INDEX_AX_ASSIGN_POS_TAB: the error is due to multiple assignment of a position table MD10910 \$MN_INDEX_AX_POS_TAB_1 or MD10930 \$MN_INDEX_AX_POS_TAB_2) to axes with different types (linear/rotary axis). 2. MD10910 \$MN_INDEX_AX_POS_TAB_1 or MD10930 \$MN_INDEX_AX_POS_TAB_2: the contents of the displayed tables are incorrect. - The entered positions must be arranged in increasing size. - A particular position must not be set more than once. - If the table is assigned to one or several modulo axes, then the contents must be within the 0 to < 360 degree range. 3. MD10900 \$MN_INDEX_AX_LENGTH_POS_TAB_1 or MD10920 \$MN_INDEX_AX_LENGTH_POS_TAB_2: the length of the displayed position table n was specified with 0.
Programm continuation:	Clear alarm with the RESET key. Restart part program

4082 [channel %1:] invalid value in machine date %2%3

Parameters:	%1 = Channel number %2 = String: MD identifier %3 = String: MD field index
Explanation:	A value has been entered which exceeds the value range or a limit value for a variable, a machine data or a function.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Enter correct values.
Programm continuation:	Clear alarm with the RESET key. Restart part program

4087 [Channel %1:] Option '%2<OPTNX>' active, spindle not permitted

Parameters:	%1 = Channel number %2 = Brief description of option
Explanation:	If the 'Fast IPO' option is enabled in a system, the active channels must not contain a spindle.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. - Deactivate option - Set MD35000 \$MA_SPIND_ASSIGN_TO_MACHAX = 0
Programm continuation:	Switch control OFF - ON.

4088 Option '%1<OPTNX>' active, IPO cycle of %2 ms not permissible

Parameters:	%1 = Brief description of option %2 = IPO cycle
Explanation:	
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please notify the authorized personnel/service. - Deactivate option - Increase IPO cycle
Programm continuation:	Switch control OFF - ON.

4090	Too many errors during power-up
Explanation:	More than <n> errors occurred during control power-up.
Reaction:	NC Start disable in this channel. Alarm display.
Remedy:	Set the machine data correctly.
Programm continuation:	Switch control OFF - ON.
4099	%1 error(s) during processing of MD initialization
Parameters:	%1 = Number of errors
Explanation:	Errors occurred during processing of the machine data initializations. See the power-up log files for a more detailed description of the errors.
Reaction:	NC not ready. Alarm display.
Remedy:	Please inform the authorized personnel/service department.
Programm continuation:	Clear alarm with the RESET key. Restart part program
4115	Time ratio communication to Ipo changed to %1
Parameters:	%1 = String (new ratio)
Explanation:	The value of MD10072 \$MN_COM_IPO_TIME_RATIO has been adapted. This can only occur if the value of the machine data is < 1 and the time thus calculated is not a multiple of the position control cycle.
Reaction:	Alarm display.
Remedy:	The MD10072 \$MN_COM_IPO_TIME_RATIO has been adapted. Please check to ensure that the calculated value is correct.
Programm continuation:	Clear alarm with the RESET key. Restart part program
4150	[Channel %1:] Invalid M function subprogram call configured
Parameters:	%1 = Channel number
Explanation:	MD10715 \$MN_M_NO_FCT_CYCLE[n] or MD10718 \$MN_M_NO_FCT_CYCLE_PAR contains invalid configuration data: An M function, which is occupied by the system and cannot be replaced by a subprogram call has been specified in MD10715 \$MN_M_NO_FCT_CYCLE[n] for the configuration of the subprogram call via M function: - M0 to M5, - M17, M30, - M19, M40 to M45, - M function for selecting spindle/axis mode according to MD20094 \$MC_SPIND_RIGID_TAPPING_M_NR (default: M70), - M functions for nibbling/punching as configured in MD26008 \$MC_NIBBLE_PUNCH_CODE if activated by MD26012 \$MC_PUNCHNIB_ACTIVATION. - Also M96 to M99 for applied external language (MD18800 \$MN_MM_EXTERN_LANGUAGE). MD10718 \$MN_M_NO_FCT_CYCLE_PAR contains an invalid array index of MD10715 \$MN_M_NO_FCT_CYCLE[n]. Currently, the values 0 to 9 are permissible. The affected machine data is reset to the default value -1. This deactivates the function.
Reaction:	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	You have the following possibilities of eliminating the error: - Configure an M function in MD10715 \$MN_M_NO_FCT_CYCLE[n] that is not occupied by the system. - Configure a valid array index in MD10718 \$MN_M_NO_FCT_CYCLE_PAR.

Programm continuation: Switch control OFF - ON.

4152 Illegal configuration of the 'Block display with absolute values' function

Explanation: The "Block display with absolute values" function has been illegally parameterized:
- An illegal block length has been set with MD28400 \$MC_MM_ABSBLOCK:
While ramping up, the machine data will be checked for the following value range:
0, 1, 128 to 512
- An invalid display range has been set with MD28402 \$MC_MM_ABSBLOCK_BUFFER_CONF[. While ramping up, the machine data will be checked for the following upper and lower limits:
0 <= MD28402 \$MC_MM_ABSBLOCK_BUFFER_CONF[0] <= 8
0 <= MD28402 \$MC_MM_ABSBLOCK_BUFFER_CONF[1] <= (MD28060 \$MC_MM_IPO_BUFFER_SIZE + MD28070 \$MC_MM_NUM_BLOCKS_IN_PREP).
Alarm 4152 is issued if the limits are violated.

Reaction: Mode group not ready.
Channel not ready.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Configure block length/display range within the permissible limits.

Programm continuation: Switch control OFF - ON.

4170 Invalid M function number for channel synchronisation assigned

Explanation: An M number between 0 and 99 has been specified In machine data MD10800 \$MN_EXTERN_CHAN_SYNC_M_NO_MIN or MD10802 \$MN_EXTERN_CHAN_SYNC_M_NO_MAX for the configuration of the M number range for channel synchronization in ISO2/3 mode or the machine data MD10802 \$MN_EXTERN_CHAN_SYNC_M_NO_MAX is smaller than MD10800 \$MN_EXTERN_CHAN_SYNC_M_NO_MIN.

Reaction: Mode group not ready.
Channel not ready.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Check MD10800 \$MN_EXTERN_CHAN_SYNC_M_NO_MIN and MD10802 \$MN_EXTERN_CHAN_SYNC_M_NO_MAX.

Programm continuation: Switch control OFF - ON.

4182 [Channel %1:] Invalid M auxiliary function number in %2%3, MD reset

Parameters: %1 = Channel number
%2 = MD identifier
%3 = If required, MD index

Explanation: In the specified machine data, a number has been specified for the configuration of an M function which is occupied by the system, and cannot be used for an assignment. (M0 to M5, M17, M30, M40 to M45 and also M98, M99 with applied ISO dialect). The value set by the user has been reset to the default value by the system.

Reaction: Mode group not ready.
Channel not ready.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy:	Configure an M function in the specified machine data which is not occupied by the system (M0 to M5, M17, M30, M40 to M45 and also M98, M99 with applied ISO dialect).
Programm continuation:	Clear alarm with the RESET key. Restart part program

4183 [Channel %1:] M auxiliary function number %2 used several times (%3 and %4)

Parameters:	%1 = Channel number %2 = M auxiliary function number %3 = MD identifier %4 = MD identifier
Explanation:	In the specified machine data, a number has been used several times for the configuration of an M function.
Reaction:	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Check the specified machine data and create a unique assignment of M auxiliary function numbers.
Programm continuation:	Switch control OFF - ON.

4184 [Channel %1:] Illegally predefined auxiliary function in %2[%3], MD reset

Parameters:	%1 = Channel number %2 = MD identifier %3 = If required, MD index
Explanation:	In the specified machine data, a predefined auxiliary function has been illegally configured. The value set by the user has been reset to the default value by the system.
Reaction:	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Configure a valid value in the specified machine data.
Programm continuation:	Clear alarm with the RESET key. Restart part program

4185 [Channel %1:] Illegal auxiliary function configured %2 %3 %4

Parameters:	%1 = Channel number %2 = Type of auxiliary function %3 = Extension %4 = Auxiliary function value
Explanation:	An auxiliary function has been illegally configured. Predefined auxiliary functions cannot be reconfigured by user-defined auxiliary functions. See: MD22010 \$MC_AUXFU_ASSIGN_TYPE[n] MD22020 \$MC_AUXFU_ASSIGN_EXTENSION[n] MD22030 \$MC_AUXFU_ASSIGN_VALUE[n] MD22035 \$MC_AUXFU_ASSIGN_SPEC[n]

Reaction:	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Reconfigure the auxiliary function.
Programm continuation:	Clear alarm with the RESET key. Restart part program

4200 [Channel %1:] Geometry axis %2 must not be declared a rotary axis

Parameters:	%1 = Channel number %2 = Axis name
Explanation:	The geometry axes represent a Cartesian coordinate system and therefore the declaration of a geometry axis as rotary axis leads to a definition conflict.
Reaction:	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Remove rotary axis declaration for this machine axis. For this purpose, the geometry axis index for the displayed geometry axis must be determined by means of MD20060 \$MC_AXCONF_GEOAX_NAME_TAB. The channel axis number is stored with the same index in MD20050 \$MC_AXCONF_GEOAX_ASSIGN_TAB. The channel axis number minus 1 provides the channel axis index under which the machine axis number is found in MD20070 \$MC_AXCONF_MACHAX_USED.
Programm continuation:	Switch control OFF - ON.

4210 [Channel %1:] Spindle %2 declaration as rotary axis missing

Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	If a machine axis is to be operated as a spindle, this machine axis must be declared as a rotary axis.
Reaction:	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Set rotary axis declaration for this machine axis in the axis-specific MD30300 \$MA_IS_ROT_AX.
Programm continuation:	Switch control OFF - ON.

4215 [Channel %1:] Spindle %2 declaration as modulo axis missing

Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	The spindle functionality requires a modulo axis (positions in [deg]).

Reaction:	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Inform the authorized personnel/service department. Set MD30310 \$MA_ROT_IS_MODULO.
Programm continuation:	Switch control OFF - ON.

4220 [Channel %1:] Spindle %2 declared repeatedly

Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	The spindle number exists more than once in the channel.
Reaction:	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. The spindle number is stored in the axis-specific MD35000 \$MA_SPIND_ASSIGN_TO_MACHAX. The channel to which this machine axis/spindle is assigned is listed in the machine axis index. (The machine axis number is given in the channel-specific MD20070 \$MC_AXCONF_MACHAX_USED).
Programm continuation:	Switch control OFF - ON.

4225 [Channel %1:] Axis %2 declaration as rotary axis missing

Parameters:	%1 = Channel number %2 = Axis name, axis number
Explanation:	The modulo functionality requires a rotary axis (positions in [deg]).
Reaction:	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Inform the authorized personnel/service department. Set MD30300 \$MA_IS_ROT_AX.
Programm continuation:	Switch control OFF - ON.

4230 [Channel %1:] Data alteration from external not possible in current channel state

Parameters:	%1 = Channel number
Explanation:	It is not allowed to enter this data while the part program is being executed (e.g. setting data for working area limitation or for dry run feedrate).
Reaction:	Alarm display.
Remedy:	The data to be entered must be altered before starting the part program.
Programm continuation:	Clear alarm with the Delete key or NC START.

4240	Runtime overflow on the IPO or position controller level %1 Parameter %2 %3 %4
Parameters:	%1 = Operating system error number %2 = Operating system error parameter 1 %3 = Operating system error parameter 2 %4 = Operating system error parameter 3
Explanation:	The settings for the interpolation and position control cycle were modified before the last power-up such that too little computing time is now available for the requisite cyclic task. The alarm occurs immediately after power-up if too little runtime is available even when the axes are stationary and the NC program has not started. However, task overflow can occur only when computation-intensive NC functions are called during program execution.
Reaction:	NC not ready. The NC switches to follow-up mode. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Alarm reaction delay is canceled.
Remedy:	Please inform the authorized personnel/service department. Take greater care when optimizing the clock times MD10050 \$MN_SYSCLOCK_CYCLE_TIME, MD10060 \$MN_POSCTRL_SYSCLOCK_TIME_RATIO and/or MD10070 \$MN_IPO_SYSCLOCK_TIME_RATIO. The test should be performed with an NC program that represents the highest possible control load. To be on the safe side, a margin of 15 to 25% should be added to the times determined in this way.
Programm continuation:	Switch control OFF - ON.

4270	Machine data %1 assigns not activated NC input/output byte %2
Parameters:	%1 = String: MD identifier %2 = Index
Explanation:	The specified machine data assigns a digital input/output byte or an analog input/output signal the processing of which has not been activated to an NC function.
Reaction:	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Correct machine data. Activate required inputs/outputs via MDs: MD10350 \$MN_FASTIO_DIG_NUM_INPUTS MD10360 \$MN_FASTIO_DIG_NUM_OUTPUTS MD10300 \$MN_FASTIO_ANA_NUM_INPUTS MD10310 \$MN_FASTIO_ANA_NUM_OUTPUTS Activation of fast inputs/outputs does not require the corresponding hardware configuration to be available at the control. All functions using fast inputs/outputs can also be made use of by the PLC specification/modification defined in the VDI interface, if the response time requirements are reduced accordingly. Activated inputs/outputs increase the computation time requirement of the interpolation cycle because the PLC manipulation signals are handled cyclically. Note: deactivate any inputs/outputs not in use.
Programm continuation:	Switch control OFF - ON.

4275	Machine data %1 and %2 both assign the same NC output byte no. %3 several times
Parameters:	%1 = String: MD identifier %2 = String: MD identifier %3 = No. of output
Explanation:	The specified machine data assign two NC functions to the same digital/analog output.
Reaction:	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Correct machine data.
Programm continuation:	Switch control OFF - ON.
4280	Assignment of NC input/output byte via MD %1[%2] does not match hardware configuration
Parameters:	%1 = String: MD identifier %2 = Index: MD array
Explanation:	When booting, the required input/output module was not found at the slot specified in the MD.
Reaction:	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Check hardware or correct the MD, if necessary. Note: monitoring of the hardware configuration is performed independently of the number of activated inputs/outputs (MD10300 \$MN_FASTIO_ANA_NUM_INPUTS, MD10310 \$MN_FASTIO_ANA_NUM_OUTPUTS, MD10350 \$MN_FASTIO_DIG_NUM_INPUTS, MD10360 \$MN_FASTIO_DIG_NUM_OUTPUTS)
Programm continuation:	Switch control OFF - ON.
4282	Hardware of external NCK outputs assigned repeatedly
Explanation:	Several outputs have been configured on the same hardware byte.
Reaction:	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Alter MD10368 \$MN_HW_ASSIGN_DIG_FASTOUT or MD10364 \$MN_HW_ASSIGN_ANA_FASTOUT.
Programm continuation:	Switch control OFF - ON.
4300	Declaration in MD %1 is not allowed for axis %2.
Parameters:	%1 = String: MD identifier %2 = Axis name, spindle number
Explanation:	The axis cannot be operated as competing positioning axes, for example because the axis is the slave axis within a closed gantry group or a gantry group to be closed.
Reaction:	Alarm display.

Remedy: Please inform the authorized personnel/service department. Reset MD30450 \$MA_IS_CONCURRENT_POS_AX for the axis concerned.

Programm continuation: Clear alarm with the RESET key. Restart part program

4310 Declaration in MD %1 index %2 is not allowed.

Parameters: %1 = String: MD identifier
%2 = Index: MD array index

Explanation: The machine data values must be written in the array in ascending order.

Reaction: Mode group not ready.
Channel not ready.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Inform the authorized personnel/service department. Correct the MD.

Programm continuation: Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

4320 Axis %1 function %2 %3 and %4 not allowed

Parameters: %1 = String: Axis identifier
%2 = String: MD identifier
%3 = String: Bit
%4 = String: MD identifier

Explanation: The functions declared by the specified machine data cannot simultaneously be active for one axis.

Reaction: Mode group not ready.
Channel not ready.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Deactivate one of the two functions.

Programm continuation: Switch control OFF - ON.

4334 [Channel %1:] The amount of fine correction in parameter %2 of the orientable toolholder %3 is too large

Parameters: %1 = Channel number
%2 = Invalid parameter of the orientable toolholder
%3 = Number of the orientable toolholder

Explanation: The maximum permissible value of the fine correction in an orientable toolholder is limited by the MD20188 \$MC_TOCARR_FINE_LIM_LIN for linear variables, and by the MD20190 \$MC_TOCARR_FINE_LIM_ROT for rotary variables. The alarm can only occur if the SD42974 \$SC_TOCARR_FINE_CORRECTION is not equal to zero.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.
NC Stop on alarm at block end.

Remedy: Enter a valid fine correction value.

Programm continuation: Clear alarm with the RESET key. Restart part program

4336	[Channel %1:] Orientable toolholder no. %2 for orientation transformation %3 does not exist
Parameters:	%1 = Channel number %2 = Number of the orientable toolholder %3 = Number of the orientation transformation that is to be parameterized with the orientable toolholder
Explanation:	The orientable toolholder, with whose data the orientation transformation is to be parameterized (see MD2.... \$MC_TRAFO5_TCARR_NO_...), does not exist.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Enter a valid tool-carrier number.
Programm continuation:	Clear alarm with the RESET key. Restart part program
4338	[Channel %1:] Invalid transformation type '%2' in toolholder %3 for orientation transformer %4
Parameters:	%1 = Channel number %2 = Transformer type %3 = Number of the orientable toolholder %4 = Number of the orientation transformation that is to be parameterized with the orientable toolholder
Explanation:	The parameters of the orientation transformation are taken over from the data of an orientable toolholder. This orientable toolholder contains an invalid transformation type. (Types T, P and M are permissible).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Enter a valid transformation type.
Programm continuation:	Clear alarm with the RESET key. Restart part program
4340	[Channel %1:] Block %2 invalid transformation type in transformation no. %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Transformation number
Explanation:	An invalid, i.e. undefined number was entered in one of the machine data \$MC_TRAFO_TYPE_.... This alarm also occurs if a certain type of transformation is only impossible on the type of control used (e.g. a 5-axis transformation).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Enter a valid transformation type.
Programm continuation:	Clear alarm with the RESET key. Restart part program
4341	[Channel %1:] Block %2 no data set available for transformation no. %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Transformation number

Explanation:	This alarm is output if an attempt is made to set multiple transformations of a group. Only a limited number of machine data sets, usually 2, is available for each related group of transformations (e.g. orientation transformations, Transmit, Tracyl, etc.). Example: Two orientation transformations are allowed. The machine data contains, for example: TRAFO_TYPE_1 = 16 ; 1st orientation transformation TRAFO_TYPE_2 = 33 ; 2nd orientation transformation TRAFO_TYPE_3 = 256 ; 1st transmit transformation TRAFO_TYPE_4 = 20 ; 3rd orientation transformation ==> This entry triggers the alarm
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Enter valid machine data.
Programm continuation:	Clear alarm with the RESET key. Restart part program

4343	[Channel %1:] Attempt made to change the machine data of an active transformation.
Parameters:	%1 = Channel number
Explanation:	An attempt was made to change the machine data of an active transformation and to activate the machine data with RESET or NEWCONFIG.
Reaction:	Interpreter stop Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Set valid machine data.
Programm continuation:	Clear alarm with the RESET key. Restart part program

4344	[Channel %1:] Block %2 Axis %3 defined in \$NK_NAME[%4] is not available in the current channel
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name %4 = Index of the chain element
Explanation:	In the specified chain element a machine axis was indicated that is not available in the current channel on transformation selection. This means that this axis is currently assigned to another channel.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Specify the axis available in the channel.
Programm continuation:	Clear alarm with the RESET key. Restart part program

4345	[Channel %1:] Invalid configuration in chained transformation no. %2
Parameters:	%1 = Channel number %2 = Transformation number

Explanation:	A chained transformation is incorrectly configured (MD24995 \$MC_TRACON_CHAIN_1 or MD24996 \$MC_TRACON_CHAIN_2). The following causes of the error are possible: - The list of transformations to be chained starts with a 0. At least one entry not equal to zero is required. - The list of transformations to be chained contains the number of a transformation which does not exist. - The number of a transformation in the list is greater than or equal to the number of the chained transformation. Example: The cascaded transformation is the fourth transformation in the system, i.e. MD24400 \$MC_TRAFO_TYPE_4 = 8192. In this case, only values 1, 2 or 3 may be entered in the associated list (e.g. MD24995 \$MC_TRACON_CHAIN_1[...]). - The chaining setting is invalid. The following restrictions currently apply. A maximum of two transformations can be chained. The first transformation must be an orientation transformation, transmit, peripheral curve transformation or inclined axis. The second transformation must be the inclined axis transformation.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Set a valid transformation chain.
Programm continuation:	Clear alarm with the RESET key. Restart part program

4346	[Channel %1:] Invalid geoaxis assignment in machine data %2[%3]
Parameters:	%1 = Channel number %2 = Name of machine data %3 = Index of the transformation geometry axis
Explanation:	MD2.... \$MC_TRAFO_GEOAX_ASSIGN_TAB_... contains an invalid entry. The following causes for the error are possible: - The entry references a channel axis which does not exist. - The entry is zero (no axis) but the transformation needs the relevant axis as a geometry axis.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Correct the entry in MD2.... \$MC_TRAFO_GEOAX_ASSIGN_TAB_... or MD2.... \$MC_TRAFO_AXES_IN_... .
Programm continuation:	Clear alarm with the RESET key. Restart part program

4347	[Channel %1:] Invalid channel axis assignment in machine data %2[%3]
Parameters:	%1 = Channel number %2 = Name of machine data %3 = Index of the transformation axis
Explanation:	The specified machine data (identifier and array index) contains an invalid entry. The following causes for the error are possible: - The entry refers to a channel axis which does not exist. - The entry is zero (no axis), but the transformation needs the relevant axis as a channel axis. - More than one external axis has been entered in MD2.... \$MC_TRAFO_AXES_IN_... for the 7-axis transformation.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Correct the entry in MD2.... \$MC_TRAFO_AXES_IN_... .
Programm continuation:	Clear alarm with the RESET key. Restart part program

4348	[Channel %1:] Block %2 Configuration error %6 in transformation \$NT_NAME[%5] = '%3'.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Name of the transformation data record %4 = Index of the transformation data record error number

Explanation:

The transformation data set is incorrect. The cause of the error is given by the following error number:

- 1. The transformation type is not known, i.e. \$NT_TRAFO_TYPE[n] contains an invalid name.
- 2. The machine kinematics have not been defined, in other words, neither in \$NT_T_CHAIN_LAST_ELEM[n] nor in \$NT_P_CHAIN_LAST_ELEM[n] is there a reference to a kinematic chain element in the kinematic description of the machine.
- 3. The kinematic chain element with the name contained in \$NT_T_CHAIN_LAST_ELEM[n] has no connection to the root element.
- 4. The kinematic chain element with the name contained in \$NT_P_CHAIN_LAST_ELEM[n] has no connection to the root element.
- 5. The kinematic chain element with the name contained in \$NT_T_CHAIN_LAST_ELEM[n] was not found.
- 6. There is no kinematic chain element (MD18880 \$MN_MM_MAXNUM_KIN_CHAIN_ELEM is zero).
- 8. The kinematic chain element with the name contained in \$NT_P_CHAIN_LAST_ELEM[n] was not found.
- 9. The kinematic chain element with the name contained in \$NT_T_REF_ELEM[n] was not found.
- 10. The rotary axis defined in \$NT_ROT_AX_NAME[n,0] was not found in the kinematic chain.
- 11. The rotary axis defined in \$NT_ROT_AX_NAME[n,1] was not found in the kinematic chain.
- 12. The rotary axis defined in \$NT_ROT_AX_NAME[n,2] was not found in the kinematic chain.
- 16. The rotary axis defined in \$NT_ROT_AX_NAME[n,1] has been defined more than once.
- 17. The rotary axis defined in \$NT_ROT_AX_NAME[n,2] has been defined more than once.
- 20. The linear axis defined in \$NT_GEO_AX_NAME[n,0] was not found in the kinematic chain.
- 21. The linear axis defined in \$NT_GEO_AX_NAME[n,1] was not found in the kinematic chain.
- 22. The linear axis defined in \$NT_GEO_AX_NAME[n,2] was not found in the kinematic chain.
- 26. The linear axis defined in \$NT_GEO_AX_NAME[n,1] has been defined more than once.
- 27. The linear axis defined in \$NT_GEO_AX_NAME[n,2] has been defined more than once.
- 28. In the kinematic description of the transformation, a linear axis was specified more than once (at least two chain elements of the type AXIS_LIN refer to the same machine axis in component \$NK_AXIS[n]).
- 29. In the kinematic description of the transformation, a rotary axis was specified more than once (at least two chain elements of the type AXIS_ROT refer to the same machine axis in component \$NK_AXIS[n]).
- 30. The base orientation has not been defined, in other words, all three components of \$NT_BASE_ORIENT[n, 0..2] are zero.
- 31. The orientation normal vector has not been defined, in other words all three components of \$NT_BASE_ORIENT_NORMAL[n, 0..2] are zero.
- 32. The vectors for definition of the base orientation (\$NT_BASE_ORIENT[n, 0..2]) and the base normal vector (\$NT_BASE_ORIENT_NORMAL[n, 0..2]) are parallel.
- 36. The number of relevant rotary axes found in the part chain is not the same as the content of \$NT_ROT_AX_CNT[n,0].
- 37. The number of relevant rotary axes found in the tool chain is not the same as the content of \$NT_ROT_AX_CNT[n,1].
- 40. The first and the second orientation axes of an orientation transformation are parallel.
- 41. The second and the third orientation axes of an orientation transformation are parallel.
- 42. No orientation axis has been defined (an orientation transformation requires at least one orientation axis).
- 43. Invalid 3-axis orientation transformation: The orientation axis is not perpendicular to the plane created by the two geometry axes.
- 47. System variable \$NT_CLOSE_CHAIN_P is disabled in the current software version, and may only contain the zero string.
- 48. The chain element specified in \$NT_CLOSE_CHAIN_T was not found.
- 50. Fewer than two geometry axes have been defined for an orientation transformation or an inclined axis transformation.
- 51. Not all three geometry axes have been defined for an orientation transformation with more than one orientation axis.
- 60. Geometry axes 1 and 2 are parallel.
- 61. Geometry axes 1 and 3 are parallel.
- 62. Geometry axes 2 and 3 are parallel.
- 65. The 3 geometry axes are on one plane.
- 68. The function "Close the part chain" is not defined for this transformation.
- 69. The function "Close the tool chain" is not defined for this transformation.
- 80. Invalid definition sequence of orientation axes. The orientation axes in \$NT_ROT_AX_NAME[n, 0..2] must be defined without gaps starting at index 0. The axis sequence in \$NT_ROT_AX_NAME[n, 0..2] must be equal to the axis sequence in the kinematic chains (when running through the chains from the end of the part chain to the end of the tool chain).
- 81. An orientation axis has been programmed more than once.
- 82. Parameterization of the first orientation axis as a spindle is not permissible.

- 83. Parameterization of the second orientation axis as a spindle is not permissible.
- 84. Parameterization of the third orientation axis as a spindle is not permissible.
- 87. Parameterization of the first orientation axis as a Hirth axis is incorrect, in other words at least one of the machine data MD30502 \$MA_INDEX_AX_DENOMINATOR, MD30501 \$MA_INDEX_AX_NUMERATOR, or MD30330 \$MA_MODULO_RANGE (for modulo axes) is zero.
- 88. Parameterization of the second orientation axis as a Hirth axis is incorrect. The error conditions are the same as for error number 87.
- 89. Parameterization of the third orientation axis as a Hirth axis is incorrect. The error conditions are the same as for error number 87.
- 100. The maximum number of kinematic elements (sum of linear axes, rotary axes and constant elements) has been exceeded. In this case, a sequence of constant elements in a chain, which is not interrupted by an axis, is only considered as one element.

A maximum of 15 kinematic elements is currently permissible for orientation transformations.

- 101. The maximum number of rotary axes in the kinematic chains for the definition of a transformation has been exceeded.
- 103. The maximum number of elements in the definition of the kinematic chain for the tool has been exceeded.
- 104. The maximum number of elements in the definition of the kinematic chain for the workpiece has been exceeded.
- 105. The maximum permissible number of constant transformation axes (redundant (rotary) axes), which must not move with an active transformation, has been exceeded.

A maximum of 6 rotary axes is currently permissible for orientation transformations.

- 106. The maximum permissible number of chain elements for internal representation of the machine kinematics has been exceeded.
- 110. The kinematic chain element with the name contained in \$NT_T_CHAIN_FIRST_ELEM[n] was not found.
- 111. The kinematic chain element with the name contained in \$NT_P_CHAIN_FIRST_ELEM[n] was not found.
- 141. The three-bit number for identifying the permutation of the geometry axes (bit 11 to bit 13 in \$NT_CNTRL[n] with Transmit or Tracyl) contains a value greater than 5.
- 142. Impermissible permutation of the geometry axes (bit 11 to bit 13 in \$NT_CNTRL[n] with Transmit or Tracyl). In the assignment of the geometry axes to the input axes of the transformation, unassigned places must not be transposed.
- 143. The parameterization of the Transmit or Tracyl transformation requires a center offset axis.
- 144. An axis name must be entered in \$NT_ROT_AX_NAME[n, 1], and only there.
- 145. After the polar axis (\$NT_ROT_AX_NAME[n, 1]), an invalid offset has been entered in the kinematic chain in the direction toward the workpiece zero.
- 146. If bit 19 is set in \$NT_CNTRL[n] for Transmit or Tracyl, the last element in the kinematic chain must be a rotary axis or a constant rotation.
- 149. After the polar axis (\$NT_ROT_AX_NAME[n, 1]), an impermissible rotation is active in the direction toward the workpiece zero (constant rotation or constant rotary axis).
- 150. Impermissible type of chain element (system error).
- 160. No axis name entered in \$NT_GEO_AX_NAME[n, 0].
- 161. No axis name entered in \$NT_GEO_AX_NAME[n, 1] although a center offset axis specified.
- 170. The only defined geometry axis must be in \$NT_GEO_AX_NAME[n, 2].
- 171. The parameter \$NT_GEO_AX_NAME[n, 2] is empty. The entry in \$NT_GEO_AX_NAME[n, 2] must always be present.
- 180. No spindle was defined (the interpolated turning transformation requires a spindle).
- 181. More than one rotary axis was defined (the interpolated turning transformation requires exactly one rotary axis that is defined as a spindle).
- 182. For the interpolated turning transformation, the spindle must be defined in \$NT_ROT_AX_NAME[n, 0].
- 183. For the interpolated turning transformation, a rotary axis was defined in \$NT_ROT_AX_NAME[n, 0] that is not configured as a spindle.
- 184. For the interpolated turning transformation, the direction of the spindle in \$NK_OFF_DIR was not entered as (0,0,-1).
- 200. At the end of the part chain, a correction element is defined although bit 7 is set in \$NT_CNTRL[n] (close part chain).
- 201. At the start of the tool chain, a correction element is defined although bit 8 is set in \$NT_CNTRL[n] (close tool chain).
- 300. The chain element to which \$NT_CORR_ELEM_P[n, 0] refers was not found.
- 301. The chain element to which \$NT_CORR_ELEM_P[n, 1] refers was not found.
- 302. The chain element to which \$NT_CORR_ELEM_P[n, 2] refers was not found.
- 303. The chain element to which \$NT_CORR_ELEM_P[n, 3] refers was not found.
- 310. The chain element to which \$NT_CORR_ELEM_T[n, 0] refers was not found.

- 311. The chain element to which \$NT_CORR_ELEM_T[n, 1] refers was not found.
- 312. The chain element to which \$NT_CORR_ELEM_T[n, 2] refers was not found.
- 313. The chain element to which \$NT_CORR_ELEM_T[n, 3] refers was not found.
- 320. The chain element to which \$NT_CORR_ELEM_P[n, 0] refers is not in the associated section.
- 321. The chain element to which \$NT_CORR_ELEM_P[n, 1] refers is not in the associated section.
- 322. The chain element to which \$NT_CORR_ELEM_P[n, 2] refers is not in the associated section.
- 323. The chain element to which \$NT_CORR_ELEM_P[n, 3] refers is not in the associated section.
- 330. The chain element to which \$NT_CORR_ELEM_T[n, 0] refers is not in the associated section.
- 331. The chain element to which \$NT_CORR_ELEM_T[n, 1] refers is not in the associated section.
- 332. The chain element to which \$NT_CORR_ELEM_T[n, 2] refers is not in the associated section.
- 333. The chain element to which \$NT_CORR_ELEM_T[n, 3] refers is not in the associated section.
- 500. No transformation chain is defined for a concatenated transformation, at least one transformation must be defined with \$NT_TRACON_CHAIN[.].
- 501. The transformation stated in \$NT_TRACON_CHAIN[n, 0] is not defined.
- 502. The transformation stated in \$NT_TRACON_CHAIN[n, 1] is not defined.
- 503. The transformation stated in \$NT_TRACON_CHAIN[n, 2] is not defined.
- 504. The transformation stated in \$NT_TRACON_CHAIN[n, 3] is not defined.
- 520. The stated transformation data block is defective on activation of a concatenated transformation.
- 521. The definition of the transformation chain leads to an endless recursion.
- 522. Too many concatenated transformations are defined for the definition of a transformation chain (8 is the maximum possible here).
- 523. An impermissible chain of partial transformations has been configured in a concatenated transformation.
- 1000. The OEM transformation cannot be activated because it was not logged on by the CC.
- 1001. The OEM transformation has been logged on as an orientation transformation, but it is not configured as an orientation transformation.
- 1002. The OEM transformation is configured as an orientation transformation, but it was not logged on as an orientation transformation.
- 1003. The activated OEM transformation does not behave like an orientation transformation, although the transformation was not configured or logged on for orientations.
- 1004. No geometry axes are defined for the activated OEM transformation (neither by the CC nor in the system variable \$NT_GEO_AX_NAME[n, i]).
- 1005. No orientation axes are defined for the activated OEM transformation, although this was configured as an orientation transformation (neither by the CC nor in the system variable \$NT_ROT_AX_NAME[n, i]).
- 1006. The OEM transformation does not support any rotation of the orientation, although the transformation was configured with 3 orientation axes.
- 1007. The OEM transformation was created for rotations of the orientation, but the transformation was not configured in this way (fewer than 3 orientation axes).
- 1050. The OEM transformation reports a general kinematic analysis error. (This occurs, for example, if the analyseChain() method has not been implemented in the CC.)
- 1051. An unknown element was discovered during the analysis of the kinematic chain by the OEM transformation.
- 1052. An offset element is incorrectly arranged in the kinematic chain for the OEM transformation.
- 1053. The stated arrangement of a linear axis is not allowed in the kinematic chain.
- 1054. The stated arrangement of a rotary axis is not allowed in the kinematic chain.
- 1055. The stated direction of a linear axis is not allowed in the kinematic chain.
- 1056. The stated direction of rotation of a rotary axis is not allowed in the kinematic chain.
- 1057. Reserved for error messages of the kinematic analysis of compile cycles.
- 1058. Reserved for error messages of the kinematic analysis of compile cycles.
- 1059. Reserved for error messages of the kinematic analysis of compile cycles.
- 1060. Reserved for error messages of the kinematic analysis of compile cycles.
- 1061. Reserved for error messages of the kinematic analysis of compile cycles.
- 1062. Reserved for error messages of the kinematic analysis of compile cycles.
- 1063. Reserved for error messages of the kinematic analysis of compile cycles.
- 1064. Reserved for error messages of the kinematic analysis of compile cycles.
- 1065. Reserved for error messages of the kinematic analysis of compile cycles.

- 1066. Reserved for error messages of the kinematic analysis of compile cycles.
- 1067. Reserved for error messages of the kinematic analysis of compile cycles.
- 1068. Reserved for error messages of the kinematic analysis of compile cycles.
- 1069. Reserved for error messages of the kinematic analysis of compile cycles.
- 1070. The orientation of the tool in the basic position must be parallel to one of the coordinate axes X, Y or Z (value of the variable \$NT_BASE_ORIENT[i]).
- 1071. The orientation of the tool in the basic position must not be parallel to the X direction (value of the variable \$NT_BASE_ORIENT[0]).
- 1072. The orientation of the tool in the basic position must not be parallel to the Y direction (value of the variable \$NT_BASE_ORIENT[1]).
- 1073. The orientation of the tool in the basic position must not be parallel to the Z direction (value of the variable \$NT_BASE_ORIENT[2]).
- 1074. The normal vector of the tool in the basic position must be parallel to one of the coordinate axes X, Y or Z (value of the variable \$NT_BASE_ORIENT_NORMAL[i]).
- 1075. The normal vector of the tool in the basic position must not be parallel to the X direction (value of the variable \$NT_BASE_ORIENT_NORMAL[0]).
- 1076. The normal vector of the tool in the basic position must not be parallel to the Y direction (value of the variable \$NT_BASE_ORIENT_NORMAL[1]).
- 1077. The normal vector of the tool in the basic position must not be parallel to the Z direction (value of the variable \$NT_BASE_ORIENT_NORMAL[2]).
- 1078. Reserved for error messages from the analysis of the transformation parameters of compile cycles.
- 1079. Reserved for error messages from the analysis of the transformation parameters of compile cycles.
- 1080. Reserved for error messages from the analysis of the transformation parameters of compile cycles.
- 1081. Reserved for error messages from the analysis of the transformation parameters of compile cycles.
- 1082. Reserved for error messages from the analysis of the transformation parameters of compile cycles.
- 1083. Reserved for error messages from the analysis of the transformation parameters of compile cycles.
- 1084. Reserved for error messages from the analysis of the transformation parameters of compile cycles.
- 1085. Reserved for error messages from the analysis of the transformation parameters of compile cycles.
- 1086. Reserved for error messages from the analysis of the transformation parameters of compile cycles.
- 1087. Reserved for error messages from the analysis of the transformation parameters of compile cycles.
- 1088. Reserved for error messages from the analysis of the transformation parameters of compile cycles.
- 1089. Reserved for error messages from the analysis of the transformation parameters of compile cycles.
- 1090. Reserved for error messages from the analysis of the transformation parameters of compile cycles.
- 10000. Invalid redundant rotary axis. Only one redundant rotary axis is permissible for orientation transformation (for the time being). This rotary axis must be the first axis in the kinematic chain.

Note:

Parameter 4 contains the descriptions of parameters 5 and 6 separated by the "|" character.

- 5 = Index of the transformation data block
- 6 = Error code

Reaction:

Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm at block end.

Remedy:

Define valid transformation data record.

**Programm
continuation:**

Clear alarm with the RESET key. Restart part program

4349 [Channel %1:] No free memory space available for transformations.**Parameters:**

%1 = Channel number
%2 = Number of the transformations already active

Explanation:	Any kinematic transformation in the NCK requires a defined memory space. If MD18866 \$MN_MM_NUM_KIN_TRAFOS does not equal zero, it indicates how many kinematic transformations are allowed to be active in the NCK at the same time. If MD18866 \$MN_MM_NUM_KIN_TRAFOS equals zero, the maximum number of kinematic transformations that are active at the same time, is determined automatically (currently twenty times the number of the existing channels).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Increase the value of MD18866 \$MN_MM_NUM_KIN_TRAFOS.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

4400	MD alteration will cause reorganization of buffered memory (Art %1), (loss of data!) - %2
Parameters:	%1 = Memory type %2 = MD identifier, if required
Explanation:	A machine data has been altered that configures the buffered memory. If the NCK powers up with the altered data, this will lead to reorganization of the buffered memory and thus to the loss of all buffered user data (part programs, tool data, GUD, leadscrew error compensation, ...) Meaning of the 1st parameter 0x00 buffered memory (internal) 0x01 buffered memory
Reaction:	Alarm display.
Remedy:	If the control includes user data that have not yet been saved, then a data backup must be performed before the next NC power-up. By manually resetting the altered MD to the value it had before the last power-up, reorganization of the memory can be avoided.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

4402	%1 causes a machine data reset
Parameters:	%1 = Machine data
Explanation:	If this machine data is set, the current machine data values are overwritten by the default values at the next ramp-up. Under certain circumstances, this may cause data loss (even in the buffered memory).
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. If the control includes user data that has not yet been saved, then a data backup must be performed before the next NCK power-up. By manually resetting the altered MD to the value it had before the last power-up, reorganization of the memory can be avoided.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

4500	Error %2 occurred (data loss!) while writing AMR backup file %1.
Parameters:	%1 = File name %2 = Error code
Explanation:	The backup file for the automatic memory configuration was not able to be written to
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department.
Programm continuation:	Switch control OFF - ON.

4501	While reading the AMR backup file %1, error %2 occurred (data loss!)
Parameters:	%1 = File name %2 = Error code
Explanation:	The backup file for automatic memory reconfiguration could not be read

Reaction: Alarm display.
Remedy: Please inform the authorized personnel/service department.
Programm continuation: Switch control OFF - ON.

4503 [TO unit %1:] H number %2 assigned more than once. Machine data is not set.

Parameters: %1 = TO unit
%2 = H number

Explanation: This error can only occur if MD10880 \$MN_MM_EXTERN_CNC_SYSTEM= 1 or 2. MD10890, \$MN_EXTERN_TOOLPROG_MODE bit 3 is reset (this MD becomes effective at power-on). On checking data management, it was found that various edges of the same TO unit had the same H number. MD10890 \$MN_EXTERN_TOOLPROG_MODE bit 3 remains set and is not included in data management.

Reaction: Alarm display.

Remedy: H numbers must be assigned only once in a TO unit. Then, MD10890, \$MN_EXTERN_TOOLPROG_MODE, bit 3 can be set = 0 and a restart can be performed.

Programm continuation: Clear alarm with the Delete key or NC START.

4600 Invalid handwheel type for handwheel %1

Parameters: %1 = Handwheel number

Explanation: The handwheel type (hardware segment) for handwheel %1 requested through MD11350 \$MN_HANDWHEEL_SEGMENT is invalid.

Reaction: Interface signals are set.
Alarm display.

Remedy: Configure a valid type for the corresponding handwheel through MD11350 \$MN_HANDWHEEL_SEGMENT.

Programm continuation: Switch control OFF - ON.

4610 Invalid handwheel module for handwheel %1

Parameters: %1 = Handwheel module

Explanation: The handwheel module for handwheel %1 requested through MD11351 \$MN_HANDWHEEL_MODULE is not available. Therefore MD11351 \$MN_HANDWHEEL_MODULE = 1 must always be set for directly connected handwheels.

Reaction: Interface signals are set.
Alarm display.

Remedy: Set machine data MD11351 \$MN_HANDWHEEL_MODULE = 1 for the corresponding handwheel.

Programm continuation: Switch control OFF - ON.

4611 Invalid handwheel input for handwheel %1

Parameters: %1 = Handwheel input

Explanation: The handwheel input for handwheel %1 requested through MD11352 \$MN_HANDWHEEL_INPUT is not available. A maximum of 2 or 3 handwheels can be connected directly to diverse systems.

Reaction: Interface signals are set.
Alarm display.

Remedy: Configure MD11352 \$MN_HANDWHEEL_INPUT for a valid input for the corresponding handwheel

Programm continuation: Switch control OFF - ON.

4620 Invalid handwheel module for handwheel %1

Parameters: %1 = Handwheel module

Explanation:	The handwheel module for handwheel %1 requested through MD11351 \$MN_HANDWHEEL_MODULE is not available. Therefore MD11351 \$MN_HANDWHEEL_MODULE = 1 must always be set for directly connected handwheels.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Set MD11351 \$MN_HANDWHEEL_MODULE = 1 for the corresponding handwheel. For other systems, MD11350 \$MN_HANDWHEEL_SEGMENT should be checked.
Programm continuation:	Switch control OFF - ON.

4621 Invalid handwheel input for handwheel %1

Parameters:	%1 = Handwheel input
Explanation:	The handwheel input for handwheel %1 requested through MD11352 \$MN_HANDWHEEL_INPUT is not available. A maximum of 2 handwheels can be directly connected.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Configure MD11352 \$MN_HANDWHEEL_INPUT for a valid input for the corresponding handwheel. MD11350 \$MN_HANDWHEEL_SEGMENT should also be checked.
Programm continuation:	Switch control OFF - ON.

4630 Invalid handwheel module for handwheel %1

Parameters:	%1 = Handwheel module
Explanation:	For PROFIBUS/PROFINET only: The reference in \$MN_HANDWHEEL_MODULE to a corresponding entry in machine data array \$MN_HANDWHEEL_LOGIC_ADDRESS[] which is required for configuring PROFIBUS/PROFINET handwheels is not available.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Configure the machine data MD11351 \$MN_HANDWHEEL_MODULE for the corresponding PROFIBUS/PROFINET handwheel so that there is a valid reference to an entry in the machine data array MD11353 \$MN_HANDWHEEL_LOGIC_ADDRESS[].
Programm continuation:	Switch control OFF - ON.

4631 Invalid handwheel slot for handwheel %1

Parameters:	%1 = Handwheel slot
Explanation:	For PROFIBUS/PROFINET only: The handwheel slot for handwheel %1 requested through machine data \$MN_HANDWHEEL_INPUT is not available for PROFIBUS/PROFINET handwheels.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Configure machine data MD11352 \$MN_HANDWHEEL_INPUT to a valid handwheel slot for the corresponding PROFIBUS/PROFINET handwheel.
Programm continuation:	Switch control OFF - ON.

4632 Logical PROFIBUS/PROFINET handwheel slot base address for %1. handwheel not found

Parameters:	%1 = Handwheel number
Explanation:	For PROFIBUS/PROFINET only: The logical basic address of the PROFIBUS/PROFINET handwheel slot in machine data array \$MN_HANDWHEEL_LOGIC_ADDRESS[] indexed in machine data \$MN_HANDWHEEL_MODULE was not found in the current PROFIBUS/PROFINET configuration.
Reaction:	Interface signals are set. Alarm display.

Remedy: Check if MD11351 \$MN_HANDWHEEL_MODULE of the corresponding handwheel is correct. Check if indexed logical base address of PROFIBUS/PROFINET handwheel slot in machine data array MD11353 \$MN_HANDWHEEL_LOGIC_ADDRESS[] is correct.

Programm continuation: Switch control OFF - ON.

4640 Invalid handwheel module for handwheel %1

Parameters: %1 = Handwheel module

Explanation: For ETHERNET only:

The handwheel module for handwheel %1 requested through MD11351 \$MN_HANDWHEEL_MODULE is not available for ETHERNET handwheels. MD11351 \$MN_HANDWHEEL_MODULE = 1 must always be set when configuring ETHERNET handwheels.

Reaction: Interface signals are set.
Alarm display.

Remedy: Set machine data MD11351 \$MN_HANDWHEEL_MODULE = 1 for the corresponding handwheel.

Programm continuation: Switch control OFF - ON.

4641 Invalid handwheel input for handwheel %1

Parameters: %1 = Handwheel input

Explanation: For ETHERNET only:

The handwheel input for handwheel %1 requested through MD11352 \$MN_HANDWHEEL_INPUT is not available for ETHERNET handwheels. A maximum of 6 handwheels can be configured.

Reaction: Interface signals are set.
Alarm display.

Remedy: Configure MD11352 \$MN_HANDWHEEL_INPUT for a valid input for the corresponding handwheel

Programm continuation: Switch control OFF - ON.

5000 Communication job not executable %1

Parameters: %1 = Reference to which resources are no longer available.

Explanation: The communication job cannot be executed because there is insufficient memory space. Cause: too many communication jobs in parallel.

Reaction: Alarm display.

Remedy: Please notify the authorized service personnel.

Reduce the number of communication jobs taking place at the same time or increase MD10134 \$MN_MM_NUM_MMC_UNITS

The alarm can be suppressed with MD11410 \$MN_SUPPRESS_ALARM_MASK bit 15.

Programm continuation: Clear alarm with the Delete key or NC START.

5010 Communication job not executable %1

Parameters: %1 = Reference to which resources are no longer available.

Explanation: The communication job cannot be executed because there is insufficient memory space. Cause: too many communication jobs in parallel.

Reaction: Alarm display.

Remedy: Please notify the authorized service personnel.

Reduce the number of communication jobs taking place simultaneously. Resources cannot be increased any further.

The alarm can be suppressed with MD11410 \$MN_SUPPRESS_ALARM_MASK bit 15.

Programm continuation: Clear alarm with the Delete key or NC START.

5020	Communication job is too extensive %1
Parameters:	%1 = Indication of what is illegal.
Explanation:	The communication job is illegal. Cause: the job is too extensive for the size of the PDU used.
Reaction:	Alarm display.
Remedy:	Please notify the authorized service personnel. Correct the configuration of the communication job on the client side (HMI, PLC or OPCUA). The alarm can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK2 bit 27.
Programm continuation:	Clear alarm with the Delete key or NC START.
5030	Communication job not executable %1
Parameters:	%1 = Reference to which resources are no longer available.
Explanation:	The communication job cannot be executed because the transmission path of the communication is generally overloaded.
Reaction:	Alarm display.
Remedy:	Please notify the authorized service personnel. Check whether more devices are connected to the NCK than is permitted. The alarm can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK2 bit 28.
Programm continuation:	Clear alarm with the Delete key or NC START.
6000	Memory reorganized using standard machine data
Explanation:	The memory management was not able to allocate the NC user memory with the values in the machine data. It did not have enough memory available because the total memory available is provided as dynamic and static memory for the NC user (e.g. for macro definitions, user variables, number of tool offsets, number of directories and files etc.).
Reaction:	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Redefine the NC memory structure! A specific MD for NC user memory allocation cannot be stated to be the cause of the alarm. The MD initiating the alarm therefore has to be determined on the basis of the default values in the machine data by changing the user-specific memory structure step by step. Usually, it is not just one single MD that has been set too large. Therefore it is advisable to reduce the memory area by a certain proportion in several MDs.
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.
6010	[Channel %1:] Data block %2 not or not completely created, error code %3
Parameters:	%1 = Channel number %2 = String (block name) %3 = Internal error code

Explanation: Data management has detected an error during ramp-up. The specified data block may not have been created. The error number specifies the type of error. An error number >100000 indicates a fatal system error. Other error numbers indicate that the user memory area provided is too small. In this case the (user) error numbers have the following meaning:

- Error number 1: No memory space available
- Error number 2: Maximum possible number of symbols exceeded
- Error number 3: Index 1 lies outside the valid value range
- Error number 4: Name already exists in channel
- Error number 5: Name already exists in NCK

If the alarm occurs after cycle programs, macro definitions or definitions for global user data (GUD) have been introduced, the machine data for the user memory configuration has been configured incorrectly. In all other cases, changes to machine data that is already correct lead to errors in the user memory configuration.

The following block names (2nd parameter) are known in the NCK (all system and user data blocks; in general, only problems in the user data blocks can be remedied by user intervention):

- _N_NC_OPT - System internal: option data, NCK global
- _N_NC_SEA - System internal: setting data, NCK global
- _N_NC_TEA - System internal: machine data, NCK global
- _N_NC_CEC - System internal: 'cross error compensation'
- _N_NC_PRO - System internal: protection areas, NCK global
- _N_NC_GD1 - User: 1st GUD block defined by _N_SGUD_DEF, NCK global
- _N_NC_GD2 - User: 2nd GUD block defined by _N_MGUD_DEF, NCK global
- _N_NC_GD3 - User: 3rd GUD block defined by _N_UGUD_DEF, NCK global
- _N_NC_GD4 - User: 4th GUD block defined by _N_GUD4_DEF, NCK global
- _N_NC_GD5 - User: 5th GUD block defined by _N_GUD5_DEF, NCK global
- _N_NC_GD6 - User: 6th GUD block defined by _N_GUD6_DEF, NCK global
- _N_NC_GD7 - User: 7th GUD block defined by _N_GUD7_DEF, NCK global
- _N_NC_GD8 - User: 8th GUD block defined by _N_GUD8_DEF, NCK global
- _N_NC_GD9 - User: 9th GUD block defined by _N_GUD9_DEF, NCK global
- _N_NC_MAC - User: macro definitions
- _N_NC_FUN - System internal: predefined functions and procedures, NCK global
- _N_CHc_OPT - System internal: option data, channel-specific
- _N_CHc_SEA - System internal: setting data, channel-specific
- _N_CHc_TEA - System internal: machine data, channel-specific
- _N_CHc_PRO - System internal: protection areas, channel-specific
- _N_CHc_UFR - System internal: frames, channel-specific
- _N_CHc_RPA - System internal: R-variables, channel-specific
- _N_CHc_GD1 - User: 1st GUD block defined by _N_SGUD_DEF, channel-specific
- _N_CHc_GD2 - User: 2nd GUD block defined by _N_MGUD_DEF, channel-specific
- _N_CHc_GD3 - User: 3rd GUD block defined by _N_UGUD_DEF, channel-specific
- _N_CHc_GD4 - User: 4th GUD block defined by _N_GUD4_DEF, channel-specific
- _N_CHc_GD5 - User: 5th GUD block defined by _N_GUD5_DEF, channel-specific
- _N_CHc_GD6 - User: 6th GUD block defined by _N_GUD6_DEF, channel-specific
- _N_CHc_GD7 - User: 7th GUD block defined by _N_GUD7_DEF, channel-specific
- _N_CHc_GD8 - User: 8th GUD block defined by _N_GUD8_DEF, channel-specific
- _N_CHc_GD9 - User: 9th GUD block defined by _N_GUD9_DEF, channel-specific
- _N_AXa_OPT - System internal: option data, axial
- _N_AXa_SEA - System internal: setting data, axial
- _N_AXa_TEA - System internal: machine data, axial
- _N_AXa_EEC - System internal: leadscrew error compensation data, axial
- _N_AXa_QEC - System internal: quadrant error compensation data, axial
- _N_ToT_TOc - System internal: toolholder data, TOA-specific
- _N_ToT_TOA - System internal: tool data, TOA-specific
- _N_ToT_TMA - System internal: magazine data, TOA-specific
- _N_NC_KIN - System internal: data to describe kinematic chains, NCK-specific

- `_N_NC_NPA` - System internal: data to describe 3D protection areas, NCK-specific
- `_N_NC_TRA` - System internal: transformation data sets, NCK-specific
- `_N_NC_WAL` - System internal: data to describe coordinate-specific working area limitation
- `_N_COMPLETE_CYD` - System internal: cycle and display machine data, NCK-, channel-, axis-specific

c = Channel number

a = Machine axis number

t = TOA unit number

There are also other internal system data blocks with identifiers.

Reaction:

NC not ready.

Channel not ready.

NC Start disable in this channel.

Interface signals are set.

Alarm display.

NC Stop on alarm.

Remedy:

Correct the machine data or undo the changes made.

Please inform the authorized personnel/service department. There are two determining machine data for cycle programs:

- MD18170 `$MN_MM_NUM_MAX_FUNC_NAMES` = max. number of all cycle programs, error number = 2 shows that this value is too small.

- MD18180 `$MN_MM_NUM_MAX_FUNC_PARAM` = max. number of all parameters defined in the cycle programs, error number = 2 shows that this value is too small

(If these MDs are modified, the memory backup is retained)

The following applies to macro definitions:

MD18160 `$MN_MM_NUM_USER_MACROS` = max. number of all macro definitions, error number = 2 shows that this value is too small.

(If these MDs are modified, the memory backup is retained)

The following applies to GUD variables:

- MD18118 `$MN_MM_NUM_GUD_MODULES` = max. number of GUD data blocks per area (NCK/channel) (if GD1, GD2, GD3, GD9 are to be defined, then the value must be = 9 and not e.g. = 4).

- MD18120 `$MN_MM_NUM_GUD_NAMES_NCK` = max. number of all NCK global GUD variables, error number = 2 shows that this value is too small.

- MD18130 `$MN_MM_NUM_GUD_NAMES_CHAN` = max. number of all channel-specific GUD variables in the channel, error number = 2 shows that this value is too small.

- MD18150 `$MN_MM_GUD_VALUES_MEM` = total value memory of all GUD variables together, error number = 1 shows that this value is too small.

Programm continuation:

Switch control OFF - ON.

6020

Machine data have been changed - now memory %1 is reorganized

Parameters:

%1 = Detailed information

Explanation:

Machine data have been changed that define the NC user memory allocation. Data management has restructured the memory in accordance with the altered machine data.

Meaning of the parameter value:

- AFS = The active file system was reconfigured. The files of the passive file system were retained.

- PFS/AFS = The passive and active file systems were reconfigured.

Via the machine data `$MN_IS_AUTOMATIC_MEM_RECONFIG` it is configured whether NCK configures the AFS automatically (value=TRUE) or not (value=FALSE).

Reaction:

Alarm display.

Remedy:

No remedial measures are required. Any user data that are required must be input again.

Programm continuation:

Clear alarm with the RESET key. Restart part program

6030	Limit of user memory has been adapted
Explanation:	Data management checks during power-up the actually available physical user memory (DRAM, DPRAM and SRAM) with the values in the system-specific machine data MD18210 \$MN_MM_USER_MEM_DYNAMIC, MD18220 \$MN_MM_USER_MEM_DPR und MD18230 \$MN_MM_USERMEM_BUFFERED-USERMEM_BUFFERED.
Reaction:	Alarm display.
Remedy:	No remedial measures are required. The new maximum permissible value can be read from the reduced machine data.
Programm continuation:	Clear alarm with the RESET key. Restart part program
6035	Instead of %1 KB the system has only %2 KB of free user memory of type '%3'
Parameters:	%1 = Free memory capacity in KB defined for the control model %2 = Actual maximum capacity of free memory in KB %3 = Type of memory, "D" =non-battery-backed, "S" =battery-backed
Explanation:	The alarm can only occur after a 'cold start' (=NCK start-up with standard machine data). The alarm is only a notice. There is no interference with any NCK functions. It shows that the NCK has less free user memory available than specified by Siemens for this control variant. The value of the actually available free user memory can also be taken from the MD18050 \$MN_INFO_FREE_MEM_DYNAMIC, MD18060 \$MN_INFO_FREE_MEMS_STATIC. Siemens supplies NCK with default settings that, depending on the model, have certain (free) memory space available for the specific settings of the actual applications. The original factory setting of NCK systems is thus that the alarm does not occur with a cold start.
Reaction:	Alarm display.
Remedy:	Reasons for the message: - The NCK contains compile cycle software, that uses so much memory space that the hardware cannot provide the required memory. - The NCK runs on hardware that is not intended for this NCK release (i.e. that has not enough memory capacity). - If the application runs properly with the remaining free user memory (i.e. can be setup without any errors), the message can simply be ignored. - If the actual application cannot be configured because there is not enough memory capacity available, either the existing compile cycle must be reduced or, if possible, the system must be upgraded with additional memory space.
Programm continuation:	Clear alarm with the RESET key. Restart part program
6401	[Channel %1:] Tool change not possible: Empty location for tool %2 on magazine %4 not available.
Parameters:	%1 = Channel ID %2 = String (identifier) %3 = -Not used- %4 = Magazine number
Explanation:	The tool cannot be moved into the selected tool magazine. There is no appropriate location for this tool. A suitable location is mainly determined by the status. The status must indicate that this location is free, not disabled, not reserved and not co-occupied by a tool that is too large. Furthermore, it is important that the type of tool matches the type of any magazine location that may be free. (If, for example, all magazine locations are of the 'B' type and these are all free and the tool is of type 'A', then this tool cannot be put into this magazine).
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	- Check whether the magazine data have been defined correctly. - Check whether there is still room in the magazine to add another tool; there may not be due to operating procedures. - Check whether a location type hierarchy is defined and whether it, for example, does not allow insertion of a type 'A' tool in a free location with type 'B'.
Programm continuation:	Clear alarm with the RESET key. Restart part program

6402	[Channel %1:] Tool change not possible. Magazine no. %2 not available
Parameters:	%1 = Channel ID %2 = Magazine number
Explanation:	The desired tool change is not possible. The magazine with the specified number is not available.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	- Check whether the magazine data have been defined correctly. - Check whether the magazine is connected to the desired tool holder/spindle via a distance relation. - The user PLC program may have sent wrong data to the NCK.
Programm continuation:	Clear alarm with the RESET key. Restart part program
6403	[Channel %1:] Tool change not possible. Magazine location number %2 on magazine %3 not available.
Parameters:	%1 = Channel ID %2 = Magazine number %3 = Magazine location number
Explanation:	The desired tool change is not possible. The specified magazine location is not contained in the specified magazine.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Check whether the magazine data have been defined correctly. The user PLC program may have delivered incorrect data to the NCK.
Programm continuation:	Clear alarm with the RESET key. Restart part program
6404	[Channel %1:] Tool change not possible. Tool %2 not available or not usable
Parameters:	%1 = Channel ID %2 = String (identifier)
Explanation:	The desired tool change is not possible. The specified tool does not exist or cannot be loaded. The tool cannot be loaded either if it is part of a multitool which is already active with another tool, or is part of a multitool whose state is 'Change active' in relation to another toolholder.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	- Check whether the part program is written correctly. - Check whether the tool data are correctly defined. - Check whether there is a replacement tool which can be used for the specified tool.
Programm continuation:	Clear alarm with the RESET key. Restart part program
6405	[Channel %1:] Command %2 has invalid PLC acknowledge parameter %3 - identifier %4
Parameters:	%1 = Channel ID %2 = Command no. %3 = PLC acknowledge parameter %4 = Error code

Explanation:	The specified command has been answered by the PLC with an invalid acknowledgment in the current context. The following assignments are defined for "command no.": 1 Move tool, load or unload magazine 2 Prepare tool change 3 Execute tool change 4 Prepare tool change and execute with T command 5 Prepare tool change and execute with M command 7 Terminate canceled tool command 8 Check tool movement with reservation 9 Check tool movement 0 Transport acknowledgment Parameters 2 and 3 designate the PLC command and the status number of the acknowledgment. The error identifier (%4) gives a more detailed description of the alarm: - 0 = Not defined - 1 = Status not allowed with this command no. or undefined status received from PLC. - 2 = Source and/or target magazine no./location no. of the previous tool not known. - 3 = Source location in ACK does not match command or current tool location. - 4 = Target magazine no. and/or location no. in ACK not final target in CMD. - 5 = Not defined - 6 = Source and/or target magazine no./location no. of the new tool not known. - 7 = PLC comm. with inconsistent data: NCK command no. not equal to PLC acknowledgement or there is no NCK command that can be acknowledged. - 8 = With asynchronous tool movement or tool rejection there is no tool at the source location. - 9 = The command acknowledgement data wants to move a tool to a location that is occupied by another tool. - 10 = Asynchronous tool motion with reservation is only defined for the motion from a magazine to a buffer location. - 11 = Invalid MT position specified. - 12 = For tool change from multitool or MT positioning, the PLC must not acknowledge the multitool position specified by NCK with a different value. - 13 = Tool rejection is not permitted.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Erroneous PLC communication: Correct the PLC program.
Programm continuation:	Clear alarm with the RESET key. Restart part program

6406 [Channel %1:] PLC acknowledge for command %2 is missing

Parameters:	%1 = Channel ID %2 = Command no.
Explanation:	There is still no acknowledgment from the PLC for the tool change. The NCK cannot continue processing until it receives this acknowledgment for the specified command number. Possible command number values are described for alarm 6405.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. - Erroneous PLC communication: Correct the PLC program. - It is possible to release NCK with the PLC command 7 from the wait condition. This cancels the waiting command.
Programm continuation:	Clear alarm with the RESET key. Restart part program

6407	[Channel %1:] Tool %2 cannot be placed in magazine %3 on location %4. Invalid definition of magazine!
Parameters:	%1 = Channel ID %2 = String (identifier) %3 = Magazine number %4 = Magazine location number
Explanation:	A tool change request or a verification request was issued to put the tool in a location which does not satisfy the prerequisites for filling. The following causes for the error are possible: - Location is blocked or not free! - Tool type does not match the location type! - Tool possibly too large, adjacent locations are not free!
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	- Check whether the magazine data are correctly defined (especially the location type). - Check whether the tool data are correctly defined (especially the location type).
Programm continuation:	Clear alarm with the RESET key. Restart part program
6408	[Channel %1:] Block %2 empty location search and/or check in magazine has failed
Parameters:	%1 = Channel ID %2 = Block number, label
Explanation:	The empty location search or the empty location check for a tool has failed. The following could be causes of the error: - Location is disabled or not empty! - Tool type does not correspond to the location type! - Tool may be too large, adjacent locations are occupied!
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	- Check whether the magazine data are correctly defined (especially the location type). - Check whether the tool data are correctly defined (especially the location type).
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
6409	[Channel %1:] Block %2 If MTH is programmed then T must also be programmed.
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Function: Multitools and T= location programming. There is no T programming in the block. Only MTL is programmed.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct NC program: - Program T in the block - or delete MTL from the block
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

6410 [TO unit %1:] Tool %2 has reached its prewarning limit with D = %4

Parameters: %1 = TO unit
%2 = Tool identifier (name)
%3 = -Not used-
%4 = D number

Explanation: Tool monitoring: This message informs that the specified D offset has reached its prewarning limit for a time-, quantity- or wear-monitored tool. If possible, the D number is displayed; if not, value 0 is assigned to the 4th parameter.
If the function additive offset is being used, additive offset monitoring may be active instead of tool wear monitoring. The actual type of tool monitoring is a tool property (see \$TC_TP9). If replacement tools are not being used, the duplo number specified has no meaning. The alarm is triggered through the HMI or PLC (=OPI interface). The channel context is not defined. The TO unit was specified for this reason (see MD28085 \$MC_MM_LINK_TOA_UNIT).

Reaction: Interface signals are set.
Alarm display.

Remedy: This alarm is for information only. Check the possible ways of eliminating the error.

Programm continuation: Clear alarm with the Delete key or NC START.

6411 [Channel %1:] Tool %2 has reached its prewarning limit with D = %4

Parameters: %1 = Channel number
%2 = Tool identifier (name)
%3 = -Not used-
%4 = D number

Explanation: Tool monitoring: This message informs that the specified D offset has reached its prewarning limit for a time-, quantity- or wear-monitored tool. If possible, the D number is displayed; if not, value 0 is assigned to the 4th parameter.
If the function additive offset is being used, additive offset monitoring may be active instead of tool wear monitoring. The actual type of tool monitoring is a tool property (see \$TC_TP9).
If replacement tools are not being used, the duplo number specified has no meaning.
The alarm originates during NC program execution.

Reaction: Interface signals are set.
Alarm display.

Remedy: This alarm is for information only. Check the possible ways of eliminating the error.

Programm continuation: Clear alarm with the Delete key or NC START.

6412 [TO unit %1:] Tool %2 has reached its monitoring limit with D = %4

Parameters: %1 = TO unit
%2 = Tool identifier (name)
%3 = -Not used-
%4 = D number

Explanation: Tool monitoring: This message informs that the specified D offset has reached its prewarning limit for a time-, quantity- or wear-monitored tool. If possible, the D number is displayed; if not, value 0 is assigned to the 4th parameter.
If the function additive offset is being used, additive offset monitoring may be active instead of tool wear monitoring.
The actual type of tool monitoring is a tool property (see \$TC_TP9).
If replacement tools are not being used, the duplo number specified has no meaning.
The alarm is triggered through the HMI or PLC (=OPI interface). The channel context is not defined. The TO unit was specified for this reason (see MD28085 \$MC_MM_LINK_TOA_UNIT).

Reaction: Interface signals are set.
Alarm display.

Remedy: This alarm is for information only. Check the possible ways of eliminating the error.

Programm continuation: Clear alarm with the Delete key or NC START.

6413	[Channel %1:] Tool %2 has reached its monitoring limit with D = %4
Parameters:	%1 = Channel number %2 = Tool identifier (name) %3 = -Not used- %4 = D number
Explanation:	Tool monitoring: This message informs that the specified D offset has reached its prewarning limit for a time-, quantity- or wear-monitored tool. If possible, the D number is displayed; if not, value 0 is assigned to the 4th parameter. If the function additive offset is being used, additive offset monitoring may be active instead of tool wear monitoring. The actual type of tool monitoring is a tool property (see \$TC_TP9). If replacement tools are not being used, the duplo number specified has no meaning. The alarm originates during NC program execution.
Reaction:	Interface signals are set. Alarm display.
Remedy:	This alarm is for information only. Check the possible ways of eliminating the error.
Programm continuation:	Clear alarm with the Delete key or NC START.
6421	[Channel %1:] Tool move not possible. Empty location for tool %2 on magazine %4 not available.
Parameters:	%1 = Channel ID %2 = String (identifier) %3 = -Not used- %4 = Magazine number
Explanation:	The desired tool motion command - triggered from the HMI or PLC - is not possible. The tool cannot be moved into the specified tool magazine. There is no appropriate location for this tool.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Check whether the magazine data have been defined correctly (e.g. the magazine must not be disabled). - Check whether the tool data are correctly defined (for example, the tool location type must match the location types allowed in the magazine). - Check whether the magazine has simply no more room to accept another tool thanks to operating procedures. - Check whether a location type hierarchy is defined and whether, for example, it does not allow insertion of a type 'A' tool in a free location with type 'B'.
Programm continuation:	Clear alarm with the Delete key or NC START.
6422	[Channel %1:] Tool move not possible. Magazine no. %2 not available.
Parameters:	%1 = Channel ID %2 = Magazine number
Explanation:	The desired tool motion command - triggered from the HMI or PLC - is not possible. The magazine with the specified number is not available.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Check whether the magazine data have been defined correctly. - If the PLC issued the command for motion: check whether the PLC program is correct. - If the HMI issued the command for motion: check whether the HMI command was assigned correct parameters.
Programm continuation:	Clear alarm with the Delete key or NC START.

6423	[Channel %1:] Tool move not possible. Location %2 on magazine %3 not available.
Parameters:	%1 = Channel ID %2 = Magazine location number %3 = Magazine number
Explanation:	The desired tool motion command - triggered from the HMI or PLC - is not possible. The specified magazine location is not contained in the specified magazine.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Check whether the magazine data have been defined correctly.
Programm continuation:	Clear alarm with the Delete key or NC START.
6424	[Channel %1:] Tool move not possible. Tool %2 not available/not usable.
Parameters:	%1 = Channel ID %2 = String (identifier)
Explanation:	The desired tool motion command - triggered from the HMI or PLC - is not possible. The status of the specified tool does not allow movement of the tool. The specified tool is not defined or is not permitted for the command. The specified tool cannot be moved either if it is part of a multitool (only the multitool itself can be moved).
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Check whether the tool status 'is being changed' ('H20') is set. If yes, then the appropriate tool change command must first be completed by the PLC. Then the tool should be able to be moved. - Check whether the tool data are correctly defined. Has the correct T number been specified? - Check whether the move command has been correctly parameterized. Is the desired tool at the source location? Is the target location suitable for taking the tool? - Check whether the tool has already been loaded (if the alarm occurs while loading the tool).
Programm continuation:	Clear alarm with the Delete key or NC START.
6425	[Channel %1:] Tool %2 cannot be placed in magazine %3 on location %4. Invalid definition of magazine!
Parameters:	%1 = Channel ID %2 = String (identifier) %3 = Magazine number %4 = Magazine location number
Explanation:	The desired tool motion command - triggered from the HMI or PLC - is not possible. A movement request was issued to put the tool in a location which does not satisfy the prerequisites for filling. The following causes for the error are possible: - Location is blocked or not free! - Tool type does not match the location type! - Tool possibly too large, adjacent locations are not free! - If a tool is to be loaded or unloaded, the load/unload position must be of 'load location' type. - If a tool is to be loaded or unloaded, is the magazine in question linked to the load/unload location? See \$TC_MDP1, \$TC_MDP2.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.

Remedy:	- Check whether the magazine data have been defined correctly. - Check whether there is still room in the magazine to add another tool; there may not be due to operating procedures. - Check whether a location type hierarchy is defined and whether it, for example, does not allow insertion of a type 'A' tool in a free location with type 'B'. - Check whether the magazine in question is linked to the load/unload location or whether a distance has been defined. - Check whether the load/unload position is of 'load location' type. See also \$TC_MPP1.
Programm continuation:	Clear alarm with the Delete key or NC START.

6430	Workpiece counter: overflow in table of monitored cutting edges.
Explanation:	No more cutting edges can be entered in the piece counter table. As many cutting edges can be noted for the workpiece counter as are possible in total in the NCK. This means that if for each tool each cutting edge in each TO unit is used precisely once for a workpiece then the limit is reached. If several workpieces are made on several toolholders/spindles simultaneously, it is possible to note MD18100 \$MN_MM_NUM_CUTTING_EDGES_IN_TOA cutting edges for the workpiece counter for all of the workpieces. If this alarm occurs, it means that cutting edges used subsequently are no longer quantity monitored until the table has been emptied again, e.g. by means of the NC language command SETPIECE or by the relevant job from HMI, PLC (PI service).
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Was decrementing of the piece counter forgotten? Then program SETPIECE in the part program, or add the correct command in the PLC program. - If the part program/PLC program is correct, then more memory should be set for tool cutting edges via the MD18100 \$MN_MM_NUM_CUTTING_EDGES_IN_TOA (can only be performed with the necessary access rights!).
Programm continuation:	Clear alarm with the Delete key or NC START.

6431	[Channel %1:] Block %2 Function not allowed. Tool management/monitoring is not active.
Parameters:	%1 = Channel ID %2 = Block number, label
Explanation:	Occurs when a data management function is called which is not available because ToolMan is deactivated. For example, the language commands GETT, SETPIECE, GETSELT, NEWT, DELT, TCA.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	- Please inform the authorized personnel/service department. - Make sure of how the NC is supposed to be configured! Is tool management or tool monitoring needed but not activated? - Are you using a part program that is meant for a numerical control with tool management/tool monitoring? It is not possible to start this program on the numerical control without tool management/tool monitoring. Either run the part program on the appropriate NC control or edit the part program. - Activate tool management/tool monitoring by setting the appropriate machine data. See MD18080\$MN_MM_TOOL_MANAGEMENT_MASK, MD20310\$MC_TOOL_MANAGEMENT_MASK - Check whether the required option is set accordingly.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

6432	Function not executable. No tool assigned to tool holder/spindle
Parameters:	%1 = Channel ID
Explanation:	When an attempt is made to perform an operation that requires a tool to be located on the spindle. This can be the quantity monitoring function, for example.

Reaction:	Interface signals are set. Alarm display.
Remedy:	Select another function, another toolholder/spindle, position tool on toolholder/spindle.
Programm continuation:	Clear alarm with the Delete key or NC START.

6433 [Channel %1:] Block %2 %3 not available with tool management

Parameters:	%1 = Channel number %2 = Block number, label %3 = Source symbol
Explanation:	The system variable specified in %3 is not available with active tool management. The function GELSELT should be used with \$P_TOOLP.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Modify program. If \$P_TOOLP has been programmed, the GETSELT function should be used instead.
Programm continuation:	Clear alarm with the RESET key. Restart part program

6434 [Channel %1:] Block %2 NC command SETMTH not allowed because tool holder function not active

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	No master toolholder has been defined for the initial state (MD20124 \$MC_TOOL_MANAGEMENT_TOOLHOLDER = 0), therefore no toolholder is available. The NC command SETMTH has neither been defined. In this setting, the tool change is carried out referring to the master spindle. The master spindle is set with SETMS.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Correct the NC program (delete or replace SETMHT) or enable toolholder function via machine data.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

6436 [Channel %1:] Block %2 command '%3' cannot be programmed. Function '%4' has not been activated.

Parameters:	%1 = Channel number %2 = Block number, label %3 = Programmed command %4 = Function identifier
Explanation:	The command cannot be programmed due to the lack of a function enable or activation. Function code (4th parameter): 1 = Flat D numbers 2 = Tool monitoring 3 = Magazine management 4 = Multitools 5 = T=Magazine location number
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.

Remedy: Correct the NC program
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

6437 [Channel %1:] Block %2 Command '%3' cannot be programmed. Function '%4' is activated.

Parameters: %1 = Channel number
 %2 = Block number, label
 %3 = Programmed command
 %4 = Function identifier

Explanation: The command cannot be programmed as the specified function is active.
 Function code (4th parameter):
 1 = Flat D numbers
 2 = Tool monitoring
 3 = Magazine management
 4 = Multitools
 5 = T=Magazine location number

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: Correct the NC program
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

6438 [Channel %1:] Block %2 inconsistent data modification is not permitted.

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: In a defined multitool, for example, the distance coding \$TC_MTP_KD cannot be changed once the multitool location has been generated.

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: Correct the NC program
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

6441 Writing of \$P_USEKT not allowed.

Explanation: An attempt was made to write the value of \$P_USEKT. This is not possible since programming T='location number' with automatic setting of \$P_USEKT is active.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check how the NC is supposed to be configured. (See bit16 and bit22 in MD 20310 \$MC_TOOL_MANAGEMENT_MASK).
 - Is a part program being used that is intended for an NC control without T='location number' with automatic setting of \$P_USEKT? This program cannot be started on an NC control with T='location number' with automatic setting of \$P_USEKT.
 - Either run the part program on an appropriate NC control or edit the part program.

Programm continuation: Clear alarm with the Delete key or NC START.

6442	[Channel %1:] Function not executable. No tool assigned to desired magazine/magazine location %2.
Parameters:	%1 = Channel ID %2 = Magazine/magazine location no.
Explanation:	PLC logic is presumably incorrect. Tool change with reject tool is configured. Preparatory command is pending. Selected tool is (e.g. from PLC) unloaded from its location. PLC acknowledges preparatory command with 'Repeat tool selection' (e.g. status =7). NCK cannot find the tool at the magazine location specified in the PLC command. Or: Illegal operator intervention in an active tool selection (unloading of the tool to be selected) has occurred. Therefore the PLC acknowledgment fails.
Reaction:	Interface signals are set. Alarm display.
Remedy:	PLC programmer must note the following: - Ensure that the tool is not removed from the specified magazine location (e.g. incorrect PLC program). - Do not remove the tool from the programmed tool change before the final acknowledgment of the command (= unload). !! It is however permissible to change the location of the tool to be loaded. The NCK can deal with this situation. This alarm supplements Alarm 6405, if it contains the identifier 8. Therefore, the diagnostics should be easier.
Programm continuation:	Clear alarm with the Delete key or NC START.
6450	[Channel %1:] Block %2 tool change not possible. Invalid magazine location no. %3 in buffer magazine
Parameters:	%1 = Channel ID %2 = Block number, label %3 = Magazine location number
Explanation:	The desired tool change is not possible. The specified magazine location is either toolholder/spindle or empty. Only the numbers of the buffer that are not toolholder/spindle may be programmed with the NC command TCI, i.e. the location number of a gripper is allowed.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	- Check whether the magazine data (\$TC_MPP1) have been defined correctly. - Check whether the alarm-causing program command _ e.g. TCI _ has been programmed correctly.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
6451	[Channel %1:] Block %2 tool change not possible. No buffer magazine defined.
Parameters:	%1 = Channel ID %2 = Block number, label
Explanation:	The desired tool change is not possible. No buffer magazine defined.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Check whether the magazine data have been defined correctly.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
6452	[Channel %1:] Block %2 tool change not possible. Tool holder/spindle number = %3 not defined.
Parameters:	%1 = Channel ID %2 = Block number, label %3 = Tool holder/spindle number

Explanation:	The desired tool change is not possible. The toolholder/spindle number has not been defined.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	General: The following must apply: 'maximum programmed address extensions (=spindle number/toolholder number) of Ts=t, Ms=6 must be less than the value of MD18076 \$MN_MM_NUM_LOCS_WITH_DISTANCE'. With magazine management: Check whether the toolholder number/spindle number and the magazine data have been defined correctly. (See also the system variables \$TC_MPP1, \$TC_MPP5 of the buffer magazine).
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

6453	[Channel %1:] Block %2 tool change not possible. No assignment between toolholder/spindle no. = %3 and buffer magazine location %4
Parameters:	%1 = Channel ID %2 = Block number, label %3 = Spindle no. %4 = Location no.
Explanation:	The desired tool change is not possible. No relation has been defined between the toolholder/spindle number and the buffer magazine location (Location No.)
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	- Check whether the magazine data (\$TC_MLSR) have been defined correctly. - Check whether the alarm-causing program command _ e.g. TCI _ has been programmed correctly.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

6454	[Channel %1:] Block %2 tool change not possible. No distance relation available.
Parameters:	%1 = Channel ID %2 = Block number, label
Explanation:	The desired tool change is not possible. Neither the spindle nor the buffer magazine location have a distance relation.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	- Check whether the magazine data (\$TC_MDP2) have been defined correctly. - Check whether the alarm-causing program command _ e.g. TCI _ has been programmed correctly.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

6455	[Channel %1:] Block %2 tool change not possible. Magazine location no. %3 not available in magazine %4
Parameters:	%1 = Channel ID %2 = Block number, label %3 = Magazine location number %4 = Magazine number
Explanation:	The desired tool change is not possible. The indicated magazine location is not available in the indicated magazine.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.

Remedy: - Check whether the causing program command - e.g. TCI - has been parameterized correctly.
- Check whether magazine data have been defined correctly. (\$TC_MAP6 and \$TC_MAP7 of the intermediate location magazine)

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

6460 [Channel %1:] Block %2 Command '%3' can only be programmed for tools. '%4' does not designate a tool.

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Programmed command
%4 = Programmed parameter

Explanation: The specified command can only be programmed for tools. The command parameter is not a T number or a tool name. If a multitool has been programmed: The command cannot be programmed for multitools.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Correct the NC program

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

6462 [Channel %1:] Block %2 Command '%3' can only be programmed for magazines. '%4' does not designate a magazine.

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Programmed command
%4 = Programmed parameter

Explanation: The specified command can only be programmed for magazines. The command parameter is not a magazine number or a magazine name. If a multitool has been programmed: The command cannot be programmed for multitools.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Correct the NC program

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

6500 NC memory full

Explanation: The NCK file system is full.
The available buffered memory does not suffice. Note: At first commissioning, files of the NC file system may be affected such as drive data, HMI files, FIFO files, NC programs...

Reaction: Alarm display.

Remedy: You have the following possibilities of eliminating the error:
Adjust the size of the buffered memory with MD18230 \$MN_MM_USER_MEM_BUFFERED.
Increase the space available in the buffered memory, e.g. by unloading part programs that are no longer being used.
Decrease the size of the ring buffer (see MD18230 \$MC_RESU_RING_BUFFER_SIZE).

Programm continuation: Clear alarm with the Delete key or NC START.

6510 Too many part programs in the NC memory

Explanation: The maximum number of possible files in the NC file system (part of the NC memory) has been reached. Note: During first commissioning, this can affect files from the NC file system, e.g. drive data, HMI files, FIFO files, NC programs, cycle programs, ...

Reaction:	Alarm display.
Remedy:	Inform the authorized personnel/service department. You have the following possibilities of eliminating the error: - Delete or unload files (e.g. part programs) - Increase the number of files in the file system in MD18320 \$MN_MM_NUM_FILES_IN_FILESYSTEM or MD18321 MD_MAXNUM_SYSTEM_FILES_IN_FILESYSTEM. - With the Siemens cycle storage, increase the number of files in the resource file.
Programm continuation:	Clear alarm with the Delete key or NC START.

6520	The value of the machine data %1%2 is too low
Parameters:	%1 = String: MD identifier %2 = If required, index: MD array
Explanation:	MD18370 \$MN_MM_PROTOD_NUM_FILES specifies the number of protocol files for the protocol users. However, more protocol files are used than are configured.
Reaction:	Alarm display.
Remedy:	Increase the number of protocol files in MD18370 \$MN_MM_PROTOD_NUM_FILES.
Programm continuation:	Clear alarm with the Delete key or NC START.

6540	Too many directories in the NC memory
Explanation:	The number of directories in the NC file system (part of the NC memory) has reached the maximum limit.
Reaction:	Alarm display.
Remedy:	You have the following possibilities of eliminating the error: - Delete or unload the directory (e.g. the workpiece) - Increase the number of directories in MD18310 \$MN_MM_NUM_DIR_IN_FILESYSTEM.
Programm continuation:	Clear alarm with the Delete key or NC START.

6560	Data format not allowed
Explanation:	An attempt was made to write impermissible data in an NCK file. This error can occur in particular when the attempt was made to load binary data in the NCK as ASCII file. The error can also occur during preprocessing of cycles (see MD10700 \$MN_PREPROCESSING_LEVEL) if the NC block is very long.
Reaction:	Alarm display.
Remedy:	You have the following possibilities of eliminating the error: Mark the file as binary data, e.g. with the extension: .BIN). If the part program block is very long, split it up.
Programm continuation:	Clear alarm with the Delete key or NC START.

6568	Limit of the extended CNC memory reached
Explanation:	The memory space assigned to the function 'Extended CNC user memory' is exhausted.
Reaction:	NC Start disable in this channel. Alarm display.
Remedy:	Delete files in the extended CNC memory
Programm continuation:	Switch control OFF - ON.

6569	HMI user memory limit reached on the memory card.
Explanation:	The memory space in the reserved user area on the memory card is exhausted.

Reaction: NC Start disable in this channel.
Alarm display.

Remedy: Delete files on the memory card

Programm continuation: Switch control OFF - ON.

6570 NC memory full

Explanation: The DRAM file system of the NCK is full. The task cannot be executed. Too many system files were created in the DRAM.

Reaction: Alarm display.

Remedy: Start fewer "execute from external" processes.

Programm continuation: Clear alarm with the Delete key or NC START.

6581 NC user memory full

Explanation: The DRAM file system of the user area is full. The order cannot be executed.

Reaction: Alarm display.

Remedy: Delete or unload files (e.g. part programs)

Programm continuation: Clear alarm with the Delete key or NC START.

6582 NC machine OEM memory full

Explanation: The DRAM file system of the machine OEM area is full. The order cannot be executed.

Reaction: Alarm display.

Remedy: Delete or unload files (e.g. part programs)

Programm continuation: Clear alarm with the Delete key or NC START.

6583 NC system memory full

Explanation: The DRAM file system of the system area (Siemens) is full. The order cannot be executed.

Reaction: Alarm display.

Remedy: Increase MD18354 \$MN_MM_S_FILE_MEM_SIZE or, with Siemens cycles, increase the partition size in the cycle resource file.

Programm continuation: Clear alarm with the Delete key or NC START.

6584 NC memory limit TMP reached

Explanation: The DRAM file system of the TMP (temporary) area is full. The job cannot be executed.

Reaction: Alarm display.

Remedy: Increase MD18351 \$MN_MM_DRAM_FILE_MEM_SIZE or MD18355 \$MN_MM_T_FILE_MEM_SIZE or switch off the precompilation of individual or all cycles or delete files in the TMP area.

Programm continuation: Clear alarm with the Delete key or NC START.

6693 File %1 lost

Parameters: %1 = File name

Explanation: Due to a power failure, a file change could not be terminated properly. The file is lost.

Reaction: NC not ready.
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Import the file again.
Programm continuation: Switch control OFF - ON.

6694 **Drives could not be mounted**

Explanation: The external drives could not be mounted within the configured time (see MD10128 \$MN_EES_MAX_MOUNT_TIME).
Reaction: NC not ready.
 Interface signals are set.
 Alarm display.
Remedy: Check logdrives.ini and increase MD10128 \$MN_EES_MAX_MOUNT_TIME if necessary.
Programm continuation: Clear alarm with the RESET key. Restart part program

6700 **[Channel %1:] Value of the machine data %2%3 is too low**

Parameters: %1 = Channel number
 %2 = MD identifier
 %3 = If required, field index
Explanation: The MD28302 \$MC_MM_PROTOD_NUM_ETP_STD_TYP specifies the number of default event types for the protocol users. However, more types are used than configured.
Reaction: Alarm display.
Remedy: Increase MD28302 \$MC_MM_PROTOD_NUM_ETP_STD_TYP.
Programm continuation: Clear alarm with the Delete key or NC START.

6710 **Data loss with trace in the diagnostics operating area. The IPO cycle is too heavily loaded by the trace.**

Explanation: Data loss with trace in the diagnostics operating area. The IPO cycle is too heavily loaded by the trace, so data blocks have to be rejected. This should prevent the trace impairing production.
 The alarm can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK2 bit 26.
Reaction: Alarm display.
Remedy: Select less data or lengthen the IPO cycle.
 The alarm can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK2 bit 26.
Programm continuation: Clear alarm with the Delete key or NC START.

6720 **Data loss with trace in the diagnostics operating area. Communication with the HMI is too heavily loaded by the trace.**

Explanation: Data loss with trace in the diagnostics operating area. Communication with the HMI is too heavily loaded by the trace, so data blocks have to be rejected. This should prevent the trace impairing production.
 The alarm can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK2 bit 26.
Reaction: Alarm display.
Remedy: Select less data or reduce the sampling rate.
 The alarm can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK2 bit 26.
Programm continuation: Clear alarm with the Delete key or NC START.

6730	Data loss with trace in the diagnostics operating area. The preprocessing is too heavily loaded by the trace.
Explanation:	The data recorded by the trace could not be accepted quickly enough on the time level of the preprocessing. The system is so heavily utilized that availability of the trace functionality is restricted. If there is a temporary overload of the preprocessing, as a remedy, the buffer between the main processing and the preprocessing can be increased. The alarm can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK2 bit 26.
Reaction:	Alarm display.
Remedy:	Increase MD18374 \$MN_MM_PROTOC_FILE_BUFFER_SIZE[5-8]. The alarm can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK2 bit 26.
Programm continuation:	Clear alarm with the Delete key or NC START.
6740	Data loss with trace in the diagnostics operating area. Communication with the HMI is too heavily loaded.
Explanation:	Data loss with trace in the diagnostics operating area. Communication with the HMI is too heavily loaded by the trace to be able to transfer all the selected data. The system is so heavily utilized that availability of the trace functionality is restricted. The alarm can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK2 bit 26.
Reaction:	Alarm display.
Remedy:	Select less data or reduce the sampling rate. The alarm can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK2 bit 26.
Programm continuation:	Clear alarm with the Delete key or NC START.
7500	Block %1 invalid protection level for command %2 (protection level act.: %3 prog.: %4)
Parameters:	%1 = Block number %2 = Programmed command %3 = Current protection level of the command %4 = Programmed protection level of the command
Explanation:	On assigning a protection level for a part program command via REDEF command - an impermissible part program command has been programmed - a protection level has been programmed that is logically smaller (larger in value) than the protection level currently applicable for this command. - the relevant definition file has not been protected sufficiently against write access. The write protection of the file must be at least as high as the highest protection level that has been assigned to a part program command in this definition file.
Reaction:	Alarm display.
Remedy:	Modify definition files /_N_DEF_DIR/_N_MACCESS_DEF or /_N_DEF_DIR/_N_UACCESS_DEF-CESS_DEF. Please see the Siemens Programming Guide or the OEM documentation for the language commands permissible for the relevant system configurations.
Programm continuation:	Clear alarm with the RESET key. Restart part program
8010	Option 'activation of more than %1 axes' not set
Parameters:	%1 = Number of axes
Explanation:	More machine axes have been defined through the MD20070 \$MC_AXCONF_MACHAX_USED than are allowed in the system.
Reaction:	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.

Remedy: Please inform the authorised personnel/service department.
 The sum of all axes that have been configured using the channel-specific MD20070 \$MC_AXCONF_MACHAX_USED must not exceed the maximum number of axes.
 Reduce the number of active axes or enable additional axes via option.
 Please also observe the information relating to the definition of 'auxiliary axes/spindles', 'simulation axes', and 'virtual axis for master value coupling with curve table'.

Programm continuation: Switch control OFF - ON.

8012 The 'Activation of more than %1 SI axes' option is not set

Parameters: %1 = Number of licensed axes
 %2 = Number of axes with active dbSi

Explanation: The drive-based safety functions were activated for more axes than permitted in the system.

Reaction: NC not ready.
 Mode group not ready, also effective for single axes.
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.
 NC Stop on alarm.

Remedy: Please notify the authorized personnel / service department. Reduce the number of axes activated with drive-based safety functions or release additional axes in the option date.

Programm continuation: Switch control OFF - ON.

8020 Option 'activation of more than %1 channels' not set

Parameters: %1 = Number of active channels

Explanation: More than the permissible number of channels have been activated.

Reaction: NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Please inform the authorized personnel/service department.
 In the system-specific MD10010 \$MN_ASSIGN_CHAN_TO_MODE_GROUP, reduce the number of active channels or enable additional channels via option.

Programm continuation: Switch control OFF - ON.

8021 Option 'activation of more than %1 mode groups' not set

Parameters: %1 = Number of mode groups

Explanation: The option for the number of mode groups is not compatible with the activated mode group.

Reaction: NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: You have the following possibilities of eliminating the error:
 Retrofit the option for more mode groups.
 Activate fewer mode groups.

Programm continuation: Switch control OFF - ON.

8022 The 'Activation of more than %1 handling channels' option is not set

Parameters: %1 = Number of active handling channels

Explanation:	More than the permissible number of handling channels have been activated by the channel-specific MD20010 \$MC_IS_ADD_CHAN.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. In the system-specific MD10010 \$MN_ASSIGN_CHAN_TO_MODE_GROUP or in the channel-specific MD20010 \$MC_IS_ADD_CHAN, reduce the number of active handling channels or enable additional handling channels with option.
Programm continuation:	Switch control OFF - ON.

8024	Option '%1<OPTNX>' is not set
Parameters:	%1 = Brief description of option
Explanation:	The option for activating multiple magazines is not set
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. - Buy option - Reduce the number of magazines (MD18084 \$MN_MM_NUM_MAGAZINE)
Programm continuation:	Switch control OFF - ON.

8025	[Channel %1:] Option '%2<OPTNX>' not set
Parameters:	%1 = Channel number %2 = Brief description of option
Explanation:	The option for 'Advanced Surface' functionality is not set.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. - Purchase option - Reset the activation of 'Advanced Surface' functionality (MD20606 \$MC_PREPDYN_SMOOTHING_ON and/or MD20443 \$MC_LOOKAH_FFORM)
Programm continuation:	Switch control OFF - ON.

8026	Axis %1: '%2<OPTNX>' option not set
Parameters:	%1 = Axis
Explanation:	The option for the 'Friction compensation' functionality is not set
Reaction:	NC Start disable in this channel. Alarm display.
Remedy:	Please inform the authorized personnel/service department. - Purchase option - Reset the activation of the 'Friction compensation' functionality (MD32490 \$MA_FRICT_COMP_MODE != 3/4 and/or MD32500 \$MA_FRICT_COMP_ENABLE)
Programm continuation:	Clear alarm with the RESET key. Restart part program

8027	'%1<OPTNX>' option not set
Parameters:	%1 = Brief description of option

Explanation:	The option for the 'Grinding Advanced' functionality is not set.
Reaction:	NC Start disable in this channel. Alarm display.
Remedy:	Please contact the authorized personnel/Service. - Buy option - Deactivate the 'Grinding Advanced' functionality - 'Grinding Advanced' functional scope: Cylinder error compensation
Programm continuation:	Switch control OFF - ON.

8028	Axis %1: '%2<OPTNX>' option not set
Parameters:	%1 = Axis
Explanation:	The option for 'pitch compensation' functionality is not set
Reaction:	NC Start disable in this channel. Alarm display.
Remedy:	Please inform the authorized personnel/service department. - Purchase option - Reset the activation of the 'pitch compensation' functionality (MD37310 \$MA_NOCO_INPUT_AX_1, MD37320 \$MA_NOCO_INPUT_AX_2, MD37330 \$MA_NOCO_INPUT_AX_3)
Programm continuation:	Clear alarm with the RESET key. Restart part program

8029	[Channel %1:] Block %2 Collision avoidance requires too many channels. %3 are required, %4 are configured.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Number of required channels %4 = Number of configured channels
Explanation:	The collision model uses more channels than configured in the OD19840 \$ON_NUM_COLLISION_CHANNELS option data.
Reaction:	Alarm display.
Remedy:	Please notify authorized personnel/service. - Purchase additional channel options for collision avoidance - Reduce collision model to fewer channels
Programm continuation:	Clear alarm with the RESET key. Restart part program

8030	[Channel %1:] Block %2 option 'interpolation of more than %3 axes' not set
Parameters:	%1 = Channel number %2 = Block number, label %3 = Number of permissible axes
Explanation:	The number of axes programmed in the interpolating group exceeds the permissible number of interpolating axes.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	In the part program, program as many axes as are permitted by the configuration of the controller or enable additional axes via option.
Programm continuation:	Clear alarm with the RESET key. Restart part program

8031 [Channel %1:] Block %2 axis %3: Axis has no IPO functionality

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis, spindle number

Explanation: An axis/spindle that has been defined as a special axis/auxiliary spindle (see MD30460 \$MA_BASE_FUNCTION_MASK bit8), should be operated as an interpolating axis.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Define axis as interpolating axis (see MD30460 \$MA_BASE_FUNCTION_MASK bit8) or change part program

Programm continuation: Clear alarm with the RESET key. Restart part program

8037 Axis %1: APC option '%2<OPTNX>' is not set

Parameters: %1 = Axis
%2 = Option ID

Explanation: More than six current setpoint filters were activated in the drive, although the corresponding option had not been set.

Reaction: NC not ready.
Channel not ready.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: - Buy option
- Deactivate the 'Advanced Positioning Control' (APC) function in the drive.
- Set a maximum of six current setpoint filters in the drive.

Programm continuation: Switch control OFF - ON.

8040 Machine data %1 reset, corresponding option is not set

Parameters: %1 = String: MD identifier

Explanation: A machine data has been set that is locked by an option.

Reaction: Alarm display.

Remedy: Please inform the authorized personnel/service department.
For retrofitting the option, please refer to your machine manufacturer or to a sales representative of SIEMENS AG, A&D MC.
Clear alarm with the Delete key or NC START.

Programm continuation:

8041 Axis %1: MD %2, corresponding option not sufficient

Parameters: %1 = Axis number
%2 = String: MD identifier

Explanation: The number of axes specified in the associated option data has been exceeded.
More axes have been selected in the corresponding machine data than are permitted by the function associated with the option.
The alarm can be reconfigured in MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY to "Channel not ready".

Reaction:	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Inform the authorized personnel/service department. - Increase the option data - Reduce the number of axes
Programm continuation:	Switch control OFF - ON.

8042 Option '%1<OPTNX>' is not set

Parameters:	%1 = Brief description of option
Explanation:	Please inform the authorized personnel/service department. A non-released option was used The stated option or an equivalent one is required to execute the action.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Terminate action, upgrade option. Please compare the available option data and/or (if available) the license image of your controller
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

8043 '%1<OPTNX>' option not set

Parameters:	%1 = Brief description of option
Explanation:	A non-released option was used The stated option or an equivalent one is required for execution of the action.
Reaction:	NC Start disable in this channel. Channel not ready. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Stop action. Retrofit option. -Please compare the available option data and/or (if available) the license image of your control
Programm continuation:	Switch control OFF - ON.

8045 'Activation drive integrated ESR' option not set

Explanation:	'Extended stop and retract (ESR)' was activated in the drive, although the corresponding option was not set.
Reaction:	NC not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	- Purchase option - Deactivate 'Extended stop and retract (ESR)' function in the drive.
Programm continuation:	Switch control OFF - ON.

8046 '%1<OPTNX>' option not set**Parameters:** %1 = Brief description of option**Explanation:** A non-released option is being used

The stated or an equivalent option is necessary to execute the action.

Note on the "Jerk adjustment" option:

For axes in motion, the switchover from the position setpoint filter chains with \$AA_DESVAL_FILTERS_SELECT is only allowed with the option set.

Reaction: NC Start disable in this channel.

Interface signals are set.

Alarm display.

NC Stop on alarm.

Remedy: Please inform the authorized personnel/service department.

Stop action. Retrofit option.

Please compare the available option data and/or (if available) the license image of your control

Note on the 'jerk adjustment' option:

Position setpoint filter chains with \$AA_DESVAL_FILTERS_SELECT either switchover at axis standstill or set the option for a switchover with axes in motion.

Programm continuation: Clear alarm with the RESET key. Restart part program

8050 Index limit 'SPL inputs/outputs' has been exceeded. MD %1[%2] is not correct**Parameters:** %1 = MD identifier

%2 = MD array index

Explanation: The access index of the SPL inputs/outputs was exceeded. Possible causes:

- The value in the specified machine data was set incorrectly.

The machine data whose value exceeds the permissible maximum value is indicated in the alarm parameters.

Reaction: NC Start disable in this channel.

Interface signals are set.

Alarm display.

Remedy: Correct the displayed machine data.**Programm continuation:** Switch control OFF - ON.

8052 Drive: The number of %1<DRVLICPANX> options required is %2**Parameters:** %1 = Drive, options ID/MLFB

%2 = Drive, option value

Explanation: The drive option has not been enabled, or the number of enabled drive options was exceeded**Reaction:** NC Start disable in this channel.

Interface signals are set.

Alarm display.

Remedy: Please notify the authorized personnel/service.

- Reset drive option

- Purchase option

Programm continuation: Switch control OFF - ON.

8053 Drive: Option %1 is unknown**Parameters:** %1 = Drive, option ID**Explanation:** Drive option is unknown

Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please notify the authorized personnel/service. - Reset drive option
Programm continuation:	Switch control OFF - ON.

8055 Error when initializing handling channels: Cause %1, Additional info 1 %2 (Additional info 2 %3)

Parameters:	%1 = Cause %2 = Additional information %3 = Additional information
Explanation:	An error occurred during configuration of handling channels. This may be due to one of the following causes: 1 - More axes than allowed have been assigned to both a machining and a handling channel by MD20070 \$MC_AXCONF_MACHAX_USED. Additional info1 contains the number of axes affected, additional info2 the maximum number allowed. 2 - In connection with the activation of handling channels, the permissible number of active axes in the system was exceeded. Additional info1 contains the maximum number of axes that can be activated. 3 - A channel was declared as a handling channel and more than the permissible number of axes for it were activated. Additional info1 contains the channel number, additional info2 contains the maximum permissible number of axes. 4 - A channel was declared as a handling channel and more than the permissible number of spindles were activated for it. Additional info1 contains the channel number, additional info2 contains the maximum permissible number of spindles. 5 - The total number of permissible axes was exceeded in the machining channels. Additional info1 contains the maximum total number of axes that can be declared over all machining channels.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. 1 - In the channel-specific MD20010 \$MC_IS_ADD_CHAN, define the channel as a machining channel or remove the corresponding axis from one of the two channels. 2 - In the channel-specific MD20070 \$MC_AXCONF_MACHAX_USED, deactivate axes or enable additional handling channels with option. 3 - In the channel-specific MD20010 \$MC_IS_ADD_CHAN, define the channel as a machining channel or reduce the number of active axes in the channel. 4 - In the channel-specific MD20010 \$MC_IS_ADD_CHAN, define the channel as a machining channel or reduce the number of active spindles in the channel. 5 - In the channel-specific MD20070 \$MC_AXCONF_MACHAX_USED, deactivate axes in the respective channels.
Programm continuation:	Switch control OFF - ON.

8060 CNC lock function: The request cannot be processed: cause %1

Parameters:	%1 = Cause
--------------------	------------

Explanation: The start conditions of the CNC lock function are not met.
The following cause was detected:

- 1 - The clock is not set.
- 2 - The option bit was deactivated.
- 3 - The control type is not supported.
- 4 - The PLC project is not supported.
- 5 - No license is available.
- 6 - MD17300 \$MN_CNC_LOCK_WARNING_TIME is zero.
- 7 - The previous order is still being processed.
- 11 - The LockSet file was not found.
- 12 - The LockSet file cannot be read.
- 13 - The version of the LockSet file is not supported.
- 14 - The number of the CF card is unknown.
- 15 - The lock date is invalid.
- 16 - The hardware serial number is unknown.
- 31 - The current mode is not permitted.

Reaction: Alarm display.

Remedy: Please inform the authorized personnel/service department.

Programm continuation: Switch control OFF - ON.

8061 CNC lock function cannot be updated : cause %1 .

Parameters: %1 = Cause

Explanation: The desired update of the active CNC lock function is rejected.
The following cause was detected:

- 1 - The clock is not set.
- 2 - The option bit had been deactivated.
- 4 - The PLC project is not supported.
- 5 - No license is available.
- 6 - MD17300 \$MN_CNC_LOCK_WARNING_TIME is zero.
- 7 - The previous order is still being processed.
- 11 - The LockSet file was not found.
- 12 - The LockSet file cannot be read.
- 13 - The version of the LockSet file is not supported.
- 14 - The number of the CF card is unknown.
- 15 - The lock date is invalid.
- 16 - The hardware serial number is unknown.
- 21 - The OEM key is incorrect.
- 22 - The PLC project was replaced.
- 31 - The current mode is not permitted.

Reaction: Alarm display.

Remedy: Please inform the authorized personnel/service department.

Programm continuation: Switch control OFF - ON.

8062 CNC lock function: The execution of the function was interrupted: cause %1

Parameters: %1 = Cause

Explanation:	The execution of the already active CNC lock function has been modified. The following cause was detected: 1 - The CF card was exchanged. 2 - The hardware was exchanged. 3 - The PLC project was changed. 4 - The PLC reports an incorrect OEM key. 5 - The data of the function was subject to unauthorized change. 6 - The PLC project is not supported. The NC start is locked.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please restore the former status of the control. If this cannot be done, please inform the authorised personnel/service department, and reactivate the CNC lock function.
Programm continuation:	Switch control OFF - ON.

8063	CNC lock function: The lock date will be reached in less than %1 days!
Parameters:	%1 = Number of production days remaining
Explanation:	A reminder is issued for the lock date in accordance with the agreements for operating this machine configuration.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department.
Programm continuation:	Clear alarm with the Delete key or NC START.

8064	CNC lock function: The lock date has been reached, an NC start is not possible!
Explanation:	The lock date has been reached in accordance with the agreements for operating this machine configuration. NC start is locked.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department.
Programm continuation:	Switch control OFF - ON.

8065	CNC lock function: Please set the correct date/time!
Explanation:	While the CNC lock function is active, incorrect settings for date/time have been found. NC start is locked. The time of day must be corrected without fail before the control is switched off. Otherwise there could be a permanent lock caused by alarm 8064 "CNC lock function: The lock date has been reached, and NC start is not possible!".
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please set the correct date/time.
Programm continuation:	Switch control OFF - ON.

8066	CNC lock function: Changing the date has reduced the length of the remaining runtime.
Explanation:	Activating the CNC lock function has brought forward the date of the control. This has reduced the length of time before the lock date is reached.

Reaction: Alarm display.
Remedy: The date of the control can be reset before switching off/on.
Programm continuation: Clear alarm with the Delete key or NC START.

8067 CNC lock function: A system alarm has occurred: cause %1

Parameters: %1 = Cause
Explanation: The CNC lock function has found problems:
1 - Internal interface 1
X - Internal interface X
Reaction: NC not ready.
Channel not ready.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.
Remedy: If you experience such a system error, please contact Technical Support.
www.siemens.com/sinumerik/help
Please supply the following information to ensure quick processing:
- Alarm number together with alarm text
- Description of the operation/mode before the alarm message
- Generate log files using the key combination: <Ctrl> + <Alt> + <D>
Programm continuation: Switch control OFF - ON.

8080 %1 option(s) is/are activated without setting the license key

Parameters: %1 = Number of non-licensed options
Explanation: One or more options were activated but no license key was set to prove the purchase of the option(s).
Reaction: Alarm display.
Remedy: Generate a license key on the internet at <http://www.siemens.com/automation/license> and enter it in the operating area "Setup", function (HSK) "Licenses".
Programm continuation: Clear alarm with the Delete key or NC START.

8081 %1 option(s) is/are activated that are not licensed by the license key

Parameters: %1 = Number of non-licensed options
Explanation: One or more options were activated, that are not licensed by the license key entered.
Reaction: Alarm display.
Remedy: Generate a new license key on the internet at <http://www.siemens.com/automation/license> and enter it in the operating area "Setup", function (HSK) "Licenses"..
Programm continuation: Clear alarm with the Delete key or NC START.

8082 A wrong license key was entered three times, Power On required before next try.

Explanation: The license key was entered wrongly at least three times. Before the next input, a new power ON is required.
Reaction: Alarm display.
Remedy: Execute NCK Power On and enter the license key (correctly).
Programm continuation: Clear alarm with the Delete key or NC START.

8083	Export-restricted system software without valid licensing.
Explanation:	A special memory card and a special license key are required to operate export-restricted system software.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please ensure that a corresponding memory card is available in the control. Generate a license key for export-restricted system software via the internet under http://www.siemens.com/automation/license , and enter the license key under the "Start-up" operating area, function (HSK) "Licenses". Note: If this alarm occurs after the replacement of a defective memory card, please observe the following: On account of export regulations applicable to the certain controls, only memory cards with the following MLBFs may be used to replace a defective memory card: 6FC58xx-1XG##-#YA0 6FC58xx-1XG##-#YA8 There are already license keys on these memory cards that enable export-restricted system software to be installed and operated. Back up this license key before overwriting the memory card with a software image, and then restore the key. If you forget to make the backup, you can restore the display of the original license key of your memory card via http://www.siemens.com/automation/license .
Programm continuation:	Switch control OFF - ON.
8084	Period %1 of the test license active remaining time %2 h
Explanation:	A test period has been started. During this period, one or several options can be set, which require a license key to prove that they have been purchased. A maximum of 6 test periods are possible, one test period can be a maximum of 150 h (up to 3000 h for larger control models) operating time of the control system.
Reaction:	Alarm display.
Remedy:	Generate a new license key through the Internet at http://www.siemens.com/automation/license and enter in the operating area "Startup", function (HSK) "Licenses". Enter a valid license key in the operating area "Startup", function (HSK) "Licenses".
Programm continuation:	Clear alarm with the Delete key or NC START.
8085	%1. Test license period has expired
Explanation:	A test period has expired.
Reaction:	Alarm display.
Remedy:	Generate a new license key via the Internet at http://www.siemens.com/automation/license and enter in the operating area "Startup", function (HSK) "Licenses". Enter a valid license key in the operating area "Startup", function (HSK) "Licenses". Activate an additional test period Reset the options that require a license key
Programm continuation:	Clear alarm with the Delete key or NC START.
8086	Test and demonstration machine
Explanation:	This controller is operated with a test license for testing and demonstration purposes. For licensing reasons, you may not use this machine in the productive process.
Reaction:	Alarm display.

Remedy: Generate a new license key through the Internet at <http://www.siemens.com/automation/license> and enter in the operating area "Startup", function (HSK) "Licenses".
Enter a valid license key in the operating area "Startup", function (HSK) "Licenses".

Programm continuation: Clear alarm with the Delete key or NC START.

8089 The function 'Select tool offsets' is not possible

Explanation: The current options do not permit a tool offset.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Disable tools offsets or
reset option packages that include the tool offset as a reduced function.

Programm continuation: Clear alarm with the RESET key. Restart part program

8090 CNC lock function: No license available

Explanation: The CNC lock function is not licensed.
A test license is not acceptable.

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Generate a new license key on the internet at <http://www.siemens.com/automation/license> and enter it in the operating area "Setup", function (HSK) "Licenses"..

Programm continuation: Switch control OFF - ON.

8100 [Channel %1:] Block %2: function not possible

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: - Impossible due to embargo regulations:
- 1. Synchronized actions: Writing of feedrate, override and axial offsets (\$AA_VC, \$AC_VC, \$AA_OVR, \$AA_VC and \$AA_OFF) from synchronized actions as well as Continuous Dressing can be programmed only once in a block.
- 2. Extended measurement: The "Cyclic measurement" (MEAC) and "Measurement from synchronized action" are not possible.
- 3. Axis interpolation: The number of axes interpolating with one another must not exceed 4. This also includes synchronized coupling of axes via synchronized actions "DO POS[X]=\$A..." "DO FA[X]=\$A...".

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Modify the part program.

Programm continuation: Clear alarm with the RESET key. Restart part program

8101 [Channel %1:] Block %2 Function %3 Option '%4<OPTNX>' is not set

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Funktionsname
%4 = Brief description of option

Explanation:	The option stage is not set for the desired function.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. - Buy option - Activate the collision avoidance functionality (set MD19830 \$ON_COLLISION_MASK)
Programm continuation:	Clear alarm with the RESET key. Restart part program

8102 [Channel %1:] Block %2 motion synchronous action: %3 function not possible

Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID
Explanation:	- Impossible due to embargo regulations: - 1. Synchronous actions: Writing of feed, override and axial offsets (\$AA_VC, \$AC_VC, \$AA_OVR, \$AA_VC and \$AA_OFF) from synchronous actions as well as Continuous Dressing can be programmed only once in a block. - 2. Extended measurement: 'Cyclic measurement' (MEAC) and 'Measurement from synchronous action' is not possible. - 3. Axis interpolation: The number of axes interpolating with one another must not exceed 4 (this also includes synchronous coupling of axes via synchronous actions "DO POS[X]=\$A..." "DO FA[X]=\$A...").
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with the RESET key. Restart part program

8122 [Channel %1:] Block %2 Slave axis/spindle %3 Generic coupling option CP-STATIC required (type %4)

Parameters:	%1 = Channel number %2 = Block number %3 = Slave axis %4 = Option type
Explanation:	The option level CP-STATIC is required for the required function. Possible reasons: - More couplings of the option type were created than permissible. - The functional scope of one or several couplings has not been released. The generic coupling involved with the specified slave spindle is the following option type: - 1: COUP with coupling factor 1:1 without superimposed motion
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Purchase an adequate option level (CP-STATIC). - Reduce the number of simultaneously active couplings of the option type. - Only use the function scope that has been released.
Programm continuation:	Clear alarm with the RESET key. Restart part program

8124 [Channel %1:] Block %2 Slave axis/spindle %3 Generic coupling option CP-BASIC required (type %4)

Parameters: %1 = Channel number
%2 = Block number
%3 = Slave axis
%4 = Option type

Explanation: Option level CP-BASIC is required for the required function. Possible reasons:

- More couplings of the option types less than or equal to the option type were created than permissible.
- The number of permissible master axes was exceeded for one or several couplings.
- The functional scope of one or more couplings has not been released.
- Override for a synchronous spindle (coupling factor [1:1]) is not possible
- The curve table functionality (corresponds to option type 2) has not been released.

The generic coupling involved with the specified slave axis/spindle is the following option type:

- 0: TRAIL (in the BCS)
- 1: COUP with coupling factor [1:1] without superimposed motion
- 2: TRAIL and LEAD also in the Machine (MCS), also mixed in synchronized actions, spindles and rotary axes, COUP

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

- Purchase an adequate option level (CP-BASIC).
- Reduce the number of simultaneously active couplings of the option type.
- Only use the functional scope that has been released.
- No superimposed programming of synchronous spindles

Programm continuation: Clear alarm with the RESET key. Restart part program

8126 [Channel %1:] Block %2 Slave axis/spindle %3 Generic coupling option CP-COMFORT required (type %4)

Parameters: %1 = Channel number
%2 = Block number
%3 = Slave axis
%4 = Option type

Explanation: For the required function, option level CP-COMFORT is required. Possible causes:

- More couplings of the option type less than or equal to the option type were created than permissible.
- For one or several couplings, the number permissible master axes was exceeded.
- The functional scope of one or several couplings has not been released.
- Superimposing a synchronous spindle (coupling factor [1:1]) is not possible
- The curve table functionality (corresponds to option type 2) has not been released.

The generic coupling involved with the specified slave axis/spindle is the following option type:

- 0: TRAIL (in the BCS)
- 1: COUP with coupling factor [1:1] without superimposed motion
- 2: TRAIL and LEAD also in Machine (MCS), also mixed in synchronized actions, spindles and rotary axes, COUP
- 3: CP couplings (without curve tables) with up to 3 master axes, also mixed in synchronized actions, spindles and axes

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

- Remedy:**
- Purchase an adequate option level (CP-COMFORT).
 - Reduce the number of simultaneously active couplings of the option type.
 - Reduce the number of master axes per coupling.
 - Only use the functional scope that has been released.
 - No superimposed programming of synchronous spindles

Programm continuation: Clear alarm with the RESET key. Restart part program

8128 [Channel %1:] Block %2 Slave axis/spindle %3 Generic coupling option CP-EXPERT required (type %4)

Parameters:

- %1 = Channel number
- %2 = Block number
- %3 = Slave axis
- %4 = Option type

Explanation: For the required function, option level CP-EXPERT is required. Possible causes:

- More couplings of the option type less than or equal to the option type were created than permissible.
- For one or several couplings, the number permissible master axes was exceeded.
- The functional scope of one or several couplings has not been released.
- Superimposing a synchronous spindle (coupling factor |1:1|) is not possible
- The curve table functionality (corresponds to option type 2) has not been released.

The generic coupling involved with the specified slave axis/spindle is the following option type:

- 0: TRAIL (in the BCS)
- 1: COUP with coupling factor |1:1| without superimposed motion
- 2: TRAIL and LEAD also in MCS, also mixed in synchronized actions, spindles and rotary axes, COUP
- 3: CP couplings (without curve tables) with up to 3 master axes, also mixed in synchronized actions, spindles and axes
- 4: CP couplings with up to 5 master axes, also possible mixed in synchronized actions, spindles and axes, cascades

Reaction:

Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

- Remedy:**
- Purchase an adequate option level (CP-EXPERT).
 - Reduce the number of simultaneously active couplings of the option type.
 - Reduce the number of master axes per coupling.
 - Only use the functional scope released.
 - No superimposed programming of synchronous spindles

Programm continuation: Clear alarm with the RESET key. Restart part program

8130 [Channel %1:] Block %2 Slave axis/spindle %3 Generic coupling function not possible (type %4)

Parameters:

- %1 = Channel number
- %2 = Block number
- %3 = Slave axis
- %4 = Option type

Explanation:	Executing the required generic coupling function is not possible on this system. Possible reasons: - More couplings of the option types less than or equal to the option type were created than permissible. - The number of permissible master axes was exceeded for one or several couplings. - The functional scope of one or several couplings has not been released. - Superimposition for a synchronous spindle (coupling factor 1:1) is not possible - The curve table functionality (corresponds to option type 2) has not been released. The generic coupling involved with the specified slave axis/spindle is the following option type: - 0: TRAIL (in the BCS) - 1: COUP with coupling factor 1:1 without superimposed motion - 2: TRAIL and LEAD also in MCS, also possible mixed in synchronized actions, spindles and rotary axes, COUP - 3: CP couplings (without curve tables) with up to 3 master axes, also possible mixed in synchronized actions, spindles and axes - 4: CP couplings with up to 5 master axes, also possible mixed in synchronized actions, spindles and axes, cascades
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Reduce the number of simultaneously active couplings of the option type. - Reduce the number of master axes per coupling. - Only use the functional scope that has been released. - No superimposed programming of synchronous spindles
Programm continuation:	Clear alarm with the RESET key. Restart part program

9000 Handwheel %1 failed

Parameters:	%1 = Handwheel number
Explanation:	For PROFIBUS/PROFINET only: PROFIBUS/PROFINET handwheel has failed
Reaction:	Interface signals are set. Alarm display.
Remedy:	Restore connection to PROFIBUS/PROFINET handwheel
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

10203 [Channel %1:] NC start without reference point (action=%2<ALNX>)

Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	NC start has been activated in the MDI or AUTOMATIC mode and at least one axis that needs to be referenced has not reached its reference point.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Via the channel-specific MD20700: \$MC_REFP_NC_START_LOCK (NC Start without reference point) you can decide whether or not the axis has to be referenced before NC Start. The start of referencing can be enabled channel-specific or axis-specific. Channel-specific reference point approach: The rising edge of the NC/PLC interface signal DB3200 DBX1.0 (Activate referencing) starts an automatic sequence which starts the axes of the channel in the same sequence as specified in the axis-specific MD34110 \$MA_REFP_CYCLE_NR (axis sequence channel-specific referencing). 0: The axis does not participate in channel-specific referencing, but it must be referenced for NC Start, -1: The axis does not participate in channel-specific referencing, but it need not be referenced for NC Start, 1- 8: Starting sequence for the channel-specific referencing (simultaneous start at the same no.), 1 - 31: CPU type Axis-specific referencing: Press the direction key that corresponds to the approach direction in the axis-specific MD34010 \$MA_REFP_CAM_MDIR_IS_MINUS (reference point approach in minus direction).

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

10204 [Channel %1:] User action not possible without reference point (internal action=%2<ALNX>)

Parameters: %1 = Channel number

%2 = internal action number/internal action name

Explanation: A specific user action is to be executed, which leads to a (possibly other) internal action, for which at least one axis that needs to be referenced has not reached its reference point.

Reaction: Interface signals are set.

Alarm display.

Remedy: Please reference the axis that needs to be referenced.

If the user action as an internal action leads to an NC start, whether or not the axis has to be referenced before NC start can be decided via the channel-specific MD20700 \$MC_REFP_NC_START_LOCK (NC start without reference point). If the user action as internal actions leads to a user ASUB start, whether or not the axis has to be referenced before ASUB start can be decided via the channel-specific MD20115 \$MC_IGNORE_REFP_LOCK_ASUP (ASUB start without reference point). If the user action as internal actions leads to a Prog Event start, whether or not the axis has to be referenced before Prog Event start can be decided via the channel-specific MD20105 \$MC_PROG_EVENT_IGN_REFP_LOCK (Prog Event start without reference point).

Channel or axis-specific referencing can be triggered.

Please inform the authorized personnel/service department. Whether or not the axis has to be referenced before NC start can be determined via the channel-specific MD20700: \$MC_REFP_NC_START_LOCK (NC start without reference point).

Channel or axis-specific referencing can be triggered.

Channel-specific reference point approach: The rising edge of the NC/PLC interface signal DB3200 DBX1.0 (activate referencing) starts an automatic sequence, which starts the axes of the channel in the same sequence as specified in the axis-specific MD34110 \$MA_REFP_CYCLE_NR (axis sequence channel-specific referencing). 0: The axis does not participate in channel-specific referencing, but it must be referenced for NC start, -1: The axis does not participate in channel-specific referencing, but it need not be referenced for NC start, 1- 8: Starting sequence for the channel-specific referencing (simultaneous start at the same no.), 1- 31: CPU type

Axis-specific referencing: Press the direction key that corresponds to the approach direction in the axis-specific MD34010 \$MA_REFP_CAM_MDIR_IS_MINUS (reference point approach in minus direction).

Programm continuation: Clear alarm with the RESET key. Restart part program

10208 [Channel %1:] Continue program with NC start

Parameters: %1 = Channel number

Explanation: After block search with calculation, the control is in the desired state. The program can now be started with NC Start or the state can be changed for the time being with overstore/jog.

Reaction: Interpreter stop

Alarm display.

NC Stop on alarm.

Remedy: Press NC Start.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

10209 [Channel %1:] Internal NC stop after block search

Parameters: %1 = Channel number

Explanation: Internal alarm which only initiates the alarm response NC Stop.

The alarm is output in the following situations:

- If MD11450 \$MN_SEARCH_RUN_MODE, bit 0 ==1 and the last action block is loaded in the main run after block search. Alarm 10208 is then activated as a function of the NC/PLC interface signal DB3200 DBX1.6 (PLC action finished).

- Search alarm 10208 has been suppressed by the PI service _N_FINDBL (third decade of the parameter supplied with "2"). Alarm 10209 is set as a function of whether or not a search ASUB has been configured (MD11450 \$MN_SEARCH_RUN_MODE bit 1) with the end of the search ASUB or the loading of the last action block in the main run.

Reaction: Interpreter stop
NC Stop on alarm.

Remedy: Continue the program with NC start.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

10222 [Channel %1:] Inter-channel communication not possible

Parameters: %1 = Channel number

Explanation: This channel has received a negative acknowledgment from the inter-channel communication because the destination channel number is not known, e.g.: START(x) or WAITE(x) but channel x has not been initialized

Reaction: Alarm display.

Remedy: This is an indication of possible discrepancies. The program continues if no acknowledgment is called for.

Programm continuation: Clear alarm with the Delete key or NC START.

10223 [Channel %1:] Command %2 is already occupied

Parameters: %1 = Channel number
%2 = Event name

Explanation: This channel has received a negative acknowledgment from the inter-channel communication because this command is already active or has not yet been terminated, e.g.: INIT(x,"ncprog") but a program select request is already active for channel x.

Reaction: Alarm display.

Remedy: This is an indication of possible discrepancies. The program continues if no acknowledgment is called for.

Programm continuation: Clear alarm with the Delete key or NC START.

10225 [Channel %1:] command denied

Parameters: %1 = Channel number

Explanation: The channel has received a command that cannot be executed.

Reaction: Alarm display.

Remedy: Press RESET.

Programm continuation: Clear alarm with the Delete key or NC START.

10226 [Channel %1:] Reset/program end canceled

Parameters: %1 = Channel number

Explanation: An error occurred during reset or program end, so that the channel cannot be switched to a ready state.
This can occur, for example, if the interpreter reports an error during the processing of the init. blocks created during reset and program end.
As a rule, further alarms indicate the exact problem.

Reaction: NC Start disable in this channel.
Channel not ready.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Rectify the problem indicated by the other alarms, and press RESET again.

Programm continuation: Clear alarm with the RESET key. Restart part program

10299 [Channel %1:] Auto-Repos function is not enabled

Parameters: %1 = Channel number

Explanation:	The Auto-Repos function (operating mode) was selected in the channel but is not implemented.
Reaction:	Alarm display.
Remedy:	This message is purely informational.
Programm continuation:	Clear alarm with the Delete key or NC START.

10601 [Channel %1:] Block %2 zero velocity at block end point during thread cutting

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	This alarm occurs only when several blocks with G33 follow in succession. The block end velocity in the specified block is zero, although a further thread cutting block follows. The reasons for this can be, for instance: - G9 - Auxiliary function after motion - Auxiliary function output before the motion of the following block - Positioning axis in the block
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Modify the NC part program by removing any programmed "Stop at end of block" G09. Modify general MD11110 \$MN_AUXFU_GROUP_SPEC [n] for selecting the output time of an auxiliary function group by changing "Auxiliary function output before/after the movement" to "Auxiliary function output during the movement". Bit 5 = 1: Auxiliary function output before movement Bit 6 = 1: Auxiliary function output during movement Bit 7 = 1: Auxiliary function output after movement
Programm continuation:	Clear alarm with the RESET key. Restart part program

10604 [Channel %1:] Block %2 thread pitch increase too high

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The thread pitch increase is causing an axis overload. A spindle override of 100% is assumed during verification.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Reduce the spindle speed, thread pitch increase or path length in the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10605 [Channel %1:] Block %2 thread pitch decrease too high

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The thread pitch decrease is causing an axis standstill in the thread block.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Reduce the thread pitch decrease or path length in the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10610 [Channel %1:] Axis %2 not stopped

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: An axis/spindle has been positioned over several NC blocks using the POSA/SPOSA instruction. The programmed target position had not yet been reached ("exact stop fine" window) when the axis/spindle was reprogrammed.

Example:

```
N100 POSA[U]=100
```

```
:
```

```
N125 X... Y... U... ; e.g.: U axis still travels from N100!
```

Reaction: NC Start disable in this channel.

Interface signals are set.

Alarm display.

NC Stop on alarm.

Remedy: Check and correct the part program (analyze whether motion beyond block boundaries is appropriate here). Prevent block change by means of the keyword WAITP for axes or WAITS for spindles until the positioning axes or positioning spindles have also reached their target position.

Example for axes:

```
N100 POSA[U]=100
```

```
:
```

```
N125 WAITP(U)
```

```
N130 X... Y... U...
```

Example for spindles:

```
N100 SPOSA[2]=77
```

```
:
```

```
N125 WAITS(2)
```

```
N130 M6
```

Programm continuation: Clear alarm with the RESET key. Restart part program

10620 [Channel %1:] Block %3 axis %2 at software limit switch %4

Parameters: %1 = Channel number
%2 = Axis name, spindle number
%3 = Block number, label
%4 = String

Explanation: During the traversing motion, the system detected that the software limit switch would be traversed in the direction indicated. Exceeding the traversing range was not detected during block preparation because there has either been a motion overlay or a work offset has been executed or a coordinate transformation is active.

Reaction: Local alarm reaction.

NC Start disable in this channel.

Interface signals are set.

Alarm display.

NC Stop on alarm at block end.

Remedy: Depending on the reason for this alarm being triggered, the following remedial measures should be undertaken:

- Handwheel override: Cancel the motion overlay and avoid this or keep it smaller when the program is repeated.

- Transformation: Check the preset/programmed work offsets (current frame). If the values are correct, the tool holder (fixture) must be moved in order to avoid triggering the same alarm when the program is repeated, which would again cause the program to be canceled.

Programm continuation: Clear alarm with the RESET key. Restart part program

10621	[Channel %1:] Axis %2 rests on software limit switch %3%4
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = String %4 = The axis of the software limit switch is only output if different from the traversing axis.
Explanation:	The specified axis is already positioned at the displayed software end delimiter.
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. Check machine data MD36110 \$MA_POS_LIMIT_PLUS/MD36130 \$MA_POS_LIMIT_PLUS2 and MD36100 \$MA_POS_LIMIT_MINUS/MD36120 \$MA_POS_LIMIT_MINUS2 for the software limit switches. Shut down in JOG mode from the software limit switch. Please inform the authorized personnel/service department. Machine data: Check whether the 2nd software limit switch has been selected in the axis-specific interface signals: "DB380x DBX1000.3 (2nd software limit switch plus) and DB380x DBX1000.2 (2nd software limit switch minus).
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.
10622	[Channel %1:] Block %3 Axis %2 reaches software limit switch %4 with active transformation
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label %4 = String
Explanation:	During the traversing motion, the system detected that the software limit switch would be traversed in the direction indicated due to the active transformation.
Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Depending on the reason for this alarm being triggered, the following remedial measures should be undertaken: - Handwheel override: Cancel the motion overlay and avoid this or keep it smaller when the program is repeated. - Transformation: Check the preset/programmed work offsets (current frame). If the values are correct, the tool holder (fixture) must be moved in order to avoid triggering the same alarm when the program is repeated, which would again cause the program to be canceled.
Programm continuation:	Clear alarm with the RESET key. Restart part program
10625	[Channel %1:] Block %3 Slave axis/spindle %2 with CP-SW limit stop %4
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label %4 = String
Explanation:	The slave axis/spindle was stopped because there is a risk that the software limit switch will be passed in the displayed direction. Depending on MD30455 \$MA_MISC_FUNCTION_MASK, bit 11 and CPMBRAKE, it is possible that also the complete coupling group was braked in the specific direction.
Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.

Remedy: Depending on the reason for this alarm being triggered, the following remedial measures should be undertaken:

- Handwheel override: Cancel the motion overlay and avoid this or keep it smaller when the program is repeated.
- Transformation: Check the preset/programmed work offsets (current frame). If the values are correct, the tool holder (fixture) must be moved in order to avoid triggering the same alarm when the program is repeated, which would again cause the program to be canceled.

Programm continuation: Clear alarm with the RESET key. Restart part program

10630 [Channel %1:] Block %2 axis %3 at working area limit %4

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis, spindle number
%4 = String (+ or -)

Explanation: The specified axis violates the working area limitation. This is recognized only in the main run either because the minimum axis values could not be measured before the transformation or because there is a motion overlay.

Reaction: Local alarm reaction.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm at block end.

Remedy: Program other motion or do not perform overlaid motion.

Programm continuation: Clear alarm with the RESET key. Restart part program

10631 [Channel %1:] Axis %2 rests at working area limit %3%4

Parameters: %1 = Channel number
%2 = Axis, spindle
%3 = String (+ or -)
%4 = The axis of the working area limitation is only output if different from the traversing axis.

Explanation: The specified axis reaches the working area limitation in JOG mode.

Reaction: Alarm display.

Remedy: Check SD43420 \$SA_WORKAREA_LIMIT_PLUS and SD43430 \$SA_WORKAREA_LIMIT_MINUS for the working area limitation.

Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

10632 [Channel %1:] Block %2 axis %3 reaches the coordinate system-specific working area limit %4

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis, spindle number
%4 = String (+ or -)

Explanation: The specified axis violates the coordinate system-specific working area limitation. This is not detected until the main run, either because the minimum axis values could not be determined before the transformation or because there is an overlaid movement.

Reaction: Local alarm reaction.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm at block end.

Remedy: Program other motion or do not perform overlaid motion.

Programm continuation: Clear alarm with the RESET key. Restart part program

10633	[Channel %1:] Axis %2 is at coordinate system-specific working area limit %3%4
Parameters:	%1 = Channel number %2 = Axis, spindle %3 = String (+ or -) %4 = The axis of the coordinate system-specific working area limitation is only output if different from the traversing axis.
Explanation:	The specified axis reaches the coordinate system-specific working area limitation in JOG mode.
Reaction:	Alarm display.
Remedy:	Check the system parameter \$P_WORKAREA_CS_xx for the coordinate system-specific working area limitation.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.
10634	[Channel %1:] Axis %2, tool radius compensation is inactive for type %3 working area limitation, reason: The tool is not oriented parallel to the axis.
Parameters:	%1 = Channel number %2 = Axis, spindle %3 = 0: BCS, 1: WCS / SZS
Explanation:	The tool radius compensation of the working area limitation of the stated axis is not taken into account. Reason: The tool is not oriented parallel to the axis (e.g. because toolcarrier or transformation is active). The alarm is reported in JOG mode.
Reaction:	Alarm display.
Remedy:	The tool radius compensation for working area limitations in JOG mode can only be taken into account if the tool is parallel to the axis. Active transformation and toolcarrier must be switched off for this function.
Programm continuation:	Clear alarm with the Delete key or NC START.
10635	[Channel %1:] Axis %2, tool radius compensation is inactive for type %3 working area limitation, reason: no milling or drilling tool.
Parameters:	%1 = Channel number %2 = Axis, spindle %3 = 0: BCS, 1: WCS / SZS
Explanation:	The tool radius compensation of the working area limitation of the stated axis is not taken into account. Reason: The tool must be of type milling cutter or drill. The alarm is reported in JOG mode.
Reaction:	Alarm display.
Remedy:	The tool radius compensation for working area limitations in JOG mode can only be taken into account for milling or drilling tools.
Programm continuation:	Clear alarm with the Delete key or NC START.
10636	[Channel %1:] Axis %2, tool radius compensation is inactive for type %3 working area limitation, reason: Transformation is active.
Parameters:	%1 = Channel number %2 = Axis, spindle %3 = 0: BCS, 1: WCS / SZS
Explanation:	The tool radius compensation of the working area limitation of the stated axis is not taken into account. Reason: A transformation is active. The alarm is reported in JOG mode.
Reaction:	Alarm display.
Remedy:	The tool radius compensation for working area limitations in JOG mode cannot be taken into account if transformation is active.

Programm continuation: Clear alarm with the Delete key or NC START.

10637 [Channel %1:] Axis %2, tool radius compensation is inactive for type %3 working area limitation, reason: Tool not active.

Parameters: %1 = Channel number
%2 = Axis, spindle
%3 = 0: BCS, 1: WCS / SZS

Explanation: The tool radius compensation of the working area limitation of the stated axis is not taken into account.
Reason: No tool is active.
The alarm is reported in JOG mode.

Reaction: Alarm display.

Remedy: The tool radius compensation for working area limitations in JOG mode cannot be taken into account without an active tool.

Programm continuation: Clear alarm with the Delete key or NC START.

10650 [Channel %1:] Axis %2 incorrect gantry machine data, error code %3

Parameters: %1 = Channel number
%2 = Axis
%3 = Error no.

Explanation: An incorrect value was entered in the gantry-specific axial machine data. Further information can be derived from the error number.

- Error no. = 1 => either an incorrect gantry unit has been entered or the designation of the following axis is incorrect.
- Error no. = 2 => master axis has been specified more than once.

Reaction: NC not ready.
Mode group not ready, also effective for single axes.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Please inform the authorized personnel/service department. Correct the machine data:
MD37100 \$MA_GANTRY_AXIS_TYPE
0: No gantry axis 1: Master axis grouping 1 11: Slave axis grouping 1 2: Master axis grouping 2 12: Slave axis grouping 2 3:
Master axis grouping 3 13: Slave axis grouping 3

Programm continuation: Switch control OFF - ON.

10651 [Channel %1:] Gantry configuration error. Error code %2

Parameters: %1 = Channel number
%2 = Reason

Explanation:	The gantry configuration set in the machine data is erroneous. Gantry unit and reason for objection can be found in the transfer parameter. The transfer parameter is made up as follows. - %2 = error designation + gantry unit (XX). - %2 = 10XX => no master axis declared - %2 = 20XX => no slave axis declared - %2 = 30XX => different contents in MD30550 \$MA_AXCONF_ASSIGN_MASTER_CHAN slave axis and master axis - %2 = 40XX => different channel or NCU assignment of the gantry axes - %2 = 50XX => no slave axis declared in this channel - %2 = 60XX => different channel assignment of the master axis - %2 = 10000 => error: slave axis is geometry axis - %2 = 11000 => error: competing positioning axis as slave axis - %2 = 12000 => error: compile cycle axis as slave axis - %2 = 13000 => error: gantry axis is spindle - %2 = 14000 => error: gantry axis is Hirth geared e.g. error code 1001 = no master axis declared, gantry unit 1.
Reaction:	NC not ready. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Correct the machine data: MD37100 \$MA_GANTRY_AXIS_TYPE 0: No gantry axis 1: Master axis grouping 1 11: Slave axis grouping 1 2: Master axis grouping 2 12: Slave axis grouping 2 3: Master axis grouping 3 13: Slave axis grouping 3
Programm continuation:	Switch control OFF - ON.

10652	[Channel %1:] Axis %2 gantry warning threshold exceeded
Parameters:	%1 = Channel number %2 = Axis
Explanation:	The gantry following axis has exceeded the warning limit specified in MD37110 \$MA_GANTRY_POS_TOL_WARNING.
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. 1. Check axis (uneven mechanical movement?) 2. MD not set correctly (MD37110 \$MA_GANTRY_POS_TOL_WARNING). Changes to this MD take effect after a RESET.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

10653	[Channel %1:] Axis %2 gantry error threshold exceeded
Parameters:	%1 = Channel number %2 = Axis
Explanation:	The gantry following axis has exceeded the error limit (actual value tolerance) specified in MD37120 \$MA_GANTRY_POS_TOL_ERROR.

Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. 1. Check axis (uneven mechanical movement?) 2. MD not set correctly (MD37120 \$MA_GANTRY_POS_TOL_ERROR). A POWER ON is necessary after modifying the MD. If the axes are not yet referenced, MD37130 \$MA_GANTRY_POS_TOL_REF is the trigger condition for the error message.
Programm continuation:	Clear alarm with the RESET key. Restart part program

10654 [Channel %1:] Waiting for synchronization start of gantry group %2

Parameters:	%1 = Channel number %2 = Gantry unit
Explanation:	The alarm message appears when the axes are ready for synchronization. The gantry grouping can now be synchronized. The actual value difference between the master and slave axes is greater than the gantry warning limit MD 37110 \$MA_GANTRY_POS_TOL_WARNING. The synchronization must be started explicitly with the NC/PLC interface signal DBX5005.4 (Start gantry synchronization).
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. See Function Manual, Special Functions, Gantry Axes (G1)
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

10655 [Channel %1:] Synchronization of gantry group %2 in progress

Parameters:	%1 = Channel number %2 = Gantry unit
Explanation:	The alarm may be suppressed with MD37150 \$MA_GANTRY_FUNCTION_MASK Bit2 = 1.
Reaction:	Alarm display.
Remedy:	The message disappears as soon as the gantry group is synchronized.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

10656 [Channel %1:] Axis %2 gantry slave axis dynamically overloaded

Parameters:	%1 = Channel number %2 = Axis
Explanation:	The indicated gantry slave axis is dynamically overloaded, i.e. the slave axis cannot follow the master axis dynamically
Reaction:	Mode group not ready. Local alarm reaction. Channel not ready. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Compare the axial machine data of the gantry slave axis with the data of the gantry master axis
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

10657 [Channel %1:] Axis %2 power OFF in the gantry error limit exceeded status

Parameters:	%1 = Channel number %2 = Axis
--------------------	----------------------------------

Explanation:	Gantry error limit exceeded status (alarm 10653) has been switched off. The error can only be removed by deleting MD37135 \$MA_GANTRY_ACT_POS_TOL_ERROR or by deactivating the extended monitoring (MD37150 \$MA_GANTRY_FUNCTION_MASK Bit0).
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. 1. Remove a mechanical misalignment 2. Check axis (uneven mechanical movement?) 3. Delete MD37135 \$MA_GANTRY_ACT_POS_TOL_ERROR or deactivate the extended monitoring 4. MD37120 \$MA_GANTRY_POS_TOL_ERROR is set incorrectly If the MD is changed, a Power ON will be required.
Programm continuation:	Clear alarm with the RESET key. Restart part program

10658	[Channel %1:] Axis %2 impermissible axis status %3.
Parameters:	%1 = Channel number %2 = Axis number %3 = Error ID and gantry unit.
Explanation:	Error ID and gantry unit - 30XX => Gantry group cannot be closed, as not all gantry axes are in one channel. - 40XX => Gantry group cannot be closed, as the gantry axes have different axis states (the axis is assigned to the PLC, for example). - 50XX => Gantry group is to change channel due to a PLC request, not all gantry axes are known in the new channel. - 60XX => Gantry group is to be transferred to the channel due to an NC program request, but the channel does not know all the gantry axes. - 70XX => Gantry group cannot be closed, as movement is pending for at least one gantry axis.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Local alarm reaction.
Remedy:	Error ID: - 30XX => assign all gantry axes to the current channel, for example via axis exchange. - 40XX => set all axes of the gantry group to the same axis state, for example assign all axes to the NC program, or assign all axes to the PLC. - 50XX => make all gantry axes known to the required channel. - 60XX => make all gantry axes known to the required channel. :end
Programm continuation:	Clear alarm with the RESET key. Restart part program

10700	[Channel %1:] Block %2 NCK protection area %3 violated during automatic or MDI mode
Parameters:	%1 = Channel number %2 = Block number %3 = Protection area number
Explanation:	The workpiece-related NCK protection area has been violated. Note that another tool-related protection area is still active. The workpiece-related protected area can be traversed after a new NC Start.

Reaction:	Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm. The SHOWALARM and SETVDI reactions can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK_2 bit20.
Remedy:	Protection area can be traversed after a new NC Start.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10701	[Channel %1:] Block %2 channel-specific protection area %3 violated during automatic or MDI mode
Parameters:	%1 = Channel number %2 = Block number %3 = Protection area number
Explanation:	The workpiece-related channel-specific protection area has been violated. Note that another tool-related protection area is still active. The workpiece-related protected area can be traversed after a new NC Start.
Reaction:	Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm. The SHOWALARM and SETVDI reactions can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK_2 bit20.
Remedy:	Protection area can be traversed after a new NC Start.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10702	[Channel %1:] NCK protection area %2 violated during manual mode
Parameters:	%1 = Channel number %2 = Protection area number
Explanation:	The workpiece-related NCK protection area has been violated. Note that another tool-related protection area is still active. The workpiece-related protected area can be traversed after a new NC Start.
Reaction:	Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Protection area can be traversed after a new NC Start.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

10703	[Channel %1:] Channel-specific protection area %2 violated during manual mode
Parameters:	%1 = Channel number %2 = Protection area number
Explanation:	The workpiece-related channel-specific protection area has been violated. Note that another tool-related protection area is still active. The workpiece-related protected area can be traversed after a new NC Start.
Reaction:	Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Protection area can be traversed after a new NC Start.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

10704	[Channel %1:] Block %2 protection area monitoring is not guaranteed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	New movements of a geometry axis which have been added could not be allowed for at the time of block preparation. It is therefore not certain that the protection areas will not be violated. This is just a warning message without further reactions.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Ensure that the motion of the geometry axes, including the additional motion, does not violate the protection areas. (The warning appears nevertheless) or exclude additional motion.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.
10706	[Channel %1:] NCK protection area %2 reached with axis %3 during manual mode
Parameters:	%1 = Channel number %2 = Protection area number %3 = Axis name
Explanation:	The workpiece-related NCK protection area has been reached with the specified axis. Note that another tool-related protection area is still active. The workpiece-related protection area can be traversed when the PLC has issued an enable signal.
Reaction:	Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Inform the authorized personnel/service department. The protection area can be traversed after enable signal from PLC.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.
10707	[Channel %1:] Channel-specific protection area %2 reached with axis %3 during manual mode
Parameters:	%1 = Channel number %2 = Protection area number %3 = Axis name
Explanation:	The workpiece-related channel-specific protection area has been reached with the specified axis. Note that another tool-related protection area is still active. The workpiece-related protection area can be traversed when the PLC has issued an enable signal.
Reaction:	Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Inform the authorized personnel/service department. The protection area can be traversed after enable signal from PLC.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.
10720	[Channel %1:] Block %3 axis %2 software limit switch %4
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label %4 = String (+ or -)
Explanation:	The path programmed for the axis violates the currently valid software limit switch. The alarm is activated when preparing the part program block. If bit 11=0 in the machine data MD11411 \$MN_ENABLE_ALARM_MASK, this alarm is issued instead of alarm 10722. If bit 11 is set in the machine data MD11411 \$MN_ENABLE_ALARM_MASK, an expanded diagnostics option is offered for the software limit switch violation. The condition for activation is the presence of the ALUN* alarm file in the HMI.

Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Check and correct positions in the NC program. Please inform the authorized personnel/service department. Check machine data: MD36100 \$MA_POS_LIMIT_MINUS / MD36120 \$MA_POS_LIMIT_MINUS2 and MD36110 \$MA_POS_LIMIT_PLUS / MD36130 \$MA_POS_LIMIT_PLUS2 for the software limit switches. Check the axis-specific interface signals: DB380x DBX1000.3 / .2 (2nd software limit switch plus/minus) to see whether the 2nd software limit switch is selected. Check the currently active work offsets via the current frame. Work offsets, overlaid movements (\$AA_OFF), DRF and transformation components must also be checked.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10721 [Channel %1:] Block %3 axis %2 software limit switch %4

Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label %4 = String (+ or -)
Explanation:	The motion planned for the axis violates the currently valid software limit switch. The alarm is activated during the preprocessing of approach or rest blocks for REPOS. Depending on MD11411 \$MN_ENABLE_ALARM_MASK, bit11=0 this alarm is output instead of alarm 10723. If this MD11411 \$MN_ENABLE_ALARM_MASK, bit11 is set in this machine data \$MN_ENABLE_ALARM_MASK, an expanded diagnostics option is offered for the software limit switch violation. The condition for activation is the presence of the ALUN* alarm file in the HMI. See also the Diagnostics Manual for alarm 10723.
Reaction:	Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Determine the cause of the offset from the initial or target position. The REPOS command is executed at the end of an ASUB or system ASUB. See also cross reference from ASUBs. Check the axis-specific NC/PLC interface signals DB380x DBX1000.3 / .2 (2nd software limit switch plus/minus) to see whether the 2nd software limit switch is selected. Check the currently active work offset via the current frame. Also check the external work offsets, overlaid movements (\$AA_OFF), DRF and transformation components. Cancel the NC program with NC reset.
Programm continuation:	Clear alarm with the RESET key. Restart part program

10722 [Channel %1:] Block %5 axis %2 software limit switch %6 violated, residual distance: %7 %3<ALUN> violated

Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Unit of distance %4 = Block number, label number+string(+/-) residual distance
--------------------	---

Explanation:	This alarm was triggered during the preparation of the displayed block. Cause: The programmed path violates the active software limit switch in the traversing direction for the displayed axis. Note: Parameter 4 contains the descriptions of parameters 5, 6 and 7 separated by the character " ". - 5 = Block number, label - 6 = Number + string (+/-) - 7 = Distance-to-go Alarm 10722 is displayed for MD11411 \$MN_ENABLE_ALARM_MASK, bit11 == 1 instead of alarm 10720. Alarm 10722 offers an expanded diagnostics option for the software limit switch violation. Condition: Alarm file ALUN* is present in the HMI. See also: Diagnostics Manual for alarm 10720
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Check and, if necessary, correct the positions programmed in the NC program. Please inform the authorised personnel/service department. Check the parameterisation of the software limit switch: - MD36100 \$MA_POS_LIMIT_MINUS - MD36120 \$MA_POS_LIMIT_MINUS2 - MD36110 \$MA_POS_LIMIT_PLUS - MD36130 \$MA_POS_LIMIT_PLUS2 Check the axis-specific NC/PLC interface signals for selecting the 2nd software limit switch - DB31, ... DBX12.2 and .3 Check currently active work offsets of the current frame. Also check external work offsets, overlaid movements (\$AA_OFF), DRF and transformation components.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10723	[Channel %1:] Block %5 axis %2 software limit switch %6 violated, residual distance: %7 %3<ALUN>
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Unit of distance %4 = Block number, label number string(+/-) residual distance

Explanation:	The alarm is triggered during the preparation of the displayed approach or residual block for repositioning on the contour (REPOS). Cause: The programmed path violates the active software limit switch in the displayed traversing direction for the displayed axis. Note: Parameter 4 contains the descriptions of parameters 5, 6 and 7 separated by the character " ". - 5 = Block number, label - 6 = Number + string (+/-) 7 = Distance-to-go Alarm 10723 is displayed for MD11411 \$MN_ENABLE_ALARM_MASK, bit11 == 1 instead of alarm 10721. Alarm 10723 offers an expanded diagnostics option for the software limit switch violation. Condition: Alarm file ALUN* is present in the HMI. See also: Diagnostics Manual for alarm 10721
Reaction:	Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Determine the cause of the offset from the initial or target position. The REPOS command is executed at the end of a user ASUB or system ASUB. See also cross reference from ASUBs. Please inform the authorised personnel/service department. Check the parameterisation of the software limit switch: - MD36100 \$MA_POS_LIMIT_MINUS - MD36120 \$MA_POS_LIMIT_MINUS2 - MD36110 \$MA_POS_LIMIT_PLUS - MD36130 \$MA_POS_LIMIT_PLUS2 Check the axis-specific NC/PLC interface signals for selecting the 2nd software limit switch - DB31, ... DBX12.2 and .3 Check the active work offsets of the current frame. Check the external work offsets, overlaid movements (\$AA_OFF), DRF and transformation components.
Programm continuation:	Clear alarm with the RESET key. Restart part program

10730 [Channel %1:] Block %3 axis %2 working area limitation %4

Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label %4 = String (+ or -)
Explanation:	This alarm is generated if it is determined during block preparation that the programmed path of the axis violates the working area limitation. If bit 11=0 in machine data MD11411\$MN_ENABLE_ALARM_MASK, this alarm is issued instead of alarm 10732. If bit 11 is set in machine data MD11411 \$MN_ENABLE_ALARM_MASK, an expanded diagnostics option is offered for the software limit switch violation. The condition for activation is the presence of the ALUN* alarm file in the HMI.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	a) Check NC program for correct positional data and, if necessary, make corrections. b) Check work offsets (current frame) c) Correct working area limitation via G25/G26, or d) Correct working area limitation via setting data, or e) Deactivate working area limitation via setting data 43410 WORKAREA_MINUS_ENABLE=FALSE

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

10731 [Channel %1:] Block %3 axis %2 working area limitation %4

Parameters: %1 = Channel number
 %2 = Axis name, spindle number
 %3 = Block number, label
 %4 = String (+ or -)

Explanation: The motion planned for the axis violates the currently active working area limit.
 The alarm is activated during the preparation of approach or rest blocks for REPOS.
 This alarm is issued instead of alarm 10733 if bit 11 is not set in MD11411 \$MN_ENABLE_ALARM_MASK.

Reaction: Local alarm reaction.
 Interface signals are set.
 Alarm display.

Remedy: Determine the cause of the offset from the initial or target position. The REPOS command is executed at the end of an ASUB or system ASUB. See also cross reference from ASUBs.
 Check the currently active work offset via the current frame.
 Also check the external work offsets, overlaid movements (\$AA_OFF), DRF and transformation components.
 Cancel NC program with NC reset.

Programm continuation: Clear alarm with the RESET key. Restart part program

10732 [Channel %1:] Block %5 axis %2 working area limitation violated, residual distance: %6 %3<ALUN>

Parameters: %1 = Channel number
 %2 = Axis name, spindle number
 %3 = Unit of distance
 %4 = Block number, label|residual distance

Explanation: This alarm was triggered during the preparation of the displayed block.
 Cause:
 The programmed path violates the active working area limitation for the displayed axis.
 Note:
 Parameter 4 contains the descriptions of parameters 5 and 6 separated by the character "|".
 - 5 = Block number, label
 - 6 = Distance-to-go
 Alarm 10732 is displayed for MD11411 \$MN_ENABLE_ALARM_MASK, bit 11 == 1 instead of alarm 10730.
 Alarm 10732 offers an expanded diagnostics option for the working area limitation violation.
 Condition:
 Alarm file ALUN* is present in the HMI.
 See also:
 Diagnostics Manual for alarm 10730

Reaction: Correction block is reorganized.
 Local alarm reaction.
 Interface signals are set.
 Alarm display.

Remedy: a) Check NC program for correct positional data and, if necessary, make corrections.
 b) Check work offsets (current frame)
 c) Correct working area limitation via G25/G26, or
 d) Correct working area limitation via setting data, or
 e) Deactivate working area limitation via SD43410 \$SA_WORKAREA_MINUS_ENABLE=FALSE

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

10733	[Channel %1:] Block %5 axis %2 working area limitation violated, residual distance: %6 %3<ALUN>
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Unit of distance %4 = Block number, label residual distance
Explanation:	The alarm was triggered during the preparation of the displayed approach or residual blocks for repositioning on the contour (REPOS) Cause: The programmed path violates the active working area limitation for the displayed axis. Note: Parameter 4 contains the descriptions of parameters 5 and 6 separated by the character " ". - 5 = Block number, label - 6 = Distance-to-go Alarm 10733 is displayed for MD11411 \$MN_ENABLE_ALARM_MASK, bit11 == 1 instead of alarm 10731. Alarm 10733 offers an expanded diagnostics option for the working area limitation violation. Condition: Alarm file ALUN* is present in the HMI. See also: Diagnostics Manual for alarm 10731
Reaction:	Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Determine the cause of the offset from the initial or target position. The REPOS command is executed at the end of an ASUB or system ASUB. See also cross reference from ASUBs. Check the currently active work offset via the current frame. Also check the external work offsets, overlaid movements (\$AA_OFF), DRF and transformation components. Cancel NC program with NC reset.
Programm continuation:	Clear alarm with the RESET key. Restart part program
10735	[Channel %1:] Block %5 axis %2 coordinate system-specific working area limitation violated, residual distance: %6 %3<ALUN>
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Unit of distance %4 = Block number, label residual distance
Explanation:	This alarm was triggered during the preparation of the displayed block. Cause: The programmed path of the displayed axis violates the coordinate system-specific working area limitation. Note: Parameter 4 contains the descriptions of parameters 5 and 6 separated by the character " ". - 5 = Block number, label - 6 = Distance-to-go Condition: Alarm file ALUN* is present in the HMI
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.

Remedy:	a) Check NC program for correct positional data and, if necessary, make corrections. b) Check work offsets (current frame) c) Correct the working area limitation with WALCS1 ... WALCS9, or d) Correct the working area limitation in \$P_WORKAREA_CS_LIMIT_PLUS or \$P_WORKAREA_CS_LIMIT_MINUS, or e) Deactivate the working area limitation with \$P_WORKAREA_CS_MINUS_ENABLE =FALSE or \$P_WORKAREA_CS_PLUS_ENABLE. In cases d) and e), then reactivate the group of the selected coordinate system-specific working area limitation.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10736	[Channel %1:] Block %5 axis %2 coordinate system-specific working area limitation violated, residual distance: %6 %3<ALUN>
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Unit of distance %4 = Block number, label residual distance
Explanation:	This alarm was triggered during the preparation of the displayed approach or residual block for repositioning on the contour (REPOS). Cause: The programmed path violates the coordination system-specific working field limitation of the displayed axis. Note: Parameter 4 contains the descriptions of parameters 5 and 6 separated by the character " ". - 5 = Block number, label - 6 = Distance-to-go Condition: The alarm file ALUN* is present in the HMI
Reaction:	Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Determine the cause of the offset from the initial or target position. The REPOS command is executed at the end of an ASUB or system ASUB. See also cross reference from ASUBs. Check the currently active work offset via the current frame. Also check the external work offsets, overlaid movements (\$AA_OFF), DRF and transformation components. Cancel NC program with NC reset.
Programm continuation:	Clear alarm with the RESET key. Restart part program

10740	[Channel %1:] Block %2 too many empty blocks in WAB programming
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	It is forbidden to program more blocks between the WAB block and the block determining the approach and retraction tangents than are specified by MD20202 \$MC_WAB_MAXNUM_DUMMY_BLOCKS.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10741	[Channel %1:] Block %2 direction reversal with WAB infeed motion
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A safety distance which has been programmed is located perpendicular to the machining plane and not between the start and end point of the WAB contour.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
10742	[Channel %1:] Block %2 WAB distance invalid or not programmed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Possible causes: In a WAB block, the parameter DISR has not been specified or its value is less than or equal to 0. During approach or retraction with circle and active tool radius, the radius of the internally generated - WAB contour is negative. The internally generated WAB contour is a circle with a radius which, when offset with the current offset radius (sum of tool radius and offset value OFFN), yields the tool center point path with the programmed radius DISR.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
10743	[Channel %1:] Block %2 WAB programmed several times
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	An attempt has been made to activate a WAB motion before a previously activated WAB motion was terminated.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
10744	[Channel %1:] Block %2 no valid WAB direction defined
Parameters:	%1 = Channel number %2 = Block number, label

Explanation:	The tangent direction for smooth approach or retraction is not defined. Possible causes: In the program, no block with travel information follows the approach block. Before a retraction block, no block with travel information has been programmed in a program. The tangent to be used for WAB motion is vertical to the current machining plane.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10745	[Channel %1:] Block %2 WAB end position not clear
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In the WAB block and in the following block, the position has been programmed perpendicular to the machining direction. In the WAB block, no position has been indicated in the machining plane.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program. Either remove the position data for the infeed axis from the WAB block or the following block, or also program a position in the machining plane in the WAB block.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10746	[Channel %1:] Block %2 block search stop for WAB
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A preprocessing stop has been inserted between an SAR approach block and the following block defining the tangent direction or between an SAR retraction block and the following block defining the end position.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10747	[Channel %1:] Block %2 retraction direction not defined for WAB
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In a WAB retraction block with quarter circle or semi-circle (G248 or G348), the end point in the machining plane was not programmed, and either G143 or G140 without tool radius compensation is active.

Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program. You can make the following changes: - Specify the end point in the machining plane in the WAB block. - Activate the tool radius compensation (effective for G140 only, not for G143). - Specify the retraction side explicitly with G141 or G142. - Use a straight line instead of a circle for retraction.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10748 [Channel %1:] Block %2 illegal retract plane with WAB

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	By means of DISRP a position of the retraction plane has been programmed which is not situated between the safety distance (DISCL) and the starting point (during approach) and/or end point (during retraction) of the WAB movement.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify part program
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10750 [Channel %1:] Block %2 tool radius compensation activated without tool number

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A tool T... must be selected so that the control can make allowance for the associated compensation values. A correction data block (D1) containing the correction values (parameter P1 - P25) is automatically assigned to each tool (T number). Up to 9 correction data blocks can be assigned to a tool by specifying the required data block with the D number (D1 - D9). The cutter radius compensation (CRC) is allowed for if function G41 or G42 is programmed. The correction values are contained in parameter P6 (geometry value) and P15 (wear value) of the active correction data block Dx.
Reaction:	Correction block is reorganized. Interpreter stop Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Before calling the TRC with G41/G42, program a tool number under the address T...
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10751 [Channel %1:] Block %2 danger of collision due to tool radius compensation

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The "Bottleneck detection" (calculation of intersection for the following compensated traversing blocks) has not been able to calculate a point of intersection for the reviewed number of traversing blocks. It is therefore possible that one of the equidistant paths violates the workpiece contour.

Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Please inform the authorized personnel/service department. Check the part program and, if possible, modify the programming so that inside corners with smaller paths than the correction value are avoided. (Outside corners are not critical because the equidistants are lengthened or intermediate blocks are inserted, so that there is always a point of intersection). Increase the number of reviewed traversing blocks via machine data MD20240 \$MC_CUTCOM_MAXNUM_CHECK_BLOCKS (default: 3), this increases the amount of computing capacity required and consequently also the block change time. Another possible remedy: program CDOF2 for 3D-WRK(CUT3DC), program CDOF for 2D-WRK.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
10752	[Channel %1:] Block %2 overflow of local block buffer with tool radius compensation (%3, %4)
Parameters:	%1 = Channel number %2 = Block number, label %3 = Error code %4 = Number of missing blocks
Explanation:	The tool radius compensation must buffer a variable number of intermediate blocks in order to enable calculation of the equidistant tool path for each NC block. The size of the buffer cannot be determined by simple means. It depends on the number of blocks without traversing information in the compensation plane, the number of contour elements to be inserted and the shape of the curvature in spline and polynomial interpolation. The size of the buffer must not exceed the size of the system memory. Additional information about the error state Error code (3rd parameter). 0 = Overrun of the local block buffer for tool radius compensation. 1 = Local block buffer is presumably parameterized too large by the number of missing blocks (4th parameter).
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Please inform the authorized personnel/service department. Simplify NC program: - By avoiding: - Blocks without traversing information in the compensation plane - Blocks with contour elements having a variable curvature (e.g. ellipses) and with curvature radii that are smaller than the compensation radius. (Such blocks are divided up into several subblocks). - Increase the number of reviewed blocks for collision monitoring (MD20240 \$MC_CUTCOM_MAXNUM_CHECK_BLOCKS). - If (MD20240 \$MC_CUTCOM_MAXNUM_CHECK_BLOCKS) is increased, it must be ensured that the system memory is adequate. That means, if necessary, increasing the number of blocks in MD28070 \$MC_MM_NUM_BLOCKS_IN_PREP. Parameter 4 serves as an orientation value for the number of missing block locations. This value depends on the situation and has to be determined individually.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
10753	[Channel %1:] Block %2 selection of the tool radius compensation only possible in linear block
Parameters:	%1 = Channel number %2 = Block number, label

Explanation:	Selection of tool radius compensation with G41/G42 may only be performed in blocks where the G function G00 (rapid traverse) or G01 (feed) is active. In the block with G41/G42, at least one axis in the plane G17 to G19 must be written. It is always advisable to write both axes because, as a rule, both axes are traversed when selecting the compensation.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Correct the NC program and put the compensation selection in a block with linear interpolation.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10754	[Channel %1:] Block %2 deselection of the tool radius compensation only possible in linear block
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Deselection of tool radius compensation with G40 can only be performed in blocks where the G function G00 (rapid traverse) or G01 (feed) is active. In the block with G40, at least one axis in the plane G17 to G19 must be written. It is always advisable to write both axes because, as a rule, both axes are traversed when deselecting the compensation.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Correct the NC program and put the compensation selection in a block with linear interpolation.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10755	[Channel %1:] Block %2 selection of the tool radius compensation via KONT not possible at the current starting point
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	When activating the cutter radius compensation with KONT the starting point of the approach block is within the compensation circle and therefore already violates the contour. If the cutter radius compensation is selected with G41/G42, the approach behavior (NORM or KONT) determines the compensation movement if the present actual position is behind the contour. With KONT, a circle is drawn with the cutter radius around the programmed initial point (= end point of the approach block). The tangent that passes through the present actual position and does not violate the contour is the approach movement. If the start point is within the compensation circle around the target point, no tangent passes through this point.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Place selection of the CRC such that the starting point of the approach movements comes to rest outside of the correction circle around the target point (programmed traversing movements > compensation radius). The following possibilities are available: Selection in the previous block Insert intermediate block Select approach behavior NORM

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

10756 [Channel %1:] Block %2 deselection of the tool radius compensation via KONT not possible at the programmed end point

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: On deselection of the cutter radius compensation, the programmed end point is within the compensation circle. If this point were in fact to be approached without compensation, there would be a contour violation.
If the cutter radius compensation is deselected via G40, the approach behavior (NORM or KONT) determines the compensation movement if the programmed end point is behind the contour. With KONT, a circle is drawn with the cutter radius about the last point at which the compensation is still active. The tangent passing through the programmed end position and not violating the contour is the retraction movement.
If the start point is within the compensation circle around the target point, no tangent passes through this point.

Reaction: Correction block is reorganized.
Local alarm reaction.
Interface signals are set.
Alarm display.
NC Stop on alarm at block end.

Remedy: Place deselection of the CRC such that the programmed end point comes to rest outside the compensation circle around the last active compensation point. The following possibilities are available:
Deselection in the next block
Insert intermediate block
Select retract behavior NORM

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

10757 [Channel %1:] Block %2 Impermissible change of orientation while tool radius compensation is active

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: An orientation change has been programmed which is not permissible with the active tool radius compensation type (G code of group 22, e.g. CUT2D or CUT2DF). As a rule, changes to the tool orientation are only permissible and useful if 3D tool radius compensation is active.
An (impermissible) orientation change can also be triggered by a change of machining plane (G17 - G19).

Reaction: Correction block is reorganized.
Local alarm reaction.
Interface signals are set.
Alarm display.
NC Stop on alarm at block end.

Remedy: Activate a G code from group 22 (e.g. CUT3DC), in which the programmed orientation change is permissible.
Execute the program with constant tool orientation.
If a plane change is necessary, first deactivate the tool radius compensation, and reactivate after the plane change.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

10758 [Channel %1:] Block %2 curvature radius with variable compensation value too small

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:	The current cutter radius compensation (the cutter used) is too large for the programmed path radius. In a block with variable tool radius compensation, a compensation must be possible either anywhere or nowhere on the contour with the smallest and the largest compensation value from the programmed range. There must be no point on the contour in which the curvature radius is within the variable compensation range. If the compensation value varies its sign within a block, both sides of the contour are checked, otherwise only the compensation side.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Use smaller cutters or allow for a part of the cutter radius at the time of contour programming.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10759 [Channel %1:] Block %2 path is parallel to tool orientation

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In a block with spline or polynomial interpolation, the corrected path runs parallel to the tool orientation in at least one point, i.e. the path has a tangent perpendicular to the compensation plane. The tangent at a point on a path is regarded as parallel to the tool orientation if the angle between the two directions is less than the limit value defined by MD21080 \$MC_CUTCOM_PARALLEL_ORI_LIMIT. However, in circumferential milling, single straight lines running parallel to the tool orientation are permissible, as well as circles with a circle plane perpendicular to the compensation plane (application with smooth retraction from the groove). Also only individually, if the circle contains a point with a tangent parallel to the tool orientation. If a compressor (COMPCAD, COMPSURF) is active, the programmed straight lines (and possibly circles) are shown as non-linear polynomials, and that means a block with polynomial interpolation (see above). Straight lines in the direction of the tool orientation are not permissible in face milling (CUT3DF, CUT3DFS, CUT3DFF, CUT3DFD).
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Do not use splines or polynomials when writing the contour section, but straight lines and circles instead. Divide up the tool piece geometry and deselect the cutter radius compensation between the various sections.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10760 [Channel %1:] Block %2 helical axis is not parallel to tool orientation

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	With active tool radius compensation a helix is only permissible if the helix axis is parallel to the tool, i.e. the circle plane and the compensation plane must be identical.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Orient helix axis perpendicular to the machining plane.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10761	[Channel %1:] Block %2 tool radius compensation for ellipse with more than one revolution not possible
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	When machining the inside of an ellipse, in parts of the ellipse the curvature radii are greater than or smaller than the cutter radius compensation. In ellipses, in this case the block would be split up into 4 subblocks with curvature radii that are greater than and less than the compensation radius. Over several revolutions, there would be a tremendous increase in the amount of calculation required by the unlimited number of resulting subblocks, and therefore this situation is rejected by the error message. If compensation is possible everywhere or nowhere on the ellipse, then ellipses are also permissible that cover more than one full revolution.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Use cutter with smaller radius or program motion block on blocks with no more than one revolution.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
10762	[Channel %1:] Block %2 too many empty blocks between two traversing blocks with active tool radius compensation
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The maximum permissible number of empty blocks is limited by a machine data.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	- Modify part program - Modify machine data - Check whether SBL2 is activated. With SBL2, a block is generated from each part program line which can lead to exceeding the maximum permissible number of empty blocks between two traversing blocks.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
10763	[Channel %1:] Block %2 path component of the block in the compensation plane becomes zero
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Due to collision monitoring with active tool radius compensation, the path component of the block in the compensation plane becomes zero. If the original block contains no motion information perpendicular to the compensation plane, it means that this block is excluded. The alarm is a warning by default. It shows or writes in the alarm log which blocks are omitted, as information for the customer. Machining is not stopped. The alarm can be suppressed with MD11410 \$MN_SUPPRESS_ALARM_MASK bit1 = 1. The alarm can be configured with MD11411 \$MN_ENABLE_ALARM_MASK Bit16 = 1 so that the machining is stopped. This setting has priority over the above-mentioned behavior of MD11410 \$MN_SUPPRESS_ALARM_MASK Bit1.
Reaction:	Alarm display.

Remedy:

- The behavior is correct at narrow places that cannot be machined with the active tool.
- Modify the part program if necessary.
- Use tool with smaller radius if necessary.
- Program CDOF/CDOF2 if bottleneck detection is active.

Programm continuation: Clear alarm with the Delete key or NC START.

10764 [Channel %1:] Block %2 discontinuous path with active tool radius compensation

Parameters:

%1 = Channel number
%2 = Block number, label

Explanation: This alarm occurs when, with active tool radius compensation, the starting point used for calculating the compensation is not identical to the end point of the preceding block. This situation can occur, for example, when a geometry axis is traversed between two positions as a positioning axis or when, with an active kinematic transformation (e.g. 5-axis transformation) the tool length compensation is altered.

Reaction:

Correction block is reorganized.
Local alarm reaction.
Interface signals are set.
Alarm display.
NC Stop on alarm at block end.

Remedy: Modify part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

10770 [Channel %1:] Block %2 change of corner type due to change of orientation with active tool radius compensation

Parameters:

%1 = Channel number
%2 = Block number, label

Explanation: The type of a corner (inside or outside corner) depends not only on the programmed path but also on the tool orientation. For this purpose, the programmed path is projected in the plane perpendicularly to the actual tool orientation and the corner type is determined there. If a change in orientation is programmed (in one or several blocks) between two traversing blocks, resulting in the type of corner at the end of the first traversing block being different from that at the start point of the second block, the above error message is issued.

Reaction:

Correction block is reorganized.
Local alarm reaction.
Interface signals are set.
Alarm display.
NC Stop on alarm at block end.

Remedy: Modify part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

10776 [Channel %1:] Block%2 axis %3 must be geometry axis if tool radius compensation is active

Parameters:

%1 = Channel number
%2 = Block number, label
%3 = Axis name

Explanation: This alarm occurs when an axis that is required for tool radius compensation is not a geometry axis. With CUT2DF, the axis can be a positioning axis perpendicular to the machining plane; with all other types of compensation (CUT2DF, CUT3DC, CUT3DF, CUT3DFF), all geometry axes must be operated as such.

Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program. To ensure that the axes involved are known as GEOAX in the channel for the selection of G41/42, program them with GEOAX() or G91 G0 X0 Y0 in the block prior to G41/42.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10777	[Channel %1:] Block %2 tool radius compensation: too many blocks with suppression of compensation
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The maximum permissible number of blocks with active compensation suppression with tool radius compensation is limited by MD20252 \$MC_CUTCOM_MAXNUM_SUPPR_BLOCKS.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	- Modify the part program. - Modify the machine data. - Check whether SBL2 is selected. If SBL2 is selected, a block is generated from each part program line. This can lead to exceeding the maximum permissible number of empty blocks between two traversing blocks.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10778	[Channel %1:] Block %2 preprocessing stop with active tool radius compensation
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	If a preprocessing stop is detected with active tool radius compensation (either programmed by the user or generated internally) and the SD42480 \$SC_STOP_CUTCOM_STOPRE is set, then this warning is issued because in this situation machine movements which were not intended by the user can occur (termination of radius compensation and new approach).
Reaction:	Alarm display. NC Stop on alarm at block end.
Remedy:	- Continue the machining with CANCEL and Start. - Modify the part program. - Set SD42480 \$SC_STOP_CUTCOM_STOPRE to FALSE.
Programm continuation:	Clear alarm with the Delete key or NC START.

10780	[Channel %1:] Block %2 impermissible change of a turning or grinding tool with active tool radius compensation
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A tool change in which the edge offset (difference between edge center and edge reference point) changes, is only permissible in straight and polynomial blocks. A tool change is not permissible in circular blocks, involute blocks and in blocks including rational polynomials with maximum permissible numerator and denominator degrees.

Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	- Continue machining with CANCEL and Start. - Modify the part program. - Set SD42480 \$SC_STOP_CUTCOM_STOPRE to FALSE.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10781 [Channel %1:] Block %2 illegal orientation of involute with tool radius compensation

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Tool radius compensation is possible for involutes only if the compensation plane matches the involute plane.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10782 [Channel %1:] Block %2 illegal curve type with tool radius compensation

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	This alarm occurs, if an attempt is made to apply the tool radius compensation to a curve type for which this function is not implemented. The only cause at present: Involute with 3D tool radius compensation.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10784 [Channel %1:] Block %2 illegal tool for tool radius compensation with constraint surface

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	When activating the tool radius compensation with constraint surface, an illegal tool type is active. Only cutting tools of the tool types 1 to 399 are admitted with the following exceptions: - 111 ball end milling cutter - 155 torus milling cutter - 156 torus milling cutter - 157 torus milling cutter

Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Use another tool.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10785	[Channel %1:] Block %2 Impermissible tool for TRC with difference tool
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Neither a turning nor a grinding tool nor any other tool with a relevant cutting edge position is permitted during the activation of the tool radius compensation with a difference tool.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Use another tool.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10790	[Channel %1:] Block %2 plane change during linear programming with angles
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The active plane was changed between the first and second subblock when programming two straight lines with angle parameters.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10791	[Channel %1:] Block %2 invalid angle during linear programming
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	No intermediate point was found when programming a contour consisting of two straight lines and an angle specification.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10792 [Channel %1:] Block %2 illegal interpolation type during linear programming with angles

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Only spline or linear interpolation is permitted for programming two straight lines with angle specification. Circular or polynomial interpolation is not allowed.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10793 [Channel %1:] Block %2 second block missing during linear programming with angles

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The second block is missing during programming of two straight lines with angle specification. This situation only occurs if the first subblock is also the last block of a program, or if the first subblock is followed by a block with a preprocessor stop.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10794 [Channel %1:] Block %2 angle specification missing in 2nd block during linear interpolation with angles

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The angle is missing from the second block when programming two straight lines with angle specification. This error can only occur if an angle was programmed in the preceding block, but no axis of the active plane was programmed in that block. The cause of the error may therefore also have been the intention to program a single straight line with an angle in the previous block. However, in this block, exactly one axis of the active plane must be programmed.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10795 [Channel %1:] Block %2 end point specification during angle programming contradictory

Parameters:	%1 = Channel number %2 = Block number, label
--------------------	---

Explanation:	The programming of a straight line specified both positions of the active plane and an angle. The position of the end point is thus over-specified. The alarm may also be output if the position of the programmed coordinate cannot be reached with the specified angle. If a contour consisting of two straight lines is to be programmed with angles, it is possible to specify the two axis positions of the plane and an angle in the second block. The error can also occur if, due to a programming error, the preceding block cannot be interpreted as the first subblock of such a contour. A block is interpreted as the first block of a two-block contour if an angle, but not an axis of the active plane, was programmed, and if the block itself is not already the second block of a contour.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10805	[Channel %1:] Block %2 repositioning after switch of geometry axes or transformation
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In the asynchronous subroutine the assignment of geometry axes to channel axes was changed or the active transformation modified.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with the RESET key. Restart part program

10810	[Channel %1:] Block %2 master spindle not defined
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The function "Revolutional feedrate" (with G95 or G96), or "Rigid tapping" (with G331/G332) has been programmed, although no master spindle is defined from which the speed could be derived. For the definition the MD 20090 \$MC_SPIND_DEF_MASTER_SPIND is available for the default or the keyword SETMS in the part program, thus allowing each spindle of the channel to be redefined as master spindle.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Preset the master spindle with MD20090 \$MC_SPIND_DEF_MASTER_SPIND[n]=m (n ... channel index, m ... spindle no.) or define it with an identifier in an NC part program before a G function that requires a master spindle is programmed. The machine axis that is to be operated as a spindle must be equipped in MD35000 \$MA_SPIND_ASSIGN_TO_MACHAX[n]=m (n ... machine axis index, m ... spindle no.) with a spindle number. Additionally, the MD20070 \$MC_AXCONF_MACHAX_USED[n]=m (n ... channel axis index, m ... machine axis index) must be used to assign it to a channel (channel axis index 1 or 2).
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10820	[Channel %1:] Rotary axis/spindle %2 not defined
Parameters:	%1 = Channel number %2 = Axis name, spindle number

Explanation:	A revolutionary feedrate has been programmed for path and synchronized axes or for an axis/spindle. However, the rotary axis/spindle from which the feedrate is to be derived is not available.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Modify the part program or set SD43300 \$SA_ASSIGN_FEED_PER_REV_SOURCE correctly.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10860 [Channel %1:] Block %2 feedrate not programmed

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Cause: A traversing velocity has not been programmed for the displayed traversing block. Feed F or FZ: With the traversing velocity defined by feed F or FZ, F or FZ was not reprogrammed after the feed type changed, for example linear feed G94 after revolutionary feedrate G95 F or G95 FZ. Modal feed FRCM: With modal traversing velocity FRCM defined for rounding RND or chamfering CHF, feed FRCM was not reprogrammed after the feed type changed, for example linear feed G94 after revolutionary feedrate G95, or revolutionary feedrate G95 F after tooth feedrate G95 FZ. Note: Feed FRCM also has to be reprogrammed when the feed type changes if the current traversing block does not contain chamfering CHF or rounding RND, but the feed FRCM was programmed active, that is unequal to 0, before the feed type changed.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Program feedrate in accordance with the interpolation type. - G93: The feedrate is specified as a time-reciprocal value under address F in [rev/min]. - G94 and G97: The feedrate is programmed under address F in [mm/min] or [m/min]. - G95: The feedrate is programmed as revolutionary feedrate under address F in [mm/revolution] or under the address FZ in [mm/tooth]. - G96: The feedrate is programmed as cutting speed under address S in [m/min]. It is derived from the current spindle speed.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10861 [Channel %1:] Block %3 velocity of positioning axis %2 is zero

Parameters:	%1 = Channel number %2 = Axis %3 = Block number, label
Explanation:	No axis velocity has been programmed and the positioning velocity set in the machine data is zero.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Enter a different velocity in MD32060 \$MA_POS_AX_VELO.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10862	[Channel %1:] Block %2 master spindle also used as path axis
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A contour has been programmed that also includes the master spindle as contouring axis. However, the velocity of the contour is derived from the rotational speed of the master spindle (e.g. G95).
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Modify the program so that no reference is possible to the program itself.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
10865	[Channel %1:] Block %2 FZ active, but no tool offset, tool %3
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Tool
Explanation:	For the displayed traversing block a tooth feedrate is active, but no tool offset. Traversing can be performed after the error has been acknowledged. For calculation of the effective feedrate one tooth per revolution will be assumed.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Check the NC program for correct tool selection and correct it, if required; then continue the program with NC start. Or: Continue the NC program with NC start. For calculation of the effective feedrate one tooth per revolution is assumed.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
10866	[Channel %1:] Block %2 FZ is active, but the number of teeth of the active D number %4 of tool %3 is zero.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Identifier %4 = D number
Explanation:	Tooth feedrate is active for the displayed traversing block, but a D number of 0 is selected with \$TC_DPNT (number of teeth). Traversing can be performed after acknowledgment of the error. For calculation of the effective feedrate one tooth per revolution is assumed.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Check the NC program for correct tool selection and correct it, if required; then continue the NC program with NC start. Or: Continue the NC program with NC start. The feedrate will be calculated assuming 1 tooth.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10870	[Channel %1:] Block %2 facing axis for constant cutting speed not defined
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Constant cutting speed was selected although no transverse axis was applied as reference axis for constant cutting speed or assigned through SCC[AX]. Constant cutting speed can be activated as follows: - Basic position G96, G961 or G962 of G group 29 during booting - Programming of G96, G961 or G962 A reference axis for G96, G961 or G962 can be applied as a transverse axis in MD20100 \$MC_DIAMETER_AX_DEF or defined through the instruction SCC[AX].
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Check MD20100 \$MC_DIAMETER_AX_DEF. Before programming G96, G961 or G962 a transverse axis must be defined as a reference axis for constant cutting speed via MD20100 \$MC_DIAMETER_AX_DEF or SCC[AX].
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
10880	[Channel %1:] Block %2 too many empty blocks between two traversing blocks when inserting chamfers or radii
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Between 2 blocks containing contour elements and which are to be joined with a chamfer or a radius (CHF, RND), more blocks without contour information have been programmed than provided for in the MD20200 \$MC_CHFRND_MAXNUM_DUMMY_BLOCKS.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Modify the part program in order that the permissible number of dummy blocks is not exceeded or adapt the channel-specific machine data MD20200 \$MC_CHFRND_MAXNUM_DUMMY_BLOCKS (dummy blocks with chamfers/radii) to the maximum number of dummy blocks.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
10881	[Channel %1:] Block %2 overflow of local block buffer in the case of chamfers or radii
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Between 2 blocks containing the contour elements and to be joined with a chamfer or a radius (CHF, RND), so many dummy blocks have been programmed without contour information that the internal buffer is too small.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Modify part program such that the number of dummy blocks is reduced.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10882	[Channel %1:] Block %2 activation of chamfers or radii (non-modal) without traversing movement in the block
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	No chamfer or radius has been inserted between 2 linear or circle contours (edge breaking) because: There is no straight line or circle contour in the plane There is a movement outside the plane A plane change has taken place The permissible number of empty blocks without traversing information (dummy blocks) has been exceeded.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Correct the part program according to the above error description or change the number of dummy blocks in the channel-specific MD20200 \$MC_CHFRND_MAXNUM_DUMMY_BLOCKS to comply with the maximum number allowed for in the program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
10883	[Channel %1:] Block %2 chamfer or fillet has to be reduced
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	This alarm is output if, when inserting chamfers or radii, at least one of the relevant blocks is so short that the contour element to be inserted must be reduced from its originally programmed value. The alarm occurs only if bit 4 is set in MD11411 \$MN_ENABLE_ALARM_MASK. Otherwise, the chamfer or rounding is adapted without an alarm being output.
Reaction:	Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify NC program of continue program without modifications after CANCEL and Start or with Start alone.
Programm continuation:	Clear alarm with the Delete key or NC START.
10890	[Channel %1:] Block %2 overflow of local block buffer when calculating splines
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The maximum permissible number of empty blocks is limited by a machine data.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	- Modify part program - Modify machine data - Check whether SBL2 is activated. With SBL2, a block is generated from each part program line which can lead to exceeding the maximum permissible number of empty blocks between two traversing blocks.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
10891	[Channel %1:] Block %2 multiplicity of node is greater than its order
Parameters:	%1 = Channel number %2 = Block number, label

Explanation:	In the B spline the distance between nodes PL (node = point on spline at which 2 polynomials meet) has been programmed with zero too often in succession (i.e. the "multiplicity" of a node is too great). In the quadratic B spline the node distance may not be specified more than twice with 0 in succession, and in the cubic B spline not more than 3 times.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Program the node distance PL = 0 in succession no more than the degree of the B spline used.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10900 [Channel %1:] Block %2 no S value programmed for constant cutting speed

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	If G96 is active, the constant cutting speed under address S is missing.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Program constant cutting speed under S in [m/min] or deselect the function G96. For example, with G97 the previous feed is retained but the spindle continues to rotate at the current speed.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10910 [Channel %1:] Block %2 irregular velocity waveform of one path axis

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	When the path axis waveforms were analyzed during block preparation, a large local deviation relative to the path velocity was detected in the velocity waveform of one or more path axes. Such a situation can have the following causes: - The path runs close to singular positions of the machine kinematics. - The programmed contour characteristic is very uneven. - The FGROUP definition is unfavorable relative to the contour. - The setting MD28530 \$MC_MM_PATH_VELO_SEGMENTS=0 is inadequate for curvature changes occurring within one block. This problem occurs more frequently with G643, G644 and COMPCAD. - A kinematic transformation has been implemented with insufficient numerical accuracy. The path velocity is generally reduced substantially in order to avoid axis overloads safely. An apparent machine standstill may occur. Severe axis movements occur suddenly as soon as the singular position is reached.
Reaction:	Alarm display. Warning display.
Remedy:	Dividing a block into several smaller ones often provides an improvement. If MD28530 \$MC_MM_PATH_VELO_SEGMENTS=0 is set, then the alarm may be avoidable by a value MD28530 \$MC_MM_PATH_VELO_SEGMENTS=3 or 5, as the blocks are then analyzed considerably more accurately.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10911 [Channel %1:] Block %2 transformation prohibits to traverse the pole

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The given curve passes through the pole of the transformation.

Reaction:	Interpreter stop Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with the RESET key. Restart part program

10913	[Channel %1:] Block %2 negative feed profile is ignored
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The specified feedrate profile is in part negative. However, a negative path feedrate is not allowed. The feedrate profile is ignored. The specified feedrate block end value is taken when traversing over the entire block.
Reaction:	Local alarm reaction. Alarm display.
Remedy:	Check the specified feedrate profile for incorrect programming, and correct it.
Programm continuation:	Clear alarm with the Delete key or NC START.

10914	[Channel %1:] Block %2: movement not possible while transformation active.
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The machine kinematics do not allow the specified motion. The following transformation-dependent error causes can be present in TRANSMIT: There is a circular area around the pole where positioning is not possible. This area exists because the tool reference point cannot be traversed into the pole. The area is defined by the following factors: - The machine data (MD24920 \$MC_TRANSMIT_BASE_TOOL..) - The active tool length compensation (see \$TC_DP..). Whether the tool length compensation is included in the calculation depends on the selected working plane (see G17,...). The following transformation-dependent error causes can be present in TRAJNT: A block with Y<>0 (WCS) was programmed during active TRAJNT transformation. (Y axis must always be set to WCS=0 for active TRAJNT) The machine stops before the faulty block.
Reaction:	Interpreter stop Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Modify the part program. Change the incorrectly specified tool length compensation.
Programm continuation:	Clear alarm with the RESET key. Restart part program

10915	[Channel %1:] Block %2 Preparation problem in LookAhead (Identifier %3, Details %4)
Parameters:	%1 = Channel number %2 = Block number, label %3 = Error code %4 = Error details
Explanation:	The NCK was incorrectly parameterized (under certain circumstances, the parameterized memory is not sufficient), which is why LookAhead can no longer be operated in the expansion mode.

Reaction:	Interpreter stop Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Change parameterization (increase LookAhead memory and/or IPO buffer, change tolerances). Use standard LookAhead. Contact Siemens if necessary.
Programm continuation:	Clear alarm with the RESET key. Restart part program

10916	[Channel %1:] Block %2 Preparation problem in LookAhead (Identifier %3, Details %4)
Parameters:	%1 = Channel number %2 = Block number, label %3 = Error code %4 = Error details
Explanation:	The NCK was incorrectly parameterized (under certain circumstances the parameterized memory is not sufficient), this is the reason that the generated profile is not as smooth and uniform as it could be.
Reaction:	Local alarm reaction. Alarm display. Warning display.
Remedy:	Change the parameterization (increase the LookAhead memory and/or IPO buffer, change tolerances). 1010: Increase IPO buffer to at least 50 blocks, or maximum number of blocks in the braking ramp times 2.
Programm continuation:	Clear alarm with the Delete key or NC START.

10917	[Channel %1:] Block %2 Warning of COMPSURF function (code %3, details %4)
Parameters:	%1 = Channel number %2 = Block number, label %3 = Error code %4 = Error details
Explanation:	COMPSURF was only able to work with restrictions. The warning is only displayed if MD11411 \$MN_ENABLE_ALARM_MASK bit1 is set.
Reaction:	No alarm reaction. Warning display.
Remedy:	1: Modify parameterization (smaller tolerance, larger block buffer).
Programm continuation:	Clear alarm with the Delete key or NC START.

10930	[Channel %1:] Block %2 interpolation type not allowed in stock removal contour
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The following types of interpolation are allowed in the contour program for stock removal: G00, G01, G02, G03, CIP, CT
Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	In the contour subroutine, program only path elements that consist of straight lines and arcs.
Programm continuation:	Clear alarm with the RESET key. Restart part program

10931	[Channel %1:] Block %2 incorrect stock removal contour
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The following errors occurred in the subroutine for the contour during stock removal: - Full circle - Overlapping contour elements - Wrong start position
Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	The errors listed above must be corrected in the subroutine for the stock removal contour.
Programm continuation:	Clear alarm with the RESET key. Restart part program
10932	[Channel %1:] Block %2 preparation of contour has been restarted
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The first contour preparation/contour decoding run must be terminated with EXECUTE.
Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Program the keyword EXECUTE to terminate the contour preparation in the part program before again calling up contour segmentation (keyword CONTPRON).
Programm continuation:	Clear alarm with the RESET key. Restart part program
10933	[Channel %1:] Block %2 contour programm does not contain enough contour blocks
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The contour program contains: - Less than 3 contour blocks with CONTPRON - No contour blocks with CONTDCON
Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Increase the size of the program with the stock removal contour to include at least 3 NC blocks with movements in both axes of the current machining plane.
Programm continuation:	Clear alarm with the RESET key. Restart part program
10934	[Channel %1:] Block %2 array for contour segmentation is set too small
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	During contour segmentation (activated with the keyword CONTPRON), the field for the contour table has been detected as too small. For every permissible contour element (circle or straight line) there must be a row in the contour table.

Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Base the definition of the field variables of the contour table on the contour elements to be expected. The contour segmentation divides some NC blocks into as many as 3 machining cuts. Example: N100 DEF TABNAME_1 [30, 11] Field variables for the contour table provide for 30 machining cuts. The number of columns (11) is a fixed quantity.
Programm continuation:	Clear alarm with the RESET key. Restart part program

10950	[Channel %1:] Calculation of arc length function too inaccurate
Parameters:	%1 = Channel number
Explanation:	With active polynomial interpolation, the arc length function could not be calculated with the required accuracy.
Reaction:	Alarm display. Warning display.
Remedy:	Increase MD20262 \$MC_SPLINE_FEED_PRECISION. Reserve more memory for the representation of the arc length polynomials. Use MD28540 \$MC_MM_ARCLENGTH_SEGMENTS to specify how many polynomial segments can be used per block in order to approximate the arc length function.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10959	[Channel %1:] Block %2 SUPD is not permissible with active 3DF* radius compensation.
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Suppression of the tool offset is not permissible with active radius compensation for face milling because of the contour violation.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10960	[Channel %1:] Block %2 Radius compensation of type CUT3DF* (TRC for face milling) can only be used with the function COMPSURF
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Tool radius compensation for face milling must be used with the function COMPSURF. If CUT3DF* tool radius compensation is active, COMPSURF must be activated.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

10961	[Channel %1:] Block %2 maximum cubic polynomials are allowed on active radius compensation.
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	With active radius compensation, only up to cubic polynomials are permissible for the geometry axes. In this case no 4th or 5th degree polynomials can be programmed.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
10963	[Channel %1:] Block %2 COMPSURF is unable to smooth adequately
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Smoothing by COMPSURF is not optimal because limited by internal memory sizes. The alarm only occurs if MD11400 \$MN_TRACE_SELECT bit10 is set; otherwise only warning 10917 is output.
Reaction:	Local alarm reaction. Interface signals are set. Alarm display. Interpreter stop
Remedy:	Reduce tolerance (CTOL, OTOL, ATOL) in the part program.
Programm continuation:	Clear alarm with the RESET key. Restart part program
10964	[Channel %1:] Block %2 Certain functions are limited for this system
Parameters:	%1 = Channel number %2 = Block number, label %3 = Cause
Explanation:	Some functions are limited for this system. This alarm may be caused by the following: Cause: 1. When COMPSURF is active, more axes are traversed than are permissible for this system. 2. CUT3DFD is not permitted for this system.
Reaction:	Local alarm reaction. Interface signals are set. Alarm display. Interpreter stop
Remedy:	1. Program fewer axes per block. 2. Deactivate CUT3DFD.
Programm continuation:	Clear alarm with the RESET key. Restart part program
10990	[Channel %1:] Block %2 CPRECON not possible for axis %3 with FIR filter
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis

Explanation:	CPRECON is active, but for one axis with FIR filter (MD32402 \$MA_AX_JERK_MODE=5) no memory space was provided with MD38020 \$MA_MM_CPREC_FIR_POINTS. This is a configuration error.
Reaction:	Alarm display. Interface signals are set. Interpreter stop
Remedy:	Provide memory space for the function with MD38020 \$MA_MM_CPREC_FIR_POINTS.
Programm continuation:	Clear alarm with the RESET key. Restart part program

12000 [Channel %1:] Block %2 address %3 programmed repeatedly

Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string of the address
Explanation:	Most addresses (address types) may only be programmed once in an NC block, so that the block information remains unambiguous (e.g. X... T... F... etc. - exception: G and M functions).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. - Remove from the NC program addresses that occur more than once (except for those where multiple value assignments are allowed). - Check whether the address (e.g. the axis name) is specified via a user-defined variable (this may not be easy to see if allocation of the axis name to the variable is performed in the program through computational operations only).
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12010 [Channel %1:] Block %2 address %3 address type programmed too often

Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string of the address
Explanation:	The number of times each address type may occur in an NC block is defined internally (for instance, all axes together form one address type to which a block limit also applies).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECTION. The correction pointer positions on the incorrect block. The program information must be split up over several blocks (but make sure that the functions are of the block-by-block type!).
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12020 [Channel %1:] Block %2 illegal address modification

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Valid address types are 'IC', 'AC', 'DC', 'CIC', 'CAC', 'ACN', 'ACP', 'CACN', 'CACP'. Not each of these address modifications can be used for each address type. The Programming Guide specifies which of these can be used for the various address types. If this address modification is applied to address types that are not allowed, then the alarm is generated, e.g.: N10 G02 X50 Y60 I=DC(20) J30 F100 interpolation parameters with DC.

Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Key: Press the NC STOP key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer is then positioned on the incorrect block. Apply block-by-block address modifications only for permissible addresses, in accordance with the Programming Manual.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12030	[Channel %1:] Block %2 invalid parameter or data type in %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	In polynomial interpolation, polynomials must not be greater than the 3rd degree (refer to Programming Guide). $f(p) = a0 + a1 p + a2 p^2 + a3 p^3$ The coefficients a0 (the starting points) are identical to the end points of the preceding block and need not be programmed. In the polynomial block, a maximum of 3 coefficients per axis is therefore allowed (a1, a2, a3).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12040	[Channel %1:] Block %2 expression %3 is not of data type 'AXIS'
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string in the block
Explanation:	Some keywords require that the data in their parameters be written in variables of the type "AXIS". For example, in the keyword PO the axis identifier must be specified in the parenthesized expression, and it must be defined as a variable of the AXIS type. With the following keywords only parameters of the AXIS type are possible: AX[...], FA[...], FD[...], FL[...], IP[...], OVRA[...], PO[...], POS[...], POSA[...] Example: N5 DEF INT ZUSTELL=Z1 incorrect, this does not specify an axis identifier but the number 26 161 N5 DEF AXIS ZUSTELL=Z1 correct : N10 POLY PO[X]=(0.1,0.2,0.3) PO[Y]=(22,33,44) &PO[INFEED]=(1,2,3)
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Correct the part program in accordance with the instructions given in the Programming Guide.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12050	[Channel %1:] Block %2 DIN address %3 not configured
Parameters:	%1 = Channel number %2 = Block number, label %3 = DIN address in the block

Explanation:	The name of the DIN address (e.g. X, U, X1) is not defined in the control. In addition to the fixed DIN addresses, the control also has variable addresses. Refer to "Variable addresses" in the Programming Guide. The names of these addresses can be altered by machine data. e.g.: DIN identifier -> Configured identifier G01 -> LINE, G04 -> WAIT ...
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Study the Programming Guide and the machine data with respect to the addresses actually configured and their significance and correct the DIN block accordingly.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12060	[Channel %1:] Block %2 same G group programmed repeatedly
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The G functions that can be used in the part program are divided into groups that are syntax defining or non-syntax defining. Only one G function may be programmed from each G group. The functions within a group are mutually preclusive. The alarm refers only to the non-syntax defining G functions. If several G functions from these groups are called in one NC block, the last of these in a group is active in each case (the previous ones are ignored). Syntax defining G functions: 1. to 4th G group Non-syntax defining G functions: 5. to nth G group
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. No remedy is required. You should, however, check whether the G function last programmed really is the one required.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12070	[Channel %1:] Block %2 too many syntax-defining G functions
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Syntax defining G functions determine the structure of the part program block and the addresses contained in it. Only one syntax defining G function may be programmed in each NC block. The G functions in the 1st to 4th G group are syntax defining.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Analyze NC block and distribute the G functions over several NC blocks.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12080	[Channel %1:] Block %2 syntax error in text %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source text area

Explanation:	The grammar in this block is incorrect at the text position indicated. The precise reason for this error cannot be specified in more detail because there are too many possibilities for error. Example 1: N10 IF GOTOF ... ; the condition for the jump is missing! Example 2: N10 DEF INT VARI=5 N11 X VARI ; the operation is missing for the X and VARI variables Example 3: N13 R1=5 N15 R1=10 M=R1 ; value assignments must stand alone in the block, there must not be any other commands, such as auxiliary function outputs or traversing. The cause may also be the use of Unicode characters. This is indicated by the representation of characters not included in the ASCII character set in the alarm text. Whether a character not included in the ASCII character set is transformed into a space or alarm 12080 is output can be set using bit 3 of MD 10280 \$MN_PROG_FUNCTION_MASK.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Analyze the block and correct it in accordance with the syntax rules given in the Programming Guide.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12090	[Channel %1:] Block %2 unexpected parameter %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Disallowed parameters in the text
Explanation:	The programmed function has been predefined; no parameters are allowed in its call. The first unexpected parameter is displayed. Example: On calling the predefined subroutine TRAFOF (switching off a transformation) parameters have been transferred (one or more).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Program function without parameter transfer.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12100	[Channel %1:] Block %2 number of passes %3 not permissible
Parameters:	%1 = Channel number %2 = Block number, label %3 = Number of passes
Explanation:	The subroutines called with MCALL are modal, i.e. after each block with positional information a routine run is automatically performed once. For this reason, programming of the number of passes under address P is not allowed. The modal call is effective until another MCALL is programmed, either with a new subroutine name or without (delete function).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.

Remedy: Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.
Program the subroutine call MCALL without number of passes.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12110 [Channel %1:] Block %2 block syntax cannot be interpreted

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The addresses programmed in the block are not permissible together with the valid syntax defining G function, e.g. G1 I10 X20 Y30 F1000.

An interpolation parameter must not be programmed in the linear block.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.
Check the block structure and correct in accordance with the programming requirements.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12120 [Channel %1:] Block %2 G function not separately programmed

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The G function programmed in this block must be alone in the block. No general addresses or synchronous actions may occur in the same block. These G functions are:

G25, G26: Working area and spindle speed limitation
G110, G111, G112: Pole programming with polar coordinates
G92: Spindle speed limitation with v constant
STARTFIFO, STOPFIFO: Control of preprocessing buffer
E.g. G4 F1000 M100: no M function allowed in the G4 block.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Program G function by itself in the block.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12140 [Channel %1:] Block %2 functionality %3 not implemented

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Software construct in the source text

Explanation: In the full configuration of the control functions are possible that are not yet implemented in the current version.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.
The displayed function must be removed from the program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12150	[Channel %1:] Block %2 operation %3 not compatible with data type
Parameters:	%1 = Channel number %2 = Block number, label %3 = String (violating operator)
Explanation:	The data types are not compatible with the required operation (within an arithmetic expression or in a value assignment). Example 1: Arithmetic operation N10 DEF INT OTTO N11 DEF STRING[17] ANNA N12 DEF INT MAX : N50 MAX = OTTO + ANNA Example 2: Value assignment N10 DEF AXIS DRILL N11 DEF INT OTTO : N50 OTTO = DRILL
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Alter the definition of the variables used such that the required operations can be executed.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12160	[Channel %1:] Block %2 Value %3 lies beyond the value range
Parameters:	%1 = Channel number %2 = Block number, label %3 = Impermissible value
Explanation:	The programmed constant or the variable lies beyond the value range that has previously been established by the definition of the data type. An initial value in a DEF or REDEF instruction lies beyond the upper (ULI) or lower (LLI) limit values that have been programmed or already exist in the DEF instruction.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Correct value of the constant or adapt data type. If the value for an integer constant is too great, it can be specified as real constant by adding a decimal point. Example: R1 = 9 876 543 210 Correct: R1 = 9 876 543 210. Value range INTEGER: +/- (2**31 - 1) Value range REAL: +/- (10**-300 .. 10**+300)
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12161	[Channel %1:] Block %2 Error on defining the limit %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Impermissible limit value

Explanation:	The alarm may have the following causes. - During definition (DEF) or redefinition (REDEF) of a variable's limits, a value was entered for the upper limit that is smaller than that for the lower limit. - A limit for a variable type was programmed that is not of type CHAR, INT or REAL. - A limit value of type CHAR was programmed for a variable with the data type INT or REAL. - A string (more than one character) was programmed for one of the limits.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	If the alarm occurs in the part program (DEF instruction), press the NC Stop key and select the function "Compensation block" using PROGRAM CORRECT softkey. The cursor is placed on the incorrect block. Adjust the limit values afterwards or completely remove the limit programming in the case of an incorrect data type. If the alarm occurs on compiling a GUD or ACCESS file, correct the GUD or ACCESS definition file (DEF file).
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12162 [Channel %1:] Block %2 Physical unit not allowed

Parameters:

- %1 = Channel number
- %2 = Block number, label

Explanation: In a DEF or REDEF instruction, a physical unit may only be defined for variables of data type INT or REAL. Furthermore, only the following values may be programmed for the physical unit:

- 0 No physical unit
- 1 Linear or angular position, dependent upon axis type
- 2 Linear position [mm ; inch]
- 3 Angular position [degrees]
- 4 Linear or angular velocity, dependent upon axis type
- 5 Linear velocity [mm/min]
- 6 Angular velocity [rev/min]
- 7 Linear or angular acceleration, dependent upon axis type
- 8 Linear accel. [m/s² ; inch/s²]
- 9 Angular accel. [rev/s²]
- 10 Linear or angular jerk
- 11 Linear jerk [m/s³ ; inch/s³]
- 12 Angular jerk [rev/s³]
- 13 Time [s]
- 14 Position controller gain [16.667/s]
- 15 Revolutionary feedrate [mm/rev ; inch/rev]
- 16 Unit for temperature compensation values, dependent upon axis type
- 18 Force [N]
- 19 Weight [kg]
- 20 Moment of inertia [kgm²]
- 21 Per cent
- 22 Frequency [Hz]
- 23 Voltage [V]
- 24 Current [A]
- 25 Temperature [degrees Celsius]
- 26 Angle [degrees]
- 27 KV [1000/min]
- 28 Linear or angular position [mm|deg or inch|deg]
- 29 Cutting speed [m/min; feet/min]
- 30 Peripheral velocity [m/s; feet/s]
- 31 Resistance [ohms]
- 32 Inductance [mH]
- 33 Torque [Nm]
- 34 Torque constant [Nm/A]
- 35 Current controller gain [V/A]
- 36 Speed controller gain [Nm/rad s⁻¹]
- 37 Speed [rev/min]
- 42 Power [kW]
- 43 Low power [μA]
- 46 Low torque [μNm]
- 48 Per mill HZ_PER_SEC = 49, [Hz/s]
- 65 Flow [l/min]
- 66 Pressure [bar]
- 67 Volume [cm³]
- 68 Controlled system gain [mm/Vmin]
- 69 Controlled system gain force controller [N/V]
- 155 Thread pitch [mm/rev; inch/rev]
- 156 Thread pitch change [mm/rev² ; inch/rev²]

Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	If the alarm occurs in the part program (DEF instruction), press the NC Stop key and select the function "Compensation block" using PROGRAM CORRECT softkey. The cursor is placed on the incorrect block. In the compensation block the data type can now be adjusted in the DEF instruction, or the physical unit (PHU xy) must be removed. If the alarm occurs on compiling a GUD or ACCESS file, correct the GUD or ACCESS definition file (DEF file).
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12163	[Channel %1:] Block %2 Change of access protection not allowed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Changing the access rights for system variables (with REDEF) is not allowed in GUD files. They can only be changed in the ACCESS files (_N_SYACCESS_DEF, _N_SACCESS_DEF, _N_MACCESS_DEF and _N_UACCESS_DEF).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Cut the REDEF instruction from the GUD file and paste it into one of the ACCESS files.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12164	[Channel %1:] Block %2 access protection programmed more than once %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Duplicate protection level programming
Explanation:	The language commands APW and APR are used to program access protection for access to both the part program and the OPI. APWP and APRP define access protection from the part program; APWB and APRB define access protection via the OPI. Programming APW in the same block together with APWP or APWB or programming APR in the same block together with APRP or APRB will lead to a conflict, as the protection level assignment is no longer unique.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	If access protection in the part program and on the OPI needs to be set to different levels, only the language commands APWP, APWB, APRP and APRB may be used. If access protection is to be the same in the part program and on the OPI, it can also be programmed with APW or APR, although in this case the APWP and APWB or APRP and APRB commands must not be programmed in the same block.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12170	[Channel %1:] Block %2 name %3 defined several times
Parameters:	%1 = Channel number %2 = Block number, label %3 = Symbol in block
Explanation:	The symbol shown in the error message has already been defined in the active part program. Note that user-defined identifiers may occur more than once if the multiple definition occurs in other (sub)programs, i.e. local variables may be redefined with the same name if the program has been exited (subprograms) or has already been concluded. This applies both to user-defined symbols (labels, variables) and to machine data (axes, DIN addresses and G functions).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.

Remedy:	The symbol already known to data management is displayed. This symbol must be looked for in the definition part of the current program using the program editor. The 1st or 2nd symbol must be given a different name.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12180	[Channel %1:] Block %2 illegal chaining of operators %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Chained operators
Explanation:	Operator chaining means the writing in sequence of binary and unary operators without using any form of parentheses. Example: N10 ERG = VARA - (- VARB) ; correct notation N10 ERG = VARA - - VARB ; error!
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Formulate the expression correctly and unambiguously making use of parentheses. This improves clarity and readability of the program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12185	[Channel %1:] Block %2 a bit combination with %3 is not permitted
Parameters:	%1 = Channel number %2 = Block number, label %3 = Address name
Explanation:	A bit combination is not possible with the assignment to this address. Bit combinations are permitted only for coupling addresses (CPMBRAKE, CPMVDI and CPMAL).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Change the part rogram. If the data type of the address permits a bit combination, write the value of the address in a variable, make a bit combination with the variable, and assign the variable to the address.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12190	[Channel %1:] Block %2 variable of type ARRAY has too many dimensions
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Array with variables of type STRING may be no more than 1-dimensional, and with all other variables no more than 2-dimensional.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Correct the array definition, with multi-dimensional arrays define a second 2-dimensional array if necessary and operate it with the same field index.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12200	[Channel %1:] Block %2 symbol %3 cannot be created
Parameters:	%1 = Channel number %2 = Block number, label %3 = Symbol in block
Explanation:	The symbol to be created with the DEF instruction cannot be created because: - it has already been defined (e.g. as variable or function) - the internal memory location is no longer sufficient (e.g. with large arrays)
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Make the following checks: - Check with the text editor whether the name to be allocated in the active program cycle (main program and called subprograms) has already been used. - Estimate the memory requirements for the symbols already defined and reduce these if necessary by using fewer global and more local variables.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12205	[Channel %1:] Block %2 area specification missing for GUD area
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The area specification (NCK or CHAN) was not programmed in the definition instruction for a GUD variable.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Complete the area specification for the GUD variable definition in the GUD definition file. The definition of a GUD variable must conform to the following syntax: DEF <Area> <Data type> <Variable name> e.g. DEF NCK INT intVar1 DEF CHAN REAL realVar1
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12210	[Channel %1:] Block %2 string %3 too long
Parameters:	%1 = Channel number %2 = Block number, label %3 = String in the block
Explanation:	- In the definition of a STRING type variable, an attempt has been made to initialize more than 200 characters. - In an allocation, it has been found that the string does not fit the given variable. - In synchronized actions, a string with more than 31 characters has been programmed.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the "Correction block" function with the PROGRAM CORRECT softkey. The cursor is positioned on the incorrect block. - Select a shorter string or divide the character string into 2 strings. - Define a longer string variable. - Restrict the string to 31 characters.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12220	[Channel %1:] Block %2 binary constant %3 in string too long
Parameters:	%1 = Channel number %2 = Block number, label %3 = Binary constant
Explanation:	When initializing or allocating the value of a variable of type STRING more than 8 bits have been found as binary constant. DEF STRING[8] OTTO = "ABC'H55"B000011111'DEF"
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. In the window for the alarm message, the first characters of the binary constant are always displayed although the surplus bit might not be located until further on. Therefore, the complete binary constant must always be checked for an incorrect value.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12230	[Channel %1:] Block %2 hexadecimal constant %3 in string too long
Parameters:	%1 = Channel number %2 = Block number, label %3 = Hexadecimal constant
Explanation:	A string can also contain bytes that do not correspond to a character that can be entered or one that is available on a keyboard with a minimized number of keys. These characters can be input as binary or hexadecimal constants. They may occupy up to 1 byte each only - therefore be < 256, e.g. N10 DEF STRING[2] OTTO=" 'HCA' 'HFE' "
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. In the window for the alarm message, the first characters of the hexadecimal constant are always displayed although the surplus bit might not be located until further on. Therefore, the complete hexadecimal constant must always be checked for an incorrect value.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12240	[Channel %1:] Block %2 tool orientation %3 defined repeatedly
Parameters:	%1 = Channel number %2 = Block number, label %3 = Text
Explanation:	Only 1 tool orientation can be programmed per DIN block. This can either be defined via the 3 Euler angles, or the end points of the axes, or through direction vectors.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Since the tool orientation can be set in 3 different ways, the most advantageous should be selected. For this type of specification, the addresses and value assignments must be programmed and all other orientation parameters must be removed. Axis end points (additional axes): A, B, C axis identifiers Euler angles: A2, B2, C2 Direction vectors: A3, B3, C3
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12250	[Channel %1:] Block %2 nested macro %3 not possible
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	The macro technique supplies a 1-line instruction or series of instructions with a new identifier by means of the keyword DEFINE. There may be additional macros in the string of instructions down to a nesting depth of 3. Example: N10 DEFINE MACRO3 AS F100 N20 DEFINE MACRO2 AS MACRO3 N10 DEFINE MACRO1 AS G01 G91 X123 MACRO2
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Nested macros must be replaced by the full program information.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12260	[Channel %1:] Block %2 too many initialization values specified %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	In the initialization of an array (array definition and value assignments to individual array elements) there are more initialization values than array elements. Example: N10 DEF INT OTTO[2,3]=(..., ..., {more than 6 values})
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Check the NC program to establish whether: 1. During array definition the number of array elements (n,m) was indicated correctly (DEF INT FIELDNAME[n,m] e.g. an array with 2 lines and 3 columns: n=2, m=3). 2. During initialization the value assignments have been made correctly (values of the individual field elements separated by comma, decimal point for variables of the type REAL).
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12261	[Channel %1:] Block %2 initialization of %3 not allowed
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	Frame type variables cannot be initialized in the definition. Example: DEF FRAME LOCFRAME = CTRANS(X,200) Equally, no default values can be programmed for axes in the program run during field initialization via SET. A REDEF instruction with PRLOC is only permitted for setting data, but not for machine data or variables.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Perform the following initialization in the separate block in the execution part of the program: DEF FRAME LOCFRAME LOCFRAME = CTRANS(X,200) When using the SET expression for axis variables replace DEF AXIS AXIS_VAR [10] AXIS_VAR [5] = SET (X, , Y) by: DEF AXIS AXIS_VAR [10] AXIS_VAR [5] = X AXIS_VAR [7] = Y

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12270 [Channel %1:] Block %2 macro identifier %3 already defined

Parameters: %1 = Channel number
 %2 = Block number, label
 %3 = Source string macro name

Explanation: The name of the macro to be selected by the instruction DEFINE is already defined in the control as:
 Macro name
 Keyword
 Variable
 Configured identifier.

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.
 Select DEFINE instruction with another macro name.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12280 [Channel %1:] Block %2 maximum macro length %3 exceeded

Parameters: %1 = Channel number
 %2 = Block number, label
 %3 = Source string

Explanation: The string of instructions on the right side of the macro is limited to 256 characters. If an attempt is made to define a longer character string under one macro (possible only through V.24 input of NC blocks, because communication between operator panel and NCK is limited to a block length of 242 characters), an alarm is displayed.

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.
 Divide the functions defined under the macro into 2 macros.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12290 [Channel %1:] Block %2 arithmetic variable %3 not defined

Parameters: %1 = Channel number
 %2 = Block number, label
 %3 = Source string arithmetic variable

Explanation: Only the R-variables are predefined as arithmetic variables. All other arithmetic variables must be defined with the DEF instruction before being used. The number of arithmetic parameters is defined via machine data. The names must be unambiguous and may not be repeated in the control (exception: local variables).

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.
 Define the required variable in the definition part of the program (possibly in the calling program if it is to be a global variable).

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12300 [Channel %1:] Block %2 call-by-reference parameter missing on subroutine call %3

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Source string

Explanation: In the subroutine definition, a formal REF parameter (call-by-reference parameter) has been specified with no actual parameter assigned to it.
The assignment takes place in the subroutine call on the basis of the position of the variable name and not on the basis of the name!

Example:

Subroutine: (2 call-by-value parameters X and Y,
1 call-by-reference parameter Z)

PROC XYZ (INT X, INT Y, VAR INT Z)

:

M17

ENDPROC

Main program:

N10 DEF INT X

N11 DEF INT Y

N11 DEF INT Z

:

N50 XYZ (X, Y) ; REF parameter Z missing

or

N50 XYZ (X, Z) ; REF parameter Z missing!

Reaction: Correction block is reorganized.

Interface signals are set.

Alarm display.

Remedy: Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block.

Assign a variable to all REF parameters (call-by-reference parameters) of the subroutine when calling. No variable must be assigned to "normal" formal parameters (call-by-value parameters), as these are defaulted with 0.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12310 [Channel %1:] Block %2 axis parameter missing on procedure call %3

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Source string

Explanation:	When calling the subroutine, an AXIS parameter is missing which, according to the EXTERN declaration, should be present. With the EXTERN instruction, user-defined subroutines (procedures) are made "known" that have a parameter transfer. Procedures without parameter transfer require no EXTERN declaration. Example: Subroutine XYZ (with the formal parameters): PROC XYZ (INT X, VAR INT Y, AXIS A, AXIS B) EXTERN instruction (with variable types): EXTERN XYZ (INT, VAR INT, AXIS, AXIS) Subroutine call (with actual parameters): N10 XYZ (, Y1, R_TISCH) Variable X is defaulted with value 0 Variable Y is supplied with the value of the variable Y1 and returns the results to the calling program after the subroutine run Variable A is supplied with the axis in R_TISCH Variable B missing!
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Program the missing AXIS parameter in the call.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12320	[Channel %1:] Block %2 parameter %3 is no variable
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	A constant or the result of a mathematical expression has been assigned to a REF parameter instead of a variable at the time of the subroutine call, even though only variable identifiers are allowed. Examples: N10 XYZ (NAME_1, 10, OTTO) or N10 XYZ (NAME_1, 5 + ANNA, OTTO)
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Remove the constant or the mathematical expression from the NC block.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12330	[Channel %1:] Block %2 type of parameter %3 incorrect
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string

Explanation:	When calling a procedure (a subroutine) it is found that the type of the actual parameter cannot be converted into the type of the formal parameter. There are two possible cases: - Call-by-reference parameter: Actual parameter and formal parameter must be of precisely the same type, e.g. STRING, STRING. - Call-by-value parameter: Actual parameter and formal parameter can in principle be different providing conversion is basically possible. In the present case, however, the types are generally not compatible, e.g. STRING -> REAL. Overview of type conversions: - from REAL to: REAL: yes, INT: yes*, BOOL: yes1), CHAR: yes*, STRING: -, AXIS: -, FRAME: - - from INT to: REAL: yes, INT: yes, BOOL: yes1), CHAR: if value 0 ...255, STRING: -, AXIS: -, FRAME: - - from BOOL to: REAL: yes, INT: yes, BOOL: yes, CHAR: yes, STRING: -, AXIS: -, FRAME: - - from CHAR to: REAL: yes, INT: yes, BOOL: yes1), CHAR: yes, STRING: yes, AXIS: -, FRAME: - - from STRING to: REAL: -, INT: -, BOOL: yes2), CHAR: only if 1 character, STRING: yes, AXIS: -, FRAME: - - from AXIS to: REAL: -, INT: -, BOOL: -, CHAR: -, STRING: -, AXIS: yes, FRAME: - - from FRAME to: REAL: -, INT: -, BOOL: -, CHAR: -, STRING: -, AXIS: -, FRAME: yes 1) Value <= 0 corresponds to TRUE, value ==0 corresponds to FALSE. 2) String length 0 => FALSE, otherwise TRUE. *) At type conversion from REAL to INT fractional values that are >=0.5 are rounded up, others are rounded down.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Check transfer parameters of the subroutine call and define the application accordingly as call-by-value or call-by-reference-parameter.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12340 [Channel %1:] Block %2 number of parameters too high %3

Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	When calling a function or a procedure (predefined or user-defined) more parameters were transferred than defined. Predefined functions and procedures: The number of parameters has been set permanently in the NCK. User-defined functions and procedures: The number of parameters is established by type and name in the definition.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Check whether the correct procedure/function has been called. Program the number of parameters in accordance with the procedure/function.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12350 [Channel %1:] Block %2 parameter %3 no longer possible

Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	An attempt has been made to transfer actual parameters although axis parameters located before them have not been assigned. For procedure or function calls, the assignment of parameters that are no longer required can be omitted if no more parameters are to be transferred subsequently. Example: N10 FGROUP(X, Y, Z, A, B); a max. of 8 axes possible The following call-by-value parameters would then be initialized with zero because the space-dependent assignment has been lost on account of the missing axis parameters. Axes that can be omitted and following parameters do not occur in the predefined procedures and functions.

Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. In predefined procedures and functions either remove the following parameters or transfer any preceding axis parameters. In user-defined procedures and functions, parameter transfer must be programmed in accordance with the instructions given in the machine manufacturer's programming guide.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12360	[Channel %1:] Block %2 dimension of parameter %3 incorrect
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	The following possibilities of error must be checked: - The current parameter is an array, but the formal parameter is a variable - The current parameter is a variable, but the formal parameter is an array - The current and formal parameters are arrays, but not with the dimensions to be defined.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Correct the NC part program in accordance with the cause of error as listed above.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12370	[Channel %1:] Block %2 range of values %3 not permissible
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	A variable has been initialized with a value range outside an initialization block. The definition of program-global variables is allowed only in special initialization blocks. These variables can be initialized with a value range.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Remove the value range specification (begins with the keyword OF) or define the variable as a global variable in the initialization block and initialize it with a value range.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12380	[Channel %1:] Block %2 maximum memory capacity reached
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The data definitions in this block cannot be processed because the maximum available memory for creating the data has been filled, or because the data block cannot accommodate any further data. The alarm can also occur if several subroutine calls are executed in sequence and no block with an effect on the machine is generated (motion, dwell, M function).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.

Remedy:	Please inform the authorized personnel/service department. Reduce the number of variables, reduce the size of arrays, or increase the capacity of the data management system. - If new macro definitions are to be introduced -> Increase MD18160 \$MN_MM_NUM_USER_MACROS - If new GUD definitions are to be introduced -> Check MD18150 \$MN_MM_GUD_VALUES_MEM, MD18130 \$MN_MM_NUM_GUD_NAMES_CHAN, MD18120 \$MN_MM_NUM_GUD_NAMES_NCK - If the error occurs while executing an NC program with LUD definitions or when using cycle programs (the parameters count as LUD variable of the cycle program), the following machine data must be checked: MD28040 \$MC_MM_LUD_VALUES_MEM, MD18242 \$MN_MM_MAX_SIZE_OF_LUD_VALUE, MD18260 \$MN_MM_LUD_HASH_TABLE_SIZE, MD28020 \$MC_MM_NUM_LUD_NAMES_TOTAL, MD28010 \$MC_MM_NUM_REORG_LUD_MODULES
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12390 [Channel %1:] Block %2 initialization value %3 cannot be converted

Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	During initialization, a value has been assigned to a variable that does not correspond to the type of the variable, nor can it be converted to the data type of the variable. Overview of type conversions: - from REAL to REAL: no, INT: yes1), BOOL: yes, CHAR: yes2), STRING: - - from INT to REAL: yes, INT: no, BOOL: yes, CHAR: yes2), STRING: - - from BOOL to REAL: yes, INT: yes, BOOL: no, CHAR: yes, STRING: - - from CHAR to REAL: yes, INT: yes, BOOL: yes, CHAR: no, STRING: yes - from STRING to REAL: -, INT: -, BOOL: yes, CHAR: yes3), STRING: no 1) Value <> 0 corresponds to TRUE, value ==0 corresponds to FALSE. 2) String length 0 => FALSE, otherwise TRUE. 3) If only one character. It is not possible to convert from type AXIS and FRAME nor into type AXIS and FRAME.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. - Define variable type such that the initialization value can be assigned, or - Select initialization value in accordance with the variable definition.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12400 [Channel %1:] Block %2 field %3 element does not exist

Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	The following causes are possible: - Impermissible index list; an axis index is missing - Array index does not match the definition of the variables - An attempt was made to access a variable at array initialization via SET or REP; this attempt did not correspond to the standard access. Single character access, partial frame access, omitted indices not possible. A non-existent element was addressed on initializing this array.

Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Array initialization: Check the array index of the addressed element. The 1st array element is given the index [0,0], the 2nd array element [0,1] etc. The right array index (column index) is incremented first. In the 2nd row, the 4th element is also addressed with the index [1,3] (the indices start at zero). Array definition: Check the size of the array. The 1st number indicates the number of elements in the 1st dimension (number of rows), the 2nd number indicates the number of elements in the 2nd dimension (number of columns). An array with 2 rows and 3 columns must be defined by specifying [2,3].
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12410	[Channel %1:] Block %2 incorrect index type for %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	In assigning a value to an element of an array variable, the array index was specified in a way that is not allowed. Only the following are allowed as array index (in square brackets): - Axis identifier, provided the array variable was defined as data type FRAME. - Integer values for all other data types.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Correct indices of the array element with respect to variable definition or define the array variable differently.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12420	[Channel %1:] Block %2 identifier %3 too long
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The symbol to be defined or the specified jump target has a name which is longer than the 31 characters allowed.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. The symbol to be created or the target of program jumps (label) must conform to the system specifications, that means the name must begin with 2 letters (but the 1st sign must not be "\$") and may be up to a maximum of 31 characters.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12430	[Channel %1:] Block %2 specified index is invalid
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In specifying an array index (in the array definition) an index was used that is outside the permissible range.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.

Remedy: Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Specify array index within the permissible range. Value range per array dimension: 1 - 32 767.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12440 [Channel %1:] Block %2 maximum number of formal arguments exceeded

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: In the definition of a procedure (a subroutine) or in an EXTERN instruction, more than 127 formal parameters have been specified.

Example: PROC ABC (FORMPARA1, FORMPARA2, FORMPARA127, FORMPARA128, ...) EXTERN ABC (FORMPARA1, FORMPARA2, FORMPARA127, FORMPARA128, ...)

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. A check must be made to determine whether all parameters really have to be transferred. If so, the formal parameters can be reduced by using global variables or R variables, or by grouping together parameters of the same type to form an array and transfer them in this form.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12450 [Channel %1:] Block %2 label defined twice

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The label of this block already exists.

If the NC program is compiled off-line, the entire program is compiled block for block. During this procedure all multiple labels are recognized; this is not always the case with on-line compilation. (Only the actual program run is compiled here, i.e. program branches that are not passed through in this run are disregarded and could therefore contain programming errors).

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer is positioned on the block where the displayed label occurs for the 2nd time. Use the editor to search the part program where this label occurs for the 1st time, and change one of the names.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12460 [Channel %1:] Block %2 maximum number of symbols exceeded with %3

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Source string

Explanation: The max. number of variable definitions (GUD, LUD), macro definitions, cycle programs and/or cycle parameters (PROC instruction) that the controller's data management system is able to handle has been exceeded.

If this alarm occurs in conjunction with alarm 15175, not enough memory for the preprocessing of the cycle program definitions is available (PROC instruction).

If this alarm occurs in conjunction with alarm 15180, then this alarm shows the name of the file (INI or DEF file) causing the error.

(For a list of names of INI files and their meaning -> please refer to alarm 6010)

Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Generally reduce the number of symbols in the affected block (possibly by using the array technique or by using R variables), or adapt the corresponding machine data (see below). MD28020 \$MC_MM_NUM_LUD_NAMES_TOTAL with error in LUD blocks (i.e. if more variable definitions were made in the active part program than allowed by the MD). GUD data blocks can cause errors as part of the 'initial.ini download' process (e.g. in the case of a series start-up) or by selective activation via PI service _N_F_COPY (activate GUD via HMI dialog). If alarm 15180 refers to a GUD definition file, then MD18120 \$MN_MM_NUM_GUD_NAMES_NCK or MD18130 \$MN_MM_NUM_GUD_NAMES_CHAN is set to a value that is too small. Macros are loaded during POWER ON/NCK RESET or selectively via PI service _N_F_COPY (activate macro via HMI dialog). If alarm 15180 refers to a macro definition file, then MD18160 \$MN_MM_NUM_USER_MACROS is set to a value that is too small. Cycle program definitions (PROC instruction) are reloaded at each POWER ON/NCK RESET. In case of failure check parameter %3 to find out whether the name of the cycle program has caused the error - in this case, the value of MD18170 \$MN_MM_NUM_MAX_FUNC_NAMES should be increased, or whether the name of a cycle call parameter has caused the error - in this case, the value of MD18180 \$MN_MM_NUM_MAX_FUNC_PARAM should be increased.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12470	[Channel %1:] Block %2 G function %3 is unknown
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	With indirectly programmed G functions, an invalid or non-allowed group number has been programmed. Allowed group number = 1. and 5 max. number of G groups. In the displayed block, a non-defined G function has been programmed. Only "real" G functions are checked, which begin with the address G, e.g. G555. "Named" G functions such as CSPLINE, BRISK etc. are interpreted as subroutine names.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. You should decide on the basis of the machine manufacturer's programming guide whether or not the displayed G function exists or is available, or whether a standard G function has been reconfigured (or introduced by an OEM). Remove G function from the part program or program function call in accordance with the machine manufacturer's programming guide.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12475	[Channel %1:] Block %2 invalid G function number %3 programmed
Parameters:	%1 = Channel number %2 = Block number, label %3 = G code number
Explanation:	A non-allowed G function number (parameter 3) has been programmed for a G group with indirect G code programming. Only the G function numbers indicated in the Programming Guide "Fundamentals", Section 12.3 "List of G functions/Path conditions" are allowed.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12480	[Channel %1:] Block %2 subroutine %3 already defined
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	The name used in the PROC or EXTERN instruction has already been defined in another call description (e.g. for cycles). Example: EXTERN CYCLE85 (VAR TYP1, VAR TYP2, ...)
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. A program name must be selected that has not yet been used as identifier. (Theoretically, the parameter declaration of the EXTERN instruction could also be adapted to the existing subroutine in order to avoid the alarm output. However, it would have been defined identically twice).
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12481	[Channel %1:] Block %2 program attribute %3 not allowed
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	The attribute used in the PROC instruction is not permitted in the current operating mode. The attribute SAVE, for example, is not allowed in a technology cycle.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press button NC STOP and select the function "Compensation block" using softkey PROGRAM CORRECT. The cursor jumps to the incorrect block. Then delete the invalid program attribute.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12490	[Channel %1:] Block %2 access permission level %3 was not set
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	The desired access authorization was not set. The desired protection level is either beyond the permitted value range or changing the protection level is not allowed. The protection level may be changed only if: 1. The current protection level is equal to or higher than the level originally defined, and 2. The new protection level will be below the level originally defined. The alarm also occurs if the access authorization is to be changed for a user data block that is not available. The higher numerical values represent the lower protection levels. The lower 4 levels (from 7 to 4) correspond to the keyswitch positions, and the upper 4 levels are associated with 4 passwords.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.

Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. - Use the REDEF instruction only in the INITIAL_INI block - Using the operator panel, set the current protection level to at least the same level as that of the variable with the highest level - Program protection level within the permissible value range - Only program new protection levels that are lower than the old values
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12495	[Channel %1:] Block %2 Change (definition) of data class %3 is not allowed here
Parameters:	%1 = Channel number %2 = Block number, label %3 = Data class
Explanation:	Change of the data class in this ACCESS file or definition in this GUD file (for file name see alarm 15180) not possible. Priority of the new data class may only be smaller or the same as that of the definition file. This means that DCS may only be programmed in SGUD (SACCESS), DCM not in UGUD and GUD9 (UACCESS), DCU not in GUD9. DCI is allowed in all GUD and ACCESS files.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Program the data class of the area permissible for this GUD or ACCESS file.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12500	[Channel %1:] Block %2 in this module %3 is not possible
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	The displayed keyword may not be used in this type of block and at this location (all files in the NCK are designated as blocks). Block types: Program block Contains a main program or subroutine Data block Contains macro or variable definitions and possibly an M, H or E function Initialization block Contains only selected language elements for data initialization
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Remove the displayed language elements (keyword) with its parameters from this block and insert in the block provided for this purpose.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12510	[Channel %1:] Block %2 too many machine data %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source symbol

Explanation:	In the part program, in the machine data file (..._TEA) and in the initialization file (..._INI), no more than 5 machine data may be used per block. Example: N ... N 100 \$MN_OVR_FACTOR_FEEDRATE [10] = 15, \$MN_OVR_FACTOR_FEEDRATE [11] = 20 N ...
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. - Divide up the part program block into several blocks. - If necessary, use the local variable for storing intermediate results.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12520 [Channel %1:] Block %2 too many tool parameters %3

Parameters:	%1 = Channel number %2 = Block number, label %3 = Source symbol
Explanation:	In the part program, in the tool offset file (..._TOA) and in the initialization file (..._INI), no more than 5 tool offset parameters may be used per block. Example: N ... N 100 \$TC_DP1 [5,1] = 130, \$TC_DP3 [5,1] = 150.123, \$TC_DP4 [5,1] = 223.4, \$TC_DP5 [5,1] = 200.12, \$TC_DP6 [5,1] = 55.02 N ...
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. - Divide up the part program block into several blocks. - If necessary, use the local variable for storing intermediate results.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12530 [Channel %1:] Block %2 invalid index for %3

Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	In macro definitions, an attempt was made to define a G function with more than 3 decades or an M function with more than 2 decades as identifier of the macro. Example: _N_UMAC_DEF DEFINE G4444 AS G01 G91 G1234 DEFINE M333 AS M03 M50 M99 : M17

Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Modify the macro definition in accordance with the Programming Guide.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12540	[Channel %1:] Block %2 Block is too long or too complex
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The maximum internal block length after translator processing must not exceed 256 characters. After editing, for example, several macros in the block or a multiple nesting, this limit can be exceeded.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Divide up the program block into several subblocks.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12550	[Channel %1:] Block %2 name %3 is not known or not defined
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source symbol
Explanation:	The identifier displayed is not known or was not defined before use. A definable identifier can be: A macro, GUD, LUD, program name or a program parameter
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Compensation block" with the softkey PROGRAM CORRECT. The cursor positions itself on the incorrect block. - Correct the name used (writing error) - Check definitions of variables, subroutines and macros - Declare subroutine with EXTERN, load subroutine to SPF-Dir - Check interface definition of subroutine - See also MD10711 \$MN_NC_LANGUAGE_CONFIGURATION.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12551	[Channel %1:] Block %2 motion synchronized action: %3 function not available
Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID
Explanation:	Motion synchronized action: this function is not available for this system.

Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	- Correct the name used (write error) - Use a higher-level software system for reduced functions - Check the definitions of variables, subroutines and macros - Declare a subroutine with EXTERN; load the subroutine to SPF-Dir - Check the interface definition of the subroutine
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12552 [Channel %1:] Block %2 tool/magazine OEM parameter not defined. Option not set.

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The programmed \$TC_... Cx system variable is not known in the control.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	- Correct the name used (writing error) - \$TC_DPCx, \$TC_TPCx, \$TC_MOPCx, \$TC_MAPCx, \$TC_MPPCx, \$TC_DPCsx, \$TC_TPCsx, \$TC_MOPCSx, \$TC_MAPCSx, \$TC_MPPCSx; with x=1,...10 - These are the OEM parameters of the tools magazines, The corresponding machine data value is set to < 10, or the option 'TM OEM parameters' has not been set. - Use correct parameter number, or - if the name cannot be changed - set machine data correction (see MD18096 \$MN_MM_NUM_CC_TOA_PARAM, ... MD18206 \$MN_MM_NUM_CCS_TOA_PARAM, ...). - Check the option (machine data are only effective when the option is enabled).
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12553 [Channel %1:] Block %2 name %3 option/function is not active

Parameters:	%1 = Channel number %2 = Block number, label %3 = Source symbol
Explanation:	The option (if MD10711 \$MN_NC_LANGUAGE_CONFIGURATION = 1) or the NC function (if MD10711 \$MN_NC_LANGUAGE_CONFIGURATION = 3) related to this language command is not active. But the name of the language command is known. Each programming of this language command is rejected with this alarm.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the "Compensation block" function by pressing the PROGRAM CORRECT softkey. The cursor positions itself on the incorrect block. - Correct the name used (in the case of a typing error). - Activate the NC function (if a language command of an inactive function has been programmed). - Enable the option required (if a language command of a function with a non-enabled option has been programmed). See also MD10711 \$MN_NC_LANGUAGE_CONFIGURATION.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12554	[Channel %1:] Block %2 replacement cycle %3 for the predefined procedure is missing.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Cycle name
Explanation:	The replacement cycle that is to be called instead of the predefined procedure is not present / unknown in the control.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC stop key, and select the "Compensation block" function by pressing the PROGRAM CORRECT softkey. The cursor will position itself in the faulty block. - Correct the name used for the predefined procedure (write error) - Or load the replacement cycle into one of the cycle directories (+ restart)
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12555	[Channel %1:] Block %2 function not available (identifier %3)
Parameters:	%1 = Channel number %2 = Block number, label %3 = Fine ID
Explanation:	The identifier is not available for this system.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC stop key and select the "Compensation block" function by pressing the "Program correct" softkey. The correction indicator will position in the incorrect block. - Correct the name used (write error) - Use a better software system in case of malfunction - Check the definition of variables, subroutines and macros - Declare a subroutine with EXTERNAL; load the subroutine to SPF-Dir - Check the interface definition of the subroutine
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12556	[Channel %1:] Block %2 name %3 Name is already known
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source symbol
Explanation:	The name of the symbol to be created is part of the NC language scope and therefore already known. Although the NC function is not active, this name can no longer be used for GUDs, macros and PROC definitions.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press key NC Stop and select "Correction block" function by pressing softkey "Program correct". The correction indicator is set to the incorrect block. - Correct the name used (typing error) - With MD10711 \$MN_NC_LANGUAGE_CONFIGURATION = 2 or 4, only those language commands are created, the option of which has been set or the function of which is active.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12560	[Channel %1:] Block %2 programmed value %3 exceeds allowed limits
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	In a value assignment, the permissible value range of the data type has been exceeded.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the faulty block. Assign value within the value range of the various data types or, if necessary, use another type in order to increase the size of the value range, e.g. INT ->REAL. Value ranges of the various variable types: - REAL: Property: Fractional number with dec. pt., value range: +/- (2.2*10e-308 ... 1.8*10e308) - INT: Property: Integers with signs, value range: -2147483648 ... +2147483647 - BOOL: Property: Truth value FALSE, TRUE, value range: 0 or 1 - CHAR: Property: 1 ASCII character, value range: 0 ... 255 - STRING: Property: Character string (max. length depends on the variable), value range: 0 ... 255 - AXIS: Property: Axis addresses, value range: Channel identifier - FRAME: Property: Geometric information, value range: ---
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12571	[Channel %1:] Block %2 %3 not permissible for motion synchronous action
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source symbol
Explanation:	The predefined subprogram %3 specified here is not allowed in a block with motion synchronous action. It may only be contained in a "normal" block.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12572	[Channel %1:] Block %2 %3 only permissible for motion synchronous action
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source symbol
Explanation:	The predefined subprogram %3 specified here is only allowed in a block with motion synchronous action. It must not be contained alone in a "normal" block.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12573	[Channel %1:] Block %2 motion-synchronous action: Call by reference parameters not allowed %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source text area
Explanation:	Call by reference parameters (keyword VAR) are not possible with technology cycles.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct PROC instruction of technology cycle.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12580	[Channel %1:] Block %2 %3 not permissible for assignment in motion synchronous action
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source symbol
Explanation:	The variable displayed must not be written in a motion synchronous action. Only selected variables are permitted here, e.g. DO \$AA_IW[X]=10 is not allowed.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Modify part program. In a motion synchronous action, only certain variables are allowed. E.g. \$AA_IM, \$AC_DTGPB
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12581	[Channel %1:] Block %2 invalid read access to %3 while in motion synchronous action
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source symbol
Explanation:	In a motion synchronous action, the displayed variable must not be entered as a variable that is to be read online, i.e. 1. The displayed variable must not be written to the left of the comparison in a motion synchronous action. Only selected variables are permissible, e.g. WHEN \$AA_OVR == 100 DO 2. In a motion synchronous action, the displayed variable must not be used as a \$\$ variable, e.g. WHEN \$AA_IM[X] >= \$ \$P_AD[1] DO ... DO \$AC_VC = \$\$P_F 3. The displayed variable must not be programmed as an online evaluated parameter of a synchronous procedure, e.g. DO SYNFACT(1, \$AC_PARAM[0], \$SA_OSCILL_REVERSE_POS2[Z])
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12582	[Channel %1:] Block %2 field index %3 incorrect
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source symbol

Explanation:	\$A or \$V variables are assessed in real-time in motion synchronous actions, i.e. in the interpolation cycle. All other variables (e.g. user-defined variables) are still computed at block preparation. It is not permissible to index the index of a variable for block preparation with a real-time variable. Example: <pre>DEF INT INPUT[3] WHEN \$A_IN[1] == INPUT[\$A_INA[1]] DO ...</pre> The locally defined variable INPUT must not be indexed with a real-time variable. Program editing: <pre>WHEN \$A_IN[1] == \$AC_MARKER[\$A_INA[1]] DO ...</pre>
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify program: Use real-time variables.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12583 [Channel %1:] Block %2 variable %3 no system variable

Parameters:	%1 = Channel number %2 = Block number, label %3 = Source symbol
Explanation:	In motion synchronous actions, only special system variables are allowed on the left side of the compare operation for the assigned variable as input and result variable of SYNFACT and as input variable for PUTFTOCF. Real-time synchronous access is allowed here. The programmed variable is not a system variable. Example: <pre>DEF REAL OTTO, BERTA[2] DO SYNFACT(2,OTTO, \$MN_...);</pre> Local variables or machine data are not allowed as parameter for SYNFACT.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program. Local variables or machine data are not allowed as parameters for SYNFACT.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12584 [Channel %1:] Block %2 variable %3 cannot be read synchronously with motion

Parameters:	%1 = Channel number %2 = Block number, label %3 = Source symbol
Explanation:	In motion synchronous actions on the left side of the compare operation, only special variables are allowed as input variables of SYNFACT and as input variables for PUTFTOCF. Motion synchronous access is possible here. Example: <pre>PUTFTOCF(1, \$AA_OVR, 2, 1, 2)</pre> The variable \$AA_OVR is not allowed here.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program. For the functions SYNFACT and PUTFTOCF only certain variables are allowed, for example \$AC_DTGPW.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12585	[Channel %1:] Block %2 variable %3 cannot be changed synchronously with motion
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source symbol
Explanation:	When assigning SYNFACT in motion synchronous actions and result variables, only special variables are allowed. Real-time synchronous access is allowed here. Example: WHEN \$AA_IM[AX1]>= 100 DO \$AC_TIME=1000. The variable \$AC_TIME (time from beginning of block) cannot be written
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program. Only certain variables are allowed for the function SYNFACT where real-time synchronous access is possible.
Program continuation:	Clear alarm with NC START or RESET key and continue the program.
12586	[Channel %1:] Block %2 motion synchronous action: type conflict in variable %3
Parameters:	%1 = Channel number %2 = Block number %3 = Source symbol
Explanation:	Type conversion is not possible for online variables \$A.. or \$V.., which are evaluated or written in the interpolation cycle. Only variables of the same type can be linked or assigned to one another. Example: WHENEVER \$AA_IM[X] > \$A_IN[1] DO ... An online variable of the REAL type (actual value) cannot be compared with a variable of the BOOL type (digital input).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify the part program. Use variables of the same type. Example 1: WHENEVER \$AA_IM[X] > \$A_IN[1] DO ... Instead use: WHENEVER \$AA_IM[X] > \$A_INA[1] DO ... Example 2: WHENEVER ... DO \$AC_MARKER[1]=\$AA_IM[X]-\$AA_MM[X] Instead use: WHENEVER ... DO \$AC_PARAM[1]=\$AA_IM[X]-\$AA_MM[X]
Program continuation:	Clear alarm with NC START or RESET key and continue the program.
12587	[Channel %1:] Block %2 motion synchronous action: operation/function %3 not allowed
Parameters:	%1 = Channel number %2 = Block number %3 = Operator/function
Explanation:	The specified function / operator is not permissible for logic operations of real-time variables in motion synchronous actions. The following operators/functions are permissible: - == >= <= > < <> + - * / - DIV MOD - AND OR XOR NOT - B_AND B_OR B_XOR B_NOT - SIN COS TAN ATAN2 SQRT POT TRUNC ROUND ABS EXP LNX SPI
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.

Remedy: Modify the part program.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12588 [Channel %1:] Block %2 motion synchronous action: address %3 not allowed

Parameters: %1 = Channel number
%2 = Block number
%3 = Address

Explanation: - The specified address cannot be programmed in motion-synchronous actions. Example: ID = 1 WHENEVER \$A_IN[1]==1 DO D3
- The cutting edge cannot be changed out of a motion-synchronous action.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify the part program.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12589 [Channel %1:] Block %2 motion synchronous action: variable %3 not allowed with modal ID

Parameters: %1 = Channel number
%2 = Block number
%3 = Variable name

Explanation: The modal ID in motion synchronous action must not be formed by means of an on-line variable.
Examples:
ID=\$AC_MARKER[1] WHEN \$a_in[1] == 1 DO \$AC_MARKER[1] = \$AC_MARKER[1]+1
This can be corrected in the following way:
R10 = \$AC_MARKER[1]
ID=R10 WHEN \$a_in[1] == 1 DO \$AC_MARKER[1] = \$AC_MARKER[1]+1
The ID in a synchronous action is always permanent, and cannot be changed in the interpolation cycle.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify the part program. Replace the on-line variable by an arithmetic variable.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12590 [Channel %1:] Block %2 global user data cannot be created

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Global user data cannot be created because the user data block for this global user data is not available.
The number of global user data blocks is defined in MD18118 \$MN_MM_NUM_GUD_MODULES.
Here, _N_SGUD_DEF corresponds to block 1, _N_MGUD_DEF corresponds to block 2, _N_UGUD_DEF corresponds to block 3, _N_GUD4_DEF corresponds to block 4 etc.
In the directory _N_DEF_DIR, there is a file with definitions for global user data, the block number of which is greater than the number of blocks given in the MD.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Please inform the authorized personnel/service department. Increase MD18118 \$MN_MM_NUM_GUD_MODULES.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12600	[Channel %1:] Block %2 invalid line checksum
Parameters:	%1 = Channel number %2 = Block number
Explanation:	On processing an INI file or when executing a TEA file, an invalid line checksum has been detected.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Correct the INI file, or correct the MD and create a new INI file via "upload".
Programm continuation:	Switch control OFF - ON.
12610	[Channel %1:] Block %2 Single character access with call-by-reference parameter not possible %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	An attempt has been made to use a single character access for a call-by-reference parameter.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Save single characters in a user-defined CHAR variable, and transfer it.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12620	[Channel %1:] Block %2 accessing this variable as single character not possible %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source string
Explanation:	The variable is not a user-defined variable. The single character access is only allowed for user-defined variables (LUD/GUD).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Save the variable in a user-defined STRING variable, process it, and save it again.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12630	[Channel %1:] Block %2 skip ID/label in control structure not allowed
Parameters:	%1 = Channel number %2 = Block number
Explanation:	Blocks with control structures (FOR, ENDIF, etc.) cannot be concealed and must not contain any labels.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct the part program as follows: Form the skip ID by an IF query. Write the label alone in the block before the control structure block.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12640 [Channel %1:] Block %2 invalid nesting of control structures

Parameters: %1 = Channel number
%2 = Block number

Explanation: Error in program run: Opened control structures (IF-ELSE-ENDIF, LOOP-ENDLOOP etc.) are not terminated or there is no beginning of loop for the programmed end of loop.

Example:

LOOP ENDIF ENDLOOP

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Correct the part program so that all open control structures are terminated.

Programm continuation: Clear alarm with the RESET key. Restart part program

12641 [Channel %1:] Block %2 maximum nesting depth of control structures exceeded

Parameters: %1 = Channel number
%2 = Block number

Explanation: Max. nesting depth control structures (IF-ELSE-ENDIF, LOOP-ENDLOOP etc.) exceeded. At the present time, the max. nesting depth is 8.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Correct the part program. If necessary, move parts to a subroutine.

Programm continuation: Clear alarm with the RESET key. Restart part program

12650 [Channel %1:] block %2 axis identifier %3 different in channel %4

Parameters: %1 = Channel number
%2 = Block number
%3 = Source symbol
%4 = Channel number with different axis definition

Explanation: In cycles that are preprocessed at Power On, only those geometry and channel axis identifiers may be used that exist in all channels with the same meaning. In different channels, different axis indices are assigned to the axis identifier.

The axis identifiers are defined via MD20060 \$MC_AXCONF_GEOAX_NAME_TAB and MD20080 \$MC_AXCONF_CHANAX_NAME_TAB. Example: C is the 4th channel axis in channel 1 and the 5th channel axis in channel 2.

If the axis identifier C is used in a cycle that is preprocessed at Power On, then this alarm is issued.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Inform the authorized personnel/service department.

1. Modify machine data: Select the same identifiers for geometry and channel axes in all channels. Example: The geometry axes are called X, Y, Z in all channels. They can then also be programmed directly in preprocessed cycles.

2. Do not program the axis directly in the cycle, but as a parameter of the axis type. Example: Cycle definition:

PROC DRILL(AXIS DRILLAXIS) G1 AX[DRILLAXIS]=10 F1000 M17

Call from the main program:

DRILL(Z)

Programm continuation: Clear alarm with the RESET key. Restart part program

12660	[Channel %1:] Block %2 motion synchronous action: variable %3 reserved for motion synchronous actions and technology cycles
Parameters:	%1 = Channel number %2 = Block number %3 = Variable name
Explanation:	The displayed variable may only be used in motion synchronous actions or in technology cycles. For example, '\$R1' may only be used in motion synchronous actions. In standard part programs R variables are programmed with R1.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12661	[Channel %1:] Block %2 technology cycle %3: no further subprogram call possible
Parameters:	%1 = Channel number %2 = Block number %3 = Name of the technology cycle call
Explanation:	In a technology cycle it is not possible to call a subroutine or another technology cycle.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12700	[Channel %1:] Block %2 contour definition programming not allowed as modal sub-program is active
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In the external language mode, a block is programmed with contour definition and a modal cycle is active at the same time. Because of unclear address assignment (e.g. R = radius for contour definition or return plane for drilling cycle) contour definition programming must not be used when a modal cycle is active.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12701	[Channel %1:] Block %2 illegal interpolation type for contour definition active
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In one contour definition block, G01 is not active as interpolation function. In one contour definition block, the linear interpolation always has to be selected with G01. G00, G02, G03, G33 etc. are not permitted.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify the part program. Program the linear interpolation with G01.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

12710	[Channel %1:] Block %2 illegal language element in external language mode
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The programmed language element is not allowed or unknown in external language mode. Only the language elements from Siemens mode which are used for subprogram calls (except for Lxx) and the language constructs for program repetition with REPEAT (UNTIL) are allowed.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify the part program. Check whether the language command is available in the Siemens mode. Switch to Siemens mode with G290. Program the command in the next block, and switch back to the external language mode in the following block.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12712	[Channel %1:] Block %2 external language mode is not active
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	It is not possible to switch to external language mode. Before external language mode can be used, it has to be configured (see MD18800 \$MN_MM_EXTERN_LANGUAGE).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program. Configure external language mode.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12720	[Channel %1:] Block %2 program number for macro call (G65/G66) missing
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	During macro call with G65/G66 no program number was defined. The program number must be programmed with address "P".
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
12722	[Channel %1:] Block %2 multiple ISO_2/3 macro or cycle calls in the block
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A mixture of cycle and macro calls are programmed in a block, e.g. as follows: - Cycle calls with G81 - G89 together with an M macro in the block - Macro call with G65/G66 together with M macros in the block. G05, G08, G22, G23, G27, G28, G29, G30, G50.1, G51.1, G72.1, G72.2 functions (ISO mode) also execute subroutine calls. It is only permissible that one macro or cycle call can appear in an NC block.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.

Remedy: Deactivate modal cycles or modal macro calls if one of the above mentioned G functions has been programmed.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12724 [Channel %1:] Block %2 no radius programmed for cylinder interpolation activation/deactivation

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: When programming G07.1 (cylinder interpolation TRACYL), no cylinder radius has been programmed. Selection of the cylinder interpolation (TRACYL) with G07.1 C <cylinder radius> deselect with G07.1 C0. For "C" the name of the rotary axis defined in the TRACYL machine data has to be programmed.

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: G07.1 block, program the cylinder radius under the name of the rotary axis for the cylinder interpolation.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12726 [Channel %1:] Block %2 illegal plane selection with parallel axes

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: In a block with plane selection (G17 _ G19), a basic axis of the coordinate system must not be programmed together with the parallel axis assigned to it.

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: For plane selection with G17, G18, G19 either program the basic axis of the coordinate system or the assigned parallel axis.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12728 [Channel %1:] Block %2 distance for double turret not set

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The tool clearance for the double turret head in the SD42162 \$SC_EXTERN_DOUBLE_TURRET_DIST is 0.

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: Enter tool clearance for the double turret head in the SD42162 \$SC_EXTERN_DOUBLE_TURRET_DIST.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12730 [Channel %1:] Block %2 no valid transformation machine data parameterized

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The machine data MD24100 \$MC_TRAFO_TYPE_1, MD24110 \$MC_TRAFO_AXES_IN_1[1], MD24210 \$MC_TRAFO_AXES_IN_2[1] are incorrectly set for G07.1, G12.1.

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: Enter valid transformation identifier for TRACYL in MD24100 \$MC_TRAFO_TYPE_1 and the rotary axis number in MD24110 \$MC_TRAFO_AXES_IN_1[1] or MD24210 \$MC_TRAFO_AXES_IN_2[1].

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12740 [Channel %1:] Block %2 modal macro call %3 not possible

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Source string

Explanation: When calling a modal macro no other modal macro, modal cycle or modal subroutine may be active.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify part program

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12750 [channel %1:] block %2 T splitting not possible

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: ISO mode turning: T programming is not possible since the T word cannot be clearly separated by tool number and correction number.

Splitting the T word is determined by the machine data 10888 \$MN_EXTERN_DIGITS_TOOL_NO and 10889 \$MN_EXTERN_DIGITS_OFFSET_NO. However, only one of the two functions may be active, and at least one function must be active. Alarm occurs only then when no function is active (both MDs = 0) or both functions are active (both MDs <> 0).

Reaction: Interpreter stop
Interface signals are set.
Alarm display.

Remedy: Machine data
Adjust 10888 EXTERN_DIGITS_TOOL_NO or
10889 EXTERN_DIGITS_OFFSET_NO.
At least one function must be active, but both functions must not be active either.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12755 [channel %1:] block %2 formatting %3 not possible

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Faulty format instructions

Explanation: The format instructions programmed with the ISOPRINT command are incorrect:

- various format instructions %m.nP and %.nP were applied
- other format instructions than %P were applied

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: - correct ISOPRINT command
- within an ISOPRINT command, only format instructions of the same type %m.nP or %.nP may be applied

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

12780	[Channel %1:] Block %2 instruction %3 not allowed for precompiling the program
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source text area
Explanation:	Not all instructions are available in compile mode. The invalid language command is shown in the alarm text.
Reaction:	Alarm display.
Remedy:	Correct part program. With external instruction: - Store the subprogram in cycle directory <code>_N_CUS_DIR</code> , <code>_N_CMA_DIR</code> or <code>_N_CST_DIR</code> - If bit 0 = 1 (default value) in MD10700 \$MN_PREPROCESSING_LEVEL, then the EXTERNAL instruction is no longer required
Programm continuation:	Clear alarm with the Delete key or NC START.
14000	[Channel %1:] Block %2 illegal end of file
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Alarm 14000 is output in the following situations: - Part program was not terminated with M30, M02 or M17. - Executing from external: Download was canceled (e.g. because HMI was switched off). - Executing from external: REPEAT loop does not lie completely within the reload buffer - Executing from external with GOTOS/M99 command: program start is no longer in the reload buffer
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- End part program with M30, M02 or M17 and start part program. - Executing from external: If the download for the selected program was canceled, the default program <code>_N_MPF0</code> is automatically selected with RESET. The selection of the user program must be repeated after that. - Executing from external with REPEAT command: Replace REPEAT loop by EXTCALL call. - Executing from external with GOTOS/M99 command is generally not possible - switch to EES (Execution from External Storage)
Programm continuation:	Clear alarm with the RESET key. Restart part program
14001	[Channel %1:] Block %2 illegal end of block
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	After system-internal data manipulation (e.g. when reloading from an external source) a part file can end without having LF as the last character.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Read out the part program, modify it with a text editor (e.g., insert blanks or comments before the displayed block), so that after reading it in again the part program has a different structure in the memory.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14004	[Channel %1:] Program %2 cannot be started because of a channel-specific start disable
Parameters:	%1 = Channel number %2 = (path with program name)
Explanation:	The selected program %2 in channel%1 cannot be executed because the channel-specific start disable is set for this channel. Background: When ShopMill or ShopTurn programs are selected or changed, the HMI performs a consistency check of the parameters that have been entered. During this time, the processing of the selected NC program is inhibited by the HMI setting what is known as the "channel-specific start disable". If an NC start is now rejected because of a set channel-specific start disable, then alarm 14004 is output as a function of MD 11411 \$MN_ENABLE_ALARM_MASK bit 15. The alarm is also output in the event of a block search, but in this case it is not dependent on MD 11411 \$MN_ENABLE_ALARM_MASK bit 15.
Reaction:	Alarm display.
Remedy:	Repeat NC start
Programm continuation:	Clear alarm with the Delete key or NC START.
14005	[Channel %1:] Block %2 program %3 program-specific start disable has been set
Parameters:	%1 = Channel number %2 = Block number, label %3 = Program name
Explanation:	Program %3 cannot be executed, because the program-specific start disable has been set for this file. Background: When an editing operation for a ShopMill or ShopTurn program has been completed, the HMI performs a consistency check of the parameters that have been entered. During this time, CNC program processing is inhibited by setting what is known as the "program-specific start disable" by the HMI. If NC start is pressed during the test, the start is not executed, and alarm 14005 is output as a function of MD 11411 \$MN_ENABLE_ALARM_MASK bit 6. Alarm 14005 is also output if the part program processing encounters a subroutine for which the file attribute "start disable" is set. After the test step has been completed, the program processing can continue by pressing NC start.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Repeat NC start
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14006	[Channel %1:] Block %2 invalid program name %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Program name
Explanation:	When selecting or calling an NC program it was found that the program name did not follow NC conventions: - The length of the program name, without prefix _N_ and Suffix _MPF / _SPF, must not exceed 24 characters, as otherwise the program name is truncated in the OPI variables.
Reaction:	Alarm display.
Remedy:	- Shorten the name of the program. - Suppress the alarm with MD 11415 \$MN_SUPPRESS_ALARM_MASK_2 bit 9.
Programm continuation:	Clear alarm with the Delete key or NC START.
14007	[Channel %1:] Block %2 Program %3 is being edited
Parameters:	%1 = Channel number %2 = Block number, label %3 = Program name

Explanation:	Program %3 cannot be executed because it has been disabled by another application, for example the HMI Editor. Background: Program %3 is on an external data carrier (CF card, network drive, USB device), and should be executed from there in EES mode (Execution from External Storage). But the program cannot be processed because it has been opened for writing by another application, for example the HMI Editor, and the WRITE lock has been set for this file.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Close the application that set the WRITE lock, that is for example the HMI Editor, and continue the program processing with NC start.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14009	[Channel %1:] Block %2 illegal program path %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Program path
Explanation:	The part program command CALLPATH was called with a parameter (program path) referring to a directory which does not exist in the file system of the NCK.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	- Modify the CALLPATH instruction such that the parameter contains the complete path name of the loaded directory. - Load the programmed directory in the file system of the NCK.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14010	[Channel %1:] Block %2 invalid default parameter in subroutine call
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In a subroutine call with parameter transfer, parameters have been omitted that cannot be replaced by default parameters (call-by-reference parameters or parameters of type AXIS. The other missing parameters are defaulted with the value 0 or with the unit frame in the case of frames).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	The missing parameters must be provided with values in the subroutine call.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14011	[Channel %1:] Block %2 program %3 not existing or will be edited
Parameters:	%1 = Channel number %2 = Block number, label %3 = Program name

Explanation:	A subroutine call was canceled because the called subroutine could not be opened. The subroutine call can be executed via - subroutine identifier - CALL / PCALL / MCALL command - SETINT command - M/T function replacement - event-driven program calls (PROG_EVENT) - selection of a PLC ASUB via PI "_N_ASUP_" and/or FB-4 - calling a PLC ASUB via interrupt interface (FC-9) There are various reasons for the alarm: - the subroutine is not in the part program memory - the subroutine is not in the search path (selected directory, _N_SPF_DIR or cycle directories _N_CUS_DIR, _N_CMA_DIR, _N_CST_DIR) - the subroutine has not been released or is being edited - faulty absolute path name in subroutine call: Examples of complete path names: /_N_directoryName_DIR/_N_programmName_SPF or /_N_WKS_DIR/_N_wpdName_WPD/_N_programmName_SPF. directoryName: MPF, SPF, CUS, CMA, CST (predefined directories). wpdName: application-specific designator for workpiece directory (max. of 24 characters). programmName: Name of subroutine (max. of 24 characters) - A reload buffer for executing from external was called as subroutine. Note: Unknown identifiers (string) found in the part program line by themselves, are interpreted as subroutine calls.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Ensure that the subroutine (alarm parameter %3) - is available in the part program memory - has been released and is not being edited - is available in the search path if not being called via an absolute path name.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14012 [Channel %1:] Block %2 maximum subroutine level exceeded

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The maximum nesting depth of 16 program levels has been exceeded. Subroutines can be called from the main program, and these in turn may have a nesting depth of 15. For interrupt routines, two additional program levels can be used. This means that the total number of program levels is increased to 18. The program levels are jointly used by user programs and Siemens cycles and/or Siemens applications such as ShopMill and ShopTurn.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Modify the machining program so that the nesting depth is reduced, e.g. using the editor copy a subroutine of the next nesting level into the calling program and remove the call for this subroutine. This reduces the nesting depth by one program level.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14013 [Channel %1:] Block %2 number of subroutine passes invalid

Parameters:	%1 = Channel number %2 = Block number, label
--------------------	--

Explanation: In a subroutine call the programmed number of passes P is zero or negative.

Reaction: Correction block is reorganized.

Interface signals are set.

Alarm display.

Remedy: Program number of passes between 1 and 9 999.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14014 [Channel %1:] Selected program %3 not available or will be edited

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Program name

Explanation: The selected part program is not in the NCK memory or the execution right for the part program has a higher level than the current access right.

During creation, this program received the protection level of the NC control which was active at the time.

In SW 5 or higher, a program edited on HMI can no longer be started with NC Start.

The alarm will also be issued if a file other than one of the specified definition files has been selected for the GUD or macro definition.

Reaction: Alarm display.

Remedy: Reload the program in the NCK memory or check and correct the name of the directory (workpiece overview) and the program (program overview) and reselect.

Programm continuation: Clear alarm with the Delete key or NC START.

14015 [Channel %1:] Block %2 program %3 is not enabled

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Program name

Explanation: The execution right currently set in the control (e.g. key switch position 0) is inadequate to execute part program %3.

Reaction: Correction block is reorganized.

Interface signals are set.

Alarm display.

Remedy: - Raise the execution right to match the protection level of part program %3
- Assign a lower protection level to part program %3 or release (key switch protection level 0)

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14016 [Channel %1:] Block %2 error when calling the subroutine via M/T function

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The following conflict was detected in a subprogram call per M or T function:

- In the block referenced by parameter %2, an M or T function replacement has already been activated:
- In the block referenced by parameter %2, a modal subprogram call is active
- In the block referenced by parameter %2, a subprogram return jump is programmed
- In the block referenced by parameter %2, the end of the part program is programmed
- In the block referenced by parameter %2, an M98 subprogram call is active, but only in the external language mode
- In the block referenced by parameter %2, a T function replacement is programmed with D function programming in the same part program line with active TLC (G43/G44) in the ISO2 system.
- In the block referenced by parameter %2, a T function replacement is programmed, configured at the end of block, and a subprogram call, for example by a modal cycle call.

Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	To replace an M or T function, ensure that a subprogram call or return jump has not already been performed as a result of other program constructs. Correct the part program if necessary. Under the following conditions, you must perform the T function replacement at the start of the block: - A T function replacement is configured with execution at end of block and a subprogram call is programmed in the same block Set MD10719 \$MN_T_NO_FCT_CYCLE_MODE bit 1 = 1.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14017 [Channel %1:] Block %2 syntax error when calling the subroutine via M function

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	When calling M code subroutine with parameter transfer, an illegal syntax was detected: - Address extension not programmed as a constant. - M function value not programmed as a constant. Note: If a parameter transfer has been programmed via MD10718 \$MN_M_NO_FCT_CYCLE_PAR for an M function replacement, the following restriction applies to this M function: both the address extension and the M function value must be programmed for replacement as constants.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Change the programming of the M function.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14018 [Channel %1:] Block %2 part program command %3 not executable (protection level setpoint value / actual value: %4)

Parameters:	%1 = Channel number %2 = Block number, label %3 = Programmed command %4 = Protection level of the command / current protection level
Explanation:	To part program command %3, a protection level has been assigned that is logically higher (smaller in value) than the current access right, or the command does not exist in the current control configuration.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program. Please see the Siemens Programming Guide or OEM documentation for the language commands permissible for the relevant system configuration.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14019 [Channel %1:] block %2 motion synchronous action: %3 wrong value or wrong number of parameters on function or procedure call

Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID
Explanation:	- An illegal parameter value was specified in a function or procedure call. - An illegal number of actual parameters was programmed in a function or procedure call.

Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14020 [Channel %1:] Block %2 wrong value or wrong number of parameters on function or procedure call

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	- An illegal parameter value was specified in a function or procedure call. - An illegal number of actual parameters was programmed in a function or procedure call.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14021 [Channel %1:] Block %2 wrong value or wrong number of parameters on function or procedure call

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	- An illegal parameter value was specified in a function or procedure call. - An illegal number of actual parameters was programmed in a function or procedure call.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14022 [Channel %1:] Block %2 error on function or procedure call, error code %3

Parameters:	%1 = Channel number %2 = Block number, label %3 = Error code
Explanation:	An error occurred during a function or procedure call. The cause of the error is indicated more closely by an error code. The meaning of the error code can be found in the documentation of the function or procedure that caused the error.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14024	[Channel %1:] Block %2 No access authorization for initialization of %3[%4].
Parameters:	%1 = Channel number %2 = Block number, label %3 = Variable to be reset %4 = Index of the variable to be reset
Explanation:	When the function DELOBJ is called, an attempt is made to reset a variable to its default value. The access authorization is not sufficient for this purpose. When this alarm occurs, no data are changed, not even that for which the access authorization would be sufficient. This alarm can only occur when the current value of the system variable, to which the attempt to write led to the alarm, is not equal to its initial setting value.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Increase access authorization.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14025	[Channel %1:] Block %2 motion synchronous action: illegal modal ID
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In modal motion synchronous actions an illegal ID number has been assigned.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with the RESET key. Restart part program
14026	[Channel %1:] Block %2 motion synchronous action: invalid polynomial number in the FCTDEF command
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	An FCTDEF command was programmed with a polynomial number that exceeds the maximum value set in MD28252 \$MC_MM_NUM_FCTDEF_ELEMENTS.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with the RESET key. Restart part program
14027	[Channel %1:] Block %2 motion-synchronous action: Too many technology cycles programmed.
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	You can call a maximum of eight technology cycles with one motion-synchronous action. You exceeded the upper limit.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.

Remedy: Modify part program.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14028 [Channel %1:] Block %2 motion-synchronous action: Technology cycle programmed with too many parameters

Parameters: %1 = Channel number
 %2 = Block number, label
Explanation: Maximum number of transfer parameters for one technology cycle exceeded.
Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.
Remedy: Change technology cycle
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14030 [Channel %1:] Block %2 combine OSCILL and POSP during oscillation with infeedmotion

Parameters: %1 = Channel number
 %2 = Block number, label
Explanation: When oscillating controlled by synchronized actions, the assignment of oscillating and infeed axis (OSCILL) as well as the definition of the infeed (POSP) must be carried out in one NC block.
Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.
Remedy: Modify the part program.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14034 [Channel %1:] Block %2 involute: angle of rotation too large

Parameters: %1 = Channel number
 %2 = Block number, label
Explanation: With programming of the angle of rotation (with AR) for involute interpolation, the maximum programmable angle of rotation is limited if the involute is moving towards the basic circle. The maximum value is reached if the involute touches the basic circle. With MD21016 \$MC_INVOLUTE_AUTO_ANGLE_LIMIT = TRUE, each angle is accepted without an alarm; if necessary, the angle is automatically limited during interpolation.
Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.
Remedy: Modify part program.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14035 [Channel %1:] Block %2 involute: start point invalid

Parameters: %1 = Channel number
 %2 = Block number, label
Explanation: With involute interpolation, the start point of the involute must be outside the basic circle. The programmed center point or radius must be adapted accordingly.
Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.
Remedy: Modify part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14036 [Channel %1:] Block %2 involute: end point invalid

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: With involute interpolation, the end point of the involute must be outside the basic circle. The programmed center point / radius or end point must be adapted accordingly.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14037 [Channel %1:] Block %2 involute: radius invalid

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: With involute interpolation, the programmed radius of the basic circle must be greater than zero.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14038 [Channel %1:] Block %2 involute not definable: end point error

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The programmed end point does not lie on the involute defined by the start point, radius and center point of the basic circle. The deviation of the effective end radius from the programmed value is greater than the permissible value specified in MD21015 \$MC_INVOLUTE_RADIUS_DELTA.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14039 [Channel %1:] Block %2 involute: end point programmed several times

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: With involute interpolation, either the end point with the geometry axis identifiers or the angle of rotation with AR=value can be programmed. Simultaneous programming of end point and angle of rotation in one block is not allowed, since the end point can thus not be defined exactly.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14040	[Channel %1:] Block %2 error in end point of circle
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In circular interpolation, either the circle radii for the initial point and the end point are further apart or the circle center points are further apart than specified in the machine data. 1. In circle radius programming the starting and end points are identical, thus the circle position is not determined by starting and end points. 2. Radii: The NCK calculates from the present starting point and the other programmed circle parameters the radii for the starting and the end point. An alarm message is issued if the difference between the circle radii is either - greater than the value in the MD21000 \$MC_CIRCLE_ERROR_CONST (for small radii, if the programmed radius is smaller than the quotient of the machine data MD21000 \$MC_CIRCLE_ERROR_CONST divided by MD21010 \$MC_CIRCLE_ERROR_FACTOR), or - greater than the programmed radius multiplied by the MD21000 \$MC_CIRCLE_ERROR_FACTOR (for large radii, if the programmed radius is greater than the quotient of the machine data MD21010 \$MC_CIRCLE_ERROR_CONST divided by MD21010 \$MC_CIRCLE_ERROR_FACTOR). 3. Center points: A new circle center is calculated using the circle radius at the starting position. It lies on the mid-perpendicular positioned on the connecting straight line from the starting point to the end point of the circle. The angle in the radian measure between both straight lines from the starting point to the center calculated/programmed as such must be lower than the root of 0.001 (corresponding to approx. 1.8 degrees). 4. Full circle with INTERSEC: Full circle is not allowed for the INTERSEC function.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Check MD21000 \$MC_CIRCLE_ERROR_CONST and MD21010 \$MC_CIRCLE_ERROR_FACTOR. If the values are within reasonable limits, the circle end point or the circle mid-point of the part program block must be programmed with greater accuracy.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14045	[Channel %1:] Block %2 error in tangential circle programming
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The alarm can be caused by the following: The tangent direction is not defined in the tangent circle programming, e.g. because no other traversing block has been programmed before the current block. No circle can be formed from start and end point as well as tangent direction because - seen from the start point - the end point is located in the opposite direction to that indicated by the tangent. It is not possible to form a tangent circle since the tangent is located perpendicular to the active plane. In the particular case in which the tangent circle changes to a straight line, several complete circular revolutions were programmed with TURN.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14048	[Channel %1:] Block %2 wrong number of revolutions in circle programming
Parameters:	%1 = Channel number %2 = Block number, label

Explanation:	In the circle programming, an inadmissible number of full revolutions has been specified. The number of revolutions must not be negative and must not be greater than 1000000.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14050	[Channel %1:] Block %2 nesting depth for arithmetic operations exceeded
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	For calculating arithmetic expressions in NC blocks, an operand stack with a fixed set size is used. With very complex expressions, this stack can overflow. This may also occur with extensive expressions in synchronized actions.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Divide up complex arithmetic expressions into several simpler arithmetic blocks.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14051	[Channel %1:] Block %2 arithmetic error in part program
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	- In calculating an arithmetic expression, an overflow has occurred (e.g. division by zero) - In a data type, the representable value range has been exceeded
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Analyze the program and correct the defective point in the program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14055	[Channel %1:] Block %2 impermissible NC language substitution, error code %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Error code
Explanation:	This alarm occurs in conjunction with an NC language substitution configured in MD30465 \$MA_AXIS_LANG_SUB_MASK. Error code %3 gives more detailed information about the cause of the problem: Error code: 1: Several events had been programmed, causing the replacement cycle to be called. Only one substitution is allowed per part program line. 2: A block-by-block synchronized action had also been programmed for the part program line with the NC language substitution. 3: The system variables \$P_SUB_SPOSIT and \$P_SUB_SPOSMODE were called outside a replacement cycle.
Reaction:	Correction block is reorganized. Interpreter stop Interface signals are set. Alarm display.
Remedy:	Modify the NC program

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14060 [Channel %1:] Block %2 invalid skip level with differential block skip

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: With "Differential block skip", a skip level greater than 7 has been specified. (In packet 1 specification of a value for the skip level is rejected by the converter as a syntax error, i.e. the only possibility is a "Suppress block" ON/OFF on one level).

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Enter a skip level (number behind the slash) less than 8.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14065 [channel %1:] block %2 error in SPRINT/ISOPRINT command: error code %4 information %3

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Additional information
%4 = Error code

Explanation: When interpreting the SPRINT or ISOPRINT command, an error was detected which was described in more detail by parameter %4. Parameter %3 may supply additional information on the incurring problem.
List of error codes (parameter %4):
1: invalid format description %3 recognized
2: Format %.nP: overrange when converting into 32 bit number
3: Format %P: Character %3 cannot be converted with the code selected by MD 10750 / \$MN_SPRINT_FORMAT_P_CODE.
4: Maximum string length of 400 bytes exceeded
5: SPRINT/ISOPRINT command programmed with an invalid number of parameters
6: SPRINT/ISOPRINT parameters programmed with impermissible data type
7: Format %m.nP: overrange due to parameter n with MD 10751 / \$MN_SPRINT_FORMAT_P_DECIMAL = 0

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Correct SPRINT and/or ISOPRINT command(s).

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14066 [channel %1:] block %2 error when outputting to external device on command %3, error code: %4

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Part program command
%4 = Error code

Explanation:	When processing the commands ISOOPEN, ISOPRINT, ISOCLOSE or EXTOPEN, WRITE, EXTCLOSE, an error was detected which is described in detail by the error code. List of error codes: 1: external device cannot be opened 2: external device is not configured 3: external device configured with invalid path 4: no access rights for external device 5: external device already exclusively assigned 6: external device already assigned in shared mode 7: file length greater than LOCAL_DRIVE_MAX_FILESIZE 8: maximum number of external devices exceeded 9: option not set for LOCAL_DRIVE 11: V24 already occupied by Easy-Message function 12: Append/Overwrite specification is inconsistent with extdev.ini 14: external device not assigned or opened 15: error when writing to external device 16: invalid external path programmed 21: error when closing external device 22: external device not installed (mounted) 90: Timeout
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Correcting the parameterization of the ISOOPEN, ISOPRINT or ISOCLOSE command. See also MD 10830 \$MN_EXTERN_PRINT_DEVICE and MD 10831 \$MN_EXTERN_PRINT_MODE. Check the configuration of the external device on the memory card in /user/sinumerik/nck/extdev.ini and /oem/sinumerik/nck/extdev.ini. Check the connection and functioning of the external device.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14070	[Channel %1:] Block %2 memory for variables not sufficient for subroutine call
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A called subroutine cannot be processed (opened), either because the internal data memory to be created for general purposes is not large enough, or because the available memory for the local program variables is too small. The alarm can only occur in MDI mode.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Analyze the part program section: 1. Has the most useful data type always been selected in the variable definitions? (For example REAL for data bits is poor; BOOL would be better) 2. Can local variables be replaced by global variables?
Programm continuation:	Clear alarm with the RESET key. Restart part program

14080	[Channel %1:] Block %2 jump destination %3 not found
Parameters:	%1 = Channel number %2 = Block number, label %3 = Jump destination
Explanation:	In conditional and unconditional jumps, the jump destination within the program must be a block with a label (symbolic name instead of block number). If no jump destination has been found with the given label when searching in the programmed direction, an alarm is output. For parameterizable returns with RET to block number or label, the jump destination within the program must be a block with the block number or label (symbolic name instead of block number). For returns over several levels (parameter 2), the jump destination must be a block within the program level you jumped to. For returns with a string as return destination, the search string must be a name known in the control and the search string must be preceded in the block by a block number and/or a label only.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Check NC part program for the following possible errors: 1. Check whether the target designation is identical with the label. 2. Is the jump direction correct? 3. Has the label been terminated with a colon?
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14082	[Channel %1:] Block %2 label %3 program section not found
Parameters:	%1 = Channel number %2 = Block number, label %3 = Start or end label
Explanation:	The start point for repetition of the program part with CALL <program name> BLOCK <start label> TO <end label> has not been found or the same program part repetition has been called recursively.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Check the start and end labels for programming repetition in the user program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14085	[Channel %1:] Block %2 instruction not allowed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The instruction 'TML()' may only be used in the subprogram, which replaces the T command.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14088 [Channel %1:] Block %2 axis %3 doubtful position

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis name, spindle number

Explanation: An axis position larger than 3.40e+38 increments has been programmed. This alarm can be suppressed with bit11 in MD11410 \$MN_SUPPRESS_ALARM_MASK.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify the part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14089 [Channel %1:] Block %2 Function %3 is no longer supported.

Parameters: %1 = Channel number
%2 = Block number, label
%3 = String: function

Explanation: An obsolete function was programmed or triggered, which is no longer supported in the current software version. The function in question is named in parameter 3.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: COMPCURV: Replace "COMPCURV" with "COMPCAD" and check machine data: MD28070
\$MC_MM_NUM_BLOCKS_IN_PREP>=80, MD28520 \$MC_MM_MAX_AXISPOLY_PER_BLOCK>=3, MD28530
\$MC_MM_PATH_VELO_SEGMENTS>=5, MD28540 \$MC_MM_ARCLENGTH_SEGMENTS>=10.
COMPCURV: Replace "COMPCURV" with "COMPCAD" and check machine data: MD28070
\$MC_MM_NUM_BLOCKS_IN_PREP>=80, MD28520 \$MC_MM_MAX_AXISPOLY_PER_BLOCK>=3, MD28530
\$MC_MM_PATH_VELO_SEGMENTS>=5, MD28540 \$MC_MM_ARCLENGTH_SEGMENTS>=10.

Programm continuation: Clear alarm with the RESET key. Restart part program

14091 [Channel %1:] Block %2 illegal function, index %3

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Index

Explanation: A function has been programmed or triggered which is not permitted in the current program context. The function in question is encoded in the "index" parameter:

Index == 1: "RET" command was programmed in the main program level
Index == 2: Conflict between "Cancel level"/"Clear number of passes" and "Implicit GET"
Index == 3: Conflict ASUB start immediately after selection of overstore (up to P3)
Index == 4: MD10760 \$MN_G53_TOOLCORR = 1 : SUPA/G153/G53 programmed in G75
Index == 5: POSRANGE command not programmed in synchronized action
Index == 6: SIRELAY command not programmed in synchronized action
Index == 7: GOTOF/GOTOB/GOTO command programmed with string variable in synchronized action.
Index == 8: COA application "Cutting generator" not active
Index == 9: Tool radius compensation active in G75
Index == 10: Number of return levels too big, with RET (...xy) across several program levels
Index == 11: The function is not implemented for this variable

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Index == 1: Substitute "RET" command with M17/M30 Index == 2: Insert an auxiliary block (e.g. M99) after the subroutine call to which the "Cancel level"/"Clear number of passes" refers Index == 3: Overstore an auxiliary block (e.g. M99), then start ASUB (up to P3) Index == 4: With MD10760 \$MN_G53_TOOLCORR = 1: Do not activate SUPA/G53/G153 in the G75 block Index == 5: Program POSRANGE command in synchronized action Index == 6: Program SIRELAY command in synchronized action Index == 7: Program GOTOF/GOTOB/GOTO command with block number or label Index == 8: Load COA application "Cutting generator" Index == 9: Tool radius compensation active in G75
Programm continuation:	Clear alarm with the RESET key. Restart part program

14092	[Channel %1:] Block %2 axis %3 is wrong axis type
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	One of the following programming errors has occurred: 1. The keyword WAITP(x) "Wait with the block change until the specified positioning axes has reached its end point", was used for an axis that is not a positioning axis. 2. G74 "Reference point approach from the program" was programmed for a spindle. (Only axis addresses are permissible.) 3. The keyword POS/POSA was used for a spindle. (For spindle positioning, keywords SPOS and SPOSA should be programmed.) 4. If the alarm occurs for the function "Thread tapping without compensating chuck " (G331) the following reasons are conceivable: - The master spindle is not in position-controlled operation. - Incorrect master spindle - Master spindle without encoder 5. An axis name that is no longer available has been programmed, e.g. when using axial variables as index. Or it was programmed as index NO_AXIS. 6. If 14092 is output as note for alarm 20140 motion synchronized action: traverse the command axis, then the the following causes are possible: - The axis is presently being traversed by the NC program. - An overlaid movement is active for the axis. - The axis is active as slave axis of a coupling. - An interpolation compensation such as a temperature compensation is active for the axis. 7. PRESETON/ PRESETONS were programmed for an unknown channel axis.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	- Correct the part program according to which of the above errors is involved. - Program SPOS. - Set the correct master spindle with SETMS.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14093	[Channel %1:] Block %2 path interval <= 0 with polynomial interpolation
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In the polynomial interpolation POLY, a negative value or 0 has been programmed under the keyword for the polynomial length PL=...
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Press the NC Stop key and select the function "Correction block" with the softkey PROGRAM CORRECT. The correction pointer positions on the incorrect block. Correct the value given in PL = ...
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14094	[Channel %1:] Block %2 polynomial degree greater than 3 programmed for polynomial interpolation
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The polynomial degree in the polynomial interpolation is based on the number of programmed coefficients for an axis. The maximum possible polynomial degree is 3, i.e. the axes are according to the function: $f(p) = a_0 + a_1 p + a_2 p^2 + a_3 p^3$ The coefficient a_0 is the actual position at the start of interpolation and is not programmed!
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Reduce the number of coefficients. The polynomial block may have a form no greater than the following: N1 POLY PO[X]=(1.11, 2.22, 3.33) PO[Y]=(1.11, 2.22, 3.33) N1 PO[n]=... PL=44 n ... n ... axis identifier, max. 8 path axes per block
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14095	[Channel %1:] Block %2 radius for circle programming too small
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The radius entered for radius programming is too small, i.e. the programmed radius is smaller than half of the distance between start and end point.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14096	[Channel %1:] Block %2 illegal type conversion
Parameters:	%1 = Channel number %2 = Block number, label

Explanation:	During the program run, a variable value assignment or an arithmetic operation has caused data to be processed in such a way that they have to be converted to another type. This would lead to the value range being exceeded. Value ranges of the various variable types: - REAL: Property: Fractional number with dec. pt., value range: $\pm(2.2 \cdot 10^{-308} \dots 1.8 \cdot 10^{308})$ - INT: Property: Integers with signs, value range: -2147483648 ... +2147483647 - BOOL: Property: Truth value FALSE, TRUE, value range: 0 or 1 - CHAR: Property: 1 ASCII character, value range: 0-255 - STRING: Property: Character string (max. length depends on the variable), value range: 0 ... 255 - AXIS: Property: Axis addresses, value range: Channel identifier - FRAME: Property: Geometric information, value range: --- Overview of type conversions: - from REAL to: REAL: yes, INT: yes*, BOOL: yes1), CHAR: yes*, STRING: -, AXIS: -, FRAME: - - from INT to: REAL: yes, INT: yes, BOOL: yes1), CHAR: if value 0 ...255, STRING: -, AXIS: -, FRAME: - - from BOOL to: REAL: yes, INT: yes, BOOL: yes, CHAR: yes, STRING: -, AXIS: -, FRAME: - - from CHAR to: REAL: yes, INT: yes, BOOL: yes1), CHAR: yes, STRING: yes, AXIS: -, FRAME: - - from STRING to: REAL: -, INT: -, BOOL: yes2), CHAR: only if 1 character, STRING: yes, AXIS: -, FRAME: - - from AXIS to: REAL: -, INT: -, BOOL: -, CHAR: -, STRING: -, AXIS: yes, FRAME: - - from FRAME to: REAL: -, INT: -, BOOL: -, CHAR: -, STRING: -, AXIS: -, FRAME: yes 1) Value ≤ 0 corresponds to TRUE, value $\neq 0$ corresponds to FALSE. 2) String length 0 $\Rightarrow$ FALSE, otherwise TRUE. 3) If only 1 character. It is not possible to convert from type AXIS and FRAME nor into type AXIS and FRAME.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify the program section such that the value range is not exceeded, e.g. by a modified variable definition.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14097	[Channel %1:] Block %2 string cannot be converted to AXIS type
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The called function AXNAME - conversion of the transferred parameters of the STRING type to an axis name (return value) of the AXIS type - has not found this axis identifier in the machine data.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Check the transferred parameter (axis name) of the function AXNAME to determine whether a geometry, channel or machine axis of this name has been configured by means of the machine data: MD10000 \$MN_AXCONF_MACHAX_NAME_TAB MD20060 \$MC_AXCONF_GEOAX_NAME_TAB MD20080 \$MC_AXCONF_CHANAX_NAME_TAB
Programm continuation:	Select the transfer string in accordance with the axis name, and change the axis name in the machine data if necessary. (If a change of name is to take place via the NC part program, this change must first be validated by means of a "POWER-ON"). Clear alarm with NC START or RESET key and continue the program.

14098	[Channel %1:] Block %2 conversion error: no valid number found
Parameters:	%1 = Channel number %2 = Block number, label

Explanation:	The string is not a valid INT or REAL number.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Modify the part program. If it is an entry, you can check whether the string is a number with the predefined ISNUMBER function with the same parameter.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14099 [Channel %1:] Block %2 result in string concatenation too long

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The result of the string chaining returns a string which exceeds the maximum string length specified by the system.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Adapt the part program. With the STRLEN function, you can query the size of the sum string before executing the chaining operation.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14102 [Channel %1:] Block %2 polynomial degree greater than 5 programmed for orientation vector angle

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	During polynomial interpolation for the orientation vector, a polynomial degree larger than 5 has been programmed.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14103 [Channel %1:] Block %2 error %3 when calling function CORRTRAFO.

Parameters:	%1 = Channel number %2 = Block number, label %3 = Error code
--------------------	--

Explanation:	An error occurred when the CORRTRAFO function was called. The error number specifies the cause of the error. Error numbers: 1: No transformation active. 2: The current active transformation is not an orientation transformation. 3: The active orientation transformation was not defined with kinematic chains. 10: The call parameter <code>_CORR_INDEX</code> is negative. 11: The call parameter <code>_CORR_MODE</code> is negative. 12: Invalid reference to the section of a partial chain (1st position of <code>_CORR_INDEX</code>). The value must not be greater than the number of orientation axes in the partial chain. 13: Invalid reference to the orientation axis of a partial chain (1st position of <code>_CORR_INDEX</code>). The value must be less than the number of orientation axes in the partial chain. 14: Invalid reference to a partial chain (10th position of <code>_CORR_INDEX</code>). Only the values 0 and 1 are permissible (reference to part or tool chain). This error number also occurs if the partial chain to which <code>_CORR_INDEX</code> refers, does not exist. 15: In the section referred to with the parameter <code>_CORR_INDEX</code>, no correction element is defined(<code>\$NT_CORR_ELEM_P</code> or <code>\$NT_CORR_ELEM_T</code>). 20: Invalid correction mode (1st position of <code>_CORR_MODE</code>). Only the values 0, 1, 8, and 9 are permissible. 21: Invalid correction mode (10th and / or 100th position of <code>_CORR_MODE</code>). When reading a system variable, the 100th position must always be zero. When reading or writing an axis direction, only the one's position is permitted to be not equal to zero. 30: The 100th position of <code>_CORR_MODE</code> is invalid. Only the values 0 and 1 are permissible. 31: The 1000th position of <code>_CORR_MODE</code> is invalid. Only the values 0 and 1 are permissible. 40: The direction vector to be taken over as the axis direction is the zero vector. 41: In the correction of an offset vector, the deviation from the current value is greater than the maximum value set in setting data 41610 <code>\$SN_CORR_TRAFO_LIN_MAX</code> in at least one coordinate. 42: In the correction of a direction vector, the angle deviation from the current direction is greater than the maximum value set in setting data 41611 <code>\$SN_CORR_TRAFO_DIR_MAX</code>. 43: The attempt to write a system variable was rejected due to missing write authorization.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Change function call.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14109	[Channel %1:] Block %2 simultaneous linear and rotary axis movement with static orientation transformation.
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The interpolation type CP (G group code 49) is not permitted with an active static orientation transformation if linear and rotary axes have to interpolate simultaneously.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Change the NC program: Activate dynamic orientation transformation. Change the G code for group 49. Execute linear and rotary axis movement successively rather than simultaneously.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14130 [Channel %1:] Block %2 too many initialization values given

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: On assigning an array by means of SET, more initialization values than existing array elements have been specified in the program run.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Reduce the number of initialization values.

Programm continuation: Clear alarm with the RESET key. Restart part program

14140 [Channel %1:] Block %2 position programming without transformation not allowed

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: A transformation must be active in order to program position information for an axis position.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Modify the program.

Programm continuation: Clear alarm with the RESET key. Restart part program

14144 [Channel %1:] Block %2 PTP movement not allowed, error code %3.

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Error code

Explanation: The desired PTP movement is not possible.
The causes of the errors are described in more detail by the following error codes.

- 1. A PTP interpolation is not possible with the currently active transformation.
- 2. PTP interpolation and tool radius compensation must not be active simultaneously.
- 3. The PTP interpolation types PTPWOC and PTPWOC2 are only permissible with orientation transformations.
- 4. PTP interpolation and COMPSURF must not be active simultaneously.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Modify the program.

Programm continuation: Clear alarm with the RESET key. Restart part program

14146 [Channel %1:] Block %2 CP or PTP movement without transformation not allowed

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: A transformation must be active in order to program a G code, CP or PTP movement.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Modify the program.
Programm continuation: Clear alarm with the RESET key. Restart part program

14149 [Channel %1:] Block %2 Error %3 on selection of the tool carrier with the number %4.

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Error code
%4 = Tool carrier number

Explanation:	An error occurred during the activation of the orientable tool carrier with the stated number, whose geometry data are to be read from kinematic chains. The geometry data of a tool carrier are read from kinematic chains if bit0 is set in system data \$TC_CARR_KIN_CNTRL[n]. The type of error is indicated more precisely by the number of the error code. Error code: 1 No kinematic chain elements are available. Remedy: Machine data MD18880 \$MN_MM_MAXNUM_KIN_CHAIN_ELEM must not be equal to zero. 2 An error occurred during the analysis of the kinematic machine model. 3 The tool carrier has an invalid type. Only types "T", "P" and "M" (optionally in upper or lower case) are permissible. 4 No tool chain was specified, this means that system data \$TC_CARR_KIN_TOOL_END[n] is empty. For tool carrier types "T" and "M", this system data must refer to a kinematic chain element. 5 No part chain was specified, this means that system data \$TC_CARR_KIN_PART_END[n] is empty. For tool carrier types "P" and "M", this system data must refer to a kinematic chain element. 6 The kinematic chain element to which the system data \$TC_CARR_KIN_TOOL_END[n] refers was not found. 7 The kinematic chain element to which the system data \$TC_CARR_KIN_PART_END[n] refers was not found. 8 The kinematic chain element to which the system data \$TC_CARR_KIN_TOOL_END[n] refers was found, but it has no connection to the ROOT element. Kinematic chain elements are only part of the valid machine model if they are connected to the ROOT element by references. 9 The kinematic chain element to which system data \$TC_CARR_KIN_PART_END[n] refers was found, but it has no connection to the ROOT element. Kinematic chain elements are only part of the valid machine model if they are connected to the ROOT element by references. 10 The kinematic chain element to which system data \$TC_CARR_KIN_TOOL_START[n] refers is not part of the kinematic chain that forms the connection between the ROOT element and the end point of the tool chain (\$TC_CARR_KIN_TOOL_END[n]). 11 The kinematic chain element to which system data \$TC_CARR_KIN_PART_START[n] refers is not part of the kinematic chain that forms the connection between the ROOT element and the end point of the part chain (\$TC_CARR_KIN_PART_END[n]). 12 The kinematic chain (tool chain) that forms the connection between the ROOT element and the end point of the tool chain (\$TC_CARR_KIN_TOOL_END[n]) contains too many elements. 13 The kinematic chain (part chain) that forms the connection between the ROOT element and the end point of the part chain (\$TC_CARR_KIN_PART_END[n]) contains too many elements. 14 The kinematic chain (tool chain) that forms the connection between the ROOT element and the end point of the tool chain (\$TC_CARR_KIN_TOOL_END[n]) contains too many rotary axes. With tool carrier type "T", a maximum of 2, with tool carrier type "M" a maximum of one rotary axis is permissible in this chain. 15 The kinematic chain (part chain) that forms the connection between the ROOT element and the end point of the part chain (\$TC_CARR_KIN_PART_END[n]) contains too many rotary axes. With tool carrier type "P", a maximum of 2, with tool carrier type "M" a maximum of one rotary axis is permissible in this chain. 16 The kinematic chain (tool chain) that forms the connection between the ROOT element and the end point of the tool chain (\$TC_CARR_KIN_TOOL_END[n]) does not contain any rotary axes. This chain must contain at least one rotary axis. 17 The kinematic chain (part chain) that forms the connection between the ROOT element and the end point of the part chain (\$TC_CARR_KIN_PART_END[n]) does not contain any rotary axes. This chain must contain at least one rotary axis. 18. The kinematic chain (tool chain) for the definition of the tool carrier contains an element of type "AXIS_LIN_VIRT", that is not permissible for a tool carrier ("virtual" linear axis). 19. The kinematic chain (part chain) for the definition of the tool carrier contains an element of type "AXIS_LIN_VIRT", that is not permissible for a tool carrier ("virtual" linear axis). 20. The kinematic chain (tool chain) for the definition of the toolcarrier contains an element of type "AXIS_ROT_VIRT", that is not permissible for a tool carrier ("virtual" rotary axis)). 21. The kinematic chain (part chain) for the definition of the toolcarrier contains an element of type "AXIS_ROT_VIRT", that is not permissible for a tool carrier ("virtual" rotary axis)
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct the incorrect data in the tool carrier definition or the incorrect definition of the kinematic chains used to parameterise the tool carrier.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14150	[Channel %1:] Block %2 illegal tool carrier number programmed or declared (MD)
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A toolholder number was programmed which is negative or greater than the MD18088 \$MN_MM_NUM_TOOL_CARRIER.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Inform the authorized personnel/service department. Program a valid tool carrier number or adapt MD 18088 \$MN_MM_NUM_TOOL_CARRIER.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14151	[Channel %1:] Block %2 illegal tool carrier rotation
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A toolholder was activated with an angle of rotation unequal to zero, although the associated axis is not defined. A rotary axis is not defined when all three direction components are zero.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Set the angle of rotation to zero, or define the associated rotary axis.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14152	[Channel %1:] Block %2 tool carrier: invalid orientation. Error code: %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Error code
Explanation:	An attempt was made to define a tool orientation by means of the active frame, which cannot be reached with the current tool carrier kinematics. This behavior can be caused by the following: - The two rotary axes of the tool carrier are not perpendicular to one another. - The tool carrier has less than two rotary axes; - Rotary axis positions must be set that violate the corresponding axis limitations. An error code is output with the alarm, which specifies the cause in detail: 1: 1st rotary axis of the first solution violates the lower limit 2: 1st rotary axis of the first solution violates the upper limit 10: 2nd rotary axis of the first solution violates the lower limit 20: 2nd rotary axis of the first solution violates the upper limit 100: 1st rotary axis of the second solution violates the lower limit 200: 1st rotary axis of the second solution violates the upper limit 1000: 2nd rotary axis of the second solution violates the lower limit 2000: 2nd rotary axis of the second solution violates the upper limit 3: The required orientation cannot be set with the given axis configuration Several of the error codes that indicate a violation of the axis limits can occur simultaneously As, when an axis limit is violated, an attempt is made to reach a valid position within the permissible axis limits by adding or subtracting multiples of 360 degrees, it is - if this is not possible - not unequivocally defined whether the lower or upper axis limit has been violated.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.

Remedy:	Modify the part program: - Use TCOABS instead of TCOFR. - Activate a different frame. - Change the tool carrier data. - Change the machining plane G17-G19. If the alarm cannot be cleared and an additional alarm 14710 is generated at RESET, the machine data 20126 \$MC_TOOL_CARRIER_RESET_VALUE must be set to zero.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14153 [Channel %1:] Block %2 unknown tool carrier type: %3

Parameters:	%1 = Channel number %2 = Block number, label %3 = Tool carrier type
Explanation:	An invalid tool carrier type was specified in \$TC_CARR23[.]. Only the following are allowed: t, T, p, P, m, M.
Reaction:	Correction block is reorganized. Interpreter stop Interface signals are set. Alarm display.
Remedy:	Change the content of the tool carrier data.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14154 [Channel %1:] Block %2 The amount of fine correction in parameter %3of the orientable toolholder %4 is too large

Parameters:	%1 = Channel number %2 = Block number, label %3 = Invalid parameter of the orientable toolholder %4 = Number of the orientable toolholder
Explanation:	The maximum permissible value of the fine correction in an orientable toolholder is limited by the MD20188 \$MC_TOCARR_FINE_LIM_LIN for linear variables, and by the MD20190 \$MC_TOCARR_FINE_LIM_ROT for rotary variables. The alarm can only occur if the SD42974 \$SC_TOCARR_FINE_CORRECTION is not equal to zero.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Enter a valid fine correction value.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14155 [Channel %1:] Block %2 invalid base frame definition for tool carrier offset

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	If a tool carrier selection causes a change in the table offset, a valid base frame must be defined in order to store this offset. For more information see machine data MD20184 \$MC_TOCARR_BASE_FRAME_NUMBER.
Reaction:	Correction block is reorganized. Interpreter stop Interface signals are set. Alarm display.

Remedy: You have the following possibilities of eliminating the error:
 Change the part program.
 Change MD20184 \$MC_TOCARR_BASE_FRAME_NUMBER.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14156 [Channel %1:] Toolholder selection error at reset

Parameters: %1 = Channel number

Explanation: The settings in MD20110 \$MC_RESET_MODE_MASK require that an active orientable toolholder is maintained after the reset. This is done by deselecting the old orientable toolholder and then reselecting it with data that may have been modified. If an error occurs during the reselection, this alarm is issued (as a warning) and then an attempt is made to select the orientable toolholder in the initial setting. If this second attempt is successful, the reset cycle is continued without any further alarms.

Typically, the alarm only occurs when the old orientable toolholder has been selected with TCOFR, and its axis directions have been changed in such a way before the reset that a setting suitable for the associated frame is no longer possible. If there is another cause for the alarm, this results in an alarm also being issued when attempting to select in the initial setting. This is then also displayed in plain text.

Reaction: Alarm display.

Remedy: Check the program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14157 [Channel %1:] Block %2 illegal interpolation type with MOV T

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: If MOV T is programmed, linear or spline interpolation (G0, G1, ASPLINE, BSPLINE, CSPLINE). must be active.

Reaction: Correction block is reorganized.
 Interpreter stop
 Interface signals are set.
 Alarm display.

Remedy: Modify the program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14159 [Channel %1:] Block %2 more than two angles programmed with ROT S or AROT S

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: Frame rotations are described using space angles with the language commands ROT S or AROT S. A maximum of two angles can be programmed.

Reaction: Correction block is reorganized.
 Interpreter stop
 Interface signals are set.
 Alarm display.

Remedy: Modify the program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14160 [Channel %1:] Block %2 tool length selection without geometry axis specification

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:	If variant C (tool length acts on the programmed axis) is activated by machine data MD20380 \$MC_TOOL_CORR_MODE_G43G44 for tool length compensation with H word and G43/G44 in ISO_2 mode, at least one geometry axis must be specified.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	You have the following possibilities of eliminating the error: Change the part program. Change MD20380 \$MC_TOOL_CORR_MODE_G43G44.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14161	[Channel: %1:] Block%2 Error %3 for call of the function CORRTC.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Error code
Explanation:	An error occurred when the CORRTC function was called. The error number specifies the cause of the error. Error numbers: 1: No tool carrier active. 2: The active tool carrier was not defined with kinematic chains. 10: The call parameter _CORR_INDEX is negative. 11: The call parameter _CORR_MODE is negative. 12: Invalid reference to the section of a partial chain (_CORR_INDEX). 13: No correction element is defined in the section to which the _CORR_INDEX parameter refers (\$TC_CARR_CORR_ELEM). 20: The 100s digit of _CORR_MODE is invalid. Only the values 0 and 1 are permissible. 21: The 1000s digit of _CORR_MODE is invalid. Only the values 0 and 1 are permissible. 30: In the correction of an offset vector, the deviation from the current value is greater than the maximum value set in setting data 41612 \$SN_CORR_TOCARR_LIN_MAX in at least one coordinate. 31: The attempt to write a system variable was rejected due to missing write authorization.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Change function call.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14162	[Channel %1:] Block %2 error %3 on activation of the CUTMOD or CUTMODK function
Parameters:	%1 = Channel number %2 = Block number, label %3 = Error code

Explanation:	An error occurred during the activation of the CUTMOD or CUTMODK function. The type of error is more closely defined by the error code number: For errors with error codes less than 100, MD20125 \$MC_CUTMOD_ERR can be used to determine whether the error condition is to lead to the issue of an alarm, and whether the alarm is only to be displayed or also trigger a program stop. Errors with error codes greater than or equal to 100 always lead to a program stop. Error code: 1 No valid cutting direction is defined for the active tool. 2 The cutting edge angles (clearance angle and holder angle) of the active tool are both zero. 3 The clearance angle of the active tool has an impermissible value (less than 0 degrees or greater than 180 degrees). 4 The holder angle of the active tool has an impermissible value (less than 0 degrees or greater than 90 degrees). 5 The tool tip angle of the active tool has an impermissible value (less than 0 degrees or greater than 90 degrees). 6 The cutting edge position - holder angle combination of the active tool is impermissible (with cutting edge positions 1 through 4, the holder angle must be greater than or equal to 90 degrees, with cutting edge positions 5 through 8, it must be less than or equal to 90 degrees). 7 The tool tip is not located in the machining plane, and the angle GAMMA between the tool tip and machining plane exceeds the upper limit specified using setting data SD42998 \$SC_CUTMOD_PLANE_TOL. 8 The cutting plate is not located in the machining plane. Angle ALPHA is greater than 1 degree. The angle ALPHA is the angle of rotation around the coordinate axis, which is perpendicular to both the axis of rotation of the angle BETA and the axis of rotation of the angle GAMMA (with G18 the X axis). 100 The rotation matrix to be used for calculating the modification of the cutting edge position does not describe a pure rotation, that is it contains mirroring, scaling or shearing. 101 When CUTMODK is activated, there is no valid orientation transformation active. A 5 or 6-axis transformation defined with kinematic chains must be active. 102 The language command "CUTMODK" was called with an invalid parameter. Only the parameters "NEW", "CLEAR", "ON" and "OFF" are permitted.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct the tool data of the active tool, or modify the part program. Alternatively, suppress the alarm for all errors with error numbers less than 100 with the aid of MD20125 \$MC_CUTMOD_ERR.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14163	[Channel %1:] Block %2 Tool carrier: Hirth tooth system is not a divisor of the full circle.
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The value of the Hirth increment (in degrees) in at least one axis is not a divisor of the full angle. This can be a problem for the display if, for example, a negative solution, which matches the Hirth tooth system, is increased by 360 degrees. The result is no longer divisible by the Hirth increment.
Reaction:	Alarm display.
Remedy:	Set the angle of rotation to zero, or define the associated rotary axis.
Programm continuation:	Clear alarm with the Delete key or NC START.

14165	[Channel %1:] Block %2 selected ISO H/D number %3 does not match tool %4
Parameters:	%1 = Channel number %2 = Block number, label %3 = ISO H/D number %4 = Tool number
Explanation:	When an H or D number is programmed in ISO_2 or ISO_3 mode, it must be available in the active tool. The active tool may also be the last tool loaded on the master spindle or master toolholder. This alarm is output if there is no H or D number on this tool.

Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Set the ISO H/D number correctly.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14166 [Channel %1:] Block %2 error %3 when programming a tool length offset with TOFF / TOFFL

Parameters:	%1 = Channel number %2 = Block number, label %3 = Error code
Explanation:	An error occurred while programming a tool length offset with TOFF or TOFFL. More precise information about the type of error is given by the error code number: Error code 1 At least one tool length offset component has been programmed twice in one block (with TOFF). 2 At least one tool length offset component has been programmed twice in one block (with TOFFL). 3 Tool length offset components have been programmed in one block with both TOFF and TOFFL. 4 An index must be declared when a tool length offset is programmed with TOFF, the form TOFF=.... is not permissible. 5 An illegal index was declared when programming TOFFL (permissible values 1..3). 6 An illegal axis was declared as the index when programming TOFF. Only geometry axes are permitted. Can also occur with TRAFOOF if TOFFON is active and no geometry axes are known without transformation.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct errors in program block.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14170 [Channel %1:] Block %2 illegal interpolation type with tool length compensation

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	If tool compensation (G43/G44) is activated in the language mode ISO_M, linear interpolation must be activated as the type of interpolation.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14180 [Channel %1:] Block %2 H number %3 is not defined

Parameters:	%1 = Channel number %2 = Block number, label %3 = H number of ISO mode
Explanation:	The specified H number is not assigned to a tool (ISO_M).

Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14185 [Channel %1:] Block %2 D number %3 is not defined

Parameters:	%1 = Channel number %2 = Block number, label %3 = D number of ISO mode
Explanation:	The specified D number is not assigned to a tool (language mode ISO_M).
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14196 [Channel %1:] Block %2 error %3 on interpreting the contents of \$SC_CUTDIRMOD

Parameters:	%1 = Channel number %2 = Block number, label %3 = Error code
Explanation:	An error has occurred during the interpretation of the strings contained in SD42984 \$SC_CUTDIRMOD. This setting data is always read when a new edge is selected. The error code indicates the cause of the error: 1: The string only consists of blanks or a sign 2: Unknown frame name after \$P_ 3: No colon after the first valid frame name 4: Insufficient memory space for creating a frame internally 5: Invalid frame index 6: Further characters found after complete string 7: Second frame name is missing after the colon 8: Impermissible frame rotation (surface normals are rotated against each other by 90 degrees or more) 9: Invalid frame chain (the first frame must come before the second frame in the frame chain) 10: Invalid axis name 11: Axis is not a rotary axis 12: Invalid string that cannot be assigned to any of the error types 1 to 11 20: Invalid angle statement (numerical value) 30: Invalid angle of rotation (not an integer multiple of 90 degrees)
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Enter valid string in SD42984 \$SC_CUTDIRMOD.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14197 [Channel %1:] Block %2 D number and H number programmed simultaneously

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: A D word and H word have been programmed simultaneously.

Reaction: Correction block is reorganized.
Local alarm reaction.
Interface signals are set.
Alarm display.
NC Stop on alarm at block end.

Remedy: Modify the part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14199 [Channel %1:] Block %2 illegal plane change for tool with diameter component

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: If a tool has a wear or length component which is evaluated as a diameter for the facing axis (bit 0 and/or bit 1 in MD20360 \$MC_TOOL_PARAMETER_DEF_MASK is set) and bit 2 of this MD is also set, this tool may only be used in the plane active on tool selection. A plane change results in an alarm.

Reaction: Correction block is reorganized.
Local alarm reaction.
Interface signals are set.
Alarm display.
NC Stop on alarm at block end.

Remedy: Modify the part program.
Reset bit 2 in MD20360 \$MC_TOOL_PARAMETER_DEF_MASK.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14200 [Channel %1:] Block %2 negative polar radius

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: In the endpoint specification of a traversing block with G00, G01, G02 or G03 in polar coordinates, the polar radius entered for the keyword RP=... is negative.
Definition of terms:
- Specification of end of block point with polar angle and polar radius, referring to the current pole (preparatory functions: G00/G01/G02/G03).
- New definition of the pole with polar angle and pole radius, referring to the reference point selected with the G function. G110 ... last programmed point in the plane, G111 ... zero point of the current work, G112 ... last pole

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Correct NC part program - permissible inputs for the pole radius are only positive absolute values that specify the distance between the current pole and the block end point. (The direction is defined by the polar angle AP=...).

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14210 [Channel %1:] Block %2 polar angle too large

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:	In specifying the endpoints in a traversing block with G00, G01, G02 or G03 in polar coordinates, the value range of the polar angle programmed under the keyword AP=... has been exceeded. It covers the range from -360 to +360 degrees with a resolution of 0.001 degrees. Definition of terms: - Specification of end of block point with polar angle and polar radius, referring to the current pole (preparatory functions: G00/G01/G02/G03). - New definition of the pole with polar angle and pole radius, referring to the reference point selected with the G function. G110 ... referred to the last programmed point in the plane, G111 ... referred to the zero point of the current workpiece coordinate system (Work), G112 ... referred to the last pole.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct NC part program. The permissible input range for the polar angle is between the values -360 degrees and +360 degrees with a resolution of 0.001 degrees.
Program continuation:	Clear alarm with NC START or RESET key and continue the program.

14250 [Channel %1:] Block %2 negative pole radius

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In redefining the pole with G110, G111 or G112 in polar coordinates, the pole radius specified under keyword RP=... is negative. Only positive absolute values are permitted. Definition of terms: - Specification of end of block point with polar angle and polar radius, referring to the current pole (preparatory functions: G00/G01/G02/G03). - New definition of the pole with polar angle and pole radius, referring to the reference point selected with the G function. G110 ... last programmed point in the plane, G111 ... zero point of the current work, G112 ... last pole
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct the NC part program. Permissible inputs for the pole radius are only positive, absolute values that specify the distance between the reference point and the new pole. (The direction is defined with the pole angle AP=...).
Program continuation:	Clear alarm with NC START or RESET key and continue the program.

14260 [Channel %1:] Block %2 pole angle too large

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In redefining the pole with G110, G111 or G112 in polar coordinates, the value range of the pole angle specified under keyword AP=... has been exceeded. It covers the range from -360 to +360 degrees with a resolution of 0.001 degrees. Definition of terms: - Specification of end of block point with polar angle and polar radius, referring to the current pole (preparatory functions: G00/G01/G02/G03). - New definition of the pole with polar angle and pole radius, referring to the reference point selected with the G function. G110 ... last programmed point in the plane, G111 ... zero point of the current work, G112 ... last pole
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct NC part program. The permissible input range for the polar angle is between the values -360 degrees and +360 degrees with a resolution of 0.001 degrees.
Program continuation:	Clear alarm with NC START or RESET key and continue the program.

14270	[Channel %1:] Block %2 pole programmed incorrectly
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	When defining the pole, an axis was programmed that does not belong to the selected processing level. Programming in polar coordinates always refers to the plane activated with G17 to G19. This also applies to the definition of a new pole with G110, G111 or G112.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct the NC part program. Only the two geometry axes may be programmed that establish the current machining plane.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14280	[Channel %1:] Block %2 polar coordinates programmed incorrectly
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The end point of the displayed block has been programmed both in the polar coordinate system (with AP=..., RP=...) and in the Cartesian coordinate system (axis addresses X, Y,...).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct the NC part program - the axis motion may be specified in one coordinate system only.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14290	[Channel %1:] Block %2 polynomial degree greater than 5 programmed for polynomial interpolation
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A polynomial degree greater than five was programmed for the polynomial interpolation. You can only program polynomials up to the 5th degree.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14300	[Channel %1:] Block %2 overlaid handwheel motion activated incorrectly
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Handwheel override has been called up incorrectly: - 1st For positioning axes: - Handwheel override programmed for indexing axes, - No position programmed, - FA and FDA programmed for the same axis in the block. - 2nd For contouring axes: - No position programmed, - G60 not active, - 1st G group incorrect (only G01 to CIP).

Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14320 [Channel %3:] Axis %4: handwheel %1 used twice (%2)

Parameters:	%1 = Handwheel number %2 = Use %3 = Channel %4 = Axis
Explanation:	Informational alarm indicating that the mentioned handwheel is used twice: The second parameter provides the explanation: 1: Block with axial handwheel override for this axis cannot be executed as the handwheel for this axis performs a DRF movement 2: Block with velocity override of the path cannot be executed as the handwheel performs a DRF movement for this axis of the path 3: Block with contour handwheel cannot be executed as the handwheel performs a DRF movement for this axis of the path 4: PLC axis with axial handwheel override cannot be started immediately as the handwheel performs a DRF movement for this axis 5: The axis is a reciprocating axis with axial handwheel override; the reciprocating movement cannot be started immediately as the handwheel performs a DRF movement for this axis 6: The DRF movement for this axis cannot be executed as an axial handwheel override is active for this axis with the handwheel 7: The DRF movement for this axis cannot be executed as a velocity override of the path with the handwheel is active and the axis belongs to the path 8: The DRF movement for this axis cannot be executed as the contour handwheel is active with this handwheel and the axis belongs to the path 9: The DRF movement for this axis cannot be executed as the axis is a PLC axis with handwheel override that is active with this handwheel 10: The DRF movement for this axis cannot be executed as the axis is active as reciprocating axis with handwheel override with this handwheel
Reaction:	Alarm display.
Remedy:	Use the handwheel for one purpose at a time only.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

14400 [Channel %1:] Block %2 tool radius compensation active at transformation switchover

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A change of transformation is not allowed when tool radius compensation is active.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Perform tool radius compensation in the NC part program with G40 (in a block with G00 or G01) before performing a transformation change.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14401	[Channel %1:] Block %2 transformation not available. Error code %3.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Error code
Explanation:	The required transformation is not available. The cause of the error is explained more closely by the error code. 1: No transformations are available. 2: No transformations of the type "inclined axis" are available. 3: No orientation transformations are available. 4: No transmit transformations are available. 5: No tracyl transformations are available. 6: No chained transformations are available. 7: No OEM transformations are available. 8: No OEM orientation transformations are available. 22: The required transformation of the type "inclined axis" was not found. 23: The required orientation transformation was not found. 24: The required transmit transformation was not found. 25: The required tracyl transformation was not found. 26: The required chained transformation was not found. 40: An attempt was made to activate a transformation defined by kinematic chains. However, no such transformations have been enabled (MD18866 \$MN_MM_NUM_KIN_TRAFOS is zero). 41: No transformation name (first call parameter) was specified for the transformation call TRAF00N. 42: An attempt was made to activate a transformation defined by kinematic chains. However, no such transformation with the specified name was found. 43: An attempt was made to activate a transformation defined by kinematic chains whose name had been changed since the last activation. Changed transformation data does not become active until after a NEWCONF or RESET. 44: An attempt was made to activate a transformation defined by kinematic chains. But the stated name is empty (zero string). 45: An attempt was made to activate a transformation defined by kinematic chains. However, the system variables \$NT_NAME[..] are all empty. 46: An attempt was made to activate a transformation defined by kinematic chains. The stated transformation name was found more than once in the array of system variables \$NT_NAME. 52: An attempt was made to activate a RESET transformation defined by kinematic chains (MD20142 \$MC_TRAFO_RESET_NAME). However, no transformation was found with the stated name. 55: An attempt was made to activate a RESET transformation defined by kinematic chains (MD20142 \$MC_TRAFO_RESET_NAME). However, the system variables \$NT_NAME[..] are all empty. 56: An attempt was made to activate a RESET transformation defined by kinematic chains (MD20142 \$MC_TRAFO_RESET_NAME). However, the stated transformation name was found more than once in the array of system variables \$NT_NAME. 201: A transformation has been incorrectly parameterized.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Error codes 1 to 6 indicate that the control does not contain the requisite software. The transformation cannot even be activated by setting machine or option data. For the remaining error codes: Modify part program; program defined transformations only. Check MD24... \$MC_TRAFO_TYPE... (assigns the transformation to the part program operation).
Programm continuation:	Clear alarm with the RESET key. Restart part program

14402	[Channel %1:] Block %2 spline active at transformation change
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A change of transformation is not allowed in a spline curve section. A series of spline blocks must be concluded.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14404	[Channel %1:] Block %2 illegal parameterization of transformation
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Error has occurred when selecting transformation. Possible causes of error: - An axis traversed by the transformation has not been enabled: - is being used by another channel (-> enable) - is in spindle mode (-> enable with SPOS) - is in POSA mode (-> enable with WAITP) - is concurrent Pos axis (-> enable with WAITP) - Parameterization via machine data has an error - Axis or geometry axis assignment to the transformation has an error, - Machine data has an error (-> modify machine data, restart) Please note: Any axes not enabled might be signaled via alarm 14092 or alarm 1011 instead of alarm 14404. Transformation-dependent error causes can be in: TRAORI: - TRANSMIT: - The current machine axis position is unsuitable for selection (e.g. selection in the pole) (-> change position slightly). - Parameterization via machine data has an error. - Special requirement with respect to the machine axis has not been fulfilled (e.g. rotary axis is not a modulo axis) (-> modify machine data, restart). TRACYL: The programmed parameter is not allowed when transformation is selected. TRAANG: - The programmed parameter is not allowed when transformation is selected. - Parameterization via machine data has an error. - Parameter is faulty (e.g. TRAANG: unfavorable angle value (-> modify machine data, restart) Persistent transformation: - Machine data for persistent transformation are wrong (-> consider dependencies, change machine data, restart) Only with active "OEM transformation" compile cycle: The axes included in the transformation must be referenced.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Modify part program or machine data. Only with active "OEM transformation" compile cycle: Reference the axes included in the transformation before selecting transformation.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14406	[Channel %1:] Block %2 Parameter error %3 on calling a transformation.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Error code
Explanation:	An error was detected during the attempt to activate a transformation. The cause of the error is indicated more precisely by the following error code. - 80. The geometry axes are (almost) linearly dependent. This means that two geometry axes are almost parallel or three geometry axes lie almost in one plane. - 81. An orientation axis is impermissible or not completely parameterized as a spindle (with \$NT_CNTRL, \$NT_ROT_AX_CNT). - 90. More than one inclined axis was parameterized in the definition of a TRANSMIT or TRACYL transformation with kinematic chains. - 91. Impermissible direction of an inclined axis in the definition of a TRANSMIT or TRACYL transformation with kinematic chains. The inclined axis does not lie in a main plane. - 92. The polar axis and the longitudinal axis are not parallel in a TRANSMIT or TRACYL transformation. - 93. The radial axis must be perpendicular to the polar axis if no longitudinal axis is present. - 94. The center offset axis must be perpendicular to the polar axis if no longitudinal axis is present. - 120. During the redirection of a TRAANG transformation to a transformation defined by kinematic chains, a parameter was stated as an angle that was not the same as the angle defined by the kinematic chains. - 121. During the redirection of a TRAANG transformation to a transformation defined by kinematic chains, a parameter was stated as an angle, although the angle of the inclined axis was not defined. This case occurs if there is more than one inclined axis or if the inclined axis does not lie in a main plane. - 150. The call of a TRACYL transformation did not state a value for the reference or work diameter. - 200. The transformation can only be activated in a transformation chain, and not as a single transformation. - 250. The spindle rotation vector is not parallel to the Z axis of the WCS (see \$NT_P_CHAIN_LAST_ELEM). The element to be entered here must be the last element in the table chain that is not a rotary axis. (If the part of the table chain before \$NT_P_CHAIN_LAST_ELEM contains rotary axes, WKS jumps will occur, which (as described above) violate the prerequisites for activation). - 251. The tool is oriented incorrectly. The tool must point to the center of rotation when TRAJNT is called. ***** The following error codes are only output with OEM transformations if an error is detected during the selection of the transformation: - 1000. The basic direction of the tool orientation must be parallel to one of the coordinate axes X, Y or Z. - 1001. The basic direction of the tool orientation must not point in the X direction. - 1002. The basic direction of the tool orientation must not point in the Y direction. - 1003. The basic direction of the tool orientation must not point in the Z direction. - 1004. The normal vector of the tool in the basic position must be parallel to one of the coordinate axes X, Y or Z. - 1005. The normal vector of the tool in the basic position must not point in the X direction. - 1006. The normal vector of the tool in the basic position must not point in the Y direction. - 1007. The normal vector of the tool in the basic position must not point in the Z direction. Note: Error codes 1000 to 1007 can only occur if \$NC_IGNORE_TOOL_ORIENT = FALSE (default value), and the active tool contains orientations that are not permissible. In this case, basic directions defined in the variables \$NT_BASE_ORIENT and \$NT_BASE_ORIENT_NORMAL do not become active
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Correct incorrect parameterisation.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14407	[Channel %1:] Block %2 constant axis %3 has an invalid position
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	An axis with a position that must not be changed during active transformation, has an impermissible position when the transformation is activated. The permissible positions are described in the relevant documentation of the transformation.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	- Before activation of the transformation, traverse the affected axis to a permissible position.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14408	[Channel %1:] Block %2 Transformation TRAJNT and function cannot be active simultaneously. (%3)
Parameters:	%1 = Channel number %2 = Block number, label %3 = Error code
Explanation:	TRAJNT cannot be operated with the following functions. - 10. CUT3DC, CUT3DF, CUT3DCD, CUT3DFF, CUT3DFS, CUT3DCC, CUT3DCCD, CUT3DFD - 20. PTP, PTPG0, PTPWOC, PTPWOC2 - 30. G17, G19 - 40. G33, G331, G332, G334, G335, G34, G35 - 50. TOFFON - 60. TOWMCS, TOWWCS, TOWBCS, TOWTCS, TOWKCS - 70. DIAMONA, DIACYCOFA, DIAM90A, DIAMOFA - 80. G63 - 90. G961, G962, G97, G971, G972 - 100. LFON - 110. DRIVE - 120. NPV (G54, G55, etc.), TRANS, ROT, MIRROR, SCALE, ATRANS, AROT, AMIRROR, ASCALE - 130. G53, G153, SUPA, SUPD - 140. The tool type must lie between 500 and 599. - 150. SPCOF - 160. Extended lookahead is active MD20443 \$MC_LOOKAH_FFORM[n]=1, n=G-code group 59
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Eliminate the incorrect parameterization.
Programm continuation:	Clear alarm with the RESET key. Restart part program
14409	[Channel %1:] Block %2: Transformation TRAJNT has detected a %3-WCS position %4 unequal to 0.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Identifier of the 2nd geometry axis %4 = WCS position
Explanation:	he programmed positions result in a WCS position of the 2nd geometry axis unequal to 0 during active transformation.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Program the axes or the spindle so that the position of the 2nd geometry axis in the WCS is 0, taking into account the correct tool lengths.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14410 [Channel %1:] Block %2 spline active at geometry axis changeover

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	It is not allowed to change the assignment of geometry axes to channel axes in a spline curve definition.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14411 [Channel %1:] Block %2 tool radius compensation active at geometry axis changeover

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	It is not permissible to change the assignment of geometry axes to channel axes when tool radius compensation is active.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14412 [Channel %1:] Block %2 transformation active at geometry axis changeover

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	It is not permissible to change the assignment of geometry axes to channel axes when transformation is active.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14413 [Channel %1:] Block %2 fine tool correction: changeover geometry/channel axis not allowed

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	It is not permissible to change the assignment of geometry axes to channel axes during active tool fine compensation.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify the part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14414 [Channel %1:] Block %2 GEOAX function: incorrect call

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The parameters for calling the GEOAX(...) are incorrect.
Possible causes:

- Uneven number of parameters.
- More than 6 parameters were specified.
- A geometry axis number was programmed which was less than 0 or greater than 3.
- A geometry axis number was programmed more than once.
- An axis identifier was programmed more than once.
- An attempt was made to assign a channel axis to a geometry axis which has the same name as one of the channel axes.
- An attempt was made to assign a channel axis to a geometry axis lacking IPO functionality (see MD30460 \$MA_BASE_FUNCTION_MASK, Bit8).
- An attempt was made to remove a geometry axis with the same name as one of the channel axes from the geometry axis grouping.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify the part program or the correction block.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14415 [Channel %1:] Block %2 tangent control: changeover geometry/channel axis not allowed

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: An assignment change of the geometry axes to channel axes is not permitted with active tangential control.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Change part program and delete active tangential control with TANGDEL.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14420 [Channel %1:] Block %2 index axis %3 frame not allowed

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis

Explanation: The axis is to be traversed as an indexing axis, but a frame is active. This is not allowed by MD32074 \$MA_FRAME_OR_CORRPOS_NOTALLOWED.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Inform the authorized personnel/service department.
Modify the part program.
Change MD32074 \$MA_FRAME_OR_CORRPOS_NOTALLOWED.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14430	[Channel %1:] Block %2 tangential axis %3 must not be traversed as POS axis
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name
Explanation:	A tangentially followed-up axis cannot be traversed as positioning axis.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Change part program and delete active tangential control with TANGDEL.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14432	[Channel %1:] Block %2 Rounding length for tangential axis %3 is too small.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name
Explanation:	For a tangential axis that is coupled during preparation, a rounding length must be indicated with TANGON() on activating the tangential control, or possibly occurring discontinuities of the tangential axis cannot be smoothed. This rounding length must be larger than 1 increment.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14434	[Channel %1:] Block %2 rel. lift-off path for tangential axis %3 is invalid
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name
Explanation:	Factor r as programmed on TLIFT for the relative lift-off path must be within range $0 \leq r < 1$.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14500	[Channel %1:] Block %2 illegal DEF or PROC instruction in the part program
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	NC part programs with high-level language elements are divided into a preceding definition part followed by a program part. The transition is not marked specifically; a definition statement is not allowed to follow the 1st program command.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Put definition and PROFC statements at the beginning of the program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14510	[Channel %1:] Block %2 PROC instruction missing on subroutine call
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In subroutine calls with parameter transfer ("call-by-value" or "call-by-reference") the called subroutine must begin with a PROC statement.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Define the subroutine in accordance with the type used. 1. Conventional subroutine structure (without parameter transfer): % SPF 123456 : M17 2. Subroutine structure with keyword and subroutine name (without parameter transfer): PROC UPNAME : M17 ENDPROC 3. Subroutine structure with keyword and subroutine name (with parameter transfer "call-by-value"): PROC UPNAME (VARNAME1, VARNAME2, ...) : M17 ENDPROC 4. Subroutine structure with keyword and subroutine name (with parameter transfer "call-by-reference"): PROC UPNAME (Typ1 VARNAME1, Typ2 VARNAME2, ...) : M17 ENDPROC
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14520	[Channel %1:] Block %2 illegal PROC instruction in data definition section
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The PROC statement may only be programmed at the beginning of the subroutine.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify NC part program appropriately.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14530	[Channel %1:] Block %2 EXTERN and PROC instruction do not correspond
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Subroutines with parameter transfer must be known before they are called in the program. If the subroutines are always available (fixed cycles) the control establishes the call interfaces at the time of system power-up. Otherwise an EXTERN statement must be programmed in the calling program. Example: N123 EXTERN UPNAME (TYP1, TYP2, TYP3, ...) The type of the variable must match the type given in the definition (PROC statements) or it must be compatible with it. The name can be different.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Check the variable types in the EXTERN and the PROC statements for correspondence and correctness.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14540	[Channel %1:] Block %2 contour tool: the min. limit angle has been programmed more than once (edge D%3)
Parameters:	%1 = Channel number %2 = Block number, label %3 = Edge number, label
Explanation:	The limit angle of a contour tool must be unequal zero in an involved edge only.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Change tool definition.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14541	[Channel %1:] Block %2 contour tool: the max. limit angle has been programmed more than once (edge D%3)
Parameters:	%1 = Channel number %2 = Block number, label %3 = Edge number, label
Explanation:	The limit angle of a contour tool must be unequal zero in an involved edge only.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Change tool definition.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14542	[Channel %1:] Block %2 contour tool: the min. limit angle has not been programmed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	On defining a contour tool, either no limit angle must be indicated, or both the minimum and the maximum limit angle must be programmed once for each.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Change tool definition.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14543	[Channel %1:] Block %2 contour tool: the max. limit angle has not been programmed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	On defining a contour tool, either no limit angle must be indicated, or both the minimum and the maximum limit angle must be programmed once for each.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Change tool definition.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14544	[Channel %1:] Block %2 contour tool: edge D%3 is not positioned between the two border edges
Parameters:	%1 = Channel number %2 = Block number, label %3 = Edge number, label
Explanation:	On defining a form tool with limit, all edges must be positioned between the edge with the minimum limit angle and the edge with the maximum limit angle when rotating counter-clockwise.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Change tool definition.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14545	[Channel %1:] Block %2 contour tool: edge D%3 completely encircles edge D%4
Parameters:	%1 = Channel number %2 = Block number, label %3 = Edge number, label %4 = Edge number, label
Explanation:	On defining a contour tool, tangents are placed on the adjacent circular edges. It will not be possible, if one edge is completely encircled by another one.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Change tool definition.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14546	[Channel %1:] Block %2 contour tool: edge D%3 defines a concave corner
Parameters:	%1 = Channel number %2 = Block number, label %3 = Edge number, label
Explanation:	The contour of a contour tool must be convex throughout, i.e. there must not be any concave corners.

Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Change tool definition.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14547 [Channel %1:] Block %2 contour tool: checksum erroneous or not available

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	When MD20372 \$MC_SHAPED_TOOL_CHECKSUM was set, no edge was found for which the tool length components and the tool radius equal the negative sum of the previous edges.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Check tool definition. An edge must exist, the tool length components and tool radius of which equal the negative sum of the previous edges. This will not take the tool length components of the first edge into consideration. On comparing the components, the relevant sums of basic value and wear value are compared with each other, not the part components themselves.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14548 [Channel %1:] Block %2 contour tool: negative radius in edge D%3 is not allowed

Parameters:	%1 = Channel number %2 = Block number, label %3 = Edge number, label
Explanation:	No negative radii are permitted for contour tools, i.e. the sum of basic radius and wear value must be at least 0.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Check tool definition. Change edge radius.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14549 [Channel %1:] Block %2 contour tool: impermissible programming. Code no. %3

Parameters:	%1 = Channel number %2 = Block number, label %3 = Error code
--------------------	--

Explanation:	Impermissible programming has been found for contour tools on active tool radius compensation. The error cause is explained in detail by the error code. 1: In G code group 17, KONT is active during activation 2: In G code group 17, KONT is active during deactivation 9: In G code group 40, CUTCONOF is not active 10: Reprogramming of G41 / G42 in already active tool radius compensation not permissible 20: Circle with more than one rotation not permissible 21: Ellipse (circle not in compensation level) 23: Involute not permissible 24: Several polynomials not permitted in one block only. These blocks could be created by e.g. COMPCAD or G643. 30: Preprocessing stop not permitted 41: Starting point of first compensation block cannot be reached by anyone of the defined cutting edges 42: End point of last compensation block cannot be reached by anyone of the defined cutting edges
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Change the NC program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14550	[Channel %1:] Block %2 contour tool: impermissible tool contour change. Code no. %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Error code
Explanation:	A new tool with deviating tool contour was activated for contour tools on active tool radius compensation The error cause is explained further by an error code. If the error code is an integer, the lower-value three decimal places specify the number of the edge, in which the error was detected, while the thousandth digit explains the reason in more detail. -1: The tool was deleted. -2: The number of contour elements (edges) explaining the tool, has changed. 1000: The edge center has changed 2000: The edge radius has changed. 3000: The initial angle has changed. 4000: The final angle has changed.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Change the NC program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14551	[Channel %1:] Block %2 contour tool: angle area of edge D%3 larger than 359 degrees
Parameters:	%1 = Channel number %2 = Block number, label %3 = Edge number, label
Explanation:	A single edge must cover a max. angle area of 359 degrees.

Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Check tool definition.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14600 [Channel %1:] Block %2 reload buffer %3 cannot be established

Parameters:	%1 = Channel number %2 = Block number, label %3 = File name
Explanation:	The download buffer for "execute from external" could not be created. Possible causes: - Not enough memory available (for minimum see MD18360 \$MN_MM_EXT_PROG_BUFFER_SIZE) - No resources available for HMI NCK communication (see MD18362 \$MN_MM_EXT_PROG_NUM) - The file already exists
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Release memory, e.g. by deleting part programs - Modify MD18360 \$MN_MM_EXT_PROG_BUFFER_SIZE and/or MD18362 \$MN_MM_EXT_PROG_NUM.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14601 [Channel %1:] Block %2 reload buffer could not be deleted

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The reload buffer for "Execute from external" could not be deleted because, for example, communication with HMI/PLC had not been terminated.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	To clear all reload buffers, perform a power on.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14602 [Channel %1:] Block %2 timeout while reloading from external.

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	No connection could be made to the HMI while reloading EXTCALL external subprograms or executing from external drives within the monitoring time set in MD10132 \$MN_MMC_CMD_TIMEOUT.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Check the connection to the HMI - Increase the monitoring time in MD10132 \$MN_MMC_CMD_TIMEOUT.

Programm continuation: Clear alarm with the RESET key. Restart part program

14603 [Channel %1:] Block %2 timeout during execution from external source.

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: If a program is selected for execution from an external source, it is assumed that the first part program line can be read from the reload buffer within 60s after the part program has started.
Otherwise, part program processing will be canceled with alarm 14603 based on the assumption that the connection to the HMI or the external device is faulted.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check the connection to the HMI and repeat selection of the program that is to be executed from external source.

Programm continuation: Clear alarm with the RESET key. Restart part program
- Acknowledge the alarm by pressing the RESET key
- Repeat program selection
- Start the part program

14615 [Channel %1:] An error occurred while handling the function 'syntax check': identifier %3

Parameters: %1 = Channel number
%2 = Is not used
%3 = Error code

Explanation: An error occurred while handling the function syntax check via the PI services _N_CHKSEL, _N_CHKRUN, _N_CHKABO and _N_SEL_BL. Parameter %3 describes the error situation more closely:
Value
1: An invalid line number was transferred with the PI service _N_SEL_BL
2: An invalid line number for the range end was transferred with the PI service _N_CHKRUN
3: PI service _N_CHKSEL was activated although a block selection (PI service _N_SEL_BL) was active for the selected program.

Reaction: Alarm display.

Remedy: Value
1: Supply PI service _N_SEL_BL with the correct line number
2: Supply PI service _N_CHKRUN with the correct line number for the range end
3: Ensure that the channel is in reset status before activating the PI service _N_CHKSEL.

Programm continuation: Clear alarm with the Delete key or NC START.

14620 [Channel %1:] Block %2 Error on opening program %3

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Program name

Explanation: Program %3 cannot be executed because it has been locked by another application, e.g. HMI Editor.
Background: Program %3 is stored on an external data medium (CF Card, network drive, USB device), and should be executed from there in EES mode (execution from external storage). However, program %3 cannot be edited because it is locked by another application, e.g. HMI Editor, is open for writing and WRITE lock is set for this file.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: - Cancel program with Reset
- Close the application that set the WRITE lock, for example the HMI Editor, and continue program editing with NC Start.

Programm continuation: Clear alarm with the RESET key. Restart part program

14621 [Channel %1:] Block %2 Timeout on access to external program %3

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Program name

Explanation: Program %3 is stored on an external data medium (CF card, network drive, USB device). A timeout occurred when the program was accessed.

Possible cause of error: network disturbance.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: - Rectify network disturbances if applicable

Programm continuation: Clear alarm with the RESET key. Restart part program

14622 [Channel %1:] Access to file %2 disrupted by %3 %4

Parameters: %1 = Channel number
%2 = File which could not be accessed
%3 = Function with which it is accessed
%4 = Error message

Explanation: The program is stored on an external data medium (CF card, network drive, USB device). An error occurred when the program was accessed.

Possible cause of error: network disturbance.

Reaction: Alarm display.

Remedy: - Rectify network disturbances if applicable

Programm continuation: Clear alarm with the Delete key or NC START.

14623 The EES library does not exist

Explanation: The EES library does not exist; no part programs can be executed with EES.

Reaction: Channel not ready.
Alarm display.

Remedy: Load EES library

Programm continuation: Switch control OFF - ON.

14624 The EES library is incompatible.

Explanation: The EES library is incompatible; no part programs can be executed with EES.

Reaction: Channel not ready.
Alarm display.

Remedy: Replace EES library

Programm continuation: Switch control OFF - ON.

14625 [Channel %1:] Block %2 Problems in EES mode accessing file %3

Parameters: %1 = Channel number
%2 = Block number, label
%3 = File which could not be accessed

Explanation:	The program is located on an external data medium (network drive, USB device). Problems occurred when accessing the program. Possible cause or error: network fault.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	- if necessary, remedy network faults und resume program
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14650	[Channel %1:] Block %2 SETINT instruction with invalid ASUB input
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Asynchronous subroutines (ASUBs) are subroutines that are executed following a hardware input (interrupt routine started by a rapid NC input). The NC input number must lie between 1 and 8. It is assigned a priority from 1 to 128 (1 is the highest priority) in the SETINT instruction with the keyword PRIO = Example: If NCK input 5 changes to "1 signal", the subroutine AB-HEB_Z should be started with the highest priority. N100 SETINT (5) PRIO = 1 ABHEB_Z Restriction for SW PLC2xx: The number of the NCK input must be 1 or 2.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Program the NC input of the SETINT statement with a value of not less than 1 or greater than 8.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14660	[Channel %1:] Block %2 SETINT instruction with invalid priority
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The NC input number must lie between 1 and 8. It is assigned a priority from 0 to 128 (1 is the highest priority) in the SETINT instruction with the keyword PRIO = Example: If NC input 5 changes to "1-signal" the subroutine ABHEB_Z should be started with the highest priority. N100 SETINT (5) PRIO = 1 ABHEB_Z Restriction for SW PLC2xx: The number of the NC input must be 1 or 2.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Program the priority of the NC input with a value of not less than 1 or greater than 128.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14700	[Channel %1:] Block %2 timeout during command to interpreter
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A timeout has occurred in control-internal commands such as ANWAHL (part program selection), RESET (channel reset), REORG (reorganization of the preprocessing buffer) and NEWCONFIG (change in the configuration-specific machine data = restart).

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. If the runtime error occurred as the result of a temporary excessive load on the system (e.g. in the HMI area or in OEM applications) error-free execution is possible on if the program or operator action are repeated. If you experience such a system error, please contact Technical Support. www.siemens.com/sinumerik/help Please supply the following information to ensure quick processing: - Alarm number together with alarm text - Description of the operation/mode before the alarm message - Generate log files using the key combination: <Ctrl> + <Alt> + <D>
Programm continuation:	Switch control OFF - ON.

14701 [Channel %1:] Block %2 number of available NC blocks reduced by %3

Parameters:	%1 = Channel number %2 = Block number, label %3 = Number of non-available blocks
Explanation:	After the reset, it was found that the number of available blocks has decreased compared with the last reset. This is due to a system error. The part program execution can be resumed after acknowledging the alarm. If the number of blocks no longer available is less than MD28060 \$MC_MM_IPO_BUFFER_SIZE, then the PowerON alarm 14700 is output.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Proceed as in the case of a system error.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14710 [Channel %1:] Block %2 error in initialization sequence in function %3

Parameters:	%1 = Channel number %2 = Block number, label %3 = Identifier of the function which caused the error
--------------------	---

Explanation:	Initialization blocks are generated (or not) after control power-up, (program) RESET and (program) START, depending on the settings in machine data MD20110 \$MC_RESET_MODE_MASK and MD20112 \$MC_START_MODE_MASK. Errors can occur because of incorrect machine data settings. The errors are output with the same error messages as would appear if the function had been incorrectly programmed in the part program. This alarm is also generated in order to indicate that an error relates to the initialization sequence. Parameter %3 specifies which function triggers the alarm: Control power-up and (program) RESET: Value: 0: Error during synchronization preprocessing/main run 1: Error on selection of tool length compensation 2: Error on selection of transformation 3: Error on selection of work offset The macro definitions and cycle interfaces are also read in during the power-up procedure. If an error occurs here, this is indicated by value = 4, or value = 5 6: Error creating 2 1/2 D protection areas during power up. (Program) START: Value 100: Error during synchronization preprocessing/main run 101: Error on selection of tool length compensation 102: Error on selection of transformation 103: Error on selection of synchronized spindle 104: Error on selection of work offset 105: Error after WRITE lock on the selected program Particularly when tool management is active, it is possible that a tool on the spindle or the toolholder is disabled but still needs to be activated. These tools are automatically activated on RESET. On START, machine data MD22562 \$MC_TOOL_CHANGE_ERROR_MODE can be used to specify whether an alarm is to be generated or an automatic bypass strategy selected. If the parameter contains 3 values from 200 to 203, this means that an insufficient number of NC blocks is available for NC block preparation on certain commands (ASUB start, overstore selection, teach-in). Remedy: Increase machine data MD28070 \$MC_MM_NUM_BLOCKS_IN_PREP.
Reaction:	Interpreter stop Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display.

Remedy:	Please inform the authorized personnel/service department. If parameter %3= 0 -3: If the alarm or alarms occur on RESET: Check the settings of machine data MD20110 \$MC_RESET_MODE_MASK, MD20120 \$MC_TOOL_RESET_VALUE, MD20121 \$MC_TOOL_PRESEL_RESET_VALUE, MD20122 \$MC_TOOL_RESET_NAME (only if tool management is active), MD20130 \$MC_CUTTING_EDGE_RESET_VALUE, MD20132 \$MC_SUMCORR_RESET_VALUE, MD20126 \$MC_TOOL_CARRIER_RESET_VALUE, MD20150 \$MC_GCODE_RESET_VALUES, MD20154 \$MC_EXTERN_GCODE_RESET_VALUES, MD20140 \$MC_TRAFO_RESET_VALUE, MD21330 \$MC_COUPLE_RESET_MODE_1, MD24002 \$MC_CHBFRAME_RESET_MASK If parameter %3= 100 - 104: Check the setting of MD20112 \$MC_START_MODE_MASK and the machine data specified under '..._RESET_...'. If tool management is active, if necessary remove the tool stated in the associated alarm from the toolholder/spindle and cancel the 'disabled' status. If parameter %3= 4 or 5: Check macro definitions in _N_DEF_DIR Check cycle directories _N_CST_DIR and _N_CUS_DIR If parameter %3= 6: Alarm 18002 or 18003 was also issued. This alarm contains the number of the incorrectly defined protection area and an identifier of what is incorrect about the protection area. The system variables must be appropriately corrected. If Parameter %3= 200 bis 203: Increase MD28070 \$MC_MM_NUM_BLOCKS_IN_PREP.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14711	[Channel %1:] Transformation selection not possible as axis %2 not available
Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	Based on the configuration of machine data MD20110 \$MC_RESET_MODE_MASK and MD20140 \$MC_TRAFO_RESET_VALUE, a transformation shall be selected by performing a reset or control ramp-up. However, this is not possible as axis %2 required for this is not available. Possible reason: The axis was occupied by another channel or the PLC.
Reaction:	Interface signals are set. Alarm display.
Remedy:	- Use the GET command to get axis %2 in the channel in which the transformation is to be selected. - Select the transformation by means of the part program command.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14712	[Channel %1:] Error selecting JOG Retract: error code %4 info %3
Parameters:	%1 = Channel number %2 = Is not used %3 = Additional information %4 = Error code

Explanation:	An error occurred on the selection of JOG Retract, which is described in more detail by the error code (parameter%4): List of error codes: 1: No retract data available 2: Selection is active during taper turning 3: Error preparing the initialization blocks. The additional info (parameter%3) states the initialization step in which the error occurred. The alarm output immediately before also refers to this initialization step: 100: Error synchronizing the preprocessing/main run 101: Error selecting the tool length compensation 102: Error selecting the transformation 103: Error generating the tool frame 104: Error generating the tapping block 105: Error replacing geometry axes 4: The position of the axis stated in the additional info does not have the status "synchronized" or "restored" 5: The axis stated in the additional info is already assigned in another channel by JOG Retract 6: The geometry axis stated by the selection of JOG Retract does not exist 7: MD 20110 \$MC_RESET_MODE_MASK bit 0 is not set 8: Thread cutting is active. The thread direction cannot be explicitly assigned to a JOG axis
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	The following conditions have to be fulfilled in order to select JOG Retract: - A program execution with active tool offset has been canceled by Reset or PowerOff - PLC signal DB3300.DBX4005.5 (Retract data available) or OPI variable retractState bit 1 is set - JOG mode is active - The channel in which JOG Retract is to be selected is in Reset state - The function "Taper turning" must not be active when JOG Retract is selected - Synchronized or restored axis positions must be present for the axes involved in the transformation - If necessary, activate position restoration for incremental encoders (MD34210 \$MA_ENC_REFP_STATE[]=3) - MD 20110 \$MC_RESET_MODE_MASK bit 0 must be set (default value) In the case of an error, the alarm must be acknowledged with Reset. The selection can then be repeated, observing the above-mentioned conditions.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14750	[Channel %1:] Block %2 too many auxiliary functions programmed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	More than 10 auxiliary functions have been programmed in an NC block.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Check whether all auxiliary functions are necessary in one block - modal functions need not be repeated. Create separate auxiliary function block or divide the auxiliary functions over several blocks.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14751	[Channel %1:] Block %2 resources for motion synchronous actions not sufficient (code: %3)
Parameters:	%1 = Channel number %2 = Block number, label %3 = Identifier

Explanation:	Processing of motion-synchronous actions requires resources that are configured using MD28060 \$MC_MM_IPO_BUFFER_SIZE, MD28070 \$MC_MM_NUM_BLOCKS_IN_PREP, MD28251 \$MC_MM_NUM_SAFE_SYNC_ELEMENTS, MD28250 \$MC_MM_NUM_SYNC_ELEMENTS, and MD28253 \$MC_MM_NUM_SYNC_STRINGS. If these resources are insufficient for the execution of the part program, then this alarm is issued. Parameter %3 shows which resource has run out: Increase identifier <= 2: MD28060 \$MC_MM_IPO_BUFFER_SIZE or MD28070 \$MC_MM_NUM_BLOCKS_IN_PREP. Increase identifier > 2: MD28250 \$MC_MM_NUM_SYNC_ELEMENTS, MD28251 \$MC_MM_NUM_SAFE_SYNC_ELEMENTS. Increase identifier 7: MD28253 \$MC_MM_NUM_SYNC_STRINGS.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct part program or increase resources.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14752 [Channel %1:] Block %2 DELDTG | STOPREOF conflict

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In a group of motion synchronous actions referring to a motion block, both DELDTG (delete distance-to-go) and STOPREOF (preprocessing stop) have been programmed.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	The functions DELDTG and STOPREOF exclude each other in a block.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14753 [Channel %1:] Block %2 motion synchronous action: %3 illegal interpolation type

Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID
Explanation:	The active interpolation type (e.g. 5-axis interpolation) is not allowed for the motion synchronous action or for the function "Several feeds".
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14754 [Channel %1:] Block %2 motion synchronous action: %3 wrong feed type

Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID
Explanation:	The active feed type is not allowed for the motion synchronous action or for the function "Several feeds".

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14756 [Channel %1:] Block %2 motion synchronous action: %3 wrong value

Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID
Explanation:	Assignment: Illegal value. The assignment to a variable or transfer parameter of a procedure or function was found to overshoot or undershoot the value range.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Modify part program. Comply with the value range of the variable or transfer parameter
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14757 [Channel %1:] Block %2 motion synchronous action and wrong type

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Programmed combination between action and type of motion synchronized action is not allowed. - RET allowed in technology cycle only - Function "Several feeds" not allowed in technology cycle - H and M function outputs not allowed with WHENEVER, FROM and DO - MEASA / MEAWA / MEAC not allowed with WHENEVER, FROM and DO - DELDTG and STOPREOF allowed only in block-by-block synchronized action with WHEN and EVERY - PRESETON / PRESETONS may only be used together with WHEN or EVERY
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14758 [Channel %1:] Block %2 programmed value not available

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The synchronous variables \$AA_LOAD, \$AA_TORQUE, \$AA_POWER and \$AA_CURR are activated by the MD36730 \$MA_DRIVE_SIGNAL_TRACKING. The system variable \$VA_IS: Safe actual position is only available if the MD36901 \$MA_SAFE_FUNCTION_ENABLE is set and the option \$ON_NUM_SAFE_AXES is set to a sufficient size.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.

Remedy: Modify program or machine data.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14760 [Channel %1:] Block %2 auxiliary function of a group programmed repeatedly

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The M and H functions can be divided up as required over machine data in groups in any variation. Auxiliary functions are thus put into groups that mutually preclude several individual functions of one group. Within one group only one auxiliary function is advisable and permissible.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Please inform the authorized personnel/service department. Only program one help function per help function group. (For the group division, see the machine manufacturer's programming guide).

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14761 [Channel %1:] Block %2 motion synchronous action: DELDTG function not allowed with active tool radius compensation

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Rapid delete distance-to-go for synchronous actions is not allowed with DELDTG when tool radius compensation is active.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: You have the following possibilities of eliminating the error:
Select the tool radius compensation before performing rapid delete distance-to-go, and then reselect.
As from SW 4.3: "Delete distance-to-go without preparation".

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14762 [Channel %1:] Block %2 too many PLC variables programmed

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The number of programmed PLC variables has exceeded the maximum permissible number.
For each write operation, one element is required for the following writing of PLC variables quickly one after the other.
If several write operations that are available as elements are to be executed, the block transport must be guaranteed (under certain circumstances, initiate preprocessing stop), or if available, increase MD28150 \$MC_MM_NUM_VDIVAR_ELEMENTS.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Modify the part program or where necessary, the machine data.

Programm continuation: Clear alarm with the RESET key. Restart part program

14769	[Channel %1:] Block %2 Spindle %3 Implicit auxiliary function %4 Buffer full
Parameters:	%1 = Channel number %2 = Block number, label %3 = Spindle number %4 = Auxiliary function number
Explanation:	A maximum of 5 auxiliary functions of type "M" may be entered in an NC block. The upper limit is the total of programmed and implicitly generated M auxiliary functions. Implicit auxiliary functions M19 and M70 are generated, if in MD35035 \$MA_SPIND_FUNCTION_MASK, bit 19 has been set for M19 and/or bit 20 for M70. M19 is generated with SPOS and SPOSA depending on the configuration. The same applies to M70 and transition into axis operation. The address extension corresponds to the spindle number like it is output to the PLC.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	- Distribute the M auxiliary functions and spindle functions that implicitly generate M19 and M70 to several blocks. - Deactivate any implicit auxiliary functions that are not required in MD35035 \$MA_SPIND_FUNCTION_MASK, bit 19 and/or bit 20.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14770	[Channel %1:] Block %2 auxiliary function programmed incorrectly
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The permissible number of programmed auxiliary functions per NC block has been exceeded or more than one auxiliary function of the same auxiliary function group has been programmed (M and S function). In the user-defined auxiliary functions, the maximum number of auxiliary functions per group in the NCK system settings has been defined for all auxiliary functions by means of the MD11100 \$MN_AUXFU_MAXNUM_GROUP_ASSIGN (default: 1). For each user-defined auxiliary function to be assigned to a group, the assignment is effected through 4 channel-specific machine data. Return jump from asynchronous subprogram with M02/M17/M30, whereby the M code is not alone in the block. This is impermissible if the asynchronous subprogram interrupts a block with WAITE, WAITM or WAITMC. Remedy: Program M02/M17/M30 alone in the block or replace via RET. 22010 AUXFU_ASSIGN_TYPE: type of auxiliary function, e.g. M 22000 AUXFU_ASSIGN_GROUP: required group 22020 AUXFU_ASSIGN_EXTENSION: any required extension 22030 AUXFU_ASSIGN_VALUE: function value
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct the part program - max. 16 auxiliary functions, max. 5 M functions per NC block, max. 1 auxiliary function per group.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14780	[Channel %1:] Block %2 option '%3<OPTNX>' is not set.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Brief description of option
Explanation:	A non-released option has been used in the block. The stated or an equivalent option is required to execute the action.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.

Remedy: Modify part program, retrofit option.
In this context, please compare the available option data and/or (if available) the license image of your controller.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14781 [Channel %1:] Block %2 motion synchronized action: %3 Option '%4<OPTNX>' is not set

Parameters: %1 = Channel number
%2 = Block number, line number
%3 = Synact ID
%4 = Brief description of option

Explanation: Motion synchronized action: a non-enabled option was used.
The specified or an equivalent option is required to execute the action.

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Change motion synchronized action, retrofit option.
In this context, please compare the available option data and/or (if available) the license image of your control

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14782 [Channel %1:] Block %2 non-active function used (identification %3)

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Fine ID

Explanation: A non-active function is used in the block
Code Short description
1 Transformation
2 Tool H numbers
3 3D protection areas
4 Tool management, multitools
5 COMPSURF and MD28071 \$MC_MM_NUM_SURF_LEVELS=0
6 TOFF (see OD19320 \$ON_TECHNO_FUNCTION_MASK)
In a handling channel, the following functions are not active either:
10 Synchronous actions
11 COMPCAD with MD20482 \$MC_COMPRESSOR_MODE > 99 (Advanced Surface)
12 COMPSURF (Top Surface)
13 AFISON with MD20630 \$MC_AFIS_MODE=0 (automatic filter switching)

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: - Modify part program.
- Activate function.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14783 [Channel %1:] Block %2 coordinate system-specific working area limitation is not active

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: An attempt is made in the block to activate a group of the coordinate system-specific working area limitation.
However, this group is not set up (see MD28600 \$MC_MM_NUM_WORKAREA_CS_GROUPS).

Reaction:	Correction block is reorganized. Interface signals are set. Alarm display. The NC program is stopped. The G code of the group WALCS01 - WALCS10 can be changed.
Remedy:	- Modify part programm. - Activate more coordinate system-specific working area limitations.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14784 [Channel %1:] Block %2 motion synchronous action: %3 function not possible

Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID
Explanation:	It is not possible to execute the function:
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with the RESET key. Restart part program

14785 [Channel %1:] Block %2 Option '%3<OPTNX>' active, function not possible

Parameters:	%1 = Channel number %2 = Block number, line number %3 = Brief description of option
Explanation:	It is not possible to execute the function:
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please notify the authorized personnel/service. - Deactivate option - Change part program
Programm continuation:	Clear alarm with the RESET key. Restart part program

14790 [Channel %1:] Block %2 axis %3 programmed by PLC

Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis
Explanation:	In the NC block, an axis has been programmed that is already being traversed by the PLC.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	- Modify part program, do not use this axis. - Stop traversing motion of the axis by the PLC, modify part program (insert WAITP).
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14800	[Channel %1:] Block %2 programmed path velocity less or equal to zero
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Zero or a negative F or FZ value has been programmed in conjunction with the G functions G93, G94, G95 or G96. The path velocity may be programmed in the range of 0.001 to 999 999.999 [mm/min, mm/rev, mm/tooth, deg/min, deg/rev] for the metric input system and 0.000 1 to 39 999.999 [inch/min, inch/rev, inch/tooth] for the inch input system.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Program the path velocity (geometric sum of the velocity components of the geometry axes involved) within the limits given above.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14810	[Channel %1:] Block %2 negative axis speed programmed for positioning axis %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis
Explanation:	A negative feed (FA value) has been programmed for the displayed axis presently operating as a positioning axis. The positioning velocity may be programmed in the range 0.001 to 999 999.999 [mm/min, deg/min] for the metric input system and 0.000 1 to 39 999.999 9 [inch/min, inch/rev] for the inch input system.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Program the positioning velocity within the limits given above.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14811	[Channel %1:] Block %2 Incorrect value range for programmed dynamic value of axis/spindle %3, error no. %4
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis, spindle %4 = Error no.
Explanation:	A value outside the permissible input range of a programmable dynamic value was used. The following causes of error are possible: 1: The value programmed for the axis velocity with VELOLIM or VELOLIMA lies outside the permissible range. The permissible range for VELOLIM is from 1 to 100 percent and for VELOLIMA from 1 to 200 percent. 2: The value programmed for the axis acceleration with ACC or ACCLIMA lies outside the permissible range from 1 to 200 percent. 3: The value programmed for the axis jerk with JERKLIM or JERKLIMA lies outside the permissible range from 1 to 200 percent.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Adjust the value range in accordance with the Programming Guide.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14812	[Channel %1:] Block %2 Incorrect value range for the programmed dynamic path response, error no. %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Error no.
Explanation:	The permissible input range for a programmable dynamic path response value was not observed. The causes of the error are as follows: 1: The value programmed for path acceleration with PACCLIM lies outside the permitted range. The permitted range for PACCLIM is from 1.0e-6 to 1.0e+38 m/s ² . 2: The value programmed for path speed with FLIM lies outside the permitted range of 1.0e-6 to 1.0e+38.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Adjust the value range in accordance with the Programming Guide.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14815	[Channel %1:] Block %2 negative thread pitch change programmed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A negative thread pitch change has been programmed.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct the value assignment. Ensure that the programmed F value is greater than zero. Zero is allowed, but has no effect.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14820	[Channel %1:] Block %2 negative value for maximum spindle speed programmed with constant cutting speed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	For the function "Constant cutting speed G96" a maximum spindle speed can be programmed with the keyword LIMS=... The values are in the range 0.1 - 999 999.9 [rev/min].
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Program the maximum spindle speed for the constant cutting speed within the limits given above. The keyword LIMS is modal and can either be placed in front of or within the block that selects the constant cutting speed.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14821	[Channel %1:] Block %2 error in selection or deselection of GWPS
Parameters:	%1 = Channel number %2 = Block number, label

Explanation:	On selecting GWPS programming (constant grinding wheel peripheral speed) with GWPSON, one of the following errors occurred: - An attempt has been made to select the GWPS programming for a spindle that has already been assigned to another tool by TMON, GWPSON, CLGON or activation of the tool length compensation. - An attempt has been made to select a tool which has not been defined. - An attempt has been made to select an edge (implicitly) which has not been defined (implicit selection: D1 of a tool, if no tool has been specified.) - Selection does not refer to a grinding-specific tool (400-499). - An attempt has been made to select GWPS for the active tool, although the TLC is not switched on. - Selection refers to an invalid spindle number. - A grinding wheel radius equal to zero has been specified. On deselecting GWPS programming with GWPSOFF, one of the following errors occurred: - Deselection does not refer to a grinding-specific tool (400-499). - An attempt has been made to deselect GWPS for the active tool, although the tool length compensation has not been activated. - Deselection refers to an invalid spindle number.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	- Check GWPSON and GWPSOF command. - Check tool compensation data: \$TC_DP1 : 400 - 499; \$TC_TGP1: Spindle number.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14822	[Channel %1:] Block %2 incorrect programming of GWPS
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	When selecting GWPS (constant grinding wheel peripheral speed) with GWPSON or programming the GWPS with "S[spindle number] = value" one of the following errors has occurred: Invalid spindle number. Invalid parameter number for radius calculation in \$TC_TPG9. The following values are valid: 3 for \$TC_DP3 (length 1) 4 for \$TC_DP4 (length 2) 5 for \$TC_DP5 (length 3) 6 for \$TC_DP6 (radius) Invalid angle in \$TC_TPG8. The following values are valid: -90 <= \$TC_TPG8 < +90. A grinding wheel radius equal to zero was specified.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Check tool compensation data. - \$TC_DP1 : 400 - 499. - \$TC_TGP1: Spindle number. - \$TC_TPG8: Inclination angle for slope grinding wheel. - \$TC_TPG9: Compensation parameters for radius computation, e.g. 3 for \$TC_GP3.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14823	[Channel %1:] Block %2 error on selection or deselection of tool monitoring
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	When selecting tool monitoring with TMON, one of the following errors occurred: - Selection does not refer to a grinding-specific tool (tool types 400-499). - Selection refers to an invalid spindle number. - An attempt has been made to select tool monitoring for a spindle that is already assigned to another tool by TMON, GWPSON, CLGON or activation of tool length compensation. - An attempt has been made to select a tool that has not been defined. - An attempt has been made to select an edge (implicitly) that has not been defined. (Implicit selection: D1 of a tool, if no edge has been specified.) - An attempt has been made to select tool monitoring for the active tool, although no tool length compensation has been activated. - Invalid parameter number for radius calculation in \$TC_TPG9. The following values are valid: 3 for \$TC_DP3 (length 1) 4 for \$TC_DP4 (length 2) 5 for \$TC_DP5 (length 3) 6 for \$TC_DP6 (radius) A grinding wheel radius equal to zero has been specified. On deselecting tool monitoring with TMOF, one of the following errors occurred: - Deselection does not refer to a grinding-specific tool (400-499). - An attempt has been made to deselect tool monitoring for the active tool, although tool length compensation is not active. - Deselection refers to an invalid spindle number.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Check TMON and TMOF command. Check tool compensation data. - \$TC_DP1 : 400 - 499. - \$TC_TPG1: Spindle number. - \$TC_TPG8: Inclination angle for slope grinding wheel. - \$TC_TPG9: Parameter number for radius computation, e.g. 3 for \$TC_GP3.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14824	[Channel %1:] Block %2 conflict with GWPS
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The functions of constant grinding wheel peripheral speed GWPS and constant cutting speed G96 S... have been activated at the same time for a spindle.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
14840	[Channel %1:] Block %2 incorrect value range for constant cutting speed
Parameters:	%1 = Channel number %2 = Block number, label

Explanation:	The programmed cutting speed is not within the input range Input range metric: 0.01 to 9 999.99 [m/min] Input range inch: 0.1 to 99 999.99 [inch/min]
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Program cutting speed under address S within the permissible range of values.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14850 [Channel %1:] Block %2 changing the reference axis for a constant cutting speed not allowed

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The attempt was made via the SCC[AX] instruction to change the reference axis for a constant cutting speed. This is not allowed if the indicated axis is no geometry axis.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Please inform authorized personnel/service. When programming SCC[AX] indicate a geometry axis known in the channel.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14860 [Channel %1:] Block %2 Selection of the tool cutting speed not allowed. Cause %3

Parameters:	%1 = Channel number %2 = Block number, label %3 = Cause of the error
Explanation:	Selection of the cutting speed SVC is not permissible in the current state Causes of the problem: the following function is active. 1: Constant cutting speed G96, G961 or G962 active 2: SPOS/SPOSA/M19 (spindle positioning mode) active 3: M70/axis mode active 4: SUG active
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	Activate the speed control mode for the spindle prior to programming SVC, for example with M3, M4 or M5.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

14861 [Channel %1:] Block %2 SVC programmed, but no tool offset active

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Cutting speed SVC programmed in the block, but no tool offset active.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display.

Remedy: Select an appropriate tool prior to the SVC instruction.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14862 **[Channel %1:] Block %2 SVC has been programmed, but the radius of the active tool correction is zero**

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: A cutting speed SVC has been programmed in the block, but the radius of the active tool offset is zero.
 The radius of the active tool offset consists of the offset parameters \$TC_DP6, \$TC_DP12, \$TC_SCPx6 and \$TC_ECPx6.

Reaction: Correction block is reorganized.
 Local alarm reaction.
 Interface signals are set.
 Alarm display.

Remedy: Select an appropriate tool offset with a positive tool radius prior to the SVC instruction.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14863 **[Channel %1:] Block %2 The programmed SVC value is zero or negative**

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The programmed value for the cutting speed SVC is zero or negative.

Reaction: Correction block is reorganized.
 Local alarm reaction.
 Interface signals are set.
 Alarm display.

Remedy: Program an SVC value larger than zero.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14900 **[Channel %1:] Block %2 center point and end point programmed simultaneously**

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: When programming a circle by means of the opening angle, the circle center point was programmed together with the circle end point. This is too much information for the circle. Only one of the two points is allowed.

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: Select the programming variant guaranteeing that the dimensions are definitely taken over from the workpiece drawing (avoidance of calculation errors).
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14910 **[Channel %1:] Block %2 invalid angle of aperture for programmed circle**

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: When programming a circle by means of the opening angle, a negative opening angle or an opening angle greater than or equal to 360 degrees has been programmed.

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: Program opening angle within the allowed range of values between 0.0001 and 359.9999 [degrees].
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

14920 [Channel %1:] Block %2 intermediate point of circle incorrect

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: When programming a circle by means of an intermediate point (CIP) all 3 points (initial, end and intermediate points) are on a straight line and the intermediate point (programmed by means of interpolation parameters I, J, K) is not located between the initial and end points.
If the circle is the component of a helix, the specified number of turns (keyword TURN=...) determines further block processing:
- TURN>0: alarm display because the circle radius is infinitely great.
- TURN=0 and CIP specified between initial and end points. A straight line is generated between the initial and end points (without alarm message).

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Locate the position of the intermediate point with the parameters I, J and K in such a way that it actually is located between the initial and end points of the circle or do not make use of this type of circle programming and instead program the circle with radius or opening angle or center point parameters.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

15000 [Channel %1:] Block %2 channel-sync command using illegal marker

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: A WAITM/WAITMC/SETM/CLEARM instruction was programmed with a marker number of less than 1 or greater than the maximum number of markers.
Exception: CLEARM(0) is allowed and clears all markers in the channel!

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Correct the instruction accordingly.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

15010 [Channel %1:] Block %2 program coordination instruction with invalid channel number

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: A WAITM, WAITMC, INIT or START instruction was programmed with an invalid channel number.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Correct the instruction accordingly.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

15020 [Channel %1:] block %2 CHANDATA instruction cannot be executed. Channel %3 is not active

Parameters: %1 = Channel number
%2 = Block number, label
%3 = String (CHANDATA parameter)

Explanation:	With a CHANDATA instruction, the data input for a channel is selected that has not been activated. For structural reasons, the input of multi-channel data must take place twice.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. - Activate the channel concerned by means of machine data or option data or - Delete the CHANDATA instruction and all following assignments to channel data. This error message occurs regularly when first reading in an INITIAL Init block with which a multi-channel system is to be installed. In this case: 1. NCK Restart must be executed in order to activate the global machine data already input for the installation of the other channels. 2. Input of the INITIAL Init block must be repeated.
Programm continuation:	Switch control OFF - ON.

15021	[Channel %1:] Block %2 CHANDATA instruction with invalid channel number
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A CHANDATA instruction is used to enter data for an illegal channel, e. g. <1,> maximum number of channels, not the active channel.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Program CHANDATA instruction in accordance with the actual configuration.
Programm continuation:	Clear alarm with the RESET key. Restart part program

15025	CHANDATA(%3): channel is not active. Channel data will be ignored.
Parameters:	%1 = Channel number %2 = Block number, label %3 = CHANDATA parameter
Explanation:	With a CHANDATA instruction, the data input for a channel is selected that has not been activated.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	This is an informational alarm referring to the fact that the file loaded into the NCK contains data of an inactive channel. The number of the inactive channel is specified. Subsequently, the data of this channel are not available in the NCK. The alarm may have two causes: (1) The channel is supposed to be activated by a following NCK RESET/POWER ON, i.e. the file must subsequently be reloaded. If the alarm occurs again, the reason is: (2) the specified channel is actually not supposed to be activated, however, the file contains the relevant data. For the 2nd reason, please check whether the system has correctly not activated the channel mentioned. If the channel has been activated, operation may be continued after another NCK RESET/POWER ON without further measures, i.e. reloading the file is not required. If the channel has not been activated, make sure that the channel inactivated by mistake is re-activated. If the settings of the channel activation are part of the file to be loaded (e.g. archive file), the file must either be modified with the relevant program or the file has to be created once more in the same system with the correct channel number. Similar alarms: 15020, 15021.
Programm continuation:	Switch control OFF - ON.

15030	[Channel %1:] Block %2 different measurement system settings
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The INCH or METRIC instruction describes the system of measurement in which the data sets have been read from the control. In order to prevent the incorrect interpretation of data intended for a particular system of measurement, a data block is only accepted if the above instruction matches the active system of measurement.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Change the measuring system or load a data block that matches the measuring system setting.
Programm continuation:	Clear alarm with the RESET key. Restart part program
15100	[Channel %1:] Block %2 REORG cancelation caused by log file overflow
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In order to synchronize the preprocessing run and the main run with REORG, the control accesses modification data which are maintained in a logfile. The alarm indicates that no more capacity is available in the logfile for the specified block in the channel.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. No remedial measures are available for the further execution of the current part program, however: 1. Reduce log file size requirement by: Reducing the distance between the preprocessing and the main run via appropriate preprocessing stops STOPRE. 2. Increase the size of the logfile by means of the channel-specific machine data: MD28000 \$MC_MM_REORG_LOG_FILE_MEM and MD 28010 \$MC_MM_NUM_REORG_LUD_MODULES
Programm continuation:	Clear alarm with the RESET key. Restart part program
15110	[Channel %1:] Block %2 REORG not possible
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In order to synchronize the preprocessing run and the main run with REORG, the control accesses modification data which are maintained in a logfile. The alarm indicates that no more capacity is available in the logfile for the specified block in the channel. The alarm message means that the logfile has been deleted in order to obtain additional memory for program reorganization. Consequently, it is no longer possible to REORG the preprocessing memory up to the next coincidence point.
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. No remedial measures are available for the further execution of the current part program, however: 1. Reduce log file size requirement by: Reducing the distance between the preprocessing and the main run via appropriate preprocessing stops (STOPRE). 2. Increase the size of the logfile by means of the channel-specific machine data: Modify MD28000 \$MC_MM_REORG_LOG_FILE_MEM and Modify MD MD28010 \$MC_MM_NUM_REORG_LUD_MODULES
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

15120	If a power failure occurs now, the most recently changed data will be lost (index/buffer size = %1)
Parameters:	%1 = Index/buffer size
Explanation:	Notification alarm. The alarm has no negative impact on the current machining. One of the system-internal data buffers, in which the last changed, buffered data are stored, has overflowed because the current data change rate is too high. The alarm warns that a spontaneous power failure in this situation (mains fault, disconnect the system from the power supply) would cause a loss of the immediately previously changed buffered data (tool data, part programs, R variables, GUDs,...) For information, parameter %1 specifies the index of the machine data, and the buffer size set there.
Reaction:	Alarm display.
Remedy:	If the alarm is present only sporadically, it can simply be regarded as a notification. The regular control behavior is not affected. If the cause should not or cannot be eliminated, the alarm can be suppressed by setting MD11415 \$MN_SUPPRESS_ALARM_MASK_2; Bit3=1 ('H8'). If the alarm is permanently present, please inform the authorized personnel/service department. If the system is used in an environment in which a power failure cannot occur, this alarm output can be prevented by MD18232 \$MN_MM_ACTFILESYS_LOG_FILE_MEM[index] = 0. The value of MD18232 \$MN_MM_ACTFILESYS_LOG_FILE_MEM[index] may be increased. If this is not an option, the number of data changing per unit time must be reduced.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.
15122	Power ON after power failure: %1 data were restored, of which %2 machine data, %3 errors.
Parameters:	%1 = Number of data %2 = Number of machine data %3 = Number of errors occurred
Explanation:	Notification alarm. The alarm has no negative effect as long as %3 the number of errors occurred is zero. %1 indicates the number of elementary and complex data restoring steps which were taken after a power OFF during power ON orduring a power failure to restore the persistent NCK data. %2 indicates the number of restored machine data. If the value is larger than zero, another warm restart (NCK reset) may be necessary to make the - possibly configuring - machine data changes prior to the power failure effective. %3 indicates the number of errors occurred during data restoring.
Reaction:	Alarm display.
Remedy:	As long as %3 number of errors occurred is zero, the alarm is only informative. As long as %3 number of errors occurred is larger than zero, the alarm indicates a software error. Further machining with the data is not recommended. Please load a suitable archive file before continuing machining to avoid subsequent problems. Please inform the authorized personnel/service department. File /_N_MPF_DIR/_N_SIEMDIAGMEMPF_MPF contains information that may help Siemens for error diagnostics.
Programm continuation:	Clear alarm with the RESET key. Restart part program
15150	[Channel %1:] Block %2 reload from external canceled
Parameters:	%1 = Channel number %2 = Block number, label

Explanation:	Execution from external was canceled because the reload buffer does not have enough machine function blocks (traversing blocks, auxiliary function, dwell time etc.). Background: When already executed machine function blocks are released, memory becomes available in the reload buffer. If machine function blocks are no longer released, nothing can be reloaded - this results in a deadlock situation. Examples: - Definition of extremely long curve tables via execution from external. - REPEAT command: REPEAT loop does not lie completely within the reload buffer.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Insert machine function blocks into the part program. - Increase the size of the reload buffer (MD18360 \$MN_MM_EXT_PROG_BUFFER_SIZE). - Decrease the size of the curve table (Note: Blocks within CTABDEF/CTABEND are not machine function blocks). - REPEAT command: Replace REPEAT loop by EXTCALL call. - Surface Turning: If alarm 15150 occurs with the function "Surface Turning" when using program sections, reduce the number of blocks commented out in programs generated with SFT.
Programm continuation:	Clear alarm with the RESET key. Restart part program

15160	[Channel %1:] Block %2 wrong preprocessing configuration, number of blocks %3, function ID %4
Parameters:	%1 = Channel number %2 = Block number, label %3 = Number of missing blocks for block preparation %4 = ID of the function that identified the problem
Explanation:	For the block preparation, the number of blocks specified in parameter %3 is also required. Using parameter %4, for additional error diagnostics, the area in which the problem occurred can be identified based on the following list: 100 - 199: Interpreter 200 - 299: Tool radius compensation 300 - 399: Compile cycle 400 - 499: LookAhead 500 - 599: Spindle 600 - 699: Repositioning 700 - 999: Contour preparation 1000 - 1099: Nibbling 1100 - 1499: Tool orientation 1500 - 1599: Soft approach/retraction
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Increase the block search configuration MD28070 \$MC_MM_NUM_BLOCKS_IN_PREP by the number of blocks specified in parameter %3.
Programm continuation:	Clear alarm with the RESET key. Restart part program

15165	[Channel %1:] Block %2 error when translating or interpreting ASUB %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = String

Explanation:	At part program start and at start of an ASUB under Reset condition, the relevant data of all the ASUBs that can be activated at that time are processed: - PLC ASUBs - With MD20108 \$MC_PROG_EVENT_MASK configured event-controlled program calls - ASUB after block search (MD11450 \$MN_SEARCH_RUN_MODE bit 1=1) - Editable system ASUB (MD11610 \$MN_ASUP_EDITABLE) If an error occurs (converter or interpreter), alarm 15165 will be output first and then a converter or interpreter alarm that describes more details of the error. Alarm 15165 will cause an interpreter stop. A compensation block will not be possible.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Correct the part program.
Programm continuation:	Clear alarm with the RESET key. Restart part program

15166	[Channel %1:] User system asub _N_ASUP_SPF not available
Parameters:	%1 = Channel number
Explanation:	By means of the MD11610 \$MN_ASUP_EDITABLE the function "User-defined system ASUB" has been activated. However, the relevant user program could not be found in the specified search path: - 1. /_N_CUS_DIR/_N_ASUP_SPF - 2. /_N_CMA_DIR/_N_ASUP_SPF The default system ASUB is used.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Load the user-defined system ASUB in /_N_CUS_DIR/_N_ASUP_SPF or /_N_CMA_DIR/_N_ASUP_SPF laden.
Programm continuation:	Clear alarm with the RESET key. Restart part program

15170	[Channel %1:] Block %2 program %3 could not be compiled
Parameters:	%1 = Channel number %2 = Block number, label %3 = String
Explanation:	An error has occurred in compile mode. The (compiler) error message refers to the program specified here.
Reaction:	Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with the Delete key or NC START.

15171	[Channel %1:] Block %2 compiled program %3 older than the relevant subroutine
Parameters:	%1 = Channel number %2 = Block number, label %3 = Compiled program file name
Explanation:	When calling a precompiled subroutine, it was noticed that the compiled program is older than the relevant SPF file. The compiled program was deleted and during start the subroutine is executed instead of the compiled program.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Perform another precompilation.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

15172 [Channel %1:] Block %2 subroutine %3. No interface available at time of preprocessing.

Parameters:	%1 = Channel number %2 = Block number, label %3 = Subroutine name
Explanation:	In compilation mode no program interface of the subroutine to be called was available at the time of pre-compilation.
Reaction:	Interpreter stop Interface signals are set. Alarm display.
Remedy:	Modify part program or recreate program interfaces and pre-compile programs again.
Programm continuation:	Clear alarm with the RESET key. Restart part program

15173 [Channel %1:] Block %2 variable %3 was unknown at the time of preprocessing.

Parameters:	%1 = Channel number %2 = Block number, label %3 = Variable
Explanation:	At the time of program precompilation, variable %3 was not known to the control.
Reaction:	Interpreter stop Interface signals are set. Alarm display.
Remedy:	Correct the part program or introduce the variable at the time of precompilation, i.e. activate the new GUD variable prior to precompilation. Then restart precompilation.
Programm continuation:	Clear alarm with the RESET key. Restart part program

15175 [Channel %1:] Block %2 program %3. Interfaces could not be built

Parameters:	%1 = Channel number %2 = Block number, label %3 = String
Explanation:	An error has occurred in interface generation mode. The (compiler) error message refers to the program specified here. In particular when loading new cycle program on the NCK, problems can occur if the value settings in MD18170 \$MN_MM_NUM_MAX_FUNC_NAMES and MD18180 \$MN_MM_NUM_MAX_FUNC_PARAM are too small.
Reaction:	Alarm display.
Remedy:	- Modify part program. - If new cycle programs have been loaded on the NCK, you will normally need to increase the values of MD18170 \$MN_MM_NUM_MAX_FUNC_NAMES and MD18180 \$MN_MM_NUM_MAX_FUNC_PARAM. See also the explanations for alarm 6010.
Programm continuation:	Clear alarm with the Delete key or NC START.

15176 [Channel %1:] Block %2 Program%3 may only be executed after Power ON

Parameters:	%1 = Channel number %2 = Block number, label %3 = File name
Explanation:	If an encrypted program is loaded to the NCK, an NCK reset (restart) must be performed afterwards, because internal data for efficient processing of the encrypted program are preprocessed during NCK power-up. On calling an encrypted NC program it has now been detected that these data do not exist or are obsolete compared to the current version of the encrypted NC program.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.

Remedy: Perform an NCK reset (restart).
Programm continuation: Clear alarm with the RESET key. Restart part program

15177 [Channel %1:] Block %2 Error on preprocessing of program %3, error code: %4

Parameters: %1 = Channel number
 %2 = Block number, label
 %3 = File name
 %4 = Error code

Explanation: If an encrypted program is loaded to the NCK, an NCK reset (restart) must be performed afterwards, because internal data for efficient processing of the encrypted program are preprocessed during NCK power-up. The following problem has occurred:
 Error code 1: Error on read-in of program %4
 Error code 2: There is not enough DRAM memory available for storing the preprocessed data.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Error code 1: Encrypt and load program %4 again. Then perform an NCK reset (restart).
 Error code 2: Where possible, increase \$MN_MM_T_FILE_MEM_SIZE.
 Otherwise increase \$MN_MM_DRAM_FILE_MEM_SIZE.
 Then perform an NCK reset (restart).

Programm continuation: Clear alarm with the RESET key. Restart part program

15180 [Channel %1:] Block %2: Error on editing program %3 as INI/DEF file.

Parameters: %1 = Channel number
 %2 = Block number, label
 %3 = String

Explanation: Errors were found when processing an initialization program (INI file), or a GUD or macro definition file (DEF file).
 The error message which is then displayed refers to the program specified here.

Reaction: Alarm display.

Remedy: Correct the initialization program (INI file), or the GUD or macro definition file (DEF file).
 In connection with Alarm 12380 or 12460, also change the memory configuration.

Programm continuation: Clear alarm with the Delete key or NC START.

15182 [channel %1:] cycle alarm from the modified SIEMENS cycle %3

Parameters: %1 = Channel number
 %2 = Is not used
 %3 = Path and file name of the modified SIEMENS cycle

Explanation: When executing a SIEMENS cycle modified by the user, a cycle alarm was output with SETAL() (see follow-up alarm in the alarm output).
 Since the SIEMENS cycle was modified by the user (e.g. machine manufacturer), the cause for the cycle alarm must be determined / eliminated by the user who modified the cycle.

Reaction: Interface signals are set.
 Alarm display.

Remedy: The error cause leading to the cycle alarm cannot be investigated by SIEMENS since the know-how of the modified cycle sequence is with those who are responsible for the cycle change.

Programm continuation: Clear alarm with the Delete key or NC START.

15185 [Channel %1:] %2 errors in INI file

Parameters: %1 = Channel number
%2 = Number of detected errors

Explanation: Errors were found when processing initialization program _N_INITIAL_INI.
This alarm will also be output, if errors are found during editing of _N_INITIAL_INI in the GUD definition files or if errors are found on ramp-up in the macro definition files.

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Inform the authorized personnel/service department.
Correct the INI or DEF file, or correct the MD and create a new INI file via 'Upload'.

Programm continuation: Switch control OFF - ON.

15186 [Channel %1:] %2 errors in GUD, macro or INI file

Parameters: %1 = Channel number
%2 = Number of detected errors

Explanation: %2 errors were found when processing GUD/macro definition files (DEF files) or initialization files (INI files)
Alarm 15180 has already informed about the corresponding file.
Prior to that the errors shown were reported by error-specific alarms, e.g. 12080 "syntax error".

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Modify definition file or initialization file

Programm continuation: Clear alarm with the RESET key. Restart part program

15187 [Channel %1:] Error during execution of PROGEVENT file %3.

Parameters: %1 = Channel number
%2 = Is not used
%3 = PROGEVENT file name

Explanation: An error has occurred on executing PROGEVENT.
With alarm 15187, the name of the program that was started as PROGEVENT is displayed. Alarm 15187 is displayed together with the alarm that describes the error cause. Alarm 15187 is also output when the alarm occurs in a subroutine started from PROGEVENT.

Reaction: Interface signals are set.
Alarm display.

Remedy: Correct the PROGEVENT file (subroutine).

Programm continuation: Clear alarm with the Delete key or NC START.

15188 [Channel %1:] Error during execution of ASUB file %3.

Parameters: %1 = Channel number
%2 = Is not used
%3 = ASUB file name

Explanation: An error has occurred on executing an ASUB.
Alarm 15188 displays the name of the program that was started as ASUB. Alarm 15188 is output together with the alarm that describes the error cause. Alarm 15188 is also output when the alarm occurs in a subroutine started from the ASUB.

Reaction: Interface signals are set.
Alarm display.

Remedy: Correct the ASUB file (subroutine).

Programm continuation: Clear alarm with the Delete key or NC START.

15190 [Channel %1:] Block %2 not enough free memory for subroutine call

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The following deadlock has been found in the interpreter: Memory is needed for calling a subroutine. The module memory is, however, empty and there is no prospect of module memory becoming free again by executing the preprocessing/main run queue, because this queue is empty.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Please inform the authorized personnel/service department. Increase machine data MD28010 \$MC_MM_NUM_REORG_LUD_MODULES / MD28040 \$MC_MM_LUD_VALUES_MEM / MD18210 \$MN_MM_USER_MEM_DYNAMIC or program a preprocessing stop STOPRE before calling the subroutine.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

15300 [Channel %1:] Block %2 invalid number-of-passed-blocks during block search

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: In the function "Block search with calculation" a negative number of passes has been entered in column P (number of passes). The permissible range of values is P 1 - P 9 999.

Reaction: Alarm display.

Remedy: Enter only positive number of passes within the range of values.

Programm continuation: Clear alarm with the Delete key or NC START.

15320 [Channel %1:] Block %2 invalid block search command

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The block search command (type of search target) is smaller than 1 or greater than 5. It is entered in column type of the block search window. The following block search orders are allowed.

Type	Meaning
1	Search for block number
2	Search for label
3	Search for string
4	Search for program name
5	Search for line number in a file

Reaction: Alarm display.

Remedy: Modify the block search command.

Programm continuation: Clear alarm with the Delete key or NC START.

15330 [Channel %1:] Block %2 invalid block number as search target

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Syntax error! Positive integers are allowed as block numbers. Block numbers must be preceded by ":" and subblocks by an "N".

Reaction: Alarm display.

Remedy: Repeat the input with corrected block number.

Programm continuation: Clear alarm with the Delete key or NC START.

15340 [Channel %1:] Block %2 invalid label as search target

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Syntax error! A label must have at least 2 but no more than 32 characters, and the first two characters must be alphabetic or underscore characters. Labels must be concluded with a colon.

Reaction: Alarm display.

Remedy: Repeat the input with corrected label.

Programm continuation: Clear alarm with the Delete key or NC START.

15350 [Channel %1:] Block %2 search target not found

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The specified program has been searched to the end of the program without the selected search target having been found.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check the part program, change the search target (typing error in the part program) and restart the search.

Programm continuation: Clear alarm with the RESET key. Restart part program

15370 [Channel %1:] Target of block search not found

Parameters: %1 = Channel number

Explanation: In a block search, an impermissible search target has been specified (e.g. negative block number).

Reaction: Alarm display.

Remedy: Check the specified block number, label or character string. Repeat entry with correct search target.

Programm continuation: Clear alarm with the Delete key or NC START.

15380 [Channel %1:] Block %2 illegal incremental programming in axis %3

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis

Explanation: The first axis programming after block search to block end point is performed incrementally. This is not allowed in the following situations:

- A transformation change took place after the search target.
- A frame with rotation component is active. The programmed axis is involved in the rotation.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Find a search target in which the axes are programmed using an absolute reference. Deactivate the addition of the accumulated search position with SD42444 \$SC_TARGET_BLOCK_INCR_PROG = FALSE. Use block search run with calculation at the contour.
Programm continuation:	Clear alarm with the RESET key. Restart part program

15390	[Channel %1:] Block %2 %3 not executed during block search
Parameters:	%1 = Channel number %2 = Block number, label %3 = Source symbol
Explanation:	During block search, commands for switching, deleting and defining of the electronic gear are not executed and not gathered but simply skipped.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Set the desired gear status using the ASUB.
Programm continuation:	Clear alarm with the Delete key or NC START.

15395	[Channel %1:] Master-slave not executable during block search
Parameters:	%1 = Channel number
Explanation:	A master-slave coupling is to be closed in the part program via the instruction MASLON. The position offset \$P_SEARCH_MASLD, however, cannot be correctly calculated during block search, as the axes to be coupled are located in different channels.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Make sure that all relevant axes are in the same channel.
Programm continuation:	Clear alarm with the RESET key. Restart part program

15400	[Channel %1:] Block %2 selected initial INIT block does not exist
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The operator has selected an INI block for a read, write or execution function which: 1. Does not exist in the NCK range or 2. Does not have the necessary protection level required for performing the function.
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. Check whether the selected INI block is contained in the file system of the NCK. The present protection level must be selected to be at least equal to (or greater than) the protection level that has been defined for the read, write or execution function at the time of creating the file.
Programm continuation:	Clear alarm with the RESET key. Restart part program

15410	[Channel %1:] Block %2 initialization file contains invalid M function
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The only M function allowed in an Init block is the M02, M17 or M30 end-of-program function.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Remove all M functions from the Init block except for the end identifier. An Init block may contain value assignments only (and global data definitions if they are not defined again in a program that can be executed later) but no motion or synchronous actions.
Programm continuation:	Clear alarm with the RESET key. Restart part program
15420	[Channel %1:] Block %2 instruction in current mode not allowed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The alarm is output in the following situations: - The interpreter has detected an illegal instruction (e.g. a motion command) while processing an INI file or a definition file (macro or GUD). - In a GUD file, the access security for a machine data item is to be changed with REDEF, although an ACCESS file (_N_SACCESS_DEF, _N_MACCESS_DEF, _N_UACCESS_DEF) is available. Access rights for machine data can then only be changed via one of the ACCESS files with REDEF. - When processing the safety initialization program /_N_CST_DIR/_N_SAFE_SPF an illegal instruction was detected due to the reduced language scope configured.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	- Correct the INI, GUD or macro file. - Correct part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
15450	[Channel %1:] Block %2 compiled program cannot be stored
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In the compile mode, a compiled program could not be stored. One of the following reasons applies: - Not enough memory - Intermediate code line (compile) too large
Reaction:	Alarm display.
Remedy:	Create space in work memory or modify part program (make it less complex).
Programm continuation:	Clear alarm with the Delete key or NC START.
15460	[Channel %1:] Block %2 syntax error when locking
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The addresses programmed in the block are not compatible with the modal syntax-determining G function. Example: N100 G01 ... I .. J.. K.. LF

Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct the displayed block and ensure that the G functions and addresses in the block are in agreement.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

15500 [Channel %1:] Block %2 illegal angle of shear

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The function CSHEAR has been called with an illegal (impossible) angle of shear, e.g. when the sum of angles between the axis vectors is greater than 360 degrees.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Program the angle of shear in accordance with the geometrical conditions of the machine and workpiece system.
Programm continuation:	Clear alarm with the RESET key. Restart part program

15700 [Channel %1:] Block %2 illegal cycle alarm number %3

Parameters:	%1 = Channel number %2 = Block number, label %3 = Cycle alarm number
Explanation:	A SETAL command has been programmed with a cycle alarm number smaller than 60 000 or greater than 69 999.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Program alarm number in the SETAL instruction in the correct range.
Programm continuation:	Clear alarm with the RESET key. Restart part program

15701 [Channel %1:] Block %2 motion synchronous action: %3 illegal cycle alarm number %4

Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID %4 = Cycle alarm number
Explanation:	A SETAL command has been programmed with a cycle alarm number smaller than 60 000 or greater than 69 999.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Program alarm number in the SETAL instruction in the correct range.
Programm continuation:	Clear alarm with the RESET key. Restart part program

15800 [Channel %1:] Block %2 wrong starting conditions for CONTPRON/CONTDCON

Parameters:	%1 = Channel number %2 = Block number, label
--------------------	---

Explanation: There is an error in the start conditions for CONTPRON/CONDCON:

- G40 not active
- SPLINE or POLY active
- Unknown machining type programmed
- Transferred machining direction not defined
- Definition of LUDs in incorrect subroutine level
- Transferred circle coordinates

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Modify part program.

Programm continuation: Clear alarm with the RESET key. Restart part program

15810 [Channel %1:] Block %2 wrong array dimension for CONTPRON/CONTDCON

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The number of columns for the array created for CONTPRON/CONTDCON does not conform to the current programming guide.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Modify part program.

Programm continuation: Clear alarm with the RESET key. Restart part program

15900 [Channel %1:] Block %2 touch probe not allowed

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Measure with deletion of distance-to-go
In the part program, an illegal probe has been programmed with the command MEAS (measure with deletion of distance-to-go). The probe numbers

0 ... no probe

1 ... probe 1

2 ... probe 2

are allowed, whether the probe is actually connected or not.

Example:

N10 MEAS=2 G01 X100 Y200 Z300 F1000

Probe 2 with deletion of distance-to-go

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Include a probe number within the limits given above in the keyword MEAS=... This must correspond to the hardware connection of the probe.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

15950	[Channel %1:] Block %2 no traverse motion programmed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Measure with deletion of distance-to-go In the part program, no axis or a traversing path of zero has been programmed with the command MEAS (measure with deletion of distance-to-go).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct the part program and add the axis address or the traversing path to the measurements block.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
15960	[Channel %1:] Block %2 no traverse motion programmed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Measure without deletion of distance-to-go In the part program, no axis or a traversing path of zero has been programmed with the command MEAW (measure without deletion of distance-to-go).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct the part program and add the axis address or the traversing path to the measurements block.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
16000	[Channel %1:] Block %2 invalid value for lifting direction
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	During the "rapid lift from contour" (keyword: LIFTFAST), a code value for the lifting direction (keyword: ALF=...) which lies outside the permissible range (permissible value range: 0 to 8) was programmed. With active cutter radius compensation: Code numbers 2, 3 and 4 cannot be used in G41 Code numbers 6, 7 and 8 cannot be used in G42 because they code the direction to the contour.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Program the lifting direction under ALF=... within the permissible limits.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
16005	[Channel %1:] Block %2 invalid value for lifting distance
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Mistake in programming: the value for the lifting path must not be negative.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify the part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16010	[Channel %1:] Block %2 machining stop after lift fast
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	LIFTFAST without interrupt routine (ASUB) has been programmed. The channel is stopped after the lift motion has been carried out.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	After the channel stop, you must retract the axes manually in JOG and cancel the program with Reset.
Programm continuation:	Clear alarm with the RESET key. Restart part program
16015	[Channel %1:] Block %2 wrong axis identifier %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name
Explanation:	Axis names from different coordinate systems were used to program axes for LIFTFAST. The retraction movement is no longer clear.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Use axis identifiers of a coordinate system.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
16016	[Channel %1:] Block %2 no retraction position programmed for axis %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name
Explanation:	The retraction enable was programmed for LIFTFAST without defining a retraction position for the axis. The retraction movement is no longer clear.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Program a retraction position for the relevant axis.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
16017	[Channel %1:] Axis %2 Identifier %3, LIFTFAST ignores this axis, current axis not capable of retraction
Parameters:	%1 = Channel %2 = Axis, spindle %3 = Identifier

Explanation:	LIFTFAST cannot be applied to the axis. Alarm can be suppressed via MD11415 \$MN_SUPPRESS_ALARM_MASK_2 bit 11. Identifier (parameter 3) is bit-coded and displays some possible causes for the alarm: 0x01 Axis is in another channel 0x02 Axis is in spindle mode (e.g. SPOS) 0x04 Axis is PLC axis 0x08 Axis is oscillating axis 0x10 Axis is neutral axis 0x20 Axis is coupled slave axis 0x40 Axis is in static synchronized action Overview of reactions of common programming to LIFTFAST: Axis Synact Reaction to LIFTFAST ----- Path STOP + LIFTFAST POS STOP + LIFTFAST POS non-modal STOP + LIFTFAST POS modal STOP + LIFTFAST POS stati. RUN + SHOWALARM 16017 POSA STOP + LIFTFAST MOV non-modal STOP + LIFTFAST MOV modal STOP + LIFTFAST MOV stati. RUN + SHOWALARM 16017 PLC RUN + SHOWALARM 16017 Oscill. RUN + SHOWALARM 16017 SPOS STOP + SHOWALARM 16017 SPOS non-modal STOP + SHOWALARM 16017 SPOS modal STOP + SHOWALARM 16017 SPOS stati. RUN + SHOWALARM 16017 SPOSA STOP + SHOWALARM 16017
Reaction:	Alarm display.
Remedy:	Remove axis from POLFMLIN or POLFMASK. Alarm can be suppressed via MD11415 \$MN_SUPPRESS_ALARM_MASK_2 bit 11. At the time of LIFTFAST, an axis for LIFTFAST is programmed, but the status of the axis does not allow LIFTFAST (e.g. oscillating axis or spindle), or the axis is not in the channel. LIFTFAST should only be applied to those axes that are capable of retracting at that time; POLFMASK or POLFMLIN should be adapted accordingly.
Programm continuation:	Clear alarm with the Delete key or NC START.

16020	[Channel %1:] Repositioning in block %2 is not possible
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Programming or operator action incorrect: Repositioning via REPOS command is only possible in an asynchronous subprogram (interrupt routine). If the REPOS command was programmed, e.g. in the main program or in a cycle, part program execution is cancelled with alarm 16020. In addition, the alarm is output in the following situations: - Access to \$AC_RETPPOINT (repositioning point) outside an ASUB (e.g. in the main program) - An axis to be repositioned was an oscillating axis with synchronous infeed (OSCILL) in the interrupted block and is now in a state that does not allow it to be traversed as a oscillating axis. Remedy: Change the axis to "neutral axis" state before repositioning with WAITP. - An axis to be repositioned was an infeed axis for an oscillating axis in the interrupted block; now it can no longer be traversed as one. Remedy: Change the axis back to "POS axis" state before repositioning. - Thread cutting (G33, G34, G35, G335, G336) was active in the interrupted block.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Modify the part program if necessary.
Programm continuation:	Clear alarm with the RESET key. Restart part program

16025 [Channel %1:] Block %2 impermissible axis exchange in REPOS command by axis %3.

Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis identifier
Explanation:	With the REPOS command, an axis or spindle was programmed that was in the NEUTRAL state at that time. As the REPOS command cannot execute any implicit GET, these axes/spindles cannot be repositioned. Part program editing is therefore canceled.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Assign the axes/spindles that are to be repositioned to the channel via GET command prior to the REPOS command. Example: GET(A) ; assign the A axis to the channel REPOS L A ; reposition the geometry axes and A axis
Programm continuation:	Clear alarm with the RESET key. Restart part program

16100 [Channel %1:] Block %2 spindle %3 not available in the channel

Parameters:	%1 = Channel number %2 = Block number, label %3 = String
Explanation:	Incorrect programming: This channel does not recognize the spindle number. The alarm can occur together with a dwell or a spindle function.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Check the part program to determine whether the programmed spindle number is correct and whether the program is run in the correct channel. Check MD35000 \$MA_SPIND_ASSIGN_TO_MACHAX for all machine axes to see whether one of them contains the programmed spindle number. This machine axis number must be entered in a channel axis of the machine data MD20070 \$MC_AXCONF_MACHAX_USED.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16105 [Channel %1:] Block %2 spindle %3 cannot be assigned

Parameters:	%1 = Channel number %2 = Block number, label %3 = String
Explanation:	Mistake in programming: The programmed spindle is not assigned a real spindle by the spindle number converter. The alarm can be issued after improper use of SD42800 \$SC_SPIND_ASSIGN_TAB[.]

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Correct the setting data or modify the part program.
Programm continuation:	Clear alarm with the RESET key. Restart part program

16111 [Channel %1:] Block %2 spindle %3 No speed programmed

Parameters:	%1 = Channel number %2 = Block number, label %3 = Spindle
Explanation:	Programming of a speed is expected.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Program speed with S[spindle number]=..
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16112 [Channel %1:] Block %2 following spindle %3 Impermissible programming

Parameters:	%1 = Channel number %2 = Block number, label %3 = Spindle
Explanation:	With synchronous spindle-VV-coupling an additional motion for the following spindle can only be programmed with M3, M4, M5 and S... The paths created by specified positions cannot be maintained safely for a velocity coupling, especially if a position control is missing. If dimensional accuracy or reproducibility are not important, the alarm can be suppressed with MD11410 \$MN_SUPPRESS_ALARM_MASK Bit27 = 1.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Use synchronous spindle-DV-coupling or program direction of rotation and speed.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16120 [Channel %1:] Block %2 invalid index for tool fine compensation

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Mistake in programming: The 2nd parameter in the PUTFTOC command indicates for which tool parameter the value is to be corrected (1 - 3 tool lengths, 4 tool radius). The programmed value is beyond the permitted range. Permissible values are 1 - 4 if on-line tool radius compensation is allowed (see MD20254 \$MC_ONLINE_CUTCOM_ENABLE), otherwise values 1 - 3.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program: Length 1 - 3 or 4 permissible for radius.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16130 [Channel %1:] Block %2 command not allowed with FTOCON

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: - Case 1: A plane change is not allowed if the modal G function FTOCON: "fine tool compensation" is active.
- Case 2: Transformation selection is allowed only for zero transformation or transformation inclined axis, Transmit or Tracyl if FTOCON is active.
- Case 3: Tool change is not allowed with M06 if FTOCON has been active since the last tool change.
- Case 4: Orientable tool holder is active.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify part program: Deselect fine tool compensation with FTOCOF.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16140 [Channel %1:] Block %2 FTOCON not allowed

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The fine tool compensation (FTOC) is not compatible with the currently active transformation.
This also applies with an active tool carrier.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify part program: Deselect fine tool compensation with FTOCOF.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16150 [Channel %1:] Block %2 invalid spindle number with PUTFTOCF

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The spindle number programmed for PUTFTOC or PUTFTOCF is beyond the permitted range for the spindle numbers.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify part program. Is the programmed spindle number available?

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16200 [Channel %1:] Block %2 spline and polynomial interpolation not available

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The spline and polynomial interpolation are options that are not contained in the basic version of the control.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Do not program spline and polynomial interpolation, or retrofit the necessary option.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16300	[Channel %1:] Block %2 denominator polynomial with zero places within parameter range not allowed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The programmed denominator polynomial (with PL [] = ... , i.e. without specification of geometry axis) has a zero place within the defined parameter range (PL = ...). This means that the quotient of the numerator polynomial and the denominator polynomial is infinite or indeterminate.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify the polynomial block so that there is no zero place within the polynomial length in the denominator polynomial.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
16400	[Channel %1:] Block %2 positioning axis %3 cannot participate in spline
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	An axis assigned to a spline grouping (n) with SPLINEPATH (n, AX1, AX2, ...) has been programmed as positioning axis with POS or POSA.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Do not assign the positioning axis to the spline grouping.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
16410	[Channel %1:] Block %2 axis %3 is not a geometry axis
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	A geometry axis has been programmed that cannot be imaged on any machine axis in the current transformation (possibly there is no transformation active at the moment). Example: Without transformation: Polar coordinate system with X, Z, and C axis With transformation: Cartesian coordinate system with X, Y, and Z, e.g. with TRANSMIT.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Activate transformation type with TRAORI (n) or do not program geometry axes that do not participate in the transformation grouping.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
16420	[Channel %1:] Block %2 axis %3 programmed repeatedly
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	It is not allowed to program an axis more than once.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Delete the axis addresses that have been programmed more than once.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16430 [Channel %1:] Block %2 geometry axis %3 cannot traverse as positioning axis in rotated coordinate system

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis name, spindle number

Explanation: In the rotated coordinate system, traversing of a geometry axis as positioning axis (i.e. along its axis vector in the rotated coordinate system) would mean traversing of several machine axes. This is in conflict with the positioning axis concept, however, in which one axis interpolator runs in addition to the path interpolator!

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Traverse geometry axes as positioning axes only with rotation deactivated.
Deactivate rotation:
Keyword ROT without further specification of axis and angle.
Example: N100 ROT

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16440 [Channel %1:] Block %2 rotation programmed for non-existent geometry axis

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: A rotation of a geometry axis which does not exist was programmed.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify the part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16500 [Channel %1:] Block %2 chamfer or rounding negative

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: A negative chamfer or rounding has been programmed under the keywords CHF= ..., RND=... or RNDM=...

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Values for chamfers, roundings and modal roundings must be programmed with positive values only.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16510 [Channel %1:] Block %2 no facing axis for diameter programming available

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:	Diameter programming has been activated although no transverse axis with diameter programming has been applied. Transverse axes can be applied with MD20100 \$MC_DIAMETER_AX_DEF or MD30460 \$MA_BASE_FUNCTION_MASK bit2 for diameter programming. Diameter programming can be applied through: - basic position DIAMON or DIAM90 of the G 29 group during booting - programming of DIAMON or DIAM90 - programming of DIAMONA[AX], DIAM90A[AX] or DAC, DIC, RAC, RIC
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. When programming DIAMON/DIAM90, a traverse axis must be configured via MD20100 \$MC_DIAMETER_AX_DEF. When programming DIAMONA[AX], DIAM90A[AX] or DAC, DIC, RAC, RIC, the AX axis must be a transverse axis for diameter programming configured via MD30460 \$MA_BASE_FUNCTION_MASK bit2.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16600	[Channel %1:] Block %2 spindle %3 gear stage change not possible
Parameters:	%1 = Channel number %2 = Block number, label %3 = Spindle number
Explanation:	The programmed speed is outside the speed range of the set gear stage. In order to execute the programmed speed, the gear stage must be changed. In order to be able to execute the automatic gear stage change (M40 is active), the spindle must be in speed control operation. The alarm will no longer be output after having set bit 30 (0x40000000) in MD11410 \$MN_SUPPRESS_ALARM_MASK. However, the function will not be affected by this.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	The changeover to speed control operation is performed by programming M3, M4 or M5. The M functions can be written together with the S word in the same block.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16605	[Channel %1:] Block %2 Spindle %3 Gear stage change in %4 not possible
Parameters:	%1 = Channel number %2 = Block number, label %3 = Spindle number %4 = Gear stage
Explanation:	A gear stage change for the spindle will not be possible, if: - thread cutting (G33, G34, G35) is active - the spindle is active as master or slave spindle in a coupling - the spindle is being positioned
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	The gear stage is to be set prior to the corresponding machining step. If it is necessary, however, to change the gear stage within one of the above mentioned functions, this function must be switched off for the time of the gear stage change. Thread cutting is deselected with G1; synchronous spindle coupling is switched off with COUPOF; the spindle positioning operation is exited with M3, M4 or M5.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16670	[Channel %1:] Block %2 following axis/spindle %3 maximum number of CP modules (%4) has been exceeded
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = Max. number of CP modules
Explanation:	An attempt was made to activate more generic couplings than are configured in MD18450 \$MN_MM_NUM_CP_MODULES.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Reduce the number of defined or active couplings, or increase the number of coupling modules configured in MD18450 \$MN_MM_NUM_CP_MODULES. If necessary, buy another option stage of the generic coupling.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
16671	[Channel %1:] Block %2 following axis/spindle %3 maximum number of CP modules (%4) has been exceeded
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = Max. number of CP modules
Explanation:	An attempt was made to activate more generic couplings than are configured in MD18450 \$MN_MM_NUM_CP_MODULES.
Reaction:	NC not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Reduce the number of defined or active couplings, or increase the number of coupling modules configured in MD18450 \$MN_MM_NUM_CP_MODULES. If necessary, buy another option stage of the generic coupling.
Programm continuation:	Clear alarm with the RESET key in all channels. Restart part program.
16672	[Channel %1:] Block %2 leading axis/spindle %3 maximum number of CP master values (%4) exceeded
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = Max. number of CP master values
Explanation:	An attempt was made to activate more master values of generic couplings than are configured in MD18452 \$MN_MM_NUM_CP_MODUL_LEAD.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Reduce the number of defined or active master values, or increase the total number of master values configured in MD18452 \$MN_MM_NUM_CP_MODUL_LEAD. If necessary, buy another option stage of the generic coupling.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16673	[Channel %1:] Block %2 leading axis/spindle %3 maximum number of CP master values (%4) exceeded
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = Max. number of CP master values
Explanation:	An attempt was made to activate more master values of generic couplings than are configured in MD18452 \$MN_MM_NUM_CP_MODUL_LEAD.
Reaction:	NC not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Reduce the number of defined or active master values, or increase the total number of master values configured in MD18452 \$MN_MM_NUM_CP_MODUL_LEAD. If necessary, buy another option stage of the generic coupling.
Programm continuation:	Clear alarm with the RESET key in all channels. Restart part program.
16674	[Channel %1:] Block %2 motion synchronous action: %3 following axis/spindle %4 maximum number of CP modules exceeded
Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID %4 = Axis name, spindle number
Explanation:	An attempt was made to activate more generic couplings than are configured in MD18450 \$MN_MM_NUM_CP_MODULES.
Reaction:	NC not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Reduce the number of defined or active couplings, or increase the number of coupling modules configured in MD18450 \$MN_MM_NUM_CP_MODULES. If necessary, buy another option stage of the generic coupling.
Programm continuation:	Clear alarm with the RESET key in all channels. Restart part program.
16675	[Channel %1:] block %2 following axis/spindle %3 coupling module already defined in channel %4
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis/spindle %4 = Channel number
Explanation:	An attempt was made to define or activate a CP coupling, although a coupling had already been defined or activated on this following axis/spindle in another channel.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Change the part program: A CP coupling module must not be simultaneously defined in multiple channels for the same following axis/spindle.

Programm continuation: Clear alarm with the RESET key. Restart part program

16676	[Channel %1:] Block %2 motion synchronous action: %3 leading axis/spindle %4 maximum number of CP modules exceeded
Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID %4 = Axis name, spindle number
Explanation:	An attempt was made to activate more master values of generic couplings than are configured in MD18452 \$MN_MM_NUM_CP_MODUL_LEAD.
Reaction:	NC not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Reduce the number of defined or active master values, or increase the total number of master values configured in MD18452 \$MN_MM_NUM_CP_MODUL_LEAD. If necessary, buy another option stage of the generic coupling.
Programm continuation:	Clear alarm with the RESET key in all channels. Restart part program.

16677	[Channel %1:] Block %2 motion synchronous action %3 coupling module is already defined in the channel %4
Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID %4 = Channel number
Explanation:	An attempt was made to define or activate a CP coupling, although a coupling had already been defined or activated on this following axis/spindle in another channel.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Change the part program: A CP coupling module must not be simultaneously defined in multiple channels for the same following axis/spindle.
Programm continuation:	Clear alarm with the RESET key. Restart part program

16678	[Channel %1:] Block %2 following axis/spindle %3 status %4 impermissible traversing instruction
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = Status
Explanation:	An additional traversing in the following axis/spindle is not permitted in the current status of the generic coupling. Example: CPOF=X G0 X100 is not permitted.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.

Remedy:	Modify part program. A motion in the following axis/spindle can be programmed with CPFPOS, CPON or CPOF
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16679 [Channel %1:] Block %2 Motion synchronized action: %3 Slave spindle/axis %4 not available

Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID %4 = Axis name, spindle number
Explanation:	A coupling was switched-in or switched-out, where the slave spindle/axis is presently not available. Possible causes are: - The spindle/axis is active in the channel. - The spindle/axis is active in the other channel. - The spindle/axis was controlled from the PLC and has still not been enabled.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Slave spindle/axis enabled with spindle/axis exchange or enabled from the PLC.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16680 [Channel %1:] Block %2 following axis/spindle %4 instruction %3 programmed repeatedly

Parameters:	%1 = Channel number %2 = Block number, label %3 = CP instruction %4 = Axis name, spindle number
Explanation:	The stated instruction has been programmed repeatedly in the block for the same following axis/spindle of a generic coupling.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16681 [Channel %1:] Block %2 following axis/spindle %3 CPFPOS not permitted (reason %4)

Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = Reason
Explanation:	CPFPOS must not be declared for a following axis/spindle of a generic coupling in the current status. The reasons for this may be: - Reason 1: The coupling does not completely switch off, at least one leading axis/spindle remains active in the coupling.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	The following remedies are available for the reasons stated below: - Reason 1: Only declare CPFPOS when switching off the coupling, if it is completely closed.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16682	[Channel %1:] Block %2 following axis/spindle %3 instructions %4 are not possible.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = CP instruction
Explanation:	The stated instructions are not permitted together in one block for a following axis/spindle of a generic coupling.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
16684	[Channel %1:] Block %2 following axis/spindle %3 instructions %4 are not possible separately.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = CP instructions
Explanation:	The stated instructions are only permitted together in one block for a following axis/spindle of a generic coupling.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
16685	[Channel %1:] Block %2 following axis/spindle %3 instructions %4 are not possible separately.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = CP instructions
Explanation:	The stated instructions are only permitted together in one block for a following axis/spindle of a generic coupling.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with the RESET key. Restart part program
16686	[Channel %1:] Block %2 following axis/spindle %3 type of coupling/instruction %4 is not possible.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = CP instructions
Explanation:	The stated instruction is not permitted for the stated type of generic coupling.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.

Remedy: Modify part program.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16687 **[Channel %1:] Block %2 motion synchronous action %3 type of coupling/instruction %4 is not possible.**

Parameters: %1 = Channel number
 %2 = Block number, line number
 %3 = Synact ID
 %4 = Coupling type

Explanation: The stated instruction is not permitted for the stated type of generic coupling.

Reaction: NC Start disable in this channel.
 Interface signals are set.
 Alarm display.
 NC Stop on alarm.

Remedy: Modify part program.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16690 **[Channel %1:] Block %2 following axis/spindle %3 changing the reference system %4 is not possible.**

Parameters: %1 = Channel number
 %2 = Block number, label
 %3 = Axis name, spindle number
 %4 = Reference system

Explanation: An attempt was made to change the reference system with generic coupling active.

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: Modify part programm.
 End coupling and reactivate with desired reference system.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16692 **[Channel %1:] Block %2 following axis/spindle %3 maximum number of couplings in the block %4 has been exceeded**

Parameters: %1 = Channel number
 %2 = Block number, label
 %3 = Axis name, spindle number
 %4 = Maximum number of couplings

Explanation: The maximum number of generic couplings in the block has been exceeded.

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: Modify part program.
 Reduce the number of generic couplings programmed in the block.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16694 [Channel %1:] Block %2 following axis/spindle %3 status/instruction %4 is not possible.

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis name, spindle number
%4 = Status, instruction

Explanation: The stated instruction is not permitted for the current status of the generic coupling.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16695 [Channel %1:] Block %2 following axis/spindle %3 status/instruction %4 is not possible.

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis name, spindle number
%4 = Status, instruction

Explanation: The stated instruction is not permitted for the current status of the generic coupling.

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Modify part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16696 [Channel %1:] Block %2 following axis/spindle %3 coupling has not been defined.

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis name, spindle number

Explanation: An instruction to an undefined coupling is to be executed.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify part programm.
Define the coupling and activate, if necessary, before the instruction.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16697 [Channel %1:] Block %2 following axis/spindle %3 coupling has not been defined.

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis name, spindle number

Explanation: An instruction to an undefined coupling is to be executed.

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy:	Modify part programm. Define the coupling and activate, if necessary, before the instruction.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16698	[Channel %1:] Block %2 following axis/spindle %3 leading axis/spindle %4 has not been defined.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = Axis name, spindle number
Explanation:	An instruction to an undefined leading axis/spindle of a coupling is to be executed.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part programm. Define the leading axis/spindle and activate, if necessary, before the instruction.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16699	[Channel %1:] Block %2 motion synchronous action %3 leading axis/spindle %4 has not been defined.
Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID %4 = Axis name
Explanation:	An instruction to an undefined leading axis/spindle of a coupling is to be executed.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Modify part programm. Define the leading axis/spindle and activate, if necessary, before the instruction.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16700	[Channel %1:] Block %2 axis %3 invalid feed type
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	In a thread cutting function, the feed has been programmed in a unit that is impermissible. G33 (thread with constant lead) and the feed have not been programmed with G94 or G95. G33 (thread with constant lead) is active (modal) and G63 is programmed additionally in a following block. (Conflict situation! G63 is in the 2nd G group, G33, G331 and G332 are in the 1st G group). G331 or G332 (rigid tapping) and the feed have not been programmed with G94.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Use only the feed type G94 or G95 in the thread cutting functions. After G33 and before G63, deselect the thread cutting function with G01.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16701 [Channel %1:] Block %2 motion synchronous action %3 following axis/spindle %4 coupling is not defined

Parameters: %1 = Channel number
%2 = Block number, line number
%3 = Synact ID
%4 = Axis name, spindle number

Explanation: An instruction to an undefined coupling is to be executed.

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Modify part programm.
Define the coupling and activate, if necessary, before the instruction.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16715 [Channel %1:] Block %2 axis %3 spindle not in standstill

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Spindle number

Explanation: The spindle must be stationary for the applied function (G74, reference point approach, interpolated turning).

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Program M5 or SPOS/SPOSA in front of the defective block in the part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16720 [Channel %1:] Block %2 axis %3 thread pitch is zero

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis name, spindle number

Explanation: No pitch was programmed in a thread block with G33 (thread with constant pitch) or G331 (rigid tapping).

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: The thread pitch must be programmed for the specified geometry axis under the associated interpolation parameters.
X -> I
Y -> J
Z -> K

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16730 [Channel %1:] Block %2 axis %3 wrong parameter

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis name, spindle number

Explanation:	In G33 (tapping with constant pitch) the pitch parameter was not assigned to the axis that determines the velocity. For longitudinal and face threads, the thread pitch for the specified geometry axis must be programmed under the associated interpolation parameter. X -> I Y -> J Z -> K For taper threads, the address I, J, K depends on the axis with the longer path (thread length). A 2nd lead for the other axis is, however, not specified.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Assign lead parameters to the axis that determines the velocity.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16735	[Channel %1:] Block %2 Incorrect geometry parameter (error %3)
Parameters:	%1 = Channel number %2 = Block number, label %3 = Error specification
Explanation:	For G335/G336 (thread cutting with a convex thread) the pitch parameter could not be assigned to a velocity-defining axis. The error number specifies the precise cause: Error 1 : The pitch parameter does not match the end points or the program circular plane. Error 2 : A circular path angle of greater than 90 degrees was programmed. Error 3 : The circular path has a helical component (helix). Error 4 : The circular path exceeds one of the angles 45/135/225/315 degrees in the programming. Error 5 : The circular path exceeds one of the angles 45/135/225/315 degrees after calculating in the frame. Error 6 : The pitch was not programmed for the axis with the longest traversing path.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	- check circle programming or - assign pitch parameter to the axis with the longest traversing distance.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16736	[Channel %1:] In block %2: Prog. thread block too short to comply with the dynamic limit values %3, %4 is required
Parameters:	%1 = Channel number %2 = Block number, label %3 = Smoothing length that can be taken from the programmed thread block %4 = Smoothing length required for dynamic response adjustment with compliance with the limit values
Explanation:	If programming requires a dynamic response adjustment from one thread element to the next, a check is made to see if the path length is long enough to comply with the dynamic limit values. Only a part of the programmed path length can be used for this smoothing because the programmed target speed of the thread block for the required thread geometry (thread pitch, spindle speed) has to be reached and output. It must be assumed that the dynamic limit values will be exceeded for the dynamic response adjustment to the required thread geometry. The alarm is only output if it is not suppressed by bit 25 of MD11415 \$MN_SUPPRESS_ALARM_MASK_2.
Reaction:	Alarm display.

- Remedy:**
1. Change part program and lengthen the path of thread block %2.
There is a danger of collision as a result of path lengthening, especially for female threads. This must be checked.
 2. Lengthen smoothing length of the thread block with DITRB = -1.
 3. Set MD11415 \$MN_SUPPRESS_ALARM_MASK_2 bit 25.
 4. Set setting data SD42010 \$SC_THREAD_RAMP_DISP[2] = 0.

Programm continuation: Clear alarm with the Delete key or NC START.

16740 [Channel %1:] Block %2 no geometry axis programmed

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: No geometry axis was programmed for tapping (G33) or for rigid tapping (G331, G332). The geometry axis is, however, essential if an interpolation parameter has been specified.

Example:

N100 G33 Z400 K2 ; thread pitch 2mm, thread end Z=400 mm

N200 SPOS=0 ; position spindle in axis mode

N201 G90 G331 Z-50 K-2 ; tapping to Z=-50, counterclockwise

N202 G332 Z5 ; retraction, direction reversal automatic

N203 S500 M03 ; spindle again in spindle mode

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Specify geometry axis and corresponding interpolation parameters.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16746 [Channel %1:] Block %2 spindle %3 selected gear stage %4 not installed

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Spindle number
%4 = Gear stage

Explanation: The first gear stage data block is active. The required gear stage is not installed in the 1st gear stage data block. The number of gear stages installed is configured in MD35090 \$MA_NUM_GEAR_STEPS.

Examples of the occurrence of the alarm with 3 gear stages installed (MD 35090 \$MA_NUM_GEAR_STEPS = 3):

* ... M44 or M45 has been programmed for the spindle concerned

* ...M70 has been programmed and MD35014 \$MA_GEAR_STEP_USED_IN_AXISMODE is larger than 3.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify part program: Only those valid gear stages can be entered which have also been installed according to MD35090 \$MA_NUM_GEAR_STEPS.

Limit M70 configuration (MD 35014 \$MA_GEAR_STEP_USED_IN_AXISMODE) to MD35090 \$MA_NUM_GEAR_STEPS.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16747 [Channel %1:] Block %2 spindle %3 inserted gear stage %4 for tapping not installed

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Spindle number
%4 = Gear stage

Explanation:	The second gear stage data block has been activated for tapping with G331. However, the current gear stage has not been installed in the second gear stage data block. The number of gear stages installed is configured in MD35092 \$MA_NUM_GEAR_STEPS2. The gear stage cannot be changed in traversing blocks. The gear stage appropriate for the speed must be loaded before the traversing block.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Procedure for automatically engaging the suitable gear stage prior to thread cutting: * Program the spindle speed (S) in a G331 block without axis motions and prior to thread cutting, e.g. G331 S1000. * Activate M40 for the spindle.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16748	[Channel %1:] Block %2 spindle %3 gear stage %4 expected
Parameters:	%1 = Channel number %2 = Block number, label %3 = Spindle number %4 = Gear stage
Explanation:	G331 activates the second gear stage data block for tapping. The programmed speed (S) of the master spindle lies outside the speed range of the active gear stage in the current traversing block. The gear stage cannot be changed in the traversing block. The gear stage appropriate for the speed must be loaded prior to the traversing block.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Procedure for automatically engaging the suitable gear stage prior to thread cutting: * Program the spindle speed (S) in a G331 block without axis motions and prior to thread cutting, e.g. G331 S1000. * Activate M40 for the spindle.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16750	[Channel %1:] Block %2 axis %3 SPCON not programmed
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	For the programmed function (rotary axis, positioning axis), the spindle must be in position control mode.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Program position control of the spindle with SPCON in the previous block.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16751	[Channel %1:] Block %2 spindle/axis %3 SPCOF not executable
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	For the programmed function, the spindle must be in the open-loop control mode. In the positioning or axis mode, the position control must not be deselected.

Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Put the spindle into open-loop control mode in the preceding block. This can be done with M3, M4 or M5 for the relevant spindle.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16757 [Channel %1:] Block %2 for following spindle %3 coupling as leading spindle/axis already existing

Parameters:	%1 = Channel number %2 = Block number, label %3 = Following spindle number
Explanation:	A coupling has been switched on in which the following spindle/axis has already been active as leading spindle/axis in another coupling. Chained couplings cannot be processed.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Check in the part program whether the following spindle/axis is already active as leading spindle/axis in another coupling.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16758 [Channel %1:] Block %2 for leading spindle %3 coupling as following spindle/axis already existing

Parameters:	%1 = Channel number %2 = Block number, label %3 = Leading spindle number
Explanation:	A coupling has been switched on in which the leading spindle/axis has already been active as following spindle/axis in another coupling. Chained couplings cannot be processed.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Check in the part program whether the leading spindle/axis is already active as following spindle/axis in another coupling.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16760 [Channel %1:] Block %2 axis %3 S value missing

Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	No spindle speed has been given for rigid tapping (G331 or G332).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Program the spindle speed under address S in [rpm] (in spite of axis mode); the direction of rotation is given by the sign of the spindle lead: - Positive thread pitch: Rotational direction as M03. - Negative thread pitch: Rotational direction as M04 N2.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16761	[Channel %1:] Block %2 axis/spindle %3 not programmable in the channel
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	Mistake in programming: The axis/spindle cannot be programmed in the channel at this time. This alarm can occur when the axis/spindle is being used by another channel or by the PLC.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify the part program. Use "GET()".
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
16762	[Channel %1:] Block %2 spindle %3 thread function is active
Parameters:	%1 = Channel number %2 = Block number, label %3 = Spindle number
Explanation:	Incorrect programming: the spindle function can currently not be executed. This alarm occurs when the spindle (master spindle) is linked with the axes by an interpolation function.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify the part program. Deselect thread cutting or tapping.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
16763	[Channel %1:] Block %2 axis %3 programmed speed is illegal (zero or negative)
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	A spindle speed (S value) was programmed with the value zero or with a negative value.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Program the speed (S value) with a positive value. Depending on the application case, the value zero may be permissible, e.g. G25 S0.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
16765	[Channel %1:] Block %2 motion synchronous action: %3 following spindle/axis missing
Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID
Explanation:	The following spindle/axis has not been written in the part program.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16766 [Channel %1:] Block %2 motion synchronous action: %3 string cannot be interpreted

Parameters: %1 = Channel number
%2 = Block number, line number
%3 = Synact ID

Explanation: A coupling has been switched on in which a non-interpretable string has been written (e.g. block change behavior).

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Modify part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16767 [Channel %1:] Block %2 motion synchronous action: %3 leading spindle/axis missing

Parameters: %1 = Channel number
%2 = Block number, line number
%3 = Synact ID

Explanation: The master spindle/axis has not been programmed in the part program.

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Modify part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16769 [Channel %1:] Block %2 motion synchronous action: %3 too many couplings for axis %4

Parameters: %1 = Channel number
%2 = Block number, line number
%3 = Synact ID
%4 = Axis name, spindle number

Explanation: For the specified axis/spindle, more master axes/spindles have been defined than are allowed.

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Modify part program.

Programm continuation: Clear alarm with the RESET key. Restart part program

16770 [Channel %1:] Block %2 axis %3 no measuring system available

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis name, spindle number

Explanation:	One of the following spindle functions has been programmed, the position control requires: SPCON, SPOS, SPOSA, COUPON, G331/G332. The position control requires at least one measuring system. No measuring system has been configured in MD30200 \$MA_NUM_ENCS of the programmed spindle.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Retrofit a measuring system.
Programm continuation:	Clear alarm with the RESET key. Restart part program

16771	[Channel %1:] Block %3 following axis %2 overlaid movement not enabled
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label
Explanation:	No gear synchronization and no overlay movement can be executed for the stated axis because this is not enabled at the VDI interface. This alarm can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK_2 bit17 = 1 or for CP programming with CPMALARM[FAX] bit11 = 1.
Reaction:	Alarm display.
Remedy:	Set the NC/PLC interface signal DB380x DBX5002.4 (enable following axis overlay).
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

16772	[Channel %1:] Block %2 axis %3 is the slave axis, the coupling is being opened
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis, spindle
Explanation:	The axis is active as a following axis in a coupling. In REF operating mode, the coupling is opened. The alarm can be suppressed with MD11410 \$MN_SUPPRESS_ALARM_MASK bit 29 = 1 or with CP programming by setting CPMALARM[FAX] bit 0 = 1.
Reaction:	Alarm display.
Remedy:	The coupling will be closed again after having exited the REF operation mode.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

16773	[Channel %1:] Axis %2 is the following axis. The axis/spindle disables of leading axes %3 and %4 differ from one another.
Parameters:	%1 = Channel number %2 = Axis, spindle %3 = Axis, spindle %4 = Axis, spindle
Explanation:	The axis is active in a coupling as a following axis. The leading axes have different states regarding axis/spindle disable. The alarm can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK_2, bit 0 = 1 or with CP programming by setting CPMALARM[FAX] bit 1 = 1.
Reaction:	Alarm display.
Remedy:	Set the same axis/spindle disable for all master axes.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

16774	[Channel %1:] Synchronization canceled for slave axis/spindle %2
Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	For the indicated axis, the synchronization procedure (EGONSYN or EGONSYNE) was canceled. There are several reasons for canceling the synchronization process: - RESET - End of program - Axis goes to follow-up mode - Rapid stop caused by an alarm
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	If canceling the synchronization procedure can be tolerated or is intended, the alarm can be suppressed with MD11410 \$MN_SUPPRESS_ALARM_MASK bit 31 = 1 or with CP programming by setting CPMALARM[FAX] bit 2 = 1. Only applicable for electronic gear (EG): If it is not possible to cancel the synchronization procedure, specify the block change criterion FINE in EGONSYN or EGONSYNE.
Programm continuation:	Clear alarm with the RESET key. Restart part program
16775	[Channel %1:] Block %2 motion synchronous action: %3 axis %4 no measuring system available
Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID %4 = Axis name, spindle number
Explanation:	One of the following spindle functions has been programmed, the position control requires: SPCON, SPOS, SPOSA, COUPON, G331/G332. The position control requires at least one measuring system. No measuring system has been configured in MD30200 \$MA_NUM_ENCS of the programmed spindle.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Retrofit a measuring system.
Programm continuation:	Clear alarm with the RESET key. Restart part program
16778	[Channel %1:] Block %2 coupling: Ring coupling at following axis %3 and leading axis %4 impermissible
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = Axis name, spindle number
Explanation:	A coupling has been switched on which results in a cyclic coupling, allowance being made for further couplings. This cyclic coupling cannot be uniquely computed.

Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Inform the authorized personnel/service department. Configure the coupling in accordance with MD21300 \$MC_COUPLE_AXIS_1 or correct the NC part program.
Programm continuation:	Clear alarm with the RESET key. Restart part program

16779 [Channel %1:] Block %2 coupling: too many couplings for axis %3, see active leading axis %4

Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = Axis name, spindle number
Explanation:	More leading axes and spindles were defined for the specified axis/spindle than are allowed. The last parameter to be specified is a leading value object/leading axis to which the specified axis/spindle is already linked.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Correct the part program.
Programm continuation:	Clear alarm with the RESET key. Restart part program

16780 [Channel %1:] Block %2 following spindle/axis missing

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The following spindle/axis has not been written in the part program.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16781 [Channel %1:] Block %2 master spindle/axis missing

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The master spindle/axis has not been programmed in the part program.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16782 [Channel %1:] Block %2 following spindle/axis %3 not available

Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
--------------------	---

Explanation:	A coupling has been switched on in which the slave spindle/axis is currently not available. Possible causes: - The spindle/axis is active in the other channel. - The spindle/axis has been accessed by the PLC and has not yet been released.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Put the master spindle/axis with spindle/axis exchange into the necessary channel or release from the PLC.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16783 [Channel %1:] Block %2 master spindle/axis %3 not available

Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	A coupling has been switched on in which the master spindle/axis is currently not available. Possible causes: - Setpoint linkage has been selected and spindle/axis is active in the other channel. - The spindle/axis has been accessed by the PLC and has not yet been released.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Put the master spindle/axis with spindle/axis exchange into the necessary channel or release from the PLC.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16785 [Channel %1:] Block %2 identical spindles/axes %3

Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	A coupling has been switched on in which the following spindle/axis is identical to the master spindle/axis.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. - Configure link accordingly in MD21300 \$MC_COUPLE_AXIS_1 - or modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

16787 [Channel %1:] Block %2 coupling parameter not changeable

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The specified coupling is write-protected. Therefore, the coupling parameters cannot be modified.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. - Remove write protection (see channel MD21340 \$MC_COUPLE_IS_WRITE_PROT_1) - or modify part program.

Programm continuation: Clear alarm with the RESET key. Restart part program

16788 [Channel %1:] Block %2 cyclic coupling

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: A coupling has been switched on which results in a cyclic coupling, allowance being made for further couplings. This cyclic coupling cannot be uniquely computed.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Please inform the authorized personnel/service department.
- Configure link accordingly in MD21300 \$MC_COUPLE_AXIS_1
- or modify part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16790 [Channel %1:] Block %2 Parameter is zero or missing

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: A coupling has been switched on in which a relevant parameter has been specified with zero or has not been written (e.g. denominator in the transmission ratio, no slave axis).

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Please inform the authorized personnel/service department.
- Configure link accordingly in SD42300 \$SC_COUPLE_RATIO_1
- or correct part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16791 [Channel %1:] Block %2 parameter is not relevant

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: A coupling has been switched on in which a non-relevant parameter has been written (e.g. parameter for ELG).

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16792 [Channel %1:] Block %2 too many couplings for axis/spindle %3

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis name, spindle number

Explanation: For the specified axis/spindle, more master axes/spindles have been defined than are allowed.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16793 [Channel %1:] Block %2 coupling of axis %3 prohibits transformation change

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis name, spindle number

Explanation: The specified axis is a slave axis in a transformation grouping. When the coupling is switched on, the transformation cannot be changed to another one.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify part program. Switch off coupling(s) of this axis before changing transformation or do not change the transformation.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16794 [Channel %1:] Block %2 coupling of axis/spindle %3 prohibits reference point approach

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis name, spindle number

Explanation: The specified axis is a (gantry) slave axis and cannot therefore approach the reference point.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify part program. Switch off coupling(s) of this axis before reference point approach or do not reference. A gantry slave axis cannot reference for itself.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16795 [Channel %1:] Block %2 string cannot be interpreted

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: A coupling has been switched on in which a non-interpretable string has been written (e.g. block change behavior).

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Modify part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16796 [Channel %1:] Block %2 coupling not defined

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: A coupling is to be switched the parameters of which have neither been programmed nor configured.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Inform the authorized personnel/service department.
Correct the NC part program or MD, program the coupling with COUPDEF or configure by means of MD.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16797 [Channel %1:] Block %2 coupling is active

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: An operation is to be performed in which no coupling may be active, e.g. COUPDEL or TANGDEL must not be used on active couplings.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Correct NC part program, deselect the link with COUPOF or TANGOF.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16800 [Channel %1:] Block %2 traverse instruction DC/CDC for axis %3 not allowed

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis name, spindle number

Explanation: The keyword DC (Direct Coordinate) can only be used for rotary axes. This causes approach of the programmed absolute position along the shortest path.

Example:
N100 C=DC(315)

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Please inform the authorized personnel/service department.
Replace the keyword DC in the displayed NC block by specifying AC (Absolute Coordinate).
If the alarm display is the result of an error in the axis definition, the axis can be declared as a rotary axis by means of the axis-specific MD30300 \$MA_IS_ROT_AX.

Corresponding machine data:
Modify MD30310: \$MA_ROT_IS_MODULO
Modify MD30320: \$MA_DISPLAY_IS_MODULO

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16810 [Channel %1:] Block %2 traverse instruction ACP for axis %3 not allowed

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis name, spindle number

Explanation: The keyword ACP (Absolute Coordinate Positive) is only allowed for "modulo axes". It causes approach of the programmed absolute position in the specified direction.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Please inform the authorized personnel/service department.
In the displayed NC block, replace the keyword ACP by specifying AC (Absolute Coordinate).
If the alarm display is based on an incorrect axis definition, the axis with the axis-specific MD30300 \$MA_IS_ROT_AX and MD30310 \$MA_ROT_IS_MODULO can be declared a rotary axis with modulo change.
Corresponding machine data:
Modify MD30320 \$MA_DISPLAY_IS_MODULO

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16820 [Channel %1:] Block %2 traverse instruction ACN for axis %3 not allowed

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis name, spindle number

Explanation: The keyword ACN (Absolute Coordinate Negative) is only allowed for "modulo axes". It causes approach of the programmed absolute position in the specified direction.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Please inform the authorized personnel/service department.
In the displayed NC block, replace the keyword ACN by specifying AC (Absolute Coordinate).
If the alarm display is based on an incorrect axis definition, the axis with the axis-specific machine data MD30300: \$MA_IS_ROT_AX and MD30310: \$MA_ROT_IS_MODULO can be declared a rotary axis with modulo change.
Corresponding machine data:
MD30320: \$MA_DISPLAY_IS_MODULO

Programm continuation: Clear alarm with the RESET key. Restart part program

16830 [Channel %1:] Block %2 incorrect position programmed for axis/spindle %3

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis name, spindle number

Explanation: A position beyond the range of 0 - 359.999 has been programmed for a modulo axis.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Program position in the range 0 - 359.999.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16904 [Channel %1:] Program control: action '%2<ALNX>' not allowed in the current state

Parameters: %1 = Channel number
%2 = Action number/action name

Explanation: The operation (program, JOG, block search, reference point, etc.) cannot be started or continued in the current status.

Reaction: Alarm display.

Remedy: Check the program status and the channel status.

Programm continuation: Clear alarm with the Delete key or NC START.

16905 [Channel %1:] Program control: action '%2<ALNX>' not allowed

Parameters: %1 = Channel number
%2 = Action number/action name

Explanation: Operation cannot be started or continued. A start is only accepted when an NCK function can be started.
Example: A start is accepted in JOG mode when, for example, the function generator is active or a JOG movement has first been stopped with the Stop key.

Reaction: Alarm reaction in Automatic mode.

Remedy: Check the program status and the channel status.

Programm continuation: Clear alarm with the Delete key or NC START.

16906 [Channel %1:] Program control: action '%2<ALNX>' is canceled due to an alarm

Parameters: %1 = Channel number
%2 = Action number/action name

Explanation: The action was canceled due to an alarm.

Reaction: Alarm display.

Remedy: Eliminate the error and acknowledge the alarm. Then restart the operation.

Programm continuation: Clear alarm with the Delete key or NC START.

16907 [Channel %1:] Action '%2<ALNX>' only possible in stop state

Parameters: %1 = Channel number
%2 = Action number/action name

Explanation: This action may only be performed in Stop state.

Reaction: Alarm display.

Remedy: Check the program status and the channel status.

Programm continuation: Clear alarm with the Delete key or NC START.

16908 [Channel %1:] Action '%2<ALNX>' only possible in reset state or at the block end

Parameters: %1 = Channel number
%2 = Action number/action name

Explanation: This action may only be performed in the Reset state or at the end of block.
In JOG mode, no axis that is traversed as geometry axis in the rotated coordinate system, must be active as PLC or command axis (started through static synchronized action) on mode change. This means that axes like that must be in the state 'neutral axis' again.

Reaction: Alarm display.

Remedy: Check the program status and channel status.
Check whether the axes are active as PLC or command axes in JOG mode.

Programm continuation: Clear alarm with the Delete key or NC START.

16909 [Channel %1:] Action '%2<ALNX>' not allowed in current mode

Parameters: %1 = Channel number
%2 = Action number/action name

Explanation: A different operating mode must be activated for the activated function.

Reaction: Alarm display.

Remedy: Check operation and operating mode.

Programm continuation: Clear alarm with the Delete key or NC START.

16911 [Channel %1:] Mode change is not allowed

Parameters: %1 = Channel number

Explanation: The change from overstore into another operating mode is not allowed.

Reaction: Alarm display.

Remedy: Terminate the "Overstore" function to change to another operating mode.

Programm continuation: Clear alarm with the Delete key or NC START.

16912	[Channel %1:] Program control: action '%2<ALNX>' only possible in reset state
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	This action can only be performed in Reset state. Example: Program selection through HMI or channel communication (INIT) can only be performed in Reset state.
Reaction:	Alarm display.
Remedy:	Reset or wait until processing has finished.
Programm continuation:	Clear alarm with the Delete key or NC START.
16913	[Mode group %1:] [Channel %2:] Mode change: action '%3<ALNX>' not allowed
Parameters:	%1 = Mode group number %2 = Channel number %3 = Action number/action name
Explanation:	The change to the desired mode is not permitted. The change can only take place in the Reset state. Example: Program processing is halted in AUTO mode by NC Stop. Then there is a mode change to JOG mode (program status interrupted). From this operating mode, it is only possible to change to AUTO mode and not to MDI mode!
Reaction:	Alarm display.
Remedy:	Either actuate the Reset key to reset the program execution, or select the mode in which the program was previously being executed.
Programm continuation:	Clear alarm with the Delete key or NC START.
16914	[Mode group %1:] [Channel %2:] Mode change: action '%3<ALNX>' not allowed
Parameters:	%1 = Mode group number %2 = Channel number %3 = Action number/action name
Explanation:	Incorrect mode change, e.g.: Auto -> MDIREF.
Reaction:	Alarm display.
Remedy:	Check the operation and/or the selected mode.
Programm continuation:	Clear alarm with the Delete key or NC START.
16915	[Channel %1:] Action '%2<ALNX>' not allowed in the current block
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	If traversing blocks are interrupted by asynchronous subroutines, then it must be possible for the interrupted program to continue (reorganization of block processing) after termination of the asynchronous subroutine. The 2nd parameter describes which action wanted to interrupt block processing.
Reaction:	Alarm display.
Remedy:	Let the program continue to a reorganized NC block or modify the part program.
Programm continuation:	Clear alarm with the Delete key or NC START.
16916	[Channel %1:] Repositioning: action '%2<ALNX>' not allowed in the current state
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	Repositioning of block processing is presently not possible. A mode change cannot take place. The 2nd parameter describes which action should be used to perform repositioning.

Reaction:	Alarm display.
Remedy:	Let the program continue to a repositioned NC block or modify the part program.
Programm continuation:	Clear alarm with the Delete key or NC START.

16918	[Channel %1:] For action '%2<ALNX>' all channels must be in reset state
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	All channels must be in the initial setting in order to carry out the action! (For example, for machine data loading)
Reaction:	Alarm display.
Remedy:	Either wait until the channel status is canceled or press the Reset key.
Programm continuation:	Clear alarm with the Delete key or NC START.

16919	[Channel %1:] Action '%2<ALNX>' is not allowed due to a pending alarm
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	This action cannot be performed due to an alarm, or the channel is in the fault condition.
Reaction:	Alarm display.
Remedy:	Press the Reset key.
Programm continuation:	Clear alarm with the Delete key or NC START.

16920	[Channel %1:] Action '%2<ALNX>' is already active
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	An identical action is still being processed.
Reaction:	Alarm display.
Remedy:	Wait until the previous procedure has been completed and then repeat the operation.
Programm continuation:	Clear alarm with the Delete key or NC START.

16921	[Mode group %2:] [Channel %1:] Machine data: channel/mode group assignment not allowed or assigned twice
Parameters:	%1 = Channel number %2 = Mode group number
Explanation:	On powering up, an illegal channel/mode group assignment was detected.
Reaction:	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Inform the authorized personnel/service department. Check MD10010 \$MN_ASSIGN_CHAN_TO_MODE_GROUP.
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

16922	[Channel %1:] Subprograms: action '%2<ALNX>' maximum nesting depth exceeded
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	Various actions can cause the current procedure to be interrupted. Depending on the action, asynchronous subroutines are activated. These asynchronous subroutines can be interrupted in the same manner as user programs. Unlimited nesting depth is not possible for asynchronous subroutines due to memory limitations. Example: An interrupt interrupts the current program processing. Other interrupts with higher priorities interrupt processing of the previously activated asynchronous subroutines. Possible actions are: DryRunOn/Off, DecodeSingleBlockOn, delete distance-to-go, interrupts
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Do not trigger the event on this block.
Programm continuation:	Clear alarm with the RESET key. Restart part program
16923	[Channel %1:] Program control: action '%2<ALNX>' not allowed in the current state
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	The current processing cannot be stopped since a preprocessing process is active. This applies, for example, to the loading of machine data, and in block searches until the search target is found.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Cancel the procedure by pressing Reset.
Programm continuation:	Clear alarm with the Delete key or NC START.
16924	[Channel %1:] Caution: program test modifies tool management data
Parameters:	%1 = Channel number
Explanation:	Tool management data is changed during program testing. It is not possible to automatically rectify the data after termination of the program testing.
Reaction:	Alarm display.
Remedy:	Inform the authorized personnel/service department. Save the tool data on HMI and reimport this data after "ProgtestOff".
Programm continuation:	Clear alarm with the Delete key or NC START.
16925	[Channel %1:] Program control: action '%2<ALNX>' not allowed in the current state, action '%3<ALNX>' active
Parameters:	%1 = Channel number %2 = Action number/action name %3 = Action number/action name
Explanation:	The action has been rejected since a mode or sub-mode change (change to automatic mode, MDI, JOG, oversteering, digitizing, etc.) is taking place. Example: This alarm message is output if the Start key is pressed during a mode or sub-mode change from, for example, automatic to MDI, before the NCK has confirmed selection of the mode.
Reaction:	Alarm display.
Remedy:	Repeat the action.
Programm continuation:	Clear alarm with the Delete key or NC START.

16926	[Channel %1:] Channel coordination: action %2 not allowed in block %3, marker %4 is already set
Parameters:	%1 = Channel number %2 = Aktion %3 = Block number %4 = Marker number
Explanation:	The action was denied, the marker was already set. Check the program. Example: SETM(1) ; CLEARM(1) ; Marker must be reset first. SETM(1)
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Repeat the action.
Programm continuation:	Clear alarm with the RESET key. Restart part program
16927	[Channel %1:] Action '%2<ALNX>' at active interrupt treatment not allowed
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	This action may not be activated during interrupt processing (e.g. mode change).
Reaction:	Alarm display.
Remedy:	Press Reset or wait until interrupt processing has finished.
Programm continuation:	Clear alarm with the Delete key or NC START.
16928	[Channel %1:] Interrupt treatment: action '%2<ALNX>' not possible
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	A program interrupt has been activated in a non REORG capable block. Examples of possible program interrupts in this case: - Traversing to fixed stop - Vdi channel delete distance-to-go - Vdi axial delete distance-to-go - Measuring - Software limit - Axis interchange - Axis comes from tracking - Servo disable - Gear stage change at actual gear stage unequal to setpoint gear stage. The block affected is a: - collection block from block search (except for the last collection block) - Block in overstore interrupt.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Do not trigger the event on this block.

Programm continuation: Clear alarm with the RESET key. Restart part program

16930 [Channel %1:] Preceding block and current block %2 must be separated through an executable block

Parameters: %1 = Channel number
%2 = Block number

Explanation: The language functions WAITMC, SETM, CLEARM and MSG must be programmed in separate NC blocks. To avoid velocity dips, these blocks are attached to the next NC block internally in the NCK (for WAITMC to the previous NC block). For this reason, there must always be an executable block (not a calculation block) between the NC blocks. An executable NC block always includes e.g. travel movements, a help function, STOPRE, dwell time etc.

Note: This does not apply to the programming of MSG with the additional parameter "1". In this case a separate block is generated, which interrupts the continuous-path mode.

Reaction: Correction block is reorganized.
Interpreter stop
Interface signals are set.
Alarm display.

Remedy: Program an executable NC block between the previous and current NC blocks.
Example:
N10 SETM.
N15 STOPRE ; insert executable NC block.
N20 CLEARM.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

16931 [Channel %1:] Subprograms: action '%2<ALNX>' maximum nesting depth exceeded

Parameters: %1 = Channel number
%2 = Action number/action name

Explanation: Various actions can cause the current procedure to be interrupted. Depending on the action, asynchronous subroutines (ASUBs) are activated. These ASUBs can be interrupted in the same manner as the user program. Unlimited nesting depth is not possible for ASUBs due to memory limitations.

Example: In the case of an approach block in a repositioning procedure do not interrupt repeatedly, instead wait until processing is completed.

Possible actions are: mode change, SlashOn/Off, overstoring.

Reaction: Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Initiate a block change and repeat the action.

Programm continuation: Clear alarm with the Delete key or NC START.

16932 [Channel %1:] Conflict when activating user data type %2

Parameters: %1 = Channel number
%2 = Data type

Explanation: The "activate user data" function (PI service _N_SETUDT) modifies a data block (tool offset, settable work offset or base frame) which is also written by the NC blocks in preparation.

In the event of a conflict, the value entered by the HMI is reset.

Parameter %2 specifies which data block is affected:

1: Active tool offset

2: Base frame

3: Active work offset

Reaction: Alarm display.

Remedy: Check the inputs on the HMI and repeat the procedure if necessary.
Programm continuation: Clear alarm with the Delete key or NC START.

16933	[Channel %1:] Interrupt treatment: action '%2<ALNX>' not allowed in the current state
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	If a temporary standstill has occurred because of a Reorg event across block boundaries, it is possible that a block without Reorg capability has been loaded. In this situation, it is unfortunately necessary to cancel the Reorg event handling! Reorg events are, e.g. cancelation subprogram, delete distance-to-go and interrupts.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Cancel program with the RESET key.
Programm continuation:	Clear alarm with the RESET key. Restart part program
16934	[Channel %1:] Interrupt treatment: action '%2<ALNX>' not possible due to stop
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	Reorg events are, e.g. cancelation subprogram, delete distance to go and interrupts, axis exchange, termination of follow-up mode. Two Reorg events overlap in this situation. The 2nd Reorg event coincides with the 1st block generated by the previous event. (e.g. an axis exchange is induced twice in rapid succession). Axis exchange leads to Reorg in the channels in which an axis is removed without preparation. This block must be stopped in the above sequence in order to prevent the interpolator buffer from overflowing. This can be achieved by pressing the Stop or StopAll key, configuring an alarm with INTERPRETERSTOP or by decode single block.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	The program must be canceled with Reset.
Programm continuation:	Clear alarm with the RESET key. Restart part program
16935	[Channel %1:] Action '%2<ALNX>' not possible due to search run
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	The action is not allowed as block search is currently running via program test. Block search via program test: "PI Service _N_FINDBL with mode parameter 5. With this block search type, it is not permissible to activate program test or dry run feedrate.
Reaction:	Alarm display.
Remedy:	Activate the action after block search is terminated.
Programm continuation:	Clear alarm with the Delete key or NC START.
16936	[Channel %1:] Action '%2<ALNX>' not possible due to active dry run
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	This action is not allowed as dry run feedrate is currently active. Example: It is not permissible to activate block search via program test (PI service _N_FINDBL with mode parameter 5) when dry run feedrate is active.

Reaction: Alarm display.
Remedy: Cancel program with the RESET key.
Programm continuation: Clear alarm with the Delete key or NC START.

16937 [Channel %1:] Action '%2<ALNX>' not possible due to program test

Parameters: %1 = Channel number
%2 = Action number/action name
Explanation: This action is not allowed as program test is currently active.
Example: It is not permissible to activate block search via program test (PI service _N_FINDBL with mode parameter 5) when program test is active.
Reaction: Alarm display.
Remedy: Deactivate program test.
Programm continuation: Clear alarm with the Delete key or NC START.

16938 [Channel %1:] Action '%2<ALNX>' canceled due to active gear change

Parameters: %1 = Channel number
%2 = Action number/action name
Explanation: Reorganization events are, among others, subprogram cancelation, delete distance-to-go and interrupts, axis exchange, exiting the correction state. These events wait for the end of a gear change. However, the maximum waiting period has elapsed.
Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.
Remedy: Cancel the program with Reset and, if necessary, increase MD10192 \$MN_GEAR_CHANGE_WAIT_TIME.
Programm continuation: Clear alarm with the RESET key. Restart part program

16939 [Channel %1:] Action '%2<ALNX>' rejected due to active gear change

Parameters: %1 = Channel number
%2 = Action number/action name
Explanation: Reorganization events that are possible in Stop state, e.g. mode change, are waiting for the end of the gear change. However, the maximum waiting period has elapsed.
Reaction: Interface signals are set.
Alarm display.
Remedy: Repeat the action or increase MD10192 \$MN_GEAR_CHANGE_WAIT_TIME.
Programm continuation: Clear alarm with the Delete key or NC START.

16940 [Channel %1:] Action '%2<ALNX>' wait for gear change

Parameters: %1 = Channel number
%2 = Action number/action name
Explanation: Reorganization events are waiting for the end of a gear change. The alarm is displayed during the waiting period.
Reaction: Alarm display.
Warning display.
Remedy: To suppress the alarm, set MD11411 \$MN_ENABLE_ALARM_MASK bit 1 = 0.
Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

16941	[Channel %1:] Action '%2<ALNX>' rejected because no program event has been executed yet
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	The setting of the MD20108 \$MC_PROG_EVENT_MASK forces an asynchronous subprogram to be triggered automatically on RESET or PowerOn. The implicitly triggered asynchronous subprograms are normally called "Event-triggered program call" or "Program event". In the alarm situation, this asynchronous subprogram could not yet be activated; that is why the action (normally start of part program) must be rejected. Reasons for the fact that the asynchronous subprogram could not be triggered: 1. The asynchronous subprogram does not exist (/ _N_CMA_DIR/ _N_PROG_EVENT_SPF) 2. The asynchronous subprogram is allowed to start in the referenced state only (see MD11602 \$MN_ASUP_START_MASK) 3. READY is missing (because of alarm)
Reaction:	Alarm display.
Remedy:	Load program Check MD11602 \$MN_ASUP_START_MASK Acknowledge alarm
Programm continuation:	Clear alarm with the Delete key or NC START.
16942	[Channel %1:] Start program command action '%2<ALNX>' not possible
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	Currently, the alarm occurs only in combination with the SERUPRO action. SERUPRO stands for search via program test. SERUPRO is currently searching the target and has therefore switched this channel to the program test mode. With the START program command in channel 1, another channel 2 would actually be started, which means that axes would really be started during the search action. If this alarm is switched off (see help), the user can make use of the above behavior by initially selecting via PLC the program test mode in channel 2, leaving channel 2 executing until its natural end, stopping channel 2 in order to deselect program test again.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Alarm can be switched off with MD10708 \$MN_SERUPRO_MASK bit 1.
Programm continuation:	Clear alarm with the RESET key. Restart part program
16943	[Channel %1:] Action '%2<ALNX>' not possible due to ASUB
Parameters:	%1 = Channel number %2 = Action number/action name

Explanation:	The action in the 2nd parameter was rejected, since an asynchronous subprogram is currently active. Currently, only the integrated search run is rejected with this alarm. The integrated search run is activated, if search run is triggered in the Stop program state. In other words: Parts of a program have already been executed and a following program part is "skipped" with search run in order to continue the program afterwards. The event is not possible if the program is stopped within an asynchronous subprogram or if an asynchronous subprogram had been selected before the event. An asynchronous subprogram is selected, when the triggering asynchronous subprogram event arrives, but the asynchronous subprogram cannot be started (e.g. the asynchronous start program is not started because of a read-in disable or because the Stop key is active). In this case, it is irrelevant whether a user ASUB or a system ASUB has been triggered. User ASUBs are activated via FC-9 or via the fast inputs. The following events lead to system ASUBS: - Mode change - Overstore on - Canceling subprogram level - Switching on of single block, type 2 - Setting machine data effective - Setting user data effective - Change skip levels - Dry run on/off - Program test off - Correction block alarms - Editing modi in Teach - External work offset - Axis exchange - Delete distance-to-go - Measuring
Reaction:	Alarm display.
Remedy:	Repeat the action after the end of the asynchronous subprogram.
Programm continuation:	Clear alarm with the Delete key or NC START.

16944	[Channel %1:] Action '%2<ALNX>' not possible due to active search blocks
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	The NCK is currently processing either the action blocks of the search run or the approach motion after the search run. In this situation, the action (2nd parameter of the alarm) must be rejected. Currently, only the integrated search run is rejected with this alarm. The integrated search run is activated, if search run is triggered in the Stop program state. In other words: Parts of a program have already been executed and a following program part is "skipped" with search run in order to continue the program afterwards.
Reaction:	Alarm display.
Remedy:	Repeat the action after the approach motion of the search run.
Programm continuation:	Clear alarm with the Delete key or NC START.

16945	[Channel %1:] Action '%2<ALNX>' delayed up to the block end
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	The currently executing action (e.g. dry run on/off, change skip levels, etc.) should be active immediately, but it can become active not earlier than at the end of the block, since a thread is currently being machined. The action is activated with a slight delay. Example: Dry run is started in the middle of the thread, then traversing at high speed does not start before the next block.
Reaction:	Alarm display.
Remedy:	Alarm can be switched off via MD11410 \$MN_SUPPRESS_ALARM_MASK bit17==1.

Programm continuation: Clear alarm with the Delete key or NC START.

16946 [Channel %1:] Start via START is not allowed

Parameters: %1 = Channel ID

Explanation: This alarm is active with "Group Serupro" only. "Group Serupro" is activated by means of MD10708 \$MN_SERUPRO_MASK, Bit 2 and enables the retrace support of entire channel groups during block search.
The MD22622 \$MC_DISABLE_PLC_START specifies which channel is generally started from the PLC and which channel is only allowed to be started from another channel via the START part program command.
This alarm occurs if the channel was started via the START part programm command and MD22622 \$MC_DISABLE_PLC_START==FALSE was set.

Reaction: Alarm display.

Remedy: Modify MD22622 \$MC_DISABLE_PLC_START of switch off "Group Serupro" (see MD10708 \$MN_SERUPRO_MASK).

Programm continuation: Clear alarm with the Delete key or NC START.

16947 [Channel %1:] Start via PLC is not allowed

Parameters: %1 = Channel ID

Explanation: This alarm is active with "Group Serupro" only. "Group Serupro" is activated by means of MD10708 \$MN_SERUPRO_MASK, Bit 2 and enables the retrace support of entire channel groups during block search.
The machine data MD22622 \$MC_DISABLE_PLC_START specifies which channel is generally started from the PLC and which channel is only allowed to be started from another channel via the START part program command.
This alarm occurs if the channel was started via the PLC and MD22622 \$MC_DISABLE_PLC_START==TRUE was set.

Reaction: Alarm display.

Remedy: Modify MD22622 \$MC_DISABLE_PLC_START of switch off "Group Serupro" (see MD10708 \$MN_SERUPRO_MASK).

Programm continuation: Clear alarm with the Delete key or NC START.

16948 [Channel %1:] dependent channel %2 still active

Parameters: %1 = Channel ID

%2 = Channel ID

Explanation: This alarm is active with "Group Serupro" only. "Group Serupro" is activated by means of MD10708 \$MN_SERUPRO_MODE, bit 2 and enables the retrace support of entire channel groups during block search.
A _dependent channel_ is a channel that had indirectly been started by the currently active channel. The currently active channel was started via PLC.
This channel m_u_s_t be terminated (i.e. reached M30) before the current channel is terminated.
This alarm occurs if the currently active channel is terminated before the dependent channel.

Reaction: Alarm display.

Remedy: Switch off "Group Serupro" (see MD10708 \$MN_SERUPRO_MASK) or install WAITE.

Programm continuation: Clear alarm with the Delete key or NC START.

16949 Correspondence between marker of channel %1 and channel %2 is invalid.

Parameters: %1 = Channel ID

%2 = Channel ID

Explanation: This channel defines a WAIT marker with other channels, which on their part have no correspondence with this wait marker. This channel's WAIT marker has no explicit counterpart in the other channel; i.e. the channels do not mutually wait.

=====

Example

Ch 3 Ch 5 Ch 7
WAITM(99,3,5) WAITM(99,3,5) WAITM(99,5,7)

The wait markers in channels 3 and 5 mutually wait for each other and channel 7 only waits for channel 5. Therefore, channel 7 may continue when 5 and 7 have reached the wait marker, but channel 3 is still far in front of the wait marker. When it continues, channel 7 deletes its wait marker. When wait marker 99 is reached again, you can no longer determine the behavior precisely.

=====

Reaction: Alarm display.

Remedy: In each wait marker, list all channels with which you want to synchronize, or suppress the alarm with MD11410 \$MN_SUPPRESS_ALARM_MASK, bit 23.

=====

Sample solution A:

Ch 3 Ch 5 Ch 7
WAITM(99,3,5,7) WAITM(99,3,5,7) WAITM(99,3,5,7)

=====

Sample solution B:

Ch 3 Ch 5 Ch 7
WAITM(99,3,5) WAITM(99,3,5)
 WAITM(88,5,7) WAITM(88,5,7)

=====

Sample solution C:

Ch 3 Ch 5 Ch 7
 WAITM(88,5,7) WAITM(88,5,7)
WAITM(99,3,5) WAITM(99,3,5)

Programm continuation: Clear alarm with the Delete key or NC START.

16950 [Channel %1:] Search run with hold block

Parameters: %1 = Channel number

Explanation: Informational alarm.

The search run was not performed on the interruption block, instead, it touches down shortly before that. This so-called "hold block" is generated by the part program command IPTRLOCK, or implicitly defined by MD22680 \$MC_AUTO_IPTR_LOCK. This is to prevent you from performing a search run in critical program areas (e.g. gear hobbing). The alarm also displays that, instead of searching for the block that actually was interrupted before, another block is being searched for. This behavior is desired and the alarm serves only informational purposes.

Reaction: Alarm display.

Remedy: MD11410 \$MN_SUPPRESS_ALARM_MASK, MD22680 \$MC_AUTO_IPTR_LOCK and language command IPTRLOCK

Programm continuation: Clear alarm with the Delete key or NC START.

16951 [Channel %1:] Search run in a protected program section.

Parameters: %1 = Channel number

Explanation: A part programmer can define protected part program sections with the language commands IPTRLOCK and IPTRUNLOCK. Every search run in these program sections will then be acknowledged with alarm 16951. In other words: When the alarm appears, the user has started a search run (Serupro type) and the search target lies in a protected area. A protected area can also be defined implicitly with the MD22680 \$MC_AUTO_IPTR_LOCK.

Note:

The alarm can only be generated if the simulation has been completed during the search run. The alarm cannot be output immediately at the start of the search run.

Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	MD11410 \$MN_SUPPRESS_ALARM_MASK, MD22680 \$MC_AUTO_IPTR_LOCK and language command IPTRLOCK
Programm continuation:	Clear alarm with the RESET key. Restart part program

16952	[Channel %1:] Start program command not possible due to MDI
Parameters:	%1 = Channel number
Explanation:	NCK is currently executing an ASUB in MDI mode. In this constellation, part program command "Start" is not allowed for another channel. Attention: If an ASUB is started from JOG, the NCK can internally change to MDI, if the NCK was previously in MDI and not in RESET. Note: Without this alarm, the MDI buffer of the other channel would always be started.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Start ASUB in AUTO or ->JOG in AUTO
Programm continuation:	Clear alarm with the RESET key. Restart part program

16953	[Channel %1:] For slave axis %2 SERUPRO not allowed, as master axis %3 not subject to axis/spindle disable
Parameters:	%1 = Channel number %2 = Slave axis name, following spindle number %3 = Master axis name, master spindle number
Explanation:	Currently, the alarm occurs only in combination with the SERUPRO action. SERUPRO stands for search via program test. SERUPRO is possible only with an active coupling, if the axis/spindle disable is active for all master axes/spindles of the slave axis/spindle
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Set axis/spindle disable of the master axis
Programm continuation:	Clear alarm with the RESET key. Restart part program

16954	[Channel %1:] Block %2 programmed stop prohibited in stop delay area
Parameters:	%1 = Channel ID %2 = Block number, label
Explanation:	In a program area (stop delay area) that is bracketed with DELAYFSTON and DELAYFSTOF, a program command was used that causes a stop. No commands other than G4 are permissible that might cause a stop even though only shortly. A stop delay area can also be defined by MD11550 \$MN_STOP_MODE_MASK.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	MD11550 \$MN_STOP_MODE_MASK and language command DELAYFSTON DELAYFSTOF
Programm continuation:	Clear alarm with the RESET key. Restart part program

16955	[Channel %1:] Stop in stop delay area is delayed
Parameters:	%1 = Channel ID
Explanation:	In a program area (stop delay area) that is bracketed by DELAYFSTON and DELAYFSTOF, an event has been detected that causes a stop. The stop is delayed and executed after DELAYFSTOF. A stop delay area can also be defined by MD11550 \$MN_STOP_MODE_MASK.
Reaction:	Interface signals are set. Alarm display.
Remedy:	MD11550 \$MN_STOP_MODE_MASK and language command DELAYFSTON DELAYFSTOF
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.
16956	[Channel %1:] Program %2 cannot be started due to global start disable.
Parameters:	%1 = Channel ID %2 = (path with program name)
Explanation:	The program selected in this channel cannot be started as "Global start disable" had been set. Note: PI "_N_STRTLK" sets the "Global start disable" and PI "_N_STRTUL" deletes the "Global start disable". The alarm is switched on with MD11411 \$MN_ENABLE_ALARM_MASK bit 6.
Reaction:	Alarm display.
Remedy:	Delete the "Global start disable" and restart.
Programm continuation:	Clear alarm with the Delete key or NC START.
16957	[Channel %1:] Stop-Delay area is suppressed
Parameters:	%1 = Channel ID
Explanation:	The program area (Stop-Delay area), which is bracketed by DELAYFSTON and DELAYFSTOF, could not be activated. Every stop therefore becomes effective immediately and is not delayed! This occurs every time, when braking into a stop Stop-Delay area, i.e. a braking process starts before the Stop-Delay area and ends not earlier than in the Stop-Delay area. If the Stop-Delay area is entered with override 0, the Stop-Delay area can also not be activated Example: a G4 before the Stop-Delay area allows the user to reduce the override to 0. The next block in the Stop-Delay area then starts with override 0 and the alarm situation described occurs. MD11411 \$MN_ENABLE_ALARM_MASK, bit 7 switches on this alarm.
Reaction:	Interface signals are set. Alarm display.
Remedy:	MD11550 \$MN_STOP_MODE_MASK and language command DELAYFSTON DELAYFSTOF
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.
16959	[Channel %1:] Action '%2<ALNX>' prohibited during simulation block search.
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	The function (2nd parameter) must not be activated during simulation search.
Reaction:	Alarm display.
Remedy:	Wait for search end.
Programm continuation:	Clear alarm with the Delete key or NC START.

16960	[Channel %1:] Action '%2<ALNX>' prohibited during EXECUTE PROGRAM AREA.
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	The function (2nd parameter) must not be activated during EXECUTE PROGRAM AREA.
Reaction:	Alarm display.
Remedy:	Wait for end of program area EXECUTE.
Programm continuation:	Clear alarm with the Delete key or NC START.
16961	[Channel %1:] Action '%2<ALNX>' prohibited during syntax check.
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	The function (2nd parameter) must not be activated during the syntax check. Comment: The syntax check is served by the following PI services: _N_CHKSEL _N_CHKRUN _N_CHKABO
Reaction:	Alarm display.
Remedy:	Wait for the end of the syntax check, or Cancel the syntax check with reset, or Cancel the syntax check with PI _N_CHKABO.
Programm continuation:	Clear alarm with the Delete key or NC START.
16962	[Channel %1:] NCK computing time reduced, start is not allowed.
Parameters:	%1 = Channel number
Explanation:	The computing time available to the NCK has been reduced, starts have therefore been locked. The computer performance is inadequate for smooth program execution. The computing time of the NCK may have been reduced by the HMI because of an HMI part program simulation.
Reaction:	Alarm display.
Remedy:	Wait for the simulation to end or press RESET in any channel.
Programm continuation:	Clear alarm with the Delete key or NC START.
16963	[Channel %1:] ASUB start declined
Parameters:	%1 = Channel number
Explanation:	An external ASUB start from the canceled program state has been declined for the following reasons: - Bit 0 is not set in MD11602 \$MN_ASUP_START_MASK - ASUB priority has been set too low (value too high) or MD11604 \$MN_ASUP_START_PRIO_LEVEL has been set too high (value too low)
Reaction:	Alarm display.
Remedy:	Correct the machine data or change the priority of the ASUB to be executed.
Programm continuation:	Clear alarm with the Delete key or NC START.
16964	[Channel %1:] Executing of init blocks not fully completed
Parameters:	%1 = Channel number
Explanation:	Init blocks are processed during ramp-up; they ensure that the control is initialized correctly. The alarm is set if processing could not be completed correctly (usually due to alarms which were already pending).
Reaction:	Alarm display.
Remedy:	Eliminate pending alarms.
Programm continuation:	Switch control OFF - ON.

16966	[Channel %1:] Action '%2<ALNX>' prohibited during Jog Retract
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	The function (2nd parameter) must not be activated during Jog Retract.
Reaction:	Alarm display.
Remedy:	End Jog Retract by Reset.
Programm continuation:	Clear alarm with the Delete key or NC START.
16967	[Channel %1:] Action '%2<ALNX>' while preparing the protection areas not permissible
Parameters:	%1 = Channel number %2 = Action number/action name
Explanation:	The function (2nd parameter) must not be activated while the protection areas, which are activated using the PI_N_PROT_A, are being prepared.
Reaction:	Alarm display.
Remedy:	Wait until PI_N_PROT_A has been completed, or cancel PI with a RESET.
Programm continuation:	Clear alarm with the Delete key or NC START.
16968	[Channel %1:] Machine data %2[%3] contains invalid syntax, error code: %4
Parameters:	%1 = Channel number %2 = String: MD identifier %3 = Index: MD array index %4 = Error code
Explanation:	A syntax rule was violated when defining an auxiliary function or a subprogram name. The error code helps pinpoint the problem: 1 - An auxiliary function definition must start with M, D, H or T. 2 - An auxiliary function definition needs an extension or a value. 3 - If present, an auxiliary function extension must be a wild card '*' or a natural number enclosed in square brackets '[,]'. A natural number is only allowed for 'T' auxiliary functions when \$MC_T_M_ADDRESS_EXT_IS_SPINO = TRUE or with active magazine management (MD18080 \$MN_MM_TOOL_MANAGEMENT_MASK, MD20310 \$MC_TOOL_MANAGEMENT_MASK). 4 - If present, the value of an auxiliary function must be a natural number or a wild card '*' after an equals sign '='. 5 - With active tool management (MD18080 \$MN_MM_TOOL_MANAGEMENT_MASK, MD20310 \$MC_TOOL_MANAGEMENT_MASK), a numerical value must not be given for 'T', only a wild card '*' is allowed. 6 - Other entries as auxiliary functions are interpreted as subprogram names. A subprogram name must be a valid NC subprogram name with the prefix '_N_', without path specification and without '/'. It must not contain special or control characters. It must not be a keyword of the NC language (e.g. POSA). 7 - '_N_ASUP1' and '_N_ASUP2' are not permitted as subprogram definitions because these are the subprogram names from system ASUBs. - Examples of correct auxiliary function definitions are: 'H[3]=7', 'M[22]', 'D[*]=4', 'T[*]=*', 'T=*', . An example of a correct subprogram name is '_N_TOOL_TWIST'.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please notify the authorized personnel/service department. Enter auxiliary function definition or subprogram name with correct syntax in the displayed MD. - CFG_STOP positions: SD42220 \$SC_CFG_STOP_ARRAY
Programm continuation:	Clear alarm with the RESET key. Restart part program

17001	[Channel %1:] Block %2 no memory left for tool/magazine data. Data type: %3 %4
Parameters:	%1 = Channel number %2 = Block number, label %3 = Data type %4 = Cause
Explanation:	Data type: 1-Tools, 2-Cutting edges, 3-Multitools, 4-Multitool locations, 5-Sum or setup offsets 6-Adapters, 7-Magazines, 8-Magazine locations, 9-Wear group, 10-Magazine distance Cause (only if data type is tool): 1-Tool count limit reached, 2-Tool list handles, 3-Tool bodies, 4-Tool groups handles, 5-Tool groups The number of the following tool/magazine data variables in the NC is specified using machine data: - Number of tools + number of grinding data blocks: MD18082 \$MN_MM_NUM_TOOL - Number of cutting edges: MD18100 \$MN_MM_NUM_CUTTING_EDGES_IN_TOA Tools, grinding data blocks, cutting edges can be used independently of the tool management. The memory for the following data is available only if the corresponding bit has been set in MD18080 \$MN_MM_TOOL_MANAGEMENT_MASK. - Number of monitoring data blocks: MD18100 \$MN_MM_NUM_CUTTING_EDGES_IN_TOA - Number of magazines: MD18084 \$MN_MM_NUM_MAGAZINE - Number of magazine locations: MD18086 \$MN_MM_NUM_MAGAZINE_LOCATION - Number of adapters: MD18104 \$MN_MM_NUM_TOOL_ADAPTER and MD18103 \$MN_MM_NUM_TOOL_ADAPTER_TYPE2 The following variable is determined by the software configuration: Number of magazine spacing data blocks: P2 permits 32 such spacing data blocks. Definition: - 'Grinding data blocks': Grinding data can be defined for a tool of type 400 to 499. A data block of this type occupies as much additional memory as that provided for a cutting edge. - 'Monitoring data blocks': Each cutting edge of a tool can be supplemented with monitoring data. - If the alarm occurs while writing one of the parameters \$TC_MDP1/\$TC_MDP2/\$TC_MLSR, check whether machine data MD18077 \$MN_MM_NUM_DIST_REL_PER_MAGLOC / MD18076 \$MN_MM_NUM_LOCS_WITH_DISTANCE has been set correctly. MD18077 \$MN_MM_NUM_DIST_REL_PER_MAGLOC defines the number of different Index1 statements that may be made for an Index2 value. MD18076 \$MN_MM_NUM_LOCS_WITH_DISTANCE defines the number of different buffer locations that may be named in Index2. If a multitool or its locations are to be generated, the alarm indicates that either more multitools need to be generated than are permitted by the setting of MD18083 \$MN_MM_NUM_MULTITool or, if the alarm occurs when the multitool locations are being generated, that more multitool locations need to be generated than is permitted by the setting of MD18085 \$MN_MM_NUM_MULTITool_LOCATIONS.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. - Modify machine data - Modify NC program, i.e. reduce number of rejected variable.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
17010	[Channel %1:] Block %2 no memory left
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	When executing/reading files from the active working memory, it was found that there is not enough memory space (e.g. for large multidimensional arrays such as LUD or GUD arrays or when creating tool offset memory).

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Make arrays smaller or make more memory space available for memory management of subroutine calls, tool offsets and user variables (machine data MM_...). See /FBI, S7 Memory Configuration
Programm continuation:	Clear alarm with the RESET key. Restart part program

17018 [Channel %1:] Block %2 incorrect value for parameter %3

Parameters:	%1 = Channel number %2 = Block number, label %3 = Parameter name
Explanation:	An incorrect value has been assigned to the stated parameter. Only the following values are permissible for the parameter \$P_WORKAREA_CS_COORD_SYSTEM =1 for workpiece coordinate system =3 for settable zero system.
Reaction:	Interpreter stop Interface signals are set. Alarm display.
Remedy:	Assign another value.
Programm continuation:	Clear alarm with the RESET key. Restart part program

17020 [Channel %1:] Block %2 illegal array index 1

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	General: Read or write access has been programmed to an array variable with an invalid 1st array index. The valid array indices must lie within the defined array size and the absolute limits (0 - 32 766). PROFIBUS/PROFINET I/O: An illegal slot / I/O area index was used while reading/writing data. Cause: 1.: Slot / I/O area index >= max. number of available slot / I/O areas. 2.: Slot / I/O area index references a slot / I/O area that has not been configured. 3.: Slot / I/O area index references a slot / I/O area that has not been released for system variables. The following applies specifically: If the alarm occurs while writing one of the parameters \$TC_MDP1/\$TC_MDP2/\$TC_MLSR, check whether MD18077 \$MN_MM_NUM_DIST_REL_PER_MAGLOC has been set correctly. MD18077 \$MN_MM_NUM_DIST_REL_PER_MAGLOC defines the number of different Index1 statements that may be made for an Index2 value. If an MT number is programmed, the value may collide with a previously defined T number or a previously defined magazine number.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct the specification of array elements in the access instruction to match the defined size.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17030	[Channel %1:] Block %2 illegal array index 2
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	General: A read or write access has been programmed to an array variable with an invalid 2nd array index. The valid array indices must lie within the defined array size and the absolute limits (0 - 32 766). PROFIBUS/PROFINET I/O: An attempt was made to read/write data outside the slot / I/O area limits of the stated slot / I/O area. The following applies specifically: If the alarm occurs while writing one of the parameters \$TC_MDP1/\$TC_MDP2/\$TC_MLSR, check whether MD18076 \$MN_MM_NUM_LOCS_WITH_DISTANCE has been set correctly. \$MN_MM_NUM_LOCS_WITH_DISTANCE defines the number of different buffer storage locations that may be named in Index2
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct the specification of array elements in the access instruction to match the defined size.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
17035	[Channel %1:] Block %2 illegal array index 3
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	General: A read or write access has been programmed to an array variable with an invalid 3rd array index. The valid array indices must lie within the defined array size and the absolute limits (0 - 32766).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct the specification of array elements in the access instruction to match the defined size.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
17040	[Channel %1:] Block %2 illegal axis index
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A read or write access has been programmed to an axial variable in which the axis name cannot be unambiguously imaged on a machine axis. Example: Writing of an axial machine data \$MA_... [X]= ... ; but geometry axis X cannot be imaged on a machine axis because of a transformation!
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Deselect transformation before writing into the axial data (keyword: TRAFOOF) or use the machine axis names as axis index.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
17050	[Channel %1:] Block %2 illegal value
Parameters:	%1 = Channel number %2 = Block number, label

Explanation:	A value has been programmed that exceeds the value range or a limit value of a variable or a machine data item. For example: In a string variable (e.g. GUD or LUD), a string needs to be written that exceeds the agreed string length in the variable definition. - If an illegal value is to be written to a tool or magazine management variable (e.g. illegal cutting edge number in \$TC_DPCE[x,y] or illegal magazine location number in \$TC_MDP2[x,y]) - The value of MTL is incorrect. MTL must be programmed with a multitool location number of a multitool that is programmed in the command T=magazine location number in the same NC block. - An illegal value is to be written in \$P_USEKT or \$A_DPB_OUT[x,y] - An illegal value is to be written in a machine data (e.g. MD10010 \$MN_ASSIGN_CHAN_TO_MODE_GROUP[0] = 0) - On accessing an individual frame element, a frame component other than TRANS, ROT, SCALE or MIRROR was addressed or the CSCALE function was assigned a negative scale factor. A multitool number has been programmed that collides with a previously defined T number or a previously defined magazine number. When programming DELMLOWNER: The command cannot be programmed with the T number of a tool that is part of a multitool.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Address frame components only with the keywords provided; program the scale factor between the limits of 0.000 01 to 999.999 99.
Programm continuation:	Clear alarm with the RESET key. Restart part program

17052	[channel %1:] block %2 impermissible value / parameter value of the STRING type
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A STRING type programmed value is already being used. E.g. - the name of the multitool to be generated is already assigned to another multitool, tool or magazine. - the name of a tool to be generated is already assigned to another tool with the same duplo number or to a multitool. - the name of a magazine to be generated is already assigned to a multitool.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Programmed value of STRING type not permitted
Programm continuation:	Clear alarm with the RESET key. Restart part program

17055	[Channel %1:] Block %2 GUD variable not existing
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The required GUD variable was not found for a MEACALC procedure during read or write access.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.

Remedy: Check whether all the GUDs were created for MEACALC.
 DEF CHAN INT _MVAR, _OVI[11]
 DEF CHAN REAL _OVR[32], _EV[20], _MV[20], _SPEED[4], _SM_R[10], _ISP[3]
 DEF NCK REAL _TP[3,10], _WP[3,11], _KB[3,7], _CM[8], _MFS[6]
 DEF NCK BOOL _CBIT[16]
 DEF NCK INT _CVAL[4].

Programm continuation: Clear alarm with the RESET key. Restart part program

17060 [Channel %1:] Block %2 requested data area too large

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The maximum memory space of 8 KB available for a symbol has been exceeded.

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: Reduce array dimensions.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17070 [Channel %1:] Block %2 data is write-protected

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: An attempt was made to write into a write-protected variable (e.g. a system variable). Safety Integrated: Safety system variables can only be written into via the safety SPL program.

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: Please inform the authorized personnel/service department. Modify part program.

Safety Integrated:

- Delete write accesses to safety system variables in part programs other than the safety SPL program
- Verify the release of the safety functionality

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17071 [Channel %1:] Block %2 data read-protected

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: An attempt has been made to read a read-protected variable (e.g. a system variable).

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: Please set the corresponding access right or modify the part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17080 [Channel %1:] Block %2 %3 value below lower limit

Parameters: %1 = Channel number
 %2 = Block number, label
 %3 = MD

Explanation: An attempt was made to write into a machine data with a value smaller than the defined lower limit.

Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Determine the input limits of the machine data and assign a value within these limits.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17090 [Channel %1:] Block %2 %3 value exceeds upper limit

Parameters:	%1 = Channel number %2 = Block number, label %3 = MD
Explanation:	An attempt was made to write into a machine data with a value greater than the defined upper limit.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Determine the input limits of the machine data and assign a value within these limits.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17095 [Channel %1:] Block %2 invalid value

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	An attempt was made to write an invalid value, e.g. zero, into a machine data.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct the value assignment, e.g. set a value not equal to zero within the value range.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17100 [Channel %1:] Block %2 digital input/comparator no. %3 not activated

Parameters:	%1 = Channel number %2 = Block number, label %3 = Input number
Explanation:	Either an attempt was made to read a digital input n via the system variable \$A_IN[n] and this input has not been activated via NCK MD10350 \$MN_FASTIO_DIG_NUM_INPUTS; or to read a comparator input via system variable \$A_INCO[n] and this input belongs to a comparator which has not been activated.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Modify part program or machine data accordingly.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17110 [Channel %1:] Block %2 digital output no. %3 not activated

Parameters:	%1 = Channel number %2 = Block number, label %3 = No. of output
--------------------	---

Explanation:	An attempt was made to read or set a digital NC output (connector X 121) via the system variable \$A_OUT [n] with the index [n] greater than the specified upper limit in MD10360 \$MN_FASTIO_DIG_NUM_OUTPUTS.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Program index [n] of the system variable \$A_OUT [n] only between 0 and the value in MD10360 \$MN_FASTIO_DIG_NUM_OUTPUTS.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17120	[Channel %1:] Block %2 analog input no. %3 not activated
Parameters:	%1 = Channel number %2 = Block number, label %3 = Input number
Explanation:	An attempt has been made by means of the system variable \$A_INA[n] to read an analog input n that has not been activated by the MD10300 \$MN_FASTIO_ANA_NUM_INPUTS.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Modify part program or machine data accordingly.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17130	[Channel %1:] Block %2 analog output no. %3 not activated
Parameters:	%1 = Channel number %2 = Block number, label %3 = No. of output
Explanation:	An attempt has been made by means of the system variable \$A_OUTA[n] to write or read an analog output n that has not been activated by the MD10310 \$MN_FASTIO_ANA_NUM_OUTPUTS.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Modify part program or machine data accordingly.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17140	[Channel %1:] Block %2 NC output %3 is assigned to a function via machine data
Parameters:	%1 = Channel number %2 = Block number, label %3 = No. of output
Explanation:	The programmed digital/analog output is assigned to an NC function (e.g. software cams).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Use another output or deactivate concurrent NC function via MD.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17150	[Channel %1:] Block %2 maximum of %3 NC outputs programmable in the block
Parameters:	%1 = Channel number %2 = Block number, label %3 = Quantity
Explanation:	No more than the specified number of outputs may be programmed in an NC block. The quantity of hardware outputs is defined in the MDs: MD10360 \$MN_FASTIO_DIG_NUM_OUTPUTS and MD10310 \$MN_FASTIO_ANA_NUM_OUTPUTS
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Program fewer digital/analog outputs in a block. The specified maximum number applies in each case separately for analog or digital outputs. If necessary, program two NC blocks.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
17160	[Channel %1:] Block %2 no tool selected
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	An attempt has been made to access the current tool offset data via the system variables: \$P_AD [n]: Contents of the parameter (n: 1 - 25) \$P_TOOL: Active D number (tool edge number) \$P_TOOLL [n]: Active tool length (n: 1- 3) \$P_TOOLR: Active tool radius although no tool had been selected previously.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Program or activate a tool offset in the NC program before using the system variables. Example: N100 G.. ... T5 D1 ... LF With the channel-specific machine data: Modify MD22550 \$MC_TOOL_CHANGE_MODE New tool offset for M function Modify MD22560 \$MC_TOOL_CHANGE_M_CODE M function with tool change It is established whether a tool offset is activated in the block with the T word or whether the new offset values are allowed for only when the M word for tool change occurs.
Programm continuation:	Clear alarm with the RESET key. Restart part program
17170	[Channel %1:] Block %2 number of symbols too large
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The predefined symbols could not be read in during power-up.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.

Remedy: If you experience such a system error, please contact Technical Support.
www.siemens.com/sinumerik/help

Please supply the following information to ensure quick processing:

- Alarm number together with alarm text
- Description of the operation/mode before the alarm message
- Generate log files using the key combination: <Ctrl> + <Alt> + <D>

Programm continuation: Clear alarm with the RESET key. Restart part program

17180 [Channel %1:] Block %2 illegal D number

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: In the displayed block, access is made to a D number that is not defined and therefore is not available.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Check tool call in the NC part program:

- Correct tool correction number D programmed? If no D number is specified with the tool change command, then the D number set by MD20270 \$MC_CUTTING_EDGE_DEFAULT will be active automatically. It is D1 by default.
- Tool parameters (tool type, length,...) defined? The dimensions of the tool edge must have been entered previously either through the operator panel or through a tool data file in NCK.

Description of the system variables \$TC_DPx[t, d] as included in a tool data file.

x ... Correction parameter number P
t ... Associated tool number T
d ... Tool correction number D

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17181 [Channel %1:] Block %2 T no.= %3, D no.= %4 not existing

Parameters: %1 = Channel number
%2 = Block number, label
%3 = T number
%4 = D number

Explanation: A programmed D number was not recognized by the NC. By default, the D number refers to the specified T number. If the flat D number function is active, T= 1 is output.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: You have the following possibilities of eliminating the error:

- The program is incorrect: Eliminate the error with a correction block and continue the program.
- The data block is missing: Load a data block for the specified T/D values onto the NCK via HMI with overstore, and continue the program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17182 [Channel %1:] Block %2 illegal sum correction number

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: An attempt was made to access a non-defined total offset of the current tool edge.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Check the access to the total offset memory with \$TC_SCP*, \$TC_ECP*, total offset selection DLx or tool selection Ty or offset selection Dz.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17183 [Channel %1:] Block %2 H number already available in T no.= %3, D no.= %4

Parameters: %1 = Channel number
%2 = Block number, label
%3 = T number
%4 = D number

Explanation: Each H number (except for H=0) must be assigned in a TO unit only once. The indicated edge already has the H number. If the H number shall be assigned more than once, MD10890 \$MN_EXTERN_TOOLPROG_MODE, bit 3 must be set = 1.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: - Change program:
- Select different H number

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17184 [Channel %1:] Block %2 Tool %3, Duplo no. %5, D no.= %6 does not exist

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Tool identifier
%4 = Duplo number | D number

Explanation: A D number has been programmed that does not exist for the selected tool.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: If the selected tool does not contain the programmed D number,
* the data block for the cutting edge can be loaded into the NC (via HMI, with overstore) or
* the cutting edge can be created subsequently, or,
* if necessary, the D number and/or the tool identifier can be corrected in the displayed block,
and the NC program can be continued..

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17188 [Channel %1:] D number %2 defined in tool T no. %3 and %4

Parameters: %1 = Channel number
%2 = Offset number D
%3 = T number of first tool
%4 = T number of second tool

Explanation: The specified D number %2 in the TO unit of channel %1 is not unique. The specified T numbers %3 and %4 each have an offset with number %2.

If tool management is active:

The specified T numbers belong to tool groups with different names.

Reaction: Interface signals are set.
Alarm display.

Remedy: You have the following possibilities of eliminating the error:
1. Use unique D numbering within the TO unit.
2. Use another command.

Programm continuation: Clear alarm with the Delete key or NC START.

17189 [Channel %1:] D number %2 of tools defined on magazine/location %3 and %4

Parameters: %1 = Channel number

%2 = Offset number D

%3 = Magazine/location number of first tool, '/' as separator

%4 = Magazine/location number of second tool, '/' as separator

Explanation: The specified D number %2 in the TO unit of channel %1 is not unique. The specified T numbers %3 and %4 each have an offset with number %2.

If tool management is active:

The specified T numbers belong to tool groups with different names.

Reaction: Interface signals are set.

Alarm display.

Remedy: You have the following possibilities of eliminating the error:

1. Use unique D numbering within the TO unit. Rename the D numbers if necessary.
2. Use another command.

Programm continuation: Clear alarm with the Delete key or NC START.

17190 [Channel %1:] Block %2 illegal T number %3

Parameters: %1 = Channel number

%2 = Block number, label

%3 = T number

Explanation: In the displayed block, a tool is accessed that is not defined and is therefore not available. The tool has been named by its T number, its name or its name and duplo number.

If the function T=magazine location is activated and programmed, the programmed T number indicates the magazine location number. The alarm can then indicate that the programmed magazine location number is illegal.

If the function T=magazine location is activated and programmed, and the multitool function is also activated and programmed in the program line MTL, the alarm can also indicate that there is no multitool at the location programmed with T=magazine location

or that there is no tool at the multitool location programmed with MTL.

Reaction: Correction block is reorganized.

Interface signals are set.

Alarm display.

Remedy: Check tool call in the NC part program:

- Is the correct tool number T.. programmed?
- T=magazine location programming: Is the correct magazine location number programmed?
- MTL programming: Is there a multitool at the programmed magazine location or is there a tool at the programmed multitool location?
- Are tool parameters P1 - P25 defined? The dimensions of the tool edge must have been entered previously either via the operator panel or the V.24 interface.

Description of the system variables \$P_DP x [n, m]

n ... Associated tool number T

m ... Tool edge number D

x ... Parameter number P

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17191	[Channel %1:] Block %2 T= %3 not existing, program %4
Parameters:	%1 = Channel number %2 = Block number, label %3 = T number or T identifier %4 = Program name
Explanation:	A tool identifier which the NCK does not recognize was programmed.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	If the program pointer is at an NC block which contains the specified T identifier: If the program is incorrect, remedy the error with a correction block and continue the program. If the data block is missing, create one. You can do this by downloading a data block with all the defined D numbers onto the NCK (via HMI with overstore) and continue the program. If the program pointer is at an NC block which does not contain the specified T identifier: The error occurred at an earlier point in the program where the T command appeared, but the alarm was not output until the change command was detected. If the program is incorrect - T5 programmed instead of T55 - the current block can be corrected with a correction block; i.e. if only M06 is entered, you can correct the block with T55 M06. The incorrect T5 line remains in the program until it is terminated by a RESET or end of program. In complex program structures with indirect programming, it may not be possible to correct the program. In this case, you can only intervene locally with an overstore block - with T55 in the example. If the data block is missing, create one. You can do this by downloading the data block of the tool with all the defined D numbers onto the NCK (via HMI with overstore), program the T command with overstore, and continue the program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17192	[TO unit %1:] Invalid tool designation of '%2', duplo no. %3. No more replacement tools possible in '%4'.
Parameters:	%1 = TO unit %2 = Tool identifier %3 = Duplonummer %4 = Group identifier
Explanation:	The tool with the specified tool identifier, duplo number cannot accept the group identifier. Reason: The maximum number of replacement tools allowed has already been defined. The name allocation causes the tool to be reallocated to a tool group which already contains the maximum number of replacement tools allowed on this machine.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Use fewer replacement tools or request a different maximum setting from the machine manufacturer.
Programm continuation:	Clear alarm with the Delete key or NC START.

17193	[Channel %1:] Block %2 the active tool is no longer on toolholder no. %3, program %4
Parameters:	%1 = Channel number %2 = Block number, label %3 = Toolholder no., spindle no. %4 = Program name

Explanation:	The tool at the specified toolholder/spindle at which the last tool change was carried out as master toolholder or master spindle, has been replaced. Example: N10 SETHTH(1) N20 T="Wz1" ; Tool change at master toolholder 1 N30 SETMTH(2) N40 T1="Wz2" ; Toolholder 1 is only a secondary toolholder. Changing the tool does not result in compensation deselection. N50 D5; New correction selection. At present, there is no active tool which D can refer to, i.e. D5 refers to T no. = 0, which results in zero correction.
Reaction:	Interface signals are set. Alarm display.
Remedy:	- Modify program: - Set desired spindle as master spindle or toolholder as master toolholder. - Then, if required, reset master spindle or master toolholder.
Programm continuation:	Clear alarm with the Delete key or NC START.

17194	[Channel %1:] Block %2 no suitable tool found
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	- An attempt was made to access a tool which has not been defined. - The specified tool does not permit access. - A tool with the desired properties is not available. - MTL=MT location T=magazine location number was programmed. There is no multitool at the programmed location
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Check access to tool: - Are the parameters of the command correctly programmed? - Does the status of the tool prevent access?
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17195	[Channel %1:] block %2 illegal tool holder number %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Tool holder number
Explanation:	In the displayed block, a tool holder that is not defined is accessed.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Check the programming of the tool holder in the NC program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17200	[Channel %1:] Block %2: Tool data cannot be deleted. Tool %3 Error ID: %4
Parameters:	%1 = Channel number %2 = Block number, label %3 = T number %4 = Error reason, error status

Explanation:	An attempt has been made to delete the tool data from the part program for a tool currently being processed. Tool data for tools involved in the current machining operation must not be deleted. This applies both for the tool preselected with T or that has been changed in place of another, and also for tools for which the constant grinding wheel peripheral speed or tool monitoring is active. The first part of parameter 4 ("Error reason") shows why the tool cannot be deleted. The possible values: 1 - Tool is active 2 - WZ is at a magazine location 3 - Tool is active and at a magazine location 4 - Tool is being moved 5 - Tool is active and is being moved 6 - Tool is at a magazine location and is being moved 7 - Tool is active, is at a magazine location, and is being moved
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Check access to tool offset memory by means of $\\$TC_DP1[t,d] = 0$ or deselect tool.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17202 [Channel %1:] Block %2 deleting magazine data not possible

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	An attempt was made to delete magazine data which cannot currently be deleted. A magazine with the 'tool in motion' status active cannot be deleted. A tool adapter which is currently allocated to a magazine location cannot be deleted. A tool adapter cannot be deleted if MD18104 \$MN_MM_NUM_TOOL_ADAPTER has the value -1.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	If an attempt to delete a magazine fails $\\$TC_MAP1[m] = 0$; Delete magazine with m=magazine no. $\\$TC_MAP1[0] = 0$; Delete all magazines $\\$TC_MAP6[m] = 0$; Delete magazines and all their tools you must ensure that the magazine does not have the 'tool in motion' status at the time of the call. If an attempt to delete a tool adapter fails $\\$TC_ADPTT[a] = -1$; Delete adapter with number a $\\$TC_ADPTT[0] = -1$; Delete all adapters then the data association with the magazine location or locations must first be canceled with $\\$TC_MPP7[m,p] = 0$; m = magazine no., p = no. of the location to which the adapter is assigned.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17210 [Channel %1:] Block %2 access to variable not possible

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The variable cannot be written/read directly from the part program. It is allowed only in motion synchronous actions. Example for variable: \$P_ACTID (which planes are active) \$AA_DTEPB (axial distance-to-go for reciprocating infeed) \$A_IN (test input) Safety Integrated: Safety PLC system variables can only be read during the safety SPL setup phase.

Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17212 [Channel %1:] Tool management: Load manual tool %3, duplo no. %2 onto spindle/toolholder %4

Parameters:	%1 = Channel number %2 = Duplo no. %3 = Tool identifier %4 = Toolholder number (spindle number)
Explanation:	Indicates that the specified manual tool must be loaded in the specified toolholder or spindle before the program continues. A manual tool is a tool whose data is known to the NCK but has not been assigned to a magazine location and is, therefore, not fully accessible to the NCK for automatic tool change or, in most cases, to the machine either. The specified manual tool can also be a tool in a multitool. In this case the multitool has to be changed.
Reaction:	Alarm display.
Remedy:	Make sure that the specified tool is loaded in the toolholder. The alarm is cleared automatically after PLC acknowledgment of the tool change on command.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

17214 [Channel %1:] Tool management: remove manual tool %3 from spindle/toolholder %2

Parameters:	%1 = Channel number %2 = Toolholder number (spindle number) %3 = Tool identifier
Explanation:	Indicates that the specified manual tool must be removed from the specified toolholder or spindle before the program continues. A manual tool is a tool whose data is known to the NCK but has not been assigned to a magazine location and is, therefore, not fully accessible to the NCK for automatic tool change or, in most cases, to the machine either. The specified manual tool may be a tool in a multitool. In this case the multitool has to be removed.
Reaction:	Alarm display.
Remedy:	Make sure that the specified tool is removed from the toolholder. The alarm is cleared automatically after PLC acknowledgment of the tool change on command. Manual tools can only be used efficiently if this is supported by the PLC program.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

17215 [Channel %1:] Tool management: Remove manual tool %3 from buffer location %2

Parameters:	%1 = Channel number %2 = Buffer location number %3 = Tool identifier
Explanation:	Indicates that the specified manual tool must be removed from the specified buffer location before the program continues. A manual tool is a tool whose data is known to the NCK but has not been assigned to a magazine location and is, therefore, not fully accessible to the NCK for automatic tool change or, in most cases, to the machine either. The specified manual tool may also be included in a multitool. In this case the multitool has to be removed.
Reaction:	Alarm display.
Remedy:	Make sure that the specified manual tool is removed from the buffer location. The alarm is cleared automatically after PLC acknowledgment of the tool change OFF command. Manual tools can only be used efficiently if this is supported by the PLC program.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

17216	[Channel %1:] Remove manual tool from toolholder %4 and load manual tool %3 %2
Parameters:	%1 = Channel number %2 = Duplo no. %3 = Tool identifier %4 = Toolholder number (spindle number)
Explanation:	Indicates that the specified manual tool must be loaded in the specified toolholder or spindle before the program is continued and that the manual tool located there must be removed. A manual tool is a tool whose data are known to the NCK but which is not assigned to a magazine location and is thus not fully accessible to the NCK, and usually also to the machine, for an automatic tool change.
Reaction:	Alarm display.
Remedy:	Make sure that the manual tools are exchanged. The alarm is cleared automatically after PLC acknowledgment of the tool change on command. Manual tools can only be used efficiently if this is supported by the PLC program.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.
17218	[Channel %1:] Block %2 Tool %3 cannot become a manual tool
Parameters:	%1 = Channel number %2 = Block number, label %3 = Tool identifier
Explanation:	The specified tool has a dedicated location and/or a location has been reserved for this tool in an actual magazine. Therefore, it cannot become a manual tool.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	- Correct the NC program - Use the programming of "DELRMRES" to check that there is no reference to an actual magazine location
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
17220	[Channel %1:] Block %2 tool not existing
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	This alarm occurs if a T no., the tool name or the tool name and duplo number is used in an attempt to access a tool that has not been defined or is yet to be defined (e.g. if tools are to be positioned in magazine locations by programming \$TC_MPP6 = 'toolNo'). This will only be possible if both the magazine location and the tool specified with 'toolNo' have been defined. The tool which does not exist can also be a multitool (the multitool is treated like a tool).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct the NC program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
17224	[Channel %1:] Block %2 tool T/D= %3 - tool type %4 is not permitted
Parameters:	%1 = Channel number %2 = Block number, label %3 = Incorrect T no. / D no. %4 = Incorrect tool type

Explanation:	On this system, it is not possible to select tool offsets of the indicated tool types. The variety of tool types can both be limited by the machine OEM and be reduced on individual control models. Only use tools of the tool types permitted for this system. Check whether an error has occurred on defining the tool.
Reaction:	Correction block is reorganized. Interpreter stop Interface signals are set. Alarm display.
Remedy:	Correct the NC program or correct the tool data
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17230 [Channel %1:] Block %2 Duplo no. already assigned

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	If an attempt is made to write a tool Duplo number to the name of which another tool (another T number) already exists with the same Duplo number.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct the NC program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17240 [Channel %1:] Block %2 illegal tool definition

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	If an attempt is made to modify a tool data that would subsequently damage the data consistency or lead to a conflicting definition, this alarm will appear.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Correct the NC program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17241 [Channel %1:] Block %2 illegal adapter definition

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Possible causes of the error: - For an old-type tool adapter (type 1), parameters belonging to the new-type adapter (type 2) cannot be written. - For a new-type tool adapter (type 2), parameters belonging to the old-type adapter (type 1) cannot be written. The adapter type can neither be changed nor set to less than 0 or greater than 2.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	- For an old-type tool adapter (type 1), only write parameters belonging to type 1. - For a new-type tool adapter (type 2), only write parameters belonging to type 2. - The adapter type can only be set once with the value 1 or 2.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17250 [Channel %1:] Block %2 illegal magazine definition

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: If an attempt is made to modify a magazine data that would subsequently damage the data consistency or lead to a conflicting definition, this alarm will appear.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Correct the NC program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17255 [Channel %1:] Block %2 magazine location hierarchies have been deleted

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: If \$TC_MAMP2, bit 15 is changed, existing hierarchies may be deleted because of a change in meaning.

Reaction: Alarm display.

Remedy: Redefine magazine location hierarchies.

Programm continuation: Clear alarm with the Delete key or NC START.

17260 [Channel %1:] Block %2 illegal magazine location definition

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: This alarm occurs if an attempt is made to change a magazine location data which would subsequently damage data consistency irreparably or lead to a conflicting definition.

Example: If parameter \$TC_MPP1 (= type of location) is written with 'spindle/toolholder location', this may conflict with the limiting MD18075 \$MN_MM_NUM_TOOLHOLDERS.

The remedy is then either - if permitted by the control model - to increase the value of MD18075 \$MN_MM_NUM_TOOLHOLDERS
or to correct the magazine definition.

A tool cannot be simultaneously:

- Loaded in two different magazine locations.
- A part of a multitool and in a magazine location.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Correct the NC program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17261 [TO unit %1:] Not all the values of %3 from magazine %2 can be displayed.

Parameters: %1 = TO unit
%2 = Magazine number
%3 = Parameter names

Explanation: Not all user magazine location data (\$TC_MPPCx[magNo, locNo] can be accessed via OPI.

Reaction: Alarm display.

Remedy: - Either reduce the number of OEM magazine location parameters. (MD18092 \$MN_MM_NUM_CC_MAGLOC_PARAM)
 - Or reduce the number of magazine locations in the stated magazine. (\$TC_MAP6[magNo], \$TC_MAP7[magNo])
 The product of the 3 stated parameters must not exceed 32767.

Programm continuation: Clear alarm with the Delete key or NC START.
 This is just an information alarm.

17262 [Channel %1:] Block %2 illegal tool adapter operation (Cause: %3)

Parameters: %1 = Channel number
 %2 = Block number, label
 %3 = Cause

Explanation: Meaning of the error causes:
 1: There is already another adapter on the intended magazine or multitool location.
 Note: If MD18104 \$MN_MM_NUM_TOOL_ADAPTER = -1 is set, each magazine location is assigned a type 1 adapter from the start.
 2: There is already a tool on the intended magazine or multitool location.
 3: The adapter cannot be removed from the location because there is still a tool on the location.
 4: An attempt is being made to bring a non-existent adapter to a magazine or multitool location.
 5: The adapter cannot be deleted because it is still assigned to a location.
 6: If \$MN_MM_NUM_TOOL_ADAPTER = -1, all adapters or one adapter of type 1 cannot be deleted.
 6: If \$TC_ADPTT[n] = -1, a type 2 adapter cannot be deleted.
 6: If \$TC_ADPTT[0] = -1, no adapter can be deleted, if \$MN_MM_NUM_TOOL_ADAPTER_TYPE2 > 0.
 21: Grinding tools (type 4xx) and turning tools (type 5xx) are not allowed on a location with a new-type adapter (type 2):
 22: An old-type tool adapter (type 1) cannot yet be assigned to a multitool location.
 23: A new-type tool adapter (type 2) cannot yet be assigned to a magazine location.
 24: If a multitool with an adapter is set on a magazine location with an adapter, only a type 1 adapter may be on the magazine location with the default setting.
 ((\$TC_ADPT1[n]= 0.0, \$TC_ADPT2[n]= 0.0, \$TC_ADPT3[n]= 0.0, \$TC_ADPTT[n]= 1)
 25: Initially a type 2 adapter may only be set on a multitool location with one location

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: - Assign a maximum of one adapter to a magazine location.
 - If MD18104 \$MN_MM_NUM_TOOL_ADAPTER = -1, only write adapter data already associated with the magazine locations.
 - When assigning an adapter to a magazine location, the magazine location must not contain a tool.
 - When removing an adapter from a magazine location, the magazine location must not contain a tool.
 - Only bring existing adapters to a magazine or multitool location.
 - Only type 1 adapters can be deleted with \$TC_ADPTT[n] = -1.
 - All adapters with \$TC_ADPTT[0] = -1 can only be deleted if \$MN_MM_NUM_TOOL_ADAPTER_TYPE2=0.
 - Set only permitted tool types on a location with new type adapters (type 2).
 - Assign old-type tool adapters (type 1) only to a magazine location.
 - Assign new-type tool adapters (type 2) only to a multitool location.
 - Do not cascade an adapter to a magazine location and a multitool location.
 - Set up a multitool with only one magazine location for a type 2 adapter.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17270 [Channel %1:] Block %2 call-by-reference: illegal variable

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: Machine data and system variables must not be transferred as call-by-reference parameters.

Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Modify NC program: Assign the value of the machine data or of the system variable to a program-local variable and transfer this as parameter.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17500 [Channel %1:] Block %2 axis %3 is not an indexing axis

Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	An indexing axis position has been programmed for an axis with the keywords CIC, CAC or CDC that has not been defined as indexing axis in the machine data.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Remove programming instruction for indexing axis positions (CIC, CAC, CDC) from the NC part program or declare the relevant axis to be an indexing axis. Indexing axis declaration: Modify MD30500: \$MA_INDEX_AX_ASSIGN_POS_TAB (indexing axis assignment) The axis will become an indexing axis when an assignment to an indexing position table was made in the stated MD. 2 tables are possible (input value 1 or 2). Modify MD10900 \$MN_INDEX_AX_LENGTH_POS_TAB_1 Modify MD10920 \$MN_INDEX_AX_LENGTH_POS_TAB_2 (Number of positions for 1st/2nd indexing axis) Standard value: 0 Maximum value: 60 Modify MD10910 \$MN_INDEX_AX_POS_TAB_1 [n] Modify MD10930 \$MN_INDEX_AX_POS_TAB_2 [n] (Positions of the 1st indexing axis) The absolute axis positions are entered. (The list length is defined via MD10900 \$MN_INDEX_AX_LENGTH_POS_TAB_1).
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17501 [Channel %1:] Block %2 indexing axis %3 with Hirth tooth system is active

Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name
Explanation:	The 'Hirth tooth system' function is activated for the indexing axis. This axis can therefore approach only indexing positions. A different traverse of the axis is not possible. It is not permissible to program PRESETON or PRESETONS.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Inform the authorized personnel/service department. Correct the part program. Correct the call FC16 or FC18. Deselect MD30505 \$MA_HIRTH_IS_ACTIVE.
Programm continuation:	Clear alarm with the RESET key. Restart part program

17502	[Channel %1:] Block %2 indexing axis %3 with Hirth tooth system stop is delayed
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name
Explanation:	For the indexing axis, the 'Hirth tooth system' function is activated and the override has been set to 0 or another stop condition (e.g. VDI interface signal) is active. Since it is possible to stop only on indexing axes, the next possible indexing position is approached. The alarm is displayed until this position is reached or the stop condition is deactivated.
Reaction:	Alarm display.
Remedy:	You have the following possibilities of eliminating the error: Wait until the next possible indexing position is reached. Set the override > 0. Deactivate another stop condition.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.
17503	[Channel %1:] Block %2 indexing axis %3 with Hirth tooth system and axis not referenced
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name
Explanation:	The "Hirth tooth system" function is activated for the indexing axis and the axis is to be traversed although it is not referenced.
Reaction:	Alarm display.
Remedy:	Reference the axis.
Programm continuation:	Clear alarm with the Delete key or NC START.
17505	[Channel %1:] Block %2 motion synchronous action: %3 indexing axis %4 is active with Hirth tooth system
Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID %4 = Axis name
Explanation:	The 'Hirth tooth system' function is activated for the indexing axis. This axis can therefore approach only indexing positions, another travel movement of the axis is not possible.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Correct part program. Correct FC16 or FC18 call. Deselect machine data MD30505 \$MA_HIRTH_IS_ACTIVE.
Programm continuation:	Clear alarm with the RESET key. Restart part program
17510	[Channel %1:] Block %2 invalid index for indexing axis %3
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number

Explanation:	The programmed index for the indexing axis is beyond the position table range. Example: Perform an absolute approach of the 56th position in the list allocated via the axis-specific MD30500 \$MA_INDEX_AX_ASSIGN_POS_TAB with the 1st positioning axis, the number of positions is e.g. only 40 (MD10900 \$MN_INDEX_AX_LENGTH_POS_TAB_1 = 40). N100 G.. U=CAC (56) Or, with equidistant distances, the programmed index is smaller or equal 0. Or, an attempt is made with a MOV movement to travel to a position outside the permitted area.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Program the indexing axis position in the NC part program in accordance with the length of the current position table, or add the required value to the position table and adjust the length of the list.
Programm continuation:	Clear alarm with the RESET key. Restart part program

17600	[Channel %1:] Block %2 preset on transformed axis %3 not possible
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	The programmed preset key axis is involved in the current transformation. This means that setting the actual value memory (PRESET) is not possible for this axis (valid for PRESETON and PRESETONS). Example: Machine axis A should be set to the new actual value A 100 at the absolute position A 300. : N100 G90 G00 A=300 N101 PRESETON A=100
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Avoid preset actual value memory for axes which are participating in a transformation or deselect the transformation with the keyword TRAFOOF.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

17601	[Channel %1:] Block %2 motion synchronous action: %3 preset not possible on axis %4
Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID %4 = Axis name, spindle number
Explanation:	Actual value preset not possible for this axis because - the axis is moving - the axis is involved in a transformation - the axis is currently being monitored for collision - the spindle traverse movement has not yet been completed - reference point approach (G74) is active - the geometry axis is not in the 'neutral axis' state
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.

Remedy: Avoid actual value preset or put the relevant geometry axis in the 'neutral axis' state in good time with RELEASE(...).
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17602 [Channel %1:] Block %2 motion synchronized action: %3 preset not possible on axis %4 in JOGREF mode

Parameters: %1 = Channel number
 %2 = Block number, line number
 %3 = Synact ID
 %4 = Axis name, spindle number

Explanation: The actual value cannot be preset for this axis if the mode group to which this axis is assigned is in JOG mode and if the machine function reference point approach is also selected.

Reaction: NC Start disable in this channel.
 Interface signals are set.
 Alarm display.
 NC Stop on alarm.

Remedy: Avoid setting actual value in this configuration or deselect the machine function reference point approach.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17603 [Channel %1:] Block %2 motion synchronized action: %3 preset is only possible on a stationary axis %4 in JOG mode

Parameters: %1 = Channel number
 %2 = Block number, line number
 %3 = Synact ID
 %4 = Axis name, spindle number

Explanation: In JOG mode, an actual value can only be preset on stationary axes.

Reaction: NC Start disable in this channel.
 Interface signals are set.
 Alarm display.
 NC Stop on alarm.

Remedy: Avoid setting an actual value while the axis is in motion; wait until the axis is stationary.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17604 [Channel %1:] Block %2 motion synchronized action: %3 preset not possible on active oscillating axis (axis %4)

Parameters: %1 = Channel number
 %2 = Block number, line number
 %3 = Synact ID
 %4 = Axis name, spindle number

Explanation: An actual value cannot be preset on an active oscillating axis controlled via synchronized actions.

Reaction: NC Start disable in this channel.
 Interface signals are set.
 Alarm display.
 NC Stop on alarm.

Remedy: Avoid setting actual value during active oscillating movement.
Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17610	[Channel %1:] Block %2 axis %3 involved in the transformation, action cannot be carried out
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	The axis is involved in the active transformation. It can therefore not execute the demanded action, traversing as positioning axis, enable for axis exchange.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Deselect the transformation with TRAFOOF ahead of time or remove the action from the part program block
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
17620	[Channel %1:] Block %2 approaching fixed point for transformed axis %3 not possible
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	In the displayed block, an axis is programmed for the fixed point approach (G75) that is involved in the active transformation. Fixed point approach is not performed with this axis!
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Remove G75 instruction from the part program block or previously deselect transformation with TRAFOOF.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
17630	[Channel %1:] Block %2 referencing for transformed axis %3 not possible
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	In the displayed block, an axis is programmed for reference point approach (G74) that is involved in the active transformation. Reference point approach is not performed with this axis!
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Remove G74 instruction, or the machine axes involved in transformation, from the part program block or previously deselect the transformation with TRAFOOF.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
17640	[Channel %1:] Block %2 spindle operation for transformed axis %3 not possible
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	The axis programmed for the spindle operation is involved in the current transformation as geometry axis. This is not allowed.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	First disable the transformation function.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17650 [Channel %1:] Block %2 machine axis %3 not programmable

Parameters: %1 = Channel number
 %2 = Block number, label
 %3 = Axis name, spindle number

Explanation: The machine axis cannot be used in an active transformation. You may be able to program the function in a different coordinate system. For example, it may be possible to specify the retraction position in the basic coordinate system or the workpiece coordinate system. The axis identifier is used to select the coordinate system.

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: Deactivate the transformation or use another coordinate system.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17800 [Channel %1:] Block %2 illegally coded position programmed

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The position number n specified with the keyword FP=n is not permissible. Two (2) absolute axis positions can be directly defined as fixed points by the axis-specific machine data MD30600 \$MA_FIX_POINT_POS[n].
 Or, if position numbers 3 and/or 4 are to be used, then machine data MD30610 \$MA_NUM_FIX_POINT_POS must be set accordingly.

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: Program keyword FP with machine fixed points 1 or 2.
 Example:
 Approach fixed point 2 with machine axes X1 and Z2.
 N100 G75 FP=2 X1=0 Z2=0
 Or modify MD30610 \$MA_NUM_FIX_POINT_POS and, if necessary, MD30600 \$MA_FIX_POINT_POS[].

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

17810 [Channel %1:] Axis %2 not referenced

Parameters: %1 = Channel number
 %2 = Axis number

Explanation: A function has been activated for the axis in JOG mode, e.g. fixed-point approach, JOG to position, JOG in circles, but the axis has not been referenced.

Reaction: Interface signals are set.
 Alarm display.

Remedy: Reference axis.

Programm continuation: Clear alarm with the Delete key or NC START.

17811 [Channel %1:] Fixed-point approach not possible for axis %2 in JOG, reason %3

Parameters: %1 = Channel number
 %2 = Axis name, spindle number
 %3 = Cause

Explanation:	A 'fixed-point approach in JOG' has been requested for an axis. This is not possible because: Reason 1: The axis is involved in the active transformation. Reason 2: The axis is a following axis in an active coupling. The fixed point approach will therefore not be executed.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Deselect fixed-point approach in JOG, or previously deselect the transformation with TRAFOOF or disband the coupling.
Programm continuation:	Clear alarm with the Delete key or NC START.

17812	[Channel %1:] Axis %2 fixed-point approach in JOG: Fixed point %3 changed
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Fixed-point number
Explanation:	'Fixed-point approach in JOG' is active for the axis, but another fixed point has been selected, or the fixed-point approach has been deactivated. The approach motion is canceled.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Trigger JOG motion again.
Programm continuation:	Clear alarm with the Delete key or NC START.

17813	[Channel %1:] Axis %2 fixed-point approach in JOG and override motion active
Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	'Fixed-point approach in JOG' is active for the axis, but another offset motion - for example a synchronization offset \$AA_OFF - has been interpolated simultaneously. The position of the selected fixed-point is not reached if offset values are changed during the traversing motion. The target point then becomes "fixed-point position + change in offset value". The end point will be reached if the traversing motion is restarted after the offset value has been changed. (For example: incremental traversing in which the traversing motion stops intermittently). Reason: Restarting the motion takes the current offset value into account.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Trigger JOG motion again.
Programm continuation:	Clear alarm with the Delete key or NC START.

17814	[Channel %1:] Axis %2 fixed-point position not available
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Number of fixed-point position
Explanation:	No fixed-point position is available for the fixed point selected in JOG mode. See MD30610 \$MA_NUM_FIX_POINT_POS.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Adapt MD30610 \$MA_NUM_FIX_POINT_POS and, if necessary, MD30600 \$MA_FIX_POINT_POS[]. Deselect fixed-point approach or select a valid fixed point, and restart the JOG motion.
Programm continuation:	Clear alarm with the Delete key or NC START.

17815	Indexing axis %1 fixed point %2 unequal indexing position
Parameters:	%1 = Axis number %2 = Array index of machine data
Explanation:	The axis is a referenced indexing axis, and the fixed-point number %2 to be approached in JOG mode (defined in MD30600 \$MA_FIX_POINT_POS) does not coincide with an indexing position. In JOG mode, referenced indexing axes approach indexing positions.
Reaction:	NC not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	MD30600 \$MA_FIX_POINT_POS[] or adapt the indexing positions.
Programm continuation:	Clear alarm with the RESET key. Restart part program
17821	[Channel %1:] Axis %2 JOG to position and override motion active
Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	'JOG to position' is active for the axis, but an offset motion - for example a synchronization offset \$AA_OFF - has been interpolated simultaneously. The position of the SD43320 \$SA_JOG_POSITION is not reached if offset values are changed during the traversing motion. The target point then becomes "Jog position + change in offset value". The position SD43320 \$SA_JOG_POSITION will be reached if the traversing motion is restarted after the offset value has been changed. (For example: incremental traversing in which the traversing motion stops intermittently). Reason: Restarting the motion takes the current offset value into account.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Trigger JOG motion again.
Programm continuation:	Clear alarm with the Delete key or NC START.
17822	[Channel %1:] Axis %2 JOG to position: Position changed
Parameters:	%1 = Channel number
Explanation:	An axis motion is active for the axis with 'JOG to position' but the position, that is the content of SD43320 \$SA_JOG_POSITION, has been changed. The approach motion is canceled.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Trigger JOG motion again.
Programm continuation:	Clear alarm with the Delete key or NC START.
17823	[Channel %1:] Axis %2 JOG to position deactivated
Parameters:	%1 = Channel number
Explanation:	An axis motion is active for the axis with 'JOG to position' but 'JOG to position' has been deactivated. The approach motion is canceled.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Trigger JOG motion again.

Programm continuation: Clear alarm with the Delete key or NC START.

17825 Indexing axis %1 \$SA_JOG_POSITION unequal indexing position

Parameters: %1 = Axis number

Explanation: The axis is a referenced indexing axis and 'JOG to position' is activated in JOG mode, but SD43320 \$SA_JOG_POSITION does not coincide with an indexing position. In JOG mode, referenced indexing axes approach indexing positions.

Reaction: NC not ready.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Modify SD43320 \$SA_JOG_POSITION or indexing positions.

Programm continuation: Clear alarm with the RESET key. Restart part program

17830 [Channel %1:] JOG in a circle is activated, but the axis %2 required for this is not a geometry axis.

Parameters: %1 = Channel number
%2 = Axis name, spindle number

Explanation: The function JOG in circles has been activated, but the axis required for this has not been defined as a geometry axis.

Reaction: Interface signals are set.
Alarm display.

Remedy: Define axis as geometry axis.

Programm continuation: Clear alarm with the Delete key or NC START.

17831 [Channel %1:] JOG a circle is not possible, reason %2

Parameters: %1 = Channel number
%2 = Cause

Explanation: The JOG in circles function was activated, but this is not possible because:

1. The current positions of the axes involved lie outside the selected pitch circle.
2. The current positions of the axes involved, with pitch circle selected and tool radius offset active, are too near to the center of the circle.
3. The current positions of the axes involved, with tool radius offset active, are too near to the limiting circle during internal machining.
4. The current positions of the axes involved, with tool radius offset active, are too near to the limiting circle during external machining.
5. The current positions of the axes involved in internal machining are outside the defined circle.
6. The current positions of the axes involved in external machining are inside the defined circle.
10. A rotation is acting on the current plane, that is the current plane is inclined in space. This is not currently supported.
20. JOG Retract is active. This mode is not supported.

Reaction: Interface signals are set.
Alarm display.

Remedy: Define axis as geometry axis.

Programm continuation: Clear alarm with the Delete key or NC START.

17833 [Channel %1:] JOG a circle is active and JOG circles deactivated

Parameters: %1 = Channel number
%2 = Axis name, spindle number

Explanation:	A circular motion is active but 'JOG in circles' has been deactivated. The circular motion is canceled.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Reactivate 'JOG circles' and trigger JOG motion again.
Programm continuation:	Clear alarm with the Delete key or NC START.

17900 [Channel %1:] Block %2 motion synchronous action: %3 axis %4 is not a machine axis

Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID %4 = Axis name
Explanation:	At this point, the block context calls for a machine axis. This is the case with: - G74 (reference point approach) - G75 (fixed point approach) - PRESETON/PRESETONS on GANTRY synchronous axis If a geometry or special axis identifier is used, then it must also be permitted as machine axis identifier (MD10000 \$MN_AXCONF_MACHAX_NAME_TAB
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Use machine axis identifier when programming.
Programm continuation:	Clear alarm with the RESET key. Restart part program

18000 [Channel %1:] Block %2 NCK-specific protection area %3 wrong. Error code %4

Parameters:	%1 = Channel number %2 = Block number, label %3 = Number of NCK protection area %4 = Error specification
Explanation:	There is an error in the definition of the protection area. The error number gives the specific reason for the alarm: No. Meaning 1: Incomplete or conflicting contour definition. 2: Contour encompasses more than one surface area. 3: Tool-related protection area is not convex. 4: If both boundaries are active in the 3rd dimension of the protection area and both limits have the same value. 5: The number of the protection area does not exist (negative number, zero or greater than the maximum number of protection areas). 6: Protection area definition consists of more than 10 contour elements. 7: Tool-related protection area is defined as inside protection area. 8: Incorrect parameter used. 9: Protection area to be activated is not defined. 10: Incorrect modal G code used for protection area definition. 11: Contour definition incorrect or frame activated. 12: Other, not further specified errors.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Modify definition of the protection area and check MD.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

18001	[Channel %1:] Block %2 channel-specific protection area %3 incorrect. Error code %4
Parameters:	%1 = Channel number %2 = Block number, label %3 = Number of the channel-specific protection area %4 = Error specification
Explanation:	There is an error in the definition of the protection area. The error number gives the specific reason for the alarm. No. Meaning 1: Incomplete or conflicting contour definition. 2: Contour encompasses more than one surface area. 3: Tool-related protection area is not convex. 4: If both boundaries are active in the 3rd dimension of the protection area and both limits have the same value. 5: The number of the protection area does not exist (negative number, zero or greater than the maximum number of protection areas). 6: Protection area definition consists of more than 10 contour elements. 7: Tool-related protection area is defined as inside protection area. 8: Incorrect parameter used. 9: Protection area to be activated is not defined. 10: Incorrect modal G code used for protection area definition. 11: Contour definition incorrect or frame activated. 12: Other, not further specified errors.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Modify definition of the protection area and check MD.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

18002	[Channel %1:] Block %2 NCK protection area %3 cannot be activated. Error code %4
Parameters:	%1 = Channel number %2 = Block number, label %3 = Number of NCK protection area %4 = Error specification

Explanation:	An error has occurred on activating the protection area. The error number gives the specific reason for the alarm. No. Meaning 1: Incomplete or conflicting contour definition. 2: Contour encompasses more than one surface area. 3: Tool-related protection area is not convex. 4: If both boundaries are active in the 3rd dimension of the protection area and both limits have the same value. 5: The number of the protection area does not exist (negative number, zero or greater than the maximum number of protection areas). 6: Protection area definition consists of more than 10 contour elements. 7: Tool-related protection area is defined as inside protection area. 8: Incorrect parameter used. 9: Protection area to be activated is not defined or number of contour element <2 or >MAXNUM_CONTOURNO_PROTECTAREA. 10: Error in internal structure of the protection areas. 11: Other, not further specified errors. 12: The number of simultaneously active protection areas exceeds the maximum number (channel-specific machine data). 13,14: Contour element cannot be created for protection areas. 15,16: No more memory space for the protection areas. 17: No more memory space for the contour elements. 18: The product of simultaneously activated or preactivated workpiece-related protection areas and tool-related protection areas is greater than 31. Example: 16 workpiece-related and 1 tool-related protection area can be active. The number of workpiece-related protection areas can then be increased, for example, to 19 ($19 * 1 = 19$). However, the number of tool-related protection areas cannot be increased to 2 ($16 * 2 = 32$).
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display. If the alarm is output on ramp-up (2nd parameter: "INIT" instead of block number), "Channel not ready to operate" will be set.
Remedy:	Please inform the authorized personnel/service department. 1. Reduce the number of simultaneously active protection areas (MD). 2. Modify part program: - Delete other protection areas. - Preprocessing stop. When the alarm occurs during control ramp-up, the system variables \$SN_PA_... have to be corrected for the specified protection area. Afterwards perform a restart. If the erroneous data cannot be recognized, the protection area's immediate activation can be removed, and the system variables of the protection area can be written again by means of NPROTDEF.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program. If the alarm occurs during NC program execution, the current block can be changed. This way, the NPROT parameters can also be adjusted. However, if there is an error in the definition of the protection area, the NC program must be canceled and the definition must be corrected under NPROTDEF. If the alarm occurs on control ramp-up, system variables \$SN_PA_... must be corrected for the specified protection area. This can be done by downloading an Initial.ini file that includes the relevant corrected data. If afterwards a restart is performed again, the alarm will have been removed provided that the data are consistent.

18003	[Channel %1:] Block %2 channel-specific protection area %3 cannot be activated. Error code %4
Parameters:	%1 = Channel number %2 = Block number, label %3 = Number of the channel-specific protection area %4 = Error specification

Explanation:	An error has occurred on activating the protection area. The error number gives the specific reason for the alarm. No. Meaning 1: Incomplete or conflicting contour definition. 2: Contour encompasses more than one surface area. 3: Tool-related protection area is not convex. 4: If both boundaries are active in the 3rd dimension of the protection area and both limits have the same value. 5: The number of the protection area does not exist (negative number, zero or greater than the maximum number of protection areas). 6: Protection area definition consists of more than 10 contour elements. 7: Tool-related protection area is defined as inside protection area. 8: Incorrect parameter used. 9: Protection area to be activated is not defined or number of the contour element <2 or >MAXNUM_CONTOURNO_PROTECTAREA. 10: Error in internal structure of the protection areas. 11: Other, not further specified errors. 12: The number of protection areas simultaneously active exceeds the maximum number (channel-specific machine data). 13,14: Contour element for protection areas cannot be created. 15,16: No more memory space for the protection areas. 17: No more memory space for the contour elements.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display. If the alarm is output on ramp-up (2nd parameter: "INIT" instead of block number), "Channel not ready to operate" will be set.
Remedy:	Please inform authorized personnel / the service department. 1. Reduce the number of simultaneously active protection areas (MD). 2. Modify part program: - Delete other protection areas. - Preprocessing stop. When the alarm occurs on control ramp-up, system variables \$SC_PA_... must be corrected for the specified protection area. Afterwards perform a restart. If the erroneous data cannot be recognized, the protection area's immediate activation can be removed, and the system variables of the protection area can be written again by means of CPROTDEF.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program. The current block can be changed if the alarm occurs during NC program execution. The CPROT parameters can also be adjusted. However, if the error lies in the definition of the protection area, the NC program must be canceled and the definition corrected under CPROTDEF. If the alarm occurs on control power-up, the system variables \$SC_PA_... must be corrected for the specified protection area. This can be done by downloading an Initial.ini file that includes the relevant corrected data. If another restart is then made, the alarm will have been eliminated provided that the data are now consistent.

18004	[Channel %1:] Block %2 orientation of workpiece-related protection area %3 does not correspond to the orientation of tool-related protection area %4
Parameters:	%1 = Channel number %2 = Block number, label %3 = Number of workpiece-related protection area
Explanation:	The orientation of the workpiece-related protection area and the orientation of the tool-related protection area differ. If the protection area number is negative, then this is an NCK protection area.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	- Modify the protection area definition or do not simultaneously activate protection areas that have different orientations. - Check machine data and modify the protection area definition if necessary.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

18005 [Channel %1:] Block %2 serious error in definition of NCK-specific protection area %3

Parameters: %1 = Channel number
 %2 = Block number, label
 %3 = Protection area number

Explanation: The protection area definition must be terminated with EXECUTE before a preprocessing stop is performed.

Reaction: Correction block is reorganized.
 Local alarm reaction.
 Interface signals are set.
 Alarm display.

Remedy: Modify the part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

18006 [Channel %1:] Block %2 serious error in definition of channel-specific protection area %3

Parameters: %1 = Channel number
 %2 = Block number, label
 %3 = Protection area number

Explanation: The protection area definition must be terminated with EXECUTE before a preprocessing stop is performed.

Reaction: Correction block is reorganized.
 Local alarm reaction.
 Interface signals are set.
 Alarm display.

Remedy: Modify the part program.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

18100 [Channel %1:] Block %2 invalid value assigned to FXS[]

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The following values are valid at the present time:
 0: "Deselect traverse against fixed stop"
 1: "Select traverse against fixed stop" valid.

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: Check the use of permissible values of the program command FXS, and correct the assignment.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

18101 [Channel %1:] Block %2 invalid value assigned to FXST[]

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: Only the range 0.0 - 100.0 is valid at the present time.

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy: Check the use of permissible values of the program command FXST, and correct the assignment.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

18102 [Channel %1:] Block %2 invalid value assigned to FXSW[]

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Only positive values including zero are valid at the present time.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Check the use of permissible values of the program command FXSW, and correct the assignment.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

18205 [Channel %1:] Block %2 motion synchronous action: %3 curve table %4 does not exist

Parameters: %1 = Channel number
%2 = Block number, line number
%3 = Synact ID
%4 = Number of curve table

Explanation: An attempt was made to use a curve table whose table number is not known in the system \par.

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Change the table number in the program instruction or define the curve table with the desired table number.

Programm continuation: Clear alarm with the RESET key. Restart part program

18300 [Channel %1:] Block %2 frame: fine shift not possible

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Allocation of a fine shift to settable frames or the basic frame is not possible since MD18600 \$MN_MM_FRAME_FINE_TRANS is not equal to 1.

Reaction: Interpreter stop
Interface signals are set.
Alarm display.

Remedy: Inform the authorized personnel/service department.
Modify the program or set MD18600 \$MN_MM_FRAME_FINE_TRANS to 1.

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

18310 [Channel %1:] Block %2 frame: illegal rotation

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Rotations are not possible with NCU global frames.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Modify part program.

Programm continuation: Clear alarm with the RESET key. Restart part program

18311 [Channel %1:] Block %2 frame: illegal instruction

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: An attempt was made to read or write a frame which does not exist.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Modify part program.

Programm continuation: Clear alarm with the RESET key. Restart part program

18312 [Channel %1:] Block %2 frame: fine shift not configured

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Fine shift must be configured with G58 and G59.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Modify machine data.

Programm continuation: Clear alarm with the RESET key. Restart part program

18313 [Channel %1:] Block %2 frame: illegal switchover of geometry axes

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: It is not allowed to change the geometry axis assignment because the current frame contains rotations.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Change NC program or set other mode with MD10602 \$MN_FRAME_GEOAX_CHANGE_MODE.

Programm continuation: Clear alarm with the RESET key. Restart part program

18314 [Channel %1:] Block %2 frame: type conflict

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: It is not possible to chain global frames and channel-specific frames. The alarm occurs if a global frame is programmed with a channel axis name and no machine axis on this NCU is assigned to the channel axis. Channel-specific frames cannot be programmed with machine axis names if there is no corresponding channel axis on this NCU.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with the RESET key. Restart part program

20000 [Channel %1:] Axis %2 reference cam not reached

Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	After starting the reference point approach, the rising edge of the reduction cam must be reached within the section defined in the MD34030 \$MA_REFP_MAX_CAM_DIST (phase 1 of referencing). (This error occurs only with incremental encoders).
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. There are 3 possible causes of error: 1. The value entered in MD34030 \$MA_REFP_MAX_CAM_DIST is too small. Determine the maximum possible distance from the beginning of reference motion up to the reduction cam and compare with the value in MD34030 \$MA_REFP_MAX_CAM_DIST, increase the value in the MD if necessary. 2. The cam signal is not received by the PLC input module. Operate the reference point switch manually and check the input signal on the NC/PLC interface (route: Switch! Connector! Cable! PLC input! User program). 3. The reference point switch is not operated by the cam. Check the vertical distance between reduction cam and activating switch.
Programm continuation:	Clear alarm with the RESET key. Restart part program

20001 [Channel %1:] Axis %2 no cam signal present

Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	At the beginning of phase 2 of reference point approach, the signal from the reduction cam is no longer available. Phase 2 of reference point approach begins when the axis remains stationary after deceleration to the reduction cam. The axis then starts in the opposite direction in order to select the next zero marker of the measuring system on leaving the reduction cam or approaching it again (negative/positive edge).
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Check whether the deceleration path after the approach velocity is greater than the distance to the reference point cam - in which case the axis cannot stop until it is beyond the cam. Use a longer cam or reduce the approach velocity in MD34020 \$MA_REFP_VELO_SEARCH_CAM. When the axis has stopped at the cam, it must be checked whether the signal DB380x DBX1000.7 (Deceleration reference point approach) is still available at the interface to the NCK. - Hardware: Wire break? Short circuit? - Software: User program?
Programm continuation:	Clear alarm with the RESET key. Restart part program

20002	[Channel %1:] Axis %2 zero marker not found
Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	The hardware zero marker of the incremental position encoder or the substitute zero mark of the absolute position encoder is not within a defined section. Phase 2 of the reference point approach ends when the zero marker of the encoder has been detected after the rising/falling edge of the NC/PLC interface signal DB380x DBX1000.7 (Deceleration reference point approach) has given the trigger start. The maximum distance between the trigger start and the zero marker that follows is defined in the MD34060 \$MA_REFP_MAX_MARKER_DIST. The monitor prevents a zero marker signal from being overtraveled and the next being evaluated as reference point signal. (Faulty cam adjustment or excessive delay by the PLC user program).
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Check the cam adjustment and make sure that the distance is sufficient between the end of the cam and the zero marker signal that follows. The path must be greater than the axis can cover in the PLC cycle time. Increase the MD34060 \$MA_REFP_MAX_MARKER_DIST, but do not select a value greater than the distance between the 2 zero markers. This might result in the monitor being switched off.
Programm continuation:	Clear alarm with the RESET key. Restart part program
20003	[Channel %1:] Axis %2 measuring system error
Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	In a measuring system with distance-coded reference marks, the distance between two adjacent markers has been found to be more than twice the value entered in MD34300 \$MA_ENC_REFP_MARKER_DIST. The control does not issue the alarm until it has again detected a distance that is too long after having made a 2nd attempt in reverse direction with half the traversing velocity.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Determine the distance between 2 odd reference marks (reference mark interval). This value (which is 20.00 mm on Heidenhain scales) must be entered in MD34060 \$MA_REFP_MAX_MARKER_DIST. Check the reference track of the scale including the electronics for the evaluation.
Programm continuation:	Clear alarm with the RESET key. Restart part program
20004	[Channel %1:] Axis %2 reference mark missing
Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	In the distance-coded length measurement system, 2 reference marks were not found within the defined searching distance (axis-specific MD34060 \$MA_REFP_MAX_MARKER_DIST). A reduction cam is not required for distance-coded scales (but an existing cam will be evaluated). The conventional direction key determines the direction of search. The searching distance MD34060 \$MA_REFP_MAX_MARKER_DIST, within which the two reference marks are expected is counted commencing at the start point.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.

Remedy: Please inform the authorized personnel/service department.
Determine the distance between 2 odd reference point markers (reference point marker interval). This value (which is 20.00 mm on Heidenhain scales) must be entered in the MD34060 \$MA_REFP_MAX_MARKER_DIST.
Check the reference point track of the scale including the electronics for the evaluation.

Programm continuation: Clear alarm with the RESET key. Restart part program

20005 [Channel %1:] Axis %2 reference point approach canceled

Parameters: %1 = Channel number
%2 = Axis name, spindle number

Explanation: Referencing could not be completed for all stated axes (e.g., cancelation caused by missing servo enable, measuring system switchover, release of direction key, etc.).
In distance-coded measuring systems, the alarm will also be displayed if the value 1 has been set in MD34000 \$MA_REFP_CAM_IS_ACTIV (reference cams) and one of the conditions stated in the remedy has been fulfilled.

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Please inform the authorized service personnel. Check the possible reasons for termination:

- Servo enable missing: NC/PLC interface signal DB380x DBX2.1 (Servo enable)
- Measuring system switchover: NC/PLC interface signal DB380x DBX1.5 / 1.6 (Position measuring system 1/2)
- Traversing key + or - missing: NC/PLC interface signal DB380x DBX4.7 / 4.6 (Traversing keys plus/minus)
- Feed override = 0
- The feed disable is active
- Exact stop not reached within MD36020 \$MA_POSITIONING_TIME.
- Drive-side error messages, e.g. reference mark signal, not received

The axis-specific MD34110 \$MA_REFP_CYCLE_NR determines which axes are involved in the channel-specific referencing.

Value	Meaning
-1:	No channel-specific referencing, NC Start without referencing.
0:	No channel-specific referencing, NC Start with referencing.
1-8:	Channel-specific referencing. The number entered here corresponds to the referencing sequence. (When all axes with contents 1 have reached the reference point, then the axes with contents 2 start, etc.).

Programm continuation: Clear alarm with the RESET key. Restart part program

20006 [Channel %1:] Axis %2 reference point shutdown velocity not reached

Parameters: %1 = Channel number
%2 = Axis name, spindle number

Explanation: In phase 2 of reference point approach (wait for zero mark), the cam end was reached but the reference point approach velocity was not within the tolerance window. (This can occur when the axis is already at the end of the cam at the beginning of reference point approach. Phase 1 is therefore considered as being already concluded and will not be started.)
Phase 2 has been interrupted (this time before the cam) and the reference point approach will be started once again automatically with phase 1. If the approach velocity is not reached at the 2nd attempt either, referencing will be stopped and the alarm displayed.

Approach velocity: MD34040 \$MA_REFP_VELO_SEARCH_MARKER
Velocity tolerance: MD35150 \$MA_SPIND_DES_VELO_TOL.

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Please inform the authorized personnel/service department.
Reduce the MD for the approach velocity MD34040 \$MA_REFP_VELO_SEARCH_MARKER and/or increase the MD for the velocity tolerance MD35150 \$MA_SPIND_DES_VELO_TOL.

Programm continuation: Clear alarm with the RESET key. Restart part program

20007 [Channel %1:] Axis %2 reference point approach requires 2 measuring systems

Parameters: %1 = Channel number
%2 = Axis name, spindle number

Explanation: 2 encoders are needed for setting MD34200 \$MA_ENC_REFP_MODE = 6!

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Inform the authorized personnel/service department.
Modify the referencing mode for MD34200 \$MA_ENC_REFP_MODE or install and configure a second encoder.

Programm continuation: Clear alarm with the RESET key. Restart part program

20008 [Channel %1:] Axis %2 reference point approach requires second referenced measuring system

Parameters: %1 = Channel number
%2 = Axis name, spindle number

Explanation: When setting MD34200 \$MA_ENC_REFP_MODE = 6 the 2nd encoder must first be referenced.

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Change the referencing mode in MD34200 \$MA_ENC_REFP_MODE or reference the 2nd encoder.

Programm continuation: Clear alarm with the RESET key. Restart part program

20050 [Channel %1:] Axis %2 handwheel mode active

Parameters: %1 = Channel number
%2 = Axis name, spindle number

Explanation: The axes cannot be traversed in JOG mode using the traversing keys because traversing is still taking place via the handwheel.

Reaction: Alarm display.

Remedy: Decide whether the axis is to be traversed by means of the direction keys or the handwheel. End handwheel travel and delete the axial distance-to-go if necessary (NC/PLC interface signal DB380x DBX2.2 (Delete distance-to-go/Spindle reset)).

Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

20051 [Channel %1:] Axis %2 handwheel mode not possible

Parameters: %1 = Channel number
%2 = Axis name, spindle number

Explanation: The axis is already traveling via the traversing keys, so handwheel mode is no longer possible.

Reaction: Alarm display.

Remedy: Decide whether the axis is to be traversed by means of the jog keys or via the handwheel.

Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

20052 [Channel %1:] Axis %2 already active**Parameters:** %1 = Channel number

%2 = Axis name, spindle number

Explanation: The axis is to traverse as a machine axis in JOG mode using the direction keys on the machine control panel. However, this is not possible because:

1. It is already traversing as a geometry axis (through the channel-specific interface DB3200 DBX1000.7 / 0.6 (Traversing keys -/+) or DB3200 DBX1004.7 / 4.6 (Traversing keys -/+) or DB3200 DBX1008.7 / 8.6 (Traversing keys -/+) or
2. It is already traversing as a machine axis (through the axis-specific interface DB380x DBX4.7 / 4.6 (Traversing keys plus/minus)) or
3. A frame is valid for a rotated coordinate system, and another geometry axis involved in this is already traversing in JOG mode by means of the direction keys.
4. As part of a retraction motion (submode JOG-Retract) it cannot be traversed as a machine axis.

Reaction: Alarm display.**Remedy:** Stop traversing through the channel or axis interface or stop the other geometry axis.**Programm continuation:** Clear alarm with the Delete key or NC START.

20053 [Channel %1:] Axis %2 DRF, \$AA_OFF, FTOCON, external zero point offset not possible**Parameters:** %1 = Channel number

%2 = Axis name, spindle number

Explanation: The axis is traversed in a mode (e.g. referencing) that allows no additional overlaid interpolation.**Reaction:** Alarm display.**Remedy:** Wait until the axis has reached its reference position or terminate reference point approach with "Reset" and start DRF once again.**Programm continuation:** Clear alarm with the Delete key or NC START.

20054 [Channel %1:] Axis %2 wrong index for indexing axis in JOG mode**Parameters:** %1 = Channel number

%2 = Axis name, spindle number

Explanation: 1. The displayed indexing axis is to be traversed incrementally in JOG mode (by 1 indexing position). However, no further indexing position is available in the selected direction.

2. The axis is stationary at the last indexing position. In incremental traversing the working area limitation or the software limit switch is reached without an indexing position being located in front of it at which a stop could be made.

Reaction: Alarm display.**Remedy:** Please inform the authorized personnel/service department. Correct (add to) the list of indexing positions by means of the machine data

MD10900 \$MN_INDEX_AX_LENGTH_POS_TAB_1

MD10910 \$MN_INDEX_AX_POS_TAB_1

MD10920 \$MN_INDEX_AX_LENGTH_POS_TAB_2

MD10930 \$MN_INDEX_AX_POS_TAB_2

or set the working area limits or the software limit switches to other values.

Programm continuation: Clear alarm with the Delete key or NC START.

20055 [Channel %1:] Master spindle not present in JOG mode**Parameters:** %1 = Channel number**Explanation:** The displayed axis is to be traversed as machine axis in JOG mode with revolutionary feed, but no master spindle has been defined from which the actual speed could have been derived.**Reaction:** Local alarm reaction.

Interface signals are set.

Alarm display.

Remedy:	Please inform the authorized personnel/service department. If the revolutionary feed is also to be active in JOG mode, a master spindle must be declared via the channel-specific MD20090 \$MC_SPIND_DEF_MASTER_SPIND. In this case you have to open a screen in the PARAMETER operating area with the softkeys "SETTINGDATA" and "JOG DATA" and preselect the G function G95 there. The JOG feedrate can then be entered in [mm/rev]. (If 0 mm/rev is set as JOG feed, the control takes the value assigned in the axis-specific MD 32050 \$MA_JOG_REV_VELO or in the case of rapid traverse overlay MD32040 \$MA_JOG_REV_VELO_RAPID). The revolutionary feed in JOG mode is deactivated by changing the G function from G95 to G94.
Programm continuation:	Clear alarm with the Delete key or NC START.

20056	[Channel %1:] Axis %2 no revolutionary feedrate possible. Axis/spindle %3 stationary
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Axis name, spindle number
Explanation:	An axis is to traverse in JOG with revolutionary feedrate. However, the feedrate of the spindle/axis from which the feedrate is to be derived is 0.
Reaction:	Alarm display.
Remedy:	You have the following possibilities of eliminating the error: - Traverse the spindle/axis from which the feedrate is to be derived. - Deselect revolutionary feedrate G95 in JOG via the Settings screenform. - Deselect revolutionary feedrate G95 in setting data SD41100 \$SN_JOG_REV_IS_ACTIVE.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

20057	[Channel %1:] Block %2 revolutionary feedrate for axis/spindle %3 is <= zero
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	Revolutional feed has been programmed for an axis/spindle, but the velocity was not programmed or the programmed value is smaller than or equal to zero.
Reaction:	Correction block is reorganized. Local alarm reaction. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Inform the authorized personnel/service department. You have the following possibilities of canceling the alarm; - Correct the part program - Specify a correct feedrate for PLC axes at the VDI interface, - Specify a feedrate for oscillating axes in SD43740 \$SA_OSCILL_VELO.
Programm continuation:	Clear alarm with the RESET key. Restart part program

20058	[Channel %1:] Axis %2 revolutionary feedrate: illegal feed source
Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	An axis/spindle is to be traversed at revolutionary feedrate. The reference axis/spindle defined in SD 43300 \$SA_ASSIGN_FEED_PER_REV_SOURCE refers to itself. The coupling caused cannot be executed.
Reaction:	Alarm display.
Remedy:	The reference axis/spindle must be modified accordingly in SD 43300.

Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

20059 [Channel %1:] Axis %2 already active due to %3

Parameters: %1 = Channel number
%2 = Axis name, spindle number
%3 = Cause

Explanation: The axis (machine axis, geometry axis or orientation axis) is to be traversed in operation mode "Automatic&Jog" (see MD10735 \$MN_JOG_MODE_MASK) by using the direction keys or a handwheel. This is not possible, as (see parameter 3):

1. the axis is active as a rotating spindle
2. the axis is a PLC axis
3. the axis is active as an asynchronous reciprocating axis
4. the axis is active as a command axis
5. the axis is active as a slave axis
6. a frame applies for a rotated coordinate system and an axis involved in the required JOG movement of the geometry axis is not available for this
7. an axis container rotation is activated via NCU link

Note: This alarm identifies an axis not capable of JOG which received a JOG order. In this case, the NCK will not proceed according to "Internal JOG".

Reaction: Alarm display.

Remedy: Wait for the axis to traverse or cancel with distance-to-go delete or RESET.

Programm continuation: Clear alarm with the Delete key or NC START.

20060 [Channel %1:] Axis %2 cannot be traversed as geometry axis

Parameters: %1 = Channel number
%2 = Axis name

Explanation: The axis is currently not in "Geometry axis" state. Therefore, it cannot be traversed in JOG mode as geometry axis. If the word Work (WCS = workpiece coordinate system) is displayed in the "Position" screen, only the geometry axes can be traversed by means of the direction keys! (MCS ... Machine coordinate system; all machine axes can now be traversed by using the direction keys on the machine control panel).

Reaction: Alarm display.

Remedy: Check the operating steps to establish whether geometry axes really must be traversed, otherwise switch over to the machine axes by activating the "Work/Machine" key on the machine control panel.

Programm continuation: Clear alarm with the Delete key or NC START.

20062 [Channel %1:] Axis %2 already active

Parameters: %1 = Channel number
%2 = Axis name, spindle number

Explanation: The displayed axis is already traversing as a machine axis. Therefore, it cannot be operated as a geometry axis. Traversing an axis can take place in JOG mode through 2 different interfaces.

1. As a geometry axis: via the channel-specific interface DB3200 DBX1000.7 / 0.6 (Traversing keys +/-)
2. As a machine axis: via the axis-specific interface DB380x DBX4.7 / 4.6 (Traversing keys plus/minus)

With the standard machine control panel, it is not possible to operate an axis as a machine axis and as a geometry axis at the same time.

Reaction: Alarm display.

Remedy: Do not start the geometry axis until the traversing motion as machine axis has been concluded.

Programm continuation: Clear alarm with the Delete key or NC START.

20064	[Channel %1:] Axis %2 selection of several axes with an active taper angle is not permitted.
Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	With an active taper angle, only one geometry axis at the time can be traversed in JOG mode by pressing traversing keys. Simultaneous traversing of a geometry axis as a machine axis is not permitted either.
Reaction:	NC not ready. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Starting the geometry axis only if traversing of the other geometry axis or machine axis completed.
Programm continuation:	Clear alarm with the RESET key. Restart part program
20065	[Channel %1:] Master spindle not defined for geometry axes in JOG mode
Parameters:	%1 = Channel number
Explanation:	The displayed axis is to be traversed as geometry axis in JOG mode with rotary feed, but no master spindle has been defined from which the actual speed could be derived.
Reaction:	Local alarm reaction. Interface signals are set. Alarm display.
Remedy:	If the revolutionary feedrate is to be active in JOG mode too, then a master spindle must be declared in the channel-specific machine data MD20090 \$MC_SPIND_DEF_MASTER_SPIND. In this case, you have to open a screen in the PARAMETER operating area with the softkeys "SETTINGDATA" and "JOG DATA", and preselect the G function G95 there. The JOG feedrate can then be entered in [mm/rev]. (If 0 mm/rev is set as JOG feedrate, the control takes the value assigned in the axis-specific machine data MD32050 \$MA_JOG_REV_VELO or in the case of rapid traverse override MD32040 \$MA_JOG_REV_VELO_RAPID). The revolutionary feedrate in JOG mode is deactivated by changing the G function from G95 to G94.
Programm continuation:	Clear alarm with the Delete key or NC START.
20070	[Channel %1:] Axis %2 software limit switch %3 programmed end position %4
Parameters:	%1 = Channel number %2 = Axis number %3 = "1+" or "1-" for software limit switches 1, "2+" or "2-" for software limit switch 2, %4 = Programmed end position
Explanation:	The axis is to be traversed by the PLC as a concurrent positioning axis to the limit position. This would violate the corresponding software limit switch for the axis. No traversing takes place. With an additional message to alarm 20140, the axis is to be traversed as a command axis.
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. Specify smaller target position. Modify MD for SW limit switch. Possibly activate another SW limit switch. Retract axis via JOG.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.
20071	[Channel %1:] Axis %2 working area limit %3 end position %4
Parameters:	%1 = Channel number %2 = Axis number %3 = "+" or "-" %4 = Programmed end position
Explanation:	The displayed axis is to be traversed as a "concurrent positioning axis" to the programmed limit position and the corresponding working area limitation active for the axis is violated. No traversing takes place. With an additional message to alarm 20140, the axis is traversed as a command axis.

Reaction:	Alarm display.
Remedy:	- Specify smaller target position. - Deactivate working area limitation. - Set working area limitation differently. - Retract axis with JOG.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

20072 [Channel %1:] Axis %2 is not an indexing axis

Parameters:	%1 = Channel number %2 = Axis number
Explanation:	The displayed axis is operated as a concurrent positioning axis. Its target position is parameterized in the FC INDEX-AXIS as indexing position number, but the axis is not an indexing axis.
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. The FC POS-AXIS for linear and rotary axes should be used or the axis should be declared as an indexing axis. Corresponding machine data for indexing axis declaration: Modify MD30500 \$MA_INDEX_AX_ASSIGN_POS_TAB Modify MD10900 \$MN_INDEX_AX_LENGTH_POS_TAB_1 Modify MD10910 \$MN_INDEX_AX_POS_TAB_1 Modify MD10920 \$MN_INDEX_AX_LENGTH_POS_TAB_2 Modify MD10930 \$MN_INDEX_AX_POS_TAB_2
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

20073 [Channel %1:] Axis %2 cannot be repositioned

Parameters:	%1 = Channel number %2 = Axis number
Explanation:	The concurrent positioning axis cannot be positioned because it has already been restarted via the VDI interface and is still active. No repositioning motion takes place and the motion initiated by the VDI interface is not affected.
Reaction:	Alarm display.
Remedy:	None.
Programm continuation:	Clear alarm with the Delete key or NC START.

20075 [Channel %1:] Axis %2 can currently not oscillate

Parameters:	%1 = Channel number %2 = Axis number
Explanation:	The axis cannot perform an oscillating movement now because it is already being traversed, e.g. in JOG mode.
Reaction:	Alarm display.
Remedy:	End the other traversing motion.
Programm continuation:	Clear alarm with the Delete key or NC START.

20076 [Channel %1:] Axis %2 oscillating - mode change not possible

Parameters:	%1 = Channel number %2 = Axis number
Explanation:	The axis is performing an oscillating movement. Mode change is not possible because oscillation is not allowed in the selected mode.

Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Do not initiate mode change. Cause the PLC to check the axis and make sure in the PLC program that the axis ends oscillation if such mode changes take place.
Programm continuation:	Clear alarm with the RESET key. Restart part program

20077	[Channel %1:] Axis %2 programmed position %4 is behind software limit switch %3
Parameters:	%1 = Channel number %2 = Axis number %3 = "+" or "-" %4 = Target position
Explanation:	The axis is traversed as an oscillating axis and the target position (reversal position or end position) is located behind the corresponding software limit switch. The axis is not traversed.
Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Specify smaller target position. Modify MD for SW limit switch. Possibly activate another SW limit switch.
Programm continuation:	Clear alarm with the RESET key. Restart part program

20078	[Channel %1:] Axis %2 programmed position %4 is behind working area limit %3
Parameters:	%1 = Channel number %2 = Axis number %3 = "+" or "-" %4 = Target position
Explanation:	The axis is traversed as an oscillating axis and the target position (reversal position or end position) is located behind the corresponding effective working area limitation. The axis is not traversed.
Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Specify smaller target position. Deactivate working area limitation. Set working area limitation differentially.
Programm continuation:	Clear alarm with the RESET key. Restart part program

20079	[Channel %1:] Axis %2 oscillation path %3 <= 0
Parameters:	%1 = Channel number %2 = Axis number %3 = Length
Explanation:	The axis is traversed as an oscillating axis and the distance to be traversed is smaller than or equal to zero. For example, both reversal points are situated on an identical position, one reversal point was shifted against the oscillating direction beyond the other reversal point. The axis is not traversed.

Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Specify correct target position (reversal position, end position).
Programm continuation:	Clear alarm with the RESET key. Restart part program

20080 [Channel %1:] Axis %2 no handwheel assigned for override

Parameters:	%1 = Channel number %2 = Axis number
Explanation:	No handwheel has been assigned for this specified axis after handwheel overlay has been started in automatic mode. If the axis identifier is missing in the alarm with active velocity overlay $FD > 0$, then the 1st geometry axis has not been defined in the NC channel. In this case the block is executed without handwheel control.
Reaction:	Alarm display.
Remedy:	If handwheel control is required, a handwheel must be activated.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

20082 [Channel %1:] Axis %2 coordinate system-specific working area limit %3 end position %4

Parameters:	%1 = Channel number %2 = Axis number %3 = "+" or "-" %4 = End position
Explanation:	The displayed axis is operated as a "concurrent positioning axis", and the corresponding active coordinate system-specific working area limitation for the axis is violated. No traversing movement. With an additional message to alarm 20140, the axis is traversed as a command axis.
Reaction:	Alarm display.
Remedy:	- Specify smaller target position. - Deactivate working area limitation. - Set working area limitation differently. - Retract axis with JOG.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

20083 [Channel %1:] Axis %2 programmed position %4 lies behind the coordinate system-specific working area limit %3

Parameters:	%1 = Channel number %2 = Axis number %3 = "+" or "-" %4 = End position
Explanation:	The axis is traversed as a reciprocating axis, and the target position (reversal position or end position) is located behind the corresponding, valid, coordinate system-specific working area limitation. The axis is not traversed.
Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.

Remedy:	Specify smaller target position. Deactivate working area limitation. Set working area limitation differentially.
Programm continuation:	Clear alarm with the RESET key. Restart part program

20085 **[Channel %1:] Contour handwheel: traverse direction or overtravel of beginning of block not allowed**

Parameters:	%1 = Channel number
Explanation:	Travel takes place on the path with the contour handwheel in the opposite direction to the programmed travel direction and the starting point of the path has been reached at the start of the block.
Reaction:	Alarm display.
Remedy:	Turn the contour handwheel in the opposite direction.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

20090 **Axis %1 travel to fixed stop not possible. Check programming and axis data.**

Parameters:	%1 = Axis name, spindle number
Explanation:	1. The "Traverse against fixed stop" function has been programmed with FXS[AX]=1 but the axis does not (yet) support this. Check MD37000 \$MA_FIXED_STOP_MODE. This function is not available for gantry axes and simulated axes. 2. On selection, no movement was programmed for axis AX. AX is a machine axis identifier. 3. It is always necessary to program a traversing movement in the selection block for the axis/spindle for which the "Traverse against fixed stop" function is activated. The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
Reaction:	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. - Check the axis type. - Check MD37000 \$MA_FIXED_STOP_MODE. - Is a machine axis movement missing in the approach block?
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

20091 **Axis %1 has not reached fixed stop**

Parameters:	%1 = Axis name, spindle number
Explanation:	On attempting to traverse against a fixed stop, the programmed end position has been reached or the traversing movement has been canceled. The alarm can be concealed by means of the MD37050 \$MA_FIXED_STOP_ALARM_MASK. The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
Reaction:	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.

Remedy:	Correct the part program and the settings: - Has the traversing block been canceled? - If the axis position does not correspond to the programmed end position, then correct the end position. - If the programmed end position is in the part, the triggering criterion must be checked. - Has the contour deviation leading to triggering been dimensioned too large? Has the torque limit been set too high?
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

20092 Axis %1 travel to fixed stop still active

Parameters:	%1 = Axis name, spindle number
Explanation:	An attempt has been made to move an axis while it is in fixed stop or while the deselection function has not yet been completed. The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
Reaction:	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. Check the following: - Has the axis at the fixed stop also been moved by a traversing movement of geometry axes? - Is a selection carried out even though the axis is stationary at the stop? - Has the deselection process been interrupted by a RESET? - Has the PLC switched the acknowledgment signals?
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

20093 Axis %1 standstill monitoring at fixed-stop end point has been triggered

Parameters:	%1 = Axis name, spindle number
Explanation:	The position of the axis has been beyond the zero speed window ever since selection has been completed. The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
Reaction:	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. - Check the mechanical components, e.g. has the stop broken away? Has the part to be clamped given way? - Position window for zero speed control too small (MD37020 \$MA_FIXED_STOP_WINDOW_DEF) (SD43520 \$SA_FIXED_STOP_WINDOW). Default is 1 mm in each case.
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

20094 Axis %1 function has been canceled

Parameters:	%1 = Axis name, spindle number
--------------------	--------------------------------

Explanation:	The function has been canceled. The possible reasons for this are: - The torque can no longer be provided because a pulse disable has occurred, . - The PLC has removed the acknowledgments. The system variable \$VA_FXS_INFO contains additional information regarding why the function was canceled. The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
Reaction:	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Check whether - there is a pulse disable from the infeed/regenerative-feedback unit or from the PLC? - the acknowledgment bits have been deleted by the PLC even though NCK has not requested deselection? Read out the system variable \$VA_FXS_INFO, and then interpret the additional information.
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

20095 Axis %1 illegal torque, current torque %2

Parameters:	%1 = Axis name, spindle number %2 = Current holding torque when brake test selected
Explanation:	The current holding torque, when brake test selected, cannot be attained with the present parameterization of the brake test.
Reaction:	Alarm display.
Remedy:	Check the parameterization for the brake test function check: - The torque for the counterweight in the drive machine data p1532 should be nearly the same as the current holding torque. The current holding torque is displayed in the alarm text. - The torque set for the brake test MD36966 \$MA_SAFE_BRAKETEST_TORQUE must be greater than the current holding torque.
Programm continuation:	Clear alarm with the Delete key or NC START.

20096 Axis %1 brake test canceled, additional information %2

Parameters:	%1 = Axis name, spindle number %2 = Error information based on \$VA_FXS_INFO
Explanation:	The brake test has detected a problem. The additional information provides more details on the cause of the alarm. The explanation can be found in the \$VA_FXS_INFO system variable documentation. Additional information: 0: No additional information available. 1: Axis type is not a PLC or command axis. 2: Programmed end position reached. 3: Cancel using NC RESET (key reset). 4: Monitoring window exited. 5: Torque reduction rejected by drive. 6: PLC has canceled enables. 7: SINAMICS parameter p2003 is zero, or telegram without torque data.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Note the supplementary conditions of the brake test, see additional info.
Programm continuation:	Clear alarm with the Delete key or NC START.

20097 Axis %1 incorrect travel direction brake test**Parameters:** %1 = Axis name, spindle number**Explanation:** Due to the selected travel direction, the brake test for the current load torque is performed with an incorrect torque.**Reaction:** Alarm display.**Remedy:** - Perform the brake test for the other travel direction
- Adjust drive parameter p1532 better to the current weight ratio. The alarm will occur only if the current torque deviates from drive parameter p1532 by more than 7.5% of MD36966 \$MA_SAFE_BRAKETEST_TORQUE when the brake is released.
- Activate the automatic determination of the load torque at the beginning of the brake test via MD36968 \$MA_SAFE_BRAKETEST_CONTROL, bit 0 = 1.**Programm continuation:** Clear alarm with the Delete key or NC START.

20120 Axis %1: too many compensation relations**Parameters:** %1 = Axis name, spindle number**Explanation:** Interpolatory compensation with tables. For each axis, the maximum number of compensation relationships defined may be no more than the number of axes in the system. In this alarm, the interpolatory compensation in the axis is switched off automatically.**Reaction:** Interface signals are set.
Alarm display.**Remedy:** Check table parameters \$AN_CEC_OUTPUT_AXIS and correct and/or switch off one or more tables (SD41300 \$SN_CEC_TABLE_ENABLE).**Programm continuation:** Clear alarm with the RESET key. Restart part program

20121 Axis %1: Configuration error in compensation table %2**Parameters:** %1 = Axis name, spindle number
%2 = Compensation table**Explanation:** Interpolatory compensation with tables. The settings for the specified table are not allowed. \$AN_CEC_MAX >= \$AN_CEC_MIN and \$AN_CEC_STEP != 0 apply to system variables. This table is switched off automatically.**Reaction:** Interface signals are set.
Alarm display.**Remedy:** Please inform the authorized personnel/service department. Check and correct the characteristic data in the compensation table. If the error cannot be found, the alarm can be suppressed by switching off the table (\$SN_CEC_TABLE_ENABLE) or switching off compensation in the axis (\$MA_CEC_ENABLE).**Programm continuation:** Clear alarm with the RESET key. Restart part program

20122 Compensation table %1: invalid axis assignment**Parameters:** %1 = Compensation table**Explanation:** Interpolatory compensation with tables. Assignment of the input or output axes in the given table is not allowed. \$AN_CEC_INPUT_AXIS and \$AN_CEC_OUTPUT_AXIS != 0 apply to system variables, and both must refer to valid axes. This table is automatically switched off.**Reaction:** Interface signals are set.
Alarm display.**Remedy:** Please inform the authorized personnel/service department. Check and correct the axis assignment in the compensation table. If the error cannot be found, the alarm can be suppressed by switching off the table (\$SN_CEC_TABLE_ENABLE) or switching off compensation in the axis (\$MA_CEC_ENABLE).**Programm continuation:** Clear alarm with the RESET key. Restart part program

20123 Axis %1: different output assignment of multiplied tables**Parameters:** %1 = Axis name, spindle number

Explanation:	Interpolatory compensation with tables. The two tables whose outputs are to be multiplied together have different output axes assigned to them. The compensation in this axis is automatically switched off.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Check and correct the characteristic data in the compensation table (\$AN_CEC_OUTPUT_AXIS and \$AN_CEC_MULT_BY_TABLE). If the error cannot be found, the alarm can be suppressed by switching off the compensation in the axis (\$MA_CEC_ENABLE) or the tables, (\$SN_CEC_TABLE_ENABLE).
Programm continuation:	Clear alarm with the RESET key. Restart part program

20124 **Axis %1: sum of compensation values too large**

Parameters:	%1 = Axis name, spindle number
Explanation:	The sum of the compensation values from all tables assigned to the axis had exceeded the limit value MD32720 \$MA_CEC_MAX_SUM and had to be limited. Contour errors could have occurred as a result.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Check characteristic data of the compensation tables assigned to the axis. Check characteristic curves in the tables (\$AN_CEC).
Programm continuation:	Clear alarm with the RESET key. Restart part program

20125 **Axis %1: change of compensation value is too rapid**

Parameters:	%1 = Axis name, spindle number
Explanation:	The compensation value has changed more rapidly than has been allowed for in MD32730 \$MA_CEC_MAX_VELO. It had to be limited temporarily. The missing section is repeated later but contour errors might have occurred.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Check characteristic data of the compensation tables assigned to the axis. Check characteristic curves in the tables (\$AN_CEC). Possibly one of the input axes has moved more rapidly than provided for.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

20130 **[Channel %1:] Contour tunnel monitoring**

Parameters:	%1 = Channel number
Explanation:	The tool tip has exited the tunnel placed around the desired contour, i.e. the distance between tool tip and desired contour was greater than specified in the MD21050 \$MC_CONTOUR_TUNNEL_TOL. The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. Check the following points in turn: 1. Is the machine in working order? That is, has the alarm been tripped by a sluggish axis, tool breakage or collision? 2. If the machine is in working order, reduce the velocity or improve the controller setting. 3. Possibly increase the size of the tunnel and monitor errors via analog output in order to ascertain the cause.

Programm continuation: Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

20138 [Channel %1:] Block %2 motion synchronous action %3 command axis %4 cannot be traversed

Parameters: %1 = Channel number
%2 = Block number, line number
%3 = Synact ID
%4 = Axis name

Explanation: The axis that should be traversed out of a synchronized action is not available
The following causes are possible:

- The axis is being or will be traversed by the NC program.
This motion can also be made indirectly by means of continuous-path mode or an active frame.
- The axis can be actively assigned on account of a function (e.g. programming of the servo-parameter set).
- A superimposed motion is active for the axis.
- The axis is active as a following axis of a coupling.
- An interpolatory compensation, such as temperature compensation, is active for the axis.

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Modify part program.

Programm continuation: Clear alarm with the RESET key. Restart part program

20139 [Channel %1:] Block %2 motion synchronous action: %3 invalid marker

Parameters: %1 = Channel number
%2 = Block number, line number
%3 = Synact ID

Explanation: Setting or deleting of a marker in the motion-synchronous action is not possible.
Possible causes:
SETM(): Maximum number of markers exceeded; marker has already been set.
CLEARM(): Specified marker is not within permissible value range.

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: SETM(): use marker in valid value range; do not set the marker again.
CLEARM(): use marker in valid value range.

Programm continuation: Clear alarm with the RESET key. Restart part program

20140 [Channel %1:] Traversing of command axis %2 see NC alarm %3 parameter %4

Parameters: %1 = Channel number
%2 = Axis
%3 = NC alarm
%4 = Additional parameter

Explanation: An NC alarm was detected for a command axis, which is to be traversed from a synchronized action. This alarm is output in the 3rd parameter as an HMI alarm number. Parameter 4 may provide additional information.

Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	See help information for the additional alarms.
Programm continuation:	Clear alarm with the RESET key. Restart part program

20141	[Channel %1:] Block %2 motion synchronous action: %3 axis %4 has illegal axis type
Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID %4 = Axis name
Explanation:	The requested command is not permissible in the current axis status for the command axis or spindle. This alarm occurs with command axes (POS, MOV), spindle commands from motion synchronous actions (M3/M4/M5, SPOS), coupled motion (TRAILON, TRAILOF) and lead value coupling (LEADON, LEADOF).
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	First stop the axis or deactivate the coupling, then select a new status.
Programm continuation:	Clear alarm with the RESET key. Restart part program

20143	[Channel %1:] Block %2 motion synchronous action: %3 command axis %4 cannot be started as it is controlled by the PLC
Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID %4 = Axis name
Explanation:	An attempt has been made to start a command axis by means of a block-related or modal synchronous action. This start is not possible as the axis is controlled by the PLC.
Reaction:	Alarm display.
Remedy:	End control of the axis by the PLC and therefore return it to the channel or start the command axis with a static synchronous action.
Programm continuation:	Clear alarm with the Delete key or NC START.

20144	[Channel %1:] Block %2 motion synchronous action: %3 system variable cannot be accessed
Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID
Explanation:	When using system variables, it is assumed that a read/write operation can access the required data successfully. In accesses to encoder actual values or digital I/Os, the result depends on the availability of the corresponding hardware components. If an access within synchronized actions does not return a valid value, alarm 20144 is output. Outside synchronized actions, such a read/write access causes block execution to be interrupted until the result is available. Block execution is subsequently continued.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.

Remedy: Before reading/writing system variables, ensure that it is possible to access, for example, the required hardware components.

Programm continuation: Clear alarm with the RESET key. Restart part program

20145 [Channel %1:] Block %2 motion synchronous action: %3 arithmetic error

Parameters: %1 = Channel number
%2 = Block number, line number
%3 = Synact ID

Explanation: In calculating an arithmetic expression for a motion synchronous action, an overflow has occurred (e.g. division by zero).

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Correct the incorrect expression.

Programm continuation: Clear alarm with the RESET key. Restart part program

20146 [Channel %1:] Block %2 motion synchronous action: %3 nesting depth exceeded

Parameters: %1 = Channel number
%2 = Block number, line number
%3 = Synact ID

Explanation: For calculating arithmetic expressions in motion synchronous blocks, an operand stack with a fixed set size is used. With very complex expressions, this stack can overflow.

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Correct the incorrect expression.

Programm continuation: Clear alarm with the RESET key. Restart part program

20147 [Channel %1:] Block %2 motion synchronous action: %3 command %4 not executable

Parameters: %1 = Channel number
%2 = Block number, line number
%3 = Synact ID
%4 = Program command

Explanation: One of the commands in the synchronized action block cannot be executed, e.g. it is not possible to perform a Reset for the specific synchronized action.

Measurement level 2

- Embargo version does not allow measurement from a synchronized action
- The MEASA command was programmed in a synchronized action
- Measurement is already active
- Programming error (see alarm 21701)

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Change the synchronized action.
Measurement level 2
Execute the measurement task from a part program first, in order to improve the error diagnostics. Do not include the measurement in the synchronized action until the first error-free run has been performed .

Programm continuation: Clear alarm with the RESET key. Restart part program

20148 [Channel %1:] Block %2 motion synchronous action: %3 internal error %4

Parameters: %1 = Channel number
%2 = Block number, line number
%3 = Synact ID
%4 = Error code

Explanation: An internal error has occurred during processing of a synchronous action. The error code is for diagnostics purposes. Please make a note and contact the manufacturer.

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Change the synchronized action.

Programm continuation: Clear alarm with the RESET key. Restart part program

20149 [Channel %1:] Block %2 motion-synchronous action: %3 Index %4 is illegal

Parameters: %1 = Channel number
%2 = Block number, line number
%3 = Synact ID
%4 = Index

Explanation: An invalid index was used to access a variable in the motion-synchronized action. The invalid index is also displayed.

Example: ... DO \$R[\$AC_MARKER[1]] = 100

The error occurs if the value of marker 1 is greater than the maximum permissible R-parameter number.

PROFIBUS/PROFINET I/O:

An invalid slot / I/O area index was used while reading/writing data.

Cause:

- 1.: Slot / I/O area index >= max. number of available slots / I/O areas.
- 2.: Slot / I/O area index references a slot / I/O area that has not been configured.
- 3.: Slot / I/O area index references a slot / I/O area that has not been released for system variables.

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Use a valid index.

Programm continuation: Clear alarm with the RESET key. Restart part program

20150 [Channel %1:] Tool management: PLC terminates interrupted command

Parameters: %1 = Channel number

Explanation: Indication that the PLC has terminated an interrupted command (with alarm output) from the tool management - tool change.

Reaction: Interface signals are set.
Alarm display.

Remedy: This alarm is for information only.

Programm continuation: Clear alarm with the Delete key or NC START.

20160 [Channel %1:] Tool management: PLC can terminate only incorrectly canceled commands

Parameters: %1 = Channel number

Explanation: Note that the PLC wanted to interrupt an active command from the tool management (tool change), or that there is no active command to cancel.

The NCK rejects for the following reasons:

- Channel status is "active". Cancel is not allowed,
- Channel status is "reset". Nothing can be canceled.

Reaction: Interface signals are set.
Alarm display.

Remedy: This alarm is for information only.

Programm continuation: Clear alarm with the Delete key or NC START.

20170 [Channel %1:] Machine data \$AC_FIFO invalid

Parameters: %1 = Channel number

Explanation: The structure of the FIFO variable \$AC_FIFO1 - \$AC_FIFO10 specified by the machine data MD28260 \$MC_NUM_AC_FIFO, MD28262 \$MC_START_AC_FIFO, MD28264 \$MC_LEN_AC_FIFO and MD28266 \$MC_MODE_AC_FIFO cannot be stored in the R parameter field defined in MD28050 \$MC_MM_NUM_R_PARAM.

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Inform the authorized personnel/service department.
Increase the number of R-parameters or reduce the number of FIFO elements.
Set the MD as follows: MD28050 \$MC_MM_NUM_R_PARAM = MD28262 \$MC_START_AC_FIFO + MD28260 \$MC_NUM_AC_FIFO * (MD28264 \$MC_LEN_AC_FIFO + 6)

Programm continuation: Switch control OFF - ON.

20200 [Channel %1:] Invalid spindle number %2 with tool fine compensation

Parameters: %1 = Channel number target channel
%2 = Spindle number

Explanation: There is no spindle/axis assignment in the target channel for the spindle specified in the PUTFTOC command.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Modify program in channel that writes the tool fine compensation.

Programm continuation: Clear alarm with the RESET key. Restart part program

20201 [Channel %1:] Spindle %2 no tool assigned

Parameters: %1 = Channel number
%2 = Spindle number

Explanation: In order to make allowance for the fine tool compensation for the tool currently in the spindle, a spindle/tool assignment must be active. This is not presently the case for the programmed spindle in the target channel of fine tool compensation.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	1. Modify the part program (write the tool fine compensation). 2. Establish spindle/tool assignment by programming: - TMON (tool monitoring) - GWPSON (tool selection)
Programm continuation:	Clear alarm with the RESET key. Restart part program

20203	[Channel %1:] No active tool
Parameters:	%1 = Channel number
Explanation:	A tool fine compensation has been written for the active tool of channel %1 with PUTFTOC. No tool is active in this channel. Therefore, the compensation cannot be assigned.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Correct the program.
Programm continuation:	Clear alarm with the RESET key. Restart part program

20204	[Channel %1:] PUTFTOC command not allowed with FTOCOF
Parameters:	%1 = Channel number
Explanation:	A tool fine compensation has been written for channel %1 with PUTFTOC. The tool fine compensation is not active in this channel. FTOCON must be active in the target channel of the PUTFTOC command.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Correct the program in the machining channel: Select FTOCON so that the channel is ready to receive the PUTFTOC command.
Programm continuation:	Clear alarm with the RESET key. Restart part program

20205	[Channel %1:] Block %2 motion synchronous action: %3 invalid spindle number %4
Parameters:	%1 = Channel number target channel %2 = Block number, line number %3 = Synact ID %4 = Spindle number
Explanation:	There is no spindle/axis assignment in the target channel for the specified spindle.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Modify program.

Programm continuation: Clear alarm with the RESET key. Restart part program

20302 [Channel %1:] Axis %2 cannot be traversed

Parameters: %1 = Channel number
%2 = Axis name, spindle number

Explanation: The displayed axis cannot be traversed as a machine axis because JOG Retract mode has been selected in JOG mode.

Reaction: Alarm display.

Remedy: Deselect JOG Retract with RESET

Programm continuation: Clear alarm with the Delete key or NC START.

20304 [Channel %1:] Axis %2 cannot be traversed as a geometry axis

Parameters: %1 = Channel number
%2 = Axis name, spindle number

Explanation: The displayed axis cannot be traversed as a geometry axis. The geometry axis is part of a retraction motion in JOG Retract mode. The requested motion of the geometry axis would lead to a violation of the permitted retraction direction.

Reaction: Alarm display.

Remedy: Deselect JOG Retract with RESET

Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

20306 [Channel %1:] Cartesian manual traverse not possible

Parameters: %1 = Channel number
%2 = Axis name, spindle number

Explanation: Cartesian manual traverse is not possible in JOG Retract mode.

Reaction: Alarm display.

Remedy: Deselect JOG Retract with RESET

Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

20308 [Channel %1:] Manual traverse in the SZS coordinate system is not possible

Parameters: %1 = Channel number
%2 = Axis name, spindle number

Explanation: Manual traverse in the SZS coordinate system is not possible in JOG Retract mode.

Reaction: Alarm display.

Remedy: Deselect JOG Retract with RESET

Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

20310 [Channel %1:] Axis %2 traverse to the specified position is not possible

Parameters: %1 = Channel number
%2 = Axis name, spindle number

Explanation: The displayed axis cannot be traversed to the entered position in JOG Retract mode. It is limited to the interrupt position when JOG Retract was selected.

Reaction: Alarm display.

Remedy: Traverse within the permitted positions

Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

21550	[Channel %1:] Axis %2 Travel from hardware limit switch not possible. Reason: %3
Parameters:	%1 = Channel number %2 = Axis name %3 = Cause
Explanation:	It has been tried to retract a following axis of an axis coupling or an output axis of a transformation through the master axis or input axis of a transformation. This is not permitted in the current situation. Possible reasons: 1 No permissible direction of retraction 2 Coupling not synchronous 3 Retraction not permitted for the active coupling 4 Reserved 5 Retraction not permitted for the active transformation
Reaction:	NC Start disable in this channel. Alarm display.
Remedy:	Remedy for error cause: 1 Define another travel direction 2 Deactivate the coupling and travel the axis/axes separately 3 Deactivate the coupling and travel the axis/axes separately 4 Reserved 5 Deactivate the transformation and travel the axis/axes separately
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.
21600	Monitoring for ESR active
Explanation:	-
Reaction:	NC not ready. Alarm display. All alarm responses are delayed by one IPO cycle.
Remedy:	The display can be suppressed with MD 11410 \$MN_SUPPRESS_ALARM_MASK Bit 16 = 1
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.
21610	[Channel %1:] Axis %2 encoder %3 frequency exceeded
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = String (encoder number)
Explanation:	The maximum permissible frequency of the currently active encoder (axis-specific interface signal DB380x DBX1.5 / 1.6 (position measuring system 1/2)) in the axis-specific MD36300 \$MA_ENC_FREQ_LIMIT [n] (n ... encoder number, 1 or 2) has been exceeded. The reference of the actual value to the mechanical slide position may have been lost. The alarm can be reprogrammed in MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
Reaction:	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Check MD36300 \$MA_ENC_FREQ_LIMIT [n] and NC/PLC interface signal DB380x DBX1.5 / 1.6 (position measuring system 1/2).
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

21611 [Channel %1:] NC-controlled Extended Stop/Retract triggered

Parameters:	%1 = Channel number
Explanation:	"NC-controlled Extended Stop/Retract" triggered.
Reaction:	The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. All channel-specific alarm reactions are delayed with this alarm, alarm display.
Remedy:	Reset
Programm continuation:	Clear alarm with the RESET key. Restart part program

21612 [Channel %1:] Axis %2: enable reset, cause %3

Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Cause of the alarm
Explanation:	Causes of alarm: 0: The cause of the alarm cannot be precisely determined. 1: The interface signal DB380x DBX2.1 (Servo enable) is missing 2: The interface signal DB380x DBX4001.7 (Pulse enable) is missing 3: Drive signal DB390x DBX4001.7 (Impulses enabled) is not set 4: Drive signal DB390x DBX4001.5 (Drive ready) is not set 5: Drive signal DB390x DBX4000.4 (Autonomous drive) does not follow the NC setpoints One of the motion-enabling signals (e.g. "Servo enable", "Pulse enable", parking/encoder selection (only for axes) or drive-specific enables has been reset for the displayed axis. The alarm can be reported with positioning axes, spindles and for axes from the geometry grouping. The axes entered in the channel-specific MD array MD20050 \$MC_AXCONF_GEOAX_ASSIGN_TAB are regarded as axes belonging to the geometry grouping. Servo enable must exist for all available geometry axes, regardless of whether or not they are currently in motion. Occurs in connection with SAFETY function: If a test stop is performed with linked axes, the alarm is issued if a motion command from the ELG grouping is pending during the test stop of the following axis.
Reaction:	The NC switches to follow-up mode. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Check the interface signals DB380x DBX2.1 (Servo enable), DB380x DBX4001.7 (Pulse enable), check the drive signals DB390x DBX4001.7 (Pulses enabled), DB390x DBX4001.5 (Drive ready) for example with the PLC status display in the DIAGNOSTICS operating area. Check the encoder selection (for axes) as well as other signals enabling motion according to the drive type used. When the terminal enables of the drive have failed, trace back the wiring or hardware function (for example relay function) or proceed as stated in the relevant drive documentation. With SAFETY: With active actual-value linkage, output of the error message on the slave axis can be prevented by increasing MD36060 \$MA_STANDSTILL_VELO_TOL (default value is 5 mm).
Programm continuation:	Clear alarm with the Delete key or NC START.

21614	[Channel %1:] Axis %2 hardware limit switch %3
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = String (+, - or +/-)
Explanation:	The signal DB380x DBX1000.1 und .0 (Hardware limit switch plus/minus) has been set at the NC/PLC interface.
Reaction:	NC Start disable in this channel. Alarm display.
Remedy:	Please inform the authorized personnel/service department. 1. With axes that have already been referenced, the software limit switch 1 or 2 should respond before the hardware limit switch is reached. Check MD36110 \$MA_POS_LIMIT_PLUS, MD36100 \$MA_POS_LIMIT_MINUS, MD36130 \$MA_POS_LIMIT_PLUS2 and MD36120 \$MA_POS_LIMIT_MINUS2 and the NC/PLC interface signal for the selection DB380x DBX1000.3 / 1000.2 (1st/2nd software limit switch plus/minus) and correct, if necessary (PLC user program). 2. If the axis has not yet been referenced, it is possible to depart from the hardware limit switch in the opposite direction in JOG mode. 3. Check the PLC user program and the connection from the switch to the PLC input module, provided the axis has not reached the hardware limit switch at all.
Programm continuation:	Clear alarm with the RESET key. Restart part program
21616	[Channel %1:] Block %2 overlaid motion active at transformation switchover
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The overlaid motion in the BCS changes its significance because of the transformation change and can therefore lead to undesired axis movements.
Reaction:	Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Take out the overlaid movement.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
21617	[Channel %1:] Block %2 transformation does not allow to traverse the pole
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The preset curve passes through the pole or a forbidden area of the transformation.
Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Modify the part program (if the alarm has occurred in AUTO mode). To escape from the alarm position, transformation must be deselected (it is not enough to try a RESET if the transformation remains active when RESET is applied).
Programm continuation:	Clear alarm with the RESET key. Restart part program
21618	[Channel %1:] As from block %2 transformation active: overlaid motion too great
Parameters:	%1 = Channel number %2 = Block number, label

Explanation:	The share of overlaid motion on the transformation-related axes is so high that the path movement planned by the preparation no longer sufficiently corresponds to the actual ratio for the interpolation. Strategy of singularities, monitoring of working range limitation and dynamic Look Ahead are possibly no longer correct.
Reaction:	Alarm display.
Remedy:	With overlaid motion, keep a sufficiently large path safety distance with regard to poles and working range limitations.
Programm continuation:	Clear alarm with the Delete key or NC START.

21619 [Channel %1:] Block %2 transformation active: motion not possible

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The machine kinematics do not allow the specified motion. Transformation-dependent error causes may be: With TRANSMIT: There is a circular area around the pole, where positioning is not possible. This area exists because the tool reference point cannot be traversed into the pole. The area is defined by the following factors: - Machine data (MD249.. \$MC_TRANSMIT_BASE_TOOL...) - Active tool length compensation (see \$TC_DP..). Whether the tool length compensation is included in the calculation depends on the selected working plane (see G17,...). The machine stops at the edge of the area where positioning is not possible. For TRAJNT: An attempt was made to activate a TRAJNT transformation with Y(WCS)<>0. (The Y axis must be set to WCS=0 when calling TRAJNT).
Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Modify the part program. Change the incorrectly specified tool length compensation. Note that RESET alone is not enough if transformation also remains active beyond RESET.
Programm continuation:	Clear alarm with the RESET key. Restart part program

21620 [Channel %1:] Axis %2 Emergency braking ramp activated

Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	An axial emergency braking ramp was activated for the specified axis/spindle The following causes are possible for the activation of the emergency braking ramp: - Alarm 26052: Path velocity for auxiliary function output too high - Alarm 1012 : System error with ID 550006 550006 - Alarm 1016 : System error with ID 550003, 550005 and 550010 With master/slave coupling, MD30132 \$MA_IS_VIRTUAL_AX (axis is virtual axis) has been set. Braking request with priority 13 may have been requested by the OEM application.
Reaction:	NC Start disable in this channel. Local alarm reaction. The NC switches to follow-up mode. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Remove or reset the cause of the alarm.
Programm continuation:	Clear alarm with the RESET key. Restart part program

21621	[Channel %1:] Block %2 The constant transformation axis %3 has moved.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Channel axis identifier
Explanation:	An axis whose position must remain constant for the transformation in the current block has moved.
Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Change part program if alarm has occurred in AUTO mode. The alarm is cancelled with RESET. If the transformation is retained beyond RESET, the constant axis goes into the transformation with its new position. If that is not wanted, the transformation must be deselected, and the axis position changed in this state. The transformation can then be reactivated.
Programm continuation:	Clear alarm with the RESET key. Restart part program
21650	[Channel %1:] Axis %2 overlaid motion not allowed
Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	An overlaid motion was requested for the axis, however, this is not allowed due to the MD32074 \$MA_FRAME_OR_CORRPOS_NOTALLOWED.
Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Inform the authorized personnel/service department. Deselect the overlaid motion or change MD32074 \$MA_FRAME_OR_CORRPOS_NOTALLOWED.
Programm continuation:	Clear alarm with the RESET key. Restart part program
21660	[Channel %1:] Block %2 axis %3 conflict between SYNACT: \$AA_OFF and CORROF
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name
Explanation:	When deselecting the position offset (\$AA_OFF) via the part program command CORROF (<axis>, "AA_OFF") an active synchronized action is detected that immediately sets \$AA_OFF for the axis (DO_\$AA_OFF [<axis>] =<value>). Deselection is executed and \$AA_OFF not set again.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

21675	[Channel %1:] Block %2 impermissible motion on change of tool direction and \$AA_TOFF active
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	If an offset is active in tool direction via \$AA_TOFF[i] there must not be a geometry axis movement in a block in which the tool orientation is changed abruptly. Abrupt changes of the tool orientation, whereby a movement of the geometry axes can be programmed simultaneously, can, for example, occur during a plane change, tool change, or activation and deactivation of an orientable tool carrier.
Reaction:	Correction block is reorganized. Local alarm reaction. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	- Modify part program - Program TOFFOF()
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
21700	[Channel %1:] Block %3 axis %2 touch probe already deflected, edge polarity not possible
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number
Explanation:	The probe programmed under the keyword MEAS or MEAW is already deflected and has switched. For a further measuring operation, the probe signal must first be canceled (quiescent state of the probe). The axis display is of no significance at present but an axis-specific evaluation has been planned for later stages of development. Note: If the MEAS or MEAW command is used in conjunction with a simulation system or a control system with simulated axes, then MD13231 \$MN_MEAS_PROBE_OFFSET must be checked in the event of an alarm. The value in this machine data moves the MEAS switching position and must be less than the length of the programmed measuring distance.
Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Verify the starting position of the measuring operation or check the probe signals in the PLC interface DB2700 DBX1.0 / .1 (Probe actuated key 1/key 2). Are the cables and connectors in good order?
Programm continuation:	Clear alarm with the RESET key. Restart part program
21701	[Channel %1:] Block %3 axis %2 measurement not possible
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number

Explanation:	Measurement level 2 (MEASA, MEAWA, MEAC). There is an error in the programmed measurement task. Possible causes: - Invalid measurement mode - Invalid probe - Invalid encoder - Invalid number of measurement signal edges - Identical measurement signal edges are only programmable in mode 2 - Invalid FIFO number - Mismatch between the number of FIFOs programmed and the number of probes used in the measurement task. Further causes: A measurement task is already active (e.g. from a synchronized action).
Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Correct the measurement tasks.
Programm continuation:	Clear alarm with the RESET key. Restart part program

21702 [Channel %1:] Block %3 axis %2 measurement canceled

Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number
Explanation:	The measurement block has ended (the programmed end position of the axis has been reached) but the activated touch probe has not yet responded. Measurement level 2 (MEAWA, MEASA, MEAC) Measured values cannot be converted to the workpiece coordinate system. The measured values of the GEO axes programmed in the measurement task are only available in the machine coordinate system. Causes: Not all GEO axes were programmed in the measurement task. At least one measured value is therefore missing for conversion back into the workpiece coordinate system. Further causes: The measurement tasks programmed for all GEO axes are not identical. When making measurements without handshake, two probes must be available in drive parameters p0680 index 0 and 1.
Reaction:	Alarm display.
Remedy:	Check the traversing movement in the measurement block. - Is it necessary in all cases for the activated probe to have switched up to the specified axis position? - Are the probe, cable, cable distributor, terminal connections in good order? - Is the probe correctly wired and configured on the hardware side (e.g. drive parameters p0488 and p0489)? Either program all GEO axes explicitly or program the traversing movement with the POS[axis] command.
Programm continuation:	Clear alarm with the Delete key or NC START.

21703 [Channel %1:] Block %3 axis %2 touch probe not deflected, illegal edge polarity

Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number
--------------------	---

Explanation:	The selected probe is not (!) deflected and therefore cannot record any measured value from the deflected to the non-deflected state. Measurement level 2 (MEAWA, MEASA, MEAC) The degree of deflection of the probe at the start of the measurement task is identical to the first programmed measurement signal edge. The test is only performed in mode 2.
Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	- Check probe - Check start positioning for measuring - Check program
Programm continuation:	Clear alarm with the RESET key. Restart part program

21740 Output value at analog output no. %1 has been limited

Parameters:	%1 = No. of output
Explanation:	The value range of the analog output n is limited by MD10330 \$MN_FASTIO_ANA_OUTPUT_WEIGHT[n].
Reaction:	Alarm display.
Remedy:	With \$A_OUTA[...] = x no greater values can be programmed than permitted in the respective machine data.
Programm continuation:	Clear alarm with the Delete key or NC START.

21760 [Channel %1:] Block %2 motion synchronous action: %3 too many auxiliary functions programmed

Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID
Explanation:	The number of programmed auxiliary functions has exceeded the maximum permissible amount. This alarm can occur in conjunction with motion synchronous actions: The maximum number of auxiliary functions must not be exceeded in motion block and motion synchronous actions.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Modify part program.
Programm continuation:	Clear alarm with the RESET key. Restart part program

21800 [Channel %1:] Workpiece setpoint %2 reached

Parameters:	%1 = Channel number %2 = Workpiece setpoint
--------------------	--

Explanation:	This alarm is activated via MD27880 \$MC_PART_COUNTER, bit 1: The number of counted workpieces (\$AC_ACTUAL_PARTS or \$AC_SPECIAL_PARTS) is equal or already greater than the programmed value for the number of required workpieces (\$AC_REQUIRED_PARTS). At the same time, the channel VDI signal "Workpiece setpoint reached" is output. The value for the number of counted workpieces (\$AC_ACTUAL_PARTS) is reset, while the value of \$AC_SPECIAL_PARTS is retained. Note: The setpoint/actual comparisons of the workpieces are only made after an NC start under the condition that \$AC_REQUIRED_PARTS > 0. If \$AC_REQUIRED_PARTS has a negative value, all workpiece counts activated through MD27880 \$MC_PART_COUNTER are frozen at the values they have reached, and the nominal/actual comparison is discontinued.
Reaction:	NC not ready. Interface signals are set. Alarm display.
Remedy:	No program interrupt. Delete alarm display.
Programm continuation:	Clear alarm with the Delete key or NC START.

21900	[Channel %1:] Block %2 CALCFIR calculation not possible for axis %3, Cause: %4.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name %4 = Identification of cause
Explanation:	CALCFIR calculation is not possible for FIR filters. Cause: 1: No jerk filter activated in MD32400 \$MA_AX_JERK_ENABLE. 2: No jerk filter of the type FIR parameterized in MD32402 \$MA_AX_JERK_MODE for the filter chain selected with MD32404 \$MA_CALCFIR_SELECT. 3: No jerk filter of the type FIR with Hamming window parametrized in MD32409 \$MA_AX_JERK_FIR_WINDOW for the filter chain selected with MD32404 \$MA_CALCFIR_SELECT. 4: MD32404 \$MA_CALCFIR_SELECT does not affect the same filter chain or the same mode in the channel axes. 5: MD32405 \$MA_CALCFIR_FREQ does not lie within the range of 10 to 100 Hz for a dynamic mode. 6: MD32431 \$MAX_AX_JERK does not lie within the range of 5 to 500 m/s³ (or 1.8 bis 180 1/s³ for rotary axes in Advanced Mode) for a dynamic mode. 7: Values cannot be calculated 8: Adjustment of filter delay time not possible because the phase filter in MD32890 \$MA_DESVAL_DELAY_ENABLE is not activated. 9: Adjustment of filter amplitude not possible because t CALCFIR settings differ too much.
Reaction:	Alarm display. Interface signals are set. Interpreter stop
Remedy:	Remedies for causes: 1: Activate jerk filter: MD32400 \$MA_AX_JERK_ENABLE = TRUE 2: Select FIR low pass type 5 in MD32402 \$MA_AX_JERK_MODE 3: Select Hamming window: MD32409 \$MA_AX_JERK_FIR_WINDOW = 1 4: Select identical filter chain in all channel axes, see MD32404 \$MA_CALCFIR_SELECT 5: Select MD32405 \$MA_CALCFIR_FREQ in the permissible range from 10 to 100 Hz, or deactivate CALCFIR calculation (MD32405 \$MA_CALCFIR_FREQ = 0 Hz) 6: Select MD32431 \$MA_MAX_AX_JERK in the permissible range from 5 to 500 m/s³ (or 1.8 to 180 1/s³ for rotary axes in Advanced Mode) or deactivate CALCFIR calculation (MD32405 \$MA_CALCFIR_FREQ = 0 Hz) 7: Please inform the authorized personnel/service department 8: Activate phase filter: MD32890 \$MA_DESVAL_DELAY_ENABLE = TRUE 9: Decrease MD32405 \$MA_CALCFIR_FREQ or increase MD32406 \$MA_CALCFIR_TOL.

Programm continuation: Clear alarm with the RESET key. Restart part program

22000 [Channel %1:] Block %2 Spindle %3 Gear stage change in %4 not possible

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Spindle number
%4 = Gear stage

Explanation: A gear stage change for the spindle will not be possible, if:
- thread cutting (G33, G34, G35) is active
- the spindle is active as master or slave spindle in a coupling
- the spindle is being positioned

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: The gear stage is to be set prior to the corresponding machining step.
If it is necessary, however, to change the gear stage within one of the above mentioned functions, this function must be switched off for the time of the gear stage change. Thread cutting is deselected with G1; synchronous spindle coupling is switched off with COUPOF; the spindle positioning operation is exited with M3, M4 or M5.

Programm continuation: Clear alarm with the RESET key. Restart part program

22001 [Channel %1:] Block %2 Axis %3: Braking time %6 [s] longer than Stop D time. Reason: %5.

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis name
%4 = Reason | Braking time[s]

Explanation: The current axis dynamic response and/or parameterized Stop D time are not sufficient to come to a standstill on time when a Stop D is triggered.

Note:

Parameter 4 contains the descriptions of parameters 5 and 6 separated by the "|" character.

Parameter 5 = Reason, possible values:

1: MD32300 \$MA_MAX_AX_ACCEL too low.

2: MD32431 \$MA_MAX_AX_JERK too low.

3: Excessive acceleration reduction activated with ACC or subsequent to FXST.

4: Excessive jerk reduction programmed with JERKLIMA.

Parameter 6 = Braking time [s]

The displayed time is the expected braking time determined for the current type of movement or the dynamic response setting of the axis.

Reaction: Alarm display.

Remedy: For 'NC-based' SI monitoring:
Increase MD36953 \$MA_SAFE_STOP_SWITCH_TIME_D.
For 'drive-based' SI monitoring:
Increase Stop D time in the drive (p9553).
Increase MD32300 \$MA_MAX_AX_ACCEL and MD32431 \$MA_MAX_AX_JERK.
Increase programmed acceleration (ACC) or jerk (JERKLIMA).
Correct torque and acceleration reduction subsequently to FXST.
Alarm can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK_2 bit 13.

Programm continuation: Clear alarm with the Delete key or NC START.

22002	[Channel %1:] Spindle %2: Braking time %6 [s] longer than Stop D time with gear stage %3. Reason %5
Parameters:	%1 = Channel number %2 = Spindle number %3 = Gear stage %4 = Reason Braking time[s]
Explanation:	The dynamic response values configured for the spindle and/or the parameterized Stop D time are not sufficient to come to a standstill on time when a Stop D is triggered. Parameter 3 contains the gear stage whose braking time from the configured dynamic response values overshoots the Stop D time the most. Note: Parameter 4 contains the descriptions of parameters 5 and 6 separated by the " " character: Parameter 5 = Reason, possible values: 10: Dynamic response for speed control: MD35130 \$MA_GEAR_STEP_MAX_VELO_LIMIT, MD35200 \$MA_GEAR_STEP_SPEEDCTRL_ACCEL 11: Dynamic response for position control: MD35135 \$MA_GEAR_STEP_PC_MAX_VELO_LIMIT, MD35210 \$MA_GEAR_STEP_POSCTRL_ACCEL. Excessive acceleration reduction programmed subsequent to FXST. 21: Dynamic response for tapping with G331, G332: MD35135 \$MA_GEAR_STEP_PC_MAX_VELO_LIMIT, MD35212 \$MA_GEAR_STEP_POSCTRL_ACCEL2 Parameter 6 = Braking time [s] The displayed time is the expected braking time determined for the current dynamic response values of the spindle.
Reaction:	Alarm display.
Remedy:	For 'NC-based' SI monitoring: Increase MD36953 \$MA_SAFE_STOP_SWITCH_TIME_D or reduce the braking time by changing the spindle's dynamic response configuration. For 'drive-based' SI monitoring: Increase Stop D time in the drive (p9553). Reduce the braking time by changing the spindle's dynamic response configuration. The alarm can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK_2 bit 13.
Programm continuation:	Clear alarm with the Delete key or NC START.
22005	[Channel %1:] Block %2 motion synchronous action %3 spindle %4 selected gear stage not installed
Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID %4 = Spindle number
Explanation:	The first gear stage data block is active. The required gear stage is not installed in the 1st gear stage data block. The number of installed gear stages is configured in MD35090 \$MA_NUM_GEAR_STEPS. Examples for the occurrence of the alarm with 3 gear stages installed (MD35090 \$MA_NUM_GEAR_STEPS = 3): * ...DO M44 or DO M45 was programmed in synchronized action for the spindle concerned. * ...DO M70 was programmed and MD35014 \$MA_GEAR_STEP_USED_IN_AXISMODE was larger than 3.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Modify part program: Only those valid gear stages can be entered which have also been installed according to MD35090 \$MA_NUM_GEAR_STEPS. Limit M70 configuration (MD 35014 \$MA_GEAR_STEP_USED_IN_AXISMODE) to MD35090 \$MA_NUM_GEAR_STEPS.
Programm continuation:	Clear alarm with the RESET key. Restart part program

22006	[Channel %1] Block %2 Motion-synchronous action: %3 Spindle %4 gear stage change not possible
Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID %4 = Spindle number
Explanation:	A gear stage change for the spindle will not be possible, if: - thread cutting (G33, G34, G35) is active - the spindle is active as master or slave spindle in a coupling - the spindle is being positioned
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	The gear stage is to be set prior to the corresponding machining step. If it is necessary, however, to change the gear stage within one of the above mentioned functions, this function must be switched off for the time of the gear stage change. Thread cutting is deselected with G1; synchronous spindle coupling is switched off with COUPOF; the spindle positioning operation is exited with M3, M4 or M5.
Programm continuation:	Clear alarm with the RESET key. Restart part program
22010	[Channel %1:] Block %3 spindle %2 actual gear stage differs from requested gear stage
Parameters:	%1 = Channel number %2 = Spindle number %3 = Block number, label
Explanation:	The requested gear stage change has been concluded. The actual gear stage reported by the PLC as being engaged is not the same as the required gear stage called for by the NC. Note: Wherever possible, the requested gear stage should always be engaged.
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. Correct the PLC program.
Programm continuation:	Clear alarm with the Delete key or NC START.
22011	[Channel %1:] Block %3 spindle %2 change to programmed gear stage not possible
Parameters:	%1 = Channel number %2 = Spindle number %3 = Block number, label
Explanation:	With the 'DryRun', 'ProgramTest' and 'SearchRunByProgTest' functions deselected, it is not possible in the REPOS module to carry out a gear stage change to a previously programmed gear stage. This is the case, if the spindle is in the deselection block not active in speed control mode, as a slave axis or in a transformation. Execution of a gear stage change is avoided if the above mentioned functions are deselected by resetting bit 2 of MD35035 \$MA_SPIND_FUNCTION_MASK.
Reaction:	Alarm display.
Remedy:	Change deselection block or block search target block to speed control mode (M3, M4, M5, SBCOF). Set bit 2 of MD35035 \$MA_SPIND_FUNCTION_MASK to 0.
Programm continuation:	Clear alarm with the Delete key or NC START.
22012	[Channel %1:] Block %2 leading spindle %3 is in simulation.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Leading spindle number

Explanation:	When coupling, no synchronism can be achieved if the lead spindle/axis is in simulation mode and the following spindle/axis is not.
Reaction:	Alarm display.
Remedy:	Switch the following spindle/axis to simulation mode or do not simulate the lead spindle/axis (MD30130 \$MA_CTRLOUT_TYPE). If the differing settings have been selected on purpose, the alarm can be suppressed with MD11410 \$MN_SUPPRESS_ALARM_MASK bit 21 = 1 or with CP programming by setting CPMALARM[FAx] bit 3 = 1.
Programm continuation:	Clear alarm with the Delete key or NC START.

22013	[Channel %1:] Block %2 dependent spindle %3 is in simulation.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Number of following spindle
Explanation:	When coupling, no synchronism can be achieved if the following spindle/axis is in simulation mode and the lead spindle/axis is not.
Reaction:	Alarm display.
Remedy:	Switch the leading spindle/axis to simulation mode or do not simulate the following spindle/axis (MD30130 \$MA_CTRLOUT_TYPE). If the differing settings have been selected on purpose, the alarm can be suppressed with MD11410 \$MN_SUPPRESS_ALARM_MASK bit 21 = 1 or with CP programming by setting CPMALARM[FAx] bit 4 = 1.
Programm continuation:	Clear alarm with the Delete key or NC START.

22014	[Channel %1:] Block %2. The dynamics of leading spindle %3 and dependent spindle %4 is too variably
Parameters:	%1 = Channel number %2 = Block number, label %3 = Leading spindle number %4 = Number of following spindle
Explanation:	If the spindles / axes differ strongly in their dynamic behavior during coupling, synchronism cannot be achieved. The dynamics are dependent on many settings: default feedforward control, parameter block data, first of all the servo gain factor, symmetrizing time, etc., feedforward control mode and feedforward setting parameter, FIPO mode, jerk filter and dynamic filter settings, DSC on/off. Among these are the following machine data: MD32620 \$MA_FFW_MODE, MD32610 \$MA_VELO_FFW_WEIGHT, MD33000 \$MA_FIPO_TYPE, VEL_FFW_TIME, MD32810 \$MA_EQUIV_SPEEDCTRL_TIME, MD32200 \$MA_POSCTRL_GAIN, MD32410 \$MA_AX_JERK_TIME, MD32644 \$MA_STIFFNESS_DELAY_TIME, MD37600 \$MA_PROFIBUS_ACTVAL_LEAD_TIME, MD37602 \$MA_PROFIBUS_OUTVAL_DELAY_TIME, MD10082 \$MN_CTRLOUT_LEAD_TIME
Reaction:	Alarm display.
Remedy:	Use spindles/axes with identical dynamic responses. If the differing settings have been selected on purpose, the alarm can be suppressed with MD11410 \$MN_SUPPRESS_ALARM_MASK bit 21 = 1 or with CP programming by setting CPMALARM[FAx] bit 5 = 1.
Programm continuation:	Clear alarm with the Delete key or NC START.

22015	[Channel %1:] Block %2 following spindle %3 No dynamic response for supplementary motion
Parameters:	%1 = Channel number %2 = Block number, label %3 = Number of following spindle
Explanation:	The differential motion of the following spindle cannot be executed due to a lack of available velocity. The coupling consumes the entire available dynamic response. The following spindle is already rotating at maximum speed. In the part program a deadlock might occur. The alarm can be suppressed with MD11410 \$MN_SUPPRESS_ALARM_MASK bit 26 = 1 or with CP programming by setting CPMALARM[FAx] bit 6 = 1.
Reaction:	Alarm display.
Remedy:	Reduce the speed of the master spindle

Programm continuation: Clear alarm with the Delete key or NC START.

22016 [Channel %1:] Block %2 following spindle %3 in the range of reduced acceleration capability

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Number of following spindle

Explanation: The following spindle is driven with position control. Additional motion components of the following spindle should not leave the linear range of the motor used. If they do, deviations may occur in the contour and servo alarms could even be output. Monitoring is based on the configuration in MD35220 \$MA_ACCEL_REDUCTION_SPEED_POINT. If the situation is being managed by the user, the alarm can be suppressed with MD11410 \$MN_SUPPRESS_ALARM_MASK bit 25 = 1 or with CP programming by setting CPMALARM[FAx] bit 7 = 1.

Reaction: Alarm display.

Remedy: Use coupling type VV and safeguard SPCOF for master and following spindle.

Programm continuation: Clear alarm with the Delete key or NC START.

22018 [Channel %1:] Block %2 following axis/spindle %3 time monitoring: 'Synchronism fine' not reached

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Following axis/spindle number

Explanation: After reaching the setpoint-side synchronism, the time until reaching the actual value-side synchronism is fine monitored. The tolerance is not reached within the time window defined in MD37240 \$MA_COUP_SYNC_DELAY_TIME[0]:
MD37210 \$MA_COUPLE_POS_TOL_FINE and MD37230 \$MA_COUPLE_VELO_TOL_FINE

Reaction: Alarm display.

Remedy: Please inform the authorized personnel/service department.

The interrelation between MD37240 \$MA_COUP_SYNC_DELAY_TIME[0] and MD37210 \$MA_COUPLE_POS_TOL_FINE or MD37230 \$MA_COUPLE_VELO_TOL_FINE must be adapted to the mechanical conditions.

Programm continuation: Clear alarm with the Delete key or NC START.

22019 [Channel %1:] Block %2 following axis/spindle %3 time monitoring: 'Synchronism coarse' not reached

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Following axis/spindle number

Explanation: After reaching the setpoint-side synchronism, the time until reaching the actual value-side synchronism is coarsely monitored. The tolerance is not reached within the time window defined in MD37240 \$MA_COUP_SYNC_DELAY_TIME[1]:
MD37200 \$MA_COUPLE_POS_TOL_COARSE or MD37220 \$MA_COUPLE_VELO_TOL_COARSE

Reaction: Alarm display.

Remedy: Please inform the authorized personnel/service department.

The interrelation between MD37240 \$MA_COUP_SYNC_DELAY_TIME[1] and MD37200 \$MA_COUPLE_POS_TOL_COARSE or MD37220 \$MA_COUPLE_VELO_TOL_COARSE must be adapted to the mechanical conditions.

Programm continuation: Clear alarm with the Delete key or NC START.

22020 [Channel %1:] Block %3 spindle %2 gear step change position not reached

Parameters: %1 = Channel number
%2 = Spindle number
%3 = Block number, label

Explanation:	Through the configuration of MD35010 \$MA_GEAR_STEP_CHANGE_ENABLE[AXn] = 2, the spindle is traversed to the position stored in MD35012 \$MA_GEAR_STEP_CHANGE_POSITION[AXn] before the actual gear step change. The required gear step change position has not been reached.
Reaction:	Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Correct sequence in the PLC.
Programm continuation:	Clear alarm with the RESET key. Restart part program

22022	[Channel %1:] Block %2 spindle %3 gear stage %4 is expected for axis mode.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Spindle %4 = Gear stage
Explanation:	The gear stage required for axis mode has not been installed. A gear stage has been configured in MD35014 \$MA_GEAR_STEP_USED_IN_AXISMODE, in which the spindle is to be in axis mode. This gear stage is checked whenever the spindle is switched into axis mode. The configured gear stage is compared with the gear stage output by the PLC (NC/PLC interface signal DB380x DBX2000.0 - .2 (Actual gear stage A through C)). This alarm will be output if the gear stages are not the same.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Program M70 before the switch to axis mode. The gear stage configured in MD35014 \$MA_GEAR_STEP_USED_IN_AXISMODE is then automatically loaded. No gear stage change is required if the configured gear stage is already active. M40 remains active beyond the gear stage change. Consider MD20094 \$MC_SPIND_RIGID_TAPPING_M_NR.
Programm continuation:	Clear alarm with the Delete key or NC START.

22024	[Channel %1:] Block %2 Spindle %3 tapping: PLC signal 'invert M3/M4' changed after %4
Parameters:	%1 = Channel number %2 = Block number, label %3 = Spindle %4 = Value
Explanation:	When loading a G331 block it was detected that the NC/PLC interface signal DB380x DBX2001.6 (invert M3/M4) had changed during part program execution. An alarm was output to prevent a tool break. The current value of the NC/PLC interface signal is displayed as parameter 4.
Reaction:	Channel not ready. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	A change in the NC/PLC interface signal DB380x DBX2001.6 (invert M3/M4) during part program execution should be avoided. If MD35035 SPIND_FUNCTION_MASK bit 22 is set, the NC/PLC interface signal DB380x DBX2001.6 (invert M3/M4) is then no longer evaluated during tapping with G331, G332. The alarm is no longer output. Notice! Setting bit 22 means a change in function.
Programm continuation:	Clear alarm with the RESET key. Restart part program

22025	[Channel %1:] Block %2 Following axis/spindle %3 synchronism (2): Fine tolerance overshoot
Parameters:	%1 = Channel number %2 = Block number, label %3 = Following axis/spindle number
Explanation:	Synchronism is monitored once the 'FINE' block-change criterion has been met. The 'fine' threshold value defined with MD37212 \$MA_COUPLE_POS_TOL_FINE_2 has been exceeded by the synchronism difference on the actual value side. The alarm can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK_2 bit 12 = 1 or with CP programming by setting CPMALARM[FAx] bit 8 = 1.
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. The following axis/spindle was not able to follow the leading axis(axis)/spindle(s).
Programm continuation:	Clear alarm with the Delete key or NC START.
22026	[Channel %1:] Block %2 Following axis/spindle %3 synchronism(2): Coarse tolerance overshoot
Parameters:	%1 = Channel number %2 = Block number, label %3 = Following axis/spindle number
Explanation:	Synchronism is monitored once the 'COARSE' block-change criterion has been met. The 'coarse' threshold value defined with MMD37202 \$MA_COUPLE_POS_TOL_COARSE_2 has been exceeded by the synchronism difference on the actual value side. The alarm can be suppressed with MD11415 \$MN_SUPPRESS_ALARM_MASK_2 bit 12 = 1 or with CP programming by setting CPMALARM[FAx] bit 9 = 1.
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. The following axis/spindle was not able to follow the leading axis(axis)/spindle(s).
Programm continuation:	Clear alarm with the Delete key or NC START.
22030	[Channel %1:] Block %2 following spindle %3 Impermissible programming
Parameters:	%1 = Channel number %2 = Block number, label %3 = Spindle
Explanation:	With synchronous spindle-VV-coupling an additional motion for the following spindle can only be programmed with M3, M4, M5 and S... The paths created by specified positions cannot be maintained safely for a velocity coupling, especially if a position control is missing. If dimensional accuracy or reproducibility are not important, the alarm can be suppressed with MD11410 \$MN_SUPPRESS_ALARM_MASK Bit27 = 1.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Use synchronous spindle-DV-coupling or program direction of rotation and speed.
Programm continuation:	Clear alarm with the RESET key. Restart part program
22033	[Channel %1:] Block %2 Axis/spindle %3 'Correct synchronism' diagnostics %4
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis/spindle number %4 = Diagnostics

Explanation:	The following situation occurred during 'Correct synchronism': - Diagnostics 1: An existing override motion is terminated on key reset. - Diagnostics 2: The override motion has been deleted. - Diagnostics 3: Writing of override value not allowed. Synchronism override is deleted. - Diagnostics 4: Override motion is stopped temporarily (e.g. G74 reference point approach) - Diagnostics 5: Delay of override motion: acceleration capacity used up by other motions. - Diagnostics 6: Delay of override motion: velocity used up by other motions. - Diagnostics 7: Delay of override motion: the maximum speed is limited to 0. System variable \$AC_SMAXVELO_INFO[n] shows the reason for this. - Diagnostics 8: Delay of override motion: the maximum acceleration capacity is limited to 0. \$AC_SMAXACC_INFO[n] shows the reason for this. MD11411 \$MN_ENABLE_ALARM_MASK activates this alarm: - Bit 9 = 1 for diagnostics 1 to 6 - Bit 12 = 1 for diagnostics 7 to 8
Reaction:	Alarm display.
Remedy:	Deactivate the alarm with MD 11411 \$MN_ENABLE_ALARM_MASK Bit9 = 0 or Bit12 = 0.
Programm continuation:	Clear alarm with the Delete key or NC START.

22035	[Channel %1:] Block %2 following axis/spindle %3 unable to determine the offset value (reason %4).
Parameters:	%1 = Channel number %2 = Block number, label %3 = Following axis/spindle number %4 = Reason
Explanation:	The determination of the offset value (\$AA_COUP_CORR[Sn]) intended by the NC/PLC signal DB380x DBX5007.6 (correct synchronism) cannot be executed. The offset value cannot be calculated properly. The reasons for this may be: - Reason 1: The following axis is not configured as a spindle. - Reason 2: The coupling has more than one active leading axis. - Reason 3: The leading axis is not configured as a spindle. - Reason 4: The coupling factor (the quotient from CPLNUM and CPLDEN) is neither 1 nor -1. - Reason 5: CPLSETVAL = "cmdvel". - Reason 6: An independent motion component (NC/PLC interface signal DB390x DBX5002.4(overlaid motion) = 1) of the following spindle is active. - Reason 7: There is no following spindle synchronism on the setpoint side. - Reason 8: The synchronism on the setpoint side has decreased again. - Reason 9: The following or leading spindle is a link axis (NCU_LINK).
Reaction:	Alarm display.
Remedy:	The following remedies are available for the indicated reasons: - Reasons 1 to 5: The coupling has to be reconfigured / reprogrammed. - Reasons 6 and 7: Wait until NC/PLC interface signals DB390x DBX5003.4 (Synchronization running) = 0 and DB390x DBX5002.4 (Overlaid motion) = 0 before setting NC/PLC DB380x DBX5007.6 (Correct synchronism) . - Reason 8: Wait until the following axle / spindle can follow the leading values before setting NC/PLC interface signal DB380x DBX5007.6 (Correct synchronism).
Programm continuation:	Clear alarm with the Delete key or NC START.

22036	[Channel %1:] Block %2 Axis/spindle %3 Synchronism override not possible (reason %4)
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis/spindle number %4 = Reason

Explanation:	The synchronism override intended by setting the VDI interface signal DB31...,DBX31.6 'Correct synchronism' or writing variable \$AA_COUP_CORR[Sn] cannot currently be considered. The reasons may be: - Reason 1: Reference point approach or zero mark synchronization for spindles is active. - Reason 2: Deletion of synchronism override is active. - Reason 3: Writing is not allowed.
Reaction:	Alarm display.
Remedy:	Wait until the conditions for override value processing are available again prior to setting VDI interface signal DB31...,DBX31.6 'Correct synchronism' or writing variable \$AA_COUP_CORR[Sn]: - Reason 1: Reference point approach / zero mark synchronization completed. - Reason 2: Deletion of synchronism override completed. - Reason 3: Writing allowed.
Programm continuation:	Clear alarm with the Delete key or NC START.

22037	[Channel %1:] Block %2 Axis/spindle %3 'Correct synchronism' is being ignored
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis/spindle number
Explanation:	VDI interface signal DB31...,DBX31.6 'Correct synchronism' is being ignored, because VDI interface signal DB31...,DBX31.7 'Delete synchronism override' has been set.
Reaction:	Alarm display.
Remedy:	Reset the two VDI interface signals DB31...,DBX31.7 'Delete synchronism override' and DB31...,DBX31.6 'Correct synchronism', before the latter signal can be set again.
Programm continuation:	Clear alarm with the Delete key or NC START.

22038	[Channel %1:] Block %2 Axis/Spindle %3 'Delete synchronism override' is being ignored
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis/spindle number
Explanation:	VDI interface signal DB31...,DBX31.7 'Correct synchronism' is being ignored, because VDI interface signal DB31...,DBX31.6 'Delete synchronism override' has been set.
Reaction:	Alarm display.
Remedy:	Reset the two VDI interface signals DB31...,DBX31.6 'Correct synchronism' and DB31...,DBX31.7 'Delete synchronism override', before the latter signal can be set again.
Programm continuation:	Clear alarm with the Delete key or NC START.

22040	[Channel %1:] Block %3 spindle %2 is not referenced with zero marker
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label
Explanation:	The current position is not referenced with the measuring system position although reference is made to it.
Reaction:	Alarm display.
Remedy:	Correct the NC part program. Create the zero mark synchronization by positioning, by rotation (at least 1 revolution) in speed control mode or with the G74 command before switching on the alarm generating function. You can suppress the alarm in the cyclic check with position control already enabled for following and leading spindle(s) by means of MD11410 \$MN_SUPPRESS_ALARM_MASK bit21 = 1 or by CP programming with CPMALARM[FAX] bit10 = 1 (in which FAX = following spindle).
Programm continuation:	Clear alarm with the Delete key or NC START.

22050	[Channel %1:] Block %3 spindle %2 no transition from speed control mode to position control mode
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label
Explanation:	- An oriented spindle stop (SPOS/SPOSA) has been programmed or the position control of the spindle was switched on with SPCON but no spindle encoder has been defined. - When switching on the position control, the spindle speed is greater than the limiting speed of the measuring system.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Spindle without attached encoder: Any NC language elements requiring the encoder signals must not be used. Spindle with attached encoder: Enter the number of spindle encoders used in the MD30200 \$MA_NUM_ENCS.
Programm continuation:	Clear alarm with the RESET key. Restart part program
22051	[Channel %1:] Block %3 spindle %2 reference mark not found
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label
Explanation:	When referencing, the spindle turned through a greater distance than given in the axis-specific MD34060 \$MA_REFP_MAX_MARKER_DIST, without receiving a reference mark signal. The check is performed for spindle positioning with SPOS or SPOSA when the spindle has not previously run with speed control (S=...).
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Check and correct the MD34060 \$MA_REFP_MAX_MARKER_DIST. The value entered states the distance in [mm] or [degrees] between 2 zero markers.
Programm continuation:	Clear alarm with the RESET key. Restart part program
22052	[Channel %1:] Block %3 spindle %2 no standstill on block change
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label
Explanation:	The displayed spindle has been programmed as spindle or as axis even though a positioning operation is still running from the previous block (with SPOSA ... spindle positioning beyond block limits). Example: N100 SPOSA [2] = 100 : N125 S2 = 1000 M2 = 04 ; Error, if spindle S2 from block N100 is still running!
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.

Remedy:	Before programming the spindle/axis again using the SPOSA instruction, a WAITS command should be activated in order to wait for the programmed spindle position. Example: N100 SPOSA [2] = 100 : N125 WAITS (2) N126 S2 = 1000 M2 = 04
Programm continuation:	Clear alarm with the RESET key. Restart part program

22053	[Channel %1:] Block %3 spindle %2 reference mode not supported
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label
Explanation:	In the case of SPOS/SPOSA with an absolute encoder, only the referencing mode MD34200 \$MA_ENC_REFP_MODE = 2 is supported! SPOS/SPOSA does not support MD34200 \$MA_ENC_REFP_MODE = 6 at all!
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Change the setting of MD34200 \$MA_ENC_REFP_MODE or change to JOG+REF and then reference.
Programm continuation:	Clear alarm with the RESET key. Restart part program

22055	[Channel %1:] Block %3 spindle %2 configured positioning speed is too high
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label
Explanation:	The current position is not referenced with the measuring system position although reference is made to it.
Reaction:	Alarm display.
Remedy:	Correct the NC part program. Create the zero mark synchronization by positioning, by rotation (at least 1 revolution) in speed control mode or with the G74 command before enabling the alarm-generating function.
Programm continuation:	Clear alarm with the Delete key or NC START.

22057	[Channel %1:] Block %2 for following spindle %3 coupling as leading spindle/axis already existing
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	A coupling has been switched on in which the following spindle/axis has already been active as leading spindle/axis in another coupling. Chained couplings cannot be processed.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Check in the part program whether the following spindle/axis is already active as leading spindle/axis in another coupling.
Programm continuation:	Clear alarm with the RESET key. Restart part program

22058	[Channel %1:] Block %2 for leading spindle %3 coupling as following spindle/axis already existing
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number
Explanation:	A coupling has been switched on in which the leading spindle/axis has already been active as following spindle/axis in another coupling. Chained couplings cannot be processed.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Check in the part program whether the leading spindle/axis is already active as following spindle/axis in another coupling.
Programm continuation:	Clear alarm with the RESET key. Restart part program
22062	[Channel %1:] Axis %2 reference point approach: zero marker search velocity (MD) is not reached
Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	The configured zero marker search velocity is not reached.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Inform the authorized personnel/service department. Check the active spindle speed limitations. Configure a lower zero marker search velocity MD34040 \$MA_REFP_VELO_SEARCH_MARKER. Check the tolerance range for the actual velocity MD35150 \$MA_SPIND_DES_VELO_TOL. Set a different referencing mode MD34200 \$MA_ENC_REFP_MODE = 7.
Programm continuation:	Clear alarm with the RESET key. Restart part program
22064	[Channel %1:] Axis %2 reference point approach: zero marker search velocity (MD) is too high
Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	The configured zero marker search velocity is too high. The encoder limit frequency is exceeded for the active measuring system.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Inform the authorized personnel/service department. Configure a lower zero marker search velocity MD34040 \$MA_REFP_VELO_SEARCH_MARKER. Check the configuration of the encoder frequency MD36300 \$MA_ENC_FREQ_LIMIT and MD36302 \$MA_ENC_FREQ_LIMIT_LOW. Set a different referencing mode MD34200 \$MA_ENC_REFP_MODE=7.
Programm continuation:	Clear alarm with the RESET key. Restart part program

22065	[Channel %1:] Tool management: Tool motion is not possible as tool %2 is not in magazine %4.
Parameters:	%1 = Channel number %2 = String (identifier) %3 = -Not used- %4 = Magazine no.
Explanation:	The desired tool motion command - triggered from the HMI or PLC - is not possible. The specified tool is not contained in the specified magazine. NCK cannot contain tools that are not assigned to a magazine. With this kind of tool, no operations (motion, change) can be performed.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	You have the following possibilities of eliminating the error: Ensure that the specified tool is contained in the desired magazine. Select another tool to be changed.
Programm continuation:	Clear alarm with the Delete key or NC START.
22066	[Channel %1:] Tool management: Tool change is not possible as tool %2 is not in magazine %4.
Parameters:	%1 = Channel number %2 = String (identifier) %3 = -Not used- %4 = Magazine no.
Explanation:	The desired tool change is not possible. The specified tool is not contained in the specified magazine. NCK cannot contain tools that are not assigned to a magazine. With this kind of tool, no operations (motion, change) can be performed.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Inform the authorized personnel/service department. - Ensure that the specified tool is contained in the desired magazine. - Program another tool that is to be changed. - Check whether the settings in MD20110 \$MC_RESET_MODE_MASK, MC20112 \$MC_START_MODE_MASK and the associated MD20122 \$MC_TOOL_RESET_NAME match the current definition data.
Programm continuation:	Clear alarm with the RESET key. Restart part program
22067	[Channel %1:] Tool management: tool change not possible since there is no tool available in tool group %2
Parameters:	%1 = Channel number %2 = String (identifier)
Explanation:	The desired tool change is not possible. The specified tool group does not contain a tool which is ready for use and could be used for tool change. It is possible that all of the tools in question have been set to the "Disabled" state by the tool monitoring function.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm at block end.
Remedy:	- Ensure that the specified tool group contains a tool that is ready for use when the tool change is requested. - For example, replace disabled tools or enable a disabled tool manually. - Check whether the tool data are correctly defined. Have all intended tools in the group been defined with the specified identifier and loaded?

Programm continuation: Clear alarm with the RESET key. Restart part program

22068 [Channel %1:] Block %2 tool management: no tool available in tool group %3

Parameters: %1 = Channel number
 %2 = Block number, label
 %3 = String (identifier)

Explanation: The specified tool group does not contain a replacement tool which is ready for use and could be used for tool change. It is possible that all the tools in question have been set to the 'Disabled' state by the tool monitoring function. The alarm can occur for example in conjunction with alarm 14710 (error on INIT block generation). In this case the NCK attempts, e.g., to replace the disabled tool located on the spindle with an available replacement tool, which however does not exist in this error case.

With this conflict, the user must, for example, remove the tool located on the spindle by issuing a spindle movement command (e.g. using an HMI operation).

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy:

- Ensure that the specified tool group contains a tool that is ready for use when the tool change is requested.
- Replace, for example, disabled tools or enable a disabled tool manually.
- If an alarm occurs on programming TCA, check whether the duplo number been programmed >0?
- Check whether the tool data are correctly defined. Have all intended tools in the group been defined with the specified identifier or loaded?

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

22069 [Channel %1:] Block %2 tool management: No tool available in tool group %3, program %4

Parameters: %1 = Channel number
 %2 = Block number, label
 %3 = String (identifier)
 %4 = Program name

Explanation: The specified tool group does not contain a tool which is ready for use and could be used for tool change. It is possible that all of the tools in question have been set to the 'Disabled' state by the tool monitoring function. Parameter %4 = program name facilitates the identification of the program containing the programming command (tool selection) that caused the error. This can be a subprogram or cycle, etc., which can no longer be identified from the display. If the parameter is not specified, it is the currently displayed program.

Reaction: Correction block is reorganized.
 Interface signals are set.
 Alarm display.

Remedy:

- Ensure that the specified tool group contains a tool that is ready for use when tool change is requested.
- This can be achieved, for example, by replacing disabled tools, or
- by releasing a disabled tool manually.
- Check whether the tool data are correctly defined. Have all intended tools in the group been defined with the specified identifier and loaded?

Programm continuation: Clear alarm with NC START or RESET key and continue the program.

22070 [TO unit %1:] Please change tool %2 into magazine. Repeat data backup

Parameters: %1 = TO unit
 %2 = T number of tool

Explanation:	The alarm can only occur when the tool management function is active in the NCK. (TOOLMAN = tool management) A data backup of the tool/magazine data has been started. During the backup, the system detected that tools are still located in the buffer magazine (= spindle, gripper, ...). During the backup, these tools will lose the information which defines the magazine and location to which they are allocated. It is therefore practical -assuming that the data are to be stored exactly as before - to ensure that all tools have been deposited in the magazine before the data backup! If this is not the case, some magazine locations will have the "reserved" status when the data are loaded again. This "reserved" status must then be reset manually. For tools with fixed location coding, the loss of the information allocating their location in the magazine has the same effect as a general empty location search when they are returned to the magazine.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Ensure that there are no tools in the buffer magazine before making the data backup. Repeat the data backup after removing the tools from the buffer magazine.
Programm continuation:	Clear alarm with the Delete key or NC START.

22071 [TO unit %1:] Tool %2 is active, but not in the magazine area under consideration

Parameters:	%1 = TO unit %2 = Tool identifier %3 = -Not used-
Explanation:	The alarm can only occur when the tool management function is active in the NCK. Either the language command SETTA has been programmed or the corresponding operator action has been carried out via HMI, PLC, The alarm can also be triggered automatically by the NCK in the wear grouping function. It is detected that more than one tool from the tool group (tools with the same name/identifier) has the status "active". The specified tool is either - from a non-considered magazine, - from a non-considered wear grouping, - or from a non-active wear grouping in a buffer location (is neither magazine nor wear grouping).
Reaction:	Interface signals are set. Alarm display.
Remedy:	The alarm is intended for information purposes. If only one tool in a group can be active at a time for technological reasons or for reasons of display, the "active" status must be canceled for the tool causing the error. Otherwise, the alarm can be ignored or even suppressed via the MD11410 \$MN_SUPPRESS_ALARM_MASK. Typical reasons of display are present, if the operator works with the function 'definite D numbers', which can be displayed on Siemens HMI in a definite form only, if exactly one tool from a tool group has the status 'active'. Before machining can be started or before the SETTA (or corresponding HMI operation, ...) language command is used, all tools of the magazine should have the status "not active". One option to achieve this is programming SETTIA (or corresponding HMI operation, ...).
Programm continuation:	Clear alarm with the Delete key or NC START.

22100 [Channel %1:] Block %3 spindle %2 chuck speed exceeded

Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label
Explanation:	The actual spindle speed is higher than the maximum speed configured in MD35100 \$MA_SPIND_VELO_LIMIT plus a tolerance of 10 percent (fixed setting). The alarm should not occur after correct optimization of the drive actuator and gear configuration. This alarm can be reconfigured with MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready to operate) to 'BAG not ready'. Note: Reconfiguring affects all alarms with alarm response 'Chan not ready'.

Reaction:	Mode group not ready. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. Check the setup and optimization data of the drive actuator in accordance with the Installation and Start-up Guide and make corrections. Increase the tolerance window in MD35150 \$MA_SPIND_DES_VELO_TOL.
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

22200	[Channel %1:] Block %3 Spindle %2 axis stopped during tapping
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label
Explanation:	When tapping with compensating chuck (G63) the drilling axis was stopped via the NC/PLC interface and the spindle continues to rotate. The thread and possibly also the tap were damaged as a result.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Provide an interlock in the PLC user program so that no axis stop can be initiated when tapping is active. If the tapping operation is to be terminated under critical machine conditions, the spindle and the axis should be stopped simultaneously if at all possible. Slight differences are then accommodated by the compensating chuck.
Programm continuation:	Clear alarm with the RESET key. Restart part program

22250	[Channel %1:] Block %3 Spindle %2 axis stopped during thread cutting
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Block number, label
Explanation:	The thread cutting axis has been stopped while a thread block was active. The stop can be caused by VDI signals that cause the feed to be interrupted.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please inform the authorized personnel/service department. Check the axis-specific/spindle-specific stop DB380x DBX4.3 (Spindle stop).
Programm continuation:	Clear alarm with the RESET key. Restart part program

22270	[Channel %1:] Block %2 thread cutting: Maximum speed axis %3 exceeded %4
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name %4 = Velocity

Explanation:	Thread cutting with G33, G34, G35: The thread axis (pitch axis) velocity calculated exceeds the maximum permissible axis velocity MD32000 \$MA_MAX_AX_VELO. The calculated axis velocity is displayed. The velocity of the thread axis is dependent upon: - The current spindle speed - The programmed thread pitch - The programmed thread pitch change and thread length (G34, G35) - The spindle override (path and individual axis overrides are ineffective)
Reaction:	Alarm display.
Remedy:	Reduce the spindle speed or thread pitch (thread pitch change).
Programm continuation:	Clear alarm with the Delete key or NC START.

22271 [Channel %1:] Block %2 thread cutting: Maximum speed axis %3 exceeded %4

Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name %4 = Velocity
Explanation:	Thread cutting with G33, G34, G35: The thread axis (pitch axis) velocity calculated exceeds the maximum permissible axis velocity MD32000 \$MA_MAX_AX_VELO. The calculated axis velocity is displayed. The velocity of the thread axis is dependent upon: - The current spindle speed - The programmed thread pitch - The programmed thread pitch change and thread length (G34, G35) - The spindle override (path and individual axis overrides are ineffective)
Reaction:	Alarm display.
Remedy:	Reduce the spindle speed or thread pitch (thread pitch change).
Programm continuation:	Clear alarm with the Delete key or NC START.

22272 [channel %1:] block %2 axis %3 thread cutting: block length %4 too short for predefined thread pitch

Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name %4 = Block length
Explanation:	Thread cutting with G33, G34, G35: Block length too short for predefined thread pitch. Block length is displayed.
Reaction:	Alarm display.
Remedy:	Reduce thread pitch (thread pitch change).
Programm continuation:	Clear alarm with the Delete key or NC START.

22275 [Channel %1:] Block %2 zero velocity of thread axis at position %3 reached

Parameters:	%1 = Channel number %2 = Block number, label %3 = Position
Explanation:	An axis standstill was reached at the specified position during thread cutting with G35 due to the linear decrease in the thread pitch. The standstill position of the thread axis depends on: - Programmed thread pitch decrease - Thread length
Reaction:	Alarm display.
Remedy:	Change at least one of the above factors.

Programm continuation: Clear alarm with the Delete key or NC START.

22280 [Channel %1:] In block %2: Prog. acceleration path too short %3, %4 required

Parameters: %1 = Channel number
 %2 = Block number, label
 %3 = Prog. acceleration path
 %4 = Required acceleration path

Explanation: In order to stay within the programmed acceleration path, the acceleration caused an overload on the thread axis. In order to accelerate the axis with the programmed dynamic response, the length of the acceleration path must be at least as large as the value in parameter %4.

The alarm is of the technological type and is output whenever bit 2 in MD11411 \$MN_ENABLE_ALARM_MASK is enabled. The HMI softkey 'Technology support' sets and clears this bit in the MD.

Reaction: Alarm display.

Remedy: Modify part program or reset MD11411 \$MN_ENABLE_ALARM_MASK bit 2.

Programm continuation: Clear alarm with the Delete key or NC START.

22282 [Channel %1:] In block %2: Prog. thread block too short to comply with the dynamic limit values %3, %4 is required

Parameters: %1 = Channel number
 %2 = Block number, label
 %3 = Smoothing length that can be taken from the programmed thread block
 %4 = Smoothing length required for dynamic response adjustment with compliance with the limit values

Explanation: If programming requires a dynamic response adjustment from one thread element to the next thread element, a check is made to see if the path length is long enough to comply with the dynamic limit values. Only a part of the programmed path length can be taken for this smoothing because the programmed target speed of the thread block for the required thread geometry (thread pitch, spindle speed) has to be reached and output. The dynamic limit values are exceeded for the dynamic response adjustment to the required thread geometry.

The alarm is only output if it is not suppressed by bit 25 of MD11415 \$MN_SUPPRESS_ALARM_MASK_2.

Reaction: Alarm display.

Remedy:

1. Change part program and lengthen the path of thread block %2 or the next block.
 There is a danger of collision as a result of path lengthening, especially for female threads. This must be checked.
2. Lengthen the smoothing length of the thread block with DITRB = -1.
3. Set MD11415 \$MN_SUPPRESS_ALARM_MASK_2 bit 25.
4. Set setting data SD42010 \$SC_THREAD_RAMP_DISP[2] = 0.

Programm continuation: Clear alarm with the Delete key or NC START.

22290 [Channel %1:] Spindle operation for transformed spindle/axis %2 not possible (reason: error code %3).

Parameters: %1 = Channel number
 %2 = Axis name, spindle number
 %3 = Error code

Explanation:	It is impermissible to start a spindle as long as it is being used by a transformation. Reason: spindle usage in a transformation requires axis operation, which must not be exited. This alarm may have the following reasons: - Error code 1 : M3, M4 or M5 per synchronized action; - Error code 2 : M41 through M45 per synchronized action; - Error code 3 : SPOS, M19 per synchronized action; - Error code 11 : DB380x DBX5006.0 (Spindle stop); - Error code 12 : DB380x DBX5006.1 (Spindle start clockwise rotation); - Error code 13 : DB380x DBX5006.2 (Spindle start counterclockwise rotation); - Error code 14 : DB380x DBX5006.4 (Spindle positioning).
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Resolve the conflict, for example by deactivating transformation prior to spindle start.
Programm continuation:	Clear alarm with the Delete key or NC START.

22291	[Channel %1:] Block %2 motion synchronous action %3 spindle mode is not possible for transformed spindle/axis %4
Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID %4 = Axis name, spindle number
Explanation:	It is impermissible to start a spindle as long as it is being used by a transformation. Reason: spindle usage in a transformation requires axis operation, which must not be exited. This alarm may have the following reasons: - Error code 1 : M3, M4 or M5 per synchronized action; - Error code 2 : M41 through M45 per synchronized action; - Error code 3 : SPOS, M19 per synchronized action; - Error code 11 : DB380x DBX5006.0 (Spindle stop); - Error code 12 : DB380x DBX5006.1 (Spindle start clockwise rotation); - Error code 13 : DB380x DBX5006.2 (Spindle start counterclockwise rotation); - Error code 14 : DB380x DBX5006.4 (Spindle positioning).
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Resolve the conflict, for example by deactivating transformation prior to spindle start.
Programm continuation:	Clear alarm with the Delete key or NC START.

22292	[Channel %1:] Changeover of the operating mode of the axis/spindle %2 using PI service not possible, Cause %3
Parameters:	%1 = Channel number %2 = Axis/spindle %3 = Cause

Explanation:	It is not possible to change over the operating mode of the axis/spindle. Cause: 1: The required axis/spindle is not known in the channel. 2: The required axis/spindle is not available in the channel. 3: The required axis/spindle is defined as virtual axis. 4: The required axis is not defined as spindle. Therefore, it is not possible to change over the operating mode of the axis. 5: The required axis/spindle is a permanently assigned PLC axis/spindle. 6: The required axis/spindle is an active slave axis/spindle. 7: Spindle operation is not possible for transformed spindle/axis. 8: The required axis/spindle is not available as command axis.
Reaction:	Alarm display.
Remedy:	1: Please select the PI service again. 2: Please select the PI service again. 3: Reset MD 30132 IS_VIRTUAL_AX. 4: When required, configure axis as spindle. 5: Axis/spindle enabled by the PLC. 6: Deactivate coupling of the slave axis/spindle. 7: Deactivate transformation. 8: Wait until the axis is again available.
Programm continuation:	Clear alarm with the Delete key or NC START.

22295	[Channel %1:] Spindle %2 DBB30 function not possible (cause: error code %3)
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = Error code
Explanation:	The function request by PLC via DBB30 interface could not be executed. The cause is specified by the error code. Error codes: - Error code 1 : internal use - Error code 2 : internal use - Error code 3 : internal use - Error code 4 : internal use - Error code 5 : Switchover to command axis not possible - Error code 6 : Switchover to PLC axis not possible - Error code 20 : internal use - Error code 21 : internal use - Error code 22 : internal use - Error code 23 : MD 30132 IS_VIRTUAL_AX has been set - Error code 50 : internal use - Error code 51 : internal use - Error code 70 : internal use
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Remedy conflict.
Programm continuation:	Clear alarm with the Delete key or NC START.

22296 [Channel %1:] Spindle %2 Error on gear stage change (cause: error code %3)

Parameters: %1 = Channel number
%2 = Axis name, spindle number
%3 = Error code

Explanation: An error occurred during gear stage change. The cause is specified by the error code.

Error codes:

- Error code 1 : internal use
- Error code 2 : internal use
- Error code 3 : internal use
- Error code 4 : internal use
- Error code 5 : Switchover to command axis not possible
- Error code 6 : Switchover to PLC axis not possible
- Error code 20 : internal use
- Error code 21 : internal use
- Error code 22 : internal use
- Error code 23 : MD 30132 IS_VIRTUAL_AX has been set
- Error code 50 : internal use
- Error code 51 : internal use
- Error code 70 : internal use

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Remedy conflict.

Programm continuation: Clear alarm with the Delete key or NC START.

22297 [Channel %1:] Spindle %2 FC18 function not possible (cause: error code %3)

Parameters: %1 = Channel number
%2 = Axis name, spindle number
%3 = Error code

Explanation: The function request by PLC via FC18 interface could not be executed. The cause is specified by the error code.

Error codes:

- Error code 1 : internal use
- Error code 2 : internal use
- Error code 3 : internal use
- Error code 4 : internal use
- Error code 5 : Switchover to command axis not possible
- Error code 6 : Switchover to PLC axis not possible
- Error code 20 : internal use
- Error code 21 : internal use
- Error code 22 : internal use
- Error code 23 : MD 30132 IS_VIRTUAL_AX has been set
- Error code 50 : internal use
- Error code 51 : internal use
- Error code 70 : internal use

Reaction: NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Remedy conflict.

Programm continuation: Clear alarm with the Delete key or NC START.

22320	[Channel %1:] Block %2 motion synchronous action: %3 PUTFTOCF command could not be transferred
Parameters:	%1 = Channel number %2 = Block number, line number %3 = Synact ID
Explanation:	The cyclic transfer of the PUTFTOCF data block (fine tool compensation) could not be performed because the transfer area is already occupied.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Check the part program, in particular with regard to the other channels. Is a data block being transferred by another channel?
Programm continuation:	Clear alarm with the RESET key. Restart part program
22321	[Channel %1:] Axis %2 PRESET not allowed during traverse motion
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A preset command was sent from the HMI or PLC while an axis was traveling in JOG mode.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Wait until the axis is stationary.
Programm continuation:	Clear alarm with the Delete key or NC START.
22322	[Channel %1:] Axis %2 PRESET: illegal value
Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	The entered Preset value is too large (number format overflow).
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Use smaller, permissible preset values.
Programm continuation:	Clear alarm with the RESET key. Restart part program
22324	[Channel %1:] Block %2 Axis %3 PRESETON or PRESETONS not permitted (cause: %4)
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis name, spindle number %4 = Index describing the problem that occurred in more detail
Explanation:	A problem has occurred when programming PRESETON or PRESETONS. This problem is described in more detail using the "Index" parameter: Index == 1: In MD30460 \$MA_BASE_FUNCTION_MASK the PRESETON or PRESETONS function is deactivated. Index == 2: For PRESETONS, the axis is monitored for collision. Actual value setting is not permitted. Index == 3: PRESETON/PRESETONS is not permissible for synchronous GANTRY axes. Index == 4: In speed control mode, PRESETON/PRESETONS is not permissible before terminating the traversing movement.

Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Apply the programming permitted. Please notify the authorized personnel/service.
Programm continuation:	Clear alarm with the RESET key. Restart part program

22326 PRESETONS not possible on safety axis %1

Parameters:	%1 = Axis number
Explanation:	PRESETONS(...) cannot be used for axes, for which a safety function is activated, which requires an absolute reference. PRESETONS was permitted in MD30460 \$MA_BASE_FUNCTION_MASK.
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Remedy conflict.
Programm continuation:	Switch control OFF - ON.

22400 [Channel %1:] Option 'contour handwheel' not set

Parameters:	%1 = Channel number
Explanation:	The function 'contour handwheel' was activated without the necessary option. If the alarm occurs - on selection of the contour handwheel via the PLC, then the contour handwheel has to be deselected in order to continue with the program - on account of programming FD=0, then the program can be corrected and continued with the compensation block and NCSTART.
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. - Set option - Cancel the activation of the function 'contour handwheel' - Modify part program.
Programm continuation:	Clear alarm with the Delete key or NC START.

25000 Axis %1 hardware fault of active encoder

Parameters:	%1 = Axis name, spindle number
Explanation:	The signals of the currently active actual position value encoder (NC/PLC interface signal DB380x DBX1.5 = 1 (Position measuring system 1) or DB380x DBX1.6 = 1 (Position measuring system 2)) are missing, do not have the same phase, or exhibit grounding/short-circuit. The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready). For PROFIdrive only: MD36310 \$MA_ENC_ZERO_MONITORING >100 replaces the existing PowerOn alarm by the Reset alarm 25010.

Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Axes of this channel must be re-referenced. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. Check measuring circuit connectors for correct contacting. Check encoder signals and replace the encoder if faults are found. Monitoring can be switched off by setting MD36310 \$MA_ENC_ZERO_MONITORING[n] to 100 (n = encoder number: 1,2).
Programm continuation:	Switch control OFF - ON.

25001 Axis %1 hardware fault of passive encoder

Parameters:	%1 = Axis name, spindle number
Explanation:	The signals from the currently inactive actual position value encoder are missing, or they are not of the same phase, or they exhibit grounding/short-circuit. For PROFIdrive only: MD36310 \$MA_ENC_ZERO_MONITORING >100 replaces the existing PowerOn alarm by the Reset alarm 25011.
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. Check that correct contacts are established for the measuring circuit connectors. Check encoder signals and replace the encoder if faults are found. Switch off monitoring with the corresponding interface signal DB380x DBX1.5 / 1.6 = 0 (position measuring system 1/2). The fault cause remains until the next power on Monitoring can be switched off by setting MD36310 \$MA_ENC_ZERO_MONITORING[n] to 100 (n = encoder number: 1, 2).
Programm continuation:	Switch control OFF - ON.

25010 Axis %1 pollution of measuring system

Parameters:	%1 = Axis name, spindle number
Explanation:	The encoder used for position control sends a contamination signal (only in measuring systems with contamination signal). The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready). For PROFIdrive only: MD36310 \$MA_ENC_ZERO_MONITORING >100 returns the existing Reset alarm instead of the Power-on alarm 25000.
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Axes of this channel must be re-referenced. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. Check the measuring system in accordance with the instructions given by the measuring device manufacturer. Monitoring can be switched off by setting MD36310 \$MA_ENC_ZERO_MONITORING[n] to 100 (n = encoder number: 1,2).
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

25011 Axis %1 pollution of passive encoder**Parameters:** %1 = Axis name, spindle number**Explanation:** The encoder not used for position control sends a contamination signal (only in measuring systems with contamination signal).

For PROFIdrive only:

MD36310 \$MA_ENC_ZERO_MONITORING >100 returns the existing Reset alarm instead of the Power-on alarm 25001.

Reaction: Alarm display.**Remedy:** Please inform the authorized personnel/service department. Check the measuring system in accordance with the instructions given by the measuring device manufacturer.

Monitoring can be switched off by setting MD36310 \$MA_ENC_ZERO_MONITORING[n] to 100 (n = encoder number: 1,2).

Programm continuation: Clear alarm with the RESET key. Restart part program

25020 Axis %1 zero mark monitoring of active encoder**Parameters:** %1 = Axis name, spindle number**Explanation:** For PROFIdrive:

The position encoder pulses between 2 zero mark pulses are counted, and the plausibility is assessed (The functionality and possibly the parameterization of the plausibility check is done on the drive side. Please refer to the relevant drive documentation for details.), and reported in a PROFIdrive message frame (encoder interface) to the control, which then issues the present alarm.

The alarm can be reprogrammed in MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).

Reaction: Mode group not ready.

The NC switches to follow-up mode.

Channel not ready.

NC Start disable in this channel.

Axes of this channel must be re-referenced.

Interface signals are set.

Alarm display.

NC Stop on alarm.

Channel not ready.

Remedy: Please inform the authorized personnel/service department.

The differences can result from transmission errors, disturbances, encoder hardware faults or from the evaluation electronics in the encoder used for position control. The actual value branch must therefore be checked:

1. Transmission path: Check the actual-value connectors for correct contacting, encoder cable for continuity, and also check for short-circuits and grounding (loose contact?).

2. Encoder pulses: Is the encoder power supply within the tolerance limits?

3. Evaluation electronics: Replace or reconfigure the drive or encoder module used.

4. Check MD34220 \$MA_ENC_ABS_TURNS_MODULO and Sinamics drive parameter P0979 subindex 5 (or 15,25). They have to be the same for correct handling of the encoder data.

Monitoring can be switched off by setting MD36310 \$MA_ENC_ZERO_MONITORING [n] to 0 or 100 (n = encoder number: 1, 2).

Programm continuation: Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

25021 Axis %1 zero mark monitoring of passive encoder**Parameters:** %1 = Axis name, spindle number**Explanation:** Monitoring relates to the encoder that is not used by the position control. (NC-PLC interface signal DB380x DBX1.5 = 0 (Position measuring system 1) or DB380x DBX1.6 = 0 (Position measuring system 2))

More detailed explanations are similar to those for alarm 25020.

Reaction: Alarm display.

Remedy:	Please inform the authorized personnel/service department. The differences can result from transmission errors, disturbances, encoder hardware faults or from the evaluation electronics in the encoder not used for position control. The actual value branch must therefore be checked: 1. Transmission path: Check the actual-value connectors for correct contacting, encoder cable for continuity, and also check for short-circuits and grounding (loose contact?). 2. Encoder pulses: Is the encoder power supply within the tolerance limits? 3. Evaluation electronics: Replace or reconfigure the drive or encoder module used. 4. Check MD34220 \$MA_ENC_ABS_TURNS_MODULO and Sinamics drive parameter P0979 subindex 5 (or 15,25). Both have to be the same for correct handling of the encoder data. Monitoring can be switched off by setting MD36310 \$MA_ENC_ZERO_MONITORING[n] to 0 or 100 (n = encoder number: 1, 2).
Programm continuation:	Clear alarm with the Delete key or NC START.

25022	Axis %1 encoder %2 warning %3
Parameters:	%1 = Axis name, spindle number %2 = Encoder number %3 = Error fine coding
Explanation:	This alarm only occurs with absolute encoders: Warning notice of missing absolute encoder adjustment, that is if MD34210 \$MA_ENC_REFP_STATE equals 0. In this case, fine error code 0 is returned.
Reaction:	Alarm display.
Remedy:	Verify encoder adjustment (machine reference) or readjust encoder.
Programm continuation:	Clear alarm with the Delete key or NC START.

25030	Axis %1 actual velocity alarm limit
Parameters:	%1 = Axis name, spindle number
Explanation:	If the axis has at least one active encoder, then the actual speed of the axis is cyclically checked in the IPO cycle. If there are no errors, the actual velocity can never become greater than specified in the axis-specific MD36200 \$MA_AX_VELO_LIMIT (threshold for velocity monitoring). This threshold value in [mm/min, rev/min] is input by an amount that is about 5 to 10% greater than that which can occur at maximum traversing velocity. Drive errors can result in the velocity being exceeded and the alarm is then triggered. The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. - Check the speed setpoint cable (bus cable). - Check the actual values and direction of position control. - Change the position control direction if the axis rotates uncontrollably -> axis-specific MD32110 \$MA_ENC_FEEDBACK_POL [n] = < -1, 0, 1 >. - Increase the monitoring limit value in MD 36200 \$MA_AX_VELO_LIMIT.
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

25031	Axis %1 actual velocity warning limit
Parameters:	%1 = Axis name, spindle number

Explanation:	The present velocity actual value is more than 80% of the limit value defined in the machine data. (Internal test criterion activated by MD36690 \$MA_AXIS_DIAGNOSIS, bit0)
Reaction:	Alarm display.
Remedy:	-
Programm continuation:	Clear alarm with the Delete key or NC START.

25040 Axis %1 standstill monitoring

Parameters:	%1 = Axis name, spindle number
Explanation:	The NC monitors to ensure that the position is held at zero speed. Monitoring is started after a time that can be set for a specific axis in the MD36040 \$MA_STANDSTILL_DELAY_TIME after interpolation has ended. A constant check is made to determine whether the axis remains within the tolerance range given in MD36030 \$MA_STANDSTILL_POS_TOL. The following cases are possible: 1. The NC/PLC interface signal DB380x DBX2.1 (Servo enable) is zero because the axis has jammed mechanically. Due to mechanical influences (e.g. high machining pressure), the axis is pushed outside the permissible position tolerance. 2. With closed position control loop (without jamming) - NC/PLC interface signal DB380x DBX2.1 (Servo enable) is "1" - the axis is pushed away from its position by mechanical forces with a small gain in the position control loop. The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. - Check MD36040 \$MA_STANDSTILL_DELAY_TIME and MD36030 \$MA_STANDSTILL_POS_TOL; increase if necessary. The value must be greater than the machine data "Exact stop - coarse" (MD36000 \$MA_STOP_LIMIT_COARSE). - Estimate machining forces and reduce if necessary by setting a lower feed or a higher rotational speed. - Increase clamping pressure. - Increase the gain in the position control loop by improved optimization (Kv factor MD32200 \$MA_POSCTRL_GAIN).
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

25042 Axis %1 standstill monitoring during torque/force limitation

Parameters:	%1 = Axis name, spindle number
Explanation:	The defined end position was not reached within the time specified in the machine data.
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	- If the drive torque (FXST) was set too low with the result that the force of the motor was not sufficient to reach the end position -> increase FXST. - If the machined part is slowly deformed, there may be a delay in reaching the end position -> increase MD36042 \$MA_FOC_STANDSTILL_DELAY_TIME.
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

25050	Axis %1 contour monitoring
Parameters:	%1 = Axis name, spindle number
Explanation:	The NCK calculates for each interpolation point (setpoint) of an axis the actual value that should result based on an internal model. If this calculated actual value and the true machine actual value differ by a larger amount than given in the MD36400 \$MA_CONTOUR_TOL, then the program is canceled and the alarm message is issued. The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. - Check whether the tolerance value set in MD36400 \$MA_CONTOUR_TOL is too small. - Check optimization of the position controller (Kv factor in the MD32200 \$MA_POSCTRL_GAIN) to establish whether the axis follows the given setpoint without overshooting. Otherwise, the speed controller optimization must be improved or the Kv servo gain factor must be reduced. - Improvement of speed controller optimization - Check the mechanics (smooth running, inertial masses).
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.
25060	Axis %1 speed setpoint limitation
Parameters:	%1 = Axis name, spindle number
Explanation:	The speed setpoint has exceeded its upper limit for a longer period than allowed. The maximum speed setpoint is limited to a certain percentage by the axis-specific MD36210 \$MA_CTRLOUT_LIMIT. The input value of 100% corresponds to the rated speed of the motor and hence the rapid traverse velocity. For SINAMICS: Drive parameter p1082 also has a limiting effect. If the values are exceeded for a short time, then this is tolerated provided they do not last longer than allowed for in the axis-specific MD36220 \$MA_CTRLOUT_LIMIT_TIME. The setpoint is limited during this time to the maximum value that has been set in (MD36210 \$MA_CTRLOUT_LIMIT). The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. This alarm should not occur if the drive controller has been set correctly and the machining conditions are those that normally prevail. - Check actual values: Local sluggishness of the carriage, speed dip by torque surge due to contact with workpiece/tool, travel against fixed obstacle, etc. - Check direction of position control: Does the axis continue to rotate without control?
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.
25070	Axis %1 drift value too large
Parameters:	%1 = Axis name, spindle number

Explanation:	Only with analog drives! The permissible maximum value of drift (internal, integrated drift value of automatic drift compensation) was exceeded during the last compensation operation. The permissible maximum value is defined in the axis-specific MD36710 \$MA_DRIFT_LIMIT. The drift value itself is not limited. Automatic drift compensation: MD36700 \$MA_DRIFT_ENABLE=1 The difference between actual and setpoint position (drift) is checked cyclically in the IPO cycle when the axes are at zero speed. The difference is automatically compensated to zero by slowly integrating an internal drift value. Drift compensation by hand: MD36700 \$MA_DRIFT_ENABLE=0 A static offset can be added to the speed setpoint in the MD36720 \$MA_DRIFT_VALUE. This is not included in the drift monitoring because it acts like a voltage work offset.
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. Adjust the drift compensation with the automatic drift compensation switched off at the drive until the position lag is approximately zero. Then reactivate the automatic drift compensation in order to balance out the dynamic drift changes (effects of heating up).
Programm continuation:	Clear alarm with the Delete key or NC START.

25080 Axis %1 positioning monitoring

Parameters:	%1 = Axis name, spindle number
Explanation:	For blocks in which "exact stop" is effective, the axis must have reached the exact stop window after the positioning time given in the axis-specific MD36020 \$MA_POSITIONING_TIME. Exact stop coarse: MD36000 \$MA_STOP_LIMIT_COARSE Exact stop fine: MD36010 \$MA_STOP_LIMIT_FINE The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. Check whether the exact stop limits (coarse and fine) correspond to the dynamic possibilities of the axis, otherwise increase them, if necessary in connection with the positioning time set in MD36020 \$MA_POSITIONING_TIME. Check speed controller/position controller optimization; select highest possible gain. Check setting of Kv factor (MD32200 \$MA_POSCTRL_GAIN) and increase, if required.
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

25100 Axis %1 measuring system switchover not possible

Parameters:	%1 = Axis name, spindle number
Explanation:	The prerequisites are not satisfied for the required encoder switchover: 1. The newly selected encoder must be in the active state: (DB380x DBX1.5 / 1.6 = 1 (Position measuring system 1/2). 2. The actual value difference between the two encoders is greater than the value in the axis-specific MD36500 \$MA_ENC_CHANGE_TOL ("Maximum tolerance for actual position value switchover"). Activation of the measuring system concerned takes place in accordance with the NC/PLC interface signals DB380x DBX1.5 (Position measuring system 1) and DB380x DBX1.6 (Position measuring system 2), i.e. the position control is now operated with this measuring system. The other measuring system is switched over to follow-up mode. If both interface signals are set to "1", then only the 1st measuring system is active; if both interface signals are set to "0", the axis is parked. Changeover takes place as soon as the interface signals have changed, even if the axis is in motion.

Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. When referencing the active actual position value encoder, the actual value system of the inactive encoder is set to the same reference point value as soon as phase 3 has been concluded. A later positional difference between the two actual value systems can have occurred only as the result of an encoder defect or a mechanical displacement between the encoders. - Check the encoder signals, actual value cable, connectors. - Check the mechanical fastenings (displacement of the measuring head, mechanical twisting possible). - Increase the axis-specific MD 36500 \$MA_ENC_CHANGE_TOL. Program continuation is not possible. The program must be canceled with "RESET", then program execution can be reinitiated with NC START, if necessary at the interruption point after "Block search with/without calculation".
Programm continuation:	Clear alarm with the RESET key. Restart part program

25105	Axis %1 measuring systems differ considerably
Parameters:	%1 = Axis name, spindle number
Explanation:	The two measuring systems differ considerably, i.e. the cyclically monitored actual value difference between the two measuring systems is greater than the associated tolerance value set in the machine data MD36510 \$MA_ENC_DIFF_TOL. This can only occur when both measuring systems are active (MD30200 \$MA_NUM_ENCS = 2) and referenced. The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Inform the authorized personnel/service department. Check the machine data for active and selected encoders. Check the machine data for the tolerance of the encoders (MD36510 \$MA_ENC_DIFF_TOL).
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

25110	Axis %1 selected encoder not available
Parameters:	%1 = Axis name, spindle number
Explanation:	The selected encoder does not correspond to the maximum number of encoders in the axis-specific MD30200 \$MA_NUM_ENCS, i.e. the 2nd encoder does not exist.
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. Enter the number of actual value encoders used for this axis in the MD30200 \$MA_NUM_ENCS ("Number of encoders"). Input value 0: Axis without encoder -> e.g. spindle Input value 1: Axis with encoder -> default setting Input value 2: Axis with 2 encoders -> e.g. direct and indirect measuring system
Programm continuation:	Clear alarm with the Delete key or NC START.

25200	Axis %1 requested set of parameters invalid
Parameters:	%1 = Axis name, spindle number
Explanation:	A new parameter set has been requested for the positioning control. The number of this parameter set is beyond the permissible limit.

Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please inform the authorized personnel/service department. Check the axis-specific/spindle-specific interface signals DB380x DBX9.0 - .2 (Select parameter set servo A, B, C). One parameter set includes the following machine data: - MD31050 \$MA_DRIVE_AX_RATIO_DENOM [n] - MD31060 \$MA_DRIVE_AX_RATIO_NUMERA [n] - MD32200 \$MA_POSCTRL_GAIN [n] - MD32452 \$MA_BACKLASH_FACTOR [n] - MD32610 \$MA_VELO_FFW_WEIGHT [n] - MD32800 \$MA_EQUIV_CURRCTRL_TIME [n] - MD32810 \$MA_EQUIV_SPEEDCTRL_TIME [n] - MD32910 \$MA_DYN_MATCH_TIME [n] - MD36012 \$MA_STOP_LIMIT_FACTOR [n] - MD36200 \$MA_AX_VELO_LIMIT [n]
Programm continuation:	Clear alarm with the RESET key. Restart part program

25201 Axis %1 drive fault

Parameters: %1 = Axis name, spindle number

Explanation: For PROFIdrive:

The drive signals a serious fault which prevents the drive from being ready. The exact cause of the fault can be found by evaluating the output drive alarms (It may be necessary to activate these diagnostic alarms by parameterizing the MDs MD13070 \$MN_DRIVE_FUNCTION_MASK, MD13140 \$MN_PROFIBUS_ALARM_ACCESS etc):
Alarms 380500 and 380501 (or the corresponding alarm numbers implemented on the HMI side).
The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).

Reaction: Mode group not ready.
The NC switches to follow-up mode.
Channel not ready.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.
Channel not ready.

Remedy: Evaluation of the drive alarms.

Programm continuation: Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

25202 Axis %1 waiting for drive

Parameters: %1 = Axis name, spindle number

Explanation: Drive group error (self-clearing).

Reaction: Interface signals are set.
Alarm display.

Remedy: For PROFIdrive only:
Wait for the drive. This alarm reveals similar problems to alarm 25201 (see that alarm). It is continuously active during power-up if the drive does not communicate (e.g. if the PROFIBUS connector has fallen out). Otherwise, the alarm is active only briefly and is replaced by alarm 25201 after an internal timeout in the event of a permanent problem.

Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

25220	Axis %1 gear ratio changed with ESR enabled
Parameters:	%1 = Axis name, spindle number
Explanation:	Because a change in the gear ratio has an effect on the retraction path traveled by the drive, no changes may be made to the gear ratio during the following periods of time: - Between the last programming of the retraction path with ESRR and the ESR enable - As from ESR enable The following machine data define the gear ratios of an axis MD31050 \$MA_DRIVE_AX_RATIO_DENOM MD31060 \$MA_DRIVE_AX_RATIO_NUMERA MD31064 \$MA_DRIVE_AX_RATIO2_DENOM MD31066 \$MA_DRIVE_AX_RATIO2_NUMERA The gear ratio must not be changed during the periods of time described above, e.g. by changing the parameter set.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	If ESR enable is missing: - Change the gear ratio before programming the retraction path with ESRR or - Reprogram the retraction path with ESRR after changing the gear ratio Then re-enable ESR.
Programm continuation:	Clear alarm with the RESET key. Restart part program
26000	Axis %1 clamping monitoring
Parameters:	%1 = Axis name, spindle number
Explanation:	The clamped axis has been pushed out of its setpoint position. The permissible difference is defined in the axis-specific MD36050 \$MA_CLAMP_POS_TOL. Clamping an axis is activated with the axis-specific interface signal DB380x DBX2.3 (Clamping process active). The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Determine the position deviation to the setpoint position and, depending on the results, either increase the permissible tolerance in the MD or mechanically improve the clamping (e.g. increase clamping pressure).
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.
26001	Axis %1 parameterization error: friction compensation
Parameters:	%1 = Axis name, spindle number
Explanation:	The parameterization of the adaptation characteristic in the quadrant error compensation is not allowed because acceleration value 2 (MD32560 \$MA_FRICT_COMP_ACCEL2 is not between acceleration value 1 (MD32550 \$MA_FRICT_COMP_ACCEL1) and acceleration value 3 (MD32570 \$MA_FRICT_COMP_ACCEL3). The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).

Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. Check the setting parameters of the quadrant error compensation (friction compensation), if necessary switch off the compensation with MD32500 \$MA_FRICT_COMP_ENABLE.
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

26002 Axis %1 encoder %2 parameterization error: number of encoder pulses

Parameters:	%1 = Axis name, spindle number %2 = Encoder number
Explanation:	1. Rotary measuring system (MD31000 \$MA_ENC_IS_LINEAR[]==FALSE) The number of encoder marks set in MD31020 \$MA_ENC_RESOL[] does not correspond to the value in the drive machine data (PROFIdrive: p979) or one of the two values is zero. 2. Absolute measuring system with EnDat interface (MD30240 \$MA_ENC_TYPE[]==4) On absolute encoders, the resolution of the incremental and absolute tracks supplied by the drive is also checked for consistency. For PROFIdrive drives: Compare drive parameter p979 (and possibly other internal drive, manufacture-specific parameters stated in the relevant drive documentation) or compare images in NC-MDs \$MA_ENC_RESOL, \$MA_ENC_PULSE_MULT, \$MA_ENC_ABS_TURNS_MODULO etc. Conditions leading to triggering the alarm are: * Number of encoder pulses in the drive!= \$MA_ENC_RESOL * PROFIdrive interface standardization/high resolution in p979 not permitted (permitted pushing factor 0...30 bits) * With absolute encoders: Interface formats in p979 for absolute and incremental information does not fit together (i.e. the absolute position in XIST2 is supplied in too coarse resolution for a complete position reconstruction) * In the case of rotary absolute encoders behind the gears (and active traversing range extension in accordance with \$MA_ENC_ABS_BUFFERING): Absolute position format (in Gx_XIST2) is not complete/sufficient for position reconstruction via PowerOff in accordance with the following condition: \$MA_ENC_RESOL*\$MA_ENC_PULSE_MULT*\$MA_ENC_ABS_TURNS_MODULO must not be smaller than 2^{32}. A remedy against alarm triggering in the latter case may be to increase \$MA_ENC_PULSE_MULT (or the associated drive-side parameterization e.g. p418/419 with SINAMICS) or (when the necessary conditions prevail) by deactivating the traversing range extension - see \$MA_ENC_ABS_BUFFERING
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. Adjust machine data. For absolute encoders, possibly pending drive alarms indicating encoder problems should be evaluated.
Programm continuation:	Switch control OFF - ON.

26003	Axis %1 parameterization error: lead screw pitch
Parameters:	%1 = Axis name, spindle number
Explanation:	The pitch of the ballscrew/trapezoidal leadscrew set in the axis-specific MD31030 \$MA_LEADSCREW_PITCH is zero. The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Determine the leadscrew pitch (specify the machine manufacturer or pitch measurement with spindle cover removed) and enter it in the MD31030: \$MA_LEADSCREW_PITCH (mostly 10 or 5 mm/rev.).
Programm continuation:	Switch control OFF - ON.
26004	Axis %1 encoder %2 parameterization error: grid point distance with linear encoders
Parameters:	%1 = Axis name, spindle number %2 = Encoder number
Explanation:	The scale division of the linear scale set in the axis-specific MD31010 \$MA_ENC_GRID_POINT_DIST is zero or differs from the corresponding drive parameters. For a better understanding of the interrelations see the explanations for alarm 26002, which refer to rotatory encoders. The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. Enter the encoder grid point distance according to the data given by the machine (or measuring device) manufacturer in the MD31010 \$MA_ENC_GRID_POINT_DIST.
Programm continuation:	Switch control OFF - ON.
26005	Axis %1 parameterization error: output rating
Parameters:	%1 = Axis name, spindle number
Explanation:	For analog drives: The output evaluation of the analog speed setpoint set in the MD32250 \$MA_RATED_OUTVAL or in MD 32260 \$MA_RATED_VELO is zero. The effective output evaluation of the speed setpoint interface is zero: a. MD32260 \$MA_RATED_VELO is zero although a standardizing reference value needs to be defined on account of the setting MD32250 \$MA_RATED_OUTVAL>0 b. The corresponding drive-side standardizing parameter is zero, invalid or unreadable/unavailable although an automatic interface scaling adjustment has been selected on account of MD32250 \$MA_RATED_OUTVAL=0. The drive parameter defining the standard is not determined by PROFIdrive, but is specific to the manufacturer (see the relevant drive documentation: For SINAMICS: p2000). The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).

Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. The nominal output voltage in [%] of the maximum setpoint value (10 V) is entered in the MD32250 \$MA_RATED_OUTVAL, at which the rated motor speed in [degrees/s] is to be reached (MD32260 \$MA_RATED_VELO).
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

26006 Axis %1 encoder %2 encoder type/output type %3 not possible

Parameters:	%1 = Axis name, spindle number %2 = Encoder number %3 = Encoder type/output type
Explanation:	Not every encoder type or output type can be used with every control or drive variant. Permissible settings: MD30240 \$MA_ENC_TYPE = 0 Simulation = 1 Raw signal incremental encoder (PROFIdrive) = 4 Absolute encoder (all drive-side absolute encoders supported by PROFIdrive) MD30130 \$MA_CTRLOUT_TYPE = 0 Simulation = 1 Standard (PROFIdrive drives) The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. Check machine data MD30240 \$MA_ENC_TYPE and/or MD30130 \$MA_CTRLOUT_TYPE and make the necessary corrections.
Programm continuation:	Switch control OFF - ON.

26007 Axis %1 QEC: invalid coarse increment

Parameters:	%1 = Axis name, spindle number
Explanation:	The course increment for QEC must be within the range 1 <= course increment <= maximum value of MD18342 \$MN_MM_QEC_MAX_POINTS (currently 1025), because a greater number of values would exceed the available memory space.
Reaction:	Alarm display.
Remedy:	Modify the system variable \$AA_QEC_COARSE_STEPS accordingly.
Programm continuation:	Clear alarm with the RESET key. Restart part program

26008	Axis %1 QEC: invalid fine increment
Parameters:	%1 = Axis name, spindle number
Explanation:	The fine increment for quadrant error compensation \$AA_QEC_FINE_STEPS must be in the range $1 \leq \text{fine increment} \leq 16$ because this value has an influence on the computation time of the QEC.
Reaction:	Alarm display.
Remedy:	Modify the system variable \$AA_QEC_FINE_STEPS accordingly.
Programm continuation:	Clear alarm with the RESET key. Restart part program
26009	Axis %1 QEC: memory overflow
Parameters:	%1 = Axis name, spindle number
Explanation:	The product of the data \$AA_QEC_COARSE_STEPS+1 and \$AA_QEC_FINE_STEPS must not exceed the maximum number of the characteristic curve points (MD38010 \$MA_MM_QEC_MAX_POINTS). With a direction-dependent characteristic, this criterion applies to $2 * (\$AA_QEC_COARSE_STEPS+1) * \$AA_QEC_FINE_STEPS!$
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. Either increase MD38010 \$MA_MM_QEC_MAX_POINTS or reduce \$AA_QEC_COARSE_STEPS and/or \$AA_QEC_FINE_STEPS.
Programm continuation:	Clear alarm with the RESET key. Restart part program
26010	Axis %1 QEC: invalid acceleration characteristic
Parameters:	%1 = Axis name, spindle number
Explanation:	\$AA_QEC_ACCEL_1/2/3: The acceleration characteristic is divided into three areas. In each area there is a different quantization of the acceleration steps. The defaults should be changed only if compensation is inadequate in these acceleration areas. The defaults are as follows: - \$AA_QEC_ACCEL_1 with approx. 2% of maximum acceleration (\$AA_QEC_ACCEL_3), - \$AA_QEC_ACCEL_2 with approx. 60% of maximum acceleration (\$AA_QEC_ACCEL_3), - \$AA_QEC_ACCEL_3 with maximum acceleration (MD32300 \$MA_MAX_AX_ACCEL).
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. Enter the values correctly: $0 < \$AA_QEC_ACCEL_1 < \$AA_QEC_ACCEL_2 < \$AA_QEC_ACCEL_3$.
Programm continuation:	Clear alarm with the RESET key. Restart part program
26011	Axis %1 QEC: invalid measuring periods
Parameters:	%1 = Axis name, spindle number
Explanation:	\$AA_QEC_MEAS_TIME_1/2/3: measuring time to determine the error criterion. The measuring period begins when the criterion for activating the compensation value has been satisfied (the desired velocity changes the sign). The end is defined by the machine data values. In general, different measuring times are required for the three characteristic ranges. The presettings should be changed only if a problem occurs. The three data apply in each case for the three corresponding acceleration ranges. 1. \$AA_QEC_MEAS_TIME_1 specifies the measuring time (for determining the error criterion) for accelerations in the range between 0 and \$AA_QEC_ACCEL_1. 2. \$AA_QEC_MEAS_TIME_2 specifies the measuring time in the range from \$AA_QEC_ACCEL_1 to \$AA_QEC_ACCEL_2. 3. \$AA_QEC_MEAS_TIME_3 specifies the measuring time in the range from \$AA_QEC_ACCEL_2 to \$AA_QEC_ACCEL_3 and beyond.
Reaction:	Alarm display.
Remedy:	Please inform the authorized personnel/service department. Enter the values correctly: $0 < \$AA_QEC_MEAS_TIME_1 < \$AA_QEC_MEAS_TIME_2 < \$AA_QEC_MEAS_TIME_3$.
Programm continuation:	Clear alarm with the RESET key. Restart part program

26012 Axis %1 QEC: feed forward control not active**Parameters:** %1 = Axis name, spindle number**Explanation:** The error criterion for determining the quadrant error necessitates a correctly set feedforward control.
The alarm can be reprogrammed in the MD11412 \$MN_ALARM_REACTION_CHAN_NOREADY (channel not ready).**Reaction:** Mode group not ready.
Channel not ready.
NC Start disable in this channel.
Alarm display.
Channel not ready.**Remedy:** Switch on feedforward control and set it correctly.**Programm continuation:** Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

26014 Axis %1 machine data %2 invalid value**Parameters:** %1 = Axis name, spindle number

%2 = String: MD identifier

Explanation: Machine data includes a value that is not valid.**Reaction:** NC not ready.
The NC switches to follow-up mode.
Mode group not ready, also effective for single axes.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.**Remedy:** Repeat entry with correct value and then Power On.**Programm continuation:** Switch control OFF - ON.

26015 Axis %1 machine data %2[%3] invalid value**Parameters:** %1 = Axis name, spindle number

%2 = String: MD identifier

%3 = Index: MD array index

Explanation: Machine data includes a value that is not valid.**Reaction:** NC not ready.
The NC switches to follow-up mode.
Mode group not ready, also effective for single axes.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.**Remedy:** Repeat entry with correct value and then Power On.**Programm continuation:** Switch control OFF - ON.

26016 Axis %1 machine data %2 invalid value**Parameters:** %1 = Axis name, spindle number

%2 = String: MD identifier

Explanation: Machine data includes a value that is not valid.

Reaction:	NC not ready. The NC switches to follow-up mode. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Repeat entry with correct value and then Reset.
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

26017 Axis %1 machine data %2[%3] invalid value

Parameters:	%1 = Axis name, spindle number %2 = String: MD identifier %3 = Index: MD array
Explanation:	Machine data includes a value that is not valid.
Reaction:	NC not ready. The NC switches to follow-up mode. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Repeat entry with correct value and then Reset.
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

26018 Axis %1 setpoint output drive %2 used more than once

Parameters:	%1 = Axis name, spindle number %2 = Drive number
Explanation:	The same setpoint assignment has been allocated more than once. MD30110 \$MA_CTRLOUT_MODULE_NR contains the same value for different axes. PROFdrive: The stated MDs contain the same values for different axes, or different entries in MD13050 \$MN_DRIVE_LOGIC_ADDRESS contain the same values.
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Inform the authorized personnel/service department. Avoid dual assignment of the setpoint by correcting MD30110 \$MA_CTRLOUT_MODULE_NR. Also check the selected bus type of MD30100 \$MA_CTRLOUT_SEGMENT_NR.
Programm continuation:	Switch control OFF - ON.

26019 Axis %1 encoder %2 measurement not possible with this controller module

Parameters:	%1 = NC axis number %2 = Encoder number
--------------------	--

Explanation:	If the MD MD13100 \$MN_DRIVE_DIAGNOSIS[8] contains a value not equal to zero, then the control has found at least one control module which does not support measuring. Measuring was programmed from the part program for the associated axis.
Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	You have the following possibilities of eliminating the error. - Modify the measuring motion so that the axis concerned does not have to travel. Ensure that you do not program this axis in the measuring block. It is no longer possible to query the measured value for this axis. - Replace the control module with one that supports the measurement. See MD13100 \$MN_DRIVE_DIAGNOSIS[8].
Programm continuation:	Clear alarm with the RESET key. Restart part program

26020 Axis %1 encoder %2 hardware fault %3 during encoder initialization

Parameters:	%1 = Axis name, spindle number %2 = Encoder number %3 = Error fine coding
Explanation:	Error during initialization or access of encoder.
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Axes of this channel must be re-referenced. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. Rectify hardware error, replace encoder if necessary.
Programm continuation:	Switch control OFF - ON.

26022 Axis %1 encoder %2 measurement with simulated encoder not possible

Parameters:	%1 = NC axis number %2 = Encoder number
Explanation:	Alarm occurs on the control when a measurement was made without the encoder hardware (simulated encoder).
Reaction:	Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	- Inform the authorized personnel/service department. - If possible, modify the measuring motion so that the axis concerned does not have to travel; do not program this axis in the MEAS block again. You can no longer query a measured value for this axis. - Ensure that measurement is not made with simulated encoders (MD30240 \$MA_ENC_TYPE).
Programm continuation:	Clear alarm with the RESET key. Restart part program

26024 Axis %1 machine data %2 value changed

Parameters:	%1 = Axis name, spindle number %2 = String: MD identifier
--------------------	--

Explanation:	The machine data contains an invalid value and therefore has been changed by the software.
Reaction:	Alarm display.
Remedy:	Check the machine data.
Programm continuation:	Clear alarm with the RESET key. Restart part program

26025 Axis %1 machine data %2[%3] value changed

Parameters:	%1 = Axis name, spindle number %2 = String: MD identifier %3 = Index: MD array index
Explanation:	The machine data contains an invalid value. It was therefore changed by the software internally to a valid value.
Reaction:	Alarm display.
Remedy:	Check the machine data.
Programm continuation:	Clear alarm with the RESET key. Restart part program

26026 Axis %1 SINAMICS drive parameter P2038 value is not allowed.

Parameters:	%1 = Axis name, spindle number
Explanation:	For SINAMICS drives only: The interface mode, which is set via drive parameter P2038, has not been set to SIMODRIVE 611 universal. The alarm can be disabled by MD13070 \$MN_DRIVE_FUNCTION_MASK - bit15. However, the following must be noted: - The device-specific assignment of the bits in the control and status words may be different. - The drive data sets can be created at will, and need not be subdivided into groups of 8. (For details see also SINAMICS Commissioning Manual). So the parameters of motors 2-4 may be incorrectly assigned.
Reaction:	NC not ready. The NC switches to follow-up mode. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	- Set P2038 = 1 or - Set P0922 = 100...199 or - Set bit 15 of MD13070 \$MN_DRIVE_FUNCTION_MASK (note the boundary conditions, see above) and execute a Power ON in each case.
Programm continuation:	Switch control OFF - ON.

26027 Axis %1 Stiffness mode Splines is not available (%2)

Parameters:	%1 = Axis name, spindle number %2 = Fine ID
Explanation:	The Stiffness mode Splines is not available. Fine coding: Bit 0 - SINAMICS function block is not present (see P0108) Bit 1 - \$MN_DRIVE_TELEGRAMM_TYPE, set telegram that supports splines functionality (e.g. telegram 136) Bit 2 - Set \$MA_VELO_FFW_WEIGHT = 100% Bit 3 - Set \$MA_FIPO_TYPE = 2 Bit 4 - Set \$MA_FFW_MODE = 3 or 4 Bit 5 - Set \$MN_POSCTRL_SYSCLOCK_TIME_RATIO = 1

Reaction:	NC not ready. The NC switches to follow-up mode. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Set \$MA_SPLINES_CONTROL_CONFIG=0, or note and implement fine error code.
Programm continuation:	Switch control OFF - ON.

26028 Machine data %1[%2] value not permissible

Parameters:	%1 = String: MD identifier %2 = Index: MD array index
Explanation:	Machine data includes a value that is not valid.
Reaction:	NC not ready. The NC switches to follow-up mode. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Repeat entry with correct value and then Power On.
Programm continuation:	Switch control OFF - ON.

26029 Machine data %1[%2] value not permissible

Parameters:	%1 = String: MD identifier %2 = Index: MD array index
Explanation:	Machine data includes a value that is not valid.
Reaction:	NC not ready. The NC switches to follow-up mode. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Repeat entry with the correct value.
Programm continuation:	Clear alarm with the RESET key. Restart part program

26030 Axis %1 encoder %2 absolute position lost

Parameters:	%1 = Axis name, spindle number %2 = Encoder number
Explanation:	The absolute position of the absolute encoder has become invalid because - on changing parameter block, a changed gear stage ratio was identified between encoder and processing or - the encoder has been replaced (the absolute encoder's serial number was changed, see MD34230 \$MA_ENC_SERIAL_NUMBER, and drive-specific parameters). - of an internal number format limitation in MD34090 \$MA_REFP_MOVE_DIST_CORR. Remedy: reduce MD10210 \$MN_INT_INCR_PER_DEG or MD10200 \$MN_INT_INCR_PER_MM.

Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Axes of this channel must be re-referenced. Interface signals are set. Alarm display. NC Stop on alarm. Channel not ready.
Remedy:	Please inform the authorized personnel/service department. Rereferencing/resynchronization of the absolute encoder; attach absolute encoder on the load side and configure correctly (e.g. MD 31040 \$MA_ENC_IS_DIRECT).
Programm continuation:	Restart part program. Clear alarm with the RESET key in all channels of this mode group. Restart part program.

26031 Axis %1 configuration error master-slave

Parameters:	%1 = Axis name, spindle number
Explanation:	The alarm is output when the same machine axis has been configured as a master and a slave axis. Each of the axes in the master/slave link can be operated either as master or slave.
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	- Check machine data for all linked axes and correct if necessary: - MD 37250 \$MA_MS_ASSIGN_MASTER_SPEED_CMD - MD 37252 \$MA_MS_ASSIGN_MASTER_TORQUE_CTR.
Programm continuation:	Clear alarm with the RESET key. Restart part program

26032 [Channel %1:] Axis %2 master-slave not configured

Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	The master-slave coupling could not be activated because of incomplete configuration.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Check the current configuration of the master-slave coupling. The configuration can be modified via the MASLDEF instruction or the machine data MD37250 \$MA_MS_ASSIGN_MASTER_SPEED_CMD and MD37252 \$MA_MS_ASSIGN_MASTER_TORQUE_CTR.
Programm continuation:	Clear alarm with the RESET key. Restart part program

26040 Axis %1 encoder parameterization MD %2[%3] has been adjusted.

Parameters:	%1 = Axis number %2 = MD identifier %3 = Machine data index
Explanation:	The parameterization of the encoder in P979 read out from the drive and displayed in the MD does not match the NCK parameterization. The corresponding NCK-MD has been adapted.

Reaction:	NC not ready. The NC switches to follow-up mode. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Power on required. This alarm only occurs when the NC-MD is set unequal to the drive parameter.
Programm continuation:	Switch control OFF - ON.

26050 Axis %1 parameter set change from %2 to %3 not possible

Parameters:	%1 = Axis name, spindle number %2 = Index: current parameter block %3 = Index: new parameter block
Explanation:	The parameter block change cannot be performed without jumps. This is due to the content of the parameter block to be switched on, e.g. different load gear factors.
Reaction:	The NC switches to follow-up mode. Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Even with different load gear ratio settings, a parameter block change can be carried out via MD31060 \$MA_DRIVE_AX_RATIO_NUMERA and MD31050 \$MA_DRIVE_AX_RATIO_DENOM without an alarm under the following constraints: Constraints: 1. No position control is active, e.g. in follow-up mode or with spindle in speed-controlled mode. 2. For position control with the direct encoder. 3. For position control with the indirect encoder (the calculated load position difference must not exceed the value in MD36500 \$MA_ENC_CHANGE_TOL).
Programm continuation:	Clear alarm with the RESET key. Restart part program

26051 [Channel %1:] In block %2 unanticipated stop crossed in continuous path mode

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The path interpolation did not stop, as required, at the end of the block, but only decelerates to a standstill in the next block. This error situation occurs if the stop at the end of the block was not planned by the path interpolation or was not detected early enough. One possible cause is that the PLC changed the spindle speed when MD35500 \$MA_SPIND_ON_SPEED_AT_IPO_START > 0, and the machine has to wait until the spindle has returned to the setpoint range. Another possible cause is that a synchronized action needs to be finished before path interpolation continues. The alarm is only output if MD11400 \$MN_TRACE_SELECT = 'H400'. The alarm output is normally suppressed. - MD11400 \$MN_TRACE_SELECT has SIEMENS password protection.
Reaction:	Alarm display.
Remedy:	MD35500 \$MA_SPIND_ON_SPEED_AT_IPO_START = 1. Program G09 before the alarm output in the block to allow the path interpolation to stop as planned.
Programm continuation:	Clear alarm with the Delete key or NC START.

26052 [Channel %1:] In block %2: path velocity too high for auxiliary function output (%3)

Parameters:	%1 = Channel number %2 = Block number, label %3 = Fine coding
--------------------	---

Explanation:	This alarm usually occurs in a block with auxiliary function output during a movement. In this case, the wait for acknowledgment of the auxiliary function was longer than planned. The alarm also occurs if internal control inconsistencies cause continuous path mode (G64, G641, ...) to be blocked unexpectedly. The path interpolation stops abruptly at the end of the block indicated in the message (regenerative stop). Alarm 21620 is often triggered as a follow-up alarm. If not, the path continues after the block change.
Reaction:	Alarm display.
Remedy:	- The time calculated for the auxiliary function output during the movement comes from the PLC in most systems. Otherwise, MD10110 \$MN_PLC_CYCLE_TIME_AVERAGE is used for this purpose. - The alarm can basically be avoided by programming in the block G09 indicated in the message. This stops the path interpolation briefly at the end of the block.
Programm continuation:	Clear alarm with the Delete key or NC START.

26053 [Channel %1:] Block %2 interpolation problem in Look Ahead (module %3, identifier %4)

Parameters:	%1 = Channel number %2 = Block number, label %3 = Module identifier %4 = Error code
Explanation:	Synchronism between interpolation and preparation is incorrect.
Reaction:	Interpreter stop Local alarm reaction. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Please contact Siemens.
Programm continuation:	Clear alarm with the RESET key. Restart part program

26054 [Channel %1:] Block %2 interpolation warning in Look Ahead (module %3, problem %4)

Parameters:	%1 = Channel number %2 = Block number, label %3 = Module identifier %4 = Error code
Explanation:	The computer performance is inadequate to create a smooth path velocity profile. This can lead to drops in velocity.
Reaction:	Local alarm reaction. Alarm display. Warning display.
Remedy:	Change parameterization. Increase interpolation cycle.
Programm continuation:	Clear alarm with the Delete key or NC START.

26070 [Channel %1:] Axis %2 cannot be controlled by the PLC, max. number exceeded

Parameters:	%1 = Channel number %2 = Axis name, spindle number
Explanation:	An attempt was made to define more axes than allowed as PLC-controlled axes.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Check the option 'Number of PLC-controlled axes' and correct if necessary or reduce the number of requests for PLC-controlled axes.

Programm continuation: Clear alarm with the Delete key or NC START.

26072 [Channel %1:] Axis %2 cannot be controlled by the PLC

Parameters: %1 = Channel number
%2 = Axis name, spindle number

Explanation: Axis cannot be made a PLC-controlled axis. For the time being, the axis cannot be controlled at any state from the PLC.

Reaction: Interface signals are set.
Alarm display.

Remedy: Use Release or Waitp to make the axis a neutral one.

Programm continuation: Clear alarm with the Delete key or NC START.

26074 [Channel %1:] Switching off PLC control of axis %2 not allowed in the current state

Parameters: %1 = Channel
%2 = Axis, spindle

Explanation: The PLC can return the control rights for an axis to program processing only, if the axis is in READY state.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Reset VDI interface signal "PLC controls axis", then activate "Axial reset" and repeat process.

Programm continuation: Clear alarm with the Delete key or NC START.

26075 [Channel %1:] Block %2 Axis %3 not available for the NC program, as exclusively controlled by the PLC

Parameters: %1 = Channel
%2 = Block number, label
%3 = Axis, spindle

Explanation: The axis is exclusively controlled by the PLC. Therefore, the axis is not available for the NC program.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Have the axis not exclusively controlled by the PLC, but only temporarily. Change MD30460 \$MA_BASE_FUNCTION_MASK, bit 4.

Programm continuation: Clear alarm with the RESET key. Restart part program

26076 [Channel %1:] Block %2 Axis %3 not available for NC program, firmly assigned PLC axis

Parameters: %1 = Channel
%2 = Block number, label
%3 = Axis, spindle

Explanation: The axis is a firmly assigned PLC axis. The axis is therefore not available for the NC program.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Do not define axis as a firmly assigned PLC axis. Change of MD30460 \$MA_BASE_FUNCTION_MASK bit5.

Programm continuation: Clear alarm with the RESET key. Restart part program

26077 [Channel %1:] Axis %2 not available for the NC program, as exclusively controlled by the PLC

Parameters: %1 = Channel
%2 = Axis, spindle

Explanation: The axis is exclusively controlled by the PLC. Therefore, the axis is not available for the NC program.

Reaction: NC Start disable in this channel.

Interface signals are set.

Alarm display.

NC Stop on alarm.

Remedy: Have the axis not exclusively controlled by the PLC, but only temporarily. Change MD30460 \$MA_BASE_FUNCTION_MASK, bit 4.

Programm continuation: Clear alarm with the RESET key. Restart part program

26078 [Channel %1:] Axis %2 not available for NC program, firmly assigned PLC axis

Parameters: %1 = Channel
%2 = Axis, spindle

Explanation: The axis is a firmly assigned PLC axis. The axis is therefore not available for the NC program.

Reaction: NC Start disable in this channel.

Interface signals are set.

Alarm display.

NC Stop on alarm.

Remedy: Do not define axis as a firmly assigned PLC axis. Change of MD30460 \$MA_BASE_FUNCTION_MASK bit5.

Programm continuation: Clear alarm with the RESET key. Restart part program

26080 [Channel %1:] Retraction position of axis %2 not programmed or invalid

Parameters: %1 = Channel
%2 = Axis, spindle

Explanation: No retraction position has been programmed for the axis trigger time or the position became invalid.

Reaction: Alarm display.

Remedy: Preset value by means of POLFA(Axis,Type,Pos), with type = 1 (absolut) or type = 2 (incremental); type = 0 specifies the position as invalid.

Programm continuation: Clear alarm with the Delete key or NC START.

26081 [Channel %1:] Axis trigger of axis %2 was activated, but axis is not PLC-controlled

Parameters: %1 = Channel
%2 = Axis, spindle

Explanation: The axis trigger for single axis was initiated. However, the axis is not PLC-controlled at the trigger time (therefore no single axis) or the position became invalid.

Reaction: Alarm display.

Remedy: Preset axis PLC-controlled (declare single axis).

Programm continuation: Clear alarm with the Delete key or NC START.

26082 [Channel %1:] ESR for PLC-controlled axis %2 has been triggered

Parameters: %1 = Channel
%2 = Axis, spindle

Explanation:	An axial ESR has been triggered for an individual axis (PLC-controlled axis): The display can be suppressed by MD11410 \$MN_SUPPRESS_ALARM_MASK bit28 = 1.
Reaction:	Alarm display.
Remedy:	The individual axis is in axial stop after the ESR movement. If an axial reset is performed for the individual axis, the alarm will be deleted and the individual axis can be traversed again.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary. The individual axis is in axial stop after the ESR movement. If an axial reset is performed for the individual axis, the alarm will be deleted and the individual axis can be traversed again.

26100 Axis %1 drive %2 sign of life missing

Parameters:	%1 = Axis name, spindle number %2 = Drive number
Explanation:	Special case: The output of drive number=0 indicates that a computing timeout occurred on the IPO level (see also alarm 4240)
Reaction:	NC not ready. The NC switches to follow-up mode. Mode group not ready, also effective for single axes. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Restart drive, check drive software.
Programm continuation:	Switch control OFF - ON.

26101 Axis %1 drive %2 communication failure

Parameters:	%1 = Axis name, spindle number %2 = Drive number
Explanation:	For PROFIdrive only: The drive is not communicating.
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Axes of this channel must be re-referenced. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	- Check the bus configuration. - Check the interface (connector removed, option module inactive, etc.).
Programm continuation:	Clear alarm with the RESET key. Restart part program

26102 Axis %1 drive %2 sign of life missing

Parameters:	%1 = Axis name, spindle number %2 = Drive number
Explanation:	For PROFIdrive only: The sign-of-life cell is no longer being updated by the drive.

Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Axes of this channel must be re-referenced. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	- Check the cycle settings (recommendation: e.g. MD10062 \$MN_POSCTRL_CYCLE_DELAY = 0.0) - Increase the cycle time if necessary. - Power-up the drive again. - Check drive software.
Programm continuation:	Clear alarm with the RESET key. Restart part program

26105 Drive of axis %1 not found

Parameters:	%1 = Axis name, spindle number
Explanation:	For PROFIdrive only: The drive configured for the specified axis could not be found. For example, a PROFIBUS slave was configured on the NC but is not contained in the PROFIBUS/PROFINET configuration.
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Possible causes: - MD30130 \$MA_CTRLOUT_TYPE not equal to 0 as a result of an oversight; the drive should actually be simulated (= 0). - MD30110 \$MA_CTRLOUT_MODULE_NR entered incorrectly, i.e. the logical drive numbers were exchanged and an invalid value is stored for this drive in MD13050 \$MN_DRIVE_LOGIC_ADDRESS (see 3.) or a drive number which does not exist on the bus was entered (check the number for slaves, for example). - MD13050 \$MN_DRIVE_LOGIC_ADDRESS contains values which were not configured on PROFIBUS/PROFINET or different addresses of the input and output slots of the drives were selected in the PROFIBUS/PROFINET configuration.
Programm continuation:	Switch control OFF - ON.

26106 Encoder %2 of axis %1 not found

Parameters:	%1 = Axis name, spindle number %2 = Encoder number
Explanation:	For PROFIdrive only: The encoder configured for the specified axis could not be found. For example, a PROFIBUS slave was configured on the NC but it is not contained in the PROFIBUS/PROFINET configuration or defective hardware was reported for it.
Reaction:	Mode group not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.

Remedy:	Possible causes: - MD 30240 \$MA_ENC_TYPE not equal to 0 as a result of an oversight; the encoder should actually be simulated (= 0). - MD 30220 \$MA_ENC_MODULE_NR entered incorrectly, i.e. the logical drive numbers were transposed and an invalid value is stored for this drive in MD 13050 \$MN_DRIVE_LOGIC_ADDRESS (see next paragraph), or a drive number which does not exist on the bus was entered (check the number for slaves, for example). - MD 13050 \$MN_DRIVE_LOGIC_ADDRESS contains values which were not configured on the PROFIBUS/PROFINET or different addresses were selected for the input and output slots of the drive in the PROFIBUS/PROFINET configuration. - A fatal encoder error was detected during the selection of the encoder (encoder defective, removed), so that park status cannot be left (in such a case, this alarm is triggered instead of alarm 25000/25001 - please refer to them for other possible causes of the error).
Programm continuation:	Switch control OFF - ON.

26110 Independent drive stop/retract triggered

Explanation:	For SINAMICS only: Informational alarm: At least in one axis, a "drive-autonomous shutdown or retraction" was triggered.
Reaction:	NC not ready. The NC switches to follow-up mode. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Deselect drive-autonomous stop or retraction. acknowledge alarm with reset.
Programm continuation:	Clear alarm with the RESET key. Restart part program

26120 [Channel %1:] Axis %2 \$AA_ESR_ENABLE = 1 but axis should be set to NEUTRAL

Parameters:	%1 = Channel %2 = Axis, spindle
Explanation:	One axis with ESR configuration and \$AA_ESR_ENABLE[axis] = 1 should be set to NEUTRAL. However, neutral axes (apart from single axes) cannot execute an ESR.
Reaction:	Alarm display.
Remedy:	Set \$AA_ESR_ENABLE[axis] = 0 before setting axis to NEUTRAL. Alarm can be suppressed via MD11415 \$MN_SUPPRESS_ALARM_MASK_2 bit 6 = 1.
Programm continuation:	Clear alarm with the Delete key or NC START.

26121 [Channel %1:] Axis %2 is NEUTRAL and \$AA_ESR_ENABLE = 1 should be set

Parameters:	%1 = Channel %2 = Axis, spindle
Explanation:	\$AA_ESR_ENABLE[axis] = 1 should not be set to neutral axes (apart from single axes). Neutral axes (apart from single axes) cannot execute an ESR.
Reaction:	Alarm display.
Remedy:	Do not apply \$AA_ESR_ENABLE[axis] = 1 to neutral axes (apart from single axes). Alarm can be suppressed via MD11415 \$MN_SUPPRESS_ALARM_MASK_2 bit 6 = 1.
Programm continuation:	Clear alarm with the Delete key or NC START.

26122 [Channel %1:] Axis %2, \$AA_ESR_ENABLE = 1, axis exchange not executed in this state

Parameters:	%1 = Channel %2 = Axis, spindle
--------------------	------------------------------------

Explanation: With \$AA_ESR_ENABLE[axis] = 1 axis exchange not permitted.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: Set \$AA_ESR_ENABLE[axis] = 0 before axis exchange.

Programm Clear alarm with the RESET key. Restart part program

continuation: Set \$AA_ESR_ENABLE[axis] = 0

26126 [channel %1:] block %2 axis %3: ESRR or ESRS could not be executed, error code %4

Parameters: %1 = Channel
%2 = Block number, label
%3 = Axis, spindle
%4 = Error code

Explanation: Writing the data of the part program commands ESRR or ESRS could not be executed.
Error code:

- 1: The indicated axis is not assigned to any axis.
- 2: One or more ESR parameters in SINAMICS are not available.
- 3: Writing of one or more ESR parameters in SINAMICS was prevented.

Reaction: Local alarm reaction.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm at block end.

Remedy: Error code:
1: Check the assignment of the NC axes to the drives.
2: One or more ESR parameters in SINAMICS are not available.
Check the assignment of the NC axes to the drives.
Programming of ESRR or ESRS is possible only for SINAMICS as from V4.4.
The function module "drive-autonomous stop and retract" in SINAMICS not active.
3: Writing one or more ESR parameters in SINAMICS was prevented.
Activate the output of additional information alarms through MD11411 \$MN_ENABLE_ALARM_MASK, bit 1 = 1.

Programm Clear alarm with the RESET key. Restart part program
continuation: Writing of the data of the part program commands ESRR or ESRS was refused.
Check programming
Acknowledge alarm with reset

26201 [Channel %1:] Block %2: The ROOT chain element was not found.

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The kinematic chain element with the name specified in MD16800 \$MN_ROOT_KIN_ELEM_NAME was not found.
This error does not occur if kinematic chain elements have not been defined, i.e. if all system variables \$NK_NAME[n] are empty.

Reaction: Correction block is reorganized.
Interface signals are set.
Alarm display.

Remedy: Change the content of machine data MD16800 \$MN_ROOT_KIN_ELEM_NAME so that it refers to an existing, kinematic chain element, or adapt the name of a kinematic chain element to the content of the specified machine data.

Programm Clear alarm with NC START or RESET key and continue the program.
continuation:

26202	[Channel %1:] Block %2: The names of the kinematic chain links \$NK_NAME[%3] and \$NK_NAME[%4] are the same
Parameters:	%1 = Channel number %2 = Block number, label %3 = Index of 1st chain element %4 = Index of 2nd chain element
Explanation:	There are (at least) two kinematic chain links with the same name. The names of the kinematic chain links must be clear and identifiable.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Change the names of the kinematic chain links involved
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
26204	[Channel %1:] Block %2: The chain element %3 referred to in \$NK_NEXT[%4] is already contained in the chain
Parameters:	%1 = Channel number %2 = Block number, label %3 = Name of the next chain link %4 = Index of the chain element
Explanation:	In one chain link, the next link of the chain is indicated as a chain link already in existence in the chain. This allows you to define a not permitted closed chain.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Define the kinematic chain in such a way that no closed chain results.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
26208	[Channel %1:] Block %2: Chain element %3, referred to in \$NK_NEXT[%4], was not found
Parameters:	%1 = Channel number %2 = Block number, label %3 = Name of the next chain link %4 = Index of chain link
Explanation:	The chain link indicated as the next link in a kinematic chain was not found.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Indicate in \$NK_NEXT[...] the name of an existing chain link.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
26210	[Channel %1:] Block %2: Chain element %3, referred to in \$NK_PARALLEL[%4], was not found
Parameters:	%1 = Channel number %2 = Block number, label %3 = Name of the next, parallel chain element %4 = Index of chain link
Explanation:	The specified parallel chain element was not found.

Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	In \$NK_PARALLEL[...], specify the name of an existing chain element.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

26211	[Channel %1:] Block %2: \$NK_SWITCH_INDEX[%3] is too large.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Index of the chain element
Explanation:	The content of \$NK_SWITCH_INDEX of a chain element of type "SWITCH" must be greater than or equal to -1 and less than the content of machine data MD18882 \$MN_MM_MAXNUM_KIN_SWITCHES.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Enter a permissible value in \$NK_SWITCH_INDEX.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

26216	[Channel %1:] Block %2: The axis direction in chain element %3 has not been defined.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Fine offset value
Explanation:	The chain element describes an axis, the direction of which is defined by the value included in \$NK_OFF_DIR and \$NK_OFF_DIR_FINE. The definition is valid only if the value of the sum vector and the value of the basic vector \$NK_OFF_DIR are higher than 1.0e-6.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Enter valid vectors in \$NK_OFF_DIR and/or \$NK_OFF_DIR_FINE, or change the type of the chain element.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

26218	[Channel %1:] Block %2: Invalid name in %3[%4]
Parameters:	%1 = Channel number %2 = Block number, label %3 = Name of the system variable %4 = Index of the system variable
Explanation:	A system variable of type STRING contains an invalid name.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Use a permissible name. The permissible names can be found in the documentation of the system variables involved.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

26220	[Channel %1:] Block %2: unknown element type in \$NK_TYPE[%3]
Parameters:	%1 = Channel number %2 = Block number, label %3 = Index of the system variable
Explanation:	The system variable \$NK_TYPE contains an impermissible element type. The following types are permissible (no distinction between upper and lower case): "OFFSET" "AXIS_LIN" "AXIS_ROT" "ROT_CONST" "SWITCH" This alarm also occurs when the element type of the kinematic chain elements and the axis type of a machine axis entered in \$NK_NAME do not correspond. Example: \$NK_TYPE[...] contains the type "AXIS_LIN" and \$NK_AXIS the string "C1", where C1 is the machine axis identifier of a rotary axis.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Use a permissible type.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
26237	[Channel %1:] Block %2: \$NP_CHAIN_ELEM[%4] = %3 refers to a chain element of type SWITCH.
Parameters:	%1 = Channel number %2 = Block number, label %3 = Name of the chain element %4 = Index of protection area
Explanation:	The component \$NP_CHAIN_ELEM of the specified protection area refers to a chain element of type "SWITCH". Protection areas must not be attached to chain elements of this type.
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Attach the protection area to another element in the kinematic chain. For example, an additional element of the type OFFSET with zero length can be inserted before the chain element of the type SWITCH.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
26260	[Channel %1:] Block %2: Collision of the two protection areas %3 and %4
Parameters:	%1 = Channel number %2 = Block number, label %3 = Name of 1st protection area %4 = Name of 2nd protection area
Explanation:	The two protection areas named collide in the indicated block, i.e. the distance between the two protection areas is smaller than the value defined by MD10619 \$MN_COLLISION_TOLERANCE.
Reaction:	Correction block is reorganized. Alarm display. NC Stop on alarm.
Remedy:	Change NC program or definition of the protection areas involved.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

26261	[Channel %1:] The two protection areas %2 and %3 collide
Parameters:	%1 = Channel number %2 = Name of 1st protection area %3 = Name of 2nd protection area
Explanation:	The two stated protection areas collide.
Reaction:	Interpreter stop Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Change NC program or definition of the protection areas involved.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
26265	[Channel %1:] Block %2: Collision of the two protection areas %3 and %4
Parameters:	%1 = Channel number %2 = Block number, label %3 = Name of 1st protection area %4 = Name of 2nd protection area
Explanation:	The two protection areas named collide in the indicated block, i.e. the distance between the two protection areas is smaller than the value defined by MD10619 \$MN_COLLISION_TOLERANCE.
Reaction:	Alarm display. NC Stop on alarm.
Remedy:	Change NC program or definition of the protection areas involved.
Programm continuation:	Clear alarm with the RESET key. Restart part program
26278	[Channel %1:] Block %2: The axis name %3 contained in \$NK_AXIS[%4] is unknown or invalid
Parameters:	%1 = Channel number %2 = Block number, label %3 = Axis or frame name %4 = Index of the chain element
Explanation:	An unknown or invalid name was entered in the element of a kinematic chain in the component \$NK_AXIS[...]. The name entered must be a machine axis identifier. The alarm also occurs if the name entered in \$NK_AXIS[...] exists, but the named element is not of the type defined in \$NK_TYPE[...]. Example: \$NK_TYPE[...] contains type "AXIS_ROT" and \$NK_AXIS[...] the machine axis identifier of a linear axis, e.g. "X1".
Reaction:	Correction block is reorganized. Interface signals are set. Alarm display.
Remedy:	Enter a valid name in \$NK_AXIS[...] (machine axis identifier). Enter the type of element in \$NK_TYPE[...] that is referred to by the content of \$NK_AXIS.
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.
26280	[Channel %1:] Axis %2 risk of collision %3 %4
Parameters:	%1 = Channel number %2 = Axis name, spindle number %3 = 1st protection area %4 = 2nd protection area
Explanation:	The indicated axis was stopped due to the risk of collision.
Reaction:	Alarm display.

Remedy: In JOG mode: Retract axis from danger zone.
In automatic mode: Determine reason for the risk of collision and eliminate. Possible reasons: wrong NC program, too large handwheel overrides, axis couplings and vice-versa impairing of two channels.

Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

26281 [Channel %1:] Axis %2 risk of collision %3 %4

Parameters: %1 = Channel number
%2 = Axis name, spindle number
%3 = 1st protection area
%4 = 2nd protection area

Explanation: The stated axis was stopped due to the risk of collision. The programmed path may have been left because it was not possible to stop in time on the path (exceptional situation).

Reaction: Local alarm reaction.
NC Start disable in this channel.
Interface signals are set.
Alarm display.
NC Stop on alarm at block end.

Remedy: In JOG mode: Retract axis from danger zone.
In automatic mode: Determine reason for the risk of collision and eliminate. Possible reasons: wrong NC program, too large handwheel overrides, axis couplings and vice-versa impairing of two channels.

Programm continuation: Clear alarm with the RESET key. Restart part program
The stated axis was stopped due to the risk of collision. The programmed path may have been left because it was not possible to stop in time on the path (exceptional situation).

26285 [Channel %1:] Block %2: emergency stop due to collision %3 %4

Parameters: %1 = Channel number
%2 = Block number, label
%3 = 1st protection area
%4 = 2nd protection area

Explanation: All axes were stopped via emergency stop due to a collision

Reaction: NC Start disable in this channel.
Local alarm reaction.
The NC switches to follow-up mode.
Interface signals are set.
Alarm display.
NC Stop on alarm.

Remedy: In Jog mode: move axis out of the collision.

Programm continuation: Clear alarm with the RESET key. Restart part program

26286 [Channel %1:] Block %2 risk of collision preactivated protection areas %3 and %4

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Name of 1st protection area
%4 = Name of 2nd protection area

Explanation: A collision was detected involving at least one preactivated protection area.
Such a collision can occur if the interface signal assigned to a preactivated protection area has been activated. In other words, if a preactivated protection area has become an active protection area.
Either a preactivated and a (static) active protection area can be involved in the collision, or two preactivated protection areas can be involved. The names of the protection areas are output in the alarm test.

Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Reset activating interface signals. Redefine protection areas. Retract
Programm continuation:	Clear alarm with NC START or RESET key and continue the program.

26300 **Loss of sign-of-life of the external collision avoidance.**

Explanation:	The configured timeout (MD16904 \$MN_COLLISION_EXT_TIMEOUT) for communication with the external collision avoidance has expired.
Reaction:	NC Stop on alarm. Alarm display. Interface signals are set. NC not ready.
Remedy:	Check external system for errors, if necessary lengthen timeout.
Programm continuation:	Clear alarm with the RESET key in all channels. Restart part program.

26302 **External collision avoidance: Waiting for connection.**

Explanation:	An external collision avoidance was configured. NCK is waiting for the system to connect.
Reaction:	Alarm display. Interface signals are set.
Remedy:	External system start, check connection if necessary.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

26303 **Collision check incomplete. Function code: %1**

Parameters:	%1 = Function code
Explanation:	The collision check is active, but insufficient computing time is available for a complete check
Reaction:	Alarm display.
Remedy:	Check and adjust the configuration of the control. Suppress alarm with MD11415 \$MN_SUPPRESS_ALARM_MASK_2 Bit 29
Programm continuation:	Clear alarm with the Delete key or NC START.

26350 **External collision avoidance: System deactivated.**

Explanation:	The external system has been deactivated. There is no collision protection!
Reaction:	Alarm display. Interface signals are set.
Remedy:	Activate external system.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

26351 **External collision avoidance: Initializing.**

Explanation:	The external system has been connected but is not yet ready.
Reaction:	Alarm display. Interface signals are set.

Remedy: Waiting. Checking whether external system is signaling errors.
Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

26352 External collision avoidance: Measuring mode.

Explanation: The external system is in measuring mode.

Reaction: Alarm display.
Interface signals are set.

Remedy: For details, see the external system output.

Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

26353 External collision avoidance: Error on inactive tool %1. Error code %2.

Parameters: %1 = Tool number
%2 = Error code

Explanation: The external system is signaling an error on an inactive tool.

Reaction: Alarm display.
Interface signals are set.

Remedy: Check external system and rectify reported error.

Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

26354 External collision avoidance: A motion is being slowed down or stopped (%1, %2, %3, %4).

Parameters: %1 = Error code
%2 = Error code
%3 = Error code
%4 = Error code

Explanation: A motion is being slowed down or stopped.

Reaction: Alarm display.
Interface signals are set.

Remedy: For details, see the external system output.

Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

26355 External collision avoidance: System is signaling a warning (%1, %2, %3, %4).

Parameters: %1 = Error code
%2 = Error code
%3 = Error code
%4 = Error code

Explanation: External system is signaling a warning.

Reaction: Alarm display.
Interface signals are set.

Remedy: For details, see the external system output.

Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

26370 External collision avoidance: Stop due to collision (%1, %2).

Parameters: %1 = Error code
%2 = Error code

Explanation: External system reports a collision.

Reaction:	Alarm display. NC Start disable in this channel. NC Stop on alarm. Interface signals are set.
Remedy:	For details, see the external system output.
Programm continuation:	Clear alarm with the RESET key. Restart part program

26371 External collision avoidance: Stop (error on active tool %1, error code %2).

Parameters:	%1 = Tool number %2 = Error code
Explanation:	The external system is signaling an error on the active tool.
Reaction:	Alarm display. NC Start disable in this channel. NC Stop on alarm. Interface signals are set.
Remedy:	Check external system and rectify reported error.
Programm continuation:	Clear alarm with the Delete key or NC START.

26372 External collision avoidance: Communication error (OPC UA, error code %1).

Parameters:	%1 = Error code
Explanation:	An error has occurred in the communication between the external system and the OPC UA Server.
Reaction:	Alarm display. NC Start disable in this channel. NC Stop on alarm. Interface signals are set.
Remedy:	For details, see the external system output.
Programm continuation:	Clear alarm with the Delete key or NC START.

26373 External collision avoidance: Log error (%1, %2).

Parameters:	%1 = Error code %2 = Error code
Explanation:	An error has occurred in the communication between the external system and the NCK.
Reaction:	Alarm display. NC Start disable in this channel. NC Stop on alarm. Interface signals are set.
Remedy:	For details, see the external system output.
Programm continuation:	Clear alarm with the Delete key or NC START.

26374 External collision avoidance: System is signaling an error (%1, %2, %3, %4).

Parameters:	%1 = Error code %2 = Error code %3 = Error code %4 = Error code
Explanation:	The external system is signaling an error.

Reaction: Alarm display.
NC Start disable in this channel.
NC Stop on alarm.
Interface signals are set.

Remedy: Check the external system error output / log files for details.

Programm continuation: Clear alarm with the RESET key. Restart part program

26375 External collision avoidance: Stop due to collision (%1, %2).

Parameters: %1 = Error code
%2 = Error code

Explanation: The external system reports a collision.

Reaction: Alarm display.
NC Start disable in this channel.
NC Stop on alarm.
Interface signals are set.

Remedy: For details, see the external system output.

Programm continuation: Clear alarm with the Delete key or NC START.

26376 External collision avoidance: System is signaling an error (%1, %2, %3, %4).

Parameters: %1 = Error code
%2 = Error code
%3 = Error code
%4 = Error code

Explanation: The external system is signaling an error.

Reaction: Alarm display.
NC Start disable in this channel.
NC Stop on alarm.
Interface signals are set.

Remedy: Check the external system error output / log files for details.

Programm continuation: Clear alarm with the Delete key or NC START.

26380 [Channel %1:] Block %2: Incorrect AFIS configuration for axis %3 identifier %4

Parameters: %1 = Channel number
%2 = Block number, label
%3 = Axis
%4 = Error code

Explanation: Automatic filter switching (AFIS) is active, but with an incorrect configuration for an axis.
1: The axis is configured as AFIS axis, but no jerk filter is activated by MD32400 \$MA_AX_JERK_ENABLE. The jerk filter must always be active for AFIS axes.
2: The axis is configured with only one filter chain (e.g. MD32402 \$MA_AX_JERK_MODE=0x). Two filter chains must always be configured for AFIS axes.

Reaction: Alarm display.
Interface signals are set.
Interpreter stop

Remedy: 1: Activate the jerk filter for the axis with MD32400 \$MA_AX_JERK_ENABLE.
2: a: Parameterize two filter chains for the axis with MD32402 \$MA_AX_JERK_MODE
b: Deactivate AFIS for the axis: MD32332 \$MA_AFIS_ENABLE = FALSE

Programm continuation: Clear alarm with the RESET key. Restart part program

27008 Axis %1 SW limit switch deactivated

Parameters: %1 = Axis name, spindle number

Explanation: Via the HMI, the SI acceptance test Safe limit position has been started, for example with the acceptance test wizard. For these acceptance tests, the single-channel software limit switches are deactivated for the axis/spindle, in order to assure that the safe limit positions can be approached.

Reaction: Alarm display.

Deactivation of the single-channel software limit switch for the displayed axis/spindle.

Remedy: Deselect the acceptance test, for example with the acceptance test wizard, or wait until completed.

Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

27033 Axis %1 parameterisation of MD %2[%3] invalid, error code %4

Parameters: %1 = Axis name, spindle number

%2 = MD name

%3 = MD array index for MD name

%4 = Error code, reference to the cause (see alarm description)

Explanation:

The parameterization of the specified machine data is incorrect. An additional indication is the array index of the machine data. If the machine data is a single machine data item, a zero is specified as the array index. This alarm occurs in accordance with the displayed error code in the following connections:

- 1: Conversion of the specified MD to the internal calculation format causes an overflow.
- 2: Error in parameterization of the input/output assignments for the SGEs/SGAs.
- 3: One of the activated cam positions lies outside the actual value modulo range.
- 4: The function "actual value synchronization 2-encoder system" (slip) has been selected for a 1-encoder system.
- 5: The function "actual value synchronization 2-encoder system" (slip) has been selected at the same time as a function with an absolute reference (SE/SN).
- 6: A safety function has been enabled in MD36901 \$MA_SAFE_FUNCTION_ENABLE although the safety functions SBH/SG have not been enabled.
- 7: An axis-specific SGE/SGA has been parameterized on the SPL interface (segment number = 4) and the function enable for the external stops (MD36901 \$MA_SAFE_FUNCTION_ENABLE, bit 6) is missing.
- 8: The cam synchronization has been activated via bit 7 in MD36901 \$MA_SAFE_FUNCTION_ENABLE without enabling the cams via bits 8...15.
- 12: A zero has been entered in MD36917 \$MA_SAFE_ENC_GRID_POINT_DIST.
- 13: A zero has been entered in MD36918 \$MA_SAFE_ENC_RESOL.
- 14: The parameterized cam modulo range MD36905 \$MA_SAFE_MODULO_RANGE is not an integer multiple of 360 degrees.
- 15: An axis-specific SGE/SGA has been parameterized on the SPL interface (segment number = 4) and SGE "Deselection ext. stop A" (assigned via MD36977 \$MA_SAFE_EXT_STOP_INPUT[0]) has been parameterized inverted (bit 31 = 1) or SGE "Deselection ext. stop A" has not been parameterized on the SPL interface \$A_OUTSI.
- 16: MD10097 \$MN_SAFE_SPL_STOP_MODE has been parameterized on value 4 (stop E) although the external stop E has not been enabled on all axes with SI function enables (MD36901 \$MA_SAFE_FUNCTION_ENABLE not equal to 0).
- 17: In MD36907 \$MA_SAFE_DRIVE_PS_ADDRESS, an invalid value has been parameterized or the same address has been assigned to multiple axes.
- 18: The internal preassignment of MD36919 \$MA_SAFE_ENC_PULSE_SHIFT from the drive parameterization was not possible because values would have to be set outside the permissible range. Adjust the encoder parameterization in the drive.
- 19: MD36932 \$MA_SAFE_VELO_OVR_FACTOR has been parameterized with decimal places.
- 20: The value entered in MD36934 \$MA_SAFE_POS_LIMIT_PLUS and MD36935 \$MA_SAFE_POS_LIMIT_MINUS have been swapped. The upper limit is less than or equal to the lower limit.
- 21: In MD30300 \$MA_IS_ROT_AX and MD36902 \$MA_SAFE_IS_ROT_AX, various settings have been made.
- 22: The parameterized cam modulo range MD36905 \$MA_SAFE_MODULO_RANGE and the modulo range in MD30330 \$MA_MODULO_RANGE are not divisible by one another with an integer result.
- 23: Testing of the brake mechanism was enabled without enabling safe operation for this axis in MD36901 \$MA_SAFE_FUNCTION_ENABLE or enabling the link to the drive-autonomous safety functions in MD37950 \$MA_SAFE_INFO_ENABLE. Testing of the brake mechanism is only permissible with safety functions in this axis.
- 24: MD36961 \$MA_SAFE_VELO_STOP_MODE or MD36963 \$MA_SAFE_VELO_STOP_REACTION has been parameterized with an impermissible value.
- 25: Alarms 27000/F01797 are to be suppressed during parking (MD36965 \$MA_SAFE_PARK_ALARM_SUPPRESS!=0). For this, SGA "Axis safely referenced" must be parameterized in MD36987 \$MA_SAFE_REFP_STATUS_OUTPUT.
- 26: The logical base address configured in Step 7 and addressed in MD36906 \$MA_SAFE_CTRLOUT_MODULE_NR, MD10393 \$MN_SAFE_DRIVE_LOGIC_ADDRESS do not match, or the slot addressed in this way has the wrong length.
- 27: Cam position MD36936 \$MA_SAFE_CAM_POS_PLUS[n] or MD36937 \$MA_SAFE_CAM_POS_MINUS[n] is parameterized too near to the modulo limit.
- 28: In MD36901 \$MA_SAFE_FUNCTION_ENABLE, "Safe cams" are enabled in bits 8...15, while in MD36903 \$MA_SAFE_CAM_ENABLE the function "Safe cam track" is enabled.
- 29: Minus cam position MD36937 \$MA_SAFE_CAM_POS_MINUS[n] is greater than the plus cam position MD36936 \$MA_SAFE_CAM_POS_PLUS[n]. This is not allowed for the function "Safe cam track."
- 30: The distance between 2 cams on one cam track (MD36937 \$MA_SAFE_CAM_POS_MINUS[n] and MD36936 \$MA_SAFE_CAM_POS_PLUS[m]) is too small. ("Safe cam track" function)
- 31: The cam length, that is the distance between plus cam position (MD36936 \$MA_SAFE_CAM_POS_PLUS[n]) and minus cam position (MD36937 \$MA_SAFE_CAM_POS_MINUS[n]), is too small. ("Safe cam track" function)
- 32: For at least 2 cams enabled in MD36903 \$MA_SAFE_CAM_ENABLE, identical values are entered in MD36938 \$MA_SAFE_CAM_TRACK_ASSIGN[n]. ("Safe cam track" function)

- 33: The value parameterized in MD36938 \$MA_SAFE_CAM_TRACK_ASSIGN[n] for a cam enabled in MD36903 \$MA_SAFE_CAM_ENABLE is invalid. ("Safe cam track" function)
- 34: More than 15 cams have been assigned to one cam track in MD36938 \$MA_SAFE_CAM_TRACK_ASSIGN[n]. ("Safe cam track" function)
- 35: Cam modulo functionality has been selected in MD36905 \$MA_SAFE_MODULO_RANGE, although this is not supported for the "Safe cam track" function.
- 36: The parameterized monitoring cycle time MD10091 \$MN_INFO_SAFETY_CYCLE_TIME does not match the monitoring cycle time parameterized in the drive monitoring channel (p9500).
- 37: The velocity hysteresis n<nx in MD36947 \$MA_SAFE_VELO_X_HYSTERESIS is greater than 3/4 of the velocity limit n<nx in MD36946 \$MA_SAFE_VELO_X.
- 38: The velocity hysteresis n<nx in MD36947 \$MA_SAFE_VELO_X_HYSTERESIS is less than or equal to 0.
- 39: The velocity tolerance n<nx in MD36947 \$MA_SAFE_VELO_X_HYSTERESIS is less than the slip tolerance in MD36949 \$MA_SAFE_SLIP_VELO_TOL.
- 40: An axis-specific SGE/SGA addresses the SPL interface outside of the scope enabled by the relevant option.
- 41: The total encoder resolution (combination of coarse and fine resolution in MD36918 \$MA_SAFE_ENC_RESOL and MD36919 \$MA_SAFE_ENC_PULSE_SHIFT) is invalid or exceeds the supported actual value format.
- 42: Simultaneous enable of NC-controlled brake test and drive-integrated brake test is not permitted.
- 43: For an axis with safety functions, no PROFIdrive drive has been parameterized in MD30100 \$MA_CTRLOUT_SEGMENT_NR for the setpoint/actual value channel assignment. Enable SIC/SCC link (MD37950 \$MA_SAFE_INFO_ENABLE) or reset the NC-controlled brake test enable (MD37000 \$MA_FIXED_STOP_MODE).

Reaction:

Mode group not ready.
 Channel not ready.
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.
 NC Stop on alarm.

Remedy:

Check and change the specified MD. Allow the checksum to be recalculated. Re-accept safety functions.

Programm**continuation:**

Switch control OFF - ON.

27811 Axis %1 Parameterizing error: MD %2 [%3] invalid
Parameters:

%1 = Axis name, spindle number
 %2 = MD name
 %3 = MD array index for MD name

Explanation:

The parameterization of the displayed machine data is incorrect.
 This alarm occurs in the following contexts:

- During evaluation of the SIC/SCC telegram number in MD13376 \$MN_SAFE_INFO_TELEGRAM_TYPE or in drive parameter p60122, an invalid SIC/SCC telegram number was found (not equal to 701).
- The check of the logical base addresses from MD13374 \$MN_SAFE_INFO_DRIVE_LOGIC_ADDR has indicated that a slot with this address does not exist, or the SIC/SCC telegram has an incorrect length and "SIC/SCC" communication cannot be enabled.

Reaction:

Mode group not ready.
 Channel not ready.
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.
 NC Stop on alarm.
 Prevention of cyclic PROFIsafe communication between PLC and drive.
 Prevention of cyclic SIC/SCC communication between the NCK and drive.

Remedy:

Parameterize a valid SIC/SCC telegram number (701).
 Configure or parameterize with valid logical basis addresses for the SIC/SCC slots or PROFIsafe slots.

Programm**continuation:**

Switch control OFF - ON.

27812 Axes %1 and %2 parameterized with the same SIC/SCC address %3.

Parameters: %1 = Axis name, spindle number
 %2 = Axis name, spindle number
 %3 = Logical base address SIC/SCC

Explanation: The same base address for communication with a drive was selected for the specified axes. This is not permissible.

Reaction: Mode group not ready.
 Channel not ready.
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.
 NC Stop on alarm.

Remedy: Correct the drive assignment for the two specified axes.
 Different logical base addresses must be selected for assignment to the specified axes via MD37954
 \$MA_SAFE_INFO_MODULE_NR and MD13374 \$MN_SAFE_INFO_DRIVE_LOGIC_ADDR.

**Programm
continuation:** Switch control OFF - ON.

27813 F logic option not set

Explanation: The option for F logic MD19500 \$ON_SAFE_PLC_LOGIC is not available.
 The safety operating mode "SINUMERIK Safety Integrated plus (F-PLC)" is set in the MD13370 \$MN_SAFE_MODE.

Reaction: NC not ready.
 Channel not ready.
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.
 NC Stop on alarm.
 Prevention of cyclic PROFIsafe communication between PLC and drive.
 Prevention of cyclic SIC/SCC communication between the NCK and drive.

Remedy: Align option data and safety operating mode.

**Programm
continuation:** Switch control OFF - ON.

27830 Axis %1 Control not ready for the drive-integrated safe brake test

Parameters: %1 = Axis name, spindle number

Explanation: The motion control rejects the request for the drive-integrated "safe brake test" via the VDI interface.
 Possible causes:
 - When the brake test was selected via the VDI, the interpolator or the axis had not stopped, therefore the axis in motion or exact stop was not (no longer) given.
 - A new brake test was requested, but the previous brake test had not yet finished in the control.
 - Another axis was in motion in the channel.

Reaction: Alarm display.

Remedy: The alarm disappears automatically if the conditions in the motion control for performing the drive-integrated "safe brake test" are fulfilled, or the request for the drive-integrated "safe brake test" is withdrawn.

**Programm
continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

27900 PROFIBUS DP: SI fault on axis %1, code %2, value %3, time %4.

Parameters: %1 = Axis name, spindle number
 %2 = Fault code of the drive (r9747).
 %3 = Fault value of the drive (r9749)
 %4 = Fault time of drive (r9748).

Explanation:	The drive signals SI fault %2 with the further information %3 at instant %4.
Reaction:	Alarm display.
Remedy:	See drive documentation for fault codes/fault values.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

27910 PROFIBUS DP: SI fault on axis %1, code %2, value %3, time %4.

Parameters:	%1 = Axis name, spindle number %2 = Fault code of the drive (r9747). %3 = Fault value of the drive (r9749) %4 = Fault time of drive (r9748).
Explanation:	The drive signals SI fault %2 with the further information %3 at instant %4.
Reaction:	NC Start disable in this channel. Alarm display. A start of the part program is prevented by an SI fault reported by the drive. The SI fault requires a safe acknowledgment.
Remedy:	See drive documentation for fault codes/fault values.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

29033 [Channel %1:] Axis exchange of axis %2 not possible, PLC axis movement not yet completed

Parameters:	%1 = Channel number %2 = Axis
Explanation:	A PLC axis has not yet reached its end position and cannot be returned to a channel or neutralized. This alarm should not occur when PLC data block FC18 is used.
Reaction:	NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	Wait until the axis has reached the end position or terminate the movement with delete distance to go.
Programm continuation:	Clear alarm with the RESET key. Restart part program

Cycle alarms

61000	%[[Channel %1:] Block %2: %]No tool offset active
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	D-correction must be programmed before the cycle call.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61001	[Channel %1:] Block %2: Thread pitch incorrectly defined
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Check parameter for the thread size or setting for the pitch (contradict each other).
Programm continuation:	Clear alarm with the RESET key. Restart part program
61002	%[[Channel %1:] Block %2: %]Type of machining incorrectly defined
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Remedy:	Modify VARI parameter.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61003	%[[Channel %1:] Block %2: %]No feed programmed in cycle
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Modify feed parameter.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61004 [Channel %1:] Block %2: Incorrect configuration of geometry axes

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: --

Programm continuation: Clear alarm with the RESET key. Restart part program

61005 [Channel %1:] Block %2: 3rd geometry axis not available

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: With an application on the turning machine with no Y-axis in the G18 plane.

Remedy: Check parameter on cycle call.

61006 %[[Channel %1:] Block %2: %]Tool radius too large

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The tool radius is too large for machining.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Select a smaller tool.

Programm continuation: Clear alarm with the RESET key. Restart part program

61007 [Channel %1:] Block %2: Tool radius too small

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The tool radius is too small for machining.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Select a larger tool.

Programm continuation: Clear alarm with the RESET key. Restart part program

61008 [Channel %1:] Block %2: No tool active

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Alarm triggered by following cycles:

Remedy: Select a tool.

61009 [Channel %1:] Block %2: Active tool number = 0

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: No tool (T) has been programmed before the cycle call.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Program tool (T).

Programm continuation: Clear alarm with the RESET key. Restart part program

61010 [Channel %1:] Block %2: Finishing allowance too large

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Causes of error:
- The finishing allowance for the base is greater than the total depth.
- The finishing allowance at the edge is greater than or equal to the tool diameter.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Reduce finishing allowance.

Programm continuation: Clear alarm with the RESET key. Restart part program

61011 [Channel %1:] Block %2: Scaling not permissible

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: A scale factor is active which is illegal for this cycle.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Modify scale factor.

Programm continuation: Clear alarm with the RESET key. Restart part program

61012 %[[Channel %1:] Block %2: %]Different scaling in planes

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: --

Programm continuation: Clear alarm with the RESET key. Restart part program

61013 [Channel %1:] Block %2: Basic settings were changed, program cannot be executed

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation: The basic settings are not compatible with the generated program.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check and, if necessary, change the basic settings.

Programm continuation: Clear alarm with the RESET key. Restart part program

61014 [Channel %1:] Block %2: Return plane exceeded

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Check parameter RTP.

61015 [Channel %1:] Block %2: Contour is not defined

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61016 [Channel %1:] Block %2: System frame for cycles missing

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Set machine data 28082 \$MC_MM_SYSTEM_FRAME_MASK, Bit 5=1.

61017 %[Channel %1:] Block %2: %]Function %4 not present in NCK

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61018	[Channel %1:] Block %2: function %4 not executable with NCK
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	
Programm continuation:	Clear alarm with the RESET key. Restart part program

61019	%[[Channel %1:] Block %2: %]Parameter %4 incorrectly defined
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	Alarm 61019 is output in very many cycles if transfer parameters have been incorrectly programmed. The alarm text states the name of the incorrect parameter. Example cycle POCKET3: Parameter _MIDA defined incorrectly. The specified parameter then has to be checked and changed. For parameters in which multiple selection options are coded by individual decimal digits, the incorrectly coded digit is also output. Example: 61019 parameter (S_MVAR: dec4) defined incorrectly The value of the 4th decimal place (dec4 -> THOUSANDS digit) of the transfer parameter S_MVAR is defined incorrectly
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.

Remedy:	Check and change the value of the parameter or the corresponding position. Particular notes for individual cycles: If error message 61019 comes from CYCLE832, then: 61019 parameter S_TOLM: xx is defined incorrectly 1. Parameter S_TOLM lies outside the value range: S_TOLM UNITS digit 0 to 3. TENS digit 0 or 1 2. Parameter S_TOLM>3 and parameter S_OTOL not programmed and setting data SD55220 \$SCS_FUNCTION_MASK_MILL_TOL_SET bit0=0 Remedy: Set parameter S_TOLM in valid range (0..13), or, Set the compatibility bit in SD55220 bit0=1 with the field technology when CYCLE832 is called (up to SW 2.6). If the error message comes from CUST_832: The manufacturer cycle CUST_832 must be upgraded to the latest cycle version. If the error message comes from CYCLE9960: 01 MD11160 : Inadequate authorization for writing the kinematic chain 10 VCS_Rotary : Compile Cycle VCS_Rotary is not fully set up. GUD variable _E996_ACTIV_STATE not present 11 VCS_Rotary : Compile Cycle VCS_Rotary is not fully set up. Variable \$MC_E996_FILE_LOCATION missing 12 VCS_Rotary MD62738 : \$MC_E996_FILE_LOCATION incorrectly parameterized 13 VCS_Rotary file : Too many E996m_files. The number is limited to _E996m_10 14 VCS_Rotary MD62736 : Compensation limit exceeded 15 VCS_Rotary MODULO : RA is a modulo axis. The measuring range includes \$MA_MODULO_RANGE_START, \$MA_MODULO_RANGE_START must be a measuring position 16 VCS_Rotary MODULO : RA is a modulo axis. The measuring range includes \$MA_MODULO_RANGE_START, the angle between the measuring points must be a divisor of \$MA_MODULO_RANGE 20 \$NT_CNTRL bit7 : With reference head, the vector chain must be open -> \$NT_CNTRL bit7=0 21 \$SCS_MEA_KIN_MODE[0] DEC2=0 : With reference head, the vector chain must be open. 24 REF HEAD TRAFOTYP : Reference head only with swivel head or mixed kinematics 25 REF HEAD S_KNUM? : Parameter S_KNUM=9000, corresponds to the active work offset S_KNUM=xx 1(G54) ... 99(G599) 26 REF HEAD : No head was measured as a reference head _OVR[105]=0 _OVR[105]=transformation number 27 REF Workoffset : _OVR[104] -> Work offset measured with the reference head does not match the current value. Programm continuation: Clear alarm with the RESET key. Restart part program
----------------	---

61020 [Channel %1:] Block %2: Machining not possible with active TRANSMIT/TRACYL

Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	
Programm continuation:	Clear alarm with the RESET key. Restart part program

61021 [Channel %1:] Block %2: Parameter %4 value too high

Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	For measuring cycles: - Correct the parameters displayed on the measuring cycle screen or measuring cycle interface. -For CYCLE63 and trochoidal milling: - The angle of contact CMAX must be less than or equal to 80° during roughing
Programm continuation:	Clear alarm with the RESET key. Restart part program

61022 [Channel %1:] Block %2: Parameter %4 value too low

Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- For CYCLE63 and trochoidal milling: - The angle of contact CMIN must be greater than 10° during roughing
Programm continuation:	Clear alarm with the RESET key. Restart part program

61023 [Channel %1:] Block %2: Parameter %4 value must be unequal to zero

Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	
Programm continuation:	Clear alarm with the RESET key. Restart part program

61024 [Channel %1:] Block %2: Parameter %4 check value

Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.

Remedy: If the error message comes from CYCLE9960:
Start/end RA1: Set measuring range is not compatible with the traversing range (machine data 36100 \$MA_POS_LIMIT_MINUS) of rotary axis 1.
Start/end RA2: Set measuring range is not compatible with the traversing range (machine data 36100 \$MA_POS_LIMIT_MINUS) of rotary axis 2.
The measuring range is always considered in the clockwise direction from the start to the end
Example: Start = 0°, end = -45°, traversing range of the axis -90°..90° => error because the measuring range is interpreted from 0° to 315° and not from -45° to 0°.
Error message is displayed when measuring the kinematics of a grinding machine:
1st measurement: Starting position is "Beta" = 0°, "Beta" <> 0° leads to the error message.
For the 2nd and 3rd measurements, "Beta" has to be rotated further, either in the positive or negative direction. A change in the direction of rotation leads to the error message.

Programm continuation: Clear alarm with the RESET key. Restart part program

61025 [Channel %1:] Block %2: Check tool carrier position

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61026 [Channel %1:] Block %2: Cycle cannot be executed with NC function %4.

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61027 %[[Channel %1:] Block %2: %]Subroutine %4 does not exist

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

- Check CYCLE62 call
- Check whether the subroutines specified on CYCLE62 call exist in the program storage

Programm continuation: Clear alarm with the RESET key. Restart part program

61028	[Channel %1:] Block %2: Contour name %4 too long
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Error message in connection with contour call: - Use shorter contour name Error message in connection with contour turning: -String lengths of the paths of the machined part contour or blank contour (if blank contour) or the updated blank contour (if residual machining) too long -Use shorter directory or contour name Error message in connection with contour milling: -String lengths of the paths of the pocket/blank contour or the island contours too long -Use shorter directory or contour name
Programm continuation:	Clear alarm with the RESET key. Restart part program
61029	%[[Channel %1:] Block %2: %]Program name %4 too long
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- use shorter program name
Programm continuation:	Clear alarm with the RESET key. Restart part program
61030	[Channel %1:] Block %2: Path not permitted: %4
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	
Programm continuation:	Clear alarm with the RESET key. Restart part program
61031	[Channel %1:] Block %2: Path not found: %4
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61032 [Channel %1:] Block %2: File not found: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61033 [Channel %1:] Block %2: Incorrect file type: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61034 [Channel %1:] Block %2: File is full: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61035 [Channel %1:] Block %2: File in use: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61036 [Channel %1:] Block %2: NC storage limit reached: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61037 [Channel %1:] Block %2: No access rights to file: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61038 [Channel %1:] Block %2: Other file error: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61039 [Channel %1:] Block %2: Line not available: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61040 [Channel %1:] Block %2: Line longer than result variable: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61041 [Channel %1:] Block %2: Line range too large: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61042 [Channel %1:] Block %2: Program name %4 illegal

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: In the case of multi-channel systems, the main program name must not end with _Cxx (xx stands for figures).
Rename main program.

Programm continuation: Clear alarm with the RESET key. Restart part program

61043 [Channel %1:] Block %2: Error affecting coordinate conversion (%4)

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	1: Type not specified 2: Error during tool identification 3: Meas. point 1 not available 4: Meas. point 2 not available 5: Meas. point 3 not available 6: Meas. point 4 not available 7: No reference point available 8: No direction of approach 9: Meas. points are identical 10: Alpha is incorrect 11: Phi is incorrect 12: Incorrect direction of approach 13: Lines do not intersect 14: Planes not available 15: No frame or incorrect frame selected 16: Not enough memory available 17: Internal error
Programm continuation:	Clear alarm with the RESET key. Restart part program

61044 %[[Channel %1:] Block %2: %]Illegal character(s) in file name: %4

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Remove illegal character from file name Permitted characters are: letters, figures, underscore, slash with path name
Programm continuation:	Clear alarm with the RESET key. Restart part program

61045 [Channel %1:] Block %2: Job list not found: %4

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	The specified job list could not be found. Check name and contents of job list. The job list must be in the same workpiece as the part program.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61046 [Channel %1:] Block %2: Part program not found in job list: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Part program (main program) not found in specified job list in respective channel.
Check name and contents of job list.

Programm continuation: Clear alarm with the RESET key. Restart part program

61047 [Channel %1:] Block %2: Label name %4 too long

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: - select shorter label name

Programm continuation: Clear alarm with the RESET key. Restart part program

61048 [Channel %1:] Block %2: Multi-channel data not found in job list: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Multi-channel data not found in job list.
Correct job list.

Programm continuation: Clear alarm with the RESET key. Restart part program

61049 [Channel %1:] Block %2: 1st spindle not programmed

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Program 1st spindle in the screen.

Programm continuation: Clear alarm with the RESET key. Restart part program

61050	[Channel %1:] Block %2: Spindle programmed twice
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The same spindle was programmed twice.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Leave 2nd spindle empty or program other spindle.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61051	%[[Channel %1:] Block %2: %]Program name assigned twice
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The same program name was assigned twice.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	When using CYCLE952, the name of the main program must not be the same as the name of the cutting file (PRG) or the name of the updated blank contour (CONR). When using CYCLE63 and/or CYCLE64, the name of the main program must not be the same as the name of the program to be generated (PRG).
Programm continuation:	Clear alarm with the RESET key. Restart part program
61052	[Channel %1:] Block %2: Maximum spindle speed for main spindle not entered
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Max. speed for main spindle was not entered.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Enter speed limit in program header or under settings.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61053	[Channel %1:] Block %2: Maximum spindle speed not entered for counterspindle
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Maximum speed of counterspindle was not entered.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Enter speed limit in program header or under settings.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61054 [Channel %1:] Block %2: Programs started from various job lists: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Programs from various job lists were started simultaneously.
This is illegal. All programs must be assigned to the same job list.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Select desired job list again, and start programs afresh.

Programm continuation: Clear alarm with the RESET key. Restart part program

61055 [channel %1:] block %2: magazine location number too low: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The magazine location number entered was too low.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61056 [channel %1:] block %2: magazine location number too high: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The magazine location number entered was too high.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61057 [Channel %1:] Block %2: magazine location number is no integer: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The magazine location number must be an integer.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61058 %[[channel %1:] block %2: %]Function %4 not released

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The specified function is not released.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - CYCLE952: Balance Cutting function must be released via machine data 52218 \$MCS_FUNCTION_MASK_TURN, Bit6.
 - CYCLE953: Option for the SFT function must be released via machine data 19620 \$ON_TECHNO_CYCLES_MASK, Bit1.
 - SMTE: Option for the corresponding SMTE expansion must be released via machine data 19620 \$ON_TECHNO_CYCLES_MASK.

Programm continuation: Clear alarm with the RESET key. Restart part program

61059 %[[Channel %1:] Block %2: %]Tool preselection failed

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: --

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: --

Programm continuation: Clear alarm with the RESET key. Restart part program

61060 %[[Channel %1:] Block %2: %]Function requires tool management

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: --

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: --

Programm continuation: Clear alarm with the RESET key. Restart part program

61061 %[[Channel %1:] Block %2: %]Different scaling in the plane and depth

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: --

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: --

Programm continuation: Clear alarm with the RESET key. Restart part program

61062 %[[Channel %1:] Block %2: %]Axis position %4incorrectly programmed

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Check the last programmed axis position

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61063 %[[Channel %1:] Block %2: %]Tool at magazine location %4 is not a multitool

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: A magazine location and a multitool location were programmed. However, there is no multitool at the magazine location.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Only program the magazine location (without multitool location).

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61064 %[[Channel %1:] Block %2: %]Invalid multitool location: %4

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: A multitool location was programmed, at which there is no multitool.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Program a valid multitool location.

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61065 [Channel %1:] Block %2: A channel specified in the job list does not exist: %4

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: A non-existent channel was specified in the job list.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Correct job list

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61066	%[[Channel %1:] Block %2: %]Cycle %4 requires G code G70 or G71
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Cycle requires G code G70 or G71
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Program G70 or G71
Programm continuation:	Clear alarm with the RESET key. Restart part program
61067	[Channel %1:] Block %2:Tool spindle is in spindle mode: %4
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	To activate the turning transformation, the tool spindle must be in axis mode. But it is in spindle mode.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Before activating the turning transformation, put the tool spindle in axis mode (with SPOS or M70).
Programm continuation:	Clear alarm with the RESET key. Restart part program
61068	[Channel %1:] Block %2: Cycle requires G code %4
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	An incorrect G code is active when the cycle is called.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Activate the stated G code before calling the cycle. Multiple G codes may be presented for selection. Example: Cycle requires G code: G70/G71
Programm continuation:	Clear alarm with the RESET key. Restart part program
61069	[Channel %1:] Block %2: Axis not referenced %4
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A referenced axis is required in the cycle, but an unreferenced axis was detected. If possible, the axis identifier is stated in the alarm text.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Reference axis before calling the cycle.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61070 [Channel %1:] Block %2: Incorrect tool type for 'shank' selection

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: For the "shank" selection, the tool must have an acute angle.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Use "tip" selection.

Programm continuation: Clear alarm with the RESET key. Restart part program

61071 %[[Channel %1:] Block %2: %] Option for EES missing

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: When a part program is called via EXTCALL without EES, the contour can only be called via "Contour name" or "Labels". This means that contour calls via "Subroutine" or "Labels in subroutine" are only possible if EES is active.
Error message from CYCLE996:
The data record can only be stored on external memory if option EES is set.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: - Program contour call via "Contour name" or "Labels"
- Error message from CYCLE996:
Set the option or do not start the program from external memory.

Programm continuation: Clear alarm with the RESET key. Restart part program

61072 %[[Channel %1:] Block %2: %]: Error code %4 on activating the intelligent load adjustment function

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: An error occurred when activating an adaptation table for adapting the loading of the machine (language command CADAPTON).
Error message from CYCLE782

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Error code:
1 : No valid adaptation table parameterized -> the commissioning of the adaptation tables must be checked
2 : Axis name parameter invalid -> check axis
3 : Input variable parameter invalid -> check value
5 : Input value parameter invalid -> check value
99: Internal error

Programm continuation: Clear alarm with the RESET key. Restart part program

61073	%[[Channel %1:] Block %2: %]: Error code %4 on deactivating the intelligent load adjustment function
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	An error occurred when deactivating an adaptation table for adapting the machine loading (language command CADAPTOF). Error message from CYCLE782
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Error code: 1 : No valid adaptation table parameterized -> the commissioning of the adaptation tables must be checked 2 : Axis name parameter invalid -> check axis 3 : Input variable parameter invalid -> check value 5 : Input value parameter invalid -> check value 99: Internal error
Programm continuation:	Clear alarm with the RESET key. Restart part program
61074	%[[[Channel %1:] Block %2: %] Number of traversing blocks for spline formation is too low
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The number of traversing blocks for spline formation is too low.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Enlarge the program section and thus the number of traversing blocks
Programm continuation:	Clear alarm with the RESET key. Restart part program
61075	%[[Channel %1:] Block %2: %]Cycle %4 does not run in the handling channel.
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The specified cycle does not run in the handling channel.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Execute the program containing the cycle to be called in the machining channel.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61076	%[[Channel %1:] Block %2: %]Cycle %4 does not support interpolated turning.
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The specified cycle does not support interpolated turning.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Disable interpolated turning
Programm continuation:	Clear alarm with the RESET key. Restart part program

61077 %[[Channel %1:] Block %2: %]Program does not run in a handling channel

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The program can only be executed in one machining channel.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Execute the program in one machining channel
Programm continuation:	Clear alarm with the RESET key. Restart part program

61098 [Channel %1:] Block %2: %4

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	This alarm is used for various purposes. Please refer to the alarm text.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Depends on alarm text
Programm continuation:	Clear alarm with the RESET key. Restart part program

61099 [Channel %1:] Block %2: Internal cycle error (%4)

Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	
Programm continuation:	Clear alarm with the RESET key. Restart part program

61100 %[[Channel %1:] Block %2: %]Rotated flat surface cannot be calculated

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The flat surface cannot be calculated with the selected turning angle alpha0 and the specifications abs/inc for X1/Y1.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	The corner point X1/Y1 must be specified in a different way, e.g. with incremental values.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61101 %[[Channel %1:] Block %2: %]Reference point defined incorrectly

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	With an incremental specification of the depth, either different values have to be selected for the reference point (reference plane) and the retraction plane, or an absolute value must be specified for the depth. When machining in the "manual machine" area, the following setting data must be checked and adapted to the machining. SD 55260 \$SCS_MAJOG_SAFETY_CLEARANCE (value greater than zero) SD 55261 \$SCS_MAJOG_RELEASE_PLANE
Programm continuation:	Clear alarm with the RESET key. Restart part program

61102 %[[Channel %1:] Block %2: %]No spindle direction programmed

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Parameter SDIR (or SDR in CYCLE840) must be programmed.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61103 [Channel %1:] Block %2: Number of holes is zero

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Remedy:	Check parameter NUM.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61104 [Channel %1:] Block %2: Contour violation of slots

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Incorrect parameterization of the milling pattern in the parameters which define the position of the slots/elongated holes on the circle and their form.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: --

Programm continuation: Clear alarm with the RESET key. Restart part program

61105 [Channel %1:] Block %2: Milling cutter radius too large

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The diameter of the cutter used is too large for the form to be machined.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Either a tool with a smaller radius has to be used or the contour must be modified.

Programm continuation: Clear alarm with the RESET key. Restart part program

61106 [Channel %1:] Block %2: Number of or distance between circular elements

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: Incorrect parameterization of NUM or INDA. The layout of the circle elements within a full circle is not possible.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Correct parameterization.

Programm continuation: Clear alarm with the RESET key. Restart part program

61107 [Channel %1:] Block %2: First drilling depth incorrectly defined

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Modify drilling depth.

Programm continuation: Clear alarm with the RESET key. Restart part program

61108 [Channel %1:] Block %2: Illegal values for radius and insertion depth parameters

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The radius (_RAD1) and insertion depth (_DP1) parameters for defining the helix path for the depth infed have been incorrectly specified.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Modify parameter.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61109 %[[Channel %1:] Block %2: %]Milling direction parameter incorrectly defined

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The value of the parameter for the cutting direction _CDIR has been incorrectly defined.
Remedy:	- Change milling direction. - During pocket machining (CYCLE63), the selected milling direction must match the milling direction of centering/rough drilling.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61110 [Channel %1:] Block %2: Finishing allowance at the base is greater than the depth infeed

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The finishing allowance at the base has been specified greater than the maximum depth infeed.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Either reduce finishing allowance or increase depth infeed.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61111 [Channel %1:] Block %2: Infeed width is greater than the tool diameter

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The programmed infeed width is greater than the diameter of the active tool.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Infeed width must be reduced.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61112 [Channel %1:] Block %2: Tool radius negative

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The radius of the active tool is negative. This is illegal.
Remedy:	Change the tool radius.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61113 [Channel %1:] Block %2: Parameter for corner radius too large

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The parameter for the corner radius _CRAD has been specified too large.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Reduce corner radius

Programm continuation: Clear alarm with the RESET key. Restart part program

61114 [Channel %1:] Block %2: Machining direction G41/G42 incorrectly defined

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The machining direction of the cutter radius compensation G41/G42 has been incorrectly selected.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Change machining direction.

Programm continuation: Clear alarm with the RESET key. Restart part program

61115 [Channel %1:] Block %2: Approach or retract mode(straight / circle / plane / space) incorrectly defined

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The approach or retract mode to/from the contour has been incorrectly defined.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check parameter _AS1 or _AS2.

Programm continuation: Clear alarm with the RESET key. Restart part program

61116 [Channel %1:] Block %2: Approach or retract path = 0

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The approach or retract path has been specified with zero.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check parameter _LP1 or _LP2.

Programm continuation: Clear alarm with the RESET key. Restart part program

61117 %[[Channel %1:] Block %2: %]Active tool radius is smaller than or equal to zero

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The radius of the active tool is negative or zero.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Modify radius.

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61118 [Channel %1:] Block %2: Length or width = 0

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The length or width of the milling area is illegal.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Check parameters _LENG and _WID.

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61119 [Channel %1:] Block %2: Nominal or core diameter programmed incorrectly

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The nominal or core diameter was incorrectly programmed.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Check thread geometry.

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61120 [Channel %1:] Block %2: Thread type inside / outside not defined

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The thread type (internal/external) was not defined.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: The internal/external thread type must be entered.

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61121 [Channel %1:] Block %2: Number of teeth per cutting edge is missing

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: No value was entered for the number of teeth per cutting edge.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Enter the number of teeth/cutting edges for the active tool into the tool list.

Programm continuation: Clear alarm with the RESET key. Restart part program

61122 [Channel %1:] Block %2: Safety distance incorrectly defined in plane

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The safety clearance is negative or zero. This is not allowed.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Define the safety clearance.

Programm continuation: Clear alarm with the RESET key. Restart part program

61123 [Channel %1:] Block %2: CYCLE72 cannot be simulated

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61124 [Channel %1:] Block %2: Infeed width is not programmed

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: With active simulation without tool, a value for the infeed width _MIDA must always be programmed.

Programm continuation: Clear alarm with the RESET key. Restart part program

61125	[Channel %1:] Block %2: Technology selection parameter incorrectly defined
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Check technology selection parameter (_TECHNO).
Programm continuation:	Clear alarm with the RESET key. Restart part program
61126	[Channel %1:] Block %2: Thread length too short
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Program lower spindle speed or raise reference point (reference plane).
Programm continuation:	Clear alarm with the RESET key. Restart part program
61127	[Channel %1:] Block %2: Wrong definition of tapping axis transformation ratio (machine data)
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Check machine data 31050 and 31060 in the appropriate gear stage of the drilling axis.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61128	[Channel %1:] Block %2: Insertion angle = 0 for insertion with oscillation or helix
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Check parameter _STA2.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61129 [Channel %1:] Block %2: perpendic. approach and retraction during contour milling only allowed with G40

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61130 [Channel %1:] Block %2: positions of parallel axes cannot be compensated. No workpiece reference agreed.

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61131 [Channel %1:] Block %2: parameter _GEO incorrect, _GEO=%4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61132 [Channel %1:] Block %2: Parallel axis parameters incorrect, check values for parallel axis parameters ABS/INK

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61133	[Channel %1:] Block %2: 3rd parallel axis parameter incorrect, check axis name or GUD _SCW_N[]
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	
Programm continuation:	Clear alarm with the RESET key. Restart part program
61134	[Channel %1:] Block %2: Rotary axis parameters incorrect, check values for rotary axis parameters ABS/INK
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	
Programm continuation:	Clear alarm with the RESET key. Restart part program
61135	[Channel %1:] Block %2: incorrect parameter sequence for approaching target position: %4
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	
Programm continuation:	Clear alarm with the RESET key. Restart part program
61136	[Channel %1:] Block %2: no 3rd geometry axis agreed in GUD _SCW_N[]
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	
Programm continuation:	Clear alarm with the RESET key. Restart part program

61137 [Channel %1:] Block %2: swiveling and parallel axes cycle are mutually exclusive because of workpiece reference \$P_WPFRAME

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61138 [Channel %1:] Block %2: parameter %4 incorrectly defined for tool monitoring in cycles

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61139 [Channel %1:] Block %2: error in function Tool monitoring in cycles

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61140 [Channel %1:] Block %2: Main spindle is not set up correctly

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Please check the following machine or setting data:
MD 20070 \$MC_AXCONF_MACHAX_USED[]
MD 20080 \$MC_AXCONF_CHANAX_NAME_TAB[]
MD 35000 \$MA_SPIND_ASSIGN_TO_MACHAX[]
MD 52206 \$MCS_AXIS_USAGE[]

Programm continuation: Clear alarm with the RESET key. Restart part program

61141 [Channel %1:] Block %2: C axis of the main spindle is not set up correctly

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Please check the following machine or setting data:
MD 20070 \$MC_AXCONF_MACHAX_USED[]
MD 20080 \$MC_AXCONF_CHANAX_NAME_TAB[]
MD 35000 \$MA_SPIND_ASSIGN_TO_MACHAX[]
MD 52206 \$MCS_AXIS_USAGE[]

Programm continuation: Clear alarm with the RESET key. Restart part program

61142 [Channel %1:] Block %2: Counterspindle is not set up correctly

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Please check the following machine or setting data:
MD 20070 \$MC_AXCONF_MACHAX_USED[]
MD 20080 \$MC_AXCONF_CHANAX_NAME_TAB[]
MD 35000 \$MA_SPIND_ASSIGN_TO_MACHAX[]
MD 52206 \$MCS_AXIS_USAGE[]

Programm continuation: Clear alarm with the RESET key. Restart part program

61143 [Channel %1:] Block %2: C axis of the counterspindle is not set up correctly

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Please check the following machine or setting data:
MD 20070 \$MC_AXCONF_MACHAX_USED[]
MD 20080 \$MC_AXCONF_CHANAX_NAME_TAB[]
MD 35000 \$MA_SPIND_ASSIGN_TO_MACHAX[]
MD 52206 \$MCS_AXIS_USAGE[]

Programm continuation: Clear alarm with the RESET key. Restart part program

61144 [Channel %1:] Block %2: Tool spindle is not set up correctly

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Please check the following machine or setting data:
MD 20070 \$MC_AXCONF_MACHAX_USED[]
MD 20080 \$MC_AXCONF_CHANAX_NAME_TAB[]
MD 35000 \$MA_SPIND_ASSIGN_TO_MACHAX[]
MD 52206 \$MCS_AXIS_USAGE[]

Programm continuation: Clear alarm with the RESET key. Restart part program

61145 [Channel %1:] Block %2: Linear axis of the counterspindle is not set up correctly

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Please check the following machine or setting data:
MD 20070 \$MC_AXCONF_MACHAX_USED[]
MD 20080 \$MC_AXCONF_CHANAX_NAME_TAB[]
MD 52206 \$MCS_AXIS_USAGE[]

Programm continuation: Clear alarm with the RESET key. Restart part program

61146 [Channel %1:] Block %2: B axis is not set up correctly

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Please check the following machine or setting data:
MD 20070 \$MC_AXCONF_MACHAX_USED[]
MD 20080 \$MC_AXCONF_CHANAX_NAME_TAB[]
MD 35000 \$MA_SPIND_ASSIGN_TO_MACHAX[]
MD 52206 \$MCS_AXIS_USAGE[]

Programm continuation: Clear alarm with the RESET key. Restart part program

61147 [Channel %1:] Block %2: Transformation not active: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: The stated transformation is not active.
 You have to activate the transformation before you can use it.

Programm continuation: Clear alarm with the RESET key. Restart part program

61148 [Channel %1:] Block %2: Swivel plane with active turning tool not possible

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: Swiveling the plane is not possible when a turning tool is active.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Load a milling tool before you swivel the plane.
 The alarm can be suppressed using SD 55410 \$SCS_MILL_SWIVEL_ALARM_MASK.

Programm continuation: Clear alarm with the RESET key. Restart part program

61149 [Channel %1:] Block %2: Positioning a milling tool with active turning tool is not possible

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: Milling tools cannot be positioned if a turning tool is active.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Load a milling tool, before you call positioning.

Programm continuation: Clear alarm with the RESET key. Restart part program

61150 [Channel %1:] Block %2: Tool cannot be aligned - error code: %4

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Remedy: Error code:
A: Only new swivel plane permitted, see parameter _ST
B: Angular range ≥ 360 -> angular range of the B axis ≥ 360 degrees
C: Rotary axis vector V1 is not equal to 0 1 0 -> rotary axis vector V1 must rotate around Y
See setup of swivel CYCLE800
D: Rotary axis vector V2 -> rotary axis vector V2 must rotate around X (1 0 0) or Z (0 0 1)
See setup of swivel CYCLE800
E: WCS ROT Y > 90 -> active rotation of the Work (WCS) around Y is >90 degrees. -90 to +90 is permitted
F: If geometry axis Y is not available -> SD55221 set Bit 5 = 1
G: Initial setting defines (\$TC_CARR37] HUNDREDTHOUSANDS digit -Z or -X) -> SD55221 set Bit 5 = 1
See setup of swivel CYCLE800
H: Align tool, but active plane not G18
I: 1st turning technology (MD52200=1) and no Y axis available -> mirroring not allowed
J: 1st turning technology (MD52200=1) and no Y axis available -> rotation around Y not possible
K: Grinding technology (MD52200=3) and align tool -> SD55221 set Bit 5 = 1
L: Grinding technology (MD52200=3) and align tool -> set MD20186 = 1

61151 [Channel %1:] Block %2: Orientation of tool not possible - error code: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Remedy: Causes of error:
1st error code = A -> only additive swivel plane permitted, see parameter _ST

61152 [Channel %1:] Block %2: B axis kinematics (turning technology) either not or incorrectly set up in Start-up of swivel cycle - error code: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Remedy: Causes of error:
1st error code = A123 -> B axis not an automatic rotary axis under ShopTurn (123 corresponds to parameter _TCBA)
2nd error code = B123 -> B axis not activated in swivel cycle start-up (kinematics)
(123 corresponds to \$TC_CARR37[n], n ... number of the swivel data record)

61153 [Channel %1:] Block %2: No 'Rotary axes direct' swivel mode possible - error code: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Remedy:	Error code: A: No tool or no cutting edge (e.g. D1) active B: Swivel "no" and swivel "direct", swivel plane "additive" not permitted C: Input value for rotary axis 1 not in the grid of the Hirth tooth system D: Input value for rotary axis 2 not in the grid of the Hirth tooth system E: Swivel "direct" programmed in automatic, but swivel cycle not set up (\$TC_CARR37 UNITS digit < =2) F ROT ? G5...: Rotation in settable WO (e.g. G54) active, not permitted F ROT ? SETFRAME: Rotation in basic reference active, not permitted F ROT ? CHBFRAME: Rotation in basic active, not permitted G WPFRAME?: Swivel mode additive and translations in workpiece reference (WPFRAME) not permitted H: X0, Y0 or Z0 not equal to 0: Swivel mode additive and translations not permitted before swivel See parameter S_ST 1st decimal place I: Turning machine and initial setting -X or -Z not possible in G18 J: Turning machine and initial setting -X or -Z and counterspindle mirrored around Z K: Turning machine and initial setting -Z and G19 not allowed Initial setting, see setup of swivel CYCLE800 Note on error codes F, G and H: If the Work (WCS) is rotated before programming swivel direct, and the swivel plane is rotated and moved additively, alarm 61153 is reported with error codes F, G or H to avoid an impermissible mixing of frame operations and direct machine positions. Alternatively, the machining program can be reprogrammed with swivel axis for each axis and swivel plane new or additionally, or with new swivel and swivel plane.
----------------	---

61154 %[[Channel %1:] Block %2: %]Final depth wrongly programmed

Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Input of end depth possible only absolutely or incrementally

61155 [Channel %1:] Block %2: Unit for plane infeed wrongly programmed

Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Unit for plane infeed possible only in mm or % of tool diameter

61156 [Channel %1:] Block %2: Depth calculation wrongly programmed

Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Depth calculation possible only with or without SDIS

61157 %[[Channel %1:] Block %2: %]Reference point wrongly programmed

Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	

- Remedy:**
- Check reference point in screenform, input only -X, centered or +X
 - During calibration of the length of the infeed axis in JOG, two causes can cause this alarm:
 1. The value of the reference workpiece was incorrectly programmed in the parameterization screenform.
 2. The length of the workpiece probe in the infeed axis has been incorrectly entered in the tool data.

61158 %[[Channel %1:] Block %2: %]Machining plane wrongly programmed

Parameters:

%1 = Channel number
 %2 = Block number, label channel number

Explanation:

Remedy: Check machining plane (G17, G18 or G19) in connection with the parameter _DMODE.

61159 [Channel %1:] Block %2: Machining plane on cycle call differs from the one in the position pattern

Parameters:

%1 = Channel number
 %2 = Block number, label channel number

Explanation:

Remedy: Adjust the machining plane on cycle call to the machining plane in the position pattern.

61160 [Channel %1:] Block %2: Residual material remains stationary, reduce plane infeed

Parameters:

%1 = Channel number
 %2 = Block number, label channel number

Explanation:

Remedy: Reduce plane infeed or slot width, or use milling cutter with larger diameter

61161 [Channel %1:] Block %2: Centering diameter or tool parameter (diameter, tip angle) are incorrect

Parameters:

%1 = Channel number
 %2 = Block number, label channel number

Explanation:

- Remedy:**
- Diameter of centering with tip angle of active tool not possible
 - Entered workpiece diameter, tool diameter or tip angle of tool incorrect
 - Diameter of tool only has to be entered if centering is to be on workpiece diameter.

Programm continuation: Clear alarm with the RESET key. Restart part program

61162 [Channel %1:] Block %2: Tool parameter diameter or tip angle incorrect

Parameters:

%1 = Channel number
 %2 = Block number, label channel number

Explanation:

- Remedy:**
- The tool parameters diameter or tip angle must be greater than 0
 - Tip angle must be less than 180°

Programm continuation: Clear alarm with the RESET key. Restart part program

61163 [Channel %1:] Block %2: Infeed width in the plane too large

Parameters:

%1 = Channel number
 %2 = Block number, label

Explanation:

Remedy: --

61164	[Channel %1:] Block %2: Transformation has incorrect type %4
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Remedy:	The transformation has the incorrect type. Correct the transformation set up.
61165	[Channel %1:] Block %2: Transformation set up incorrectly: %4
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Remedy:	The transformation has been set up incorrectly. Correct the transformation set up.
61166	[Channel %1:] Block %2: Check machine data: %4
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Remedy:	The machine data must be checked. Adapt the setting of the machine data.
61167	[Channel %1:] Block %2: Transformation not set up or not active: %4
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Remedy:	The specified transformation is not set up or not active. Set up or activate the transformation.
61168	[Channel %1:] Block %2: Incorrect machining plane: %4
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Remedy:	The machining plane is incorrect. Program correct machining plane.
61169	[Channel %1:] Block %2: Spindle incorrectly programmed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	An incorrect spindle was programmed.
Remedy:	Change the spindle selection.
61170	[Channel %1:] Block %2: Incorrect block plane (%4)
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	An invalid block plane was used.
Remedy:	Use a valid block plane. It is only permissible that the block planes are used in an ascending sequence.
61171	[Channel %1:] Block %2: Block plane used twice (%4)
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The same block plane was used twice.
Remedy:	Only nest the block planes in an ascending sequence.

61172 [Channel %1:] Block %2: Spindle groups must not be nested

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: You have used spindles in several nested groups.

Remedy: Only use one spindle in one group plane with nested groups.

61173 [Channel %1:] Block %2: Supplementary run-in code only possible with spindle

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The supplementary run-in code can only be used in one block with spindle.

Remedy: Use a block with spindle.

61174 [Channel %1:] Block %2: Not possible to align milling tool with active turning tool

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: It is not possible to align milling tools with an active turning tool.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Load a milling tool before you call alignment.

Programm continuation: Clear alarm with the RESET key. Restart part program

61175 [Channel %1:] Block %2: angle of aperture programmed too small

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The angle of aperture of the text (_DF) in the engraving cycle is too small. This means that the text for engraving does not fit in the specified angle.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Enter a larger angle of aperture.

Programm continuation: Clear alarm with the RESET key. Restart part program

61176 [Channel %1:] Block %2: text length programmed too small

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The text length (_DF) in the engraving cycle is too short. This means that the text for engraving is longer than the specified text length.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Enter longer text length

Programm continuation: Clear alarm with the RESET key. Restart part program

61177 [Channel %1:] Block %2: polar text length > 360 degrees

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: In the engraving cycle, the polar text length must not exceed 360 degrees.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Enter shorter text length.

Programm continuation: Clear alarm with the RESET key. Restart part program

61178 [Channel %1:] Block %2: code page not present

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The specified code page is not supported by the cycle.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Use code page 1252.

Programm continuation: Clear alarm with the RESET key. Restart part program

61179 [Channel %1:] Block %2: character does not exist, no.: %4

Parameters: %1 = Channel number
%2 = Block number, label
%4 = Character number

Explanation: The character entered in the text for engraving cannot be milled.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Enter another character.

Programm continuation: Clear alarm with the RESET key. Restart part program

61180 [Channel %1:] Block %2: No name assigned to swivel data record

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Although there are several swivel data blocks, no unique names have been assigned.

Remedy: A unique name must be assigned to the swivel data block (\$TC_CARR34[n]) if machine data 18088 \$MN_MM_NUM_TOOL_CARRIER is > 1.

61181 [Channel %1:] Block %2: NCK software version is insufficient for the Swivel function

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Swivelling is not possible with the current NCK software version.

Remedy: Upgrade NCK software to NCK 75.00 or higher.

61182 [Channel %1:] Block %2: Name of swivel data record unknown: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The specified name of the swivel data block is unknown.

Remedy: Check name of swivel data record \$TC_CARR34[n].

61183 [Channel %1:] Block %2: Swivel CYCLE800: Retraction mode parameter lies outside value range: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The value of the retraction mode parameter (_FR) lies outside the valid range.

Remedy: Swivel CYCLE800: Check transfer parameter _FR. Value range 0 to 8

61184 [Channel %1:] Block %2: No solution possible with current input angle values

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The surface defined via the input angle cannot be processed with the machine.

Remedy: -Check the angles entered for swiveling the machining plane: %4
-Parameter _MODE coding incorrect, e.g. rotation axis-wise YXY

61185 [Channel %1:] Block %2: Invalid angular ranges of rotary axes in swivel data record: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The angular range of the rotary axes is invalid.
Check setup of the swivel CYCLE800.

Parameter \$TC_CARR30[n] to \$TC_CARR33[n] n number of swivel data record

Example: Rotary axis 1 modulo 360 degrees: -> \$TC_CARR30[n]=0 \$TC_CARR32[n]=360

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check setup of swivel cycle CYCLE800.

Programm continuation: Clear alarm with the RESET key. Restart part program

61186 [Channel %1:] Block %2: Invalid rotary axis vectors --> Check setup of the swivel cycle CYCLE800.

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: No or incorrect entry for rotary axis vector V1 or V2.

Remedy: Check commissioning of swivel CYCLE800
Check rotary axis vector V1xyz: \$TC_CARR7[n], \$TC_CARR8[n], \$TC_CARR9[n]
Check rotary axis vector V2xyz: \$TC_CARR10[n], \$TC_CARR11[n], \$TC_CARR12[n]
If 2nd rotary axis not available (\$TC_CARR35[n]=""), then it is possible that V2xyz=0
n Number of the swivel data set

61187 [Channel %1:] Block %2: Check setup of the swivel cycle CYCLE800. - Error code: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:**Reaction:**

Interpreter stop

NC Start disable in this channel.

Interface signals are set.

Alarm display.

Remedy:

Error code: See current cycles software version notes in siemens.txt

**Programm
continuation:**

Clear alarm with the RESET key. Restart part program

61188 [Channel %1:] Block %2: No axis name agreed for rotary axis 1 -> Check setup of the swivel cycle CYCLE800.**Parameters:**

%1 = Channel number

%2 = Block number, label

Explanation:

No axis name was specified for the rotary axis 1.

Remedy:

Check setup of swivel CYCLE800.

Axis name of rotary axis 1 see parameter \$TC_CARR35[n] n number of swivel data record

61189 [Channel %1:] Block %2: Swivel direct: Invalid rotary axis positions: %4**Parameters:**

%1 = Channel number

%2 = Block number, label

Explanation:

Swivel direct: Check input values of rotary axes.

Remedy:

Swivel mode direct: check the input values of the rotary axes or setup of swivel CYCLE800.

Check angular range of rotary axes in swivel data record n:

Rotary axis 1: \$TC_CARR30[n], \$TC_CARR32[n]

Rotary axis 2: \$TC_CARR31[n], \$TC_CARR33[n]

If values are entered in the work offset (WO) of the rotary axes, and machine data MD21186=0:

Value in WO of the rotary axis does not correspond to the angular range, rotary axis 1 or 2

Value in WO of the rotary axis plus input value does not correspond to the angular range, rotary axis 1 or 2

Note: for modulo axes, for swivel direct, the input value is calculated in the modulo range

Example: angular range, rotary axis modulo 0 up to 360: input value =-21, rotary axis moves to 339 degrees

61190 [Channel %1:] Block %2: Unable to retract prior to swiveling -> Error code: %4**Parameters:**

%1 = Channel number

%2 = Block number, label

Explanation:

Remedy: If tool carrier is active, check setup of swivel CYCLE800. Parameter \$TC_CARR37[n] 7th and 8th decimal places
n number of swivel data set
If align turning tool with milling/turning machine (transformation on basic kinematic chain) is active,
check parameter \$NT_IDENT[n,0] 7th and 8th decimal places (n = name of transformation)
Error code:
A: Retraction Z not set up
B: Retraction Z XY not set up
C: Retraction in tool direction max. not set up
D: Retraction in tool direction incremental not set up
E: Retraction in tool direction: NC function CALCPOSI reports error
For the CALCPOSI function, the axes must be referenced. Check machine data 20700 \$MC_REFP_NC_START_LOCK.
F: Retraction in tool direction: no tool axis available
Missing geometry axis (tool axis) Z with G17, Y with G18 or X with G19
G: Retraction in tool direction max.: negative retraction path
H: Retraction in tool direction incremental: negative retraction path not permitted
I: Retraction setup of swivel CYCLE800 not set up
J: Retraction in tool direction is not permitted, because current Work (WCS) is mirrored
Tool carrier is active
K: Retraction and swivel plane and transformation on basic kinematic chain are active
Retraction with transformation only if align turning tool is active
L: Retraction in tool direction and align tool are only permitted if setting data 42954 \$SC_TOOL_ORI_CONST_M=0
Transformation on basic kinematic chain is active
M: Retraction in tool direction and align tool are only permitted if setting data 42956 \$SC_TOOL_ORI_CONST_T=0
Transformation on basic kinematic chain is active
N: Retraction in tool direction and swivel plane toward counterspindle are not possible
Turning machine with active tool carrier and initial setting -X (see swivel setup)
O: Retraction in tool direction, align tool with counterspindle is not possible
P: Retraction in tool direction in G18 toward counterspindle is not possible
Q: Retraction in tool direction is not permitted because the current Work (WCS) is mirrored
Align turning tool with milling/turning machine (transformation on basic kinematic chain) active
R: Retraction in tool direction is not possible with align tool
Align turning tool with milling/turning machine (transformation on basic kinematic chain) active

61191 [Channel %1:] Block %2: Multi-axis transformation not set up. Error code: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Error code:
Number or parameter name of multi-axis transformation

Programm continuation: Clear alarm with the RESET key. Restart part program

61192 [Channel %1:] Block %2: Additional multi-axis transformations not set up. Error code: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Error code: Number or parameter name of multi-axis transformation
Programm continuation:	Clear alarm with the RESET key. Restart part program

61193 [Channel %1:] Block %2: compressor option not set up

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	--
Programm continuation:	Clear alarm with the RESET key. Restart part program

61194 [Channel %1:] Block %2: spline interpolation option not set up

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	--
Programm continuation:	Clear alarm with the RESET key. Restart part program

61195 [Channel %1:] Block %2: Aligning a turning tool is only possible with active turning tool

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Aligning turning tools is only possible with one active turning tool.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Change a turning tool, before you call alignment.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61196 [Channel %1:] Block %2: No swiveling in JOG --> Multi-axis transformations and TCARR activated at the same time

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Multi-axis transformations (TRAORI) and Toolcarrier (TCARR) activated at the same time.

Remedy: Deselection of multi-axis transformation with TRAFOOF
or deselection of Toolcarrier (TCARR) with CYCLE800()

61197 [Channel %1:] Block %2: Swiveling - plane not allowed -> Error code %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Error code:

Programm continuation: Clear alarm with the RESET key. Restart part program

61198 [Channel %1:] Block %2: Swiveling with kinematic chain -> Error code: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: --

Programm continuation: Clear alarm with the RESET key. Restart part program

61199 [Channel %1:] Block %2: Swiveling - tool not allowed -> Error code: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Error is also output if no swivel data record is active and only tool approach is programmed.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: A CYCLE800 must be called with a valid swivel data record before orientation.
Error code:

A: Orientation of tool and change of swivel data record not allowed

Programm continuation: Clear alarm with the RESET key. Restart part program

61200 [Channel %1:] Block %2: Too many elements in machining block

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The machining block contains too many elements.

Remedy: Check the machining block, delete some elements if required.

61201 [Channel %1:] Block %2: Wrong sequence in machining block

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:	The sequence of elements in the machining block is invalid.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Sort the sequence in the machining block.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61202 [Channel %1:] Block %2: No technology cycle

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	No technology cycle was programmed in the machining block.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Program a technology block.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61203 [Channel %1:] Block %2: No position cycle

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	No positioning cycle was programmed in the machining block.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Program positioning block.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61204 [Channel %1:] Block %2: Technology cycle unknown

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The specified technology cycle in the machining block is unknown.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Delete and reprogram the technology block.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61205 [Channel %1:] Block %2: Position cycle unknown

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The specified positioning cycle in the machining block is unknown.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Delete and reprogram the positioning block.

Programm continuation: Clear alarm with the RESET key. Restart part program

61206 [Channel %1:] Block %2: Synchronizing possible only when using a job list

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Synchronizing with a counterspindle step in another channel is possible only if a job list is used.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Create job list and add programs for the individual channels.

Programm continuation: Clear alarm with the RESET key. Restart part program

61207 [Channel %1:] Block %2: No counterspindle step found for synchronizing

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: No counterspindle step was found in any channel with which this channel could synchronize.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Control program.
Delete step for synchronizing if it is not required.

Programm continuation: Clear alarm with the RESET key. Restart part program

61208 [Channel %1:] Block %2: Assign parameters for main spindle chuck in the spindle chuck data

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The parameters for the main spindle chuck in the spindle chuck data are not assigned.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Indicate parameters ZCn, ZSn and ZEn in the screen "Parameters" > "Setting data" > "Spindle chuck data".

Programm continuation: Clear alarm with the RESET key. Restart part program

61209 [channel %1:] block %2: counterspindle step programmed in several channels

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Counterspindle step may be programmed in one channel only.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	The step "Counterspindle: synchronizing" must be used in the other channels.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61210 [Channel %1:] Block %2: Block search element not found

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The element specified for the block search does not exist.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Repeat block search.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61211 [Channel %1:] Block %2: Absolute reference missing

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	An incremental indication was made, but the absolute reference is unknown.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Program an absolute position prior to using incremental indications.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61212 %[[Channel %1:] Block %2: %]Wrong tool type

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The tool type is not suitable for machining.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Select a new tool type.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61213 [Channel %1:] Block %2: Circle radius too small

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The programmed circle radius is too small.
Remedy:	Correct the circle radius, center point or end point.

61214 [Channel %1:] Block %2: No pitch programmed

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: No thread/helical pitch has been entered.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Program a pitch.

Programm continuation: Clear alarm with the RESET key. Restart part program

61215 [Channel %1:] Block %2: Unfinished dimension incorrectly programmed

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Check the blank spigot dimensions. The blank spigot must be larger than the production part spigot.

Remedy: Check parameters _AP1 and _AP2.

61216 %[[Channel %1:] Block %2: %]Feed/tooth only possible with cutting tools

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Feed per tooth is only possible with milling tools.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: As alternative, set a different feed type.

Programm continuation: Clear alarm with the RESET key. Restart part program

61217 [Channel %1:] Block %2: Cutting speed programmed for tool radius 0

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: To be able to work with cutting speed, the tool radius has to be specified.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Enter a value for cutting speed.

Programm continuation: Clear alarm with the RESET key. Restart part program

61218 [Channel %1:] Block %2: Feed/tooth programmed, but number of tools equals zero

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: For feed per tooth, the number of teeth has to be specified.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Enter the number of teeth on the milling tool in the "Tool list" menu.

Programm continuation: Clear alarm with the RESET key. Restart part program

61219 [Channel %1:] Block %2: Tool radius too large

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The tool radius is too large for machining.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Select a suitable tool.

Programm continuation: Clear alarm with the RESET key. Restart part program

61220 [Channel %1:] Block %2: Tool radius too small

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The tool radius is too small for machining.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Select a suitable tool.

Programm continuation: Clear alarm with the RESET key. Restart part program

61221 [Channel %1:] Block %2: No tool active

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: No tool active.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Select a suitable tool.

Programm continuation: Clear alarm with the RESET key. Restart part program

61222 [Channel %1:] Block %2: Plane infeed greater than tool diameter

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The plane infeed must not be greater than the tool diameter.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Reduce plane infeed.

Programm continuation: Clear alarm with the RESET key. Restart part program

61223 [Channel %1:] Block %2: Approach path too small

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The approach path must not be less than zero.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Enter a greater value for the approach path.

Programm continuation: Clear alarm with the RESET key. Restart part program

61224 [Channel %1:] Block %2: Retract path too small

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The retract path must not be less than zero.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Enter a greater value for the retract path.

Programm continuation: Clear alarm with the RESET key. Restart part program

61225 [Channel %1:] Block %2: Swivel data record unknown

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: An attempt was made to access a swivel data block which has not been defined.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Select another swivel data block or define a new swivel data block.

Programm continuation: Clear alarm with the RESET key. Restart part program

61226 [Channel %1:] Block %2: Swivel head cannot be exchanged

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The parameter "Swivel data block" is set to "No". In spite of this, an attempt has been made to change the swivel head.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Set the parameter "Swivel data block" in the setup screen "Rotary axes" to "Automatic" or "Manual".

Programm continuation: Clear alarm with the RESET key. Restart part program

61227	[Channel %1:] Block %2: Target position cannot be reached: %4
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The target position of the approach motion is outside the software limit switch. This situation may arise from swiveling or coordinate rotations.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	If possible, lower retraction plane. Select alternative solution for swiveling (direction +/-) or clamp on workpiece differently.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61228	[Channel %1:] Block %2: Retraction plane for swiveling with swivel head not reached due to software limit switches
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Retraction plane not reached!
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Correct retraction plane
Programm continuation:	Clear alarm with the RESET key. Restart part program
61229	[Channel %1:] Block %2: The external retraction plane must be greater than the internal retraction plane
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The external retraction plane must be greater than the internal retraction plane.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Correct the retraction planes.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61230	[Channel %1:] Block %2: Tool probe diameter too small
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The tool probe has not been calibrated correctly.
Remedy:	Check the following machine or setting data: 51780 \$MNS_J_MEA_T_PROBE_DIAM_RAD[n]
61231	[Channel %1:] Block %2: ShopMill program %4 not executable, as not tested by ShopMill
Parameters:	%1 = Channel number %2 = Block number, label %4 = Program name
Explanation:	Before a ShopMill program can be executed, it has to be tested by ShopMill.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	The program first has to be simulated in ShopMill or loaded into the operating mode "Machine auto" by ShopMill.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61232	[Channel %1:] Block %2: Impossible to load magazine tool
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Only manual tools may be loaded into a swivel head in which only manual tools can be loaded.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Load a manual tool into the swivel head or set the parameter "Tool change" on the setup screenform "Rotary axes" to "Automatic".
Programm continuation:	Clear alarm with the RESET key. Restart part program

61233	[Channel %1:] Block %2: Thread angle wrongly defined
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The thread angles were specified too large or too small.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Check thread geometry.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61234	[Channel %1:] Block %2: ShopMill subroutine %4 cannot be executed, as not tested by ShopMill
Parameters:	%1 = Channel number %2 = Block number, label %4 = Subroutine name
Explanation:	Before a ShopMill subroutine can be used, it has to be tested by ShopMill.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	The subroutine first has to be simulated in ShopMill or loaded into the ShopMill operating mode "Machine auto".
Programm continuation:	Clear alarm with the RESET key. Restart part program

61235	[Channel %1:] Block %2: ShopTurn program %4 cannot be executed as not tested by ShopTurn.
Parameters:	%1 = Channel number %2 = Block number, label %4 = Program name

Explanation:	Before a ShopTurn program can be executed, it has to be tested by ShopTurn.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	First simulate the program in ShopTurn or load it into the ShopTurn operating mode "Machine auto".
Programm continuation:	Clear alarm with the RESET key. Restart part program

61236 [Channel %1:] Block %2: ShopTurn subroutine %4 cannot be executed as not tested by ShopTurn.

Parameters:	%1 = Channel number %2 = Block number, label %4 = Subroutine name
Explanation:	Before a ShopTurn subroutine can be used, it has to be tested by ShopTurn.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Simulate the subroutine first in ShopTurn or load it into the ShopTurn operating mode "Machine auto".
Programm continuation:	Clear alarm with the RESET key. Restart part program

61237 [Channel %1:] Block %2: Retraction direction unknown. Withdraw tool manually!

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The tool is in the retraction area and it is unknown in which direction it can be travelled out of it.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Manually retract the tool from the retraction area defined in the program header and restart the program.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61238 [Channel %1:] Block %2: Machining direction unknown!

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The direction of the next machining is unknown.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please contact the responsible Siemens regional office.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61239 [Channel %1:] Block %2: Tool change point lies within retraction area!

Parameters:	%1 = Channel number %2 = Block number, label
--------------------	---

Explanation:	The tool change point has to be far enough outside the retraction area so that no tool extends into the retraction area when the turret is swiveled.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Specify another tool change point.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61240 %[[Channel %1:] Block %2: %]Wrong feed type

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The feed type is not possible for this machining.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Check feed type
Programm continuation:	Clear alarm with the RESET key. Restart part program

61241 [Channel %1:] Block %2: Retraction plane not defined for this machining direction

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	No retraction plane has been defined for the selected machining direction.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Define the missing retraction plane.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61242 [Channel %1:] Block %2: Wrong machine direction

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The machining direction has been specified incorrectly.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Check the programmed machining direction.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61243 [Channel %1:] Block %2: Correct tool change point, tool tip in retraction area!

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The tool change point must be situated so far outside the retraction area that no tool protrudes into the retraction area on turret swivelling.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Specify another tool change point.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61244 [Channel %1:] Block %2: Pitch change leads to undefined thread

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The specified pitch change causes a reversal of the thread direction.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Check thread pitch change and thread geometry.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61245 [Channel %1:] Block %2: Machining plane does not match modal machining plane

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Machining plane does not match modal one.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Check the machining plane.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61246 [Channel %1:] Block %2: Safety distance too small

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The safety clearance is too small for machining.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Increase safety clearance.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61247 [Channel %1:] Block %2: Blank radius too small

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The blank radius is too small for machining.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Increase blank radius.

Programm continuation: Clear alarm with the RESET key. Restart part program

61248 [Channel %1:] Block %2: Infeed too small

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The infeed is too small for machining.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Increase infeed.

Programm continuation: Clear alarm with the RESET key. Restart part program

61249 [Channel %1:] Block %2: Number of edges too small

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The number of edges is too small.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Increase number of edges.

Programm continuation: Clear alarm with the RESET key. Restart part program

61250 [Channel %1:] Block %2: Width across flats/edge length too small

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The width across flats/edge length is too small.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Increase key width/edge length.

Programm continuation: Clear alarm with the RESET key. Restart part program

61251 [Channel %1:] Block %2: Width across flats/edge length too large

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The width across flats/edge length is too large.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Decrease key width/edge length.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61252 [Channel %1:] Block %2: Chamfer/radius too large

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Chamfer/radius is too large.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Decrease chamfer/radius.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61253 [Channel %1:] Block %2: No finishing allowance programmed

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	No finishing allowance has been entered.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Program a finishing allowance.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61254 [Channel %1:] Block %2: Error while traveling to fixed stop

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Error on travelling to fixed stop.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	specify another Z1 position for gripping the counterspindle.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61255 [Channel %1:] Block %2: Error during cut-off: Tool broken?

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Cut-off could not be completed. A tool breakage might have occurred.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Check the tool.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61256 [Channel %1:] Block %2: Mirroring not allowed at program start. Deselect work offset!

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Mirroring impermissible at program start.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Deselect work offset.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61257 [Channel %1:] Block %2: incomplete setup of counterspindle

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Setup of the counterspindle is incomplete.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	The following machine and setting data must be set for the counterspindle: MD 52206 \$MCS_AXIS_USAGE SD 55232 \$SCS_SUB_SPINDLE_REL_POS SD 55550 \$SCS_TURN_FIXED_STOP_DIST SD 55551 \$SCS_TURN_FIXED_STOP_FEED SD 55552 \$SCS_TURN_FIXED_STOP_FORCE
Programm continuation:	Clear alarm with the RESET key. Restart part program

61258 [Channel %1:] Block %2: Assign parameters for counterspindle chuck in the spindle chuck data

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The parameters for the counterspindle chuck in the spindle chuck data have not been assigned.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Indicate parameters ZCn, ZSn and ZEn in the screen "Parameters" > "Setting data" > "Spindle chuck data".
Programm continuation:	Clear alarm with the RESET key. Restart part program

61259 [Channel %1:] Block %2: program contains new machining steps from ShopMill %4

Parameters: %1 = Channel number
 %2 = Block number, label
 %4 = ShopMill version

Explanation: The program has been created with a ShopMill version that is higher than the existing one.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Delete the machining step and reprogram machining if required.

Programm continuation: Clear alarm with the RESET key. Restart part program

61260 [Channel %1:] Block %2: program contains new machining steps from ShopTurn %4

Parameters: %1 = Channel number
 %2 = Block number, label
 %4 = ShopTurn version

Explanation: The program has been created with a ShopTurn version that is higher than the existing one.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Delete the machining step and reprogram machining if required.

Programm continuation: Clear alarm with the RESET key. Restart part program

61261 [Channel %1:] Block %2: center offset too large

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The center offset on center drilling is larger than permissible.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Enter lower eccentricity (\$SCS_DRILL_MID_MAX_ECCENT).

Programm continuation: Clear alarm with the RESET key. Restart part program

61262 [Channel %1:] Block %2: pitch not possible with selected tool

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The pitch of the tap does not match the programmed pitch.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Use a tap with the programmed pitch.

Programm continuation: Clear alarm with the RESET key. Restart part program

61263	[Channel %1:] Block %2: Chained ShopMill program blocks not permissible in subprogram on pos. pattern
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	If a subroutine is called from a position pattern, the subroutine itself must not include a position pattern.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Reprogram machining.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61264	[Channel %1:] Block %2: Chained ShopTurn program blocks not permissible in subprogram on pos. pattern
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	If a subroutine is called from a position pattern, the subroutine itself must not include a position pattern.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Reprogram machining.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61265	[Channel %1:] Block %2: Too many restrictions, use rectangular pocket
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In face milling a maximum of only 3 sides can be delimited.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Use pocket cycle.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61266	[Channel %1:] Block %2: Illegal machining direction
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In face milling, the delimitations and the direction of machining do not match.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Select another direction of machining.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61267 [Channel %1:] Block %2: Plane infeed too large, residual corners remain

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: In face milling, the plane infeed must not exceed 85%.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Select a smaller plane infeed, as otherwise residual corners will be left over.

Programm continuation: Clear alarm with the RESET key. Restart part program

61268 [Channel %1:] Block %2: Illegal machining direction, residual corners are left over.

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: In face milling, the machining direction does not match the selected delimitations.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: The machining direction must be selected to match the delimitations.

Programm continuation: Clear alarm with the RESET key. Restart part program

61269 [Channel %1:] Block %2: External tool diameter too small

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Incorrect tool definition.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check angle and diameter of the tool used.

Programm continuation: Clear alarm with the RESET key. Restart part program

61270 %[[Channel %1:] Block %2: %]Chamfer width too small

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Chamfer width selected too small.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Increase the chamfer width.

Programm continuation: Clear alarm with the RESET key. Restart part program

61271 %[[Channel %1:] Block %2: %]Chamfer width greater than tool radius

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: Chamfer width larger than tool radius.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Use a larger tool.

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61272 %[[Channel %1:] Block %2: %]Insertion depth too small

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: Insertion depth on chamfering too small.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Increase the insertion depth.

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61273 %[[Channel %1:] Block %2: %]Insertion depth too large

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: Insertion depth on chamfering too large.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Decrease the insertion depth.

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61274 %[[Channel %1:] Block %2: %]Invalid tool angle

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: Invalid tool angle.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Check tool angle

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61275	[Channel %1:] Block %2: Target point violates software limit switch!
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Due to a swivel action, the end point is outside the software limit switches.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Select another retraction plane or approach a suitable interpolation point.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61276	[Channel %1:] Block %2: External tool diameter required for restrictions
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Outer tool diameter required in case of delimitations.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Specify the outer tool diameter.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61277	[Channel %1:] Block %2: Tool diameter larger than restriction
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Tool diameter larger than delimitation.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Use a smaller tool.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61278	[Channel %1:] Block %2: If tool angle is larger than 90°, both tool diameters must be equal
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	For tool angles larger than 90°, the two tool diameters must be identical.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Correct the tool angle or the tool diameters.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61279 [Channel %1:] Block %2: If tool angle equals 90°, both tool diameters must be equal

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: For tool angles equal to 90°, the two tool diameters must be identical.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Correct the tool angle or the tool diameters.

Programm continuation: Clear alarm with the RESET key. Restart part program

61280 [Channel %1:] Block %2: %4- Mirroring missing in work offset for counterspindle

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The work offset for counterspindle machining does not have Z mirroring.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Select Z mirroring for the work offset used.

Programm continuation: Clear alarm with the RESET key. Restart part program

61281 [Channel %1:] Block %2: starting point of machining outside retraction planes

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The starting point of machining is outside the retraction planes.
It is derived from the programmed geometry plus the safety distance in the selected machining direction.
The calculated point must lie within the retraction area to ensure safe approach.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Adjust the retraction planes.

Programm continuation: Clear alarm with the RESET key. Restart part program

61282 [Channel %1:] Block %2: end point of machining outside retraction planes

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The end point of machining is outside the retraction planes.
It is calculated internally (according to the selected machining strategy).

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Adjust the retraction planes.

Programm continuation: Clear alarm with the RESET key. Restart part program

61283	[Channel %1:] Block %2: direct approach not possible, as tool change required
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	After block search a position is to be reached by direct approach, but a tool change is required before.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	First execute a manual tool change, then restart the block search.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61284	[Channel %1:] Block %2: starting point cannot be approached without collision. Pre-position tool manually
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The starting point cannot be approached without collisions.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Preposition the tool manually.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61285	[Channel %1:] Block %2: parking position is below return plane XRA.
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The parking position is below retraction plane XRA.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Move the parking position above retraction plane XRA.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61286	[Channel %1:] Block %2: machining not possible, check tool angle.
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Machining not possible with the specified tool.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Use a suitable tool.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61287 %[[Channel %1:] Block %2: %]No master spindle active.

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: No master spindle active.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Activate the master spindle (machine data 20090).

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61288 [Channel %1:] Block %2: Main spindle not set up

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Please check the following machine or setting data:
 MD 20070 \$MC_AXCONF_MACHAX_USED[]
 MD 20080 \$MC_AXCONF_CHANAX_NAME_TAB[]
 MD 35000 \$MA_SPIND_ASSIGN_TO_MACHAX[]
 MD 52206 \$MCS_AXIS_USAGE[]

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61289 [Channel %1:] Block %2: Counterspindle not set up

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Please check the following machine or setting data:
 MD 20070 \$MC_AXCONF_MACHAX_USED[]
 MD 20080 \$MC_AXCONF_CHANAX_NAME_TAB[]
 MD 35000 \$MA_SPIND_ASSIGN_TO_MACHAX[]
 MD 52206 \$MCS_AXIS_USAGE[]

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61290 [Channel %1:] Block %2: Tool spindle not set up

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please check the following machine or setting data: MD 20070 \$MC_AXCONF_MACHAX_USED[] MD 20080 \$MC_AXCONF_CHANAX_NAME_TAB[] MD 35000 \$MA_SPIND_ASSIGN_TO_MACHAX[] MD 52206 \$MCS_AXIS_USAGE[]
Programm continuation:	Clear alarm with the RESET key. Restart part program

61291 [Channel %1:] Block %2: Linear axis of counterspindle not set up

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Please check the following machine or setting data: MD 20070 \$MC_AXCONF_MACHAX_USED[] MD 20080 \$MC_AXCONF_CHANAX_NAME_TAB[] MD 52206 \$MCS_AXIS_USAGE[]
Programm continuation:	Clear alarm with the RESET key. Restart part program

61292 [Channel %1:] Block %2: B axis not set up

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Set up the B axis in the machine data 52206 \$MCS_AXIS_USAGE.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61293 [Channel %1:] Block %2: Tool %4 has no spindle rotation direction

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Select spindle rotation direction in tool list.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61294 [Channel %1:] Block %2: Active radius/diameter setting does not match reset setting

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Before starting up the program, set G group 29 (DIAMON, DIAMOF, etc.) to reflect the corresponding reset value.

Programm continuation: Clear alarm with the RESET key. Restart part program

61295 [Channel %1:] Block %2: The value of the 'Axis sequence' parameter is illegal

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Correct the "Axis sequence" parameter in the screenform

Programm continuation: Clear alarm with the RESET key. Restart part program

61296 [Channel %1:] Block %2: Blank programmed incorrectly

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The blank has been programmed incorrectly.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Correct the blank.

Programm continuation: Clear alarm with the RESET key. Restart part program

61297 [Channel %1:] Block %2: Reference for incremental retraction plane missing

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The retraction plane can only be specified in increments if the blank is entered.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Program the retraction plane in absolute terms.

Programm continuation: Clear alarm with the RESET key. Restart part program

61298 [Channel %1:] Block %2: No work offset entered for main spindle

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: No work offset has been specified for the main spindle.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Specify a work offset for the main spindle in the program header or under Settings.

Programm continuation: Clear alarm with the RESET key. Restart part program

61299 [Channel %1:] Block %2: No work offset entered for counterspindle

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: No work offset has been entered for the counterspindle.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Specify a work offset for the counterspindle in the program header or under Settings.

Programm continuation: Clear alarm with the RESET key. Restart part program

61300 [Channel %1:] Block %2: Probe defective

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61301 [Channel %1:] Block %2: Probe not switching

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The measuring distance was completely traversed, but no switching signal was generated at the measuring input.

Remedy: -Check measuring input
 -Check measuring distance
 -Probe defective
 -If the measuring cycles are used with SinuTrain or an NCU with simulated axes, check the machine data 13231 \$MN_MEAS_PROBE_OFFSET.
 MD13231 moves the MEAS switching position and must be less than the measuring distance parameterized in the current measuring cycle.

61302 [Channel %1:] Block %2: Probe - collision

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The measuring probe collided with an obstacle when being positioned.

Remedy:

- Check spigot diameter (may be too small)
- Check measuring distance (may be too long)

61303 [Channel %1:] Block %2: Safety margin exceeded %4

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The measuring result differs greatly from the specified value.

Remedy: Check setpoint value and parameter TSA.

61304 [Channel %1:] Block %2: Allowance

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

- The difference between actual and setpoint measurements is greater than the upper tolerance limit (screen parameter TUL):
- TUL is the upper tolerance limit of the measurement difference.
- TUL is always related to the material, irrespective of whether external or internal machining is involved.
- The hole/pocket is thus too small and the spigot is too large.
- This means that further material can be removed.
- The measuring cycle parameter TUL corresponds to "upper deviation", the usual term used in mechanical engineering for fits and tolerances.

Reaction:

- Interpreter stop
- NC Start disable in this channel.
- Interface signals are set.
- Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61305 [Channel %1:] Block %2: Dimension too small

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

- The difference between the actual and setpoint measurement is less than the lower tolerance limit (screen parameter TLL):
- TLL is the lower tolerance limit of the measurement difference.
- TLL is always related to the material, irrespective of whether external or internal machining is involved.
- The hole/pocket is thus too large and the spigot too small.
- This means that too much material has already been removed.
- The measuring cycle parameter TLL corresponds to "lower deviation", the usual term used in mechanical engineering for fits and tolerances.

Reaction:

- Interpreter stop
- NC Start disable in this channel.
- Interface signals are set.
- Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61306	[Channel %1:] Block %2: Permissible measuring difference exceeded
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check setpoint value and parameter DIF.
61307	[Channel %1:] Block %2: Incorrect measuring variant %4
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Parameter S_MVAR has an invalid value. Measure tool: For milling/turning machines, calibration must be performed using Cycle971 and the permitted tool types.
61308	[Channel %1:] Block %2: Check measuring path
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Remedy:	For measuring, a traversing path is generated, the size of which can be specified. This describes the maximum distance before and after the expected switching position (workpiece edge). This value must be greater than 0. In AUTOMATIC operating mode: - Check parameter DFA In the JOG mode: - Check machine data 51786 \$MNS_J_MEA_T_PROBE_MEASURE_DIST, 51752 \$MNS_J_MEA_M_DIST_TOOL_LENGTH and 51753 \$MNS_J_MEA_M_DIST_TOOL_RADIUS.
61309	[Channel %1:] Block %2: Check probe type
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Remedy:	Measurement of workpiece: Check tool type of measuring probe in the tool management. When measuring workpiece milling, tool types 710, 712, 713 or 714 should preferably be used. But a type 1xy can also be used. Type 710 is permitted for workpiece measurement in all measuring cycles. Types 712, 713 and 714 are intended for special measuring tasks. When measuring workpiece turning, tool type 580 should preferably be used. However, a type 1xy can also be used, but only if setting data \$SC_TOOL_LENGTH_TYPE=2 is set. Measurement of tool: - For measuring tool milling, no permissible tool probe type is entered in SD54633 \$SNS_MEA_TP_TYPE[S_PRNUM-1] or SD54648 \$SNS_MEA_TPW_TYPE[S_PRNUM-1]. For probe type "Disk" the permissible working plane G17...G19 must be checked. - "Cube" is the only tool probe type permitted on milling/turning machines: SD54633 \$SNS_MEA_TP_TYPE=0 and SD54648 \$SNS_MEA_TPW_TYPE=0
61310	[Channel %1:] Block %2: Scale factor is active
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Scale factor = scaling is active.
Remedy:	Switch off the active scale factor in the program. Measuring is not possible with an active scale factor.

61311	[Channel %1:] Block %2: No D number is active
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	No tool offset for the measuring probe (for workpiece measurement) or no tool offset for the active tool (for tool measurement) is selected.
Remedy:	Select a cutting edge number D of the tool.
61312	[Channel %1:] Block %2: Check measuring cycle number
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Remedy:	The measuring cycle called is impermissible for the current technology.
61313	[Channel %1:] Block %2: Check probe number
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Remedy:	Check parameter S_PRNUM. Measure workpiece: Parameter S_PRNUM 1 to 40 Measure tool: Parameter S_PRNUM 1 to 6
61314	[Channel %1:] Block %2: Check selected tool type
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Remedy:	Measure workpiece: - Specify new S_PRNUM or recalibrate probe - Check whether the probe (type 7xx or 5xx) is suitable for the measuring task Measure tool: Tool type impermissible for calibration (adjustment) of the tool probe.
61315	[Channel %1:] Block %2: Check position of cutting edge
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	When measuring the workpiece for the technology turning, cutting edge positions 7 and 8 are allowed for probe type 580. Cutting edge positions 5 and 6 are also possible in special applications, such as measuring at the counterspindle.
Remedy:	When measuring the workpiece for the technology turning, check the cutting edge position of the probe in the tool list. When measuring the tool for the technology turning with orientable toolholders, the active cutting edge position of the probe is evaluated. In this case, the currently active cutting edge position must be checked.
61316	[Channel %1:] Block %2: Center and radius cannot be determined
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	No circle can be calculated from the measured points, as all measured points lie on a straight line.
Remedy:	Program change

61317 [Channel %1:] Block %2: Check number of circle calculation points

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Parameterization faulty. 3 or 4 points are required to calculate the center point.

Remedy: Change parameterization of CYCLE116.

61318 [Channel %1:] Block %2: Check weighting factor

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Remedy: - Check parameter (FW)

61319 [Channel %1:] Block %2: Check call parameter CYCLE114

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Remedy: Check call parameter CYCLE114.

61320 [channel %1:] block %2: check tool name / number

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Remedy: - Check parameter S_TNAME.
With active tool management, parameter S_TNAME is empty or the specified tool name is unknown to the tool management.

61321 [Channel %1:] Block %2: Check WO memory number

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The work offset to be corrected does not exist.
Or a correction should be made to the coordinate rotation of a global work offset.
Global work offsets have only linear offsets and no rotational offsets.
It is therefore not possible to correct measured angles or other rotational offsets in them.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check the number of the work offset to be corrected that is specified in the measuring cycle mask.
Check also the parameters S_KNUM and S_KNUM1 in the measuring cycle interface.

If the machine data 18601 \$MN_MM_NUM_GLOBAL_USER_FRAMES is greater than zero, all work offsets are globally defined. In this case, no coordinate rotation can be corrected. If you want to correct a coordinate rotation, the machine data 18601 must be set to zero so that the work offsets are defined according to the specific channel.
For this the machine data 18601 \$MN_MM_NUM_GLOBAL_USER_FRAMES and 28080 \$MC_MM_NUM_USER_FRAMES must be checked

Programm continuation: Clear alarm with the RESET key. Restart part program

61322 [Channel %1:] Block %2: Check 4th digit of _KNUM

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The stated digit of _KNUM includes invalid values. Also check _MVAR.

Remedy: Check parameter for the tool offset target (_KNUM) and/or the measurement variant (S_MVAR).

61323 [Channel %1:] Block %2: Check 5th digit of _KNUM

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The stated digit of _KNUM includes invalid values. Also check _MVAR.

Remedy: Check parameter for the tool offset target (_KNUM) and/or the measurement variant (S_MVAR).

61324 [Channel %1:] Block %2: Check 6th digit of _KNUM

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The stated digit of _KNUM includes invalid values. Also check _MVAR.

Remedy: Check parameter for the tool offset target (_KNUM) and/or the measurement variant (S_MVAR).

61325 [Channel %1:] Block %2: Check measuring axis/offset axis

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Remedy: Check the parameter for the measuring axis (X, Y, Z).

61326 [Channel %1:] Block %2: Check measuring direction

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Remedy: Milling measuring cycles:
- Check the measuring direction (+/-) entered in the mask.
Turning measuring cycles:
- Check the current pre-positioning of the workpiece probe with reference to the entered inner or outer measurement (setpoint).

61327 [Channel %1:] Block %2: Program reset required

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: NC reset required.

Remedy: Execute NC reset.

61328 [Channel %1:] Block %2: Check D number

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The D number in parameter _KNUM is larger than the maximum value in the machine data 18105 \$MN_MM_MAX_CUTTING_EDGE_NO.

Only cutting edges 1 and 2 are permitted for the "simultaneous measurement" function.

Remedy: Check the parameter for the tool offset target (S_KNUM1).

Check the value in the machine data 18105 \$MN_MM_MAX_CUTTING_EDGE_NO.

61329	[Channel %1:] Block %2: Check rotary axis
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Remedy:	No name has been assigned to the axis number specified in the parameter of the rotary axis, or this axis is not configured as a rotary axis. Check the machine data 20080 \$MC_AXCONF_CHANAX_NAME_TAB, 30300 \$MA_IS_ROT_AX and 52207 \$MCS_AXIS_USAGE_ATTRIB Bit6.
61330	[Channel %1:] Block %2: Coordinate rotation active
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	No measuring possible in the rotated coordinate system.
Remedy:	Check the conditions for measuring.
61331	[Channel %1:] Block %2: Angle too large, change measuring axis
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The parameter Start angle (alpha 0) is too large for the specified measuring axis.
Remedy:	Select a different measuring axis or check the value for the start angle.
61332	[Channel %1:] Block %2: Modify tool tip position
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The tool tip is below the measuring probe surface (e.g. for a ring gauge or cube).
Remedy:	Place the tool above the measuring probe surface.
61333	[Channel %1:] Block %2: Check calibration block number
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The _CALNUM parameter is too large.
Remedy:	Reduce the _CALNUM parameter to the permissible value. Check the following machine data: 51601 \$MNS_MEA_CAL_EDGE_NUM
61334	[Channel %1:] Block %2: Check safety area
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Remedy:	Check parameters for the protection area: -XS -YS -ZS
61335	[Channel %1:] Block %2: Reserved
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Alarm triggered: Reserved
Remedy:	reserved

61336	[Channel %1:] Block %2: Geometry axes do not exist
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	Not all the geometry axes required for measurement or machining are configured.
Remedy:	Machine data 20060[0..2] \$MC_AXCONF_GEOAX_NAME_TAB must be checked and, if necessary, changed.
61337	[Channel %1:] Block %2: Check measuring input
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	
Programm continuation:	Clear alarm with the RESET key. Restart part program
61338	[Channel %1:] Block %2: Positioning speed equal to zero
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In some measuring variants, e.g. measuring spigots (CYCLE977), intermediate paths are generated in addition to the actual measuring paths. These are traversed at a specific feed rate. The values for the feed rate can be found in the setting data 55634 \$SCS_MEA_FEED_PLANE_VALUE, 55636 \$SCS_MEA_FEED_FEEDAX_VALUE and 55640 \$SCS_MEA_FEED_CIRCLE.
Remedy:	Check the values for the feed rate in the setting data 55634 \$SCS_MEA_FEED_PLANE_VALUE, 55636 \$SCS_MEA_FEED_FEEDAX_VALUE and 55640 \$SCS_MEA_FEED_CIRCLE.
61339	[Channel %1:] Block %2: Correction factor for rapid traverse speed = 0
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	The correction factor for rapid traverse speed is 0.
Remedy:	Check setting data 55632 \$SCS_MEA_FEED_RAPID_IN_PERCENT.
61340	[Channel %1:] Block %2: Incorrect alarm number
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Internal error in measuring cycles.
61341	[Channel %1:] Block %2: Probe not calibrated in active plane or wrong calibration data record
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	The probe is not calibrated in the active plane or an incorrect calibration data set has been selected.
Remedy:	Calibrate the probe before measuring. Check the number of the probe calibration data field (calibration data record) in parameter S_PRNUM. Note planes G17, G18 and G19. Only G18 is permitted for workpiece measurement when turning. Check: Setting data 54611 \$SNS_MEA_WP_FEED[S_PRNUM-1] > 0 after calibration

61342	[Channel %1:] Block %2: Upgrade NCK software version
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Upgrade NCU software version.
61343	%[[channel %1:] block %2:%]Tool does not exist: %4
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check the tool name.
61344	[Channel %1:] Block %2: Several tools are active
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Remove tool from another spindle.
61345	[Channel %1:] Block %2: D number of tool offset, too many digits
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Reduce the D number in _KNUM or check MD of flat D number.
61346	[Channel %1:] Block %2: Distance between starting point and measuring point is smaller than or equal to zero
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	The distance between the starting point and the measuring point is less than or equal to 0. The parameters X1 or X2 are not occupied or smaller than 0.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Check parameters X1 and X2.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61347	[Channel %1:] Block %2: Angle 1st edge - 2nd edge equals 0
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	The parameter following angle (alpha 1) is 0.
Remedy:	Check the parameter following angle (alpha 1).
61348	[Channel %1:] Block %2: Angle rel. to reference edge equals 0
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61349 [Channel %1:] Block %2: Distance upper probe edge - measuring position = 0 for tool radius measurement

Parameters: %1 = Channel number
 %2 = Block number, label channel number

Explanation: The distance between the upper edge and lower edge of the tool probe is 0. This is relevant for radius measurement.

Remedy: Check the setting data 54634 \$SNS_MEA_TP_CAL_MEASURE_DEPTH.

61350 [Channel %1:] Block %2: Feed, speed not programmed for tool measurement with rotating spindle

Parameters: %1 = Channel number
 %2 = Block number, label channel number

Explanation: No feed rate or spindle speed is programmed for tool measurement with rotating spindle.

Remedy: Check parameters F1 and S1.

61351 [Channel %1:] Block %2: Tool length or radius is 0

Parameters: %1 = Channel number
 %2 = Block number, label channel number

Explanation: The active tool length or the active tool radius is 0.

Remedy: Cutter: - Check length and radius of the active tool in the compensation data memory
 Drill: - Check length of the active tool in the compensation data memory
 - Radius or tip angle of the active tool must be predefined in the compensation data memory

61352 [Channel %1:] Block %2: Path for logfile not permitted

Parameters: %1 = Channel number
 %2 = Block number, label channel number

Explanation: The specified path for the log file is incorrect.

Remedy: Check the programmed path specification.
 Check parameter _PROTNAME[0].

61353 [Channel %1:] Block %2: Path for logfile not found

Parameters: %1 = Channel number
 %2 = Block number, label channel number

Explanation: The specified directory does not exist or the specified path is incorrect.

Remedy: Check the programmed path specification.
 Check parameter _PROTNAME[0].

61354 [Channel %1:] Block %2: Log file not found

Parameters: %1 = Channel number
 %2 = Block number, label channel number

Explanation: No name specified for the log file.

Remedy: Check the programmed path specification.
Check parameter _PROTNAME[0].

61355 [Channel %1:] Block %2: Incorrect file type for logfile

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation: The file extension for the log file is incorrect.
The file extensions .txt and .csv are permitted.

Remedy: Check parameter _PROTNAME[0].

61356 [Channel %1:] Block %2: Logfile is being used

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation: The log file is already used by an NC program.

Remedy: Check parameter _PROTNAME[1].

61357 %[[Channel %1:] Block %2: %] Not enough NC memory or too many files/directories in the NC

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation: There is not enough NC memory available or there are too many files or directories in the NC file system.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Delete files whose names are comprised exclusively of numbers, e.g. "201202100938202_MPF", in the directory /
_N_WKS_DIR/_N_TEMP_WPD.
Also check whether other files in this directory can be deleted.
Check, and if required, increase machine data 18320: \$MN_MM_NUM_FILES_IN_FILESYSTEM.

Programm continuation: Clear alarm with the RESET key. Restart part program

61358 [Channel %1:] Block %2: Error during reporting: WRITE command %4

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation: Internal error caused by the WRITE command.

Remedy: Causes of error codes:
10 The file size specified in MD11420 \$MN_LEN_PROTOCOL_FILE has been reached (file is full).
Machine data MD11420 must be set to a value of at least 20 kB, and this sets the maximum size of the log file.
- Increase the value in MD11420 or
- Select log data "new" in cycle150 (data are overwritten) or
- Delete log file or
- Create new log file (change the name of the log file in CYCLE150)
Error code 10 occurs only when logging in the passive file system of the NC.
13 The protection level must be greater than or equal to the Write right of the stated log file.
16 Check the path of the log file (invalid external path).
Other errors: See Programming Guide: WRITE command
Save measurement results:
After eliminating the cause of the error, the associated log can be generated with the function "Report last measurement".

61359 [Channel %1:] Block %2: Error recording in table format: %4

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation: Internal error

Remedy: Call the hotline!

61360 [Channel %1:] Block %2: Error recording in JOG: %4

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation: Internal error

Remedy: Call the hotline!

61361 [Channel %1:] Block %2: Error reporting last measurement %4

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation: Internal error

Remedy: Call the hotline!

61362 [Channel %1:] Block %2: Tolerance of the linear vector %4 exceeded

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation: If the error comes from CYCLE996 or CYCLE9960:
The tolerance of the linear vectors is exceeded during the measurement of the kinematics.
The value of the tolerance is transferred in parameter TLIN.
If TLIN=0 or tolerance (check) = no, the measured vectors are not monitored.

Remedy: A 2nd measurement with a larger tolerance can be made for the analysis. The kinematic data should not be overwritten.
The newly measured vectors are documented in the measurement log (data file).

61363 [Channel %1:] Block %2: Tolerance of the rotary axis vector %4 exceeded

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation: The rotary axis orientation is also calculated during kinematic measurement.
If the deviation is negligible and only the tolerance range is too small, this can be changed in \$SN_CORR_TRAFO_DIR_MAX.
A deviation of the rotary axis orientation can also have a mechanical cause.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: If the deviation is very large, the cause may be a small measuring circuit.
With a rotary table, the calibration ball must not be too close to the center of rotation.
With head kinematics, the measuring circuit can be enlarged by positioning the 2nd rotary axis when measuring the first.

61364 [Channel %1:] Block %2: Check distance between measuring points %4

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: In automatic mode, the Distance measuring points (_ID) parameter must be checked.
In JOG mode, the selected measuring points are congruent. The measuring points must be redefined.

61365	[Channel %1:] Block %2: Check circular feed
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check parameter SD55640 \$SCS_MEA_FEED_CIRCLE
61366	[Channel %1:] Block %2: Direction of rotation for tool measurement with rotating spindle not specified.
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check setting data 54674 \$SNS_MEA_CM_SPIND_ROT_DIR. Permissible values are 3 (corresponds to M3) or 4 (corresponds to M4)
61367	[channel %1:] block %2: parameters %4 are identical
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Specify different positions for the relevant points of P1(X1,Y1), P2(X2,Y2), P3(X3,Y3) and P4(X4,Y4).
61368	[channel %1:] block %2: straights through parameter %4 do not intersect
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Specify different positions for the relevant points of P1(X1,Y1), P2(X2,Y2), P3(X3,Y3) and P4(X4,Y4).
61369	[Channel %1:] Block %2: Position of corner not clearly definable, check parameter %4
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Define points P1(X1,Y1) and P2(X2,Y2) or P3(X3,Y3) and P4(X4,Y4) so that the intersection of the straight lines passing through these points lies outside the sections formed by P1(X1,Y1) and P2(X2,Y2) or P3(X3,Y3) and P4(X4,Y4).
Programm continuation:	Clear alarm with the RESET key. Restart part program
61371	[Channel %1:] Block %2: Product of column width and number of columns is greater than %4 characters per line
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check user programming in CUST_MEAPROT.SPF.

61372	[Channel %1:] Block %2: selected meas.variant requires SPOS-capable spindle
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Change the measuring variant or check the machine equipment. If the error message comes from CYCLE9960: Calibration of the probe on ball is not possible with non-SPOS-capable spindle. Select measuring variant without calibration.
61373	[Channel %1:] Block %2: No SPOS-capable spindle available
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	- Check configuration/parameterization of the spindle axis - If the intention to use a 3D workpiece probe at a "non-SPOS capable spindle", then check the setting of MD 52207 \$MCS_AXIS_USAGE_ATTRIB[n], bit 9 (also see Commissioning instructions, cycles) - If a 3D workpiece probe is attached to the machine outside the spindle, then check the setting of MD 51740 \$MNS_MEA_FUNCTION_MASK, bit 4. (also see Commissioning instructions, cycles)
61374	[Channel %1:] Block %2: Probe not calibrated in axis direction %4
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	The probe is not calibrated in the specified axis direction. Axis calibration is deleted if the following conditions change between two calibrations: - Measuring speed - Spindle position - Rotations of the coordinate system - Reference of probe length to ball end or center (MD51740 Bit 1) - Correction of ball diameter in tool or calibration data (MD54740 Bit 3)
Remedy:	Calibrate the probe in the specified axis direction. Check part program and make sure that no condition mentioned above has been changed between two calibrations.
61375	[Channel %1:] Block %2: Trigger values of measuring sensor are incompatible
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Trigger values of the tool measuring sensor must be fully described either via the _TP[] / _TPW[] fields or via the setting data (SD: 54625-54632 or SD: 54640-54647). A mixture of the two variants is not permitted.
61376	[Channel %1:] Block %2: Number of teeth missing from tool parameters
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Enter the number of teeth of the tool in the tool management.

61377	[Channel %1:] Block %2: Dimensional tolerance %4 exceeded
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	Error message is displayed while measuring the kinematics of a grinding machine: When the kinematics are measured (CYCLE496), it is checked whether the measured vectors lie within the tolerance value of setting data \$SCS_GRIND_MEA_KIN_TOL.
Remedy:	Error message is displayed while measuring the kinematics of a grinding machine: Enter the vectors of the kinematics in advance so that the tolerance value in setting data 55844 \$SCS_GRIND_MEA_KIN_TOL is not exceeded during the following measuring process.
61378	[Channel %1:] Block %2: Tool spindle is not the master spindle
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Before calling the measuring cycles, the tool spindle must be defined as master spindle (SETMS...).
61379	[Channel %1:] Block %2: Too many teeth
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	Tools with a maximum of 100 teeth can be measured.
Remedy:	Check the number of teeth of the tool in tool management.
61380	[Channel %1:] Block %2: Tool probe width too small
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	The width of the tool probe is too small.
Remedy:	Check the following machine data: 51781 \$MNS_MEA_T_PROBE_THICKNESS[n]
61381	[Channel %1:] Block %2: Coupling the spindle position with coordinate rotation around %4 not executable
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	The alarm relates to the cross-measuring tasks measuring cycle function "Coupling of spindle position with coordinate rotation around the infeed axis". This function requires a positionable spindle.
Remedy:	If a positionable spindle is not available for holding the workpiece probe, the function "Coupling the spindle position with coordinate rotation around the infeed axis" can be deactivated with setting data 55740 \$SCS_MEA_FUNCTION_MASK, bit 1=0.
61382	[Channel %1:] Block %2 probe is attached to the machine, measuring variant is not possible
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	The measuring variant cannot be executed with a probe permanently mounted on the machine. The selected measuring variant requires rotational positioning/alignment of the probe.
Remedy:	Select a measuring variant that does not require rotational positioning/alignment of the probe.

61383	[Channel %1:] Block %2: Rotary axis 1: Diameter tolerance of calibration ball of measurement %4 exceeded
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	CYCLE996: See measured diameter in the parameters _OVR[72] to _OVR[74] or the value in the SD \$SCS_MEA_KIN_DM_TOL CYCLE9960: See measured diameter in the parameters _OVR[72] or the value in the SD \$SCS_MEA_KIN_DM_TOL
Remedy:	Check the calibration data or recalibrate the 3D probe. Check also the mechanical structure (stiffness) of the calibration ball in the machine.
61384	[Channel %1:] Block %2: Rotary axis 2: Diameter tolerance of calibration ball of measurement %4 exceeded
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	CYCLE996: See measured diameter in the parameters _OVR[75] to _OVR[77] or the value in the SD \$SCS_MEA_KIN_DM_TOL CYCLE9960: See measured diameter in the parameters _OVR[75] or the value in the SD \$SCS_MEA_KIN_DM_TOL
Remedy:	Check the calibration data or recalibrate the 3D probe. Check also the mechanical structure (stiffness) of the calibration ball in the machine.
61385	[Channel %1:] Block %2: Probe not calibrated in the coordinate system
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	Probe has not been calibrated in the coordinate system set in MD52000 \$MCS_DISP_COORDINATE_SYSTEM.
Remedy:	Calibrate the probe before measurement.
61386	[Channel %1:] Block %2: Invalid protection level for executing measuring cycles %4
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	The protection level is inadequate for the execution of measuring cycles.
Remedy:	Check machine data 51742 \$MNS_MEA_ACCESS_EXEC and 11160 \$NM_ACCESS_EXEC_CST.
61387	[Channel %1:] Block %2: Internal execution error
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Call the SIEMENS hotline
61401	[Channel %1:] Block %2: Probe does not switch, path reduced by software end position %4
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	The traversing path would extend beyond the software end position on the current measuring axis. The traversing path has currently been shortened, and does not reach the position specified as a setpoint. Alarm 61401 is output after 5 unsuccessful contact attempts.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Check setpoint value specification. - Reduce the measuring distance (DFA). - Place the workpiece further away from the software end position.

Programm continuation: Clear alarm with the RESET key. Restart part program

61402 [Channel %1:] Block %2: Probe collision, path reduced by software end position %4

Parameters: %1 = Channel number

%2 = Block number, label channel number

Explanation: This alarm is only output with external measurements (web, spigot, ball) in conjunction with a possible collision in the infeed axis.

The collision is caused by the reduction of the path in the measuring axis of the working plane, before lowering the infeed axis to the measuring height.

The probe was switched during the following infeed in the infeed axis.

If the path had not been reduced, the traversing movement would have extended beyond the software end position of the working plane, and the corresponding NCK alarm 10722 would have been triggered.

Reaction: Interpreter stop

NC Start disable in this channel.

Interface signals are set.

Alarm display.

Remedy: - Check setpoint value specification.

- Place the workpiece further away from the software limit position.

Programm continuation: Clear alarm with the RESET key. Restart part program

61403 [Channel %1:] Block %2: Work offset correction not executed

Parameters: %1 = Channel number

%2 = Block number, label channel number

Explanation:

Remedy: The measurement result contains more than one rotation component around the geometry axes of the coordinate system. However, only one of the rotation components of a rotary axis can be corrected.

To prevent any consequential position errors, the offset of the selected rotary axis is not performed.

"Correction into the coordinate system" must be selected as the bypass.

61404 [Channel %1:] Block %2: Tool correction not executed

Parameters: %1 = Channel number

%2 = Block number, label channel number

Explanation: The offset of the selected tool could not be executed because of the current tool status.

The following applies to tools without a tool status:

- Must not be disabled, must have been active and in use.

The following applies to tools that form a tool grouping:

- Must not be disabled, must have been active and in use.

Remedy: Check the tool state and adapt accordingly.

61405 [Channel %1:] Block %2: Tool environment does not exist

Parameters: %1 = Channel number

%2 = Block number, label channel number

Explanation:

Remedy: Correct the name of the tool environment (_TENV) or create this environment.

61406 [Channel %1:] Block %2: Check DL number

Parameters: %1 = Channel number

%2 = Block number, label channel number

Explanation:

Remedy: Check parameter DL.
Check also the number of the sum and setup offset.

61407 [Channel %1:] Block %2: Check 7th digit and higher of _KNUM

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: - Check parameter _KNUM.
- Check the the number of the sum offset and that of the setup offset.

61408 [Channel %1:] Block %2: total offsets not present

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Set MD 18080, Bit 8=1

61409 [Channel %1:] Block %2: set up offsets not present

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Set MD 18112, Bit 4=1

61410 [Channel %1:] Block %2 access to nonexistent tool element or property

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: The variable to be corrected requires an option or an increase in MD values.

61411 [Channel %1:] Block %2: Check the distribution of measuring points on the plane.

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Check the setpoint and actual values.

61412 [Channel %1:] Block %2: channel basic frame not present

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Set machine data 28081 \$MC_MM_NUM_BASE_FRAMES > 0 or check \$P_CHBFRMASK > 0.

61413 [Channel %1:] Block %2: check setpoint of ball diameter, %4

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Check setpoint value for the spherical diameter.

61414	[Channel %1:] Block %2 : distortion of triangle over limit
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check the setpoint and actual values.
61415	[Channel %1:] Block %2: Check probe / machining plane
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	A probe permissible for the machining plane must be used. Check the setting data 54633 \$SNS_MEA_TP_TYPE or 54648 \$SNS_MEA_TPW_TYPE or change the machining plane.
61416	[Channel %1:] Block %2: Probe number is greater than the maximum number of fields
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check parameter S_PRNUM Measure workpiece: Parameter S_PRNUM 1 to 40 Measure tool: Parameter S_PRNUM 1 to 6
61417	[Channel %1:] Block %2: Probe will collide with the carrier of the reference groove.
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Take up collision-free initial position of the axes involved in the measuring process.
61418	[Channel %1:] Block %2: Protocol file too small, check MD11420: LEN_PROTOCOL_FILE.
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	The machine data 11420 \$MN_LEN_PROTOCOL_FILE is set too small.
Remedy:	Check MD11420 \$MN_LEN_PROTOCOL_FILE: A value of at least 20 kB must be set to use the function "Log measurement results". This machine data specifies the maximum size of the log file.
61419	[Channel %1:] Block %2: Check probe calibration with reference to center of ball/ circumference of ball.
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	Setting in MD 51740 \$MNS_MEA_FUNCTION_MASK Bit 1 does not match calibration status in setting data 54610 \$SNS_MEA_WP_STATUS_GEN[S_PRNUM]. Check the THOUSANDS digit: 1 = circumference; 0 = TCP (Tool Center Point)
Remedy:	Check machine data 51740 \$MNS_MEA_FUNCTION_MASK Bit 1 Remedy: 1. Recalibrate probe (adjust) 2. Change probe number S_PRNUM 3. Adjust MD51740 Bit 1

61420 [Channel %1:] Block %2: Check calibration of multi/mono probes.**Parameters:** %1 = Channel number

%2 = Block number, label channel number

Explanation: The tool type does not match the alignment data set.**Remedy:** The workpiece probe must be calibrated according to its type and use.

61421 [Channel %1:] Block %2: Software release of measuring cycles or NCK inadequate or set up incorrectly - error code %4**Parameters:** %1 = Channel number

%2 = Block number, label channel number

Explanation:**Remedy:** Causes of error: Error code see %4

A -> _OVR[] - parameter field too small. Check GUD definition.

B -> \$SCS_MEA_KIN_MODE? SD55645 not set up

61422 [channel %1:] block %2: parameter measuring variant incorrect - error code: %4**Parameters:** %1 = Channel number

%2 = Block number, label channel number

Explanation:**Remedy:** Causes of error: See error code %4

A -> CYCLE996 _MVAR = 9x identifiers CYCLE996 measure kinematics or

A -> CYCLE996 _MVAR ONES digit outside the value range 0..4

B -> CYCLE996 _MVAR (parameter for normalization) HUNDRED THOUSANDS digit (dec6) or

B -> CYCLE996 ONE MILLION digit(dec7) outside the value range 0..3

C -> CYCLE996 Measurement version "compute kinematics" active, but rotary axes 1 and/or 2 not measured (see also parameter _OVR[40])

or rotary axis 2 exists and no rotary axis vectors (V2xyz) are set up.

D -> CYCLE996 _MVAR TEN THOUSANDS digit (parameter rotary axis 1,2 or vector chain open, closed) outside the value range 0..3

1 -> CYCLE9960 S_MVAR ONES to TEN THOUSANDS digit outside the value range

2 -> CYCLE9960 S_MVAR TENS digit not compatible with the ONES DIGIT

3 -> CYCLE9960 S_MVAR TENS digit outside the value range 0,2

61423 [Channel %1:] Block %2: Parameter %4 not agreed or not created**Parameters:** %1 = Channel number

%2 = Block number, label channel number

Explanation:**Remedy:** Causes of error: see error code %4

1 Parameter CYCLE996 S_TC incorrect or equal zero

2 No swivel data set created -> MD18088 \$MN_MM_NUM_TOOL_CARRIER = 0

3 \$NT_NAME? -> CYCLE996 System variable \$NT_NAME not present

4 TRAFO NO=0? -> CYCLE996 Trafo number = 0?

5 TRAFO TYP? -> CYCLE996 Transformation type not equal to 24, 40 or 56

6 S_MVAR? -> CYCLE996 Trafo type OK, but incorrect call from CYCLE9960

4 -> CYCLE9960 compile cycle E996 not set up

61424 [Channel %1:] Block %2: Parameter %4 for diameter of calibration ball incorrect**Parameters:** %1 = Channel number

%2 = Block number, label channel number

Explanation:

Remedy: Check whether the correct diameter of the calibration ball is entered in parameter S_SETV, or the correct probe ball radius is entered in the tool data of the current workpiece probe.

The mechanical deviation of the position of the current workpiece probe must be minimized by presetting.

61425 [Channel %1:] Block %2: Parameter for measuring axis rotary axis 1 or 2 incorrect - Error code: %4

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Causes of error: see error code %4

- A -> Rotary axis number incorrect (1 or 2)
- B -> No name agreed for rotary axis 1
- C -> Rotary axis vector V1xyz equals zero
- D -> No name agreed for rotary axis 2
- E -> Rotary axis vector V2xyz equals zero
- F VECTOR=0? -> CYCLE996 Orientation vector of the 1st rotary axis = 0
- G VECTOR=0? -> CYCLE996 Orientation vector of the 2nd rotary axis = 0
- 1 -> CYCLE9960 Incorrect number of measurements
- 2 -> CYCLE9960 Number of measurements incorrect: maximum 12 per axis
- 3 -> CYCLE9960 Number of measurements incorrect: minimum 3 per axis
- 4(RA1) -> CYCLE9960 Measuring range rotary axis 1 too small
- 4(RA2) -> CYCLE9960 Measuring range rotary axis 2 too small
- 5(RA1) -> CYCLE9960 Measuring range rotary axis1 too large
- 5(RA2) -> CYCLE9960 Measuring range rotary axis 2 too large
- 6 -> CYCLE9960 Number of measurements incorrect, min. per axis 2 for interpolation points
- 7 -> CYCLE9960 Modulo range: Measuring range covers the complete modulo range (360°), and therefore must begin at the starting position of the modulo range (usually 0)

The permissible measuring range of a rotary axis is from 10 to 360 degrees

61426 [Channel %1:] Block %2: Sum of the active offsets does not equal zero - Error code: %4

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Causes of error: See error code %4

Check the overview of active offsets (\$P_ACTFRAME)

Delete offsets in the rotary axes

- A -> sum of the translatory offsets of geometry axes $\neq 0$
- B -> sum of the fine offsets of the geometry axes $\neq 0$
- C -> sum of the rotary components of the geometry axes $\neq 0$
- D -> sum of the translatory offsets of rotary axis 1 $\neq 0$
- E -> sum of the translatory offsets of rotary axis 2 $\neq 0$

61427 [Channel %1:] Block %2: Tool data of the active workpiece probe incorrect or inactive - Error code: %4

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Causes of error: See error code %4

- A -> Workpiece probe (or tool edge) inactive
- B -> Length L1 of the workpiece probe = 0

61428 [Channel %1:] Block %2: Error while creating log file - Error code: %4

Parameters: %1 = Channel number
 %2 = Block number, label channel number

Explanation:

Remedy: Causes of error: See error code %4
 A -> Number of log files in the current directory > 99
 B -> Log files too long. Rename or delete log files,
 check MD11420 \$MN_LEN_PROTOCOL_FILE!

61429 [Channel %1:] Block %2: Measuring axis (rotary axis 1 or 2) not in basic or intended position - Error code: %4

Parameters: %1 = Channel number
 %2 = Block number, label channel number

Explanation:

Remedy: Error causes: See Error code %4
 A -> Rotary axis 1 not in basic position for 1st measurement
 B -> Rotary axis 2 not in basic position for 1st measurement
 C -> Rotary axis 2 not rotated for the 2nd or 3rd measurement with reference to the 1st measurement -> see parameter
 _OVR[63 to 65]
 D -> Rotary axis 1 not rotated for the 2nd or 3rd measurement with reference to the 1st measurement -> see parameter
 _OVR[60 to 62]
 1 (RA1) -> CYCLE9960 Rotary axis 1 initially not in basic position
 2 (AMODE DEC5) -> Selected basic position is not permissible

61430 [Channel %1:] Block %2: Kinematic vectors not computed - Error code: %4

Parameters: %1 = Channel number
 %2 = Block number, label channel number

Explanation:

Remedy:	Causes of error: see error code %4 A -> Plausibility of the input points PM1, PM2, PM3 not fulfilled, resulting side lengths must not be equal to zero (Notice: even in the case of side lengths not equal to zero, there is a risk of not being able to form a triangle => check PM1...3!) B -> Enclosed angle at PM1 between the spread vectors PM1PM2 and PM1PM3 is equal to 0. Starting points do not form a triangle. C -> Enclosed angle at PM2 between the spread vectors PM2PM1 and PM2PM3 is equal to 0. Starting points do not form a triangle. D -> Enclosed angle at PM3 between the spread vectors PM3PM1 and PM3PM2 is equal to 0. Starting points do not form a triangle. E -> Normalizing interpolation point: Invalid axis name defined for computation F -> Normalizing interpolation point: Invalid plane defined for computation G -> If the computed angle is smaller than the limiting value of the angular segment of the rotary axis in parameter TVL. The computed limit angle and the name of the rotary axis are displayed. With values of TVL < 20 degrees, inaccuracies are to be expected as a result of measuring inaccuracies in the micrometer range of the probe. Example: "61429 .. G Axis:C->TVLmin=12.345" Remedy: Adjust angular value of rotary axis in user program or parameter TVL. With complete measurement of kinematics with CYCLE9960, the value for the limit angles is entered in SD \$SCS_MEA_KIN_MIN_ANG_TRIANGLE (minimum internal angle of the measuring triangle) "CC Option ?" -> Option compile cycle "Measurement of kinematics" not set "\$MN_CC_ACTIVE_IN_CHAN_C996[0] ?" -> machine data for compile cycle not set "License ?" -> License for "Measurement of kinematics" not set When measuring head kinematics without offset (spindle extension), an alternative calculation is performed with error message A or G. This applies on condition that the rotary axis to be measured has been repositioned H -> Conditions for alternative calculation not fulfilled (rotary axis not positioned -> see _OVR[60] to _OVR[62] or SD55648 \$SCS_MEA_KIN_MIN_ANG_POS smaller than the difference of the rotary axis positions in _OVR[60] to _OVR[62]) I -> Conditions for alternative calculation not fulfilled (rotary axis not positioned -> see _OVR[60] to _OVR[62])
----------------	--

61431	[Channel %1:] Block %2: Kinematic vectors not corrected - Error code: %4
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Error causes: see error code %4 A -> Correction not possible with active transformation. A persistent transformation is active. The transformation can only be calculated but not corrected. The values to be corrected are to be found in parameters _OVR[1] to _OVR[20]. B -> Correction not possible with active transformation. A user transformation is active. The transformation can only be calculated but not corrected. The values to be corrected are to be found in parameters _OVR[1] to _OVR[20].
61432	[Channel %1:] Block %2: %4 not active or not created
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	The transformation / tool carrier to be measured must be active before CYCLE9960 is started. Check whether the specified transformation / tool carrier has been created. If this is the case, check whether the transformation / tool carrier was activated before calling CYCLE9960. It is also possible that an incorrect transformation / tool carrier is active. or S_TNAME=0 -> No TCARR or no transformation was specified for measuring.

61440	[Channel %1:] Block %2: Position of cutting edge cannot be determined
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	A turning tool with a cutting edge position between 1 and 8 must be used as the tool type. Check the entered cutting edge position with reference to the basic position of the tool carrier.
61441	[Channel %1:] Block %2: Position of cutting edge is not in the machining plane.
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	The cutting edge position of the turning tool (cutting edge plate) is no longer in the machining plane (interpolation plane), e.g. caused by an orientable tool carrier.
Remedy:	Check the tool carrier position and, if necessary, correct it!
61442	[Channel %1:] Block %2: Tool carrier not parallel to the geometry axes
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	After positioning the orientable tool carrier, the tool lengths L1, L2 and L3 are not parallel to the geometry axes.
Remedy:	Check the positioning behavior of the rotary axes (e.g. blocking) of the tool carrier.
61443	[Channel %1:] Block %2: Advance angle %4 or greater/less than +/-90° or +/-120°
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check the value in the alpha 1 advance angle parameter! If 3-point measurement is selected, alpha 1 must not be greater/smaller than +/-120°, and if 4-point measurement is selected, alpha 1 must not be greater/smaller than +/-90°! The parameter of the advance angle alpha 1 must always be set to a value other than "zero".
61444	[Channel %1:] Block %2: Current measuring speed is not identical to the calibration speed
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	The relevant calibration speed is also stored in each calibration data record. The current measuring speed with feedrate override of 100% is not equal to the calibration speed. After calibration, the calibration speed value must be in the following setting data. For workpiece measurement: SD 54611 \$SNS_MEA_WP_FEED[S_PRNUM-1] > 0 For tool measurement: SD 54636 \$SNS_MEA_TP_FEED[S_PRNUM-1] > 0 for calibration in the machine coordinate system SD 54651 \$SNS_MEA_TPW_FEED[S_PRNUM-1] > 0 for calibration in the workpiece coordinate system Recalibrate probe (adjust) or specify new S_PRNUM.
61445	[Channel %1:] Block %2: Check holder angle
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check the entry for the holder angle in the tool offset. For cutting edge positions 1-4, the holder angle must be greater than or equal to 90° and less than 180°, for cutting edge positions 5-8, it must be greater than 0° and less than 90°.

61446	[Channel %1:] Block %2: Check insert angle and clearance angle
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check the entry for the insert angle / clearance angle in the tool offset!
61447	[Channel %1:] Block %2: Reference point, measuring direction, check tool default setting of probe
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	This alarm is only output for measurement in JOG with calibration of probe length, on a reference piece or on the sphere. An implausible result has occurred, comparable with overrunning the safe area in automatic mode.
Remedy:	Check the specifications stated in the alarm text.
61501	[Channel %1:] Block %2: Simulation is active
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Reset simulation
Programm continuation:	Clear alarm with the RESET key. Restart part program
61502	[Channel %1:] Block %2: No tool offset active
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	A tool number must be programmed
Programm continuation:	Clear alarm with the RESET key. Restart part program
61503	[Channel %1:] Block %2: tool nose radius compensation left or right
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	A tool offset value has to be programmed.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61504	[Channel %1:] Block %2: _KNG incorrect for setup
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	
Programm continuation:	Clear alarm with the RESET key. Restart part program

61505 [Channel %1:] Block %2: retraction path is smaller than 1mm

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Increase retraction path

Programm continuation: Clear alarm with the RESET key. Restart part program

61506 [Channel %1:] Block %2: infeed path is smaller than 1mm

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Increase infeed path

Programm continuation: Clear alarm with the RESET key. Restart part program

61507 [Channel %1:] Block %2: safety clearance is smaller than 1mm

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61508 [Channel %1:] Block %2: Incorrect default setting for shoulder position

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61509 [Channel %1:] Block %2: Incorrect default setting for dresser position

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61510 [Channel %1:] Block %2: Test run feed is active

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Switch off test run feed

Programm continuation: Clear alarm with the RESET key. Restart part program

61511 [Channel %1:] Block %2: Incorrect shoulder position or tool edge D1/D2

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61512 [Channel %1:] Block %2: Incorrect longitudinal position

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61513 [Channel %1:] Block %2: Dresser left and inclined grinding wheel

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61514 [Channel %1:] Block %2: Grinding wheel type missing

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61515 [Channel %1:] Block %2: Retraction path is smaller than or equal to dressing amount

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Change retraction path.

Programm continuation: Clear alarm with the RESET key. Restart part program

61517 [Channel %1:] Block %2: Angle of inclined grinding wheel missing

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Enter angle under \$TC_TPG8

Programm continuation: Clear alarm with the RESET key. Restart part program

61518	[Channel %1:] Block %2: Shoulder height of the grinding wheel must be greater than the grinding wheel radius
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Change shoulder height or grinding wheel radius
Programm continuation:	Clear alarm with the RESET key. Restart part program
61519	%[[Channel %1:] Block %2: %]Incorrect type of machining
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Assign a value between 1 and 3 to parameter B_ART
Programm continuation:	Clear alarm with the RESET key. Restart part program
61520	[Channel %1:] Block %2: Additional offsets not set
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Set MD18094 MM_NUM_CC_TDA_PARAM=10
Programm continuation:	Clear alarm with the RESET key. Restart part program
61521	[Channel %1:] Block %2: Current grinding wheel too wide
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Reduce width of grinding wheel
Programm continuation:	Clear alarm with the RESET key. Restart part program
61522	[Channel %1:] Block %2: Overlap is greater than or equal to the actual grinding wheel width
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Reduce overlap
Programm continuation:	Clear alarm with the RESET key. Restart part program
61523	[Channel %1:] Block %2: Zero signal of calipers missing
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check calipers signal
Programm continuation:	Clear alarm with the RESET key. Restart part program

61524	[Channel %1:] Block %2: Incorrect oblique angle
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	The oblique plunge angles must be $>-90^\circ$ and $<90^\circ$.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61525	[Channel %1:] Block %2: Incorrect grinding wheel type
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Change grinding wheel type \$TC_TPC1
Programm continuation:	Clear alarm with the RESET key. Restart part program
61526	[Channel %1:] Block %2: Workpiece radius = 0
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Enter workpiece radius > 0 .
Programm continuation:	Clear alarm with the RESET key. Restart part program
61527	[Channel %1:] Block %2: Grinding wheel radius is greater than or equal to the workpiece radius
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Change grinding wheel radius or workpiece radius
Programm continuation:	Clear alarm with the RESET key. Restart part program
61529	[Channel %1:] Block %2: Dimensional notation INCH programmed
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Basic system MD \$MN_SCALING_SYSTEM_IS_METRIC does not correspond to programmed G command (G group 13).
Programm continuation:	Clear alarm with the RESET key. Restart part program
61530	[Channel %1:] Block %2: Default longitudinal position incorrect
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check longitudinal position parameter
Programm continuation:	Clear alarm with the RESET key. Restart part program

61531 [Channel %1:] Block %2: Longitudinal position not registered in Z

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Increase infeed path parameter

Programm continuation: Clear alarm with the RESET key. Restart part program

61532 [Channel %1:] Block %2: Value for _LAGE is incorrect

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Correct parameter content for _LAGE

Programm continuation: Clear alarm with the RESET key. Restart part program

61533 [Channel %1:] Block %2: No length L1 entered under D...

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Enter length L1 in the tool offset D of the grinding wheel

Programm continuation: Clear alarm with the RESET key. Restart part program

61540 [Channel %1:] Block %2: Incorrect D number / dresser D field active

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: A tool D number must be programmed that is < _GC_DNUM

Programm continuation: Clear alarm with the RESET key. Restart part program

61541 [Channel %1:] Block %2: Incorrect grinding wheel type entered

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Select a valid grinding wheel type in tool management

Programm continuation: Clear alarm with the RESET key. Restart part program

61542 [Channel %1:] Block %2: Incorrect grinding wheel reference point selected when selecting the dresser coordinate system

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: A tool D number must be programmed that is < _GC_DNUM

Programm continuation: Clear alarm with the RESET key. Restart part program

61543	[Channel %1:] Block %2: Incorrect dresser selected when selecting the dresser coordinate system
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	A dresser number > 0 and < 4 must be selected
Programm continuation:	Clear alarm with the RESET key. Restart part program

61544	[Channel %1:] Block %2: Grinding wheel diameter worn down
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	New grinding wheel required, or check limit values in the grinding wheel data
Programm continuation:	Clear alarm with the RESET key. Restart part program

61545	[Channel %1:] Block %2: Width of grinding wheel worn down
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	New grinding wheel required, or check limit values in the grinding wheel data
Programm continuation:	Clear alarm with the RESET key. Restart part program

61546	[Channel %1:] Block %2: Dresser %4, wear limit length 1 reached
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	New dresser required, or check limit values of dresser
Programm continuation:	Clear alarm with the RESET key. Restart part program

61547	[Channel %1:] Block %2: Dresser %4, wear limit length 2 reached
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	New dresser required, or check limit values of dresser
Programm continuation:	Clear alarm with the RESET key. Restart part program

61548	[Channel %1:] Block %2: Dresser %4, wear limit length 3 reached
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	New dresser required, or check limit values of dresser
Programm continuation:	Clear alarm with the RESET key. Restart part program

61549 [Channel %1:] Block %2: Incorrect dresser type selected

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Check dresser type on input

Programm continuation: Clear alarm with the RESET key. Restart part program

61550 [Channel %1:] Block %2: Swiveling of plane not possible with active grinding tool

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Swiveling of the plane is not possible with an active grinding tool.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Load a milling tool before you swivel the plane.
The alarm can be suppressed using SD 55410 \$SCS_MILL_SWIVEL_ALARM_MASK.

Programm continuation: Clear alarm with the RESET key. Restart part program

61551 [Channel %1:] Block %2: Setting of milling tool not possible with active grinding tool

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Setting of milling tools is not possible with an active grinding tool.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Load a milling tool, before you call positioning.

Programm continuation: Clear alarm with the RESET key. Restart part program

61552 [Channel %1:] Block %2: Alignment of milling tool not possible with active grinding tool

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Alignment of milling tools is not possible with an active grinding tool.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Load a milling tool before you call alignment.

Programm continuation: Clear alarm with the RESET key. Restart part program

61553 [Channel %1:] Block %2: Alignment of grinding tool only possible with active grinding tool

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Alignment of grinding tools is only possible with an active grinding tool.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Load a grinding tool before calling alignment.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61555 [Channel %1:] Block %2: Diameter of grinding wheel ==0, GWPS cannot be calculated

Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check diameter
Programm continuation:	Clear alarm with the RESET key. Restart part program

61556 [Channel %1:] Block %2: Impossible chamfer and radius of left edge of wheel

Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check values in grinding wheel data
Programm continuation:	Clear alarm with the RESET key. Restart part program

61557 [Channel %1:] Block %2: Impossible chamfer and radius of right edge of wheel

Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check values in grinding wheel data
Programm continuation:	Clear alarm with the RESET key. Restart part program

61558 [Channel %1:] Block %2: Chamfer / radius + shoulder height are larger than the retraction height of the left edge of the grinding wheel

Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check values in grinding wheel data
Programm continuation:	Clear alarm with the RESET key. Restart part program

61559 [Channel %1:] Block %2: Chamfer / radius + shoulder height are larger than the retraction height of the right edge of the grinding wheel

Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check values in grinding wheel data
Programm continuation:	Clear alarm with the RESET key. Restart part program

61560 [Channel %1:] Block %2: Infeed in Z direction too big per stroke, or wheel too narrow

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Reduce infeed path parameter or use other tool

Programm continuation: Clear alarm with the RESET key. Restart part program

61561 [Channel %1:] Block %2: Feed left wheel edge is smaller than or equal to zero

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Check values in grinding wheel data

Programm continuation: Clear alarm with the RESET key. Restart part program

61562 [Channel %1:] Block %2: Feed right wheel edge is smaller than or equal to zero

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Check values in grinding wheel data

Programm continuation: Clear alarm with the RESET key. Restart part program

61563 [Channel %1:] Block %2: Feed on the diameter is smaller than or equal to zero

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Check values in grinding wheel data

Programm continuation: Clear alarm with the RESET key. Restart part program

61564 %[[Channel %1:] Block %2: %]Feed insertion is smaller than or equal to zero

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Check values in grinding wheel data

Programm continuation: Clear alarm with the RESET key. Restart part program

61565 [Channel %1:] Block %2: Feed dressing is smaller than or equal to zero

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Remedy: Check values in grinding wheel data

Programm continuation: Clear alarm with the RESET key. Restart part program

61566	[Channel %1:] Block %2: Chamfer / radius is larger than the grinding wheel width
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check values in grinding wheel data
Programm continuation:	Clear alarm with the RESET key. Restart part program
61567	[Channel %1:] Block %2: %4 Total infeed depth and sum of the infeed must have the same sign
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Remedy:	Check the signs of the infeeds
Programm continuation:	Clear alarm with the RESET key. Restart part program
61568	%[[Channel %1:] Block %2: %]Error during form-truing %4
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	-103: Machining not possible -121: Cancellation due to lack of memory
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	-103: Check grinding wheel contour or position of dresser does not match contour -121: Check contour of the grinding wheel and technological data Call the SIEMENS hotline
Programm continuation:	Clear alarm with the RESET key. Restart part program
61569	%[[Channel %1:] Block %2: %]Machining plane different in new profiling and continue profiling
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- The machining plane must be the same for new profiling and continue profiling.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61570	%[[Channel %1:] Block %2: %]Profiling type is different in new profiling and continue profiling
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- The type of profiling (parallel to the axis, parallel to the contour) must be the same for new profiling and continue profiling.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61571 %[[Channel %1:] Block %2: %]Infeed direction is different for new profiling and continue profiling

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- The infeed direction must be the same for new profiling and continue profiling.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61572 %[[Channel %1:] Block %2: %]Grinding wheel is not suitable for continue profiling

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- The same grinding wheel must be used for continue profiling as for new profiling.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61573 %[[Channel %1:] Block %2: %]Edge of grinding wheel is not suitable for continue profiling

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- The same edge of the grinding wheel must be used for continue profiling as for new profiling.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61574 %[[Channel %1:] Block %2: %]Error in contour %4

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	-1: Contour is not continuous

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Check programming of the contour -1: Contour must be continuous in the machining axis
Programm continuation:	Clear alarm with the RESET key. Restart part program

61575 %[[Channel %1:] Block %2: %]G0 blocks in the grinding wheel contour description

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	G0 blocks are included in the grinding wheel contour description.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- G0 blocks may not be included in the contour description. - Check whether approach movements to and retraction movements from the grinding wheel are included in the contour description. If this is the case, remove them.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61576 %[[Channel %1:] Block %2: %]The grinding wheel profile cannot be exactly machined with the active tool

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The grinding wheel profile cannot be exactly machined with the tool angles (clearance and pitch angles) of the active dressing tool. Residual material would be left when using the current tool angles.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Check tool angles (clearance and pitch angles) of the active dressing tool resp. contour. Use another dressing tool.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61577 %[[Channel %1:] Block %2: %]No tool carrier %4 is active

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	- No tool carrier is active
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Activate tool carrier
Programm continuation:	Clear alarm with the RESET key. Restart part program

61578 [Channel %1:] Block %2: B axis kinematics (grinding technology) either not started up or started up incorrectly in swivel cycle - error code: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Remedy: Causes of error:
1. Error code = B789 -> B axis in start-up of swivel cycle (kinematics) not activated
(789 corresponds to \$TC_CARR7[n], n ... number of the swivel data record)

Programm continuation: Clear alarm with the RESET key. Restart part program

61601 [Channel %1:] Block %2: Finished part diameter too small

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Remedy: Check parameter SPD or DIATH.

Programm continuation: Clear alarm with the RESET key. Restart part program

61602 [Channel %1:] Block %2: Tool width incorrectly defined

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Plunge cutter is larger than the programmed groove width.

Remedy: Check tool or change program.

Programm continuation: Clear alarm with the RESET key. Restart part program

61603 [Channel %1:] Block %2: Recess type incorrectly defined

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Radii/chamfers at the groove base do not match the groove width. Face groove on a contour element running parallel to the longitudinal axis is not possible.

Remedy: Check parameter VARI.

Programm continuation: Clear alarm with the RESET key. Restart part program

61604 [Channel %1:] Block %2: Active tool violates programmed contour

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Contour violation in the relief cut elements due to the tool clearance angle of the tool used.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Use a different tool or check the contour subroutine.

Programm continuation: Clear alarm with the RESET key. Restart part program

61605	[Channel %1:] Block %2: Contour incorrectly programmed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Illegal relief cut element detected.
Remedy:	Check contour program.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61606	[Channel %1:] Block %2: Error during contour preparation
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	An error has been found on conditioning the contour. This alarm is always related to one of NCK alarms 10930...10934, 15800 or 15810.
Remedy:	Check contour subroutine.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61607	[Channel %1:] Block %2: Starting point incorrectly programmed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The starting point reached before the cycle call does not lie outside the rectangle described by the contour subroutine.
Remedy:	Check starting point prior to cycle call.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61608	[Channel %1:] Block %2: Incorrect tool point direction programmed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	A cutting edge position 1...4, matching the undercut form, must be programmed.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61609	[Channel %1:] Block %2: Shape incorrectly defined
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Remedy:	Check parameter for the undercut form or groove form or pocket.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61610	[Channel %1:] Block %2: No infeed depth programmed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Remedy:	Check parameter MID.

Programm continuation: Clear alarm with the RESET key. Restart part program

61611 [Channel %1:] Block %2: No point of intersection found

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: No intersection could be calculated with the contour.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check contour programming or modify infeed depth.

Programm continuation: Clear alarm with the RESET key. Restart part program

61612 [Channel %1:] Block %2: Synchronized thread machining not possible

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Remedy: Check the preconditions for synchronized thread machining:
- It is not permissible that a toolholder is active.
- It is not permissible that transformation is active.
- It is not permissible that rotation is active.
If required, deselect thread synchronization.

61613 [Channel %1:] Block %2: Undercut position incorrectly defined

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check value in parameter _VARI.

Programm continuation: Clear alarm with the RESET key. Restart part program

61614 [Channel %1:] Block %2: %4Z mirroring in work offset for main spindle not permitted

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The work offset for main spindle machining must not have mirroring in the specified axis.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Deselect mirroring in the specified axis in the work offset used.

Programm continuation: Clear alarm with the RESET key. Restart part program

61615 [Channel %1:] Block %2: %4- Mirroring in the work offset is not permitted for the counterspindle

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The work offset for counterspindle machining must not have any Z mirroring.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Deselect Z mirroring in the WO used.

Programm continuation: Clear alarm with the RESET key. Restart part program

61616 [Channel %1:] Block %2: Current cutting edge position %4 impermissible

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Cutting edge positions 1 to 4 are permissible for corner stock removal.

Programm continuation: Clear alarm with the RESET key. Restart part program

61617 [Channel %1:] Block %2: Maximum spindle speed for the main spindle not entered

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The maximum spindle speed for the main spindle was not entered.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Enter the maximum spindle speed for the main spindle.

Programm continuation: Clear alarm with the RESET key. Restart part program

61618 [Channel %1:] Block %2: Main spindle has not been set up

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: A main spindle has not been set up.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Please check the following machine or setting data:
MD 20070 \$MC_AXCONF_MACHAX_USED[]
MD 20080 \$MC_AXCONF_CHANAX_NAME_TAB[]
MD 35000 \$MA_SPIND_ASSIGN_TO_MACHAX[]
MD 52206 \$MCS_AXIS_USAGE[]

Programm continuation: Clear alarm with the RESET key. Restart part program

61619 [Channel %1:] Block %2: Main spindle has not been correctly set up

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The main spindle has not been correctly set up.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Please check the following machine or setting data:
MD 20070 \$MC_AXCONF_MACHAX_USED[]
MD 20080 \$MC_AXCONF_CHANAX_NAME_TAB[]
MD 35000 \$MA_SPIND_ASSIGN_TO_MACHAX[]
MD 52206 \$MCS_AXIS_USAGE[]
MD 52207 \$MCS_AXIS_USAGE_ATTRIB bit 8

Programm continuation: Clear alarm with the RESET key. Restart part program

61620 [Channel %1:] Block %2: %4-Mirroring for the linear axis of the counter spindle not permitted

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: It is not permissible that the linear axis of the counterspindle machining has Z mirroring.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Deselect Z mirroring in the WO used.

Programm continuation: Clear alarm with the RESET key. Restart part program

61621 [Channel %1:] Block %2: Angle of opening of the convex thread too high

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Convexity of the thread is too high.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: - Check parameter XS or RS

Programm continuation: Clear alarm with the RESET key. Restart part program

61622 [Channel %1:] Block %2: Toolcarrier for turning not set up

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: A toolcarrier was not set up for turning.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Set up a tool with carrier with the rotary axes: B axis and tool spindle. Set the identifier "B axis kinematics".
Programm continuation:	Clear alarm with the RESET key. Restart part program

61623 [Channel %1:] Block %2: A toolcarrier has not been set up for milling on the main spindle

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A toolcarrier has not been setup for a milling on the main spindle.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Set up a toolcarrier with rotary axes: B axis and main spindle. Do not set the identifier "B axis kinematics".
Programm continuation:	Clear alarm with the RESET key. Restart part program

61624 [Channel %1:] Block %2: A toolcarrier has not been set up for milling on the counterspindle

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	A toolcarrier has not been set up for milling on the counterspindle.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Set up a toolcarrier with the rotary axes: B axis and counterspindle. Do not set the identifier "B axis kinematics".
Programm continuation:	Clear alarm with the RESET key. Restart part program

61625 [Channel %1:] Block %2: Programmed angular value is not in the grid of the Hirth tooth system: %4

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	An angular value that is not in the grid of the Hirth tooth system was programmed.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Program an angular value that is in the grid of the Hirth tooth system.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61626 [Channel %1:] Block %2: With the programmed angular values, the tool tip is not located in the turning plane %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Angular values were programmed where the tool tip is not located in the turning plane.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Program suitable angular values or use the programming based on "Beta" and "Gamma".

Programm continuation: Clear alarm with the RESET key. Restart part program

61627 [Channel %1:] Block %2: Rotation of the turning tool not possible as the tool holder for turning tools is fixed.

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Rotation of the turning tool not possible as the tool holder for turning tools is fixed.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Select Use "fixed"

Programm continuation: Clear alarm with the RESET key. Restart part program

61628 [Channel %1:] Block %2: Swivel plane not possible %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Swivel plane is not possible

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: \$TC_DPV[n,m]<>0 : A tool with the specified orientation must be defined for the CYCLE800 by the orientation vectors \$TC_DPV3,\$TC_DPV4 and \$TC_DPV5. A definition by \$TC_DPV only is not supported by CYCLE800. For a definition by means of vectors, MD 18114 \$MN_MM_ENABLE_TOOL_ORIENT must = 2.

Programm continuation: Clear alarm with the RESET key. Restart part program

61695 %[[Channel %1:] Block %2: %]Parameter R123 incorrectly programmed

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: - Check parameter R123

Programm continuation: Clear alarm with the RESET key. Restart part program

61696 %[[Channel %1:] Block %2: %]Parameter R122 too high

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check parameter R122

Programm continuation: Clear alarm with the RESET key. Restart part program

61697 %[[Channel %1:] Block %2: %]Parameter R122 too low

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check parameter R122

Programm continuation: Clear alarm with the RESET key. Restart part program

61698 %[[Channel %1:] Block %2: %]Parameter R122 has incorrect sign

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check parameter R122

Programm continuation: Clear alarm with the RESET key. Restart part program

61699 %[[Channel %1:] Block %2: %]Parameter R121 has incorrect sign

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check parameter R121

Programm continuation: Clear alarm with the RESET key. Restart part program

61700 %[[Channel %1:] Block %2: %]Name of program to be generated is missing

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check parameter PRG

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61701 %[[Channel %1:] Block %2: %]Contour %4 does not exist

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check parameter CON
 - Check contour call
 - Check whether the contours exist in the program storage (workpieces, subroutines or part programs)

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61702 %[[Channel %1:] Block %2: %]Label %4 not existing in machined part contour

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check whether the labels exist in the machined part contour

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61703 %[[Channel %1:] Block %2: %]Label %4 not existing in the blank contour

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check whether the labels exist in the blank contour

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61704 %[[Channel %1:] Block %2: %]Machined part contour missing

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check contour call (CYCLE62)

Programm continuation: Clear alarm with the RESET key. Restart part program

61705 %[[Channel %1:] Block %2: %]Blank contour missing

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check contour call

Programm continuation: Clear alarm with the RESET key. Restart part program

61706 %[[Channel %1:] Block %2: %]Error in machined part contour %4

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check programming of machined part contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61707 %[[Channel %1:] Block %2: %]Error in the blank contour %4

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check programming of the blank contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61708 %[[Channel %1:] Block %2: %]Too many contours specified

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check number of contours
 - Max. two contours (machined part and blank contours)
 - Min. one contour (machined part contour)

Programm continuation: Clear alarm with the RESET key. Restart part program

61709 %[[Channel %1:] Block %2: %]Cutting edge radius too small

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check cutting edge radius of the tool in tool management

Programm continuation: Clear alarm with the RESET key. Restart part program

61710 %[[Channel %1:] Block %2: %]Calculation has been canceled

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Calculation has been canceled by PI service; please try again

Programm continuation: Clear alarm with the RESET key. Restart part program

61711 %[[Channel %1:] Block %2: %]Infeed D is larger than the tip width of the tool

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check infeed D in connection with the tip width of the tool in tool management.

Programm continuation: Clear alarm with the RESET key. Restart part program

61712 %[[Channel %1:] Block %2: %]Infeed DX or DZ is larger than tip length of tool

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check infeed DX or DZ in connection with tip length of the tool in tool management.

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61713 %[[Channel %1:] Block %2: %]Tool radius larger than half the tip width

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check tool radius and tip width of tool (plunge cutter, cutting tool)

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61714 %[[Channel %1:] Block %2: %]Error during contour turning %4

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: -103: Machining not possible
 -121: Cancellation due to lack of memory

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: -103: Check contour or the position of the tool does not match the contour
 -121: Check contour and technological data
 Call the SIEMENS hotline

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61730 %[[Channel %1:] Block %2: %]Machining range outside delimitation

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check machining range and delimitation

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61731 %[[Channel %1:] Block %2: %]Unable to determine contour direction

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check contours
 - Check whether the contour starting point exists

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61732 %[[Channel %1:] Block %2: %]No material available for machining

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check programming of the blank and machined part contour, particularly their position towards each other

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61733 %[[channel %1:] block %2: %]Cutting edge not compatible with machining direction

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check programmed machining direction in connection with cutting edge position of the tool

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61734 %[[Channel %1:] Block %2: %]Machined part contour is outside the blank contour

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Check the programming of the machined part and blank contour, particularly their position in relation to each other

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61735	%[[Channel %1:] Block %2: %]Infeed D larger than the tip length of the tool
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Check infeed D in relation to the tip length of the tool in tool management
Programm continuation:	Clear alarm with the RESET key. Restart part program
61736	%[[Channel %1:] Block %2: %]Cutting depth greater than maximum depth of cut of the tool
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	--
Programm continuation:	Clear alarm with the RESET key. Restart part program
61737	%[[Channel %1:] Block %2: %]Cutting depth smaller than minimum depth of cut of the tool
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	--
Programm continuation:	Clear alarm with the RESET key. Restart part program
61738	%[[Channel %1:] Block %2: %]Incorrect cutting edge position
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Check cutting edge position in tool management
Programm continuation:	Clear alarm with the RESET key. Restart part program

61739 %[[Channel %1:] Block %2: %]Blank must be closed contour

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check whether the blank contour is closed

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61740 %[[Channel %1:] Block %2: %]Collision through approach

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Select the starting position to enable collision-free approach of the contour

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61741 %[[Channel %1:] Block %2: %]Axis in negative range

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check the position of the axis in the ordinate

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61742 %[[Channel %1:] Block %2: %]Retraction plane %4 is within the machining range

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: For internal machining, check the machining range in relation to the entered retraction distance (SD 55506 \$SCS_TURN_ROUGH_I_RELEASE_DIST).

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61743 %[[channel %1:] block %2: %]Guide channel for two-channel cutting missing

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check if a guide channel has been defined

Programm continuation: Clear alarm with the RESET key. Restart part program

61744 %[[channel %1:] block %2: %]Following channel for two-channel cutting missing

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check if a following channel has been defined

Programm continuation: Clear alarm with the RESET key. Restart part program

61745 %[[channel %1:] block %2: %]Two-channel cutting in two guide channels (%4) active

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check if two guide channels are active
 - Check if two-channel cutting is active simultaneously in more than two channels
 - Two channels only may be active: a guide and a following channel

Programm continuation: Clear alarm with the RESET key. Restart part program

61746 %[[channel %1:] block %2: %]Two-channel cutting active already in the channels (%4)

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check if two-channel cutting is active simultaneously in more than two channels.
 - Two channels only may be active simultaneously: a guide and a following channel.

Programm continuation: Clear alarm with the RESET key. Restart part program

61747 %[[channel %1:] block %2: %]Incorrect guide channel for two-channel cutting (%4)

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check if the program of the guide channel runs in the channel selected via the program of the following channel in parameter partner channel.

Programm continuation: Clear alarm with the RESET key. Restart part program

61748 %[[channel %1:] block %2: %]Machining plane different in guide and following channel

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Machining plane must be the same in guide and following channel.

Programm continuation: Clear alarm with the RESET key. Restart part program

61749 %[[channel %1:] block %2: %]Technology different in guide and following channel

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Technology (cutting / residual, plunge-cutting / residual, plunge-turning / residual) must be the same in guide and following channel.

Programm continuation: Clear alarm with the RESET key. Restart part program

61750 %[[channel %1:] block %2: %]Machining different in guide and following channel

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Machining (rough cutting / finish cutting) must not be different in guide and following channel.

Programm continuation: Clear alarm with the RESET key. Restart part program

61751	%[[Channel %1:] Block %2: %]The dimension system is different in the leading and following channels
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Dimension system (G group: 13 (G70, G71, G700, G710)) must be the same in both the leading and following channels.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61752	%[[Channel %1:] Block %2: %]Cutting edge positions or cutting directions of the tools are different
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Cutting edge position and cutting direction of the tools must be the same in guide and following channel.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61753	%[[channel %1:] block %2: %]Difference in tool radii too large
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Tool radii may not be greater than the finishing allowance at maximum for rough cutting.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61754	%[[channel %1:] block %2: %]Tool radii must have same size for rough cutting
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Check if tool radii have the same size in guide and following channel.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61755	%[[channel %1:] block %2: %]Plate widths are different
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Check if plate widths of recessing tools are the same size in guide and following channel.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61756	%[[Channel %1:] Block %2: %]Multichannel machining not possible because of collision of the tools.
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Multichannel machining with the programmed parameters would lead to a collision of the tools.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Adjust parameter (DCH offset) so that mutichannel machining is possible, or use single-channel machining.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61757	%[[Channel %1:] Block %2: %]The finished part lies outside the specified grooving limits.
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The finished part lies outside the specified grooving limits.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Check the position of the finished part contour in respect of grooving limits XDA and XDB
Programm continuation:	Clear alarm with the RESET key. Restart part program
61758	%[[Channel %1:] Block %2: %]Master spindle machine axes different in leading and following channels.
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The machine axis references of the master spindle are different in the leading and following channels.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Check machine data 35000 \$MA_SPIND_ASSIGN_TO_MACHAX, 30550 \$MA_AXCONF_ASSIGN_MASTER_CHAN, 20090 \$MC_SPIND_DEF_MASTER_SPIND and 20070 \$MC_AXCONF_MACHAX_USED
Programm continuation:	Clear alarm with the RESET key. Restart part program

61759	%[[Channel %1:] Block %2: %]Position of following channel violates software limit switch
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In the case of dual-channel stock removal with Balance Cutting machining (finishing or roughing with parameter DCH=0), the tool position from the leading channel from CYCLE952 is approached before the axis coupling is switched on in the following channel. In the actual case, the tool position from the leading channel violates the software limit switch in the following channel.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	A position must be approached in the leading channel, which can also be approached in the following channel without violating the software limit switch.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61800	[Channel %1:] Block %2: Ext. CNC system missing
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Machine data for external language MD18800: \$MN_MM_EXTERN_LANGUAGE or option bit 19800 \$ON_EXTERN_LANGUAGE is not set.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	--
Programm continuation:	Clear alarm with the RESET key. Restart part program
61801	[Channel %1:] Block %2: Wrong G code selected
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	In the program call CYCLE300<value> an impermissible numerical value was programmed for the entered CNC system, or in the cycles setting data an incorrect value for the G code system was set.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	--
Programm continuation:	Clear alarm with the RESET key. Restart part program
61802	[Channel %1:] Block %2: Wrong axis type
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The programmed axis is assigned to a spindle
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	--

Programm continuation: Clear alarm with the RESET key. Restart part program

61803 [Channel %1:] Block %2: Programmed axis not available

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The programmed axis is not in the system.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check parameter _AXN.
Check machine data 20050 to 20080.

Programm continuation: Clear alarm with the RESET key. Restart part program

61804 [Channel %1:] Block %2: Progr. position exceeds reference point

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The programmed intermediate position or actual position is behind the reference point.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: --

Programm continuation: Clear alarm with the RESET key. Restart part program

61805 [Channel %1:] Block %2: Value programmed absolute and incremental

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The programmed intermediate position is both absolutely as well as incrementally programmed.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: --

Programm continuation: Clear alarm with the RESET key. Restart part program

61806 [Channel %1:] Block %2: Wrong axis assignment

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The axis-assignment sequence is wrong.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: --

Programm continuation: Clear alarm with the RESET key. Restart part program

61807 [Channel %1:] Block %2: Wrong spindle direction programmed (active)

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The programmed spindle direction contradicts the spindle direction planned for the cycle.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check parameters SDR and SDAC.

Programm continuation: Clear alarm with the RESET key. Restart part program

61808 [Channel %1:] Block %2: Final drilling depth or single drilling depth missing

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The total depth Z or individual drilling depth Q is missing from the G8xblock (initial cycle call).

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: --

Programm continuation: Clear alarm with the RESET key. Restart part program

61809 [Channel %1:] Block %2: Drill position not permissible

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: --

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: --

Programm continuation: Clear alarm with the RESET key. Restart part program

61810 [Channel %1:] Block %2: ISO G code not possible

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: In the call block an impermissible ISO axis name was programmed.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: --

Programm continuation: Clear alarm with the RESET key. Restart part program

61811 [Channel %1:] Block %2: ISO axis name illegal

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: In the call block an impermissible numerical value was programmed.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: --

Programm continuation: Clear alarm with the RESET key. Restart part program

61812 [Channel %1:] Block %2: Value(s) in external cycle call wrongly defined

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: In the call block an impermissible numerical value was programmed.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: --

Programm continuation: Clear alarm with the RESET key. Restart part program

61813 [Channel %1:] Block %2: GUD value wrongly defined

Explanation: An impermissible numerical value was entered in the cycles-setting data.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: --

Programm continuation: Clear alarm with the RESET key. Restart part program

61814 [Channel %1:] Block %2: Polar coordinates not possible with cycle

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: --

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: --

Programm continuation: Clear alarm with the RESET key. Restart part program

61815 [Channel %1:] Block %2: G40 not active

Parameters: %1 = Channel number
%2 = Block number

Explanation:	G40 was inactive before the cycle call.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	--
Programm continuation:	Clear alarm with the RESET key. Restart part program

61816 [Channel %1:] Block %2: Axes not on reference point

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	--
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	--
Programm continuation:	Clear alarm with the RESET key. Restart part program

61817 [Channel %1:] Block %2: Axis coordinates within protection area

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	--
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	--
Programm continuation:	Clear alarm with the RESET key. Restart part program

61818 [Channel %1:] Block %2: Axis range limits are equal

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	--
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	--
Programm continuation:	Clear alarm with the RESET key. Restart part program

61819 [Channel %1:] Block %2: Risk of collision on retraction: tool violates programmed contour

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	With G70 in ISO mode, the contour is violated during retraction to the starting point.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Insert a G1 block at the end of the contour at the height of the starting point.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61836 [Channel %1:] Block %2 wrong axis identifier %4

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The programmed axis identifiers do not match the identifiers in the source program.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Correct incorrect axis identifier.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61837 [Channel %1:] Block %2 syntax error in the program %4

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Check the program for syntax errors.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Correct syntax errors.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61838 [Channel %1:] Block %2: Data format of the program %4 is incorrect

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Check the data format of the program.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Correct data format.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61839 [Channel %1:] Block %2: Application does not run

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Ensure that the application runs.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Restart part program.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61840 [Channel %1:] Block %2: Error on execution of automatic servo tuning

Parameters:	%1 = Channel number %2 = Block number, label %3 = Acknowledgment mode %4 = MMC sequence number
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	
Programm continuation:	Clear alarm with the RESET key. Restart part program

61841 [Channel %1:] Block %2: Necessary GUD for automatic servo tuning is missing: %3

Parameters:	%1 = Channel number %2 = Block number, label %3 = Missing GUD
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	
Programm continuation:	Clear alarm with the RESET key. Restart part program

61842 [Channel %1:] Block %2: Calling a cycle of the automatic servo tuning is not permissible: %3

Parameters:	%1 = Channel number %2 = Block number, label %3 = Caller
Explanation:	Calling CYCLE75x is not permissible because it is called by a cycle from the standard or manufacturer cycle directory.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	You need the manufacturer password to call CYCLE75x.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61850 [channel %1:] block %2: cylinder surface transformation not released

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Cylinder surface transformation not released for ShopMill.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61851 [channel %1:] block %2: no suitable transformation set up: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The required transformation is not set up on this machine.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61852 [channel %1:] block %2: transformation not set up for this plane: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Transformation not set up for the plane used. Change plane.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61853 [channel %1:] block %2: incorrect plane for machining with rotary axis: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Machining cannot be executed on the rotary axis of the current plane. Change plane.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61854 [Channel %1:] Block %2: Subprogram level too low for block search

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The subprogram level is too low for block search.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Execute block search with another block.

Programm continuation: Clear alarm with the RESET key. Restart part program

61855 [Channel %1:] Block %2: Target point lies in the retraction area

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The specified target point lies in the retraction area.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Change target point or retraction area.

Programm continuation: Clear alarm with the RESET key. Restart part program

61856 [Channel %1:] Block %2: Absolute input of the work offset values not enabled

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The absolute input of the work offset value has not been enabled.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: 52212 \$MCS_FUNCTION_MASK_Tech Bit 6: work offset value WO cannot be entered as absolute value (ShopTurn).

Programm continuation: Clear alarm with the RESET key. Restart part program

61857 [Channel %1:] Block %2: No rotary axis to accept a blank has been set up

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: No rotary axis to accept a blank has been set up.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check machine data 52207 \$MCS_AXIS_USAGE_ATTRIB Bit 8.

Programm continuation: Clear alarm with the RESET key. Restart part program

61858 [Channel %1:] Block %2: Turning is only possible with a blank that is clamped, centered

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Turning is only possible with a blank that is clamped, centered.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Use a blank that is clamped so that it is centered.

Programm continuation: Clear alarm with the RESET key. Restart part program

61859 [Channel %1:] Block %2: Turning has not been enabled

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Turning has not been set up on the machine.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check machine data: 52201 \$MCS_TECHNOLOGY_EXTENSION=1 (turning).

Programm continuation: Clear alarm with the RESET key. Restart part program

61860 [Channel %1:] Block %2: Turning only possible on a main spindle

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: For turning, a main spindle was not selected for clamping.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Select a main spindle as clamping for turning.

Programm continuation: Clear alarm with the RESET key. Restart part program

61861 [Channel %1:] Block %2: Tailstock not selected in this channel

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The tailstock was selected in another channel, but not in this channel.
The different selection/deselection results in a conflict.
When the tailstock is selected, it is not permissible that the counterspindle is positioned.
However, when the tailstock is deselected, the counterspindle should be positioned.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Select or deselect the tailstock consistently in all channels.

Programm continuation: Clear alarm with the RESET key. Restart part program

61862	[Channel %1:] Block %2: It is not permissible to call a ShopTurn cycle in a ShopMill program
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	An attempt was made to call a ShopTurn cycle in a ShopMill program.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Delete block.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61863	[Channel %1:] Block %2: It is not permissible to call a ShopMill cycle in a ShopTurn program
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	An attempt was made to call a ShopMill cycle in a ShopTurn program.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Delete block.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61864	[Channel %1:] Block %2: The selection, tailstock yes/no must be identical in all channels
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The selection, tailstock yes/no in the program header must be identical in all channels.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	For tailstock yes/no in the program header, make the same selection for all channels.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61865	[Channel %1:] Block %2: Calling a ShopTurn cycle is only permissible in a ShopTurn program
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	It is not permissible that a ShopTurn cycle is used outside a ShopTurn program, as the required environment variables are otherwise not assigned.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Calling a ShopTurn cycle in a ShopTurn program. If this is not possible, then the task must be programmed using G code.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61866	[Channel %1:] Block %2: It is only permissible to call a ShopMill cycle in a ShopMill program
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	It is not permissible that a ShopMill cycle is used outside a ShopMill program, as the required environment variables are otherwise not assigned.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Calling a ShopMill cycle in a ShopMill program. If this is not possible, then the task must be programmed using G code.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61867	[Channel %1:] Block %2: On face C, the retraction distance must not be larger than the distance to the center point.
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Retraction distance too large. On face C, the retraction distance must not be larger than the distance to the center point. Otherwise, retraction would become negative, which would lead to a reversal of the work spindle.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Use a smaller retraction distance or face Y if possible.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61868	[Channel %1:] Block %2: Program was created on another machine and must be adjusted.
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The program was created on another machine and contains program parts that can not be executed on this machine.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	The program must be adjusted in the ShopMill/ShopTurn editor.
Programm continuation:	Clear alarm with the RESET key. Restart part program
61869	[Channel %1:] Block %2: Block search is only possible with calculation
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	With ShopMill and ShopTurn, block search is only possible with calculation.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Use a different block search mode.
Programm continuation:	Clear alarm with the RESET key. Restart part program

61870 [Channel %1:] Block %2: Danger of collision during automatic retraction. Retract tool manually!

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: There is a danger of collision during automatic retraction.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Retract tool manually!

Programm continuation: Clear alarm with the RESET key. Restart part program

61900 %[[Channel %1:] Block %2: %]Name of program to be generated is missing

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: - Check parameter PRG

Programm continuation: Clear alarm with the RESET key. Restart part program

61901 %[[Channel %1:] Block %2: %]Contour %4 does not exist

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: - Check contour call
- Check whether the contours exist in the program storage (workpieces, subroutines or part programs)

Programm continuation: Clear alarm with the RESET key. Restart part program

61902 %[[Channel %1:] Block %2: %]Label %4 not existing in the pocket contour

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: - Check whether the labels exist in the pocket contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61903 %[[Channel %1:] Block %2: %]Label %4 not existing in the blank contour

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check whether the labels exist in the blank contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61904 %[[Channel %1:] Block %2: %]Label %4 not existing in the island contour

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check whether the labels exist in the island contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61905 %[[Channel %1:] Block %2: %]Label %4 not existing in the spigot contour

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check whether the labels exist in the spigot contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61906 %[[Channel %1:] Block %2: %]Label %4 not existing in the contour

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check whether the labels exist in the contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61907 %[[Channel %1:] Block %2: %]Pocket contour missing

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check contour call

Programm continuation: Clear alarm with the RESET key. Restart part program

61908 %[[Channel %1:] Block %2: %]Blank contour missing

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check contour call

Programm continuation: Clear alarm with the RESET key. Restart part program

61909 %[[Channel %1:] Block %2: %]Error in pocket contour %4

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check programming of the pocket contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61910 %[[Channel %1:] Block %2: %]Error in the blank contour %4

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check programming of the blank contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61911 %[[Channel %1:] Block %2: %]Error in island contour %4

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check programming of the island contour
 - Check whether the island contour is closed
 - Check the contour for self-cuts

Programm continuation: Clear alarm with the RESET key. Restart part program

61912 %[[Channel %1:] Block %2: %]Error in spigot contour %4

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check programming of the spigot contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61913 %[[Channel %1:] Block %2: %]Error in contour %4

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check programming of the contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61914 %[[Channel %1:] Block %2: %]Too many contours specified

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check the number of contours

Programm continuation: Clear alarm with the RESET key. Restart part program

61915	%[[Channel %1:] Block %2: %]Cutter radius too small
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Check the radius of the milling cutter in tool management
Programm continuation:	Clear alarm with the RESET key. Restart part program
61916	%[[Channel %1:] Block %2: %]Calculation has been canceled
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Calculation has been canceled by PI service; please try again
Programm continuation:	Clear alarm with the RESET key. Restart part program
61917	%[[Channel %1:] Block %2: %]Combination of centering/predrilling and spigot not allowed
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Machining of spigot in conjunction with predrilling/centering not allowed!
Programm continuation:	Clear alarm with the RESET key. Restart part program
61918	%[[Channel %1:] Block %2: %]Cut. radius for residual mach. must be smaller than cut. radius for ref. tool
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Check cutter radius for residual machining which must be smaller than cutter radius for reference tool !
Programm continuation:	Clear alarm with the RESET key. Restart part program

61919 %[[Channel %1:] block %2: %]Radius of the reference tool is too small

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check the radius of the reference tool.

Programm continuation: Clear alarm with the RESET key. Restart part program

61920 %[[Channel %1:] Block %2: %]Error during contour milling %4

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: 3020: No more memory is available
 3022: The contour is incorrect
 3023: Check contour (contour may contain too small elements)
 3356: The residual material cannot be removed completely with the tool used.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: 3020, 3022, and 3023: Check contour and technological data
 3356: A tool with a smaller diameter, with which the residual material can be removed completely, must be used for residual machining.
 Call the SIEMENS hotline

Programm continuation: Clear alarm with the RESET key. Restart part program

61921 %[[Channel %1:] Block %2: %]Error during groove milling %4

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy:

Programm continuation: Clear alarm with the RESET key. Restart part program

61922 %[[Channel %1:] Block %2: %]Label %4 not present in the groove contour

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check whether the labels are present in the groove contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61923 %[[Channel %1:] Block %2: %]Error in the groove contour %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: - Check the programming of the groove contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61924 %[[Channel %1:] Block %2: %]Groove contour missing

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: - Check contour call

Programm continuation: Clear alarm with the RESET key. Restart part program

61925 %[[Channel %1:] Block %2: %]Communication failure between cycle and application

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Local variables that are used for communication between cycle and spiral algorithm could not be read.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check the cycle and app versions, they must be identical.

Programm continuation: Clear alarm with the RESET key. Restart part program

61926 %[[Channel %1:] Block %2: %]Program %4 could not be copied

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Local variables that are used for communication between cycle and spiral algorithm could not be read.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check the cycle and app versions, they must be identical.
Programm continuation: Clear alarm with the RESET key. Restart part program

61927 %[[Channel %1:] Block %2: %]Corner radius %4 too small

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The minimum corner radius is too small.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Increase the corner radius or use a smaller tool.
Programm continuation: Clear alarm with the RESET key. Restart part program

61928 %[[Channel %1:] Block %2: %]First contour element too short for corner radius %4

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The first contour element is too short for the corner radius.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Lengthen the contour element or reduce the corner radius.
Programm continuation: Clear alarm with the RESET key. Restart part program

61929 %[[Channel %1:] Block %2: %]Last contour element too short for corner radius %4

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The last contour element is too short for the corner radius.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Lengthen the contour element or reduce the corner radius.
Programm continuation: Clear alarm with the RESET key. Restart part program

61930 %[[Channel %1:] Block %2: %]No contour available

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy:

- Check contour call
- Check whether the contours exist in the program storage (workpieces, subroutines or part programs)

Programm continuation: Clear alarm with the RESET key. Restart part program

61931 %[[Channel %1:] Block %2: %]Contour not closed

Parameters:

- %1 = Channel number
- %2 = Block number, label

Explanation:

Reaction:

- Interpreter stop
- NC Start disable in this channel.
- Interface signals are set.
- Alarm display.

Remedy:

- Check whether the contours are closed

Programm continuation: Clear alarm with the RESET key. Restart part program

61932 %[[Channel %1:] Block %2: %]Selfcutting contour

Parameters:

- %1 = Channel number
- %2 = Block number, label

Explanation:

Reaction:

- Interpreter stop
- NC Start disable in this channel.
- Interface signals are set.
- Alarm display.

Remedy:

- Modify contour programming

Programm continuation: Clear alarm with the RESET key. Restart part program

61933 %[[Channel %1:] Block %2: %]Too many contour elements

Parameters:

- %1 = Channel number
- %2 = Block number, label

Explanation:

Reaction:

- Interpreter stop
- NC Start disable in this channel.
- Interface signals are set.
- Alarm display.

Remedy:

- Modify contour programming and thereby try to reduce the number of contour elements

Programm continuation: Clear alarm with the RESET key. Restart part program

61934 %[[Channel %1:] Block %2: %]Programming of the machining plane not allowed here

Parameters:

- %1 = Channel number
- %2 = Block number, label

Explanation:

Reaction:

- Interpreter stop
- NC Start disable in this channel.
- Interface signals are set.
- Alarm display.

Remedy: - Modify contour programming
Programm continuation: Clear alarm with the RESET key. Restart part program

61935 **%[[Channel %1:] Block %2: %]Programming of inch/metric measuring system not allowed here**

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Modify contour programming
Programm continuation: Clear alarm with the RESET key. Restart part program

61936 **%[[Channel %1:] Block %2: %]G0 is not allowed in contour programming**

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Modify contour programming, replace G0 by G1
Programm continuation: Clear alarm with the RESET key. Restart part program

61937 **%[[Channel %1:] Block %2: %]Pocket depth programmed incorrectly**

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check parameter Z1
Programm continuation: Clear alarm with the RESET key. Restart part program

61938 **%[[Channel %1:] Block %2: %]No starting point specified**

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy:	- Check parameter for specified starting point, - for G17: XS, YS - for G18: ZS, XS - for G19: YS, ZS
Programm continuation:	Clear alarm with the RESET key. Restart part program

61939 %[[Channel %1:] Block %2: %]No center point specified for circle

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Check contour programming, particularly circle programming
Programm continuation:	Clear alarm with the RESET key. Restart part program

61940 %[[Channel %1:] Block %2: %]Specified starting point programmed incorrectly

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Correct specified starting point
Programm continuation:	Clear alarm with the RESET key. Restart part program

61941 %[[Channel %1:] Block %2: %]Helix radius too small

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Increase helix radius
Programm continuation:	Clear alarm with the RESET key. Restart part program

61942 %[[Channel %1:] Block %2: %]Helix violates contour

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: - Check helix radius and reduce in size, if possible

Programm continuation: Clear alarm with the RESET key. Restart part program

61943 %[[Channel %1:] Block %2: %]Approach/retract motion violates contour

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: - Reduce safety clearance SC, if possible

Programm continuation: Clear alarm with the RESET key. Restart part program

61944 %[[Channel %1:] Block %2: %]Ramp path too short

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: During oscillating insertion, the message "Ramp path too short" occurs if the tool moves less than the mill diameter away from the insertion point on the ramp path or the machining depth is not reached.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: - Reduce the insertion angle if the tool remains too near to the insertion point
- Enlarge insertion angle if the tool does not reach the machining depth
- Use tool with smaller radius
- Use another insertion mode

Programm continuation: Clear alarm with the RESET key. Restart part program

61945 %[[Channel %1:] Block %2: %]Plane infeed too large, residual corners remaining

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: - Check parameter for plane infeed
- for G17: DXY
- for G18: DZX
- for G19: DYZ

Programm continuation: Clear alarm with the RESET key. Restart part program

61946 %[[Channel %1:] Block %2: %]Island contour existing twice

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Delete double island contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61947 %[[Channel %1:] Block %2: %]Spigot contour existing twice

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Delete double spigot contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61948 %[[Channel %1:] Block %2: %]No material available for machining

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check programming of the contours

Programm continuation: Clear alarm with the RESET key. Restart part program

61949 %[[Channel %1:] Block %2: %]Island is outside the pocket

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Check programming of the island/pocket contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61950 %[[Channel %1:] Block %2: %]No residual material available

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: --

Programm continuation: Clear alarm with the RESET key. Restart part program

61951 %[[Channel %1:] Block %2: %]Cutter radius for residual material too large

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Use cutter with smaller radius

Programm continuation: Clear alarm with the RESET key. Restart part program

61952 %[[Channel %1:] Block %2: %]Radius of res. material cutter too small in relation to ref. cutter

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Use a cutter with a larger radius for residual machining

Programm continuation: Clear alarm with the RESET key. Restart part program

61953 %[[Channel %1:] Block %2: %]Technology change to preprocessing not possible

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: - Technology of the current machining does not match the technology of the preprocessing

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: - Adapt the technology of the current machining to the technology of the preprocessing

Programm continuation: Clear alarm with the RESET key. Restart part program

61954	%[[Channel %1:] Block %2: %]Active and programmed tools are different
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	- Active and programmed tools are different
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Check active and programmed tools
Programm continuation:	Clear alarm with the RESET key. Restart part program
61955	%[[Channel %1:] Block %2: %]Internal memory limit reached for contour calculation
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	- The internal memory is insufficient to calculate the contour.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Check the following parameters/possibilities: - The angle of contact can be increased - A tool with a larger diameter can be used - Can be reset in setting data \$SCS_FUNCTION_MASK_MILL_SET bit3
Programm continuation:	Clear alarm with the RESET key. Restart part program
61956	%[[Channel %1:] Block %2: %]Active tool radius must be less than or equal to the radius of the reference tool
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Check the active tool radius, this must be less than or equal to the radius of the reference tool
Programm continuation:	Clear alarm with the RESET key. Restart part program
61957	%[[Channel %1:] Block %2: %]Straight contour finish not possible
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The programmed finish contour is not possible because of the length of the last contour element.
Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Adapt contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61958 %[[Channel %1:] Block %2: %]Straight contour element too short

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The straight contour element is too short.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check and adapt contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61959 %[[Channel %1:] Block %2: %]Contour elements overlap

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: Elements of the contour overlap.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Eliminate the contour overlaps.

Programm continuation: Clear alarm with the RESET key. Restart part program

61960 %[[Channel %1:] Block %2: %]Contour radius too small

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The contour radius is too small for the desired slot width.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check validity of contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61961 %[[Channel %1:] Block %2: %]Circular contour element too short

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: The circular contour element is too short.

Reaction: Interpreter stop
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy: Check contour

Programm continuation: Clear alarm with the RESET key. Restart part program

61962 %[[Channel %1:] Block %2: %]Plane infeed %4 too small

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The plane infeed is too small.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: The plane infeed must be increased.

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61963 %[[Channel %1:] Block %2: %]Plane infeed %4 too large

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The plane infeed is too large, it must not be greater than the tool radius.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: The plane infeed must be reduced.

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61964 %[[Channel %1:] Block %2: %]Angle of wrap %4 too small

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The wrap angle is too small, it must not be less than 8°.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: The wrap angle must be increased.

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61965 %[[Channel %1:] Block %2: %]Angle of wrap %4 too large

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: The wrap angle is too large, it must not be greater than or equal to 89°.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: The wrap angle must be reduced.

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61966 %[[Channel %1:] Block %2: %]Only uneven calibration data sets may be selected

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: Only uneven calibration data sets may be programmed for the
 "Simultaneous measurement" function when measuring in AUTO mode. The _PRNUM parameter
 should be checked.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Select another calibration data set.

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61967 %[[Channel %1:] Block %2: %]Difference between the position deviation of probes is too large (%4)

Parameters: %1 = Channel number
 %2 = Block number, label
 %4 = Difference between position deviations

Explanation: The position deviations between the two probes must not be too large for
 the "Simultaneous measurement" function. The maximum possible
 difference can be programmed in SD55701.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Reduce the difference between the position deviations of the two probes.

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61968 %[[Channel %1:] Block %2: %]Only even calibration data sets may be selected for D2

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: When calibrating in JOG, for cutting edge 2 only uneven calibration data sets
 may be programmed for the "Simultaneous measurement" function.
 The _PRNUM parameter should be checked.

Reaction: Interpreter stop
 NC Start disable in this channel.
 Interface signals are set.
 Alarm display.

Remedy: Select another calibration data set.

**Programm
continuation:** Clear alarm with the RESET key. Restart part program

61969 %[[Channel %1:] Block %2: %]Only uneven calibration data sets may be selected for D1

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: When calibrating in JOG, for cutting edge 1 only uneven calibration data sets
 may be programmed for the "Simultaneous measurement" function.
 The _PRNUM parameter should be checked.

Reaction:	Interpreter stop NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Select another calibration data set.
Programm continuation:	Clear alarm with the RESET key. Restart part program

62000 [Channel %1:] Block %2: Insert new tool

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Please load new tool.
Reaction:	Alarm display.
Remedy:	--
Programm continuation:	Clear alarm with the Delete key or NC START.

62001 [Channel %1:] Block %2: Dynamic response of axis %4 inadequate

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The programmed cutting speed is too high.
Reaction:	Alarm display.
Remedy:	Reduce cutting speed
Programm continuation:	Clear alarm with the Delete key or NC START.

62098 [Channel %1:] Block %2: %4

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	This alarm is used for various purposes. Please refer to the alarm text.
Reaction:	Alarm display.
Remedy:	Depends on alarm text
Programm continuation:	Clear alarm with the Delete key or NC START.

62100 [Channel %1:] Block %2: No drilling cycle active

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	No modal drilling cycle has been called before the drilling pattern cycle call.
Reaction:	Alarm display.
Remedy:	Check whether a drilling cycle was called prior to calling the drilling pattern cycle.
Programm continuation:	Clear alarm with the Delete key or NC START.

62101 [Channel %1:] Block %2: Milling direction incorrect - G3 is generated

Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Synchronous or reverse rotation programmed. But the spindle does not rotate at a cycle call.
Reaction:	Alarm display.

Remedy: Check value in parameter CDIR.
Programm continuation: Clear alarm with the Delete key or NC START.

62102 [Channel %1:] Block %2: pocket not completely solidly machined during finishing

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Alarm display.

Remedy:

Programm continuation: Clear alarm with the Delete key or NC START.

62103 [Channel %1:] Block %2: No finishing allowance programmed

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation: No finishing allowance is programmed, although it is necessary for this machining.

Reaction: Alarm display.

Remedy: Program a finishing allowance.

Programm continuation: Clear alarm with the Delete key or NC START.

62104 [Channel %1:] Block %2: Drilling cycle incorrectly defined

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Alarm display.

Remedy:

Programm continuation: Clear alarm with the Delete key or NC START.

62105 [Channel %1:] Block %2: Number of columns or lines equals zero

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Alarm display.

Remedy: Check parameters _NUM1 and _NUM2.

Programm continuation: Clear alarm with the Delete key or NC START.

62106 [Channel %1:] Block %2: incorrect value for monitoring status in tool monitoring

Parameters: %1 = Channel number
 %2 = Block number, label

Explanation:

Reaction: Alarm display.

Remedy:

Programm continuation: Clear alarm with the Delete key or NC START.

62107	[Channel %1:] Block %2: parameter %4 incorrectly defined for tool monitoring in cycles
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Alarm display.
Remedy:	
Programm continuation:	Clear alarm with the Delete key or NC START.
62108	[Channel %1:] Block %2: error in function Tool monitoring in cycles
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	
Reaction:	Alarm display.
Remedy:	
Programm continuation:	Clear alarm with the Delete key or NC START.
62109	%[[Channel %1:] Block %2: Machine parameterization not ideal
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	For an optimum machining result, a cycle reduction is required between the servo and interpolation cycles.
Reaction:	Alarm display.
Remedy:	The factor for the servo cycle (MD10060 \$MN_POSTCTRL_SYSLOCK_TIME_RATIO) must be less than the factor for the interpolation cycle (MD10070 \$MN_IPO_SYSLOCK_TIME_RATIO).
Programm continuation:	Clear alarm with the Delete key or NC START.
62180	[Channel %1:] Block %2: Set rotary axes %4
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Sample display of the swivel angles to be set for manual rotary axes: 62180 "Set rotary axes B=32.5° C=45°"
Reaction:	Alarm display.
Remedy:	Settable angles for manual rotary axes.
Programm continuation:	Clear alarm with the Delete key or NC START.
62181	[Channel %1:] Block %2: Set rotary axis %4
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Sample display of the swivel angle to be set for a manual rotary axis: 62181 "Set rotary axis B=32.5°"
Reaction:	Alarm display.
Remedy:	Settable angle for manual rotary axis.
Programm continuation:	Clear alarm with the Delete key or NC START.

62182 [Channel %1:] Block %2 : load swivel head: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Alarm display.

Remedy: Request to load a swivel head.

Programm continuation: Clear alarm with the Delete key or NC START.

62183 [Channel %1:] Block %2 : unload swivel head: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Alarm display.

Remedy: --

Programm continuation: Clear alarm with the Delete key or NC START.

62184 [Channel %1:] Block %2 : replace swivel head: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation:

Reaction: Alarm display.

Remedy: --

Programm continuation: Clear alarm with the Delete key or NC START.

62185 [Channel %1:] Block %2 : angle adapted to angle grid: %4

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: %4 difference angle with Hirth tooth system

Reaction: Alarm display.

Remedy: Check setup of swivel CYCLE800.

Programm continuation: Clear alarm with the Delete key or NC START.

62186 [Channel %1:] Block %2: No swiveling in JOG -> WO G%4 active and total basic WO (G500) contain rotations

Parameters: %1 = Channel number
%2 = Block number, label

Explanation: On swiveling in JOG no rotation can be written to the work offset WO, if rotations are already contained in the total basic WO or in the basic reference
Error 62186 message can be masked -> see setting data 55410 \$SCS_MILL_SWIVEL_ALARM_MASK

Reaction: Alarm display.

Remedy: %4 number of the active work offset WO.

Programm continuation: Clear alarm with the Delete key or NC START.

62187	[Channel %1:] Block %2: Swiveling in JOG - G500 active and total basic WO or basic reference contain rotations
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	During swiveling in JOG, it is not possible to write a rotation into the work offset WO, if, with active G500, rotations are already contained in the total basic WO or in the basic reference Error message 62187 can be masked -> see setting data 55410 \$SCS_MILL_SWIVEL_ALARM_MASK
Reaction:	Alarm display.
Remedy:	See notes for 62186 and 62187.
Programm continuation:	Clear alarm with the Delete key or NC START.
62200	[Channel %1:] Block %2: Start spindle
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	Stop prior to thread machining, as the spindle is in stop position.
Reaction:	Alarm display.
Remedy:	Start the tool spindle before machining the thread.
Programm continuation:	Clear alarm with the Delete key or NC START.
62201	[Channel %1:] Block %2: Z offset does not influence the retraction planes.
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	The retraction planes refer to the workpiece. Therefore, programmable offsets do not influence the retraction planes.
Reaction:	Alarm display.
Remedy:	Check that offset does not cause collision. Then press NC Start.
Programm continuation:	Clear alarm with the Delete key or NC START.
62202	[Channel %1:] Block %2: NOTICE: tool travels directly to machining!
Parameters:	%1 = Channel number %2 = Block number, label
Explanation:	After block search a position is to be reached by direct approach.
Reaction:	Alarm display.
Remedy:	Check whether the desired position can be reached without collision. Then execute an NC start.
Programm continuation:	Clear alarm with the Delete key or NC START.
62300	[Channel %1:] Block %2: Check number of empirical value memory
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	--
Reaction:	Alarm display.
Remedy:	Check setpoint value
Programm continuation:	Clear alarm with the Delete key or NC START.

62301 [Channel %1:] Block %2: Notice! Search run, test run or simulation active

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Reaction: Alarm display.

Remedy: - Deactivate program test or test run

Programm continuation: Clear alarm with the Delete key or NC START.

62303 [Channel %1:] Block %2: Safety margin exceeded %4

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Reaction: Alarm display.

Remedy: - Check setpoint value and parameter _TSA

Programm continuation: Clear alarm with the Delete key or NC START.

62304 [Channel %1:] Block %2: Allowance

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation: The difference between actual and setpoint measurements is greater than the upper tolerance limit (screen parameter TUL):

- TUL is the upper tolerance limit of the measurement difference.
- TUL is always related to the material, irrespective of whether external or internal machining is involved.
- The hole/pocket is thus too small and the spigot is too large.
- This means that further material can be removed.
- The measuring cycle parameter TUL corresponds to "upper deviation", the usual term used in mechanical engineering for fits and tolerances.

Reaction: Alarm display.

Remedy: The difference between actual and setpoint value is larger than upper tolerance limit (parameter _TUL).

Programm continuation: Clear alarm with the Delete key or NC START.

62305 [Channel %1:] Block %2: Dimension too small

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation: The difference between the actual and setpoint measurement is less than the lower tolerance limit (screen parameter TLL):

- TLL is the lower tolerance limit of the measurement difference.
- TLL is always related to the material, irrespective of whether external or internal machining is involved.
- The hole/pocket is thus too large and the spigot too small.
- This means that too much material has already been removed.
- The measuring cycle parameter TLL corresponds to "lower deviation", the usual term used in mechanical engineering for fits and tolerances.

Reaction: Alarm display.

Remedy: The difference between actual and setpoint value is smaller than lower tolerance limit (parameter _TLL).

Programm continuation: Clear alarm with the Delete key or NC START.

62306	[Channel %1:] Block %2: Permissible measuring difference exceeded
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Reaction:	Alarm display.
Remedy:	The difference between actual and setpoint value is larger than tolerance parameter _TDIF, tool data are not corrected.
Programm continuation:	Clear alarm with the Delete key or NC START.
62307	[Channel %1:] Block %2: Maximum number of characters per line exceeded.
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	Insufficient number of characters per line.
Reaction:	Alarm display.
Remedy:	Increase the value in _PROTFORM[1]
Programm continuation:	Clear alarm with the Delete key or NC START.
62310	[Channel %1:] Block %2: The max. number of characters per line is limited to %4 characters per line
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Reaction:	Alarm display.
Remedy:	--
Programm continuation:	Clear alarm with the Delete key or NC START.
62311	[Channel %1:] Block %2: The maximum number of characters per line _PROTFORM[1] is adjusted.
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	Max. number of characters per line _PROTFORM[1] has been adjusted.
Reaction:	Alarm display.
Remedy:	--
Programm continuation:	Clear alarm with the Delete key or NC START.
62312	[Channel %1:] Block %2: probe is not perpendicular to plane!
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Reaction:	Alarm display.
Remedy:	--
Programm continuation:	Clear alarm with the Delete key or NC START.

62314	[Channel %1:] Block %2: Path limitation via software end position %4, collision detection activated, continue with NC START / cancel with RESET
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	This alarm is only output with external measurements (web, spigot, ball) as a query about the program continuation before the lowering movement in the infeed axis The alarm scan is caused by the reduction of the path of the measuring axis in the working plane that has just been made. If the path had not been reduced, the traversing movement would have extended beyond the software end position of the working plane. A corresponding NCK alarm 10722 would have been triggered. With program stop, the user can check whether the infeed axis can be lowered to measuring height without causing a collision. Alarm 61402 is output if there is a switch (collision) of the probe in the subsequent movement of the infeed axis.
Reaction:	Alarm display.
Remedy:	- Check setpoint value specification. - Place the workpiece further away from the software limit position.
Programm continuation:	Clear alarm with the Delete key or NC START.
62315	[Channel %1:] Block %2: Overwrite kinematics data record %4, yes -> NC start, no -> reset
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Reaction:	Alarm display.
Remedy:	
Programm continuation:	Clear alarm with the Delete key or NC START.
62316	[Channel %1:] Block %2: Overwrite TRAORIdata, yes -> NC start, no -> reset
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Reaction:	Alarm display.
Remedy:	
Programm continuation:	Clear alarm with the Delete key or NC START.
62317	[Channel %1:] Block %2: Tolerance of the linear vector %4 exceeded
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	If the error comes from CYCLE996 or CYCLE9960: The tolerance of the linear vectors is exceeded during the measurement of the kinematics. The value of the tolerance is transferred in parameter TLIN. If TLIN=0 or tolerance (check) = no, the measured vectors are not monitored.
Reaction:	Alarm display.
Remedy:	A 2nd measurement with a larger tolerance can be made for the analysis. The kinematic data should not be overwritten. The newly measured vectors are documented in the measurement log (data file).
Programm continuation:	Clear alarm with the Delete key or NC START.

62318	[Channel %1:] Block %2: Tolerance of the rotary axis vector %4 exceeded
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	The rotary axis orientation is also calculated during kinematic measurement. If the deviation is negligible and only the tolerance range is too small, this can be changed in \$SN_CORR_TRAFO_DIR_MAX. A deviation of the rotary axis orientation can also have a mechanical cause.
Reaction:	Alarm display.
Remedy:	If the deviation is very large, the cause may be a small measuring circuit. With a rotary table, the calibration ball must not be too close to the center of rotation. With head kinematics, the measuring circuit can be enlarged by positioning the 2nd rotary axis when measuring the first.
Programm continuation:	Clear alarm with the Delete key or NC START.
62319	[Channel %1:] Block %2: No internal correction of the calibration data
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Reaction:	Alarm display.
Remedy:	Check probe alignment/spindle position! The alignment (programmed position) of the tool probe in the workspindle must be identical during calibration and measuring! If these positions vary, the calibration data cannot be corrected cycle-internally with regards to a coordinate rotation of the workplane around the infeed axis!
Programm continuation:	Clear alarm with the Delete key or NC START.
62320	[Channel %1:] Block %2 Individual edges lie outside the dimensional difference: %4
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	
Reaction:	Alarm display.
Remedy:	Measurement of the individual edges shows that the specified number of edges lies outside the dimensional difference. A decision has to be made: whether or not one can continue working with this tool.
Programm continuation:	Clear alarm with the Delete key or NC START.
62321	[Channel %1:] Block %2: Rotary axis 1: Diameter tolerance of calibration ball between measurement %4 exceeded
Parameters:	%1 = Channel number %2 = Block number, label channel number
Explanation:	see measured diameter in the parameters _OVR[72] to _OVR[74] or the value in SD \$SCS_MEA_KIN_DM_TOL
Reaction:	Alarm display.
Remedy:	Check the calibration data or recalibrate the 3D probe Check the mechanical structure of the calibration ball in the machine
Programm continuation:	Clear alarm with the Delete key or NC START.

62322 [Channel %1:] Block %2: Rotary axis 2: Diameter tolerance of calibration ball between measurement %4 exceeded

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation: see measured diameter in the parameters _OVR[75] to _OVR[77] or the value in SD \$SCS_MEA_KIN_DM_TOL

Reaction: Alarm display.

Remedy: Check the calibration data or recalibrate the 3D probe
Check the mechanical structure of the calibration ball in the machine

Programm continuation: Clear alarm with the Delete key or NC START.

62377 [Channel %1:] Block %2: Dimensional tolerance %4 exceeded

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Reaction: Alarm display.

Remedy:

Programm continuation: Clear alarm with the Delete key or NC START.

62500 [Channel %1:] Block %2: GWPS has been limited

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Reaction: Alarm display.

Remedy: Check limit value for GWPS and program a lower value in the NC program if necessary

Programm continuation: Clear alarm with the Delete key or NC START.

62501 [Channel %1:] Block %2: Speed has been limited

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Reaction: Alarm display.

Remedy: Check limit value for speed and program a lower value in the NC program if necessary

Programm continuation: Clear alarm with the Delete key or NC START.

62502 [Channel %1:] Block %2: Dresser %4, GWPS has been limited

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Reaction: Alarm display.

Remedy: Check limit value for GWPS and program a lower value in the NC program if necessary

Programm continuation: Clear alarm with the Delete key or NC START.

62503 [Channel %1:] Block %2: Dresser %4, speed has been limited

Parameters: %1 = Channel number
%2 = Block number, label channel number

Explanation:

Reaction: Alarm display.

Remedy: Check limit value for speed and program a lower value in the NC program if necessary

Programm continuation: Clear alarm with the Delete key or NC START.

HMI alarms

120200	Image preparation suppressed, please wait.
Explanation:	The control is so heavily loaded by the processing of a subroutine, that it cannot keep all the display values up-to-date.
Reaction:	Alarm display.
Remedy:	The alarm disappears automatically as soon as the overload situation has been eliminated. If this alarm occurs often, the start-up engineer will have to take appropriate measures (e.g. reduce IPO clock pulse rate).
Programm continuation:	Internal
120400	The settings for the acyclic links with the drive devices are not yet effective.%nSwitch off/on HMI !
Explanation:	A file transfer from/to a drive device has failed as the settings for acyclic links with the drive devices become effective only after an HMI reboot.
Reaction:	Alarm display.
Remedy:	Switch off/on HMI and then repeat the process leading to the alarm.
Programm continuation:	Internal
120401	SINAMICS: Write job for parameter %1, value %2, area %3: %4s timeout!
Parameters:	%1 = Number of parameter the value of which is to be written. %2 = Value to be written %3 = Area (drive object class to which the write job was addressed) %4 = Time passed without the write job being acknowledged by the drive device.
Explanation:	The write job of a SINAMICS parameter was not not acknowledged within 10 seconds by the drive device. If the write job is not acknowledged within the next 10 seconds, the alarm will again be triggered. The waiting period for the acknowledgment of a write job is a maximum of 130 seconds, i.e. if the timeout specified in the alarm is 130 seconds, it is assumed that the write job has failed. Otherwise it can be assumed that the write job was successful despite the timeout.
Reaction:	Alarm display.
Remedy:	As long as the timeout specified in the alarm is less than 130 seconds, acknowledge alarm, otherwise switch off/on control, drive system and HMI, and then repeat the process leading to the alarm.
Programm continuation:	Internal
120402	Bus%1.Slave%2: %3: First commissioning of SINAMICS required!
Parameters:	%1 = Bus number %2 = Slave address %3 = Name of the affected drive device
Explanation:	The drive device with the bus number and slave address specified in the alarm is in 'First commissioning' state.
Reaction:	Alarm display.
Remedy:	Execute first commissioning for the affected drive device. To do so, switch in the HMI to the dialog 'First commissioning > Drive system > Drive devices, select the affected drive device, and follow the instructions of the HMI.
Programm continuation:	Internal

120403	Bus%1.Slave%2: %3: Check/acknowledge topology!
Parameters:	%1 = Bus number %2 = Slave address %3 = Name of the affected drive device
Explanation:	The drive device with the bus number and slave address specified in the alarm has detected an illegal difference between target topology and actual topology during the ramp-up when checking the DRIVE-CLiQ topology. For this reason, the drive device has stopped the ramp-up in the 'Topology error' state.
Reaction:	Alarm display.
Remedy:	- Check actual topology and possibly replug in line with the target topology. - Check DRIVE-CLiQ cables for breakage and problems with contacts. - Test DRIVE-CLiQ components for operational functioning. Note: Under 'Setup > Drive system > Drive devices > Topology', HMI offers a suitable diagnostics (e.g. target/actual value comparison).
Programm continuation:	Internal
120404	Setting up acyclic link %1 failed.%nSwitch off/on control, drives and HMI.
Parameters:	%1 = Name of connection
Explanation:	Setting up an acyclic link with a drive device for file transfer from/to this drive device has failed. The file could not be transferred from/to this drive device. The affected drive device has the bus number and slave address specified in the link name: /DRIVE_<Bus number>_<Slave address>.
Reaction:	Alarm display.
Remedy:	Execute the following measures in the sequence specified until the process leading to the alarm can be repeated successfully: 1. Switch off/on control, drives and HMI, and then repeat the process leading to the alarm. 2. Load PROFIBUS configuration (HW Config) with same PLC and CP-Subnet-ID in PLC and CP, switch off/on control and HMI, and then repeat the process leading to the alarm. 3. Return to factory settings of the affected drive device, switch off/on control, drives and HMI, and then repeat the process leading to the alarm. 4. Regarding the error text, submit a Support Request to: http://www.siemens.com/automation/support-request
Programm continuation:	Internal
120405	SINAMICS: Firmware update for DRIVE-CLiQ components is running.%nPlease wait for the firmware update to be completed!
Explanation:	The firmware update is being executed for at least one DRIVE-CLiQ component.
Reaction:	Alarm display.
Remedy:	None required. Please wait for the firmware update to be completed. Completion of the firmware update is signaled by alarm 120406.
Programm continuation:	Internal
120406	SINAMICS: Firmware update of DRIVE-CLiQ components completed.%nSwitch off/on drive system!
Explanation:	Firmware update of all DRIVE-CLiQ components completed.
Reaction:	Alarm display.
Remedy:	Switch off/on drive system including all DRIVE-CLiQ components.
Programm continuation:	Internal

120407	SINAMICS: Read job for parameter %1, area %2: %3 s timeout!
Parameters:	%1 = Number of the parameter whose value was read. %2 = Area (drive object class to which the write job was addressed) %3 = Time required to read the parameter.
Explanation:	It is taking too long to read a SINAMICS parameter. This can slow down the operation of a connected HMI significantly.
Reaction:	Alarm display.
Remedy:	1. Acknowledge alarm. 2. Check drive load: The CPU time load values in parameter r9976 for the corresponding Control Unit should be less than 80%. 3. Regarding the error text, submit a Support Request to: http://www.siemens.com/automation/support-request
Programm continuation:	Internal
120408	The safety operating mode needs to be adapted in at least one drive device!
Explanation:	The safety operating mode needs to be adapted in at least one drive device.
Reaction:	Alarm display.
Remedy:	The safety operating mode needs to be adapted under 'Setup/Safety/Adapt SI mode'.
Programm continuation:	Internal
120409	Adaptation to SINUMERIK required in at least one drive device.
Explanation:	An adaptation to SINUMERIK is required in at least one drive device.
Reaction:	Alarm display.
Remedy:	An adaptation to SINUMERIK is required in at least one drive device. To do so, carry out a Reset (PO), then acknowledge the following system dialog "Adaptation to SINUMERIK" with "OK". Alternatively, a manual adaptation can be made in the affected drive device using the parameter sequence P0009 = 30 and P0976 = 502. Then save the parameters of the drive device.
Programm continuation:	Internal
150000	Auto Servo Tuning has been shut down unexpectedly during a previous operation.%nIt may be necessary to restore the output data of the last tuning.
Explanation:	The alarm signals that a recovery point exists. A recovery point may come to a standstill on a platform if AST is unexpectedly shut down (e.g. in the case of power failure, failure in communications etc.) Recovery of the recovery point sets the machine data back to the values before the tuning. This ensures that the machine is in a consistent state.
Reaction:	Alarm display.
Remedy:	Data recovery may be executed from the Auto Servo Tuning application in HMI-Setup.
Programm continuation:	Internal
150001	Error during Auto Servo Optimization: %1
Explanation:	Automatic axis optimization has failed. Auto Servo Tuning canceled optimization because of an error.
Reaction:	Alarm display.
Remedy:	Place a support request with the error text under: http://www.siemens.com/automation/support-request
Programm continuation:	Internal

150002 Error in the AST Kernel Library: %1

Explanation: Automatic axis optimization has failed.
Auto Servo Tuning canceled optimization because of an error.

Reaction: Alarm display.

Remedy: Place a support request with the error text under: <http://www.siemens.com/automation/support-request>

Programm continuation: Internal

150003 Auto Servo Optimization has aborted the optimization. Reason: %1 (%2<AST>)

Explanation: Automatic axis optimization has failed.
Ensure that:

1. The channel is in RESET.
2. The axis can be traversed in JOG mode.
3. The axis optimization calls in the part program are neither incorrect nor incomplete.

Reaction: Alarm display.

Remedy: Look up error number in the user documentation.
After debugging, restart the part program.

Programm continuation: Internal

150004 AST Kernel Library has aborted the optimization. Reason: %1 (%2<AST>)

Explanation: Automatic axis optimization has failed.
The axis optimization calls in the part program are probably incorrect or incomplete.

Reaction: Alarm display.

Remedy: Look up error number in the user documentation.
After debugging, restart the part program.

Programm continuation: Internal

150005 Auto Servo Tuning was canceled by the user.

Explanation: Automatic axis optimization was canceled by the user.

Reaction: Alarm display.

Remedy: The part program must be restarted.

Programm continuation: Internal

150006 Auto Servo Optimization has aborted the optimization. Reason: %1 (%2<AST>)

Explanation: An error has occurred during a measurement of the automatic axis optimization.

Reaction: Alarm display.

Remedy:

- 1: Unselect the REF/TEACH/single block function.
- 2: Press the "Feedrate enable" key.
- 3: Increase the feedrate of the axis.
- 4: Press the "Spindle enable" key.
- 5: Reference the axis.
- 6: First stop other measurements. Check parameter p4701 of the CU. Exit all external operates which access the control.
- 7: First stop the trace (drive). Check parameter p4700 of the CU. Exit all external operates which access the control.
- 8: Check ON/OFF1 signal enable in the axis diagnostics and, if necessary, set parameter p840 in the drive parameters.
- 9: Check ON/OFF1 signal enable of the infeed and, if necessary, set parameter p840 in the drive parameters.

After debugging, the part program must be restarted.

**Programm
continuation:** Internal

150100 **Adaptation of the softkey access levels active**

Explanation: The alarm signalizes that the commissioning mode for softkeys has been activated.
In this mode, the access level of a softkey can be reassigned by a right click on the softkey.

Reaction: Alarm display.

Remedy: The alarm disappears automatically as soon as the commissioning mode for softkeys is terminated.

**Programm
continuation:** Internal

150201 **Communication to %1 failed**

Parameters: %1 = Source URL of the component involved

Explanation: The operator panel is connected to the NC and PLC by a communications bus.
This alarm occurs when the communication to these components is interrupted.
In connection with this alarm, all display values connected with the NC/PLC become invalid.
Such faults are normal while the controls are ramping up (e.g. after resetting).

Reaction: Alarm display.

Remedy: The alarm disappears automatically as soon as the fault situation has ended.
If this alarm is continuously present, a wide variety of faults may be the cause. (e.g. wire breakage, NC/PLC not ramped up, faulty address/data transfer rate configuration of one of the bus nodes, etc.).

**Programm
continuation:** Internal

150202 **Waiting for a connection to %1**

Parameters: %1 = Source URL of the component involved

Explanation: The operator panel is connected to the NC and PLC by a communications bus.
This alarm occurs if the MMC is started for the first time and the NC/PLC ramp-up has not yet finished or the communication to these components is faulty.
In conjunction with this alarm, all display values connected with the NC/PLC become invalid.
Such faults are normal while the controls are starting up (e.g. after resetting).

Reaction: Alarm display.

Remedy: The alarm disappears automatically as soon as the fault situation has ended.
If this alarm is continuously present, a wide variety of faults may be the cause. (e.g. wire breakage, NC/PLC not ramped up, faulty address/data transfer rate configuration of one of the bus nodes, etc.).

**Programm
continuation:** Internal

150204 **----- Start alarm acquisition -----**

Explanation: The alarm indicates the start or restart of alarm acquisition in the alarm log.
If the alarm log has been configured so that it is persistently written into the file system, a further alarm is written into the log at each new start. The alarm thus separates the individual time intervals during which alarm acquisition is active.
The coming and going time stamps are identical, and correspond to the time of the start/restart of the alarm acquisition.
The alarm is only visible in the alarm log.

Reaction: Alarm display.

Remedy: The alarm can but need not be deleted as it is only visible in the alarm log.

**Programm
continuation:** Internal

150205	%1 %2
Explanation:	The alarm displays errors found by the alarm and event server. The alarm is used universally. That means the actual text appears in the parameters %1 and %2, and is always in English. The alarm is only visible in the alarm log.
Reaction:	Alarm display.
Remedy:	The alarm is deleted immediately after setting, and is therefore only visible in the alarm log.
Programm continuation:	Internal
150206	%1 %2
Explanation:	The alarm displays errors found by the adapter of the alarm and event server. The alarm is used universally. That means the actual text appears in the parameters %1 and %2, and is always in English. The alarm is only visible in the alarm log.
Reaction:	Alarm display.
Remedy:	The alarm is deleted immediately after setting, and is therefore only visible in the alarm log.
Programm continuation:	Internal
150207	----- Maximum log size %1 MB reached -----
Parameters:	%1 = Maximum log size
Explanation:	The alarm indicates that the alarm log, for alarm acquisition, of the alarm recorder has reached its maximum size. No more events will be recorded!
Reaction:	Alarm display.
Remedy:	The alarm can but need not be deleted as it is only visible in the alarm log.
Programm continuation:	Internal
150300	%1 is active
Explanation:	The alarm signalizes that a defined energy state has been reached. Energy states can be configured via an HMI screenform in commissioning. The HMI screenforms can be accessed with the shortcut "Ctrl-E".
Reaction:	Alarm display.
Remedy:	The alarm disappears automatically as soon as the energy state reached has been terminated.
Programm continuation:	Internal
150301	HMI Operate version %1 requires CNC software version %2
Explanation:	The alarm indicates that the version of the HMI Operate software used requires a different version of the SINUMERIK CNC software. This combination can lead to malfunctions or display problems.
Reaction:	Alarm display.
Remedy:	Use of the version of the SINUMERIK CNC software stated in the alarm.
Programm continuation:	Internal
150400	The system CF card is nearly full.
Explanation:	The alarm signalizes that the system CF card is nearly full. Please delete the programs no longer required on the local drive and/or the data on the system CF card.
Reaction:	Alarm display.
Remedy:	The alarm disappears automatically as soon as sufficient memory space is available again.

**Programm
continuation:** Internal

150401 '%1' : '%2' cannot be reselected in channel '%3'

Parameters: %1 = Name of the NCU for which reselection is to be made.
 %2 = Program name with path details.
 %3 = Channel number for reselection.

Explanation: On the NCU, the program could not be automatically selected for the channel for external execution.
 Please check whether the channel is in reset and if the program is present.

Reaction: Alarm display.

Remedy: The alarm disappears automatically as soon as the program is selected on the NCU for the channel for 'Execution from external source'

**Programm
continuation:** Internal

150402 The buffered memory for the 'NC Extend' drive is full

Explanation: The alarm indicates that the 'NC Extend' drive is full.
 Please delete programs that are no longer needed from the local drive.

Reaction: Alarm display.

Remedy: The alarm disappears automatically as soon as sufficient memory space is available again.

**Programm
continuation:** Internal

150403 The set user memory on the 'local drive'/NC Extend' has been exceeded, see display MD HMI_MEM_LIMIT_USER

Explanation: The alarm indicates that the user memory set in display MD HMI_MEM_LIMIT_USER is full.
 Please delete data that is no longer needed from the local drive/NC Extend.

Reaction: Alarm display.

Remedy: The alarm disappears automatically as soon as sufficient memory space is available again.

**Programm
continuation:** Internal

150404 The available manufacturer memory has been exceeded, see display MD HMI_MEM_LIMIT_USER

Explanation: The alarm indicates that the available manufacturer memory set in display MD HMI_MEM_LIMIT_USER is full.
 Please delete data that is no longer needed from manufacturer area of the CF card.

Reaction: Alarm display.

Remedy: The alarm disappears automatically as soon as sufficient memory space is available again.

**Programm
continuation:** Internal

150405 The SD card is almost full

Explanation: The alarm indicates that the SD card is almost full.
 Delete any programs that are no longer needed on the local drive and/or any data on the SD card.

Reaction: Alarm display.

Remedy: The alarm disappears automatically as soon as sufficient memory space is available again.

**Programm
continuation:** Internal

150406 The memory available for users and manufacturer data (6 GB) is full

Explanation: The alarm indicates that the area for users and manufacturer data is full.
Please delete programs that are no longer needed from the drives.

Reaction: Alarm display.

Remedy: The alarm disappears automatically as soon as sufficient memory space is available again.

Programm continuation: Internal

150407 /install directory exceeds the permissible size, please correct.

Explanation: The alarm indicates that the install directory is too full.
Please delete data that are no longer needed with external tools, and restart the HMI.

Reaction: Alarm display.

Remedy: The alarm does not disappear until the next HMI restart after the cause has been eliminated.

Programm continuation: Internal

150408 The available memory for manufacturer 'oem' and/or 'individual' is full

Explanation: The alarm indicates that the manufacturer drive 'oem' and/or 'individual' is full.
Delete any files on the drive that you no longer need.

Reaction: Alarm display.

Remedy: The alarm disappears automatically as soon as sufficient memory space is available.

Programm continuation: Internal

150410 Action not possible. Option not set: %1

Explanation: The functionality can only be executed if the corresponding option is set.
In the operating area "Setup", set (HSK) "Licenses", (VSK) "All options"

Reaction: Alarm display.

Remedy: The alarm disappears when the option is set and the HMI is then rebooted.

Programm continuation: Internal

150411 Texts in the PLC project have been changed!%nIf required, they must be imported and the HMI restarted.

Explanation: Loading new texts to the PLC requires an HMI reboot.
If texts have been changed in the PLC project, they have to be imported, and the HMI restarted if they are used in the HMI, e.g. alarm texts.

Reaction: Alarm display.

Remedy: The alarm disappears on HMI reboot.

Programm continuation: Internal

150412 No information on SIEMENS registration available.

Explanation: Checking the machine registration is activated and has failed.
The machine is not registered with SIEMENS.

Reaction: Alarm display.

Remedy: The alarm disappears if the machine is registered with Siemens. The registration can be made in the operating area "Diagnostics" in the operating screen "Version" with the softkey "Register machine". Scan the QR code in the operating screen "Register machine". This code leads via a link to the official SIEMENS registration page. Enter the necessary information on the registration page to receive the 12-digit registration code. The 12-digit registration code must then be entered in the operating screen "Register machine". Please ensure that the registered CF card is also inserted in the registered NCU.

**Programm
continuation:** Internal

150413 Backup data archive could not be created, next attempt tomorrow at %1%n %2 .

Parameters: %1 = Time of next data backup

%2 = Cause of the error

Explanation: The creation of automatic data backup archives is enabled. However, no data backup archive could be created due to errors. A new attempt will be made after 24 hours.

Reaction: Alarm display.

Remedy: The alarm explains the cause of the error and how to fix it.

It disappears with the next successful data backup.

**Programm
continuation:** Internal

150414 The creation of the automatic data backup archive will start in %1 minutes.

Parameters: %1 = Number of minutes

Explanation: The creation of automatic data backup archives is enabled and notification of the start of the data backup has been given. Notifications appear at two-minute intervals starting 10 minutes before the start.

Reaction: Alarm display.

Remedy: The alarm disappears once the system starts the data backup.

**Programm
continuation:** Internal

150420 Please set Windows enable and distribute drives.

Explanation: The alarm signals that logon data for EES drives are missing.
Please set Windows enable under Setup/HMI/Log. drives, and distribute drives.

Reaction: Alarm display.

Remedy: The alarm disappears automatically as soon as the logon data have been set for Windows enable and the drives have been distributed.

**Programm
continuation:** Internal

150421 The drive configuration is being distributed and activated on NCU %1

Parameters: %1 = Name of the NCU on which the drive configuration is being distributed.

Explanation: The alarm signals that the drives are being distributed.

Reaction: Alarm display.

Remedy: The alarm disappears automatically as soon as the drives have been activated on the NCU.

**Programm
continuation:** Internal

150422 Error during the drive configuration of drives %2 on NCU %1

Parameters: %1 = Name of the NCU on which the error occurred.

%2 = List of the drives on which an error occurred.

Explanation: The alarm signals that an error has occurred during activation of the drives on the NCU.

Reaction: Alarm display.

Remedy: The alarm disappears automatically as soon as the NCU drives have been successfully activated.

**Programm
continuation:** Internal

150423 The drive configuration could not be distributed on the NCU %1 as programs are being processed

Parameters: %1 = Name of the NCU on which programs are being processed.
Explanation: The alarm signals that not all channels on the NCU are in the RESET state.
Reaction: Alarm display.
Remedy: The alarm disappears automatically as soon as the NCU drives have been successfully activated.
Programm continuation: Internal

150424 The drive configuration has been changed, and must be redistributed

Explanation: The alarm signals that the contents of the logdrive.ini file(s) have changed, or are not the same as those on the NCU. Please distribute the drives under Setup/HMI/Log. drives.
Reaction: Alarm display.
Remedy: The alarm disappears automatically as soon as the drives have been distributed.
Programm continuation: Internal

150425 Error accessing NCU %1. Please check the NCU and redistribute the drives.

Explanation: The alarm signals that an error has occurred while accessing the NCU. Please check the NCU, and redistribute the drives under Setup/HMI/Log. Drives.
Reaction: Alarm display.
Remedy: The alarm disappears automatically as soon as the drives have been distributed.
Programm continuation: Internal

SINAMICS alarms

All objects: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, CU_NX_828, CU_NX_COMBI, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

201000 <location>Internal software error

Drive object: All objects
Message value: Module: %1, line: %2
Reaction: OFF2
Acknowledge: POWER ON
Cause: An internal software error has occurred.
 Fault value (r0949, interpret hexadecimal):
 Only for internal Siemens troubleshooting.
Remedy:

- evaluate fault buffer (r0945).
- carry out a POWER ON (switch-off/switch-on) for all components.
- if required, check the data on the non-volatile memory (e.g. memory card).
- upgrade firmware to later version.
- contact Technical Support.
- replace the Control Unit.

201001 <location>FloatingPoint exception

Drive object: All objects
Message value: %1
Reaction: OFF2
Acknowledge: POWER ON
Cause: An exception occurred for an operation with the FloatingPoint data type.
 The error can be caused by the basic system or a technology function (e.g. FBLOCKS, DCC, TEC).
 Fault value (r0949, interpret hexadecimal):
 Only for internal Siemens troubleshooting.
 Note:
 Refer to r9999 for additional information about this fault.
 r9999[0]: Fault number.
 r9999[1]: Program counter at the time when the exception occurred.
 r9999[2]: Cause of the FloatingPoint exception.
 Bit 0 = 1: Operation invalid
 Bit 1 = 1: Division by zero
 Bit 2 = 1: Overflow
 Bit 3 = 1: Underflow
 Bit 4 = 1: Inaccurate result
Remedy:

- carry out a POWER ON (switch-off/switch-on) for all components.
- check configuration and signals of the blocks in FBLOCKS.
- check configuration and signals of DCC charts.
- check configuration and signals of TEC charts.
- upgrade firmware to later version.
- contact Technical Support.

201002 <location>Internal software error

Drive object: All objects
Message value: %1
Reaction: OFF2
Acknowledge: IMMEDIATELY
Cause: An internal software error has occurred.
Fault value (r0949, interpret hexadecimal):
Only for internal Siemens troubleshooting.
Remedy: - carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade firmware to later version.
- contact Technical Support.

201003 <location>Acknowledgment delay when accessing the memory

Drive object: All objects
Message value: %1
Reaction: OFF2
Acknowledge: IMMEDIATELY
Cause: A memory area was accessed that does not return a "READY".
Fault value (r0949, interpret hexadecimal):
Only for internal Siemens troubleshooting.
Remedy: - carry out a POWER ON (switch-off/switch-on) for all components.
- contact Technical Support.

201004 <location>Internal software error

Drive object: All objects
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: An internal software error has occurred.
Fault value (r0949, hexadecimal):
Only for internal Siemens troubleshooting.
Remedy: - read out diagnostics parameter (r9999).
- contact Technical Support.
See also: r9999 (Software error internal supplementary diagnostics)

201005 <location>Firmware download for DRIVE-CLiQ component unsuccessful

Drive object: All objects
Message value: Component number: %1, fault cause: %2
Reaction: NONE
Acknowledge: IMMEDIATELY

Cause:	It was not possible to download the firmware to a DRIVE-CLiQ component. Fault value (r0949, interpret hexadecimal): yyxxxx hex: yy = component number, xxxx = fault cause xxxx = 000B hex = 11 dec: DRIVE-CLiQ component has detected a checksum error. xxxx = 000F hex = 15 dec: The selected DRIVE-CLiQ component did not accept the contents of the firmware file. xxxx = 0012 hex = 18 dec: Firmware version is too old and is not accepted by the component. xxxx = 0013 hex = 19 dec: Firmware version is not suitable for the hardware release of the component. xxxx = 0065 hex = 101 dec: After several communication attempts, no response from the DRIVE-CLiQ component. xxxx = 008B hex = 139 dec: Initially, a new boot loader is loaded (must be repeated after POWER ON). xxxx = 008C hex = 140 dec: Firmware file for the DRIVE-CLiQ component not available on the memory card. xxxx = 008D hex = 141 dec: An inconsistent length of the firmware file was signaled. The firmware download may have been caused by a loss of connection to the firmware file. This can occur during a project download/reset in the case of a SINAMICS Integrated Control Unit, for example. xxxx = 008F hex = 143 dec: Component has not changed to the mode for firmware download. It was not possible to delete the existing firmware. xxxx = 0090 hex = 144 dec: When checking the firmware that was downloaded (checksum), the component detected a fault. It is possible that the file on the memory card is defective. xxxx = 0091 hex = 145 dec: Checking the loaded firmware (checksum) was not completed by the component in the appropriate time. xxxx = 009C hex = 156 dec: Component with the specified component number is not available (p7828). xxxx = Additional values: Only for internal Siemens troubleshooting.
Remedy:	- check the selected component number (p7828). - check the DRIVE-CLiQ wiring. - save suitable firmware file for download in the directory "/siemens/sinamics/code/sac/". - use a component with a suitable hardware version - after POWER ON has been carried out again for the DRIVE-CLiQ component, download firmware again. Depending on p7826, the firmware will be automatically downloaded.

201006	<location>Firmware update for DRIVE-CLiQ component required
Drive object:	All objects
Message value:	Component number: %1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The firmware of a DRIVE-CLiQ component must be updated as there is no suitable firmware or firmware version in the component for operation with the Control Unit. Alarm value (r2124, interpret decimal): Component number of the DRIVE-CLiQ component.

Remedy: Update the firmware using the commissioning tool:
The firmware version of all of the components on the "Version overview" page can be read in the Project Navigator under "Configuration" of the associated drive unit and an appropriate firmware update can be carried out.
Firmware update via parameter:
- take the component number from the alarm value and enter into p7828.
- start the firmware download with p7829 = 1.

201007 <location>POWER ON for DRIVE-CLiQ component required

Drive object: All objects

Message value: Component number: %1

Reaction: NONE

Acknowledge: NONE

Cause: A DRIVE-CLiQ component must be switched on again (POWER ON) (e.g. due to a firmware update).

Alarm value (r2124, interpret decimal):

Component number of the DRIVE-CLiQ component.

Note:

For a component number = 1, a POWER ON of the Control Unit is required.

Remedy: - Switch off the power supply of the specified DRIVE-CLiQ component and switch it on again.
- For SINUMERIK, auto commissioning is prevented. In this case, a POWER ON is required for all components and the auto commissioning must be restarted.

201009 <location>CU: Control module overtemperature

Drive object: All objects

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The temperature (r0037[0]) of the control module (Control Unit) has exceeded the specified limit value.

Remedy: - check the air intake for the Control Unit.

- check the Control Unit fan.

Note:

The alarm is automatically withdrawn once the limit value has been fallen below.

201010 <location>Drive type unknown

Drive object: All objects

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: An unknown drive type was found.

Fault value (r0949, interpret decimal):

Drive object number (refer to p0101, p0107).

Remedy: - replace Power Module.

- carry out a POWER ON (switch-off/switch-on) for all components.

- upgrade firmware to later version.

- contact Technical Support.

201011 <location>Download interrupted

Drive object: All objects

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause:	The project download was interrupted. Fault value (r0949, interpret decimal): 1: The user prematurely interrupted the project download. 2: The communication cable was interrupted (e.g. cable breakage, cable withdrawn). 3: The project download was prematurely exited by the commissioning tool. 100: Different versions between the firmware version and project files which were loaded by loading into the file system "Download from memory card". Note: The response to an interrupted download is the state "first commissioning".
Remedy:	- check the communication cable. - download the project again. - boot from previously saved files (switch-off/switch-on or p0976). - when loading into the file system (download from memory card), use the matching version.

201012 <location>Project conversion error

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2 (NONE)
Acknowledge:	IMMEDIATELY
Cause:	When converting the project of an older firmware version, an error occurred. Fault value (r0949, interpret decimal): Parameter number of the parameter causing the error. For fault value = 600, the following applies: The temperature evaluation is no longer assigned to the power unit but to the encoder evaluation. Notice: Monitoring of the motor temperature is no longer ensured.
Remedy:	Check the parameter indicated in the fault value and correctly adjust it accordingly. For fault value = 600: Parameter p0600 must be set to the values 1, 2 or 3 in accordance with the assignment of the internal encoder evaluation to the encoder interface. Value 1 means: The internal encoder evaluation is assigned to the encoder interface 1 via p0187. Value 2 means: The internal encoder evaluation is assigned to the encoder interface 2 via p0188. Value 3 means: The internal encoder evaluation is assigned to the encoder interface 3 via p0189. - if necessary, the internal encoder evaluation must be assigned to an encoder interface via parameters p0187, p0188 or p0189 accordingly. - if necessary, upgrade the firmware to a later version.

201013 <location>CU: Fan operating time reached or exceeded

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The maximum operating time of the fan in the Control Unit has either been reached or exceeded. Alarm value (r2124, interpret decimal): 0: The maximum fan operating time is 500 hours. 1: The maximum fan operating time has been exceeded (50000 hours).
Remedy:	Replace the fan in the Control Unit and reset the operating hours counter to 0 (p3961 = 0).

201014 <location>Topology: DRIVE-CLiQ component property changed

Drive object:	All objects
----------------------	-------------

Message value: Component number: %1
Reaction: NONE
Acknowledge: IMMEDIATELY
Cause: The properties of the DRIVE-CLiQ component have fundamentally changed.
Fault value (r0949, interpret hexadecimal):
Component number.
Remedy:
- check the DRIVE-CLiQ component, and if required replace.
- carry out a warm restart (p0009 = 30, p0976 = 2, 3).

201015 <location>Internal software error

Drive object: All objects
Message value: %1
Reaction: OFF2
Acknowledge: POWER ON
Cause: An internal software error has occurred.
Fault value (r0949, interpret decimal):
Only for internal Siemens troubleshooting.
Remedy:
- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade firmware to later version.
- contact Technical Support.

201016 <location>Firmware changed

Drive object: All objects
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: At least one firmware file in the directory was illegally changed on the non-volatile memory (memory card/device memory) with respect to the version when shipped from the factory.
Alarm value (r2124, interpret decimal):
0: Checksum of one file is incorrect.
1: File missing.
2: File too many.
3: Incorrect firmware version.
4: Incorrect checksum of the back-up file.
Remedy: For the non-volatile memory for the firmware (memory card/device memory), restore the delivery condition.
Note:
The file involved can be read out using parameter r9925.
The status of the firmware check is displayed using r9926.
See also: r9925 (Firmware file incorrect), r9926 (Firmware check status)

201017 <location>Component lists changed

Drive object: All objects
Message value: %1
Reaction: NONE
Acknowledge: NONE

Cause:	On the memory card, one file in the directory /SIEMENS/SINAMICS/DATA or /ADDON/SINAMICS/DATA has been illegally changed with respect to that supplied from the factory. No changes are permitted in this directory. Alarm value (r2124, interpret decimal): xyz dec: x = problem, y = directory, z = file name x = 1: File does not exist. x = 2: Firmware version of the file does not match the software version. x = 3: File checksum is incorrect. y = 0: Directory /SIEMENS/SINAMICS/DATA/ y = 1: Directory /ADDON/SINAMICS/DATA/ z = 0: File MOTARM.ACX z = 1: File MOTSRM.ACX z = 2: File MOTSLM.ACX z = 3: File ENCDATA.ACX z = 4: File FILTDATA.ACX z = 5: File BRKDATA.ACX z = 6: File DAT_BEAR.ACX z = 7: File CFG_BEAR.ACX z = 8: File ENC_GEAR.ACX z = 9: File CFG_BRK.ACX z = 10: File THERMMOTMOD.ACX z = 11: File MAPPING.ACX z = 12: File LOADGEAR.ACX z = 13: File MOTRSM.ACX
Remedy:	For the file on the memory card involved, restore the status originally supplied from the factory.

201020 <location>Writing to RAM disk unsuccessful

Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	A write access to the internal RAM disk was unsuccessful.
Remedy:	Adapt the file size for the system logbook to the internal RAM disk (p9930). See also: p9930 (System logbook activation)

201023 <location>Software timeout (internal)

Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	An internal software timeout has occurred. Fault value (r0949, interpret decimal): Only for internal Siemens troubleshooting.
Remedy:	- carry out a POWER ON (switch-off/switch-on) for all components. - upgrade firmware to later version. - contact Technical Support.

201030 <location>Sign-of-life failure for master control

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-

Reaction: Infeed: OFF1 (NONE, OFF2)
Servo: OFF3 (IASC/DCBRK, NONE, OFF1, OFF2, STOP2)
Hla: OFF3 (NONE, OFF1, OFF2, STOP2)

Acknowledge: IMMEDIATELY

Cause: For active PC master control, no sign-of-life was received within the monitoring time.
The master control was returned to the active BICO interconnection.

Remedy: Set the monitoring time higher at the PC or, if required, completely disable the monitoring function.
The monitoring time is set as follows using the commissioning tool:
<Drive> -> Commissioning -> Control panel -> Button "Fetch master control" -> A window is displayed to set the monitoring time in milliseconds.
Notice:
The monitoring time should be set as short as possible. A long monitoring time means a late response when the communication fails!

201031 <location>Sign-of-life failure for OFF in REMOTE

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: Infeed: OFF1 (NONE, OFF2)
Servo: OFF3 (IASC/DCBRK, NONE, OFF1, OFF2, STOP2)
Hla: OFF3 (NONE, OFF1, OFF2, STOP2)

Acknowledge: IMMEDIATELY

Cause: With the "OFF in REMOTE" mode active, no sign-of-life was received within 3 seconds.

Remedy: - check the data cable connection at the serial interface for the Control Unit (CU) and operator panel.
- check the data cable between the Control Unit and operator panel.

201032 <location>ACX: all parameters must be saved

Drive object: All objects

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The parameters of an individual drive object were saved (p0971 = 1), although there is still no backup of all drive system parameters.
The saved object-specific parameters are not loaded the next time that the system powers up.
For the system to successfully power up, all of the parameters must have been completely backed up.
Alarm value (r2124, interpret decimal):
Only for internal Siemens troubleshooting.
See also: p0971 (Save drive object parameters)

Remedy: Save all parameters (p0977 = 1 or "copy RAM to ROM").
See also: p0977 (Save all parameters)

201033 <location>Units changeover: Reference parameter value invalid

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: Parameter: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: When changing over the units to the referred representation type, it is not permissible for any of the required reference parameters to be equal to 0.0
Fault value (r0949, parameter):
Reference parameter whose value is 0.0.
See also: p0349 (System of units motor equivalent circuit diagram data), p0505 (Selecting the system of units)

Remedy: Set the value of the reference parameter to a number different than 0.0.
See also: p0304, p0305, p0310, p2000, p2001, p2002, p2003, r2004

201034 <location>Units changeover: Calculation parameter values after reference value change unsuccessful

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: Parameter: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: The change of a reference parameter meant that for an involved parameter the selected value was not able to be re-calculated in the per unit representation. The change was rejected and the original parameter value restored.
Fault value (r0949, parameter):
Parameter whose value was not able to be re-calculated.
See also: p0304, p0305, p0310, p2000, p2001, p2002, p2003, r2004

Remedy: - Select the value of the reference parameter such that the parameter involved can be calculated in the per unit representation.
- technology unit selection (p0595) before changing the reference parameter p0596, set p0595 = 1.

201035 <location>ACX: Parameter back-up file corrupted

Drive object: All objects

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: When the Control Unit is booted, no complete data set was found from the parameter back-up files. The last time that the parameterization was saved, it was not completely carried out.
It is possible that the backup was interrupted by switching off or withdrawing the memory card.
Alarm value (r2124, interpret hexadecimal):
ddccbbaa hex:
aa = 01 hex:
Power up was realized without data backup. The drive is in the factory setting.
aa = 02 hex:
The last available backup data record was loaded. The parameterization must be checked. It is recommended that the parameterization is downloaded again.
dd, cc, bb:
Only for internal Siemens troubleshooting.
See also: p0971 (Save drive object parameters), p0977 (Save all parameters)

Remedy: - download the project again using the commissioning tool.
- save all parameters (p0977 = 1 or "copy RAM to ROM").
See also: p0977 (Save all parameters)

201036 <location>ACX: Parameter back-up file missing

Drive object: All objects

Message value: %1

Reaction: Infeed: NONE (OFF2)
Servo: NONE (OFF1, OFF2, OFF3)
Hla: NONE (OFF1, OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause:	When downloading the device parameterization, a parameter back-up file PSxxxxxyy.ACX associated with a drive object cannot be found. Fault value (r0949, interpret hexadecimal): Byte 1: yyy in the file name PSxxxxxyy.ACX yyy = 000 --> consistency back-up file yyy = 001 ... 062 --> drive object number yyy = 099 --> PROFIBUS parameter back-up file Byte 2, 3, 4: Only for internal Siemens troubleshooting.
Remedy:	If you have saved your project data using the commissioning tool, carry-out a new download for your project. Save using the function "Copy RAM to ROM" or with p0977 = 1. This means that the parameter files are again completely written into the non-volatile memory. Note: If the project data have not been backed up, then a new first commissioning is required.

201038 <location>ACX: Loading the parameter back-up file unsuccessful

Drive object:	All objects
Message value:	%1
Reaction:	Infeed: NONE (OFF2) Servo: NONE (OFF1, OFF2, OFF3) Hla: NONE (OFF1, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	An error has occurred when downloading PSxxxxxyy.ACX or PTxxxxxyy.ACX files from the non-volatile memory. Fault value (r0949, interpret hexadecimal): Byte 1: yyy in the file name PSxxxxxyy.ACX yyy = 000 --> consistency back-up file yyy = 001 ... 062 --> drive object number yyy = 099 --> PROFIBUS parameter back-up file Byte 2: 255: Incorrect drive object type. 254: Topology comparison unsuccessful -> drive object type was not able to be identified. Reasons could be: - incorrect component type in the actual topology - Component does not exist in the actual topology. - Component not active. Additional values: Only for internal Siemens troubleshooting. Byte 4, 3: Only for internal Siemens troubleshooting.
Remedy:	- if you have saved the project data using the commissioning tool, download the project again. Save using the function "Copy RAM to ROM" or with p0977 = 1. This means that the parameter files are again completely written to the non-volatile memory. - replace the memory card or Control Unit. For byte 2 = 255: - correct the drive object type (see p0107).

201039 <location>ACX: Writing to the parameter back-up file was unsuccessful

Drive object:	All objects
Message value:	%1

Reaction:	Infeed: NONE (OFF2) Servo: NONE (OFF1, OFF2, OFF3) Hla: NONE (OFF1, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	Writing to at least one parameter back-up file PSxxxxxyy.*** in the non-volatile memory was unsuccessful. - in the directory /USER/SINAMICS/DATA/ at least one parameter back-up file PSxxxxxyy.*** has the "read only" file attribute and cannot be overwritten. - there is not sufficient free memory space available. - the non-volatile memory is defective and cannot be written to. Fault value (r0949, interpret hexadecimal): dcba hex a = yyy in the file names PSxxxxxyy.*** a = 000 --> consistency back-up file a = 001 ... 062 --> drive object number a = 070 --> FEPROM.BIN a = 080 --> DEL4BOOT.TXT a = 099 --> PROFIBUS parameter back-up file b = xxx in the file names PSxxxxxyy.*** b = 000 --> data save started with p0977 = 1 or p0971 = 1 b = 010 --> data save started with p0977 = 10 b = 011 --> data save started with p0977 = 11 b = 012 --> data save started with p0977 = 12 d, c: Only for internal Siemens troubleshooting.
Remedy:	- check the file attribute of the files (PSxxxxxyy.***, CAxxxxxyy.***, CCxxxxxyy.***) and, if required, change from "read only" to "writeable". - check the free memory space in the non-volatile memory. Approx. 80 kbyte of free memory space is required for every drive object in the system. - replace the memory card or Control Unit.

201040 <location>Save parameter settings and carry out a POWER ON

Drive object:	All objects
Message value:	-
Reaction:	OFF2
Acknowledge:	POWER ON
Cause:	A parameter was changed, which means that it is necessary to save the parameters and reboot.
Remedy:	- save parameters (p0971, p0977). - carry out a POWER ON (switch-off/switch-on) for all components. Then: - upload the drive unit (commissioning tool).

201041 <location>Parameter save necessary

Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY

Cause: Defective or missing files were detected on the memory card when booting.

Fault value (r0949, interpret decimal):

- 1: Source file cannot be opened.
- 2: Source file cannot be read.
- 3: Target directory cannot be set up.
- 4: Target file cannot be set up/opened.
- 5: Target file cannot be written to.

Additional values:

Only for internal Siemens troubleshooting.

Remedy:

- save the parameters.
- download the project again to the drive unit.
- update the firmware
- if required, replace the Control Unit and/or memory card card.

201042 **<location>Parameter error during project download**

Drive object: All objects

Message value: Parameter: %1, index: %2, fault cause: %3

Reaction:

Infeed: NONE (OFF1, OFF2)

Servo: OFF2 (NONE, OFF1, OFF3)

Hla: OFF2 (NONE, OFF1, OFF3)

Acknowledge: IMMEDIATELY

Cause:	An error was detected when downloading a project using the commissioning software (e.g. incorrect parameter value). It is possible that the parameter limits are dependent on other parameters. The detailed cause of the fault can be determined using the fault value. Fault value (r0949, interpret hexadecimal): cbbbaaaa hex aaaa = Parameter bb = Index cc = fault cause 0: Parameter number illegal. 1: Parameter value cannot be changed. 2: Lower or upper value limit exceeded. 3: Sub-index incorrect. 4: No array, no sub-index. 5: Data type incorrect. 6: Setting not permitted (only resetting). 7: Descriptive element cannot be changed. 9: Descriptive data not available. 11: No master control. 15: No text array available. 17: Task cannot be executed due to operating state. 20: Illegal value. 21: Response too long. 22: Parameter address illegal. 23: Format illegal. 24: Number of values not consistent. 25: Drive object does not exist. 101: Presently deactivated. 104: Illegal value. 107: Write access not permitted when controller enabled. 108: Unit unknown. 109: Write access only in the commissioning state, encoder (p0010 = 4). 110: Write access only in the commissioning state, motor (p0010 = 3). 111: Write access only in the commissioning state, power unit (p0010 = 2). 112: Write access only in the quick commissioning mode (p0010 = 1). 113: Write access only in the ready mode (p0010 = 0). 114: Write access only in the commissioning state, parameter reset (p0010 = 30). 115: Write access only in the Safety Integrated commissioning state (p0010 = 95). 116: Write access only in the commissioning state, technological application/units (p0010 = 5). 117: Write access only in the commissioning state (p0010 not equal to 0). 118: Write access only in the commissioning state, download (p0010 = 29). 119: Parameter may not be written in download. 120: Write access only in the commissioning state, drive basic configuration (device: p0009 = 3). 121: Write access only in the commissioning state, define drive type (device: p0009 = 2). 122: Write access only in the commissioning state, data set basic configuration (device: p0009 = 4). 123: Write access only in the commissioning state, device configuration (device: p0009 = 1). 124: Write access only in the commissioning state, device download (device: p0009 = 29). 125: Write access only in the commissioning state, device parameter reset (device: p0009 = 30). 126: Write access only in the commissioning state, device ready (device: p0009 = 0). 127: Write access only in the commissioning state, device (device: p0009 not equal to 0). 129: Parameter may not be written in download. 130: Transfer of the master control is inhibited via binector input p0806. 131: Required BICO interconnection not possible because BICO output does not supply floating value
---------------	--

132: Free BICO interconnection inhibited via p0922.
133: Access method not defined.
200: Below the valid values.
201: Above the valid values.
202: Cannot be accessed from the Basic Operator Panel (BOP).
203: Cannot be read from the Basic Operator Panel (BOP).
204: Write access not permitted.

Remedy:

- correct the parameterization in the commissioning tool and download the project again.
- enter the correct value in the specified parameter.
- identify the parameter that restricts the limits of the specified parameter.

201043 <location>Fatal error at project download

Drive object: All objects

Message value: Fault cause: %1

Reaction:

Infeed: NONE (OFF1, OFF2)
Servo: NONE (OFF1, OFF2, OFF3)
Hla: NONE (OFF1, OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause: A fatal error was detected when downloading a project using the commissioning tool.

Fault value (r0949, interpret decimal):

- 1: Device status cannot be changed to Device Download (drive object ON?).
- 2: Incorrect drive object number.
- 3: A drive object that has already been deleted is deleted again.
- 4: Deleting a drive object that has already been registered for generation.
- 5: Deleting a drive object that does not exist.
- 6: Generating an undeleted drive object that already existed.
- 7: Regenerating a drive object already registered for generation.
- 8: Maximum number of drive objects that can be generated exceeded.
- 9: Error while generating a device drive object.
- 10: Error while generating target topology parameters (p9902 and p9903).
- 11: Error when generating a drive object (global component).
- 12: Error when generating a drive object (drive component).
- 13: Unknown drive object type.
- 14: Drive status cannot be changed to "ready for operation" (r0947 and r0949).
- 15: Drive status cannot be changed to drive download.
- 16: Device status cannot be changed to "ready for operation".
- 17: It is not possible to download the topology. The component wiring should be checked, taking into account the various messages/signals.
- 18: A new download is only possible if the factory settings are restored for the drive unit.
- 19: The slot for the option module has been configured several times (e.g. CAN and COMM BOARD)
- 20: The configuration is inconsistent (e.g. CAN for Control Unit, however no CAN configured for drive objects A_INF, SERVO or VECTOR).
- 21: Error when accepting the download parameters.
- 22: Software-internal download error.
- 23: download not possible when know-how protection is activated.
- 24: download not possible during a partial power up after inserting a component.
- 25: The configuration is inconsistent. Know-how protection is either not activated or only partially.

Additional values:

Only for internal Siemens troubleshooting.

- Remedy:**
- use the current version of the commissioning tool.
 - modify the offline project and carry out a new download (e.g. compare the number of drive objects, motor, encoder, power unit in the offline project and at the drive).
 - change the drive state (is a drive rotating or is there a message/signal?).
 - Observe additional active messages/signals and remove their cause (e.g. correct any incorrectly set parameters).
 - automatically calculate the control parameters (p0340). Then set p0010 = 0.
 - boot from previously saved files (switch-off/switch-on or p0976).
 - before a new download, restore the factory setting if the know-how protection was not activated on all drive objects.

201044 <location>CU: Descriptive data error

- Drive object:** All objects
- Message value:** %1
- Reaction:** OFF2
- Acknowledge:** POWER ON
- Cause:** An error was detected when loading the descriptive data saved in the non-volatile memory.
- Remedy:** Replace the memory card or Control Unit.

201045 <location>CU: Configuring data invalid

- Drive object:** All objects
- Message value:** %1
- Reaction:** NONE
- Acknowledge:** NONE
- Cause:** An error was detected when evaluating the parameter files PSxxxxxyy.ACX, PTxxxxxyy.ACX, CAxxxxxyy.ACX, or CCxxxxxyy.ACX saved in the non-volatile memory. Because of this, under certain circumstances, several of the saved parameter values were not able to be accepted.
- Also see r9406 up to r9408.
- Alarm value (r2124, interpret hexadecimal):
- Only for internal Siemens troubleshooting.
- Remedy:**
- check the parameters displayed in r9406 up to r9408, and correct these if required.
 - Restore the factory setting (p0976 = 1) and reload the project into the converter.
- Then save the parameterization in STARTER using the function "Copy RAM to ROM" or with p0977 = 1. This overwrites the incorrect parameter files in the non-volatile memory – and this alarm is withdrawn.
- See also: r9406 (PS file parameter number parameter not transferred), r9407 (PS file parameter index parameter not transferred), r9408 (PS file fault code parameter not transferred)

201049 <location>CU: It is not possible to write to file

- Drive object:** All objects
- Message value:** %1
- Reaction:** NONE
- Acknowledge:** NONE
- Cause:** It is not possible to write into a write-protected file (PSxxxxxx.acx). The write request was interrupted.
- Alarm value (r2124, interpret decimal):
- Drive object number.
- Remedy:** Check whether the "write protected" attribute has been set for the files in the non-volatile memory under .../USER/SINAMICS/DATA/...
- When required, remove write protection and repeat the save operation (e.g. set p0977 = 1).

201050 <location>Memory card and device incompatible

- Drive object:** All objects
- Message value:** -

Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (NONE, OFF1, OFF3) Hla: OFF2 (NONE, OFF1, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	The memory card and the device type do not match (e.g. a memory card for SINAMICS S is inserted in SINAMICS G).
Remedy:	- insert the matching memory card. - use the matching Control Unit or power unit.

201054 <location>CU: System limit exceeded

Drive object:	All objects
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	At least one system overload has been identified. Fault value (r0949, interpret decimal): 1: Computing time load too high (r9976[1]). 5: Peak load too high (r9976[5]). Note: As long as this fault is present, it is not possible to save the parameters (p0971, p0977). See also: r9976 (System utilization)
Remedy:	For fault value = 1, 5: - reduce the computing time load of the drive unit (r9976[1] and r9976[5]) to under 100 %. - check the sampling times and adjust if necessary (p0115, p0799, p4099). - deactivate function modules. - deactivate drive objects. - remove drive objects from the target topology. - note the DRIVE-CLiQ topology rules and if required, change the DRIVE-CLiQ topology. When using the Drive Control Chart (DCC) or free function blocks (FBLOCKS), the following applies: - the computing time load of the individual runtime groups on a drive object can be read out in r21005 (DCC) or r20005 (FBLOCKS). - if necessary, the assignment of the runtime group (p21000, p20000) can be changed in order to increase the sampling time (r21001, r20001). - if necessary, reduce the number of cyclically calculated blocks (DCC) and/or function blocks (FBLOCKS).

201055 <location>CU: Internal error (SYNO of port and application not identical)

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	All applications that operate with slaves at one port must be derived from the same SYNO clock cycle. The first application whose registration (log-on) connects a slave to a port defines the SYNO clock cycle that will be used as basis for the port. Fault value (r0949, interpret hexadecimal): Method ID. Note: Only for internal Siemens troubleshooting.
Remedy:	Contact Technical Support.

201056 <location>CU: Internal error (clock cycle of parameter group already assigned differently)

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value:	%1

Reaction: NONE
Acknowledge: IMMEDIATELY
Cause: The requested parameter group (IREG, NREG, ...) is already being used in a different clock cycle.
 Fault value (r0949, interpret hexadecimal):
 Method ID.
 Note:
 Only for internal Siemens troubleshooting.
Remedy: Contact Technical Support.

201057 <location>CU: Internal error (different DRIVE-CLiQ type for the slave)

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value: %1
Reaction: NONE
Acknowledge: IMMEDIATELY
Cause: The requested DRIVE-CLiQ type (hps_ps, hps_enc, ...) has been specified differently for the same slave component.
 Fault value (r0949, interpret hexadecimal):
 Method ID.
 Note:
 Only for internal Siemens troubleshooting.
Remedy: Contact Technical Support.

201058 <location>CU: Internal error (slave missing in topology)

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value: %1
Reaction: NONE
Acknowledge: IMMEDIATELY
Cause: The requested slave component does not exist in the topology.
 Fault value (r0949, interpret hexadecimal):
 Method ID.
 Note:
 Only for internal Siemens troubleshooting.
Remedy: Contact Technical Support.

201059 <location>CU: Internal error (port does not exist)

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value: %1
Reaction: NONE
Acknowledge: IMMEDIATELY
Cause: The port object assigned according to the topology of the requested slave component does not exist.
 Fault value (r0949, interpret hexadecimal):
 Method ID.
 Note:
 Only for internal Siemens troubleshooting.
Remedy: Contact Technical Support.

201060 <location>CU: Internal error (parameter group not available)

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value: %1
Reaction: NONE

Acknowledge: IMMEDIATELY
Cause: The requested parameter group (IREG, NREG, ...) is not offered by this slave type.
Fault value (r0949, interpret hexadecimal):
Method ID.
Note:
Only for internal Siemens troubleshooting.
Remedy: Contact Technical Support.

201061 <location>CU: Internal error (application not known)

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value: %1
Reaction: NONE
Acknowledge: IMMEDIATELY
Cause: An application that is not registered with TSM has attempted to register with registerSlaves().
The cause can be an unsuccessful TSM registration or an incorrect registration sequence. It is always necessary to log in to the TSM before registerSlaves() can be used.
Fault value (r0949, interpret hexadecimal):
Method ID.
Note:
Only for internal Siemens troubleshooting.
Remedy: Contact Technical Support.

201063 <location>CU: Internal error (PDM)

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value: %1
Reaction: NONE
Acknowledge: IMMEDIATELY
Cause: An internal software error has occurred.
Fault value (r0949, interpret hexadecimal):
Method ID.
Note:
Only for internal Siemens troubleshooting.
Remedy: Contact Technical Support.

201064 <location>CU: Internal error (CRC)

Drive object: All objects
Message value: -
Reaction: NONE
Acknowledge: NONE
Cause: A checksum error (CRC error) has occurred in the Control Unit program memory
Remedy:
- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade firmware to later version.
- contact Technical Support.

201068 <location>CU: Data memory memory overflow

Drive object: All objects
Message value: %1
Reaction: OFF2
Acknowledge: IMMEDIATELY

Cause: The utilization for a data memory area is too large.
 Fault value (r0949, interpret binary):
 Bit 0 = 1: High-speed data memory 1 overloaded
 Bit 1 = 1: High-speed data memory 2 overloaded
 Bit 2 = 1: High-speed data memory 3 overloaded
 Bit 3 = 1: High-speed data memory 4 overloaded

Remedy:

- deactivate the function module.
- deactivate drive object.
- remove the drive object from the target topology.

201069 <location>Parameter backup and device incompatible

Drive object: All objects

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The parameter backup on the memory card and the drive unit do not match.
 The module boots with the factory settings.
 Example:
 Devices A and B. are not compatible and a memory card with the parameter backup for device A is inserted in device B.

Remedy:

- insert a memory card with compatible parameter backup and carry out a POWER ON.
- insert a memory card without parameter backup and carry out a POWER ON.
- save the parameters (p0977 = 1).

201070 <location>Project/firmware is being downloaded to the memory card

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: An upgrade (project/firmware download) was initiated on the memory card.
 While this fault is present, the corresponding update takes place with plausibility and consistency checks. After this, depending on the command option, a new boot (reset) for the Control Unit is initiated.
 Caution:
 During the upgrade and while this fault is present, it is not permissible to switch off the Control Unit.
 If the operation is interrupted, this can destroy the file system on the memory card. The memory card will then no longer work properly and must be repaired.

Remedy: Not necessary.
 The fault is automatically withdrawn after the upgrade has been completed.

201072 <location>Memory card restored from the backup copy

Drive object: All objects

Message value: -

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: The Control Unit was switched-off while writing to the memory card. This is why the visible partition became defective.
 After switching on, the data from the non-visible partition (backup copy) were written to the visible partition.

Remedy: Check that the firmware and parameterization is up-to-date.

201073 <location>POWER ON required for backup copy on memory card

Drive object: All objects

Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The parameter assignment on the visible partition of the memory card has changed. In order that the backup copy on the memory card is updated on the non-visible partition, it is necessary to carry out a POWER ON or hardware reset (p0972) of the Control Unit. Note: It is possible that a new POWER ON is requested via this alarm (e.g. after saving with p0971 = 1).
Remedy:	- carry out a POWER ON (switch-off/switch-on) for the Control Unit. - carry out a hardware reset (RESET button, p0972).

201082 <location>Parameter error when powering up from data backup

Drive object:	All objects
Message value:	Parameter: %1, index: %2, fault cause: %3
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (NONE, OFF1, OFF3) Hla: OFF2 (NONE, OFF1, OFF3)
Acknowledge:	IMMEDIATELY

Cause: Parameterizing errors have been detected (e.g. incorrect parameter value). It is possible that the parameter limits are dependent on other parameters.

The detailed cause of the fault can be determined using the fault value.

Fault value (r0949, interpret hexadecimal):

cbbbaaaa hex

aaaa = Parameter

bb = Index

cc = fault cause

0: Parameter number illegal.

1: Parameter value cannot be changed.

2: Lower or upper value limit exceeded.

3: Sub-index incorrect.

4: No array, no sub-index.

5: Data type incorrect.

6: Setting not permitted (only resetting).

7: Descriptive element cannot be changed.

9: Descriptive data not available.

11: No master control.

15: No text array available.

17: Task cannot be executed due to operating state.

20: Illegal value.

21: Response too long.

22: Parameter address illegal.

23: Format illegal.

24: Number of values not consistent.

25: Drive object does not exist.

101: Presently deactivated.

104: Illegal value.

107: Write access not permitted when controller enabled.

108: Unit unknown.

109: Write access only in the commissioning state, encoder (p0010 = 4).

110: Write access only in the commissioning state, motor (p0010 = 3).

111: Write access only in the commissioning state, power unit (p0010 = 2).

112: Write access only in the quick commissioning mode (p0010 = 1).

113: Write access only in the ready mode (p0010 = 0).

114: Write access only in the commissioning state, parameter reset (p0010 = 30).

115: Write access only in the Safety Integrated commissioning state (p0010 = 95).

116: Write access only in the commissioning state, technological application/units (p0010 = 5).

117: Write access only in the commissioning state (p0010 not equal to 0).

118: Write access only in the commissioning state, download (p0010 = 29).

119: Parameter may not be written in download.

120: Write access only in the commissioning state, drive basic configuration (device: p0009 = 3).

121: Write access only in the commissioning state, define drive type (device: p0009 = 2).

122: Write access only in the commissioning state, data set basic configuration (device: p0009 = 4).

123: Write access only in the commissioning state, device configuration (device: p0009 = 1).

124: Write access only in the commissioning state, device download (device: p0009 = 29).

125: Write access only in the commissioning state, device parameter reset (device: p0009 = 30).

126: Write access only in the commissioning state, device ready (device: p0009 = 0).

127: Write access only in the commissioning state, device (device: p0009 not equal to 0).

129: Parameter may not be written in download.

130: Transfer of the master control is inhibited via binector input p0806.

131: Required BICO interconnection not possible because BICO output does not supply floating value

132: Free BICO interconnection inhibited via p0922.
133: Access method not defined.
200: Below the valid values.
201: Above the valid values.
202: Cannot be accessed from the Basic Operator Panel (BOP).
203: Cannot be read from the Basic Operator Panel (BOP).
204: Write access not permitted.

Remedy:

- correct the parameterization in the commissioning tool and download the project again.
- enter the correct value in the specified parameter.
- identify the parameter that restricts the limits of the specified parameter.

201097 <location>NTP server cannot be accessed

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The selected NTP server (p3105[0...3]) cannot be accessed. Time synchronization cannot be performed.

Note:

NTP: Network Time Protocol

Remedy: Correctly set the IP address of the NTP server, and check the connection to the NTP server.

201099 <location>UTC synchronization tolerance violated

Drive object: All objects

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The tolerance (p3109) set for UTC synchronization was violated.

Note:

UTC: Universal Time Coordinates

See also: p3109 (UTC synchronization tolerance)

Remedy: Select the synchronization intervals shorter so that the deviation between the time of day master and drive system lies within the tolerance.

Note:

The deviation when synchronizing is shown in r3107.

See also: r3107 (UTC synchronization time out of tolerance)

201100 <location>CU: Memory card withdrawn

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The memory card (non-volatile memory) was withdrawn during operation.

Notice:

It is not permissible for the memory card to be withdrawn or inserted under voltage.

Remedy:

- switch off the drive system.
- re-insert the memory card that was withdrawn - this card must match the drive system.
- switch on the drive system again.

201105	<location>CU: Insufficient memory
Drive object:	All objects
Message value:	%1
Reaction:	OFF1
Acknowledge:	POWER ON
Cause:	Too many functions have been configured on this Control Unit (e.g. too many drives, function modules, data sets, Technology Extensions, blocks, etc). Fault value (r0949, interpret decimal): Only for internal Siemens troubleshooting.
Remedy:	- change the configuration on this Control Unit (e.g. fewer drives, function modules, data sets, Technology Extensions, blocks, etc). - use an additional Control Unit.
201106	<location>CU: Insufficient memory
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	There is not sufficient free memory space available.
Remedy:	Not necessary.
201107	<location>CU: Save to memory card unsuccessful
Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	A data save in the non-volatile memory was not able to be successfully carried out. - non-volatile memory is defective. - insufficient space in the non-volatile memory. Fault value (r0949, interpret decimal): Only for internal Siemens troubleshooting.
Remedy:	- try to save again. - replace the memory card or Control Unit.
201110	<location>CU: More than one SINAMICS G on one Control Unit
Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	More than one SINAMICS G type power unit is being operated from the Control Unit. Fault value (r0949, interpret decimal): Number of the second drive with a SINAMICS G type power unit.
Remedy:	Only one SINAMICS G drive type is permitted.
201111	<location>CU: Mixed operation of drive units illegal
Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY

Cause: Illegal operation of various drive units on one Control Unit:
- SINAMICS S together with SINAMICS G
- SINAMICS S together with SINAMICS S Value or Combi
Fault value (r0949, interpret decimal):
Number of the first drive object with a different power unit type.

Remedy: Only power units of one particular drive type may be operated with one Control Unit.

201112 <location>CU: Power unit not permissible

Drive object: All objects
Message value: %1
Reaction: NONE
Acknowledge: IMMEDIATELY
Cause: The connected power unit cannot be used together with this Control Unit.
Fault value (r0949, interpret decimal):
1: Power unit is not supported (e.g. PM240).
2: DC/AC power unit connected to CU310 not permissible.
3: Power unit (S120M) not permitted for vector control.

Remedy: Replace the power unit that is not permissible by a component that is permissible.

201120 <location>Terminal initialization has failed

Drive object: All objects
Message value: %1
Reaction: OFF1 (OFF2)
Acknowledge: IMMEDIATELY (POWER ON)
Cause: An internal software error occurred while the terminal functions were being initialized.
Fault value (r0949, interpret hexadecimal):
Only for internal Siemens troubleshooting.

Remedy:
- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade firmware to later version.
- contact Technical Support.
- replace the Control Unit.

201122 <location>Frequency at the measuring probe input too high

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value: %1
Reaction: OFF1 (OFF2)
Acknowledge: IMMEDIATELY
Cause: The frequency of the pulses at the measuring probe input is too high.
Fault value (r0949, interpret decimal):
1: DI/DO 9 (X122.8)
2: DI/DO 10 (X122.10)
4: DI/DO 11 (X122.11)
8: DI/DO 13 (X132.8)
16: DI/DO 14 (X132.10)
32: DI/DO 15 (X132.11)
64: DI/DO 8 (X122.7)
128: DI/DO 12 (X132.7)

Remedy: Reduce the frequency of the pulses at the measuring probe input.

201122 <location>Frequency at the measuring probe input too high**Drive object:** CU_NX_828, CU_NX_COMBI**Message value:** %1**Reaction:** OFF1 (OFF2)**Acknowledge:** IMMEDIATELY**Cause:** The frequency of the pulses at the measuring probe input is too high.

Fault value (r0949, interpret decimal):

1: DI/DO 9 (X122.8)

2: DI/DO 10 (X122.10)

4: DI/DO 11 (X122.11)

64: DI/DO 8 (X122.7)

Remedy: Reduce the frequency of the pulses at the measuring probe input.

201123 <location>Power unit does not support digital inputs/outputs**Drive object:** SERVO_828**Message value:** -**Reaction:** OFF1 (OFF2)**Acknowledge:** IMMEDIATELY**Cause:** Power unit does not support the activated "digital inputs/outputs" function module**Remedy:** Deactivate the function module.

201150 <location>CU: Number of instances of a drive object type exceeded**Drive object:** All objects**Message value:** Drive object type: %1, number permitted: %2, actual number: %3**Reaction:** NONE**Acknowledge:** IMMEDIATELY**Cause:** The maximum permissible number of instances of a drive object type was exceeded.

Drive object type:

Drive object type (p0107), for which the maximum permissible number of instances was exceeded.

Number permitted:

Max. permissible number of instances for this drive object type.

Actual number:

Current number of instances for this drive object type.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

ddccbbaa hex: aa = drive object type, bb = number limited, cc = actual number, dd = no significance

Remedy: - switch off the unit.

- suitably restrict the number of instances of a drive object type by reducing the number of inserted components.

- re-commission the unit.

201151 <location>CU: Number of drive objects of a category exceeded**Drive object:** All objects**Message value:** Drive object category: %1, number permitted: %2, actual number: %3**Reaction:** NONE**Acknowledge:** IMMEDIATELY

Cause:	The maximum permissible number of drive objects of a category was exceeded. Drive object category: Drive object category, for which the maximum permissible number of drive objects was exceeded. Number permitted: Max. permissible number for this drive object category. Actual number: Actual number for this drive object category. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): ddccbbaa hex: aa = drive object category, bb = number limited, cc = actual number, dd = no significance
Remedy:	- switch off the unit. - suitably restrict the number of drive objects of the specified category by reducing the number of inserted components. - re-commission the unit.

201152 <location>CU: Invalid constellation of drive object types

Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	POWER ON
Cause:	It is not possible to simultaneously operate drive object types SERVO, VECTOR and HLA. A maximum of 2 of these drive object types can be operated on a Control Unit.
Remedy:	- switch off the unit. - restrict the use of drive object types SERVO, VECTOR, HLA to a maximum of 2. - re-commission the unit.

201200 <location>CU: Time slice management internal software error

Drive object:	All objects
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	A time slice management error has occurred. It is possible that the sampling times have been inadmissibly set. Fault value (r0949, interpret hexadecimal): 998: Too many time slices occupied by technology functions (e.g. DCC). 999: Too many time slices occupied by the basic system. Too many different sampling times may have been set. Additional values: Only for internal Siemens troubleshooting.
Remedy:	- check the sampling time setting (p0112, p0115, p4099, p9500, p9511). - contact Technical Support.

201205 <location>CU: Time slice overflow

Drive object:	All objects
Message value:	%1
Reaction:	OFF2
Acknowledge:	POWER ON
Cause:	Insufficient processing time is available for the existing topology. Fault value (r0949, interpret hexadecimal): Only for internal Siemens troubleshooting.

Remedy:

- reduce the number of drives.
- increase the sampling times.

201221 <location>CU: Basic clock cycle too low

Drive object: All objects

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: The closed-loop control / monitoring cannot maintain the envisaged clock cycle.
 The runtime of the closed-loop control/monitoring is too long for the particular clock cycle or the computing time remaining in the system is not sufficient for the closed-loop control/monitoring.
 Fault value (r0949, interpret hexadecimal):
 Only for internal Siemens troubleshooting.

Remedy: Increase the basic clock cycle of DRIVE-CLiQ communication.
 See also: p0112 (Sampling times pre-setting p0115)

201222 <location>CU: Basic clock cycle too low (computing time for communication not available)

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: A time slice has not been defined that fulfills the requirements.
 The port cannot be correctly operated as the alternating cyclic clock cycle cannot be maintained.
 Fault value (r0949, interpret hexadecimal):
 Method ID.
 Note:
 Only for internal Siemens troubleshooting.

Remedy: Contact Technical Support.

201223 <location>CU: Sampling time inconsistent

Drive object: All objects

Message value: %1

Reaction: NONE

Acknowledge: NONE

- Cause:** When changing a sampling time (p0115[0], p0799 or p4099), inconsistency between the clock cycles has been identified.
Alarm value (r2124, interpret decimal):
- 1: Value lower than minimum value.
 - 2: Value higher than maximum value.
 - 3: Value not a multiple of 1.25 μ s.
 - 4: Value does not match isochronous PROFIBUS operation.
 - 5: Value not a multiple of 125 μ s.
 - 6: Value not a multiple of 250 μ s.
 - 7: Value not a multiple of 375 μ s.
 - 8: Value not a multiple of 400 μ s.
 - 10: Special restriction of the drive object violated.
 - 20: On a SERVO with a sampling time of 62.5 μ s, more than two drive objects or one drive object of a type other than SERVO have been detected on the same DRIVE-CLiQ line (a maximum of two SERVO type drive objects are permitted).
 - 21: Value can be a multiple of the current controller sampling time of a servo or vector drive in the system (e.g. for TB30, the values of all of the indices should be taken into account).
 - 30: Value less than 31.25 μ s.
 - 31: Value less than 62.5 μ s (31.25 μ s is not supported for SMC10, SMC30, SMI10 and Double Motor Modules).
 - 32: Value less than 125 μ s.
 - 33: Value less than 250 μ s.
 - 40: Nodes have been identified on the DRIVE-CLiQ line whose highest common denominator of the sampling times is less than 125 μ s. Further, none of the nodes has a sampling time of less than 125 μ s.
 - 41: A chassis unit was identified on the DRIVE-CLiQ line as a node. Further, the highest common denominator of the sampling times of all of the nodes connected to the line is less than 250 μ s.
 - 42: An Active Line Module was identified on the DRIVE-CLiQ line as a node. Further, the highest common denominator of the sampling times of all of the nodes connected to the line is less than 125 μ s.
 - 43: A Voltage Sensing Module (VSM) was identified on the DRIVE-CLiQ line as a node. Further, the highest common denominator of the sampling times of all of the nodes connected to the line is not equal to the current controller sampling time of the drive object of the VSM.
 - 44: The highest common denominator of the sampling times of all of the components connected to the DRIVE-CLiQ line is not the same for all components of this drive object (e.g. there are components on different DRIVE-CLiQ lines on which different highest common denominators are generated).
 - 45: A chassis parallel unit was identified on the DRIVE-CLiQ line as a node. Further, the highest common denominator of the sampling times of all of the nodes connected to the line is less than 162.5 μ s or 187.5 μ s (for a 2x or 3x parallel connection).
 - 46: A node has been identified on the DRIVE-CLiQ line whose sampling time is not a multiple of the lowest sampling time on this line.
 - 52: Nodes have been identified on the DRIVE-CLiQ line whose highest common denominator of the sampling times is less than 31.25 μ s.
 - 54: Nodes have been identified on the DRIVE-CLiQ line whose highest common denominator of the sampling times is less than 62.5 μ s.
 - 56: Nodes have been identified on the DRIVE-CLiQ line whose highest common denominator of the sampling times is less than 125 μ s.
 - 58: Nodes have been identified on the DRIVE-CLiQ line whose highest common denominator of the sampling times is less than 250 μ s.
 - 99: Inconsistency of cross drive objects detected.
 - 116: Recommended clock cycle in r0116[0...1].
- General note:
The topology rules should be noted when connecting up DRIVE-CLiQ (refer to the appropriate product documentation).
The parameters of the sampling times can also be changed with automatic calculations.
Example for highest common denominator: 125 s, 125 μ s, 62.5 μ s --> 62.5 μ s
- Remedy:**
- check the DRIVE-CLiQ cables.
 - set a valid sampling time.
- See also: p0115, p0799, p4099

201224 <location>CU: Pulse frequency inconsistent**Drive object:** All objects**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE**Cause:** When changing the minimum pulse frequency (p0113) inconsistency between the pulse frequencies was identified.

Alarm value (r2124, interpret decimal):

1: Value lower than minimum value.

2: Value higher than maximum value.

3: Resulting sampling time is not a multiple of 1.25 µs.

4: Value does not match isochronous PROFIBUS operation.

10: Special restriction of the drive object violated.

99: Inconsistency of cross drive objects detected.

116: Recommended clock cycle in r0116[0...1].

Remedy: Set a valid pulse frequency.

See also: p0113 (Minimum pulse frequency, selection)

201250 <location>CU: CU-EEPROM incorrect read-only data**Drive object:** All objects**Message value:** %1**Reaction:** NONE (OFF2)**Acknowledge:** POWER ON**Cause:** Error when reading the read-only data of the EEPROM in the Control Unit.

Fault value (r0949, interpret decimal):

Only for internal Siemens troubleshooting.

Remedy: - carry out a POWER ON (switch-off/switch-on).

- replace the Control Unit.

201251 <location>CU: CU-EEPROM incorrect read-write data**Drive object:** All objects**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE**Cause:** Error when reading the read-write data of the EEPROM in the Control Unit.

Alarm value (r2124, interpret decimal):

Only for internal Siemens troubleshooting.

Remedy: For alarm value r2124 < 256, the following applies:

- carry out a POWER ON (switch-off/switch-on).

- replace the Control Unit.

For alarm value r2124 ≥ 256, the following applies:

- for the drive object with this alarm, clear the fault memory (p0952 = 0).

- as an alternative, clear the fault memory of all drive objects (p2147 = 1).

- replace the Control Unit.

201255 <location>CU: Option Board EEPROM read-only data error**Drive object:** All objects**Message value:** %1**Reaction:** NONE (OFF2)**Acknowledge:** POWER ON

Cause: Error when reading the read-only data of the EEPROM in the Option Board.
Fault value (r0949, interpret decimal):
Only for internal Siemens troubleshooting.

Remedy: - carry out a POWER ON (switch-off/switch-on).
- replace the Control Unit.

201256 <location>CU: Option Board EEPROM read-write data error

Drive object: All objects

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: Error when reading the read-write data of the EEPROM in the Option Board.
Alarm value (r2124, interpret decimal):
Only for internal Siemens troubleshooting.

Remedy: - carry out a POWER ON (switch-off/switch-on).
- replace the Control Unit.

201260 <location>Software not released

Drive object: All objects

Message value: -

Reaction: Infeed: OFF1
Servo: OFF3
Hla: OFF3

Acknowledge: POWER ON

Cause: The runtime software (RT-SW) has not been released.

Remedy: Only for internal Siemens troubleshooting.

201275 <location>Hardware description error

Drive object: All objects

Message value: %1

Reaction: Infeed: OFF2
Servo: OFF3
Hla: OFF3

Acknowledge: POWER ON

Cause: An error has occurred while accessing the hardware description file on the CompactFlash card.
Directory and file name: ADDON/SINAMICS/DATA/HW_DESC/<DOType>/DESC0000
Fault value (r0949, interpret decimal):
22: File not found.
24: File read access error.
26: Format error.
28: Version error.
30: Internal reader error.
40: Contents error.
45: Hardware description not consistent.
60: Inconsistency: Number of Power Stack Adapters (PSA).
61: Inconsistency: Number of Sensor Module Cabinets (SMC).
62: Inconsistency: Number of Voltage Sensing Modules (VSM).
63: Inconsistency: Number of Terminal Modules (TM).
64: Inconsistency: Number of Terminal Boards (TB).

Remedy: Only for internal Siemens troubleshooting.

201276 <location>Hardware description not fully compatible**Drive object:** All objects**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE**Cause:** The hardware description file contains more data than the firmware requires.**Remedy:** Not necessary.

201302 <location>Error in the component trace**Drive object:** A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE**Cause:** An error has occurred in the component trace.

The message appears in the following cases:

- upload trace data (p7792 = 1).

- change factory setting (p7790, p7791) for missing property "component trace" (r0193.1 = 0).

Alarm value (r2124, interpret decimal):

1: The DRIVE-CLiQ component does not support the component trace (r0193.1 = 0).

101: Data from trace 1 cannot be read.

102: Data from trace 2 cannot be read.

103: Data from trace 3 cannot be read.

104: Data from trace 4 cannot be read.

105: Data from trace 5 cannot be read.

Remedy: For alarm value = 1:

Upgrade the firmware of the DRIVE-CLiQ component involved.

201303 <location>Component does not support the required function**Drive object:** All objects**Message value:** %1**Reaction:** OFF2**Acknowledge:** IMMEDIATELY

Cause:	A function requested by the Control Unit is not supported by a DRIVE-CLiQ component. Fault value (r0949, interpret decimal): 1: The component does not support the deactivation. 101: The Motor Module does not support an internal armature short-circuit. 102: The Motor Module does not support the deactivation. 201: The Sensor Module does not support actual value inversion (p0410.0 = 1) when using a Hall sensor (p0404.6 = 1) for the commutation. 202: The Sensor Module does not support parking/unparking. 203: The Sensor Module does not support the deactivation. 204: The firmware of this Terminal Module 15 (TM15) does not support the application TM15DI/DO. 205: The Sensor Module does not support the selected temperature evaluation (r0458, r0459). 206: The firmware of this Terminal Modules TM41/TM31/TM15 refers to an old firmware version. It is urgently necessary to upgrade the firmware to ensure disturbance-free operation. 207: The power unit with this hardware version does not support operation with device supply voltages of less than 380 V. 208: The Sensor Module does not support deselection of commutation with zero mark (via p0430.23). 211: The Sensor Module does not support single-track encoders (r0459.10). 212: The Sensor Module does not support LVDT sensors (p4677.0). 213: The Sensor Module does not support the characteristic type (p4662). 214: The power unit does not support the temperature evaluation via PT1000 (r0193). 215: The Terminal Module does not support the temperature evaluation via PT1000 216: The Voltage Sensing Module (VSM) does not support operation with a PT1000 temperature sensor.
Remedy:	Upgrade the firmware of the DRIVE-CLiQ component involved. For fault value = 205, 214, 215: - check parameter p0600 and p0601 and if required, adapt. For fault value = 207: - replace the power unit or if required set the device supply voltage higher (p0210). For fault value = 208: - check parameter p0430.23 and reset if necessary. For fault value = 216: - check the setting of the sensor type (p3665). - use a Voltage Sensing module that supports operation with PT1000 (MLFB ...-xxx1).

201304 <location>Firmware version of DRIVE-CLiQ component is not up-to-date

Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The non-volatile memory has a more recent firmware version than the one in the connected DRIVE-CLiQ component. Alarm value (r2124, interpret decimal): Component number of the DRIVE-CLiQ component involved.
Remedy:	Update the firmware (p7828, p7829 - or commissioning tool).

201305 <location>Topology: Component number missing

Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY

Cause:	The component number from the topology was not parameterized (p0121 (for power unit, refer to p0107), p0131 (for servo/vector drives, refer to p0107), p0141, p0151, p0161). Fault value (r0949, interpret decimal): Data set number. Note: The fault also occurs if encoders have been configured (p0187 to p0189) but no component numbers exist for them. In this case, the fault value includes the drive data set number plus 100 * encoder number (e.g. 3xx, if a component number was not entered in p0141 for encoder 3 (p0189)). See also: p0121, p0131, p0141, p0142, p0151, p0161, p0186, p0187, p0188, p0189
Remedy:	- enter missing component number. - if required, remove the component and restart commissioning. See also: p0121, p0131, p0141, p0142, p0151, p0161, p0186, p0187, p0188, p0189

201306 <location>Firmware of the DRIVE-CLiQ component being updated

Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	Firmware update is active for at least one DRIVE-CLiQ component. Alarm value (r2124, interpret decimal): Component number of the DRIVE-CLiQ component.
Remedy:	Not necessary. This alarm is automatically withdrawn after the firmware update has been completed.

201314 <location>Topology: Component must not be present

Drive object:	All objects
Message value:	%1, to %2, %3, connection: %4
Reaction:	NONE
Acknowledge:	NONE
Cause:	For a component, "deactivate and not present" is set but this component is still in the topology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: aa = component number bb = component class of the component cc = connection number Note: Component class and connection number are described in F01375.
Remedy:	- remove the corresponding component. - change the setting "deactivate and not present". Note: Under "Topology --> Topology view", the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison). See also: p0105, p0125, p0145, p0155, p0165

201317 <location>Deactivated component again present

Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE

Cause: If a component of the target topology for an active drive object is inserted and the associated parameter of the component is set to "deactivate" (p0125, p0145, p0155, p0165).

Note:

This is the only message that is displayed for a deactivated component.

Remedy: The alarm is automatically withdrawn for the following actions:

- activate the components involved (p0125 = 1, p0145 = 1, p0155 = 1, p0165 = 1).
- again withdraw the component involved.

See also: p0125 (Activate/deactivate power unit components), p0145, p0155, p0165 (Activate/deactivate filter module)

201318 <location>BICO: Deactivated interconnections present

Drive object: All objects

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: This alarm is used in the following cases:

- if an inactive/non-operational drive object is active again/ready for operation
- if there are items in the list of BI/CI parameters (r9498[0...29], r9499[0...29])
- if the BICO interconnections saved in the list of BI/CI parameters (r9498[0...29], r9499[0...29]) have actually been changed

Remedy: Reset alarm:

- set p9496 to 1 or 2
- or
- deactivate the drive object again.

201319 <location>Inserted component not initialized

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: Initialization is required for at least one inserted component.

This is only possible if the pulses are inhibited for all the drive objects.

Remedy: Activate pulse inhibit for all drive objects.

201320 <location>Topology: Drive object number does not exist in configuration

Drive object: All objects

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: A drive object number is missing in p0978

Alarm value (r2124, interpret decimal):

Index of p0101 under which the missing drive object number can be determined.

Remedy: Set p0009 to 1 and change p0978:

Rules:

- p0978 must include all of the drive object numbers (p0101).
- it is not permissible for a drive object number to be repeated.
- by entering a 0, the drive objects with PZD are separated from those without PZD.
- only 2 partial lists are permitted. After the second 0, all values must be 0.
- dummy drive object numbers (255) are only permitted in the first partial list.

201321 <location>Topology: Drive object number does not exist in configuration**Drive object:** All objects**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE

Cause: p0978 contains a drive object number that does not exist.
 Alarm value (r2124, interpret decimal):
 Index of p0978 under which the drive object number can be determined.

Remedy: Set p0009 to 1 and change p0978:
 Rules:
 - p0978 must include all of the drive object numbers (p0101).
 - it is not permissible for a drive object number to be repeated.
 - by entering a 0, the drive objects with PZD are separated from those without PZD.
 - only 2 partial lists are permitted. After the second 0, all values must be 0.
 - dummy drive object numbers (255) are only permitted in the first partial list.

201322 <location>Topology: Drive object number present twice in configuration**Drive object:** All objects**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE

Cause: A drive object number is present more than once in p0978.
 Alarm value (r2124, interpret decimal):
 Index of p0978 under which the involved drive object number is located.

Remedy: Set parameter p0009 = 1 and change p0978:
 Rules:
 - p0978 must include all of the drive object numbers (p0101).
 - it is not permissible for a drive object number to be repeated.
 - by entering a 0, the drive objects with PZD are separated from those without PZD.
 - only 2 partial lists are permitted. After the second 0, all values must be 0.
 - dummy drive object numbers (255) are only permitted in the first partial list.

201323 <location>Topology: More than two partial lists created**Drive object:** All objects**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE

Cause: Partial lists are available more than twice in p0978. After the second 0, all must be 0.
 Alarm value (r2124, interpret decimal):
 Index of p0978 under which the illegal value is located.

Remedy: Set p0009 to 1 and change p0978:
 Rules:
 - p0978 must include all of the drive object numbers (p0101).
 - it is not permissible for a drive object number to be repeated.
 - by entering a 0, the drive objects with PZD are separated from those without PZD.
 - only 2 partial lists are permitted. After the second 0, all values must be 0.
 - dummy drive object numbers (255) are only permitted in the first partial list.

201324 <location>Topology: Dummy drive object number incorrectly created**Drive object:** All objects

Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	In p0978, dummy drive object numbers (255) are only permitted in the first partial list. Alarm value (r2124, interpret decimal): Index of p0978 under which the illegal value is located.
Remedy:	Set p0009 to 1 and change p0978: Rules: - p0978 must include all of the drive object numbers (p0101). - it is not permissible for a drive object number to be repeated. - by entering a 0, the drive objects with PZD are separated from those without PZD. - only 2 partial lists are permitted. After the second 0, all values must be 0. - dummy drive object numbers (255) are only permitted in the first partial list.

201325	<location>Topology: Component number not present in target topology
Drive object:	All objects
Message value:	Component number: %1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	The component configured in a parameter (e.g. p0121, p0131, etc.) is not present in the target topology. Fault value (r0949, interpret decimal): Configured component number that is not present in target topology.
Remedy:	Establish topology and DO configuration consistency.

201330	<location>Topology: Quick commissioning not possible
Drive object:	All objects
Message value:	Fault cause: %1, supplementary information: %2, preliminary component number: %3
Reaction:	NONE
Acknowledge:	NONE

- Cause:** Unable to carry out a quick commissioning. The existing actual topology does not fulfill the requirements.
Alarm value (r2124, interpret hexadecimal):
ccccbbaa hex: cccc = preliminary component number, bb = supplementary information, aa = fault cause
aa = 01 hex = 1 dec:
On one component illegal connections were detected.
- bb = 01 hex = 1 dec: For a Motor Module, more than one motor with DRIVE-CLiQ was detected.
 - bb = 02 hex = 2 dec: For a motor with DRIVE-CLiQ, the DRIVE-CLiQ cable is not connected to a Motor Module.
- aa = 02 hex = 2 dec:
The topology contains too many components of a particular type.
- bb = 01 hex = 1 dec: There is more than one master Control Unit.
 - bb = 02 hex = 2 dec: There is more than 1 infeed (8 for a parallel circuit configuration).
 - bb = 03 hex = 3 dec: There are more than 10 Motor Modules (8 for a parallel circuit configuration).
 - bb = 04 hex = 4 dec: There are more than 9 encoders.
 - bb = 05 hex = 5 dec: There are more than 8 Terminal Modules.
 - bb = 07 hex = 7 dec: Unknown component type
 - bb = 08 hex = 8 dec: There are more than 6 drive slaves.
 - bb = 09 hex = 9 dec: Connection of a drive slave not permitted.
 - bb = 0a hex = 10 dec: There is no drive master.
 - bb = 0b hex = 11 dec: There is more than one motor with DRIVE-CLiQ for a parallel circuit.
 - bb = 0c hex = 12 dec: Different power units are being used in a parallel connection.
- cccc: Not used.
- aa = 03 hex = 3 dec:
More than 16 components are connected at a DRIVE-CLiQ socket of the Control Unit.
- bb = 0, 1, 2, 3 means e.g. detected at the DRIVE-CLiQ socket X100, X101, X102, X103.
- cccc: Not used.
- aa = 04 hex = 4 dec:
The number of components connected one after the other is greater than 125.
- bb: Not used.
- cccc = preliminary component number of the first component and component that resulted in the fault.
- aa = 05 hex = 5 dec:
The component is not permissible for SERVO.
- bb = 01 hex = 1 dec: SINAMICS G available.
 - bb = 02 hex = 2 dec: Chassis available.
- cccc = preliminary component number of the first component and component that resulted in the fault.
- aa = 06 hex = 6 dec:
On one component illegal EEPROM data was detected. These must be corrected before the system continues to boot.
- bb = 01 hex = 1 dec: The Article No. [MLFB] of the power unit that was replaced includes a space retainer. The space retainer (*) must be replaced by a correct character.
- cccc = preliminary component number of the component with illegal EEPROM data.
- aa = 07 hex = 7 dec:
The actual topology contains an illegal combination of components.
- bb = 01 hex = 1 dec: Active Line Module (ALM) and Basic Line Module (BLM).
 - bb = 02 hex = 2 dec: Active Line Module (ALM) and Smart Line Module (SLM).
 - bb = 03 hex = 3 dec: SIMOTION control (e.g. SIMOTION D445) and SINUMERIK component (e.g. NX15).
 - bb = 04 hex = 4 dec: SINUMERIK control (e.g. SINUMERIK 730.net) and SIMOTION component (e.g. CX32).
- cccc: Not used.
- aa = 08 hex = 8 dec:
The motor is not completely connected.
- bb: Not used.
- cccc: Not used.
- Note:**
Connection type and connection number are described in F01375.

See also: p0097 (Select drive object type), r0098 (Actual device topology), p0099 (Device target topology)

Remedy:

- adapt the output topology to the permissible requirements.
- commission the device using the commissioning tool.
- for motors with DRIVE-CLiQ, connect the power and DRIVE-CLiQ cable to the same Motor Module (Single Motor Module: DRIVE-CLiQ at X202, Double Motor Module: DRIVE-CLiQ from motor 1 (X1) to X202, from motor 2 (X2) to X203).

For aa = 06 hex = 6 dec and bb = 01 hex = 1 dec:
Correct the Article No. when commissioning using the commissioning tool.
See also: p0097 (Select drive object type), r0098 (Actual device topology), p0099 (Device target topology)

201331 <location>Topology: At least one component not assigned to a drive object

Drive object: All objects

Message value: Component number: %1

Reaction: NONE

Acknowledge: NONE

Cause: At least one component is not assigned to a drive object.

- when commissioning, a component was not able to be automatically assigned to a drive object.
- the parameters for the data sets are not correctly set.

Alarm value (r2124, interpret decimal):
Component number of the unassigned component.

Remedy: This component is assigned to a drive object.
Check the parameters for the data sets.
Examples:

- power unit (p0121).
- motor (p0131, p0186).
- encoder interface (p0140, p0141, p0187 ... p0189).
- encoder (p0140, p0142, p0187 ... p0189).
- Terminal Module (p0151).
- option board (p0161).

201340 <location>Topology: Too many components on one line

Drive object: All objects

Message value: Component number or connection number: %1, fault cause: %2

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause:	For the selected communications clock cycle, too many DRIVE-CLiQ components are connected to one line of the Control Unit. Fault value (r0949, interpret hexadecimal): xyy hex: x = fault cause, yy = component number or connection number. 1yy: The communications clock cycle of the DRIVE-CLiQ connection on the Control Unit is not sufficient for all read transfers. 2yy: The communications clock cycle of the DRIVE-CLiQ connection on the Control Unit is not sufficient for all write transfers. 3yy: Cyclic communication is fully utilized. 4yy: The DRIVE-CLiQ cycle starts before the earliest end of the application. An additional dead time must be added to the control. Sign-of-life errors can be expected. The conditions of operation with a current controller sampling time of 31.25 µs have not been maintained. 5yy: Internal buffer overflow for net data of a DRIVE-CLiQ connection. 6yy: Internal buffer overflow for receive data of a DRIVE-CLiQ connection. 7yy: Internal buffer overflow for send data of a DRIVE-CLiQ connection. 8yy: The component clock cycles cannot be combined with one another 900: The lowest common multiple of the clock cycles in the system is too high to be determined. 901: The lowest common multiple of the clock cycles in the system cannot be generated with the hardware.
Remedy:	- check the DRIVE-CLiQ wiring. - reduce the number of components on the DRIVE-CLiQ line involved and distribute these to other DRIVE-CLiQ sockets of the Control Unit. This means that communication is uniformly distributed over several lines. For fault value = 1yy - 4yy in addition: - increase the sampling times (p0112, p0115, p4099). If necessary, for DCC or FBLOCKS, change the assignment of the runtime group (p21000, p20000) so that the sampling time (r21001, r20001) is increased. - if necessary, reduce the number of cyclically calculated blocks (DCC) and/or function blocks (FBLOCKS). - reduce the function modules (r0108). - establish the conditions for operation with a current controller sampling time of 31.25 µs (at the DRIVE-CLiQ line, only operate Motor Modules and Sensor Modules with this sampling time and only use a permitted Sensor Module (e.g. SMC20, this means a 3 at the last position of the Article No.)). - For an NX, the corresponding Sensor Module for a possibly existing second measuring system should be connected to a free DRIVE-CLiQ socket of the NX. - for BSR Motor Modules, the following applies: If Safety Extended Functions is enabled, and 6 axes are operated on the DRIVE-CLiQ line, then the clock cycle for the actual value sensing must be set as follows: $p9511 \geq 8 \cdot \text{current controller sampling time (p0115[0])}$. For fault value = 8yy in addition: - check the clock cycles settings (p0112, p0115, p4099). Clock cycles on a DRIVE-CLiQ line must be perfect integer multiples of one another. As clock cycle on a line, all clock cycles of all drive objects in the previously mentioned parameters apply, which have components on the line involved. For fault value = 9yy in addition: - check the clock cycles settings (p0112, p0115, p4099). The lower the numerical value difference between two clock cycles, the higher the lowest common multiple. This behavior has a significantly stronger influence, the higher the numerical values of the clock cycles.

201341 <location>Topology: Maximum number of DRIVE-CLiQ components exceeded

Drive object: All objects

Message value: -

Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	Too many DRIVE-CLiQ components were defined in the actual topology. Note: Pulse enable is withdrawn and prevented.
Remedy:	- check the DRIVE-CLiQ wiring. - reduce the number components on the DRIVE-CLiQ line involved in order to maintain the maximum quantity structure.

201354 <location>Topology: Actual topology indicates an illegal component

Drive object:	All objects
Message value:	Fault cause: %1, component number: %2
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	The actual topology indicates at least one illegal component. Fault value (r0949, interpret hexadecimal): yyxx hex: yy = component number, xx = cause. xx = 1: Component at this Control Unit not permissible. xx = 2: Component in combination with another component not permissible. Note: Pulse enable is prevented.
Remedy:	Remove the illegal components and restart the system.

201355 <location>Topology: Actual topology changed

Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	The device target topology (p0099) does not correspond to the device actual topology (r0098). The fault only occurs if the topology was commissioned using the automatic internal device mechanism and not using the commissioning tool. Fault value (r0949, interpret decimal): Only for internal Siemens troubleshooting. See also: r0098 (Actual device topology), p0099 (Device target topology)

Remedy: One of the following counter-measures can be selected if no faults have occurred in the topology detection itself:

If commissioning is still not completed:

- carry out a self-commissioning routine (starting from p0009 = 1).

In general:

Set p0099 = r0098, set p0009 = 0; for existing Motor Modules, this results in servo drives being automatically generated (p0107).

Generating servo drives: Set p0097 to 1, set p0009 to 0.

Generating vector drives: Set p0097 to 2, set p0009 to 0.

Generating vector drives with parallel connection: set p0097 to 12, set p0009 to 0.

In order to set configurations in p0108, before setting p0009 to 0, it is possible to first set p0009 to 2 and modify p0108. The index corresponds to the drive object (p0107).

If commissioning has already been completed:

- re-establish the original connections and re-connect power to the Control Unit.
- restore the factory setting for the complete equipment (all of the drives) and allow automatic self-commissioning again.
- change the device parameterization to match the connections (this is only possible using the commissioning tool).

Notice:

Topology changes that result in this fault being generated cannot be accepted by the automatic function in the device, but must be transferred using the commissioning tool and parameter download. The automatic function in the device only allows constant topology to be used. Otherwise, when the topology is changed, all of the previous parameter settings are lost and replaced by the factory setting.

See also: r0098 (Actual device topology)

201356 <location>Topology: There is a defective DRIVE-CLiQ component

Drive object: All objects

Message value: Fault cause: %1, Component number: %2, Connection number: %3

Reaction: NONE (OFF2)

Acknowledge: IMMEDIATELY

Cause: The actual topology indicates at least one defective DRIVE-CLiQ component.

Fault value (r0949, interpret hexadecimal):

zzyyxx hex:

zz = connection number of the component at which the defective component is connected

yy = component number of the component at which the defective component is connected

xx = fault cause

xx = 1: Component at this Control Unit not permissible.

xx = 2: component with communication defect.

Note:

Pulse enable is withdrawn and prevented.

Remedy: Replace the defective component and restart the system.

201357 <location>Topology: Two Control Units identified on the DRIVE-CLiQ line

Drive object: All objects

Message value: component number: %1, connection number: %2

Reaction: NONE (OFF2)

Acknowledge: IMMEDIATELY

Cause:	In the actual topology, 2 Control Units are connected with one another through DRIVE-CLiQ. As standard, this is not permitted. This is only permitted if the Technology Extension OALINK has already been installed on the two Control Units and has been commissioned online. Fault value (r0949, interpret hexadecimal): yyxx hex: yy = connection number of the Control Unit at which the second Control Unit is connected xx = component number of the Control Unit at which the second Control Unit is connected Note: Pulse enable is withdrawn and prevented.
Remedy:	In general: - remove the connection to the second Control Unit and restart. - for the S120M component DRIVE-CLiQ extension, interchange the hybrid cable (IN/OUT). When using OALINK: - remove the DRIVE-CLiQ connection and restart the systems. - install OALINK on both Control Units and activate. - Check the configuration of the DRIVE-CLiQ sockets in OALINK.

201358 <location>Topology: Line termination not available

Drive object:	All objects
Message value:	CU connection number: %1, component number: %2, connection number: %3
Reaction:	NONE
Acknowledge:	NONE
Cause:	At least one line with distributed drives is not terminated. The last participant on the line must be terminated with a line termination connector. This therefore ensures the degree of protection of the distributed drives. Alarm value (r2124, interpret hexadecimal): zzyyxx hex: zz = connection number of the distributed drive where there is no terminating connector yy = component number xx = CU connection number
Remedy:	Install the line terminating connector for the last distributed drive.

201359 <location>Topology: DRIVE-CLiQ performance not sufficient

Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	The DRIVE-CLiQ performance is not sufficient at one line in order to identify an inserted component. Fault value (r0949, interpret hexadecimal): Only for internal Siemens troubleshooting.
Remedy:	- carry out a POWER ON (switch-off/switch-on). - Distribute components across several DRIVE-CLiQ lines. Note: For this topology, do not withdraw and insert components in operation.

201360 <location>Topology: Actual topology not permissible

Drive object:	All objects
Message value:	Fault cause: %1, preliminary component number: %2
Reaction:	NONE

Acknowledge:	IMMEDIATELY
Cause:	The detected actual topology is not permissible. Fault value (r0949, interpret hexadecimal): ccccbbaa hex: cccc = preliminary component number, bb = no significance, aa = fault cause aa = 01 hex = 1 dec: Too many components were detected at the Control Unit. A maximum of 199 components is permissible. aa = 02 hex = 2 dec: The component type of a component is not known. aa = 03 hex = 3 dec: It is illegal to combine ALM and BLM. aa = 04 hex = 4 dec: It is illegal to combine ALM and SLM. aa = 05 hex = 5 dec: It is illegal to combine BLM and SLM. aa = 06 hex = 6 dec: A CX32 was not directly connected to a permitted Control Unit. aa = 07 hex = 7 dec: An NX10 or NX15 was not directly connected to a permitted Control Unit. aa = 08 hex = 8 dec: A component was connected to a Control Unit that is not permitted for this purpose. aa = 09 hex = 9 dec: A component was connected to a Control Unit with out-of-date firmware. aa = 0A hex = 10 dec: Too many components of a particular type detected. aa = 0B hex = 11 dec: Too many components of a particular type detected on a single line. Note: The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.
Remedy:	For fault cause = 1: Change the configuration. Connect less than 199 components to the Control Unit. For fault cause = 2: Remove the component with unknown component type. For fault cause = 3, 4, 5: Establish a valid combination. For fault cause = 6, 7: Connect the expansion module directly to a permitted Control Unit. For fault cause = 8: Remove component or use a permissible component. For fault cause = 9: Upgrade the firmware of the Control Unit to a later version. For fault cause = 10, 11: Reduce the number of components.

201361	<location>Topology: Actual topology contains SINUMERIK and SIMOTION components
Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE

Cause:	The detected actual topology contains SINUMERIK and SIMOTION components. The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: cc = fault cause, bb = component class of the actual topology, aa = component number of the component cc = 01 hex = 1 dec: An NX10 or NX15 was connected to a SIMOTION control. cc = 02 hex = 2 dec: A CX32 was connected to a SINUMERIK control.
Remedy:	For alarm value = 1: Replace all NX10 or NX15 by a CX32. For alarm value = 2: Replace all CX32 by an NX10 or NX15.

201362 **<location>Topology: Topology rule(s) broken**

Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE

Cause:	At least one topology rule for the SINAMICS S120 Combi has been broken. In the event of a fault, the ramping up of the drive system is aborted and closed-loop drive control is not enabled. Alarm value (r2124, interpret decimal): The alarm value indicates which rule has been violated. 1: The S120 Combi may only be wired via DRIVE-CLiQ socket X200 to X100 on the NCU. 2: In DRIVE-CLiQ socket X101 on the NCU, only one Single Motor Module (SMM) may be connected via X200, one Double Motor Module (DMM) via X200, one Terminal Module 54F (TM54F) via X500 or one DRIVE-CLiQ Hub Module (DMC20, DME20) via X500. 3: In DRIVE-CLiQ socket X102 on the NCU, only one Terminal Module 54F (TM54F) may be connected via X500, one DRIVE-CLiQ Hub Module (Hub) via X500 or one NX15 via X100. 4: Only Sensor Modules may be connected to DRIVE-CLiQ sockets X201 up to X203 (3-axis) or X204 (4-axis) on the S120 Combi. 5: In DRIVE-CLiQ socket X205 (X204 is not available for 3 axes), only SMC / SME Sensor Modules and DRIVE-CLiQ encoders may be connected. 6: In the case of a Single Motor Module as first expansion axis, only one additional Single Motor Module may be connected in the DRIVE-CLiQ socket X201 via X200, one Terminal Module 54F (TM54F) via X500 or one DRIVE-CLiQ Hub Module (DMC20, DME20) via X500. 7: Only Sensor Modules or DRIVE-CLiQ encoders may be connected in the DRIVE-CLiQ socket X202 on possibly available Single Motor Modules. 8: For a second Single Motor Module or for a Double Motor Module, at X201 a 54F Terminal Module (TM54F) or a DRIVE-CLiQ Hub Module (DMC 20, DME 20) may be connected via X500. 9: If a Double Motor Module is used as an expansion axis, only Sensor Modules may be connected to X202 and X203. 10: If a Terminal Module 54F (TM54F) is configured, only one DRIVE-CLiQ Hub Module (DMC20, DME20) may be connected to X501 of the TM54F module via DRIVE-CLiQ socket X500. In this case, it is not permissible that an existing Hub Module is connected elsewhere. 11: For DRIVE-CLiQ Hub Modules, only Sensor Modules (SMC, SME) and DRIVE-CLiQ encoders may be connected to X501 to X505. 12: Only certain Motor Modules may be used for expansion axes. 13: For an S120 Combi with 3 axes, nothing must be connected at the DRIVE-CLiQ Hub Module at X503. 14: A maximum of one Terminal Module 54F (TM54F) is permitted. 15: A maximum of one DRIVE-CLiQ Hub Module (DMC20, DME20) is permitted. 16: DRIVE-CLiQ socket X100 of NX15 must be connected with the NCU via X102. 17: The S120 Combi may only be connected to X101 of the NX15 via the DRIVE-CLiQ socket X200. 18: In DRIVE-CLiQ socket X102 on the NX15, only one Single Motor Module (SMM) may be connected via X200, one Double Motor Module (DMM) via X200, one Terminal Module 54F (TM54F) via X500 or one DRIVE-CLiQ Hub Module (DMC20, DME20) via X500. 19: It is not permissible that anything is connected at DRIVE-CLiQ socket X103 on the NX15.
Remedy:	Evaluate the alarm value and ensure compliance with the corresponding topology rule(s).

201375 <location>Topology: Connection duplicated between two components

Drive object:	All objects
Message value:	Component: %1, %2, connection: %3
Reaction:	NONE
Acknowledge:	IMMEDIATELY

Cause:	When checking the actual topology, a ring-type connection was detected. The fault value describes a component contained in the ring. Fault value (r0949, interpret hexadecimal): ccbbaaaa hex: cc = connection number (%3) bb = component class (% 2) aaaa = preliminary component number (%1) Component class: 0: Component unknown. 1: Control Unit 2: Motor Module 3: Line Module 4: Sensor Module 5: Voltage Sensing Module 6: Terminal Module 7: DRIVE-CLiQ Hub Module 8: Controller Extension 9: Filter Module 10: Hydraulic Module. 49: DRIVE-CLiQ component 50: Option slot 60: Encoder 70: DRIVE-CLiQ motor 71: Hydraulic cylinder 72: Hydraulic valve 80: Motor Connection number: 0: Port 0, 1: Port 1, 2: Port 2, 3: Port 3, 4: Port 4, 5: Port 5 10: X100, 11: X101, 12: X102, 13: X103, 14: X104, 15: X105 20: X200, 21: X201, 22: X202, 23: X203 50: X500, 51: X501, 52: X502, 53: X503, 54: X504, 55: X505
Remedy:	Output the fault value and remove the specified connection. Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201380 <location>Topology: Actual topology EEPROM defective

Drive object:	All objects
Message value:	Preliminary component number: %1
Reaction:	NONE
Acknowledge:	POWER ON
Cause:	When detecting the actual topology, a component with a defective EEPROM was detected. Fault value (r0949, interpret hexadecimal): bbbbaaaa hex: bbbb = reserved aaaa = preliminary component number of the defective components
Remedy:	Output the fault value and remove the defected component.

201381 <location>Topology: Line Module incorrectly inserted

Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value:	Component: %1, to %2, %3, connection: %4

Reaction:	NONE
Acknowledge:	NONE
Cause:	The topology comparison has detected a Line Module in the actual topology that has been incorrectly inserted with respect to the target technology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = connection number (%4) cc = component number (%3) bb = component class (% 2) aa = component number of the incorrectly inserted component (% 1) Note: The component is described in dd, cc and bb, where the component involved is incorrectly inserted. Component class and connection number are described in F01375. The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.
Remedy:	Adapting topologies: - insert the components involved at the right connection (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). - automatically remove the topology error (p9904). Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201381	<location>Topology: power unit incorrectly inserted
Drive object:	CU_I_828, CU_I_COMBI, CU_LINK, CU_NX_828, CU_NX_COMBI, HLA_828, HUB, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	Component: %1, to %2, %3, connection: %4
Reaction:	NONE
Acknowledge:	NONE
Cause:	The topology comparison has detected a power unit in the actual topology that has been incorrectly inserted. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = connection number (%4) cc = component number (%3) bb = component class (% 2) aa = component number of the incorrectly inserted component (% 1) Note: The component is described in dd, cc and bb, where the component involved is incorrectly inserted. Component class and connection number are described in F01375. The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.
Remedy:	Adapting topologies: - insert the components involved at the right connection (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). - automatically remove the topology error (p9904). Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201381	<location>Topology: Motor Module incorrectly inserted
Drive object:	SERVO_828, SERVO_COMBI
Message value:	Component: %1, to %2, %3, connection: %4
Reaction:	NONE
Acknowledge:	NONE

Cause:	The topology comparison has detected a Motor Module in the actual topology that has been incorrectly inserted with respect to the target technology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = connection number (%4) cc = component number (%3) bb = component class (% 2) aa = component number of the incorrectly inserted component (% 1) Note: The component is described in dd, cc and bb, where the component involved is incorrectly inserted. Component class and connection number are described in F01375. The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.
Remedy:	Adapting topologies: - insert the components involved at the right connection (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). - automatically remove the topology error (p9904). Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201382 <location>Topology: Sensor Module incorrectly inserted

Drive object:	All objects
Message value:	Component: %1, to %2, %3, connection: %4
Reaction:	NONE
Acknowledge:	NONE
Cause:	The topology comparison has detected a Sensor Module in the actual topology that has been incorrectly inserted with respect to the target technology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = connection number (%4) cc = component number (%3) bb = component class (% 2) aa = component number of the incorrectly inserted component (% 1) Note: The component is described in dd, cc and bb, where the component involved is incorrectly inserted. Component class and connection number are described in F01375. The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.
Remedy:	Adapting topologies: - insert the components involved at the right connection (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). - automatically remove the topology error (p9904). Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201383 <location>Topology: Terminal Module incorrectly inserted

Drive object:	All objects
Message value:	Component: %1, to %2, %3, connection: %4
Reaction:	NONE
Acknowledge:	NONE

Cause:	The topology comparison has detected a Terminal Module in the actual topology that has been incorrectly inserted with respect to the target technology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = connection number (%4) cc = component number (%3) bb = component class (% 2) aa = component number of the incorrectly inserted component (% 1) Note: The component is described in dd, cc and bb, where the component involved is incorrectly inserted. Component class and connection number are described in F01375. The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.
Remedy:	Adapting topologies: - insert the components involved at the right connection (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). - automatically remove the topology error (p9904). Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201384 <location>Topology: DRIVE-CLiQ Hub Module incorrectly inserted

Drive object:	All objects
Message value:	Component: %1, to %2, %3, connection: %4
Reaction:	NONE
Acknowledge:	NONE
Cause:	The topology comparison has detected a DRIVE-CLiQ Hub Module in the actual topology that has been incorrectly inserted with respect to the target topology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = connection number (%4) cc = component number (%3) bb = component class (% 2) aa = component number of the incorrectly inserted component (% 1) Note: The component is described in dd, cc and bb, where the component involved is incorrectly inserted. Component class and connection number are described in F01375. The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.
Remedy:	Adapting topologies: - insert the components involved at the right connection (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). - automatically remove the topology error (p9904). Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201385 <location>Topology: Controller Extension incorrectly inserted

Drive object:	All objects
Message value:	Component: %1, to %2, %3, connection: %4
Reaction:	NONE
Acknowledge:	NONE

Cause:	The topology comparison has detected a controller extension 32 (CX32) in the actual topology that has been incorrectly inserted with respect to the target topology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = connection number (%4) cc = component number (%3) bb = component class (% 2) aa = component number of the incorrectly inserted component (% 1) Note: The component is described in dd, cc and bb, where the component involved is incorrectly inserted. Component class and connection number are described in F01375. The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.
Remedy:	Adapting topologies: - insert the components involved at the right connection (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). - automatically remove the topology error (p9904). Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201386 <location>Topology: DRIVE-CLiQ component incorrectly inserted

Drive object:	All objects
Message value:	Component: %1, to %2, %3, connection: %4
Reaction:	NONE
Acknowledge:	NONE
Cause:	The topology comparison has detected a DRIVE-CLiQ component in the actual topology that has been incorrectly inserted with respect to the target topology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = connection number (%4) cc = component number (%3) bb = component class (% 2) aa = component number of the incorrectly inserted component (% 1) Note: The component is described in dd, cc and bb, where the component involved is incorrectly inserted. Component class and connection number are described in F01375. The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.
Remedy:	Adapting topologies: - insert the components involved at the right connection (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). - automatically remove the topology error (p9904). Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201389 <location>Topology: Motor with DRIVE-CLiQ incorrectly inserted

Drive object:	All objects
Message value:	Component: %1, to %2, %3, connection: %4
Reaction:	NONE
Acknowledge:	NONE

Cause:	The topology comparison has detected a motor with DRIVE-CLiQ in the actual topology that has been incorrectly inserted with respect to the target topology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = connection number (%4) cc = component number (%3) bb = component class (% 2) aa = component number of the incorrectly inserted component (% 1) Note: The component is described in dd, cc and bb, where the component involved is incorrectly inserted. Component class and connection number are described in F01375. The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.
Remedy:	Adapting topologies: - insert the components involved at the right connection (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). - automatically remove the topology error (p9904). Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201416 <location>Topology: Component additionally inserted

Drive object:	All objects
Message value:	%1, to %2, %3, connection: %4
Reaction:	NONE
Acknowledge:	NONE
Cause:	The topology comparison has found a component in the actual topology which is not specified in the target topology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = component class (% 2) cc = connection number (%4) bb = component class of the additional component (%1) aa = component number (%3) Note: The component class of the additional component is contained in bb. The component is described in dd, cc and aa, where the additional component is inserted. Component class and connection number are described in F01375.
Remedy:	Adapting topologies: - remove the additional component (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201420 <location>Topology: Component different

Drive object:	All objects
Message value:	Component: %1, target: %2, actual: %3, difference: %4
Reaction:	NONE
Acknowledge:	NONE

Cause:	The topology comparison has detected differences in the actual topology and target topologies in the electronic rating plate. Alarm value (r2124, interpret hexadecimal): ddccbaa hex: aa = component number (%1), bb = component class of the target topology (%2), cc = component class of the actual topology (%3), dd = difference (%4) dd = 01 hex = 1 dec: Different component type. dd = 02 hex = 2 dec: Different article number. dd = 03 hex = 3 dec: Different manufacturer. dd = 04 hex = 4 dec: For a multi-component slave, the incorrect subcomponent (index) is connected (e.g. Double Motor Module X201 instead of X200) - or only a part of a multi-component slave is set to "deactivate and not available". dd = 05 hex = 5 dec: NX10 or NX15 used instead of CX32. dd = 06 hex = 6 dec: NX10 or NX15 used instead of CX32. dd = 07 hex = 7 dec: Different number of connections. Note: The component class is described in F01375. The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.
Remedy:	Adapting topologies: - connect the expected component (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). Topology comparison - if required, adapt the comparison level: - parameterize the topology comparison of all components (p9906). - parameterize the topology comparison of one components (p9907, p9908). Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201425 <location>Topology: Serial number different

Drive object:	All objects
Message value:	Component: %1, %2, differences: %3
Reaction:	NONE
Acknowledge:	NONE
Cause:	The topology comparison has detected differences in the actual and target topologies in relation to one component. The serial number is different. Alarm value (r2124, interpret hexadecimal): ddccbaa hex: dd = reserved cc = number of differences (%3) bb = component class (% 2) aa = component number (%1) Note: The component class is described in F01375. The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.

Remedy:	Adapting topologies: - change over the actual topology to match the target topology. - load the target topology that matches the actual topology (commissioning tool). For byte cc: cc = 1 --> can be acknowledged using p9904 or p9905. cc > 1 --> can be acknowledged using p9905 and can be deactivated using p9906 or p9907/p9908. Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison). See also: p9904 (Topology comparison acknowledge differences), p9905 (Device specialization), p9906 (Topology comparison all components comparison level), p9907 (Topology comparison component number), p9908 (Topology comparison of a component comparison level)
201428	<location>Topology: Incorrect connection used
Drive object:	All objects
Message value:	Component: %1, %2, connection (actual): %3, connection (target): %4
Reaction:	NONE
Acknowledge:	NONE
Cause:	The topology comparison has detected differences in the actual and target topologies in relation to one component. For a component, another connection was used. The different connections of a component are described in the alarm value. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = connection number of the target topology (%4) cc = connection number of the actual topology (%3) bb = component class (% 2) aa = component number (%1) Note: Component class and connection number are described in F01375. The drive system is no longer booted. In this state, the drive control (closed-loop) cannot be enabled.
Remedy:	Adapting topologies: - reinsert the DRIVE-CLiQ cable to the component (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). - automatically remove the topology error (p9904). Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison). See also: p9904 (Topology comparison acknowledge differences)
201451	<location>Topology: Target topology is invalid
Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY

Cause: An error was detected in the target topology.
The target topology is invalid.
Fault value (r0949, interpret hexadecimal):
ccccbbaa hex: cccc = index error, bb = component number, aa = fault cause
aa = 1B hex = 27 dec: Error not specified.
aa = 1C hex = 28 dec: Value illegal.
aa = 1D hex = 29 dec: Incorrect ID.
aa = 1E hex = 30 dec: Incorrect ID length.
aa = 1F hex = 31 dec: Too few indices left.
aa = 20 hex = 32 dec: component not connected to Control Unit.

Remedy: Download the target topology again using the commissioning tool.

201481 <location>Topology: power unit not connected

Drive object: CU_I_828, CU_I_COMBI, CU_LINK, CU_NX_828, CU_NX_COMBI, HLA_828, HUB, TM120, TM150, TM54F_MA, TM54F_SL

Message value: Component: %1, to %2, %3, connection: %4

Reaction: NONE

Acknowledge: NONE

Cause: The topology comparison has detected a power unit that is missing in the actual topology with respect to the target topology.
Alarm value (r2124, interpret hexadecimal):
ddccbbbaa hex:
dd = connection number (%4)
cc = component number (%3)
bb = component class (% 2)
aa = component number of the component that has not been inserted (% 1)
Note:
The component is described in dd, cc and bb, where the component has not been inserted.
Component class and connection number are described in F01375.

Remedy: Adapting topologies:
- insert the components involved at the right connection (correct the actual topology).
- adapt the project/parameterizing in the commissioning tool (correct the target topology).
Check the hardware:
- check the 24 V supply voltage.
- check DRIVE-CLiQ cables for interruption and contact problems.
- check that the component is working properly.
Note:
Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201481 <location>Topology: Line Module not connected

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: Component: %1, to %2, %3, connection: %4

Reaction: NONE

Acknowledge: NONE

Cause:	The topology comparison has detected a Line Module that is missing in the actual topology with respect to the target topology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = connection number (%4) cc = component number (%3) bb = component class (% 2) aa = component number of the component that has not been inserted (% 1) Note: The component is described in dd, cc and bb, where the component has not been inserted. Component class and connection number are described in F01375.
Remedy:	Adapting topologies: - insert the components involved at the right connection (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). Check the hardware: - check the 24 V supply voltage. - check DRIVE-CLiQ cables for interruption and contact problems. - check that the component is working properly. Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201481	<location>Topology: Motor Module not connected
Drive object:	SERVO_828, SERVO_COMBI
Message value:	Component: %1, to %2, %3, connection: %4
Reaction:	NONE
Acknowledge:	NONE
Cause:	The topology comparison has detected a Motor Module that is missing in the actual topology with respect to the target topology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = connection number (%4) cc = component number (%3) bb = component class (% 2) aa = component number of the component that has not been inserted (% 1) Note: The component is described in dd, cc and bb, where the component has not been inserted. Component class and connection number are described in F01375.
Remedy:	Adapting topologies: - insert the components involved at the right connection (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). Check the hardware: - check the 24 V supply voltage. - check DRIVE-CLiQ cables for interruption and contact problems. - check that the component is working properly. Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201482 <location>Topology: Sensor Module not connected

Drive object:	All objects
Message value:	Component: %1, to %2, %3, connection: %4

Reaction:	NONE
Acknowledge:	NONE
Cause:	The topology comparison has detected a Sensor Module that is missing in the actual topology with respect to the target topology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = connection number (%4) cc = component number (%3) bb = component class (% 2) aa = component number of the component that has not been inserted (% 1) Note: The component is described in dd, cc and bb, where the component has not been inserted. Component class and connection number are described in F01375.
Remedy:	Adapting topologies: - insert the components involved at the right connection (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). Check the hardware: - check the 24 V supply voltage. - check DRIVE-CLiQ cables for interruption and contact problems. - check that the component is working properly. Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201483 <location>Topology: Terminal Module not connected

Drive object:	All objects
Message value:	Component: %1, to %2, %3, connection: %4
Reaction:	NONE
Acknowledge:	NONE
Cause:	The topology comparison has detected a Terminal Module that is missing in the actual topology with respect to the target topology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = connection number (%4) cc = component number (%3) bb = component class (% 2) aa = component number of the component that has not been inserted (% 1) Note: The component is described in dd, cc and bb, where the component has not been inserted. Component class and connection number are described in F01375.
Remedy:	Adapting topologies: - insert the components involved at the right connection (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). Check the hardware: - check the 24 V supply voltage. - check DRIVE-CLiQ cables for interruption and contact problems. - check that the component is working properly. Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201484	<location>Topology: DRIVE-CLiQ Hub Module not connected
Drive object:	All objects
Message value:	Component: %1, to %2, %3, connection: %4
Reaction:	NONE
Acknowledge:	NONE
Cause:	The topology comparison has detected a DRIVE-CLiQ Hub Module missing in the actual topology with respect to the target topology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = connection number (%4) cc = component number (%3) bb = component class (% 2) aa = component number of the component that has not been inserted (% 1) Note: The component is described in dd, cc and bb, where the component has not been inserted. Component class and connection number are described in F01375.
Remedy:	Adapting topologies: - insert the components involved at the right connection (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). Check the hardware: - check the 24 V supply voltage. - check DRIVE-CLiQ cables for interruption and contact problems. - check that the component is working properly. Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).
201485	<location>Topology: Controller Extension not connected
Drive object:	All objects
Message value:	Component: %1, to %2, %3, connection: %4
Reaction:	NONE
Acknowledge:	NONE
Cause:	The topology comparison has detected a Control Extension (CX32) missing in the actual topology with respect to the target topology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = connection number (%4) cc = component number (%3) bb = component class (% 2) aa = component number of the component that has not been inserted (% 1) Note: The component is described in dd, cc and bb, where the component has not been inserted. Component class and connection number are described in F01375.

Remedy: Adapting topologies:
- insert the components involved at the right connection (correct the actual topology).
- adapt the project/parameterizing in the commissioning tool (correct the target topology).
Check the hardware:
- check the 24 V supply voltage.
- check DRIVE-CLiQ cables for interruption and contact problems.
- check that the component is working properly.
Note:
Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201486 <location>Topology: DRIVE-CLiQ component not connected

Drive object: All objects

Message value: Component: %1, to %2, %3, connection: %4

Reaction: NONE

Acknowledge: NONE

Cause: The topology comparison has detected a DRIVE-CLiQ component missing in the actual topology with respect to the target topology.

Alarm value (r2124, interpret hexadecimal):

ddccbbaa hex:

dd = connection number (%4)

cc = component number (%3)

bb = component class (% 2)

aa = component number of the component that has not been inserted (% 1)

Note:

The component is described in dd, cc and bb, where the component has not been inserted.

Component class and connection number are described in F01375.

Remedy: Adapting topologies:
- insert the components involved at the right connection (correct the actual topology).
- adapt the project/parameterizing in the commissioning tool (correct the target topology).
Check the hardware:
- check the 24 V supply voltage.
- check DRIVE-CLiQ cables for interruption and contact problems.
- check that the component is working properly.
Note:
Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201487 <location>Topology: Option slot component not inserted

Drive object: All objects

Message value: Component: %1, to %2, %3, connection: %4

Reaction: NONE

Acknowledge: NONE

Cause:	The topology comparison has detected an option slot component missing in the actual topology with respect to the target topology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = connection number (%4) cc = component number (%3) bb = component class (% 2) aa = component number of the component that has not been inserted (% 1) Note: The component is described in dd, cc and bb, where the component has not been inserted. Component class and connection number are described in F01375.
Remedy:	Adapting topologies: - insert the components involved at the right connection (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). Check the hardware: - check the 24 V supply voltage. - check DRIVE-CLiQ cables for interruption and contact problems. - check that the component is working properly. Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201489	<location>Topology: motor with DRIVE-CLiQ not connected
Drive object:	All objects
Message value:	Component: %1, to %2, %3, connection: %4
Reaction:	NONE
Acknowledge:	NONE
Cause:	The topology comparison has detected a motor with DRIVE-CLiQ missing in the actual topology with respect to the target topology. Alarm value (r2124, interpret hexadecimal): ddccbbaa hex: dd = connection number (%4) cc = component number (%3) bb = component class (% 2) aa = component number of the component that has not been inserted (% 1) Note: The component is described in dd, cc and bb, where the component has not been inserted. Component class and connection number are described in F01375.
Remedy:	Adapting topologies: - insert the components involved at the right connection (correct the actual topology). - adapt the project/parameterizing in the commissioning tool (correct the target topology). Check the hardware: - check the 24 V supply voltage. - check DRIVE-CLiQ cables for interruption and contact problems. - check that the component is working properly. Note: Under "Topology --> Topology view" the commissioning tool where relevant offers improved diagnostics capability (e.g. setpoint/actual value comparison).

201507	<location>BICO: Interconnections to inactive objects present
Drive object:	All objects
Message value:	%1

Reaction:	NONE
Acknowledge:	NONE
Cause:	There are BICO interconnections to an inactive/inoperable drive object. The BI/CI parameters involved are listed in r9498. The associated BO/CO parameters are listed in r9499. The list of the BICO interconnections to other drive objects is displayed in r9491 and r9492 of the deactivated drive object. Note: r9498 and r9499 are only written to, if p9495 is not set to 0. Alarm value (r2124, interpret decimal): Number of BICO interconnections found to inactive drive objects.
Remedy:	- set all open BICO interconnections centrally to the factory setting with p9495 = 2. - make the non-operational drive object active/operational again (re-insert or activate components).

201508 <location>BICO: Interconnections to inactive objects exceeded

Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The maximum number of BICO interconnections (signal sinks) when deactivating a drive object was exceeded. When deactivating a drive object, all BICO interconnections (signal sinks) are listed in the following parameters: - r9498[0...29]: List of the BI/CI parameters involved. - r9499[0...29]: List of the associated BO/CO parameters.
Remedy:	Not necessary. This alarm is automatically withdrawn as soon as no BICO interconnection is entered in r9498[29] and r9499[29] (value = 0). Notice: When re-activating the drive object, all BICO interconnections should be checked and if required, re-established.

201510 <location>BICO: Signal source is not float type

Drive object:	All objects
Message value:	Parameter: %1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	The requested connector output does not have the correct data type. This interconnection is not established. Fault value (r0949, interpret decimal): Parameter number to which an interconnection should be made (connector output).
Remedy:	Interconnect this connector input with a connector output having a float data type.

201511 <location>BICO: Interconnection with different scalings

Drive object:	All objects
Message value:	Parameter: %1
Reaction:	NONE
Acknowledge:	IMMEDIATELY

Cause:	The requested BICO interconnection was established. However, a conversion is made between the BICO output and BICO input using the reference values. - the BICO output has different normalized units than the BICO input. - message only for interconnections within a drive object. Example: The BICO output has, as normalized unit, voltage and the BICO input has current. This means that the factor p2002/p2001 is calculated between the BICO output and the BICO input. p2002: contains the reference value for current p2001: contains the reference value for voltage Fault value (r0949, interpret decimal): Parameter number of the BICO input (signal sink).
Remedy:	Not necessary.

201512 <location>BICO: No scaling available

Drive object:	All objects
Message value:	%1
Reaction:	Infeed: OFF2 (OFF1) Servo: OFF2 Hla: OFF2
Acknowledge:	POWER ON
Cause:	An attempt was made to determine a conversion factor for a scaling that does not exist. Fault value (r0949, interpret decimal): Unit (e.g. corresponding to SPEED) for which an attempt was made to determine a factor.
Remedy:	Apply scaling or check the transfer value.

201513 <location>BICO: Interconnection cross DO with different scalings

Drive object:	All objects
Message value:	Parameter: %1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	The requested BICO interconnection was established. However, a conversion is made between the BICO output and BICO input using the reference values. An interconnection is made between different drive objects and the BICO output has different normalized units than the BICO input or the normalized units are the same but the reference values are different. Example 1: BICO output with voltage normalized unit, BICO input with current normalized unit, BICO output and BICO input lie in different drive objects. This means that the factor p2002/p2001 is calculated between the BICO output and the BICO input. p2002: contains the reference value for current p2001: contains the reference value for voltage Example 2: BICO output with voltage normalized unit in drive object 1 (DO1), BICO input with voltage normalized unit in drive object 2 (DO2). The reference values for voltage (p2001) of the two drive objects have different values. This means that the factor p2001(DO1)/p2001(DO2) is calculated between the BICO output and the BICO input. p2001: contains the reference value for voltage, drive objects 1, 2 Fault value (r0949, interpret decimal): Parameter number of the BICO input (signal sink).
Remedy:	Not necessary.

201514 <location>BICO: Error when writing during a reconnect

Drive object:	All objects
Message value:	Parameter: %1

Reaction:	NONE
Acknowledge:	NONE
Cause:	During a reconnect operation (e.g. while booting or downloading - but can also occur in normal operation) a parameter was not able to be written to. Example: When writing to BICO input with double word format (DWORD), in the second index, the memory areas overlap (e.g. p8861). The parameter is then reset to the factory setting. Alarm value (r2124, interpret decimal): Parameter number of the BICO input (signal sink).
Remedy:	Not necessary.

201515 <location>BICO: Writing to parameter not permitted as the master control is active

Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	When changing the number of CDS or when copying from CDS, the master control is active.
Remedy:	If required, return the master control and repeat the operation.

201590 <location>Drive: Motor maintenance interval expired

Drive object:	All objects
Message value:	Fault cause: %1 bin
Reaction:	NONE
Acknowledge:	NONE
Cause:	The selected service/maintenance interval for this motor was reached. Alarm value (r2124, interpret decimal): Motor data set number. See also: p0650 (Actual motor operating hours), p0651 (Motor operating hours maintenance interval)
Remedy:	carry out service/maintenance and reset the service/maintenance interval (p0651).

201600 <location>SI P1 (CU): STOP A initiated

Drive object:	HLA_828
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The drive-integrated "Safety Integrated" function on the Control Unit (CU) has detected a fault and initiated a STOP A (STO via the safety switch-off signal path of the Control Unit). - forced checking procedure (test stop) of the safety switch-off signal path of the Control Unit unsuccessful. - subsequent response to fault F01611 (defect in a monitoring channel). Fault value (r0949, interpret decimal): 0: Stop request from monitoring channel 2. 1005: STO active although STO not selected and there is no internal STOP A present. 1010: STO inactive although STO is selected or an internal STOP A is present. 9999: Subsequent response to fault F01611.

Remedy:

- select Safe Torque Off and deselect again.
- replace Hydraulic Module involved.

For fault value = 9999:

- carry out diagnostics for fault F01611.

Note:

CU: Control Unit

SI: Safety Integrated

STO: Safe Torque Off / SH: Safe standstill

201600 <location>SI P1 (CU): STOP A initiated

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The drive-integrated "Safety Integrated" function on the Control Unit (CU) has detected a fault and initiated a STOP A (STO via the safety switch-off signal path of the Control Unit).

- forced checking procedure (test stop) of the safety switch-off signal path of the Control Unit unsuccessful.

- subsequent response to fault F01611 (defect in a monitoring channel).

Fault value (r0949, interpret decimal):

0: Stop request from monitoring channel 2.

1005:

- STO active, although STO not selected and there is no internal STOP A active.

- For a Power Module with "STO via terminals at the Power Module" (STO_A/STO_B), these terminals are active (DIP switch to "ON"). However, the "STO via terminals at the Power Module" function has not been enabled (p9601.7 = p9801.7 = 0).

1010: STO inactive although STO is selected or an internal STOP A is present.

1015: Feedback signal of STO for Motor Modules connected in parallel are different.

9999: Subsequent response to fault F01611.

Remedy:

- select Safe Torque Off and deselect again.

- replace the Motor Module involved.

For fault value = 1005:

- deactivate terminals STO_A/STO_B on the Power Module (set both DIP-switches to "OFF") or enable the "STO via terminals at the Power Module" function.

For fault value = 9999:

- carry out diagnostics for fault F01611.

Note:

CU: Control Unit

MM: Motor Module

SI: Safety Integrated

STO: Safe Torque Off / SH: Safe standstill

201611 <location>SI P1 (CU): Defect in a monitoring channel

Drive object: HLA_828

Message value: %1

Reaction: NONE (OFF1, OFF2, OFF3)

Acknowledge: IMMEDIATELY (POWER ON)

- Cause:** The drive-integrated "Safety Integrated" function on processor 1 has detected a fault in the data cross-check between the two monitoring channels and has initiated a STOP F.
- As a result of this fault, after the parameterized transition has expired (p9658), fault F01600 (SI CU: STOP A initiated) is output.
- Fault value (r0949, interpret decimal):
- 0: Stop request from another monitoring channel.
 - 1 ... 999:
Number of the cross-compared data that resulted in this fault. This number is also displayed in r9795.
- 1: SI monitoring clock cycle (r9780, r9880).
 - 2: SI enable safety functions (p9601, p9801). Crosswise data comparison is only carried out for the supported bits.
 - 3: SI SGE changeover discrepancy time (p9650, p9850).
 - 4: SI transition period STOP F to STOP A (p9658, p9858).
 - 6: SI Motion enable, safety-relevant functions (p9501, internal value).
 - 7: SI delay time of STO for Safe Stop 1 (p9652, p9852).
 - 8: SI PROFIsafe address (p9610, p9810).
 - 9: SI debounce time for STO/SBC/SS1 (p9651, p9851).
 - 10: SI delay time for initiating STO for ESR (p9697, p9897).
 - 11: SI HLA shutoff valve feedback signal contact configuration (p9626, p9826).
 - 12: SI HLA shutoff valve wait time switch-on (p9625[0], p9825[0]).
 - 13: SI HLA shutoff valve wait time switch-off (p9625[1], p9825[1]).
 - 14: SI PROFIsafe telegram selection (p9611, p9811).
 - 15: SI PROFIsafe bus failure response (p9612, p9812).
- 1000: Watchdog timer has expired.
- Within the time of approx. 5 x p9650, alternatively, the following was defined:
- the signal at terminal STO of the Hydraulic Module continually changed with time intervals less than or equal to the discrepancy time (p9650/p9850).
 - via PROFIsafe/TM54F, STO (also as subsequent response) was continually selected and deselected with time intervals less than or equal to the discrepancy time (p9650/p9850).
- 1001, 1002: Initialization error, change timer / check timer.
 - 1900: CRC error in the SAFETY sector.
 - 1901: CRC error in the ITCM sector.
 - 1902: Overloading in the ITCM sector has occurred in operation.
 - 1903: Internal parameterizing error for CRC calculation.
 - 1950: Module temperature outside the permissible temperature range.
 - 1951: Module temperature not plausible.
 - 2000: Status of the STO selection for both monitoring channels different.
 - 2001: Feedback signal of STO shutdown for both monitoring channels different.
 - 2002: Status of the delay timer SS1 for both monitoring channels different (status of the timer in p9650/p9850).
 - 2003: Status of the STO terminal for both monitoring channels different.
- 6000 ... 6999:
- Error in the PROFIsafe control.
- For these fault values, the failsafe control signals (Failsafe Values) are transferred to the safety functions. If "STOP B after failure of the PROFIsafe communication" (p9612) is parameterized, the transfer of the Failsafe Values is delayed.
- 6000: A fatal PROFIsafe communication error has occurred.
- 6064 ... 6071: error when evaluating the F parameter. The values of the transferred F parameters do not match the expected values in the PROFIsafe driver.
 - 6064: Destination address and PROFIsafe address are different (F_Dest_Add).
 - 6065: Destination address not valid (F_Dest_Add).
 - 6066: Source address not valid (F_Source_Add).
 - 6067: Watchdog time not valid (F_WD_Time).
 - 6068: Incorrect SIL level (F_SIL).
 - 6069: Incorrect F-CRC length (F_CRC_Length).
 - 6070: Incorrect F parameter version (F_Par_Version).

6071: CRC error for the F parameters (CRC1). The transferred CRC value of the F parameters does not match the value calculated in the PROFIsafe driver.

6072: F parameterization is inconsistent.

6165: A communications error was identified when receiving the PROFIsafe telegram. The fault may also occur if an inconsistent or out-of-date PROFIsafe telegram has been received after switching the Control Unit off and on or after plugging in the PROFIBUS/PROFINET cable.

6166: A time monitoring error (timeout) was identified when receiving the PROFIsafe telegram.

Remedy:

For fault value = 1 ... 5 and 7 ... 999:

- check the cross data comparison that resulted in a STOP F.
- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade the Hydraulic Module software.
- upgrade the Control Unit software.

For fault value = 6:

- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade the Hydraulic Module software.
- upgrade the Control Unit software.

For fault value = 1000:

- check the STO terminal at the Hydraulic Module (contact problems).
- PROFIsafe: Remove contact problems/faults at the PROFIBUS master/PROFINET controller.
- check the wiring of the failsafe inputs at the TM54F (contact problems).
- check the discrepancy time, and if required, increase the value (p9650/p9850).

For fault value = 1001, 1002:

- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade the Hydraulic Module software.
- upgrade the Control Unit software.

For fault value = 1900, 1901, 1902:

- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade the Control Unit software.
- replace Control Unit.

For fault value = 2000, 2001, 2002, 2003:

- check the discrepancy time, and if required, increase the value (p9650/p9850, p9652/p9852).
- check the wiring of the safety-relevant inputs (SGE) (contact problems).
- check the causes of the STO selection in r9772. When the SMM functions are active (p9501 = 1), STO can also be selected using these functions.
- replace Hydraulic Module involved.

Note:

This fault can be acknowledged after removing the cause of the error and after correct selection/deselection of STO.

For fault value = 6000:

- carry out a POWER ON (switch-off/switch-on) for all components.
- check whether there is a DRIVE-CLiQ communication error between the two monitoring channels and, if required, carry out a diagnostics routine for the faults identified.
- increase the monitoring cycle clock settings (p9500, p9511).
- upgrade firmware to later version.
- contact Technical Support.
- replace the Control Unit.

For fault value = 6064:

- check the setting of the value in the F parameter F_Dest_Add at the PROFIsafe slave.
- check the setting of the PROFIsafe address of the Control Unit (p9610) and that of the hydraulic module (p9810).

For fault value = 6065:

- check the setting of the value in the F parameter F_Dest_Add at the PROFIsafe slave. It is not permissible for the destination address to be either 0 or FFFF!

For fault value = 6066:

- check the setting of the value in the F parameter F_Source_Add at the PROFIsafe slave. It is not permissible for the source address to be either 0 or FFFF!

For fault value = 6067:

- check the setting of the value in the F parameter F_WD_Time at the PROFIsafe slave. It is not permissible for the watch time to be 0!

For fault value = 6068:

- check the setting of the value in the F parameter F_SIL at the PROFIsafe slave. The SIL level must correspond to SIL2!

For fault value = 6069:

- check the setting of the value in the F parameter F_CRC_Length at the PROFIsafe slave. The setting of the CRC2 length is 2-byte CRC in the V1 mode and 3-byte CRC in the V2 mode!

For fault value = 6070:

- check the setting of the value in the F parameter F_Par_Version at the PROFIsafe slave. The value for the F parameter version is 0 in the V1 mode and 1 in the V2 mode!

For fault value = 6071:

- check the settings of the values of the F parameters and the F parameter CRC (CRC1) calculated from these at the PROFIsafe slave and, if required, update.

For fault value = 6072:

- check the settings of the values for the F parameters and, if required, correct.

The following combinations are permissible for F parameters F_CRC_Length and F_Par_Version:

F_CRC_Length = 2-byte CRC and F_Par_Version = 0

F_CRC_Length = 3-byte CRC and F_Par_Version = 1

For fault value = 6165:

- if the fault occurs after powering up the Control Unit or after plugging in the PROFIBUS/PROFINET cable, acknowledge the fault.

- check the configuration and communication at the PROFIsafe slave.

- check the setting of the value for F parameter F_WD_Time on the PROFIsafe slave and increase if necessary.

- check whether there is a DRIVE-CLiQ communication error between the two monitoring channels and, if required, carry out a diagnostics routine for the faults identified.

- check whether all F parameters of the drive match the F parameters of the F host.

For fault value = 6166:

- check the configuration and communication at the PROFIsafe slave.

- check the setting of the value for F parameter F_WD_Time on the PROFIsafe slave and increase if necessary.

- evaluate diagnostic information in the F host.

- check PROFIsafe connection.

- check whether all F parameters of the drive match the F parameters of the F host.

Note:

CU: Control Unit

EP: Enable Pulses (pulse enable)

ESR: Extended Stop and Retract

MM: Motor Module

SGE: Safety-relevant input

SI: Safety Integrated

SMM: Safe Motion Monitoring

SS1: Safe Stop 1 (corresponds to Stop Category 1 acc. to EN60204)

STO: Safe Torque Off / SH: Safe standstill

201611 <location>SI P1 (CU): Defect in a monitoring channel

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE (OFF1, OFF2, OFF3)

Acknowledge: IMMEDIATELY (POWER ON)

- Cause:** The drive-integrated "Safety Integrated" function on processor 1 has detected a fault in the data cross-check between the two monitoring channels and has initiated a STOP F.
- As a result of this fault, after the parameterized transition has expired (p9658), fault F01600 (SI CU: STOP A initiated) is output.
- Fault value (r0949, interpret decimal):
- 0: Stop request from another monitoring channel.
- 1 ... 999:
- Number of the cross-compared data that resulted in this fault. This number is also displayed in r9795.
- 1: SI monitoring clock cycle (r9780, r9880).
- 2: SI enable safety functions (p9601, p9801). Crosswise data comparison is only carried out for the supported bits.
- 3: SI SGE changeover discrepancy time (p9650, p9850).
- 4: SI transition period STOP F to STOP A (p9658, p9858).
- 5: SI enable Safe Brake Control (p9602, p9802).
- 6: SI Motion enable, safety-relevant functions (p9501, internal value).
- 7: SI delay time of STO for Safe Stop 1 (p9652, p9852).
- 8: SI PROFIsafe address (p9610, p9810).
- 9: SI debounce time for STO/SBC/SS1 (p9651, p9851).
- 10: SI delay time for initiating STO for ESR (p9697, p9897).
- 11: SI Safe Brake Adapter mode, BICO interconnection (p9621, p9821).
- 12: SI Safe Brake Adapter relay ON time (p9622[0], p9822[0]).
- 13: SI Safe Brake Adapter relay OFF time (p9622[1], p9822[1]).
- 14: SI PROFIsafe telegram selection (p9611, p9811).
- 15: SI PROFIsafe bus failure response (p9612, p9812).
- 1000: Watchdog timer has expired.
- Within the time of approx. 5 x p9650, alternatively, the following was defined:
- the signal at terminal EP of the Motor Module continually changed with time intervals less than or equal to the discrepancy time (p9650/p9850).
 - via PROFIsafe/TM54F, STO (also as subsequent response) was continually selected and deselected with time intervals less than or equal to the discrepancy time (p9650/p9850).
 - safe pulse cancellation (r9723.9 - also as subsequent response) was continually selected and deselected with time intervals less than or equal to the discrepancy time (p9650/p9850).
- 1001, 1002: Initialization error, change timer / check timer.
- 1900: CRC error in the SAFETY sector.
- 1901: CRC error in the ITCM sector.
- 1902: Overloading in the ITCM sector has occurred in operation.
- 1903: Internal parameterizing error for CRC calculation.
- 1950: Module temperature outside the permissible temperature range.
- 1951: Module temperature not plausible.
- 2000: Status of the STO selection for both monitoring channels different.
- 2001: Feedback signal of STO shutdown for both monitoring channels different. This value can also subsequently occur as a result of other faults.
- 2002: Status of the delay timer SS1 for both monitoring channels different (status of the timer in p9650/p9850).
- 2003: Status of the STO terminal for both monitoring channels different.
- 2004: Status of the STO selection for Motor Modules connected in parallel different.
- 2005: Feedback signal of the safe pulse suppression on the Control Unit and Motor Modules connected in parallel different.
- 6000 ... 6999:
- Error in the PROFIsafe control.
- For these fault values, the failsafe control signals (Failsafe Values) are transferred to the safety functions. If "STOP B after failure of the PROFIsafe communication" (p9612) is parameterized, the transfer of the Failsafe Values is delayed.
- 6000: A fatal PROFIsafe communication error has occurred.
- 6064 ... 6071: error when evaluating the F parameter. The values of the transferred F parameters do not match the expected values in the PROFIsafe driver.
- 6064: Destination address and PROFIsafe address are different (F_Dest_Add).
- 6065: Destination address not valid (F_Dest_Add).

- 6066: Source address not valid (F_Source_Add).
- 6067: Watchdog time not valid (F_WD_Time).
- 6068: Incorrect SIL level (F_SIL).
- 6069: Incorrect F-CRC length (F_CRC_Length).
- 6070: Incorrect F parameter version (F_Par_Version).
- 6071: CRC error for the F parameters (CRC1). The transferred CRC value of the F parameters does not match the value calculated in the PROFIsafe driver.
- 6072: F parameterization is inconsistent.
- 6165: A communications error was identified when receiving the PROFIsafe telegram. The fault may also occur if an inconsistent or out-of-date PROFIsafe telegram has been received after switching the Control Unit off and on or after plugging in the PROFIBUS/PROFINET cable.
- 6166: A time monitoring error (timeout) was identified when receiving the PROFIsafe telegram.

Remedy:

For fault value = 1 ... 5 and 7 ... 999:

- check the cross data comparison that resulted in a STOP F.
- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade the Motor Module software.
- upgrade the Control Unit software.

For fault value = 6:

- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade the Motor Module software.
- upgrade the Control Unit software.

For fault value = 1000:

- check the EP terminal at the Motor Module (contact problems).
- PROFIsafe: Remove contact problems/faults at the PROFIBUS master/PROFINET controller.
- check the wiring of the failsafe inputs at the TM54F (contact problems).
- check the discrepancy time, and if required, increase the value (p9650/p9850).

For fault value = 1001, 1002:

- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade the Motor Module software.
- upgrade the Control Unit software.

For fault value = 1900, 1901, 1902:

- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade the Control Unit software.
- replace Control Unit.

For fault value = 2000, 2001, 2002, 2003, 2004, 2005:

- check the discrepancy time, and if required, increase the value (p9650/p9850, p9652/p9852).
- check the wiring of the safety-relevant inputs (SGE) (contact problems).
- check the causes of the STO selection in r9772. When the SMM functions are active (p9501 = 1), STO can also be selected using these functions.
- replace the Motor Module involved.
- diagnose the other active faults and resolve the causes.

Note:

This fault can be acknowledged after removing the cause of the error and after correct selection/deselection of STO.

For fault value = 6000:

- carry out a POWER ON (switch-off/switch-on) for all components.
- check whether there is a DRIVE-CLiQ communication error between the two monitoring channels and, if required, carry out a diagnostics routine for the faults identified.
- increase the monitoring cycle clock settings (p9500, p9511).
- upgrade firmware to later version.
- contact Technical Support.
- replace the Control Unit.

For fault value = 6064:

- check the setting of the value in the F parameter F_Dest_Add at the PROFIsafe slave.
- check the setting of the PROFIsafe address of the Control Unit (p9610) and that of the Motor Module (p9810).

For fault value = 6065:

- check the setting of the value in the F parameter F_Dest_Add at the PROFIsafe slave. It is not permissible for the destination address to be either 0 or FFFF!

For fault value = 6066:

- check the setting of the value in the F parameter F_Source_Add at the PROFIsafe slave. It is not permissible for the source address to be either 0 or FFFF!

For fault value = 6067:

- check the setting of the value in the F parameter F_WD_Time at the PROFIsafe slave. It is not permissible for the watch time to be 0!

For fault value = 6068:

- check the setting of the value in the F parameter F_SIL at the PROFIsafe slave. The SIL level must correspond to SIL2!

For fault value = 6069:

- check the setting of the value in the F parameter F_CRC_Length at the PROFIsafe slave. The setting of the CRC2 length is 2-byte CRC in the V1 mode and 3-byte CRC in the V2 mode!

For fault value = 6070:

- check the setting of the value in the F parameter F_Par_Version at the PROFIsafe slave. The value for the F parameter version is 0 in the V1 mode and 1 in the V2 mode!

For fault value = 6071:

- check the settings of the values of the F parameters and the F parameter CRC (CRC1) calculated from these at the PROFIsafe slave and, if required, update.

For fault value = 6072:

- check the settings of the values for the F parameters and, if required, correct.

The following combinations are permissible for F parameters F_CRC_Length and F_Par_Version:

F_CRC_Length = 2-byte CRC and F_Par_Version = 0

F_CRC_Length = 3-byte CRC and F_Par_Version = 1

For fault value = 6165:

- if the fault occurs after powering up the Control Unit or after plugging in the PROFIBUS/PROFINET cable, acknowledge the fault.

- check the configuration and communication at the PROFIsafe slave.

- check the setting of the value for F parameter F_WD_Time on the PROFIsafe slave and increase if necessary.

- check whether there is a DRIVE-CLiQ communication error between the two monitoring channels and, if required, carry out a diagnostics routine for the faults identified.

- check whether all F parameters of the drive match the F parameters of the F host.

For fault value = 6166:

- check the configuration and communication at the PROFIsafe slave.

- check the setting of the value for F parameter F_WD_Time on the PROFIsafe slave and increase if necessary.

- evaluate diagnostic information in the F host.

- check PROFIsafe connection.

- check whether all F parameters of the drive match the F parameters of the F host.

Note:

CU: Control Unit

EP: Enable Pulses (pulse enable)

ESR: Extended Stop and Retract

MM: Motor Module

SGE: Safety-relevant input

SI: Safety Integrated

SMM: Safe Motion Monitoring

SS1: Safe Stop 1

STO: Safe Torque Off / SH: Safe standstill

201612 <location>SI P1 (CU): STO inputs for power units connected in parallel different

Drive object: SERVO_828, SERVO_COMBI

Message value: Fault cause: %1 bin

Reaction: NONE (OFF1, OFF2, OFF3)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The drive-integrated "Safety Integrated" function on the Control Unit (CU) has identified different states of the AND'ed STO inputs for power units connected in parallel and has initiated a STOP F.

As a result of this fault, after the parameterized transition has expired (p9658), fault F01600 (SI CU: STOP A initiated) is output.

Fault value (r0949, interpret binary):

Binary image of the digital inputs of the Control Unit that are used as signal source for the function "Safe Torque Off".

Remedy:

- check the tolerance time SGE changeover and if required, increase the value (p9650).
- check the wiring of the safety-relevant inputs (SGE) (contact problems).

Note:

CU: Control Unit

SGE: Safety-relevant input

SI: Safety Integrated

STO: Safe Torque Off / SH: Safe standstill

201620 <location>SI P1 (CU): Safe Torque Off active

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The "Safe Torque Off" (STO) function of the basic functions has been selected on the Control Unit (CU) using the input terminal and is active.

Note:

- this message does not result in a safety stop response.

- this message is not output when STO is selected using the Extended Functions.

Remedy: Not necessary.

Note:

CU: Control Unit

SI: Safety Integrated

STO: Safe Torque Off / SH: Safe standstill

201621 <location>SI P1 (CU): Safe Stop 1 active

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The "Safe Stop 1" (SS1) function has been selected on the Control Unit (CU) and is active.

Note:

This message does not result in a safety stop response.

Remedy: Not necessary.

Note:

CU: Control Unit

SI: Safety Integrated

SS1: Safe Stop 1

201625 <location>SI P1 (CU): Sign-of-life error in safety data

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The drive-integrated "Safety Integrated" function on the Control Unit (CU) has detected an error in the sign-of-life of the safety data between the two monitoring channels and has initiated a STOP A.

- there is either a DRIVE-CLiQ communication error or communication has failed.

- a time slice overflow of the safety software has occurred.

Fault value (r0949, interpret decimal):

Only for internal Siemens troubleshooting.

- Remedy:**
- select STO and then deselect again.
 - carry out a POWER ON (switch-off/switch-on) for all components.
 - check whether there is a DRIVE-CLiQ communication error between the two monitoring channels and, if required, carry out a diagnostics routine for the faults identified.
 - deselect all drive functions that are not absolutely necessary.
 - reduce the number of drives.
 - check the electrical cabinet design and cable routing for EMC compliance
- Note:**
- CU: Control Unit
MM: Motor Module
SI: Safety Integrated
STO: Safe Torque Off

201630 <location>SI P1 (CU): Brake control error

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The drive-integrated "Safety Integrated" function on the Control Unit (CU) has detected a brake control fault and initiated a STOP A.

- motor cable is not shielded correctly.
- defect in the brake control circuit of the Motor Module.

Fault value (r0949, interpret decimal):

10, 11:

Fault in "open holding brake" operation.

- parameter p1278 incorrectly set.
- no brake connected or wire breakage (check whether brake releases for p1278 = 1 and p9602/p9802 = 0 (SBC deactivated)).
- ground fault in brake cable.

20:

Fault in "brake open" state.

- short-circuit in brake winding.

30, 31:

Fault in "close holding brake" operation.

- no brake connected or wire breakage (check whether brake releases for p1278 = 1 and p9602/p9802 = 0 (SBC deactivated)).
- short-circuit in brake winding.

40:

Fault in "brake closed" state.

50:

Fault in the brake control circuit of the Control Unit or communication fault between the Control Unit and Motor Module (brake control diagnostics).

80:

Safe Brake Adapter.

Fault in the brake control circuit of the Control Unit or communication fault between the Control Unit and Motor Module (brake control diagnostics).

90:

Brake released for service purposes (X4).

Remedy:

- check parameter p1278 (for SBC, only p1278 = 0 is permissible).
- for a parallel connection, check the setting of the power unit data set to control the holding brake (p7015).
- select Safe Torque Off and deselect again.
- check the motor holding brake connection.
- check the function of the motor holding brake.
- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.
- check that the electrical cabinet design and cable routing are in compliance with EMC regulations (e.g. shield of the motor cable and brake conductors are connected with the shield connecting plate and the motor connectors are tightly screwed to the housing).
- replace the Motor Module involved.

Operation with Safe Brake Module or Safe Brake Adapter:

- check the Safe Brake Module or Safe Brake Adapter connection.
- Replace the Safe Brake Module or Safe Brake Adapter.

Note:

CU: Control Unit
SBC: Safe Brake Control
SI: Safety Integrated

201631 <location>SI P1 (CU): motor holding brake/SBC configuration not practical

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: A configuration of motor holding brake and SBC was detected that is not practical.

The following configurations can result in this message:

- "No motor holding brake available" (p1215 = 0) and "SBC" enabled (p9602 = 1).
- "Motor holding brake just like the sequence control, connection via BICO" (p1215 = 3) and "SBC" enabled (p9602 = 1).

Remedy: Check the parameterization of the motor holding brake and SBC and correct.

Note:

SBC: Safe Brake Control

See also: p1215 (Motor holding brake configuration), p9602 (SI enable Safe Brake Control (Control Unit)), p9802 (SI enable Safe Brake Control (Motor Module))

201632 <location>SI P1 (CU): shutoff valve control/feedback signal error

Drive object: HLA_828

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause:	The drive-integrated "Safety Integrated" function on the Control Unit (monitoring channel 1) has detected a fault for the control/feedback signal of the shutoff valve and initiated a STOP A. Possible causes: - shutoff valve either not connected or not correctly connected (X272). - feedback signal of the shutoff valve either not connected or not correctly connected (X281/X282). - feedback signal of the shutoff valve incorrectly set (p9626/p9826). - shutoff valve defective. - Hydraulic Module defective. Fault value (r0949, interpret decimal): 10, 11: Fault in the "Open shutoff valve" operation. 20: Fault in the "Shutoff valve open" state. 30, 31: Fault in the "Close shutoff valve" operation. 40: Fault in the "Shutoff valve closed" state. 50, 80: Fault in the control/feedback signal of the cutoff valve or communication error between the Control Unit and the Hydraulic Module.
Remedy:	- check the shutoff valve connection (X272). - check the feedback signals of the shutoff valve (X281, X282). - check the configuration of the feedback signals of the shutoff valve (p9626/p9826). - check for EMC-compliant control cabinet design and cable routing (e.g. use shielded cables and connect the shield). - if necessary, replace the shutoff valve. - if necessary, replace the Hydraulic Module. See also: p9626 (SI HLA shutoff valve feedback signal contact configuration (CU)), p9826 (SI HLA shutoff valve feedback signal contact configuration (MM))

201640	<location>SI P1 (CU): component replacement identified and acknowledgment/save required
Drive object:	HLA_828
Message value:	Fault cause: %1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	"Safety Integrated" has identified that a component has been replaced. It is no longer possible to operate the particular drive without fault. When safety functions are active, after a component has been replaced it is necessary to carry out a partial acceptance test. Fault value (r0949, interpret binary): Bit 0 = 1: It has been identified that the Control Unit has been replaced. Bit 1 = 1: It has been identified that the Motor Module/Hydraulic Module has been replaced. Bit 2 = 1: It has been identified that the Power Module has been replaced. Bit 3 = 1: It has been identified that the Sensor Module channel 1 has been replaced. Bit 4 = 1: It has been identified that the Sensor Module channel 2 has been replaced. Bit 5 = 1: It has been identified that the sensor channel 1 has been replaced. Bit 6 = 1: It has been identified that sensor channel 2 has been replaced.

Remedy:

- acknowledge component replacement (p9702 = 29).
- save all parameters (p0977 = 1 or p0971 = 1 or "copy RAM to ROM").
- acknowledge fault (e.g. binector input p2103).

Note:

In addition to the fault, diagnostics bits r9776.2 and r9776.3 are set.

See also: p9702 (SI Acknowledge component replacement), r9776 (SI diagnostics)

201640 <location>SI P1 (CU): component replacement identified and acknowledgment/save required

Drive object: SERVO_828, SERVO_COMBI

Message value: Fault cause: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause:

"Safety Integrated" has identified that a component has been replaced.

Replacing the component means that the "Global checksum" of the "Safety-relevant hardware" is changed. It is no longer possible to operate the particular drive without fault.

When safety functions are active, after a component has been replaced it is necessary to carry out a partial acceptance test.

Fault value (r0949, interpret binary):

Bit 0 = 1:
It has been identified that the Control Unit has been replaced.

Bit 1 = 1:
It has been identified that the Motor Module/Hydraulic Module has been replaced.

Bit 2 = 1:
It has been identified that the Power Module has been replaced.

Bit 3 = 1:
It has been identified that the Sensor Module channel 1 has been replaced.

Bit 4 = 1:
It has been identified that the Sensor Module channel 2 has been replaced.

Bit 5 = 1:
It has been identified that the sensor channel 1 has been replaced.

Bit 6 = 1:
It has been identified that sensor channel 2 has been replaced.

Remedy:

- acknowledge component replacement (p9702 = 29).
- save all parameters (p0977 = 1 or p0971 = 1 or "copy RAM to ROM").
- acknowledge fault (e.g. binector input p2103).

Note:

In addition to the fault, diagnostics bits r9776.2 and r9776.3 are set.

See also: p9702 (SI Acknowledge component replacement), r9776 (SI diagnostics)

201641 <location>SI P1 (CU): component replacement identified and save required

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI

Message value: Fault cause: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause:	"Safety Integrated" has identified that a component has been replaced. No additional fault response is initiated, therefore operation of the particular drive is not restricted. When safety functions are active, after a component has been replaced it is necessary to carry out a partial acceptance test. Fault value (r0949, interpret binary): Bit 0 = 1: It has been identified that the Control Unit has been replaced. Bit 1 = 1: It has been identified that the Motor Module/Hydraulic Module has been replaced. Bit 2 = 1: It has been identified that the Power Module has been replaced. Bit 3 = 1: It has been identified that the Sensor Module channel 1 has been replaced. Bit 4 = 1: It has been identified that the Sensor Module channel 2 has been replaced. Bit 5 = 1: It has been identified that the sensor channel 1 has been replaced. Bit 6 = 1: It has been identified that sensor channel 2 has been replaced.
Remedy:	- save all parameters (p0977 = 1 or p0971 = 1 or "copy RAM to ROM"). - acknowledge fault (e.g. binector input p2103). See also: r9776 (SI diagnostics)

201641	<location>SI P1 (CU): component replacement identified and save required
Drive object:	TM54F_MA
Message value:	-
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	The "Safety Integrated" function integrated in the drive has identified that a Terminal Module 54F (TM54F) has been replaced.
Remedy:	- save all parameters (p0977 = 1 or p0971 = 1 or "copy RAM to ROM"). - acknowledge fault (e.g. binector input p2103). See also: r9776 (SI diagnostics)

201641	<location>SI P1 (CU): component replacement identified and save required
Drive object:	SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1
Reaction:	NONE
Acknowledge:	IMMEDIATELY

Cause:	"Safety Integrated" has identified that a component has been replaced. Replacing the component does not change the "Global checksum" of the "Safety-relevant hardware". No additional fault response is initiated, therefore operation of the particular drive is not restricted. When safety functions are active, after a component has been replaced it is necessary to carry out a partial acceptance test. Fault value (r0949, interpret binary): Bit 0 = 1: It has been identified that the Control Unit has been replaced. Bit 1 = 1: It has been identified that the Motor Module/Hydraulic Module has been replaced. Bit 2 = 1: It has been identified that the Power Module has been replaced. Bit 3 = 1: It has been identified that the Sensor Module channel 1 has been replaced. Bit 4 = 1: It has been identified that the Sensor Module channel 2 has been replaced. Bit 5 = 1: It has been identified that the sensor channel 1 has been replaced. Bit 6 = 1: It has been identified that sensor channel 2 has been replaced.
Remedy:	- save all parameters (p0977 = 1 or p0971 = 1 or "copy RAM to ROM"). - acknowledge fault (e.g. binector input p2103). See also: r9776 (SI diagnostics)

201649 <location>SI P1 (CU): Internal software error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	An internal error in the Safety Integrated software on the Control Unit has occurred. Note: This fault results in a STOP A that cannot be acknowledged. Fault value (r0949, interpret hexadecimal): Only for internal Siemens troubleshooting.
Remedy:	- carry out a POWER ON (switch-off/switch-on) for all components. - re-commission the "Safety Integrated" function and carry out a POWER ON. - upgrade the firmware of the Control Unit to a later version. - contact Technical Support. - replace the Control Unit. Note: CU: Control Unit SI: Safety Integrated

201650 <location>SI P1 (CU): Acceptance test required

Drive object:	A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, CU_NX_828, CU_NX_COMBI, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)

- Cause:** The drive-integrated "Safety Integrated" function on monitoring channel 1 requires an acceptance test.
- Note:**
 This fault results in a STOP A that can be acknowledged.
 Fault value (r0949, interpret decimal):
 130: Safety parameters for monitoring channel 2 not available.
- Note:**
 This fault value is always output when Safety Integrated is commissioned for the first time.
 1000: Reference and actual checksum on monitoring channel 1 are not identical (booting).
 - as a result of the changed current controller sampling time (p0115[0]), the clock cycle time for the Safety Integrated Basic Functions (r9780) was adapted.
 - at least one checksum-checked piece of data is defective.
 - safety parameters set offline and loaded into the Control Unit.
 2000: Reference and actual checksum on monitoring channel 1 are not identical (commissioning mode).
 - reference checksum on monitoring channel 1 incorrectly entered (p9799 not equal to r9798).
 - when deactivating the safety functions, p9501 or p9503 were not deleted.
 2001: Reference and actual checksum on monitoring channel 2 are not identical (commissioning mode).
 - reference checksum on monitoring channel 2 incorrectly entered (p9899 not equal to r9898).
 - when deactivating the safety functions, p9501 or p9503 are not deleted.
 2002: Enable of safety-related functions between the two monitoring channels differ (p9601 not equal to p9801).
 2003: Acceptance test is required as a safety parameter has been changed.
 2004: An acceptance test is required because a project with enabled safety-functions has been downloaded.
 2005: The Safety logbook has identified that a functional safety checksum has changed. An acceptance test is required.
 2010: Enable of safety-related brake control between the two monitoring channels differ (p9602 not equal to p9802).
 2020: Error when saving the safety parameters for the monitoring channel 2.
 3003: Acceptance test is required as a hardware-related safety parameter has been changed.
 3005: The Safety logbook has identified that a hardware-related safety checksum has changed. An acceptance test is required.
 9999: Subsequent response of another safety-related fault that occurred when booting that requires an acceptance test.

Remedy:

For fault value = 130:

- carry out safety commissioning routine.

For fault value = 1000:

- check the Safety Integrated Basic Functions (r9780) and adapt the reference checksum (p9799).
- again carry out safety commissioning routine.
- replace the memory card or Control Unit.
- Using STARTER, activate the safety parameters for the drive involved (change settings, copy parameters, activate settings).

For fault value = 2000:

- check the safety parameters on monitoring channel 1 and adapt the reference checksum (p9799).

For fault value = 2001:

- check the safety parameters on monitoring channel 2 and adapt the reference checksum (p9899).

For fault value = 2002:

- check the enable the safety-related functions on both monitoring channels (p9601 = p9801).

For fault value = 2003, 2004, 2005:

- carry out an acceptance test and generate an acceptance report.

The procedure when carrying out an acceptance test as well as an example of the acceptance report are provided in the following literature:

SINAMICS S120 Function Manual Safety Integrated

Note:

The fault with fault value 2005 can only be acknowledged when the "STO" function is deselected.

For fault value = 2010:

- check the enable the safety-related brake control on both monitoring channels (p9602 = p9802).

For fault value = 2020:

- again carry out safety commissioning routine.
- replace the memory card or Control Unit.

For fault value = 3003:

- carry out the function checks for the modified hardware and generate an acceptance report.

The procedure when carrying out an acceptance test as well as an example of the acceptance report are provided in the following literature:

SINAMICS S120 Function Manual Safety Integrated

For fault value = 3005:

- carry out the function checks for the modified hardware and generate an acceptance report.

The fault with fault value 3005 can only be acknowledged when the "STO" function is deselected.

For fault value = 9999:

- carry out diagnostics for the other safety-related fault that is present.

Note:

CU: Control Unit

MM: Motor Module

SI: Safety Integrated

STO: Safe Torque Off

See also: p9799 (SI reference checksum SI parameters (Control Unit)), p9899 (SI reference checksum SI parameters (Motor Module))

201650 <location>SI P1 (CU): Acceptance test required

Drive object: HLA_828

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

- Cause:** The drive-integrated "Safety Integrated" function on monitoring channel 1 requires an acceptance test.
- Note:**
 This fault results in a STOP A that can be acknowledged.
 Fault value (r0949, interpret decimal):
 130: Safety parameters for monitoring channel 2 not available.
- Note:**
 This fault value is always output when Safety Integrated is commissioned for the first time.
 1000: Reference and actual checksum on monitoring channel 1 are not identical (booting).
 - as a result of the changed current controller sampling time (p0115[0]), the clock cycle time for the Safety Integrated Basic Functions (r9780) was adapted.
 - at least one checksum-checked piece of data is defective.
 - safety parameters set offline and loaded into the Control Unit.
 2000: Reference and actual checksum on monitoring channel 1 are not identical (commissioning mode).
 - reference checksum on monitoring channel 1 incorrectly entered (p9799 not equal to r9798).
 - when deactivating the safety functions, p9501 or p9503 were not deleted.
 2001: Reference and actual checksum on monitoring channel 2 are not identical (commissioning mode).
 - reference checksum on monitoring channel 2 incorrectly entered (p9899 not equal to r9898).
 - when deactivating the safety functions, p9501 or p9503 are not deleted.
 2002: Enable of safety-related functions between the two monitoring channels differ (p9601 not equal to p9801).
 2003: Acceptance test is required as a safety parameter has been changed.
 2004: An acceptance test is required because a project with enabled safety-functions has been downloaded.
 2005: The Safety logbook has identified that a functional safety checksum has changed. An acceptance test is required.
 2020: Error when saving the safety parameters for the monitoring channel 2.
 3003: Acceptance test is required as a hardware-related safety parameter has been changed.
 3005: The Safety logbook has identified that a hardware-related safety checksum has changed. An acceptance test is required.
 9999: Subsequent response of another safety-related fault that occurred when booting that requires an acceptance test.

Remedy:

For fault value = 130:

- carry out safety commissioning routine.

For fault value = 1000:

- check the Safety Integrated Basic Functions (r9780) and adapt the reference checksum (p9799).
- again carry out safety commissioning routine.
- replace the memory card or Control Unit.
- Using STARTER, activate the safety parameters for the drive involved (change settings, copy parameters, activate settings).

For fault value = 2000:

- check the safety parameters on monitoring channel 1 and adapt the reference checksum (p9799).

For fault value = 2001:

- check the safety parameters on monitoring channel 2 and adapt the reference checksum (p9899).

For fault value = 2002:

- check the enable the safety-related functions on both monitoring channels (p9601 = p9801).

For fault value = 2003, 2004, 2005:

- carry out an acceptance test and generate an acceptance report.

The procedure when carrying out an acceptance test as well as an example of the acceptance report are provided in the following literature:

SINAMICS S120 Function Manual Safety Integrated

The fault with fault value 2005 can only be acknowledged when the "STO" function is deselected.

For fault value = 2020:

- again carry out safety commissioning routine.
- replace the memory card or Control Unit.

For fault value = 3003:

- carry out the function checks for the modified hardware and generate an acceptance report.

The procedure when carrying out an acceptance test as well as an example of the acceptance report are provided in the following literature:

SINAMICS S120 Function Manual Safety Integrated

For fault value = 3005:

- carry out the function checks for the modified hardware and generate an acceptance report.

The fault with fault value 3005 can only be acknowledged when the "STO" function is deselected.

For fault value = 9999:

- carry out diagnostics for the other safety-related fault that is present.

Note:

CU: Control Unit

MM: Motor Module

SI: Safety Integrated

STO: Safe Torque Off

See also: p9799 (SI reference checksum SI parameters (Control Unit)), p9899 (SI reference checksum SI parameters (Motor Module))

201651 <location>SI P1 (CU): Synchronization safety time slices unsuccessful

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause:	The "Safety Integrated" function requires a synchronization of the safety time slices between the two monitoring channels and between the Control Unit and the higher-level control. This synchronization routine was unsuccessful. Note: This fault results in a STOP A that cannot be acknowledged. Fault value (r0949, interpret decimal): 121: - with SINUMERIK Safety Integrated enabled, a drive-side warm restart was performed on the CU/NX. - with SINUMERIK Safety Integrated enabled, the function "restore factory setting" was selected on a drive object of the CU and a drive-side warm restart was initiated. 150: - fault in the synchronization to the PROFIBUS master. All other values: - only for internal Siemens troubleshooting. See also: p9510 (SI Motion isochronous PROFIBUS master)
Remedy:	For fault value = 121: - carry out a common POWER ON/warm restart for the higher-level control and SINAMICS. For fault value = 150: - check the setting of p9510 (SI Motion isochronous PROFIBUS master) and if required, correct. General: - carry out a POWER ON (switch-off/switch-on) for all components. - upgrade the Motor Module/Hydraulic Module software. - upgrade the Control Unit software. - upgrade the software of the higher-level control. Note: CU: Control Unit SI: Safety Integrated

201652	<location>SI P1 (CU): Illegal monitoring clock cycle
Drive object:	HLA_828
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)

Cause:

One of the Safety Integrated monitoring clock cycles is not permissible.

- the monitoring clock cycle integrated in the drive cannot be maintained due to the communication conditions required in the system.
- the monitoring clock cycle for safe motion monitoring functions is not permissible (p9500).
- the actual value sensing clock cycle for safe motion monitoring functions is not permissible (p9511).
- the sampling time for the current controller (p0112, p0115[0]) cannot be supported.

Note:

This fault results in a STOP A that cannot be acknowledged.

Fault value (r0949, interpret decimal):

For motion monitoring functions that are not enabled (p9601.2 = p9801.2 = 0, p9501 = 0), the following applies:

- Minimum setting for the monitoring clock cycle (in μ s).

For motion monitoring functions that are enabled (p9601.2 = p9801.2 = 1 and/or p9501 > 0), the following applies:

100:

- no matching monitoring clock cycle was able to be found.
- an illegal actual value sensing clock cycle was set for S120M (p9511).

101:

- the monitoring clock cycle is not an integer multiple of the actual value sensing clock cycle.

102:

- An error has occurred when transferring the actual value sensing clock cycle to the Hydraulic Module.

103:

- An error has occurred when transferring the actual value sensing clock cycle to the Sensor Module.

104, 105:

- four times the current controller sampling time (p0115[0]) is greater than 1 ms when operating with a non-isochronous PROFIBUS.

- four times the current controller sampling time (p0115[0]) is greater than the DP clock cycle when operating with an isochronous PROFIBUS.

- the DP clock cycle is not an integer multiple of the sampling time of the current controller (p0115[0]).

106:

- the monitoring clock cycle does not match the monitoring clock cycle of the TM54F.

107:

- the actual value sensing clock cycle (p9511) is less than four times the current controller sampling time (p0115[0]).
- the actual value sensing clock cycle (p9511) is not an integer multiple of the sampling time of the current controller (p0115[0]).

108:

- the parameterized actual value sensing clock cycle cannot be set on this component

111:

- the monitoring clock cycle is not an integer multiple of the sampling time of the current controller (p0115[0]).

112:

- an actual value sensing clock cycle p9511 = 0 is not permissible in this configuration.

202:

- the current controller sampling time is set to zero (p0115[0]).

Remedy:	For enabled SI monitoring integrated in the drive (p9601/p9801 > 0): - upgrade the firmware of the Control Unit to a later version. For enabled motion monitoring function (p9501 > 0): - correct the monitoring clock cycle (p9500) and carry out POWER ON. For fault value = 100: - for S120M, set the actual value sensing clock cycle to p9511 = 0. For fault value = 101: - actual value sensing clock cycle corresponds to position control clock cycle/DP clock cycle (factory setting). - for motion monitoring functions integrated in the drive (p9601/p9801 bit 2 = 1) the actual value sensing clock cycle can be directly parameterized in p9511/p9311. For fault value = 104, 105: - set a separate actual value sensing clock cycle in p9511. - restrict operation to a maximum of two vector drives. For the standard setting in p0112, p0115, the current controller sampling time is automatically reduced to 250 µs. If the standard values were changed, then the current controller sampling time (p0112, p0115) should be appropriately set. - increase the DP clock cycle for operation with an isochronous PROFIBUS so that there is a multiple clock cycle ratio of at least 4:1 between the DP clock cycle and the current controller sampling time. A clock cycle ratio of at least 8:1 is recommended. - With firmware version 2.5, please ensure that parameter p9510 is set to 1 in the drive (clock cycle synchronous operation). For fault value = 106: - set the parameters for the monitoring clock cycles the same (p10000 and p9500/p9300). For fault value = 107: - set an actual value sensing clock cycle that matches the current controller clock cycle ($p9511 \geq 4 * p0115[0]$, $8 * p0115[0]$) is recommended. Note: An actual value sensing clock cycle (p9511) that is set too low, can sporadically mean that safety messages C01711/C30711 are output with message value 1020 or 1021. For fault value = 108: - set a suitable actual value sensing clock cycle in p9511. - if the DP clock cycle is used as the actual value sensing clock cycle for operation with isochronous PROFIBUS (p9511 = 0), then a suitable DP clock cycle must be configured. This must be set to less than 8 ms. If this is not possible, then p9511 must be set to the required actual value sensing clock cycle (< 8 ms). - For SIMOTION D410-2, a suitable multiple of the DP clock cycle (e.g. 1, 2, 3, 4, 5, 6, 8, 10) must be parameterized. Otherwise, the clock cycle must be set to less than 8 ms. For fault value = 111: - set the monitoring clock cycle in p9500 as an integer multiple of the sampling time of the current controller (p0115[0]). For fault value = 112: - set the actual value sensing clock cycle p9511 to the required value (not equal to zero). For fault value = 202: - set the current controller sampling time to a sensible value (p0115[0]). Note: CU: Control Unit SI: Safety Integrated
----------------	---

201652	<location>SI P1 (CU): Illegal monitoring clock cycle
Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)

Cause:

One of the Safety Integrated monitoring clock cycles is not permissible.

- the monitoring clock cycle integrated in the drive cannot be maintained due to the communication conditions required in the system.
- the monitoring clock cycle for safe motion monitoring functions is not permissible (p9500).
- the actual value sensing clock cycle for safe motion monitoring functions is not permissible (p9511).
- the sampling time for the current controller (p0112, p0115[0]) cannot be supported.

Note:

This fault results in a STOP A that cannot be acknowledged.

Fault value (r0949, interpret decimal):

For motion monitoring functions that are not enabled (p9601.2 = p9801.2 = 0, p9501 = 0), the following applies:

- Minimum setting for the monitoring clock cycle (in μ s).

For motion monitoring functions that are enabled (p9601.2 = p9801.2 = 1 and/or p9501 > 0), the following applies:

100:

- no matching monitoring clock cycle was able to be found.
- an illegal actual value sensing clock cycle was set for S120M (p9511).

101:

- the monitoring clock cycle is not an integer multiple of the actual value sensing clock cycle.
- SINAMICS S120M: the monitoring clock cycle (p9500) is not an integer multiple of 2 ms.

102:

- An error has occurred when transferring the actual value sensing clock cycle to the Motor Module.

103:

- An error has occurred when transferring the actual value sensing clock cycle to the Sensor Module.

104, 105:

- four times the current controller sampling time (p0115[0]) is greater than 1 ms when operating with a non-isochronous PROFIBUS.
- four times the current controller sampling time (p0115[0]) is greater than the DP clock cycle when operating with an isochronous PROFIBUS.
- the DP clock cycle is not an integer multiple of the sampling time of the current controller (p0115[0]).

106:

- the monitoring clock cycle does not match the monitoring clock cycle of the TM54F.

107:

- the actual value sensing clock cycle (p9511) is less than four times the current controller sampling time (p0115[0]).
- the actual value sensing clock cycle (p9511) is not an integer multiple of the sampling time of the current controller (p0115[0]).

108:

- the parameterized actual value sensing clock cycle cannot be set on this component

109:

- if the motion monitoring functions have been parameterized as encoderless (p9506), the actual value sensing clock cycle (p9511) and the current controller clock cycle (p0115[0]) must be identical.
- SINAMICS S110: if the motion monitoring functions have been parameterized as encoderless (p9506), the actual value sensing clock cycle p9511 must be = 250 μ s.

110:

- the actual value sensing clock cycle (p9511) for safety with encoder (p9506 = 0) is less than 2 ms for this Control Unit (e.g. CU305).

111:

- the monitoring clock cycle is not an integer multiple of the sampling time of the current controller (p0115[0]).

112:

- An actual value sensing clock cycle p9511 = 0 on a drive object of a Double Motor Module is not permissible in the existing configuration.

200, 201:

- S120M: the monitoring clock cycle cannot be maintained as a result of the conditions required in the system.

202:

- the current controller sampling time is set to zero (p0115[0]).

- Remedy:**
- For enabled SI monitoring integrated in the drive (p9601/p9801 > 0):
 - upgrade the firmware of the Control Unit to a later version.
 - For enabled motion monitoring function (p9501 > 0):
 - correct the monitoring clock cycle (p9500) and carry out POWER ON.
 - For fault value = 100:
 - for S120M, set the actual value sensing clock cycle to p9511 = 0.
 - For fault value = 101:
 - actual value sensing clock cycle corresponds to position control clock cycle/DP clock cycle (factory setting).
 - for motion monitoring functions integrated in the drive (p9601/p9801 bit 2 = 1) the actual value sensing clock cycle can be directly parameterized in p9511/p9311.
 - SINAMICS S120M: set the monitoring clock cycle (p9500) to an integer multiple of 2 ms.
 - For fault value = 104, 105:
 - set a separate actual value sensing clock cycle in p9511.
 - restrict operation to a maximum of two vector drives. For the standard setting in p0112, p0115, the current controller sampling time is automatically reduced to 250 µs. If the standard values were changed, then the current controller sampling time (p0112, p0115) should be appropriately set.
 - increase the DP clock cycle for operation with an isochronous PROFIBUS so that there is a multiple clock cycle ratio of at least 4:1 between the DP clock cycle and the current controller sampling time. A clock cycle ratio of at least 8:1 is recommended.
 - With firmware version 2.5, please ensure that parameter p9510 is set to 1 in the drive (clock cycle synchronous operation).
 - For fault value = 106:
 - set the parameters for the monitoring clock cycles the same (p10000 and p9500/p9300).
 - For fault value = 107:
 - set an actual value sensing clock cycle that matches the current controller clock cycle ($p9511 \geq 4 * p0115[0]$, $8 * p0115[0]$ is recommended).
 - Note:

An actual value sensing clock cycle (p9511) that is set too low, can sporadically mean that safety messages C01711/C30711 are output with message value 1020 or 1021.
 - For fault value = 108:
 - set a suitable actual value sensing clock cycle in p9511.
 - if the DP clock cycle is used as the actual value sensing clock cycle for operation with isochronous PROFIBUS (p9511 = 0), then a suitable DP clock cycle must be configured. This must be set to less than 8 ms. If this is not possible, then p9511 must be set to the required actual value sensing clock cycle (< 8 ms).
 - For SIMOTION D410-2, a suitable multiple of the DP clock cycle (e.g. 1, 2, 3, 4, 5, 6, 8, 10) must be parameterized. Otherwise, the clock cycle must be set to less than 8 ms.
 - For fault value = 109:
 - set the actual value sensing clock cycle in p9511 to the same value as the current controller clock cycle (p0115[0]).
 - SINAMICS S110: set the actual value sensing clock cycle to p9511 = 250 µs.
 - For fault value = 110:
 - set the actual value sensing clock cycle in p9511 to 2 ms or higher.
 - For fault value = 111:
 - set the monitoring clock cycle in p9500 as an integer multiple of the sampling time of the current controller (p0115[0]).
 - For fault value = 112:
 - set the actual value sensing clock cycle p9511 to the required value (not equal to zero).
 - For fault value = 200, 201:
 - increase the current controller sampling time (p0115[0]).
 - if required, reduce the number of components connected to the corresponding DRIVE-CLiQ line, or distribute the components across several DRIVE-CLiQ sockets.
 - For fault value = 202:
 - set the current controller sampling time to a sensible value (p0115[0]).
 - Note:

CU: Control Unit
MM: Motor Module
SI: Safety Integrated

201653 <location>SI P1 (CU): PROFIBUS/PROFINET configuration error**Drive object:** HLA_828, SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:** NONE (OFF1, OFF2, OFF3)**Acknowledge:** IMMEDIATELY (POWER ON)**Cause:** There is a PROFIBUS/PROFINET configuration error for using Safety Integrated monitoring functions with a higher-level control (SINUMERIK or F-PLC).**Note:**

For safety functions that have been enabled, this fault results in a STOP A that cannot be acknowledged.

Fault value (r0949, interpret decimal):

200: A safety slot for receive data from the control has not been configured.

210, 220: The configured safety slot for the receive data from the control has an unknown format.

230: The configured safety slot for the receive data from the F-PLC has the incorrect length.

231: The configured safety slot for the receive data from the F-PLC has the incorrect length.

240: The configured safety slot for the receive data from the SINUMERIK has the incorrect length.

250: A PROFIsafe slot is configured in the higher-level F control, however PROFIsafe is not enabled in the drive.

300: A safety slot for the send data to the control has not been configured.

310, 320: The configured safety slot for the send data to the control has an unknown format.

330: The configured safety slot for the send data to the F-PLC has the incorrect length.

331: The configured safety slot for the send data to the F-PLC has the incorrect length.

340: The configured safety slot for the send data to the SINUMERIK has the incorrect length.

400: The telegram number in the F-PLC does not match the parameterization in the drive.

Remedy: The following generally applies:

- check and, if necessary, correct the PROFIBUS/PROFINET configuration of the safety slot on the master side.

- upgrade the Control Unit software.

For fault value = 250:

- remove the PROFIsafe configuring in the higher-level F control or enable PROFIsafe in the drive.

For fault value = 231, 331:

- in the drive, parameterize the appropriate PROFIsafe telegram (p9611/p9811) to be set on the F-PLC and to be set in p60022.

- Configure the PROFIsafe telegram matching the parameterization (p9611/p9811) in the F-PLC.

201654 <location>SI P1 (CU): Deviating PROFIsafe configuration**Drive object:** HLA_828, SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE**Cause:** The configuration of a PROFIsafe telegram in the higher-level control (F-PLC) does not match the parameterization in the drive.**Note:**

This message does not result in a safety stop response.

Alarm value (r2124, interpret decimal):

1:

A PROFIsafe telegram is configured in the higher-level control, however PROFIsafe is not enabled in the drive (p9601.3).

2:

PROFIsafe is parameterized in the drive; however, a PROFIsafe telegram has not been configured in the higher-level control.

Remedy: The following generally applies:

- check and, if necessary, correct the PROFIsafe configuration in the higher-level control.

For alarm value = 1:

- remove the PROFIsafe configuring in the higher-level F control or enable PROFIsafe in the drive.

For alarm value = 2:

- configure the PROFIsafe telegram to match the parameterization in the higher-level F-control.

201655 <location>SI P1 (CU): Align monitoring functions

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: An error has occurred when aligning the Safety Integrated monitoring functions of both monitoring channels. No common set of supported SI monitoring functions was able to be determined.

- there is either a DRIVE-CLiQ communication error or communication has failed.
- Safety Integrated software releases on the Control Unit and Motor Module/Hydraulic Module are not compatible with one another.

Note:

This fault results in a STOP A that cannot be acknowledged.

Fault value (r0949, interpret hexadecimal):

Only for internal Siemens troubleshooting.

Remedy:

- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade the Motor Module/Hydraulic Module software.
- upgrade the Control Unit software.
- check the electrical cabinet design and cable routing for EMC compliance

Note:

CU: Control Unit

SI: Safety Integrated

201656 <location>SI CU: Parameter monitoring channel 2 error

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: When accessing the Safety Integrated parameters for monitoring channel 2 in the non-volatile memory, an error has occurred.

Note:

This fault results in a STOP A that can be acknowledged.

Fault value (r0949, interpret decimal):

129:

- safety parameters for monitoring channel 2 corrupted.
- drive with enabled safety functions was possibly copied offline using the commissioning tool and the project downloaded.

131: Internal Motor Module/Hydraulic Module software error.

132: Communication errors when uploading or downloading the safety parameters for monitoring channel 2.

255: Internal software error on the Control Unit.

Remedy:

- re-commission the safety functions.
- upgrade the Control Unit software.
- upgrade the Motor Module/Hydraulic Module software.
- replace the memory card or Control Unit.

For fault value = 129:

- activate the safety commissioning mode (p0010 = 95).
- adapt the PROFIsafe address (p9610).
- start the copy function for SI parameters (p9700 = D0 hex).
- acknowledge data change (p9701 = DC hex).
- exit the safety commissioning mode (p0010 = 0).
- save all parameters (p0977 = 1 or "copy RAM to ROM").
- carry out a POWER ON (switch-off/switch-on) for all components.

For fault value = 132:

- check the electrical cabinet design and cable routing for EMC compliance

Note:
CU: Control Unit
SI: Safety Integrated

201657 <location>SI P1 (CU): PROFIsafe telegram number invalid

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: POWER ON

Cause: The PROFIsafe telegram number set in p9611 is not valid.
When PROFIsafe is enabled (p9601.3 = 1), then a telegram number greater than zero must be entered in p9611.
Note:

This fault does not result in a safety stop response.

See also: p9611 (SI PROFIsafe telegram selection (Control Unit)), p60022 (PROFIsafe telegram selection)

Remedy: Check the telegram number setting (p9611).

201658 <location>SI P1 (CU): PROFIsafe telegram number differ

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The PROFIsafe telegram number is set differently in p9611 and p60022.
For p9611 not equal to 998, the following applies:
The telegram number must be identically set in both parameters.
The following applies for p9611 = 998:
As a result of the compatibility to firmware versions < 4.5, then only the values 0 and 30 are permitted in p60022.
Note:

This fault does not result in a safety stop response.

See also: p9611 (SI PROFIsafe telegram selection (Control Unit)), p60022 (PROFIsafe telegram selection)

Remedy: Match the telegram number in both parameters so that they are the same (p9611, p60022).

201659 <location>SI P1 (CU): Write request for parameter rejected

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

- Cause:** The write request for one or several Safety Integrated parameters on the Control Unit (CU) was rejected.
- Note:**
This fault does not result in a safety stop response.
Fault value (r0949, interpret decimal):
- 1: The Safety Integrated password is not set.
 - 2: A reset of the drive parameters was selected. However, the Safety Integrated parameters were not reset, as Safety Integrated is presently enabled.
 - 3: The interconnected STO input is in the simulation mode.
 - 10: An attempt was made to enable the STO function although this cannot be supported.
 - 11: An attempt was made to enable the SBC function although this cannot be supported.
 - 12: An attempt was made to enable the SBC function although this cannot be supported for a parallel circuit configuration (r9871.14).
 - 13: An attempt was made to enable the SS1 function although this cannot be supported.
 - 14: An attempt was made to enable the PROFIsafe communication - although this cannot be supported or the version of the PROFIsafe driver used on both monitoring channels is different.
 - 15: An attempt was made to enable the motion monitoring functions integrated in the drive although these cannot be supported.
 - 16: An attempt was made to enable the STO function although this cannot be supported when the internal voltage protection (p1231) is enabled.
 - 17: An attempt was made to enable the PROFIsafe function although this cannot be supported for a parallel circuit configuration.
 - 18: An attempt was made to enable the PROFIsafe function for Basic Functions although this cannot be supported.
 - 19: An attempt was made to enable the SBA (Safe Brake Adapter), although this cannot be supported.
 - 20: An attempt was made to enable the motion monitoring functions integrated in the drive and the STO function, both controlled via F-DI.
 - 21: An attempt was made to enable the motion monitoring functions integrated in the drive for a parallel connection, although these cannot be supported.
 - 22: An attempt was made to enable the Safety Integrated Functions although these cannot be supported by the connected Power Module.
 - 23: For ESR, an attempt was made to enable the delay of STO, although this cannot be supported.
 - 24: An attempt was made to enable the SBC function, although no power unit data set is set for the brake control (p7015 = 99).
 - 25: An attempt was made to parameterize a PROFIsafe telegram although this cannot be supported.
 - 26: With the selected signal source for STO/SS1, an attempt was made to activate the simulation mode.
 - 27: An attempt was made to activate the Basic Functions by controlling via TM54F although this is not supported.
 - 28: An attempt was made to enable the "STO via terminals at the Power Module" function although this cannot be supported.
 - 29: An attempt was made to parameterize the STOP B as stop response for PROFIsafe failure, although this cannot be supported.
 - 9612: An attempt was made to parameterize STOP B as stop response for PROFIsafe failure, although PROFIsafe is not enabled.
- See also: p0970, p3900, p9612, r9771, r9871

Remedy:

For fault value = 1:

- set the Safety Integrated password (p9761).

For fault value = 2:

- inhibit Safety Integrated (p9501, p9601) or reset safety parameters (p0970 = 5), then reset the drive parameters again.

For fault value = 3:

- end the simulation mode for the digital input (p0795).

For fault value = 10, 11, 12, 13, 14, 15, 17, 18, 19, 21, 22, 23, 27:

- check whether there are faults in the safety function alignment between the two monitoring channels (F01655, F30655) and if required, carry out diagnostics for the faults involved.
- use a Motor Module that supports the required function.
- upgrade the Motor Module software.
- upgrade the Control Unit software.

For fault value = 16:

- inhibit the internal voltage protection (p1231).

For fault value = 20:

- correct the enable setting (p9601).

For fault value = 22:

- use a Power Module that supports the Safety Integrated Functions.

For fault value = 24:

- set the power unit data set for the holding brake (p7015).

For fault value = 25:

- use a Power Module that supports the PROFIsafe telegram selection.
- correct the telegram number setting (p9611).

For fault value = 26:

- deactivate the simulation mode for the set signal source for STO/SS1 (p9620) (p0795).

For fault value = 28:

- use the power unit with the feature "STO via terminals at the Power Module".

For fault value = 29:

- use a Motor Module that supports the required function.
- upgrade the Motor Module software.
- upgrade the Control Unit software.
- if required, parameterize the stop response for PROFIsafe failure to STOP A (p9612 = p9812 = 0).

For fault value = 33:

- deselect drive integrated motion monitoring without selection (p9601.5, p9801.5) and select safety functions that are supported (see p9771/p9871).
- use a Motor Module that supports the required function.
- upgrade the Motor Module software.
- upgrade the Control Unit software.

For fault value = 9612:

- establish communications with PROFIsafe (p9601).
- parameterize STOP A as the stop response for PROFIsafe failure (p9612 = 0).

Note:

CU: Control Unit

ESR: Extended Stop and Retract

F-DI: Failsafe Digital Input

SBA: Safe Brake Adapter

SBC: Safe Brake Control

SI: Safety Integrated

SS1: Safe Stop 1

STO: Safe Torque Off / SH: Safe standstill

See also: p9501, p9601, p9612, p9620, p9761

201659	<location>SI P1 (CU): Write request for parameter rejected
Drive object:	HLA_828
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The write request for one or several Safety Integrated parameters on the Control Unit (CU) was rejected. Note: This fault does not result in a safety stop response. Fault value (r0949, interpret decimal): 1: The Safety Integrated password is not set. 2: A reset of the drive parameters was selected. However, the Safety Integrated parameters were not reset, as Safety Integrated is presently enabled. 3: The interconnected STO input is in the simulation mode. 10: An attempt was made to enable the STO function although this cannot be supported. 13: An attempt was made to enable the SS1 function although this cannot be supported. 14: An attempt was made to enable the PROFIsafe communication - although this cannot be supported or the version of the PROFIsafe driver used on both monitoring channels is different. 15: An attempt was made to enable the motion monitoring functions integrated in the drive although these cannot be supported. 16: An attempt was made to enable the STO function although this cannot be supported when the internal voltage protection (p1231) is enabled. 18: An attempt was made to enable the PROFIsafe function for Basic Functions although this cannot be supported. 23: For ESR, an attempt was made to enable the delay of STO, although this cannot be supported. 25: An attempt was made to parameterize a PROFIsafe telegram although this cannot be supported. 26: With the selected signal source for STO/SS1, an attempt was made to activate the simulation mode. 27: An attempt was made to activate the Basic Functions by controlling via TM54F although this is not supported. 29: An attempt was made to parameterize the fault response for PROFIsafe failure to STOP B although this cannot be supported. See also: p0970, p3900, p9612, r9771, r9871

Remedy:	For fault value = 1: - set the Safety Integrated password (p9761). For fault value = 2: - inhibit Safety Integrated (p9501, p9601) or reset safety parameters (p0970 = 5), then reset the drive parameters again. For fault value = 3: - end the simulation mode for the digital input (p0795). For fault value = 10, 11, 12, 13, 14, 15, 17, 18, 19, 21, 22, 23: - check whether there are faults in the safety function alignment between the two monitoring channels (F01655, F30655) and if required, carry out diagnostics for the faults involved. - use a Hydraulic Module that supports the required function. - upgrade the Hydraulic Module software. - upgrade the Control Unit software. For fault value = 16: - inhibit the internal voltage protection (p1231). For fault value = 25: - correct the telegram number setting (p9611). For fault value = 26: - deactivate the simulation mode for the set signal source for STO/SS1 (p9620) (p0795). For fault value = 29: - check whether p9612 and p9812 are set; if required, correct the settings. - use a Hydraulic Module that supports the required function. - upgrade the Hydraulic Module software. - upgrade the Control Unit software. Note: CU: Control Unit ESR: Extended Stop and Retract SI: Safety Integrated SS1: Safe Stop 1 STO: Safe Torque Off / SH: Safe standstill See also: p9501, p9601, p9612, p9620, p9761
----------------	--

201659 <location>SI P1 (CU): Write request for parameter rejected

Drive object:	TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The write request for one or several Safety Integrated parameters on the Control Unit (CU) was rejected. Note: This fault does not result in a safety stop response. Fault value (r0949, interpret decimal): 1: The Safety Integrated password is not set. 2: A reset of the drive parameters was selected. However, the Safety Integrated parameters were not reset, as Safety Integrated is presently enabled. 27: An attempt was made to activate the Basic Functions by controlling via TM54F although this is not supported. See also: p0970, p3900, p9612, r9771, r9871

Remedy:

- For fault value = 1:
 - set the Safety Integrated password (p10061).
- For fault value = 2:
 - inhibit Safety Integrated (p9501, p9601) or reset safety parameters (p0970 = 5), then reset the drive parameters again.
- For fault value = 27:
 - check whether there are faults in the safety function alignment between the Control Unit and the Motor Module involved (F01655, F30655) and if required, carry out diagnostics for the faults involved.
 - use Motor Modules that supports the required function.
 - upgrade the Motor Module software.
 - upgrade the Control Unit software.

Note:

CU: Control Unit
 MM: Motor Module
 SI: Safety Integrated

See also: p9501, p9601, p9612, p9620, p9761

201660 <location>SI P1 (CU): Safety-related functions not supported

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The Motor Module/Hydraulic Module does not support the safety-related functions (e.g. the Motor Module/Hydraulic Module version is not the correct one). Safety Integrated cannot be commissioned.

Note:

This fault does not result in a safety stop response.

Remedy:

- use a Motor Module/Hydraulic Module that supports the safety-related functions.
- upgrade the Motor Module/Hydraulic Module software.

Note:

CU: Control Unit

SI: Safety Integrated

201663 <location>SI P1 (CU): Copying the SI parameters rejected

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: In p9700, the value 87 or 208 is saved or was entered offline.

This is the reason that when booting, an attempt is made to copy Safety Integrated parameters from monitoring channel 1 to monitoring channel 2. However, no safety-relevant function has been selected in monitoring channel 1 (p9501 = 0, p9601 = 0). Copying was rejected for safety reasons.

As a consequence, inconsistent parameterization can occur in both monitoring channels, which in turn results in additional error messages.

Especially for inconsistent enabling of the safety functions on both monitoring channels (p9601 = 0, p9801 <> 0), fault F30625 is output.

Note:

This fault does not result in a safety stop response.

SI: Safety Integrated

See also: p9700 (SI Motion copy function)

- Remedy:**
- set p9700 to 0.
 - check p9501 and p9601 and if required, correct.
 - restart the copying function by entering the corresponding value into p9700.
- Alternatively, using the STARTER commissioning tool, perform the following steps in the online mode:
- call the "Safety Integrated" screen form (the field "Select safety functions" is at "No Safety Integrated").
 - click on "Change settings".
 - click on "Activate settings" (as a consequence, Safety Integrated is inhibited on both monitoring channels).
 - save all parameters (p0977 = 1 or "copy RAM to ROM").
 - carry out a POWER ON (switch-off/switch-on) for all components.

201664 <location>SI P1 (CU): No automatic firmware update

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: During booting, the system detected that the "Firmware update automatic" function (p7826 = 1) was not activated. This function must be activated for automatic firmware updates/downgrades to prevent impermissible version combinations when safety functions are enabled.

Note:

This fault does not result in a safety stop response.

See also: p7826 (Firmware update automatic)

Remedy: When safety functions are enabled (p9501 $\neq$ 0 and/or p9601 $\neq$ 0):

1. Activate the "Firmware update automatic" function (p7826 = 1).

2. Backup the parameters (p0977 = 1) and carry out a POWER ON.

When deactivating the safety functions (p9501 = 0, p9601 = 0), the fault can be acknowledged after exiting the safety commissioning mode.

201665 <location>SI P1 (CU): System is defective

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: A system defect was detected before the last boot or in the actual one. The system might have been rebooted (reset).

Fault value (r0949, interpret hexadecimal):

200000 hex, 400000 hex, 8000yy hex (yy any):

- fault in the actual booting/operation.

800004 hex:

- parameters p9500/p9300 are, under certain circumstances, not the same. In addition, Safety message C01711/C30711 is displayed.

Additional values:

- defect before the last time that the system booted.

Remedy: - carry out a POWER ON (switch-off/switch-on).

- upgrade firmware to later version.

- contact Technical Support.

For fault value = 200000 hex, 400000 hex, 8000yy hex (yy any):

- ensure that the Control Unit is connected to the Power Module.

For fault value = 800004 hex:

- check that parameters p9500/p9300 are the same.

Note:

PM: Power Module

STO: Safe Torque Off

201669	<location>SI Motion: Unfavorable combination of motor and power unit
Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The combination of motor and power unit used is not suitable for using safe motion monitoring functions without an encoder. The ratio between the power unit rated current (r0207[0]) and rated motor current (p0305) is greater than 5. Alarm value (r2124, interpret decimal): Number of the motor data set, which caused the fault. Notice: If this alarm is not observed, then message C01711 or C30711 – with the value 1041 ... 1044 – can sporadically occur.
Remedy:	Use a suitable power unit with a lower power rating or a motor with a higher power rating.
201670	<location>SI Motion: Invalid parameterization Sensor Module
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The parameterization of a Sensor Module used for Safety Integrated is not permissible. Note: This fault results in a STOP A that cannot be acknowledged. Fault value (r0949, interpret decimal): 1: No encoder was parameterized for Safety Integrated. 2: An encoder was parameterized for Safety Integrated that does not have an A/B track (sine/cosine). 3: The encoder data set selected for Safety Integrated is still not valid. 4: A communication error with the encoder has occurred. 5: Number of relevant bits in the encoder coarse position invalid. 6: DRIVE-CLiQ encoder configuration invalid. 7: Non-safety relevant component of the encoder coarse position for the linear DRIVE-CLiQ encoder not valid. 8: Parameterized Safety comparison algorithm not supported. 9: Relationship between the grid division and measuring step for linear DRIVE-CLiQ encoder is not binary. 10: For an encoder used for Safety Integrated, not all of the Drive Data Sets (DDS) are assigned to the same Encoder Data Set (EDS) (p0187 ... p0189). 11: The zero point setting of a linear DRIVE-CLiQ encoder used in Safety Integrated is not zero. 12: The second encoder is not parameterized (p9526 = 1 is not permissible). 13: Hydraulic Module: A second encoder has not been parameterized and a DRIVE-CLiQ encoder is not being used. 14: SCSE encoder is used in conjunction with an HTL/TTL encoder, another SCSE encoder or in a 1-encoder system.

Remedy:	For fault value = 1, 2: - use and parameterize an encoder that Safety Integrated supports (encoder with track A/B sine-wave, p0404.4 = 1). For fault value = 3: - check whether the drive or drive commissioning function is active and if required, exit this (p0009 = p00010 = 0), save the parameters (p0971 = 1) and carry out a POWER ON For fault value = 4: - check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Sensor Module involved and if required, carry out a diagnostics routine for the faults identified. For fault value = 5: - p9525 = 0 (not permissible). Check the encoder parameterization on the Sensor Modules involved. For fault value = 6: - check p9515.0 (for DRIVE-CLiQ encoders, the following applies: p9515.0 = 1). Check the encoder parameterization on the Sensor Modules involved. For fault value = 7: - p12033 for an encoder used for Safety Integrated is not equal to 1. Use a linear DRIVE-CLiQ encoder and parameterize for p12033 = 1. For fault value = 8: - check p9541. Use and parameterize an encoder that implements an algorithm supported by Safety Integrated. For fault value = 9: - check p9514 and p9522. Use an encoder and parameterize, where the ratio between p9514 and p9522 is binary. For fault value = 10: - align the EDS assignment of all of the encoders used for Safety Integrated (p0187 ... p0189). For fault value = 11: - use and parameterize a linear DRIVE-CLiQ encoder, where the zero point setting is equal to 0. For fault value = 12: - parameterize an encoder for the second channel (p9526 > 1). For fault value = 13: - parameterize a second encoder or use a DRIVE-CLiQ encoder. For fault value = 14: - use a DRIVE-CLiQ encoder for channel 1 in conjunction with an SCSE encoder for channel 2. Note: SCSE: Single Channel Safety Encoder (single-channel encoder) SI: Safety Integrated
----------------	--

201671	<location>SI Motion: Parameterization encoder error
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The parameterization of the encoder used by Safety Integrated is different to the parameterization of the standard encoder. Note: This fault does not result in a safety stop response. Fault value (r0949, interpret decimal): Parameter number of the non-corresponding safety parameter.
Remedy:	Align the encoder parameterization between the safety encoder and the standard encoder. Note: SI: Safety Integrated

201672	<location>SI P1 (CU): Motor Module software/hardware incompatible
---------------	--

Drive object:	HLA_828
Message value:	%1
Reaction:	OFF2

Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The existing Hydraulic Module software does not support safe motion monitoring or is not compatible to the software on the Control Unit or there is a communications error between the Control Unit and Hydraulic Module. Note: This fault results in a STOP A that cannot be acknowledged. Fault value (r0949, interpret decimal): 1: The existing Hydraulic Module software does not support the safe motion monitoring function. 2, 3, 6, 8: There is a communications error between the Control Unit and Hydraulic Module. 4, 5, 7: The existing Hydraulic Module software is not compatible to the software on the Control Unit.
Remedy:	- check whether there are faults in the safety function alignment between the Control Unit and the Hydraulic Module involved (F01655, F30655) and if required, carry out diagnostics for the faults involved. For fault value = 1: - use a Hydraulic Module that supports safe motion monitoring. For fault value = 2, 3, 6, 8: - check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Hydraulic Module involved and, if required, carry out a diagnostics routine for the faults identified. For fault value = 4, 5, 7: - upgrade the Hydraulic Module software. Note: SI: Safety Integrated HM: Hydraulic Module.

201672	<location>SI P1 (CU): Motor Module software/hardware incompatible
Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The existing Motor Module software does not support safe motion monitoring or is not compatible to the software on the Control Unit or there is a communications error between the Control Unit and Motor Module. Note: This fault results in a STOP A that cannot be acknowledged. Fault value (r0949, interpret decimal): 1: The existing Motor Module software does not support the safe motion monitoring function. 2, 3, 6, 8: There is a communications error between the Control Unit and Motor Module. 4, 5, 7: The existing Motor Module software is not compatible to the software on the Control Unit. 9, 10, 11, 12: The existing Motor Module software does not support the safe encoderless motion monitoring function. 13: At least one Motor Module in parallel operation does not support the safe motion monitoring function.

Remedy:

- check whether there are faults in the safety function alignment between the Control Unit and the Motor Module involved (F01655, F30655) and if required, carry out diagnostics for the faults involved.

For fault value = 1:

- use a Motor Module that supports safe motion monitoring.

For fault value = 2, 3, 6, 8:

- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.

For fault value = 4, 5, 7, 9, 13:

- upgrade the Motor Module software.

Note:

SI: Safety Integrated

201673 <location>SI Motion: Sensor Module software/hardware incompatible

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The existing Sensor Module software and/or hardware does not support the safe motion monitoring function with the higher-level control.

Note:

This fault does not result in a safety stop response.

Fault value (r0949, interpret decimal):

Only for internal Siemens troubleshooting.

Remedy:

- upgrade the Sensor Module software.
- use a Sensor Module that supports the safe motion monitoring function.

Note:

SI: Safety Integrated

201674 <location>SI Motion P1 (CU): Safety function not supported by PROFIsafe telegram

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: POWER ON

Cause: The monitoring function enabled in p9501 and p9601 is not supported by the currently set PROFIsafe telegram (p9611).

Note:

This fault results in a STOP A that cannot be acknowledged.

Fault value (r0949, interpret bitwise binary):

Bit 4 = 1:

SS2ESR via PROFIsafe is not supported (p9501.4).

Bit 18 = 1:

SS2E via PROFIsafe is not supported (p9501.18).

Bit 24 = 1:

Transfer SLS (SG) limit value via PROFIsafe not supported (p9501.24).

Bit 25 = 1:

Transfer safe position (SP) via PROFIsafe is not supported (p9501.25).

Bit 26 = 1:

Gearbox stage switchover via PROFIsafe is not supported (p9501.26).

Bit 28 = 1:

SCA via PROFIsafe is not supported (p9501.28).

Remedy:

- Deselect the monitoring function involved (p9501, p9601).
- set the matching PROFIsafe telegram (p9611).

Note:

SCA: Safe Cam
 SI: Safety Integrated
 SLS: Safely-Limited Speed / SG: Safely reduced speed
 SP: Safe Position
 SS2E: Safe Stop 2 External (Safe Stop 2 with external stop, external STOP D)
 SS2ESR: Safe Stop 2 Extended Stop and Retract

201675 <location>SI Motion P1: settings in the PROFIBUS/PROFINET controller not permissible

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: For the "Safe synchronous position via PROFIsafe" function, an incorrect configuration setting was identified.

Note:

This fault results in a STOP A that can be acknowledged in the following way.

- select STO and then deselect again.
- internal event acknowledge (if the "Extended message acknowledgment" is active, p9507.0 = 1).

Fault value (r0949, interpret decimal):

1:

"Synchronous safe position via PROFIsafe" is enabled (p9501.29 = 1) and is not set according to the rule $Tdp = 2 \times n \times p9500$ ($n = 1, 2, 3, \dots$).

2:

"Synchronous safe position via PROFIsafe" is enabled (p9501.29 = 1) and isochronous operation is not set.

Note:

STO: Safe Torque Off

Remedy:

For fault value = 1:

- set bus cycle time Tdp and monitoring clock cycle p9500 according to the rule $Tdp = 2 \times n \times p9500$ ($n = 1, 2, 3, \dots$).

For fault value = 2:

- set "Isochronous mode" on the PROFIBUS/PROFINET controller.

201679 <location>SI CU: Safety parameter settings and topology changed, warm restart/POWER ON required

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2 (OFF1, OFF3)

Acknowledge: POWER ON

Cause: Safety parameters have been changed; these will only take effect following a warm restart or POWER ON (see alarm A01693).

A partial power up (boot) with modified configuration was then performed.

Remedy:

- carry out a warm restart (p0009 = 30, p0976 = 2, 3).
- carry out a POWER ON (switch-off/switch-on) for all components.

201680 <location>SI Motion P1 (CU): Checksum error safety monitoring functions

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause:	The actual checksum calculated by the drive and entered in r9728 via the safety-relevant parameters does not match the reference checksum saved in p9729 at the last machine acceptance. Safety-relevant parameters have been changed or a fault is present. Note: This fault results in a STOP A that can be acknowledged. Fault value (r0949, interpret decimal): 0: Checksum error for SI parameters for motion monitoring. 1: Checksum error for SI parameters for actual values. 2: Checksum error for SI parameters for component assignment.
Remedy:	- check the safety-relevant parameters and if required, correct. - execute the function "Copy RAM to ROM". - perform a POWER ON if safety parameters requiring a POWER ON have been modified. - carry out an acceptance test.

201681 **<location>SI Motion P1 (CU): Incorrect parameter value**

Drive object:	HLA_828
Message value:	Parameter: %1, supplementary information: %2
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)

Cause: The parameter cannot be parameterized with this value.

Note:

This message does not result in a safety stop response.

Fault value (r0949, interpret decimal):

yyyyxxxx dec: yyyy = supplementary information, xxxx = parameter

yyyy = 0:

No additional information available.

xxxx = 9500 and yyyy = 1:

Parameter p9500 is not equal to p9300 or not an integer multiple of the sampling time of the current controller (p0115[0]).

xxxx = 9500 and yyyy = 16:

"Synchronous safe position via PROFIsafe" is enabled on several axes (p9501.29 = 1), and the monitoring clock cycle p9500 is set differently for these axes.

It is possible that the maximum permissible number of axes for the "Synchronous safe position via PROFIsafe" has been exceeded.

xxxx = 9501:

It is not permissible to enable the function "n < nx hysteresis and filtering" (p9501.16) in conjunction with the function "Extended functions without selection" (p9601.5).

xxxx = 9501 and yyyy = 8:

Referencing via SCC (p9501.27 = 1) is enabled without enabling absolute motion monitoring functions (p9501.1 or p9501.2).

xxxx = 9501 and yyyy = 10:

Referencing via SCC (p9501.27 = 1) and EPOS (r0108.4 = 1) are simultaneously enabled.

xxxx = 9501 and yyyy = 11:

Safe function SS2E (p9501.18 = 1) is enabled without enabling PROFIsafe.

xxxx = 9501 and yyyy = 12:

SCA (p9501.28 = 1) is enabled without enabling PROFIsafe.

xxxx = 9501 and yyyy = 14:

"Synchronous safe position via PROFIsafe" is enabled (p9501.29 = 1), without enabling "Safe position via PROFIsafe" (p9501.25).

xxxx = 9501 and yyyy = 17:

"Synchronous safe position via PROFIsafe" is enabled (p9501.29 = 1) and "Safety without encoder" is enabled (p9506).

xxxx = 9501 and yyyy = 19:

SLA (p9501.20 = 1) is enabled with encoderless actual value sensing (p9506 equal to 1 or 3).

xxxx = 9501 and yyyy = 20:

SLA (p9501.20 = 1) is enabled with a 2-encoder system (p9526 not equal to 1).

xxxx = 9511 and yyyy = 1:

Parameter p9511 is not equal to p9311.

xxxx = 9511 and yyyy = 2:

Between the drive objects no different values in p9511 and p0115[0] are permitted.

xxxx = 9522:

The gear stage was set too high.

xxxx = 9534 or 9535:

The limit values of SLP have been set too high (absolute values).

xxxx = 9544:

For linear axes, the maximum value is limited to 1 mm.

xxxx = 9547:

Parameter p9547 has been set too low.

xxxx = 9573:

"Referencing via Safety Control Channel" was requested (p9573 = 263), without enabling the function "Referencing via SCC" (p9501.27 = 0).

xxxx = 9578:

SLA is enabled (p9501.20 = 1). Acceleration limit is too low (p9578). The acceleration resolution is no longer sufficient (r9790).

The minimum limit is x-times the acceleration resolution:

- firmware version 5.1: $3 * r9790[0]$

- firmware version 5.2 and higher: $10 * r9790[1]$

xxxx = 9601 and yyyy = 1:

If motion monitoring functions integrated in the drive (p9601.2 = 1) and extended functions without selection (p9601.5 = 1) are activated, then PROFIsafe (p9601.3 = 1) is not possible.

xxxx = 9601 and yyyy = 2:

Extended functions without selection (p9601.5 = 1) are enabled without enabling motion monitoring functions integrated in the drive (p9601.2).

xxxx = 9601 and yyyy = 5:

Transfer of the SLS limit value via PROFIsafe (p9501.24) has been enabled, without enabling PROFIsafe.

xxxx = 9601 and yyyy = 6:

Transfer of the safe position via PROFIsafe (p9501.25) has been enabled, without enabling PROFIsafe.

xxxx = 9601 and yyyy = 7:

Safe switchover of the gearbox stages (p9501.26) has been enabled without enabling PROFIsafe.

xxxx = 9601 and yyyy = 18:

SLA (p9501.20 = 1) is enabled without enabling PROFIsafe.

xxxx = 9601 and yyyy = 21:

SS2ESR (p9501.4 = 1) is enabled without enabling PROFIsafe.

Remedy: Correct parameter (if required, also on another monitoring channel, p9801).

If xxxx = 9500 and yyyy = 1:

- set p9500 "SI Motion monitoring clock cycle" as an integer multiple of p0115[0] "Current controller sampling time".
- align parameters 9300 and 9500, backup parameters (p0971 = 1) and carry out a POWER ON.

For xxxx = 9500 and yyyy = 16:

Inhibit "Synchronous safe position via PROFIsafe" function (p9501.29 = 0), or set monitoring clock cycle p9500 on all axes the same when the function is enabled.

If xxxx = 9501:

- correct parameters p9501.16 and p9301.16, or deselect the extended functions without selection (p9601.5).

If xxxx = 9501 and yyyy = 8:

Inhibit referencing via SCC (p9501.27) or enable an absolute motion monitoring function (p9501.1 or p9501.2).

If xxxx = 9501 and yyyy = 10:

Inhibit referencing via SCC (p9501.27) or EPOS (r0108.4).

For xxxx = 9501 and yyyy = 11:

Inhibit SS2E (p9501.18) - or enable PROFIsafe.

For xxxx = 9501 and yyyy = 12:

Inhibit SCA (p9501.28) - or enable PROFIsafe.

For xxxx = 9501 and yyyy = 14:

Inhibit "Synchronous safe position via PROFIsafe" function (p9501.29 = 0), or enable "Safe position via PROFIsafe" (p9501.25).

For xxxx = 9501 and yyyy = 17:

Inhibit "Synchronous safe position via PROFIsafe" function (p9501.29 = 0), or set "Safety with encoder" (p9506).

For xxxx = 9501 and yyyy = 19:

Inhibit SLA (p9501.20) or activate actual value sensing with encoder (p9506 equal to 0 or 2).

For xxxx = 9501 and yyyy = 20:

Inhibit SLA (p9501.20) or activate a 1-encoder system (p9526 equal to 5).

For xxxx = 9511:

Align parameters p9311 and p9511, back up the parameters (p0971 = 1) and carry out a POWER ON.

For xxxx = 9517:

Parameter p9516.0 should also be checked.

For xxxx = 9522:

Correct the corresponding parameter.

For xxxx = 9534 or 9535:

Reduce the limit values (absolute values) of SLP.

For xxxx = 9544:

Correct parameter (for linear axes, the maximum value is limited to 1 mm).

For xxxx = 9547:

With hysteresis/filtering enabled (p9501.16 = 1), the following applies:

- set parameters p9546/p9346 and p9547/p9347 according to the following rule: $p9546 \geq 2 \times p9547$; $p9346 \geq 2 \times p9347$
- if the actual value synchronization is enabled (p9501.3 = 1), then this rule must be complied with: $p9549 \leq p9547$; $p9349 \leq p9347$

For xxxx = 9578:

- observe the information in r9790.

If xxxx = 9601:

yyyy = 1:

Only enable motion monitoring functions integrated in the drive (p9601.2 = 1) and extended functions without selection (p9601.5 = 1) – or only PROFIsafe (p9601.3 = 1).

yyyy = 2:

Enable motion monitoring functions integrated in the drive (p9601.2 = 1).

yyyy = 5:

To transfer the SLS limit values via PROFIsafe (p9501.24 = 1), also enable PROFIsafe (p9601.3 = 1) and motion monitoring functions integrated in the drive (p9601.2 = 1).

yyyy = 6:

For the safe position via PROFIsafe (p9501.25 = 1), also enable PROFIsafe (p9601.3 = 1) and the motion monitoring functions integrated in the drive (p9601.2 = 1).

yyyy = 7:

For safe switchover of gearbox stages (p9501.26 = 1) also enable PROFIsafe (p9601.3 = 1) and the motion monitoring functions integrated in the drive (p9601.2 = 1).

yyyy = 18:

For Safely-Limited Acceleration (p9501.20 = 1), also enable PROFIsafe (p9601.3 = 1) and the motion monitoring functions integrated in the drive (p9601.2 = 1).

yyyy = 21:

For Safe Stop 2 Extended Stop and Retract (p9501.4), also enable PROFIsafe (p9601.3 = 1) and motion monitoring functions integrated in the drive (p9601.2 = 1).

201681 <location>SI Motion P1 (CU): Incorrect parameter value

Drive object: SERVO_828, SERVO_COMBI

Message value: Parameter: %1, supplementary information: %2

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause:	The parameter cannot be parameterized with this value. Note: This message does not result in a safety stop response. Fault value (r0949, interpret decimal): yyyyxxxx dec: yyyy = supplementary information, xxxx = parameter yyyy = 0: No additional information available. xxxx = 9500 and yyyy = 1: Parameter p9500 is not equal to p9300 or not an integer multiple of the sampling time of the current controller (p0115[0]). xxxx = 9500 and yyyy = 16: "Synchronous safe position via PROFIsafe" is enabled on several axes (p9501.29 = 1), and the monitoring clock cycle p9500 is set differently for these axes. It is possible that the maximum permissible number of axes for the "Synchronous safe position via PROFIsafe" has been exceeded. xxxx = 9501: It is not permissible to enable the function "n < nx hysteresis and filtering" (p9501.16) in conjunction with the function "Extended functions without selection" (p9601.5). xxxx = 9501 and yyyy = 8: Referencing via SCC (p9501.27 = 1) is enabled without enabling an absolute motion monitoring function (p9501.1 or p9501.2). xxxx = 9501 and yyyy = 10: Referencing via SCC (p9501.27 = 1) and EPOS (r0108.4 = 1) are simultaneously enabled. xxxx = 9501 and yyyy = 14: "Synchronous safe position via PROFIsafe" is enabled (p9501.29 = 1), without enabling "Safe position via PROFIsafe" (p9501.25). xxxx = 9501 and yyyy = 17: "Synchronous safe position via PROFIsafe" is enabled (p9501.29 = 1) and "Safety without encoder" is enabled (p9506). xxxx = 9501 and yyyy = 19: SLA (p9501.20 = 1) is enabled with encoderless actual value sensing (p9506 equal to 1 or 3). xxxx = 9501 and yyyy = 20: SLA (p9501.20 = 1) is enabled with a 2-encoder system (p9526 not equal to 1). xxxx = 9505: When SLP is active (p9501.1 = 1), the modulo function is activated and this is not permitted (p9505 not equal to 0). xxxx = 9506 and yyyy = 1: Parameter p9506 is not equal to p9306. xxxx = 9511 and yyyy = 1: Parameter p9511 is not equal to p9311. xxxx = 9511 and yyyy = 2: On a Double Motor Module, between the drive objects, no different values in p9511 and p0115[0] is permitted. xxxx = 9319: The fine resolution of the encoder for the second channel is too high. xxxx = 9522: The gear stage was set too high. xxxx = 9534 or 9535: The limit values of SLP have been set too high (absolute values). xxxx = 9544: For linear axes, the maximum value is limited to 1 mm. xxxx = 9547: The hysteresis tolerance is not permissible. xxxx = 9573: "Referencing via Safety Control Channel" was requested (p9573 = 263), without enabling the function "Referencing via SCC" (p9501.27 = 0). xxxx = 9576:
---------------	---

The filtering for SLA has been enabled - however, the Motor Module used does not support this function.

xxxx = 9578:

SLA is enabled (p9501.20 = 1). Acceleration limit is too low (p9578). The acceleration resolution is no longer sufficient (r9790).

The minimum limit is x-times the acceleration resolution:

- firmware version 5.1: $3 * r9790[0]$

- firmware version 5.2 and higher: $10 * r9790[1]$

xxxx = 9585:

For Safety without encoder and synchronous motor, p9585 must be set to 4.

xxxx = 9601 and yyyy = 1:

If motion monitoring functions integrated in the drive (p9601.2 = 1) and extended functions without selection (p9601.5 = 1) are enabled, then PROFIsafe (p9601.3 = 1) or onboard F-DI (p9601.4 = 1) is not possible.

xxxx = 9601 and yyyy = 2:

Extended functions without selection (p9601.5 = 1) are enabled without enabling motion monitoring functions integrated in the drive (p9601.2).

xxxx = 9601 and yyyy = 3:

Onboard F-DI are enabled without enabling motion monitoring functions integrated in the drive (p9601.2).

xxxx = 9601 and yyyy = 4:

Onboard F-DI are enabled. Then, it is not permissible to simultaneously set PROFIsafe and F-DI via PROFIsafe (p9501.30).

xxxx = 9601 and yyyy = 5:

Transfer of the SLS limit value via PROFIsafe (p9501.24) has been enabled, without enabling PROFIsafe.

xxxx = 9601 and yyyy = 6:

Transfer of the safe position via PROFIsafe (p9501.25) has been enabled, without enabling PROFIsafe.

xxxx = 9601 and yyyy = 7:

Safe switchover of the gearbox stages (p9501.26) has been enabled without enabling PROFIsafe.

xxxx = 9601 and yyyy = 11:

SS2E (p9501.18 = 1) is enabled without PROFIsafe being enabled.

xxxx = 9601 and yyyy = 12:

SCA (p9501.28 = 1) is enabled without enabling PROFIsafe.

xxxx = 9601 and yyyy = 18:

SLA (p9501.20 = 1) is enabled without enabling PROFIsafe.

xxxx = 9601 and yyyy = 21:

SS2ESR (p9501.4 = 1) is enabled without enabling PROFIsafe.

Remedy: Correct parameter (if required, also on another monitoring channel, p9801).

If xxxx = 9500 and yyyy = 1:

- set p9500 "SI Motion monitoring clock cycle" as an integer multiple of p0115[0] "Current controller sampling time".
- align parameters 9300 and 9500, backup parameters (p0971 = 1) and carry out a POWER ON.

For xxxx = 9500 and yyyy = 16:

Inhibit "Synchronous safe position via PROFIsafe" function (p9501.29 = 0), or set monitoring clock cycle p9500 on all axes the same when the function is enabled.

If xxxx = 9501:

- correct parameters p9501.16 and p9301.16, or deselect the extended functions without selection (p9601.5).

If xxxx = 9501 and yyyy = 8:

Inhibit referencing via SCC (p9501.27) or enable an absolute motion monitoring function (p9501.1 or p9501.2).

If xxxx = 9501 and yyyy = 10:

Inhibit referencing via SCC (p9501.27) or EPOS (r0108.4).

For xxxx = 9501 and yyyy = 11:

Inhibit SS2E (p9501.18) - or enable PROFIsafe.

For xxxx = 9501 and yyyy = 12:

Inhibit SCA (p9501.28) - or enable PROFIsafe.

For xxxx = 9501 and yyyy = 14:

Inhibit "Synchronous safe position via PROFIsafe" function (p9501.29 = 0), or enable "Safe position via PROFIsafe" (p9501.25).

For xxxx = 9501 and yyyy = 17:

Inhibit "Synchronous safe position via PROFIsafe" function (p9501.29 = 0), or set "Safety with encoder" (p9506).

For xxxx = 9501 and yyyy = 19:

Inhibit SLA (p9501.20) or activate actual value sensing with encoder (p9506 equal to 0 or 2).

For xxxx = 9501 and yyyy = 20:

Inhibit SLA (p9501.20) or activate a 1-encoder system (p9526 equal to 1).

For xxxx = 9505:

Correct parameter p9501.1 or p9505.

For xxxx = 9507:

Set synchronous or induction motor according to p0300.

For xxxx = 9506:

Align parameters p9306 and p9506, back up the parameters (p0971 = 1) and carry out a POWER ON.

For xxxx = 9511:

Align parameters p9311 and p9511, back up the parameters (p0971 = 1) and carry out a POWER ON.

For xxxx = 9517:

Parameter p9516.0 should also be checked.

For xxxx = 9319:

For the SCSE encoder, parameter p9319 must not be set higher than 11.

For xxxx = 9522:

Correct the corresponding parameter.

For xxxx = 9534 or 9535:

Reduce the limit values (absolute values) of SLP.

For xxxx = 9544:

Correct parameter (for linear axes, the maximum value is limited to 1 mm).

For xxxx = 9547:

With hysteresis/filtering enabled (p9501.16 = 1), the following applies:

- set parameters p9546 and p9547 according to the following rule: $p9547 \leq 0.75 \times p9546$
- if the actual value synchronization is enabled (p9501.3 = 1), then this rule must be complied with: $p9547 \geq p9549$

For xxxx = 9576:

- update the firmware on the Motor Module.
- deselect function with value 0.

For xxxx = 9578:

- observe the information in r9790.

For xxxx = 9585:

Correct parameter (if required, also on the second monitoring channel, p9385).

If xxxx = 9601:

yyyy = 1:

Only enable motion monitoring functions integrated in the drive (p9601.2 = 1) and extended functions without selection (p9601.5 = 1), or only enable PROFIsafe (p9601.3 = 1) or only onboard F-DI (p9601.4 = 1).

yyyy = 2, 3:

Enable motion monitoring functions integrated in the drive (p9601.2 = 1).

yyyy = 4:

If onboard F-DI are enabled, then it is not permissible to simultaneously set PROFIsafe and F-DI via PROFIsafe (p9501.30), deselect PROFIsafe functionality or onboard F-DI.

yyyy = 5:

To transfer the SLS limit values via PROFIsafe (p9501.24 = 1), also enable PROFIsafe (p9601.3 = 1) and motion monitoring functions integrated in the drive (p9601.2 = 1).

yyyy = 6:

For the safe position via PROFIsafe (p9501.25 = 1), also enable PROFIsafe (p9601.3 = 1) and the motion monitoring functions integrated in the drive (p9601.2 = 1).

yyyy = 7:

For safe switchover of gearbox stages (p9501.26 = 1) also enable PROFIsafe (p9601.3 = 1) and the motion monitoring functions integrated in the drive (p9601.2 = 1).

yyyy = 18:

For Safely-Limited Acceleration (p9501.20 = 1), also enable PROFIsafe (p9601.3 = 1) and the motion monitoring functions integrated in the drive (p9601.2 = 1).

yyyy = 21:

For Safe Stop 2 Extended Stop and Retract (p9501.4), also enable PROFIsafe (p9601.3 = 1) and motion monitoring functions integrated in the drive (p9601.2 = 1).

Note:

SCA: Safe Cam

SCSE: Single Channel Safety Encoder (single-channel encoder)

SS2E: Safe Stop 2 External (Safe Stop 2 with external stop, external STOP D)

SS2ESR: Safe Stop 2 Extended Stop and Retract

SLA: Safely-Limited Acceleration

201682 <location>SI Motion P1 (CU): Monitoring function not supported

Drive object: HLA_828

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause:	The monitoring function enabled in p9501, p9601 or p9801 is not supported in this firmware version. Note: This fault results in a STOP A that cannot be acknowledged. Fault value (r0949, interpret decimal): 2: Monitoring function SCA not supported (p9501.7 and p9501.8 ... 15 and p9503). 3: Monitoring function SLS override not supported (p9501.5). 6: Enable actual value synchronization not supported (p9501.3). 9: Monitoring function not supported by the firmware or enable bit not used. 13: SINUMERIK Safety Integrated with SPL on a Hydraulic Module is not supported. 14: Monitoring function SLA and ncSI not supported. 20: Motion monitoring functions integrated in the drive are only supported in conjunction with PROFIsafe (p9501, p9601.1 ... 2 and p9801.1 ... 2). 21: Enable a safe motion monitoring function (in p9501), not supported for enabled basic functions via PROFIsafe (p9601.2 = 0, p9601.3 = 1). 45: Deactivating SOS/SLS during an external STOP A is not supported (p9501.23). 46: This firmware version does not support control of the basis functions via TM54F and the simultaneous enable of the extended functions or ncSI. 50: Switchover times for SOS (p9569/p9369, p9567/p9367) are not supported. 53: SS2E function not supported (p9501.18). 54: SCA function not supported (p9501.28). 57: "Synchronous transfer safe position" function not supported (p9501.29). 58: "Safety limited acceleration" function (SLA) not supported (p9501.20). 9612: The setting p9612/p9812 = 1 is not supported for control via TM54F. See also: p9612 (SI PROFIsafe failure response (Control Unit))
Remedy:	- deselect the monitoring function involved (p9501, p9601, p9801). For fault value = 9612: - set parameter p9612/p9812 = 0. Note: ESR: Extended Stop and Retract SCA: Safe Cam / SN: Safe software cam SI: Safety Integrated SLS: Safely-Limited Speed / SG: Safely reduced speed SOS: Safe Operating Stop / SBH: Safe operating stop SPL: Safe programmable logic SS2E: Safety Stop 2 external (external STOP D) See also: p9501, p9503, p9601, p9612, r9771

201682	<location>SI Motion P1 (CU): Monitoring function not supported
Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)

- Cause:** The monitoring function enabled in p9501, p9601, p9801, p9307 or p9507 is not supported in this firmware version.
- Note:**
This fault results in a STOP A that cannot be acknowledged.
Fault value (r0949, interpret decimal):
- 1: Monitoring function SLP not supported (p9501.1).
 - 2: Monitoring function SCA not supported (p9501.7 and p9501.8 ... 15 and p9503).
 - 3: Monitoring function SLS override not supported (p9501.5).
 - 4: Monitoring function external ESR activation not supported (p9501.4).
 - 5: Monitoring function F-DI in PROFIsafe not supported (p9501.30).
 - 6: Enable actual value synchronization not supported (p9501.3).
 - 9: Monitoring function not supported by the firmware or enable bit not used.
 - 10: Monitoring functions only supported for a SERVO drive object.
 - 11: Encoderless monitoring functions (p9506.1) only supported for motion monitoring integrated in the drive (p9601.2).
 - 12: Monitoring functions for ncSI are not supported for CU305.
 - 14: Monitoring function SLA and ncSI not supported.
 - 20: Motion monitoring functions integrated in the drive are only supported in conjunction with PROFIsafe (p9501, p9601.1 ... 2 and p9801.1 ... 2).
 - 21: Enable a safe motion monitoring function (in p9501), not supported for enabled basic functions via PROFIsafe (p9601.2 = 0, p9601.3 = 1).
 - 22: Encoderless monitoring functions in "chassis" format not supported.
 - 23: CU240 does not support monitoring functions requiring an encoder.
 - 24: Monitoring function SDI not supported (p9501.17).
 - 25: Drive-integrated motion monitoring functions not supported (p9501, p9601.2).
 - 26: Hysteresis and filtering for SSM monitoring function without an encoder not supported (p9501.16).
 - 27: This hardware does not support onboard F-DI and F-DO.
 - 28: Encoderless monitoring functions are not supported for synchronous motors (p9507.2).
 - 29: SINAMICS S120M: Safety Extended Functions without encoder not supported.
 - 31: This hardware does not support transfer SLS (SG) limit value via PROFIsafe (p9301/p9501.24).
 - 33: Safety functions without selection not supported (p9601.5, p9801.5).
 - 34: This module does not support safe position via PROFIsafe.
 - 36: Function "SS1E" not supported.
 - 37: Safe actual value sensing with HTL/TTL encoder (SMC30) not supported.
 - 38: It is not permissible to simultaneously enable the safety functions (p9601) and the essential service mode (ESM, Essential Service Mode, p3880).
 - 39: This module or software version of the CU/MM does not support safe gearbox stage switchover (p9501.26).
 - 40: SIMOTION D410-2: Motion monitoring functions integrated in the drive or PROFIsafe control not supported.
 - 41: SIMOTION D410-2: Safety functions not supported for the "Chassis" format.
 - 42: Motion monitoring functions SLP and SP not supported for D4x5-2 and CX32-2 (p9501.1/25).
 - 43: Motion monitoring functions SLP and SP as well as PROFIsafe telegrams 31/901/902 not supported for D410-2 (p9501.1/24/25/30, p9611).
 - 44: This module/this software version does not support referencing via the Safety Control Channel (p9501.27).
 - 45: Deactivating SOS/SLS during an external STOP A is not supported (p9501.23).
 - 46: This firmware version does not support control of the basis functions via TM54F and the simultaneous enable of the extended functions or ncSI or PROFIsafe.
 - 50: Shortening the switchover times for SOS (p9569/p9369, p9567/p9367) is not supported.
 - 51: Safe actual value sensing with SCSE is not supported for dbSi (motion monitoring functions integrated in the drive, p9601.2 = 1).
 - 52: "SBR with encoder" function is not supported (p9506 = 2).
 - 53: SS2E function not supported (p9501.18).
 - 54: SCA function not supported (p9501.28).
 - 57: "Synchronous transfer safe position via PROFIsafe" function not supported (p9501.29).
 - 58: "Safety limited acceleration" function (SLA) not supported (p9501.20).
 - 59: Safe actual value sensing with SIL3 encoder not supported.

9586: The set value of p9586/p9386 is greater than the supported maximum value.
 9588: The set value of p9588/p9388 is greater than the supported maximum value.
 9589: The set value of p9589/p9389 is greater than the supported maximum value.
 9612: An attempt was made to parameterize STOP B as stop response for PROFI-safe failure, although PROFI-safe is not enabled.

See also: p9612 (SI PROFI-safe failure response (Control Unit))

Remedy:

- deselect the monitoring function involved (p9501, p9503, p9506, p9601, p9801, p9307, p9507).
- reduce the set value (p9586, p9588, p9589).
- increase the set value (p9578).

For fault value = 59:

- upgrade the firmware of the Motor Module to a later version.

For fault value = 9612:

- establish communications with PROFI-safe (p9601).
- parameterize STOP A as the stop response for PROFI-safe failure (p9612 = 0).

Note:

ESR: Extended Stop and Retract

SBR: Safe Brake Ramp (safe brake ramp monitoring)

SCA: Safe Cam / SN: Safe software cam

SCSE: Single Channel Safety Encoder (single-channel encoder)

SDI: Safe Direction (safe motion direction)

SLA: Safely-Limited Acceleration

SI: Safety Integrated

SLP: Safely-Limited Position / SE: Safe software limit switches

SLS: Safely-Limited Speed / SG: Safely reduced speed

SOS: Safe Operating Stop / SBH: Safe operating stop

SP: Safe Position

SPL: Safe programmable logic

SS1E: Safe Stop 1 External (Safe Stop 1 with external stop)

SS2E: Safe Stop 2 External (Safe Stop 2 with external stop, external STOP D)

See also: p9501, p9503, p9601, p9612, r9771

201683 <location>SI Motion P1 (CU): SOS/SLS enable missing

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The safety-relevant basic function "SOS/SLS" is not enabled in p9501 although other safety-relevant monitoring functions are enabled.

Note:

This fault does not result in a safety stop response.

Remedy: Enable the function "SOS/SLS" (p9501.0) and carry out a POWER ON.

Note:

SI: Safety Integrated

SLS: Safely-Limited Speed / SG: Safely reduced speed

SOS: Safe Operating Stop / SBH: Safe operating stop

See also: p9501 (SI Motion enable safety functions (Control Unit))

201684 <location>SI Motion P1 (CU): Safely-Limited Position limit values interchanged

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: For the function "Safely-Limited Position" (SLP), a lower value is in p9534 than in p9535.

Note:

This fault does not result in a safety stop response.

Fault value (r0949, interpret decimal):

1: Limit values SLP1 interchanged.

2: Limit values SLP2 interchanged.

See also: p9534, p9535

Remedy: - correct the lower and upper limit values (p9535, p9534).

- carry out a POWER ON (switch-off/switch-on).

Note:

SI: Safety Integrated

SLP: Safely-Limited Position / SE: Safe software limit switches

201685 <location>SI Motion P1 (CU): Safely-Limited Speed limit value too high

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The limit value for the function "Safely-Limited Speed" (SLS) is greater than the speed that corresponds to an encoder limit frequency of 500 kHz.

Note:

This fault does not result in a safety stop response.

Fault value (r0949, interpret decimal):

Maximum permissible speed.

Remedy: Correct the limit values for SLS and carry out a POWER ON.

Note:

SI: Safety Integrated

SLS: Safely-Limited Speed / SG: Safely reduced speed

See also: p9531

201686 <location>SI Motion: Illegal parameterization cam position

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause:	For dbSI: - at least one enabled "Safe cam" (SCA) is parameterized in p9536 or p9537 too close to the tolerance range around the modulo position: the minus position value of a cam must be greater than the lower modulo limit + cam tolerance (p9540) + position tolerance (p9542); the plus position value of a cam must be less than the modulo limit - cam tolerance (p9540) - position tolerance (p9542). For a parameterized modulo position (p9505>0), the lower modulo limit = 0, the upper modulo limit = p9505. - the cam length of cam x = p9536[x]-p9537[x] is less than the cam tolerance + the position tolerance (= p9540 + p9542). This also means that cams of the minus position value must be less than the plus position value. For ncSI: At least one enabled "Safety Cam" (SCA) is parameterized in p9536 or p9537 too close to the tolerance range around the modulo position. The following conditions must be complied with to assign cams to a cam track: - the cam length of cam x = p9536[x]-p9537[x] must be greater or equal to the cam tolerance + the position tolerance (= p9540 + p9542). This also means that for cams on a cam track, the minus position value must be less than the plus position value. - the distance between 2 cams x and y (minus position value[y] - plus position value[x] = p9537[y] - p9536[x]) on a cam track must be greater than or equal to the cam tolerance + position tolerance (= p9540 + p9542). Note: This fault does not result in a safety stop response. Fault value (r0949, interpret decimal): Number of the "Safe Cam" with an illegal position. See also: p9501 (SI Motion enable safety functions (Control Unit))
	Remedy: Correct the cam position and carry out a POWER ON. Note: SCA: Safe Cam / SN: Safe software cam SI: Safety Integrated See also: p9536, p9537

201687	<location>SI Motion: Illegal parameterization modulo value SCA (SN)
Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The parameterized modulo value for the "Safe Cam" (SCA) function is not a multiple of 360 000 mDegrees. Note: This fault does not result in a safety stop response.
Remedy:	Correct the modulo value for SCA and carry out a POWER ON. Note: SCA: Safe Cam / SN: Safe software cam SI: Safety Integrated See also: p9505

201688	<location>SI Motion CU: Actual value synchronization not permissible
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)

Cause:	- it is not permissible to enable actual value synchronization for a 1-encoder system. - it is not permissible to simultaneously enable actual value synchronization and a monitoring function with absolute reference (SCA/SLP). - it is not permissible to simultaneously enable actual value synchronization and safe position via PROFIsafe. Note: This fault results in a STOP A that cannot be acknowledged.
Remedy:	- Either select the "actual value synchronization" function or parameterize a 2-encoder system. - either deselect the function "actual value synchronization" or the monitoring functions with absolute reference (SCA/SLP) and carry out a POWER ON. - either deselect the "actual value synchronization" function or do not enable "Safe position via PROFIsafe". Note: SCA: Safe Cam / SN: Safe software cam SI: Safety Integrated SLP: Safely-Limited Position / SE: Safe software limit switches SP: Safe Position See also: p9501, p9526

201689	<location>SI Motion: Axis re-configured
Drive object:	SERVO_828, SERVO_COMBI
Message value:	Parameter: %1
Reaction:	OFF2
Acknowledge:	POWER ON
Cause:	The axis configuration was changed and internally set to the correct value (e.g. switchover, linear axis/rotary axis). Parameter p0108.13 is internally set to the correct value. Note: This fault does not result in a safety stop response. Fault value (r0949, interpret decimal): Number of the parameter that initiated the change. See also: p9502 (SI Motion axis type (Control Unit))
Remedy:	The following should be carried out after the changeover: - exit the safety commissioning mode (p0010). - save all parameters (p0977 = 1 or "copy RAM to ROM"). - carry out a POWER ON. Once the Control Unit has been switched on, safety message F01680 or F30680 indicates that the checksums in r9398[0] and r9728[0] have changed in the drive. The following must, therefore, be carried out: - activate safety commissioning mode again. - complete safety commissioning of the drive. - exit the safety commissioning mode (p0010). - save all parameters (p0977 = 1 or "copy RAM to ROM"). - carry out a POWER ON. Note: For the commissioning tool, the units are only consistently displayed after a project upload.

201690	<location>SI Motion: Data save problem for the NVRAM
Drive object:	All objects
Message value:	%1
Reaction:	Infeed: NONE (OFF1, OFF2) Servo: NONE (OFF1, OFF2, OFF3) Hla: NONE (OFF1, OFF2, OFF3)
Acknowledge:	POWER ON

Cause: There is not sufficient memory space in the NVRAM on the drive to save parameters r9781 and r9782 (safety logbook).
Note:

This fault does not result in a safety stop response.

Fault value (r0949, interpret decimal):

0: There is no physical NVRAM available in the drive.

1: There is no longer any free memory space in the NVRAM.

Remedy: For fault value = 0:

- use a Control Unit NVRAM.

For fault value = 1:

- deselect functions that are not required and that take up memory space in the NVRAM.

- contact Technical Support.

Note:

NVRAM: Non-Volatile Random Access Memory (non-volatile read and write memory)

201691 <location>SI Motion: Ti and To unsuitable for DP cycle

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The configured times for PROFIBUS communication are not permitted and the DP cycle is used as the actual value acquisition cycle for the safe movement monitoring functions.

Isochronous PROFIBUS:

The sum of Ti and To is too high for the selected DP cycle. The DP cycle should be at least 1 current controller cycle greater than the sum of Ti and To.

No isochronous PROFIBUS:

The DP clock cycle must be at least 4x the current controller clock cycle.

Notice:

If this alarm is not observed, then message C01711 or C30711 – with the value 1020 ... 1021 – can sporadically occur.

Remedy: Configure Ti and To low so that they are suitable for the DP cycle or increase the DP cycle time.

Alternative when SI monitoring integrated in the drive is enabled (p9601/p9801 > 0):

Use the actual value acquisition cycle p9511/p9311 and, in turn, set independently from DP cycle. The actual values sensing clock cycle must be at least 4x the current controller clock cycle. A clock cycle ratio of at least 8:1 is recommended.

See also: p9511 (SI Motion actual value sensing cycle clock (Control Unit))

201692 <location>SI Motion P1 (CU): Parameter value not permitted for encoderless

Drive object: SERVO_828, SERVO_COMBI

Message value: Parameter: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The parameter cannot be set to this value if encoderless motion monitoring functions have been selected in p9506.

Note:

This fault does not result in a safety stop response.

Fault value (r0949, interpret decimal):

Parameter number with the incorrect value.

See also: p9501 (SI Motion enable safety functions (Control Unit))

Remedy: - correct the parameter specified in the fault value.

- if necessary, deselect encoderless motion monitoring functions (p9506).

See also: p9501 (SI Motion enable safety functions (Control Unit))

201693 <location>SI P1 (CU): Safety parameter setting changed, warm restart/POWER ON required

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL

Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: Safety parameters have been changed; these will only take effect following a warm restart or POWER ON.
Alarm value (r2124, interpret decimal):
Parameter number of the safety parameter which has changed, necessitating a warm restart or POWER ON.
Remedy:
- carry out a warm restart (p0009 = 30, p0976 = 2, 3).
- carry out a POWER ON (switch-off/switch-on) for all components.
Note:
Before performing an acceptance test, a POWER ON must be carried out for all components.

201694 **<location>SI Motion CU: Firmware version Motor Module/Hydraulic Module older Control Unit**

Drive object: HLA_828, SERVO_828, SERVO_COMBI
Message value: -
Reaction: OFF2
Acknowledge: IMMEDIATELY (POWER ON)
Cause: The firmware version of the Motor Module/Hydraulic Module is older than the version of the Control Unit.
It is possible that safety functions are not available (r9771/r9871).
Note:
This message does not result in a safety stop response.
This message can also occur, if after an automatic firmware update, a POWER ON was not carried out (Alarm A01007).
Remedy: Upgrade the firmware of the Motor Module/Hydraulic Module to a later version.
See also: r9390 (SI Motion version safety motion monitoring (Motor Module)), r9590 (SI Motion version safety motion monitoring (Control Unit))

201695 **<location>SI Motion: Sensor Module was replaced**

Drive object: HLA_828, SERVO_828, SERVO_COMBI
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: A Sensor Module, which is used for safe motion monitoring functions, was replaced. The hardware replacement must be acknowledged. An acceptance test must be subsequently performed.
Note:
This message does not result in a safety stop response.
Remedy: Carry out the following steps using the STARTER commissioning tool:
- press the "Acknowledge hardware replacement" button in the safety screen form.
- execute the function "Copy RAM to ROM".
- carry out a POWER ON (switch-off/switch-on) for all components.
As an alternative, carry out the following steps in the expert list of the commissioning tool:
- start the copy function for the node identifier on the drive (p9700 = 1D hex).
- acknowledge the hardware CRC on the drive (p9701 = EC hex).
- save all parameters (p0977 = 1).
- carry out a POWER ON (switch-off/switch-on) for all components.
Then carry out an acceptance test (refer to the Safety Integrated Function Manual).
For SINUMERIK, the following applies:
HMI supports the replacement of components with Safety functions (operating area "Diagnostics" --> Softkey "Alarm list" --> Softkey "Confirm SI HW" etc.).
The precise procedure is given in the following document:
SINUMERIK Function Manual Safety Integrated
See also: p9700 (SI Motion copy function), p9701 (Acknowledge SI motion data change)

201696	<location>SI Motion: Test stop for the motion monitoring functions selected when booting
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The forced checking procedure (test stop) for the safe motion monitoring functions is already selected when booting, which is not permissible. This is the reason that the test is only carried out again after first selecting the forced checking procedure. Note: This message does not result in a safety stop response. See also: p9705 (SI Motion test stop signal source)
Remedy:	Deselect the forced checking procedure for the safe motion monitoring functions and then select again. Notice: It is not permissible to use TM54F inputs to select the test stop. Note: The signal source to select the forced checking procedure is set via binector input p9705. SI: Safety Integrated
201697	<location>SI Motion: Test stop for motion monitoring functions required
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The time set in p9559 for the forced checking procedure (test stop) for the safe motion monitoring functions has been exceeded. A new forced checking procedure is required. After the next time the forced checking procedure is selected, the message is withdrawn and the monitoring time is reset. Note: - this message does not result in a safety stop response. - As the switch-off signal paths are not automatically checked during booting, an alarm is always issued once booting is complete. - the test must be performed within a defined, maximum time interval (p9559, maximum of 9000 hours) in order to comply with the requirements as laid down in the standards for timely fault detection and the conditions to calculate the failure rates of safety functions (PFH value). Operation beyond this maximum time period is permissible if it can be ensured that the forced checking procedure is performed before persons enter the hazardous area and who are depending on the safety functions correctly functioning. See also: p9559 (SI Motion forced checking procedure timer (Control Unit)), r9765 (SI Motion forced check procedure remaining time (Control Unit))
Remedy:	Carry out the forced checking procedure of the safety motion monitoring functions. The signal source to select the forced checking procedure is set via binector input p9705. Notice: It is not permissible to use TM54F inputs to select the forced checking procedure. Note: SI: Safety Integrated See also: p9705 (SI Motion test stop signal source)
201698	<location>SI P1 (CU): Commissioning mode active
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA
Message value:	-
Reaction:	NONE
Acknowledge:	NONE

Cause: The commissioning of the "Safety Integrated" function is selected.
This message is withdrawn after the safety functions have been commissioned.

Note:

- this message does not result in a safety stop response.
- in the safety commissioning mode, the "STO" function is internally selected.

See also: p0010

Remedy: Not necessary.

Note:

CU: Control Unit

SI: Safety Integrated

201699 <location>SI P1 (CU): Test stop for STO required

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The time set in p9659 for the forced checking procedure (test stop) for the "STO" function has been exceeded. A new forced checking procedure is required.

After the next time the "STO" function is deselected, the message is withdrawn and the monitoring time is reset.

Note:

- this message does not result in a safety stop response.
- the test must be performed within a defined, maximum time interval (p9659) in order to comply with the requirements as laid down in the standards for timely fault detection and the conditions to calculate the failure rates of safety functions (PFH value). Operation beyond this maximum time period is permissible if it can be ensured that the forced checking procedure is performed before persons enter the hazardous area and who are depending on the safety functions correctly functioning.

See also: p9659 (SI forced checking procedure timer), r9660 (SI forced checking procedure remaining time)

Remedy: Select STO and then deselect again.

Note:

CU: Control Unit

SI: Safety Integrated

STO: Safe Torque Off / SH: Safe standstill

201700 <location>SI Motion P1 (CU): STOP A initiated

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The drive is stopped via a STOP A (STO via the safety switch-off signal path of the Control Unit).

Possible causes:

- stop request from the second monitoring channel.
- STO not active after parameterized time (p9557) after test stop selection.
- subsequent response to the message C01706 "SI Motion CU: SAM/SBR limit exceeded".
- subsequent response to the message C01714 "SI Motion CU: Safely-Limited Speed exceeded".
- subsequent response to the message C01701 "SI Motion CU: STOP B initiated".
- subsequent response to the message C01715 "SI Motion CU: Safely-Limited Position exceeded".
- subsequent response to the message C01716 "SI Motion CU: tolerance for safe motion direction exceeded".

Remedy:	- remove the cause of the fault on the second monitoring channel. - carry out a diagnostics routine for message C01706. - carry out a diagnostics routine for message C01714. - carry out a diagnostics routine for message C01701. - carry out a diagnostics routine for message C01715. - carry out a diagnostics routine for message C01716. - check the value in p9557 (where available), increase the value if necessary, and carry out a POWER ON - check the switch-off signal path of the Control Unit (check DRIVE-CLiQ communication if it has been implemented) - replace the Motor Module, Power Module or Hydraulic Module. - replace Control Unit. This message can be acknowledged without a POWER ON as follows (safe acknowledgment): - Terminal Module 54F (TM54F). - onboard F-DI (only CU310-2). - PROFIsafe. - machine control panel. Note: SAM: Safe Acceleration Monitor (safe acceleration monitoring) SBR: Safe Brake Ramp (safe brake ramp monitoring) SI: Safety Integrated
----------------	---

201701	<location>SI Motion P1 (CU): STOP B initiated
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE (OFF3)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The drive is stopped via a STOP B (braking along the OFF3 deceleration ramp). As a result of this fault, after the time parameterized in p9556 has expired, or the speed threshold parameterized in p9560 has been undershot, message C01700 "STOP A initiated" is output. Possible causes: - stop request from the second monitoring channel. - subsequent response to the message C01714 "SI Motion CU: Safely-Limited Speed exceeded". - subsequent response to the message C01711 "SI Motion CU: Defect in a monitoring channel". - subsequent response to the message C01707 "SI Motion CU: tolerance for safe operating stop exceeded". - subsequent response to the message C01715 "SI Motion CU: Safely-Limited Position exceeded". - subsequent response to the message C01716 "SI Motion CU: tolerance for safe motion direction exceeded".
Remedy:	- remove the cause of the fault on the second monitoring channel. - carry out a diagnostics routine for message C01714. - carry out a diagnostics routine for message C01711. - carry out a diagnostics routine for message C01707. - carry out a diagnostics routine for message C01715. - carry out a diagnostics routine for message C01716. This message can be acknowledged without a POWER ON as follows (safe acknowledgment): - Terminal Module 54F (TM54F). - onboard F-DI (only CU310-2). - PROFIsafe. - machine control panel. Note: SI: Safety Integrated

201706	<location>SI Motion P1 (CU): SAM/SBR limit exceeded
Drive object:	HLA_828

Message value:	-
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	Motion monitoring functions with encoder (p9506 = 0): - after initiating STOP B (SS1) or STOP C (SS2), the speed has exceeded the selected tolerance. The drive is shut down by the message C01700 "SI Motion: STOP A initiated".
Remedy:	Check the braking behavior and, if necessary, adapt the parameterization of the parameter settings of the "SAM" or the "SBR" function. This message can be acknowledged without a POWER ON as follows (safe acknowledgment): - Terminal Module 54F (TM54F). - onboard F-DI (only CU310-2). - PROFIsafe. - machine control panel. Note: SAM: Safe Acceleration Monitor (safe acceleration monitoring) SBR: Safe Brake Ramp (safe ramp monitoring) SI: Safety Integrated See also: p9548, p9581, p9582, p9583

201706 <location>SI Motion P1 (CU): SAM/SBR limit exceeded

Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	Motion monitoring functions with encoder (p9506 = 0) or encoderless with set acceleration monitoring (SAM, p9506 = 3): - after initiating STOP B (SS1) or STOP C (SS2), the speed has exceeded the selected tolerance. Motion monitoring functions encoderless with set brake ramp monitoring (SBR p9506 = 1): - after initiating STOP B (SS1) or SLS changeover to the lower speed level, the speed has exceeded the selected tolerance. The drive is shut down by the message C01700 "SI Motion: STOP A initiated".
Remedy:	Check the braking behavior and, if necessary, adapt the parameterization of the parameter settings of the "SAM" or the "SBR" function. This message can be acknowledged without a POWER ON as follows (safe acknowledgment): - Terminal Module 54F (TM54F). - onboard F-DI (only CU310-2). - PROFIsafe. - machine control panel. Note: SAM: Safe Acceleration Monitor (safe acceleration monitoring) SBR: Safe Brake Ramp (safe ramp monitoring) SI: Safety Integrated See also: p9548, p9581, p9582, p9583

201707 <location>SI Motion P1 (CU): Tolerance for safe operating stop exceeded

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The actual position has distanced itself further from the target position than the standstill tolerance. The drive is shut down by the message C01701 "SI Motion: STOP B initiated".

Remedy:

- check whether safety faults are present and if required carry out the appropriate diagnostic routines for the particular faults.
- check whether the standstill tolerance matches the accuracy and control dynamic performance of the axis.
- carry out a POWER ON.

This message can be acknowledged without a POWER ON as follows (safe acknowledgment):

- Terminal Module 54F (TM54F).
- onboard F-DI (only CU310-2).
- PROFIsafe.
- machine control panel.

Note:

SI: Safety Integrated

SOS: Safe Operating Stop / SBH: Safe operating stop

See also: p9530

201708 <location>SI Motion P1 (CU): STOP C initiated

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: STOP2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The drive is stopped via a STOP C (braking along the OFF3 deceleration ramp).
"Safe Operating Stop" (SOS) is activated after the parameterized time has expired.
Possible causes:

- stop request from the higher-level control.
 - subsequent response to the message C01714 "SI Motion CU: Safely-Limited Speed exceeded".
 - subsequent response to the message C01715 "SI Motion CU: Safely-Limited Position exceeded".
 - subsequent response to the message C01716 "SI Motion CU: tolerance for safe motion direction exceeded".
- See also: p9552 (SI Motion transition time STOP C to SOS (SBH) (Control Unit))

Remedy:

- remove the cause of the fault at the control.
- carry out a diagnostics routine for message C01714/C01715/C01716.

This message can be acknowledged without a POWER ON as follows (safe acknowledgment):

- Terminal Module 54F (TM54F).
- onboard F-DI (only CU310-2).
- PROFIsafe.
- machine control panel.

Note:

SI: Safety Integrated

SOS: Safe Operating Stop / SBH: Safe operating stop

201709 <location>SI Motion P1 (CU): STOP D initiated

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The drive is stopped via a STOP D (braking along the path).
"Safe Operating Stop" (SOS) is activated after the parameterized time has expired.
Possible causes:

- stop request from the higher-level control.
- subsequent response to the message C01714 "SI Motion CU: Safely-Limited Speed exceeded".
- subsequent response to the message C01715 "SI Motion CU: Safely-Limited Position exceeded".
- subsequent response to the message C01716 "SI Motion CU: tolerance for safe motion direction exceeded".

See also: p9553 (SI Motion transition time STOP D to SOS (SBH) (Control Unit))

Remedy:

- remove the cause of the fault at the control.
- carry out a diagnostics routine for message C01714/C01715/C01716.

This message can be acknowledged without a POWER ON as follows (safe acknowledgment):

- Terminal Module 54F (TM54F).
- onboard F-DI (only CU310-2).
- PROFIsafe.
- machine control panel.

Note:

SI: Safety Integrated
SOS: Safe Operating Stop / SBH: Safe operating stop

201710 <location>SI Motion P1 (CU): STOP E initiated

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The drive is stopped via a STOP E (retraction motion).
"Safe Operating Stop" (SOS) is activated after the parameterized time has expired.
Possible causes:

- stop request from the higher-level control.
- subsequent response to the message C01714 "SI Motion CU: Safely-Limited Speed exceeded".
- subsequent response to the message C01715 "SI Motion CU: Safely-Limited Position exceeded".
- subsequent response to the message C01716 "SI Motion CU: tolerance for safe motion direction exceeded".

See also: p9554 (SI Motion transition time STOP E to SOS (SBH) (Control Unit))

Remedy:

- remove the cause of the fault at the control.
- carry out a diagnostics routine for message C01714/C01715/C01716.

This message can be acknowledged without a POWER ON as follows (safe acknowledgment):

- Terminal Module 54F (TM54F).
- onboard F-DI (only CU310-2).
- PROFIsafe.
- machine control panel.

Note:

SI: Safety Integrated
SOS: Safe Operating Stop / SBH: Safe operating stop

201711 <location>SI Motion P1 (CU): Defect in a monitoring channel

Drive object: HLA_828

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

- Cause:**
- When cross-comparing the two monitoring channels, the drive detected a difference between the input data or results of the monitoring functions and initiated a STOP F. One of the monitoring functions no longer reliably functions - i.e. safe operation is no longer possible.
- If at least one monitoring function is active, then after the parameterized timer has expired, the message C01701 "SI Motion: STOP B initiated" is output.
- The message value that resulted in a STOP F is displayed in r9725.
- If the drive is operated together with a SINUMERIK, the message values are described in message 27001 of SINUMERIK, with the exception of the following message values, which can only occur in SINAMICS:
- 1007: communication error with the PLC (sign-of-life)
 - 1008: communication error with the PLC (CRC)
- The following described message values involve the data cross-check between the two monitoring channels (safety functions integrated in the drive).
- The message values may also occur in the following cases if the cause that is explicitly mentioned does not apply:
- cycle times not uniformly parameterized (p9500/p9300 and p9511/p9311)
 - excessively fast cycle times (p9500/p9300, p9511/p9311).
 - For message values 3, 44 ... 57, 232 and 1-encoder system, differently set encoder parameters.
 - For message values 3, 44 ... 57, 232 and 2-encoder system, encoder parameters that have not been correctly set.
 - incorrect synchronization.
- Message value (r9749, interpret decimal):
- 0 to 999: Number of the cross-compared data that resulted in this fault.
- Message values that are not subsequently listed are only for internal Siemens troubleshooting.
- 0: Stop request from another monitoring channel.
- 1: Status image of monitoring functions SOS, SLS, SAM/SBR, SDI or SLP (result list 1) (r9710[0], r9710[1]).
- 2: Status image of monitoring function SCA or n < nx (result list 2) (r9711[0], r9711[1]).
- 3: The position actual value differential (r9713[0/1]) between the two monitoring channels is greater than the tolerance in p9542/p9342. When actual value synchronization is enabled (p9501.3/p9301.3), the velocity differential (based on the position actual value) is greater than the tolerance in p9549/p9349.
- 4: Error when synchronizing the data cross-check between the two channels.
- 5: Enable safe functions (p9501/p9301). Safety monitoring clock cycle too small (p9500/p9300).
- 6: Limit value for SLS1 (p9531[0]/p9331[0])
- 7: Limit value for SLS2 (p9531[1]/p9331[1])
- 8: Limit value for SLS3 (p9531[2]/p9331[2])
- 9: Limit value for SLS4 (p9531[3]/p9331[3])
- 10: Standstill tol. (p9530/p9330)
- 11: Upper limit value for SLP1 (p9534[0]/p9334[0]).
- 12: Lower limit value for SLP1 (p9535[0]/p9335[0]).
- 13: Upper limit value for SLP2 (p9534[1]/p9334[1]).
- 14: Lower limit value for SLP2 (p9535[1]/p9335[1]).
- 31: Position tolerance (p9542/p9342) or (p9549/p9349) when actual value synchronization is enabled (p9501.3/p9301.3)
- 32: Position tolerance for safe referencing (p9544/p9344).
- 33: Time, velocity changeover (p9551/p9351)
- 35: Delay time, STOP A (p9556/p9356)
- 36: Checking time, STO (p9557/p9357)
- 37: Trans. time, STOP C to SOS (p9552/p9352)
- 38: Trans. time STOP D to SOS (p9553/p9353)
- 39: Trans. time, STOP E to SOS (p9554/p9354)
- 40: Stop response for SLS (p9561/p9361).
- 41: Stop response for SLP1 (p9562[0]/p9362[0]).
- 42: Shutdown speed, STO (p9560/p9360)
- 43: Memory test stop response (STOP A).
- 44 ... 57: General
- Possible cause 1 (during commissioning or parameter modification)
- The tolerance value for the monitoring function is not the same on the two monitoring channels.

Possible cause 2 (during active operation)

The limit values are based on the actual value (r9713[0/1]). If the safe actual values on the two monitoring channels do not match, the limit values, which have been set at a defined interval, will also be different (i.e. corresponding to message value 3). This can be ascertained by checking the safe actual positions.

Permissible deviation between the two monitoring channels: p9542/p9342.

44: Position actual value (r9713[0/1]) + limit value SLS1 (p9531[0]/p9331[0]) * safety monitoring clock cycle (p9500/p9300).

45: Position actual value (r9713[0/1]) - limit value SLS1 (p9531[0]/p9331[0]) * safety monitoring clock cycle (p9500/p9300).

46: Position actual value (r9713[0/1]) + limit value SLS2 (p9531[1]/p9331[1]) * safety monitoring clock cycle (p9500/p9300).

47: Position actual value (r9713[0/1]) - limit value SLS2 (p9531[1]/p9331[1]) * safety monitoring clock cycle (p9500/p9300).

48: Position actual value (r9713[0/1]) + limit value SLS3 (p9531[2]/p9331[2]) * safety monitoring clock cycle (p9500/p9300).

49: Position actual value (r9713[0/1]) - limit value SLS3 (p9531[2]/p9331[2]) * safety monitoring clock cycle (p9500/p9300).

50: Position actual value (r9713[0/1]) + limit value SLS4 (p9531[3]/p9331[3]) * safety monitoring clock cycle (p9500/p9300).

51: Position actual value (r9713[0/1]) - limit value SLS4 (p9531[3]/p9331[3]) * safety monitoring clock cycle (p9500/p9300).

52: Standstill position + tolerance (p9530/p9330)

53: Standstill position - tolerance (p9530/p9330)

54: Position actual value (r9713[0/1]) + limit value nx (p9546/p9346) * safety monitoring clock cycle (p9500/p9300) + tolerance (p9542/p9342).

55: Position actual value (r9713[0/1]) + limit value nx (p9546/p9346) * safety monitoring clock cycle (p9500/p9300).

56: Position actual value (r9713[0/1]) - limit value nx (p9546/p9346) * safety monitoring clock cycle (p9500/p9300).

57: Position actual value (r9713[0/1]) - limit value nx (p9546/p9346) * safety monitoring clock cycle (p9500/p9300) - tolerance (p9542/p9342).

58: Actual stop request.

75: Velocity limit nx (p9546, p9346).

When the function "n < nx: hysteresis and filtering" (p9501.16 = 1) is enabled, this message value is also output for a different hysteresis tolerance (p9547/p9347).

76: Stop response for SLS1 (p9563[0]/p9363[0]).

77: Stop response for SLS2 (p9563[1]/p9363[1]).

78: Stop response for SLS3 (p9563[2]/p9363[2]).

79: Stop response for SLS4 (p9563[3]/p9363[3]).

81: Velocity tolerance for SAM (p9548/p9348)

82: SGEs for SLS correction factor.

83: Acceptance test timer (p9558/p9358)

84: Trans. time STOP F (p9555/p9355)

85: Trans. time bus failure (p9580/p9380)

86: ID 1-encoder system (p9526/p9326).

87: Encoder assignment, second channel (p9526/p9326)

89: Encoder limit freq.

230: Filter time constant for n < nx.

231: Hysteresis tolerance for n < nx.

232: Smoothed velocity actual value.

233: Limit value nx / safety monitoring clock cycle + hysteresis tolerance.

234: Limit value nx / Safety monitoring clock cycle.

235: -Limit value nx / Safety monitoring clock cycle.

236: -Limit value nx / safety monitoring clock cycle - hysteresis tolerance.

237: SGA n < nx.

238: Speed limit value for SAM (p9568/p9368).

243: Function configuration (p9507/p9307).

- 246: Voltage tolerance acceleration (p9589/p9389).
- 247: SDI tolerance (p9564/p9364).
- 248: SDI positive upper limit (7FFFFFFF hex).
- 249: Position actual value (r9713[0/1]) - SDI tolerance (p9564/p9364).
- 250: Position actual value (r9713[0/1]) + SDI tolerance (p9564/p9364).
- 251: SDI negative lower limit (80000001 hex).
- 252: SDI stop response (p9566/p9366).
- 253: SDI delay time (p9565/p9365).
- 256: Status image of monitoring functions SOS, SLS, SLP, test stop, SBR, SDI (result list 1 ext) (r9710).
- 257: Safety functions for motion monitoring functions without selection (p9512/p9312) different.
- 259: Scaling factor for safe position via PROFIsafe (p9574/p9374) or PROFIsafe telegram (p9611/p9811) different.
- 260: Modulo value including scaling (p9505/p9305 and p9574/p9374) for SP with 16 bit.
- 263: Stop response for SLP2 (p9562[1]/p9362[1])
- 264: Position tolerance including scaling (p9542/p9342 and p9574/p9374) for SP with 16 bit.
- 265: Status image of all change functions (results list 1) (r9710).
- 266: The switchover speed to SOS differs (p9567/p9367).
- 267: The transition time to SOS after standstill differs (p9569/p9369).
- 268: SLP delay time differs (p9577/p9377).
- 269: Factor to increase the position tolerance when switching over the gearbox stage (p9543/p9343).
- 270: Screen form for SGE image: all functions, which are not supported/enabled for the actual parameterization (p9501/p9301, p9601/p9801 and p9506/p9306)..
- 271: Screen form for SGE image: Deselect all bits for the "Safe gearbox switchover" function.
- 272: Activation of the increased position tolerance for the "Safe gearbox switchover" function different.
- 273: speed limit value for flattening the ramp for SAM/SBR different.
- 274: SGA SCA, cams 1 to 15.
- 275: SGA SCA, cams 16 to 30.
- 276: Limit value for SLA1 (p9578/p9378).
- 277: Stop response for SLA1 (p9579/p9379).
- 278: Upper limit value for SLA1.
- 279: Lower limit value for SLA1.
- 280: Upper limit value for SLA1 (fine resolution).
- 281: Lower limit value for SLA1 (fine resolution).
- 282: SLA filter time.
- 283: Acceleration actual value (fine resolution).
- 1000: Watchdog timer has expired. Too many signal changes have occurred at safety-relevant inputs.
- 1001: Initialization error of watchdog timer.
- 1002:
- User agreement after the timer has expired different.
- The user agreement is not consistent. After a time of 4 s has expired, the status of the user agreement is different in both monitoring channels.
- 1003:
- Reference tolerance exceeded.
- When the user agreement is set, the difference between the new reference point that has been determined after the system boots (absolute encoder) or reference point approach (distance-coded or incremental measuring system) and the safe actual position (saved value + traversing distance) is greater than the reference tolerance (p9544). In this case, the user agreement is withdrawn.
- 1004:
- Plausibility error for user agreement.
1. If the user agreement has already been set, then the setting is initiated again. In this case, the user agreement is withdrawn.
 2. The user agreement was set, although the axis has still not been referenced.
- 1005: STO already active for test stop selection.
- 1011: Acceptance test status between the monitoring channels differ.

1012: Plausibility violation of the encoder actual value.
1014: fault when synchronizing the SGA for the "Safe cam" function
1015: Gearbox switchover (bit 27 in PROFIsafe telegram) takes longer than 2 min.
1020: Cyc. communication failure between the monit. channels.
1021: Cyc. communication failure between the monit. channel and Sensor Module.
1022: Sign-of-life error for DRIVE-CLiQ encoders monitoring channel 1.
1023: Error in the effectiveness test in the DRIVE-CLiQ encoder
1024: Sign-of-life error for HTL/TTL encoders.
1032: Sign-of-life error for DRIVE-CLiQ encoders monitoring channel 2.
1033: Error checking offset between POS1 and POS2 for DRIVE-CLiQ encoder monitoring channel 1.
1034: Error checking offset between POS1 and POS2 for DRIVE-CLiQ encoder monitoring channel 2.
1039: Overflow when calculating the position.
1041: Current absolute value too low (encoderless)
1042: Current/voltage plausibility error
1043: Too many acceleration phases
1044: Current actual values plausibility error.
5000 ... 5140:
PROFIsafe message values.
For these message values, the failsafe control signals (Failsafe Values) are transferred to the safety functions.
5000, 5014, 5023, 5024, 5030 ... 5032, 5042, 5043, 5052, 5053, 5068, 5072, 5073, 5082 ... 5087, 5090, 5091, 5122 ...
5125, 5132 ... 5135, 5140: an internal software error has occurred (only for internal Siemens fault diagnostics).
5012: Error when initializing the PROFIsafe driver.
5013: The result of the initialization is different for the two controllers.
5022: Error when evaluating the F parameters. The values of the transferred F parameters do not match the expected values in the PROFIsafe driver.
5025: The result of the F parameterization is different for the two controllers.
5026: CRC error for the F parameters. The transferred CRC value of the F parameters does not match the value calculated in the PST.
5065: A communications error was identified when receiving the PROFIsafe telegram.
5066: A time monitoring error (timeout) was identified when receiving the PROFIsafe telegram.
6000 ... 6166:
PROFIsafe message values (PROFIsafe driver for PROFIBUS DP V1/V2 and PROFINET).
For these message values, the failsafe control signals (Failsafe Values) are transferred to the safety functions. If "Stop B after failure of the PROFIsafe communication" (9612) is parameterized, the transfer of the Failsafe Values is delayed.
The significance of the individual message values is described in safety fault F01611.
7000: Difference of the safe position is greater than the parameterized tolerance (p9542/p9342).
7001: Scaling value for the safe position in the 16 bit notation, too low (p9574/p9374).
7002: Cycle counter for transferring the safe position is different in both monitoring channels.
7003: error when providing the data for the "Synchronous safe position via PROFIsafe" function.
7004: PROFIsafe clock cycle not correctly synchronized to the DP clock cycle.
See also: p9555 (SI Motion transition time STOP F to STOP B (Control Unit)), r9725 (SI Motion diagnostics STOP F)

Remedy:

The following generally applies:

The monitoring clock cycles in both channels and the axis types should be checked for equality and the same setting applied if necessary. If the error continues to be identified, increasing the monitoring clock cycles may resolve it.

For message value = 0:

- no error was identified in this monitoring channel. Note the error message of the other monitoring channel (for HM: C30711).

For message value = 3:

Commissioning phase:

- check the encoder parameters, and if required, correct (p9516/p9316, p9517/p9317, p9518/p9318, p9520/p9320, p9521/p9321, p9522/p9322, p9526/p9326).

In operation:

- check the mechanical design and the encoder signals.

For message value = 4:

The monitoring clock cycles in both channels should be checked for equality and if required, set the same. In combination with message value 5 from the other monitoring channel (with HM: C30711), the monitoring clock cycle settings must be increased.

For message value = 11 ... 14:

- the limit values in p9534/p9334 or p9535/p9335 are not equal or have been set too high. Correct the values.

For message value = 232:

- increase the hysteresis tolerance (p9547/p9347). Possibly set the filtering higher (p9545/p9345).

For message value = 274, 275:

- increase the cam tolerance p9540/p9340 and/or the position tolerance p9542/p9342.

For message value = 278, 279, 280, 281:

- check as to whether the same acceleration limit has been set for both channels. A different result depends on whether SLA is enabled and not selected - or enabled and selected. In this case, another message value is possible.

For message value = 1 ... 999:

- if the message value is listed under cause: Check the cross-checked parameters to which the message value refers.

- copy the safety parameters.

- carry out a POWER ON (switch-off/switch-on) for all components.

- upgrade the Hydraulic Module software.

- upgrade the Control Unit software.

- correction of the encoder evaluation. The actual values differ as a result of mechanical faults (V belts, travel to a mechanical endstop, wear and window setting that is too narrow, encoder fault, ...).

Note:

For SINAMICS firmware version ≥ 4.7 , the KDV list is increased when setting p9567 > 0 . For a non-compatible version of SINUMERIK this can lead to an error for the data cross-check (is indicated with message value ≥ 237). If necessary, p9567 must be set = 0, or the firmware version of SINUMERIK upgraded.

For message value = 1000:

- investigate the signal associated with the safety-relevant input (contact problems).

For message value = 1001:

- carry out a POWER ON (switch-off/switch-on) for all components.

- upgrade the Hydraulic Module software.

- upgrade the Control Unit software.

For message value = 1002:

- perform safe acknowledgment, set the user agreement in both monitoring channels simultaneously (within 4 s).

For message value = 1003:

- check the mechanical system of the axis. It is possible that the axis was shifted when switched-off, and the last saved actual position no longer corresponds with the new actual position after the system has been powered up again.

- increase the tolerance for the actual value comparison when referencing (p9544).

Then check the actual values, perform a POWER ON and set the user agreement again.

For message value = 1004:

For 1., the following applies: Perform safe acknowledgment. Set the user agreement again.

For 2., the following applies: Perform safe acknowledgment. Only set the user agreement again if the axis has been referenced.

For message value = 1005: deselect checking the conditions for STO.

For message value = 1007:

- check the PLC for the correct operating state (run state, basic program).

For message value = 1008:

- check whether incorrect or overlapping address ranges have been set in SINUMERIK machine data MD10393.

For message value = 1011:

- for diagnostics, refer to parameter (r9571).

For message value = 1012:

- upgrade the Sensor Module firmware to a more recent version.
- for 1-encoder systems, the following applies: check the encoder parameters for equality (p9515/p9315, p9519/p9319, p9523/p9323, p9524/p9324, p9525/p9325, p9529/p9329).
- for a 1-encoder system and 2-encoder system the following applies: in order to correctly copy the encoder parameters from p04xx, p9700 must be set to 46 and p9701 must be set to 172.
- for DQI encoders the following applies: If required, upgrade the firmware version of the Control Unit to a more recent version, which is released for DQI encoders.
- the parameterized encoder does not correspond to the connected encoder - replace the encoder.
- check the electrical cabinet design and cable routing for EMC compliance
- carry out a POWER ON (switch-off/switch-on) for all components or a warm restart (p0009 = 30, p0976 = 2, 3).
- replace the hardware.

For message value = 1014:

- check the encoder actual values. If required, increase the position tolerance (p9542) and/or cam tolerance (p9540).

For message value = 1020, 1021, 1024:

- check the communication link.
- if required, increase the monitoring cycle clock settings (p9500, p9511).
- carry out a POWER ON (switch-off/switch-on) for all components or a warm restart (p0009 = 30, p0976 = 2, 3).
- replace the hardware.

For message value = 1033:

- if required, upgrade the firmware version of the Control Unit to a more recent version, which is released for DQI encoders.

For message value = 1039:

- check the conversion factors such as spindle pitch or gearbox ratios.

For message value = 1041:

- check whether the motor has sufficient current (>r9785[0]).
- reduce the minimum current (p9588).
- for synchronous motors increase the absolute value of p9783.
- check whether the function "Closed-loop controlled operation with HF signal injection" is activated (p1750.5 = 1) and if required, deactivate.

For message value = 1042:

- increase the ramp-function generator ramp-up/down time (p1120/p1121).
- check that the current/speed control is set correctly (torque-generating/field-generating current and actual speed value may not fluctuate).
- reduce the dynamic response of the setpoint value.
- check the absolute current and voltage values, and set the control behavior so that this is greater than 3% of the rated converter data in operation or in the case of a fault.
- increase the minimum current (p9588).

For message value = 1043:

- increase the voltage tolerance (p9589). When operating a reluctance motor, the controller settings are generally set to be more dynamic. If this message is output for the factory setting of p9589, then the acceleration limit should be increased as countermeasure (p9589 = 500 ... 1000 %). From experience, this provides a rugged response.
- increase the ramp-function generator ramp-up/down time (p1120/p1121).
- check that the current/speed control is set correctly (torque-generating/field-generating current and actual speed value may not fluctuate).
- reduce the dynamic response of the setpoint value.

For message value = 5000, 5014, 5023, 5024, 5030, 5031, 5032, 5042, 5043, 5052, 5053, 5068, 5072, 5073, 5082 ... 5087, 5090, 5091, 5122 ... 5125, 5132 ... 5135, 5140:

- carry out a POWER ON (switch-off/switch-on) for all components.
- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Hydraulic Module involved and, if required, carry out a diagnostics routine for the faults identified.
- upgrade firmware to later version.
- contact Technical Support.
- replace the Control Unit.

For message value = 5012:

- check the setting of the PROFIsafe address of the Control Unit (p9610) and that of the hydraulic module (p9810). It is not permissible for the PROFIsafe address to be 0 or FFFF!

For message value = 5013, 5025:

- carry out a POWER ON (switch-off/switch-on) for all components.
- check the setting of the PROFIsafe address of the Control Unit (p9610) and that of the hydraulic module (p9810).
- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Hydraulic Module involved and, if required, carry out a diagnostics routine for the faults identified.

For message value = 5022:

- check the setting of the values of the F parameters at the PROFIsafe slave (F_SIL, F_CRC_Length, F_Par_Version, F_Source_Add, F_Dest_add, F_WD_Time).

For message value = 5026:

- check the settings of the values of the F parameters and the F parameter CRC (CRC1) calculated from these at the PROFIsafe slave and update.

For message value = 5065:

- check the configuration and communication at the PROFIsafe slave (cons. No. / CRC).
- check the setting of the value for F parameter F_WD_Time on the PROFIsafe slave and increase if necessary.
- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Hydraulic Module involved and, if required, carry out a diagnostics routine for the faults identified.

For message value = 5066:

- check the setting of the value for F parameter F_WD_Time on the PROFIsafe slave and increase if necessary.
- evaluate diagnostic information in the F host.
- check PROFIsafe connection.

For message value = 6000 ... 6999:

Refer to the description of the message values in safety fault F01611.

For message value = 7000:

- increase the position tolerance (p9542/p9342).
- determine the actual position of CU (r9713[0] and the second channel r9713[1], and check the difference for plausibility.
- reduce the difference of the actual position from CU (r9713[0] and the second channel r9713[1] for a 2-encoder system.

For message value = 7001:

- increase the scaling value for the safe position in the 16 bit notation (p9574/p9374).
- if required, reduce the traversing range.

For message value = 7002:

- carry out a POWER ON (switch-off/switch-on) for all components.
- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Hydraulic Module involved and, if required, carry out a diagnostics routine for the faults identified.

This message can be acknowledged as follows:

- motion monitoring functions integrated in the drive: Via Terminal Module 54F (TM54F) or PROFIsafe
- motion monitoring functions with SINUMERIK: Via the machine control panel

For message value = 7003, 7004:

- if required, adapt the settings for the times for Tdp, Ti and To - or increase the monitoring clock cycle p9500 (rule Tdp = 2 x n x p9500, n= 1, 2, 3, ...).

See also: p9300 (SI Motion monitoring clock cycle (Motor Module)), p9500 (SI Motion monitoring clock cycle (Control Unit))

201711 <location>SI Motion P1 (CU): Defect in a monitoring channel

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE
Acknowledge: IMMEDIATELY (POWER ON)

Cause:

When cross-comparing the two monitoring channels, the drive detected a difference between the input data or results of the monitoring functions and initiated a STOP F. One of the monitoring functions no longer reliably functions - i.e. safe operation is no longer possible.

If at least one monitoring function is active, then after the parameterized timer has expired, the message C01701 "SI Motion: STOP B initiated" is output.

The message value that resulted in a STOP F is displayed in r9725.

If the drive is operated together with a SINUMERIK, the message values are described in message 27001 of SINUMERIK, with the exception of the following message values, which can only occur in SINAMICS:

1007: communication error with the PLC (sign-of-life).

1008: communication error with the PLC (CRC).

The following described message values involve the data cross-check between the two monitoring channels (safety functions integrated in the drive).

The message values may also occur in the following cases if the cause that is explicitly mentioned does not apply:

- cycle times not uniformly parameterized (p9500/p9300 and p9511/p9311)
- differently parameterized axis types (p9502/p9302).
- excessively fast cycle times (p9500/p9300, p9511/p9311).
- For message values 3, 44 ... 57, 232 and 1-encoder system, differently set encoder parameters.
- For message values 3, 44 ... 57, 232 and 2-encoder system, encoder parameters that have not been correctly set.
- incorrect synchronization.

Message value (r9749, interpret decimal):

0 to 999: Number of the cross-compared data that resulted in this fault.

Message values that are not subsequently listed are only for internal Siemens troubleshooting.

0: Stop request from another monitoring channel.

1: Status image of monitoring functions SOS, SLS, SAM/SBR, SDI, SLA or SLP (result list 1) (r9710[0], r9710[1]).

2: Status image of monitoring function SCA or n < nx (result list 2) (r9711[0], r9711[1]).

3: The position actual value differential (r9713[0/1]) between the two monitoring channels is greater than the tolerance in p9542/p9342. When actual value synchronization is enabled (p9501.3/p9301.3), the velocity differential (based on the position actual value) is greater than the tolerance in p9549/p9349.

4: Error when synchronizing the data cross-check between the two channels.

5: Enable safe functions (p9501/p9301). Safety monitoring clock cycle too small (p9500/p9300).

6: Limit value for SLS1 (p9531[0]/p9331[0])

7: Limit value for SLS2 (p9531[1]/p9331[1])

8: Limit value for SLS3 (p9531[2]/p9331[2])

9: Limit value for SLS4 (p9531[3]/p9331[3])

10: Standstill tol. (p9530/p9330)

11: Upper limit value for SLP1 (p9534[0]/p9334[0]).

12: Lower limit value for SLP1 (p9535[0]/p9335[0]).

13: Upper limit value for SLP2 (p9534[1]/p9334[1]).

14: Lower limit value for SLP2 (p9535[1]/p9335[1]).

15: Upper limit value for SCA, cam 1 plus position (p9536[0]/p9336[0]+p9540/p9340)

16: Lower limit value for SCA, cam 1 plus position (p9536[0]/p9336[0])

17: Upper limit value for SCA, cam 1 minus position (p9537[0]/p9337[0]+p9540/p9340)

18: Lower limit for SCA, cam 1 minus position (p9537[0]/p9337[0])

19...30: limit value SCA, cams 2 to 4. Refer above fault values 15 to 18 for cam 1

31: Position tolerance (p9542/p9342) or (p9549/p9349) when actual value synchronization is enabled (p9501.3/p9301.3)

32: Position tolerance for safe referencing (p9544/p9344).

33: Time, velocity changeover (p9551/p9351)

35: Delay time, STOP A (p9556/p9356)

36: Checking time, STO (p9557/p9357)

37: Trans. time, STOP C to SOS (p9552/p9352)

38: Trans. time STOP D to SOS (p9553/p9353)

39: Trans. time, STOP E to SOS (p9554/p9354)

40: Stop response for SLS (p9561/p9361).

41: Stop response for SLP1 (p9562[0]/p9362[0]).

42: Shutdown speed, STO (p9560/p9360)

43: Memory test stop response (STOP A).

44 ... 57: General

Possible cause 1 (during commissioning or parameter modification)

The tolerance value for the monitoring function is not the same on the two monitoring channels.

Possible cause 2 (during active operation)

The limit values are based on the actual value (r9713[0/1]). If the safe actual values on the two monitoring channels do not match, the limit values, which have been set at a defined interval, will also be different (i.e. corresponding to message value 3). This can be ascertained by checking the safe actual positions.

Permissible deviation between the two monitoring channels: p9542/p9342.

44: Position actual value (r9713[0/1]) + limit value SLS1 (p9531[0]/p9331[0]) * safety monitoring clock cycle (p9500/p9300).

45: Position actual value (r9713[0/1]) - limit value SLS1 (p9531[0]/p9331[0]) * safety monitoring clock cycle (p9500/p9300).

46: Position actual value (r9713[0/1]) + limit value SLS2 (p9531[1]/p9331[1]) * safety monitoring clock cycle (p9500/p9300).

47: Position actual value (r9713[0/1]) - limit value SLS2 (p9531[1]/p9331[1]) * safety monitoring clock cycle (p9500/p9300).

48: Position actual value (r9713[0/1]) + limit value SLS3 (p9531[2]/p9331[2]) * safety monitoring clock cycle (p9500/p9300).

49: Position actual value (r9713[0/1]) - limit value SLS3 (p9531[2]/p9331[2]) * safety monitoring clock cycle (p9500/p9300).

50: Position actual value (r9713[0/1]) + limit value SLS4 (p9531[3]/p9331[3]) * safety monitoring clock cycle (p9500/p9300).

51: Position actual value (r9713[0/1]) - limit value SLS4 (p9531[3]/p9331[3]) * safety monitoring clock cycle (p9500/p9300).

52: Standstill position + tolerance (p9530/p9330)

53: Standstill position - tolerance (p9530/p9330)

54: Position actual value (r9713[0/1]) + limit value nx (p9546/p9346) * safety monitoring clock cycle (p9500/p9300) + tolerance (p9542/p9342).

55: Position actual value (r9713[0/1]) + limit value nx (p9546/p9346) * safety monitoring clock cycle (p9500/p9300).

56: Position actual value (r9713[0/1]) - limit value nx (p9546/p9346) * safety monitoring clock cycle (p9500/p9300).

57: Position actual value (r9713[0/1]) - limit value nx (p9546/p9346) * safety monitoring clock cycle (p9500/p9300) - tolerance (p9542/p9342).

58: Actual stop request.

75: Velocity limit nx (p9546, p9346).

When the function "n < nx: hysteresis and filtering" (p9501.16 = 1) is enabled, this message value is also output for a different hysteresis tolerance (p9547/p9347).

76: Stop response for SLS1 (p9563[0]/p9363[0]).

77: Stop response for SLS2 (p9563[1]/p9363[1]).

78: Stop response for SLS3 (p9563[2]/p9363[2]).

79: Stop response for SLS4 (p9563[3]/p9363[3]).

80: Modulo value for SP for rotary axes (p9505/p9305).

81: Velocity tolerance for SAM (p9548/p9348)

82: SGEs for SLS correction factor.

83: Acceptance test timer (p9558/p9358)

84: Trans. time STOP F (p9555/p9355)

85: Trans. time bus failure (p9580/p9380)

86: ID 1-encoder system (p9526/p9326).

87: Encoder assignment, second channel (p9526/p9326)

88: SCA (SN) enable (p9503/p9303).

89: Encoder limit freq.

90: Upper limit value for SCA, cam 5 plus position (p9536[4]/p9336[4]+p9540/p9340).

91: Lower limit value for SCA, cam 5 plus position (p9536[4]/p9336[4]).

- 92: Upper limit value for SCA, cam 5 minus position (p9537[4]/p9337[4]+p9540/p9340).
- 93: Lower limit for SCA, cam 5 minus position (p9537[4]/p9337[4]).
- 94...224: limit value SCA, cams 6 to 30. See above, fault values 90 to 93 for cam 5.
- 225...229: Status screens of the monitoring function SCA (result lists 3...7).
- 230: Filter time constant for $n < nx$.
- 231: Hysteresis tolerance for $n < nx$.
- 232: Smoothed velocity actual value.
- 233: Limit value nx / safety monitoring clock cycle + hysteresis tolerance.
- 234: Limit value nx / Safety monitoring clock cycle.
- 235: -Limit value nx / Safety monitoring clock cycle.
- 236: -Limit value nx / safety monitoring clock cycle - hysteresis tolerance.
- 237: SGA $n < nx$.
- 238: speed limit value for SAM (p9568/p9368 or p9346/p9346).
- 239: Acceleration for SBR (p9581/p9381 and p9583/p9383).
- 240: Inverse value of acceleration for SBR (p9581/p9381 and p9583/p9383).
- 241: Deceleration time for SBR (p9582/p9382).
- 242: Function specification (p9506/p9306).
- 243: Function configuration (p9507/p9307).
- 244: Encoderless actual value sensing filter time (p9587/p9387).
- 245: Encoderless actual value sensing minimum current (p9588/p9388).
- 246: Voltage tolerance acceleration (p9589/p9389).
- 247: SDI tolerance (p9564/p9364).
- 248: SDI positive upper limit (7FFFFFFF hex).
- 249: Position actual value (r9713[0/1]) - SDI tolerance (p9564/p9364).
- 250: Position actual value (r9713[0/1]) + SDI tolerance (p9564/p9364).
- 251: SDI negative lower limit (80000001 hex).
- 252: SDI stop response (p9566/p9366).
- 253: SDI delay time (p9565/p9365).
- 254: Setting the evaluation delay for actual value sensing after pulse enable (p9586/p9386).
- 255: Setting, behavior during pulse suppression (p9509/p9309).
- 256: Status image of monitoring functions SOS, SLS, SLP, test stop, SBR, SDI (result list 1 ext) (r9710).
- 257: Safety functions for motion monitoring functions without selection (p9512/p9312) different.
- 258: Fault tolerance, actual value sensing encoderless (p9585/p9385).
- 259: Scaling factor for safe position via PROFIsafe (p9574/p9374) or PROFIsafe telegram (p9611/p9811) different.
- 260: Modulo value including scaling (p9505/p9305 and p9574/p9374) for SP with 16 bit.
- 261: Scaling factor for acceleration for SBR different.
- 262: Scaling factor for the inverse value of the acceleration for SBR different.
- 263: Stop response for SLP2 (p9562[1]/p9362[1])
- 264: Position tolerance including scaling (p9542/p9342 and p9574/p9374) for SP with 16 bit.
- 265: Status image of all change functions (results list 1) (r9710).
- 266: The switchover speed to SOS differs (p9567/p9367).
- 267: The transition time to SOS after standstill differs (p9569/p9369).
- 268: SLP delay time differs (p9577/p9377).
- 269: Factor to increase the position tolerance when switching over the gearbox stage (p9543/p9343).
- 270: Screen form for SGE image: all functions, which are not supported/enabled for the actual parameterization (p9501/p9301, p9601/p9801 and p9506/p9306)..
- 271: Screen form for SGE image: Deselect all bits for the "Safe gearbox switchover" function.
- 272: activation of the increased position tolerance for the "Safe gearbox switchover" function different (p9568/p9368 or p9346/p9346 or "0").
- 273: speed limit value for flattening the ramp for SAM/SBR different.
- 274: SGA SCA, cams 1 to 15.
- 275: SGA SCA, cams 16 to 30.
- 276: Limit value for SLA1 (p9578/p9378).

277: Stop response for SLA1 (p9579/p9379).

278: Upper limit value for SLA1.

279: Lower limit value for SLA1.

280: Upper limit value for SLA1 (fine resolution).

281: Lower limit value for SLA1 (fine resolution).

282: SLA filter time.

283: Acceleration actual value (fine resolution).

1000: Watchdog timer has expired. Too many signal changes have occurred at safety-relevant inputs.

1001: Initialization error of watchdog timer.

1002:

User agreement after the timer has expired different.

The user agreement is not consistent. After a time of 4 s has expired, the status of the user agreement is different in both monitoring channels.

1003:

Reference tolerance exceeded.

When the user agreement is set, the difference between the new reference point that has been determined after the system boots (absolute encoder) or reference point approach (distance-coded or incremental measuring system) and the safe actual position (saved value + traversing distance) is greater than the reference tolerance (p9544). In this case, the user agreement is withdrawn.

1004:

Plausibility error for user agreement.

1. If the user agreement has already been set, then the setting is initiated again. In this case, the user agreement is withdrawn.

2. The user agreement was set, although the axis has still not been referenced.

1005:

- for safe motion monitoring functions without encoder: pulses already suppressed for test stop selection.

- for safe motion monitoring functions with encoder: STO already active for test stop selection.

1011: Acceptance test status between the monitoring channels differ.

1012: Plausibility violation of the encoder actual value.

1014: Error when synchronizing the SGA for the "Safe cam" function.

1015: Gearbox switchover (bit 27 in PROFIsafe telegram) takes longer than 2 min.

1020: Cyc. communication failure between the monit. channels.

1021: Cyc. communication failure between the monit. channel and Sensor Module.

1022: Sign-of-life error for DRIVE-CLiQ encoders monitoring channel 1.

1023: Error in the effectiveness test in the DRIVE-CLiQ encoder

1024: Sign-of-life error for HTL/TTL encoders.

1032: Sign-of-life error for DRIVE-CLiQ encoders monitoring channel 2.

1033: Error checking offset between POS1 and POS2 for DRIVE-CLiQ encoder monitoring channel 1.

1034: Error checking offset between POS1 and POS2 for DRIVE-CLiQ encoder monitoring channel 2.

1035: offset between POS1 and POS2 for DRIVE-CLiQ encoder on one of the monitoring channels has changed since the last commissioning.

1039: Overflow when calculating the position.

1041: Current absolute value too low (encoderless)

1042: Current/voltage plausibility error

1043: Too many acceleration phases

1044: Current actual values plausibility error.

5000 ... 5140:

PROFIsafe message values.

For these message values, the failsafe control signals (Failsafe Values) are transferred to the safety functions.

5000, 5014, 5023, 5024, 5030 ... 5032, 5042, 5043, 5052, 5053, 5068, 5072, 5073, 5082 ... 5087, 5090, 5091, 5122 ... 5125, 5132 ... 5135, 5140:

An internal software error has occurred (only for internal Siemens troubleshooting).

5012: Error when initializing the PROFIsafe driver.

5013: The result of the initialization is different for the two controllers.

5022: Error when evaluating the F parameters. The values of the transferred F parameters do not match the expected values in the PROFIsafe driver.

5025: The result of the F parameterization is different for the two controllers.

5026: CRC error for the F parameters. The transferred CRC value of the F parameters does not match the value calculated in the PST.

5065: A communications error was identified when receiving the PROFIsafe telegram.

5066: A time monitoring error (timeout) was identified when receiving the PROFIsafe telegram.

6000 ... 6166:

PROFIsafe message values (PROFIsafe driver for PROFIBUS DP V1/V2 and PROFINET).

For these message values, the failsafe control signals (Failsafe Values) are transferred to the safety functions. If "Stop B after failure of the PROFIsafe communication" (p9612) is parameterized, the transfer of the Failsafe Values is delayed.

The significance of the individual message values is described in safety fault F01611.

7000: Difference of the safe position is greater than the parameterized tolerance (p9542/p9342).

7001: Scaling value for the safe position in the 16 bit notation, too low (p9574/p9374).

7002: Cycle counter for transferring the safe position is different in both monitoring channels.

7003: error when providing the data for the "Synchronous safe position via PROFIsafe" function.

7004: PROFIsafe clock cycle not correctly synchronized to the DP clock cycle.

See also: p9555 (SI Motion transition time STOP F to STOP B (Control Unit)), r9725 (SI Motion diagnostics STOP F)

Remedy:

The following generally applies:

The monitoring clock cycles in both channels and the axis types should be checked for equality and the same setting applied if necessary. If the error continues to be identified, increasing the monitoring clock cycles may resolve it.

For message value = 0:

- no error was identified in this monitoring channel. Note the error message of the other monitoring channel (for MM: C30711).

For message value = 3:

Commissioning phase:

- check the encoder parameters, and if required, correct (p9516/p9316, p9517/p9317, p9518/p9318, p9520/p9320, p9521/p9321, p9522/p9322, p9526/p9326).

In operation:

- check the mechanical design and the encoder signals.
- if closed-loop control with edge modulation is parameterized (p1802[x] = 9): parameterize edge modulation for actual value sensing without encoder (p9507.5 = p9307.5 = 1).

For message value = 4:

The monitoring clock cycles in both channels should be checked for equality and if required, set the same. In combination with message value 5 from the other monitoring channel (with MM: C30711), the monitoring clock cycle settings must be increased.

For message value = 11 ... 14:

- the limit values in p9534/p9334 or p9535/p9335 are not equal or have been set too high. Correct the values.

For message value = 15 ... 30 and 90 ... 229:

- the cam positions for function SCA in p9536/p9336, p9537/p9337 or the cam tolerance p9540/p9340 are not equal. Correct the values. Increase the cam tolerance p9540/p9340.

For message value = 232:

- increase the hysteresis tolerance (p9547/p9347). Possibly set the filtering higher (p9545/p9345).

For message value = 274, 275:

- increase the cam tolerance p9540/p9340 and/or the position tolerance p9542/p9342.

For message value = 278, 279:

- check as to whether the same acceleration limit has been set for both channels. A different result depends on whether SLA is enabled and not selected - or enabled and selected. In this case, another message value is possible.

For message value = 1 ... 999:

- if the message value is listed under cause: Check the cross-checked parameters to which the message value refers.

- copy the safety parameters.

- carry out a POWER ON (switch-off/switch-on) for all components.

- upgrade the Motor Module software.

- upgrade the Control Unit software.

- correction of the encoder evaluation. The actual values differ as a result of mechanical faults (V belts, travel to a mechanical endstop, wear and window setting that is too narrow, encoder fault, ...).

Note:

For SINAMICS firmware version ≥ 4.7 , the KDV list is increased when setting $p9567 > 0$. For a non-compatible version of SINUMERIK this can lead to an error for the data cross-check (is indicated with message value ≥ 237). If necessary, p9567 must be set = 0, or the firmware version of SINUMERIK upgraded.

For message value = 1000:

- investigate the signal associated with the safety-relevant input (contact problems).

For message value = 1001:

- carry out a POWER ON (switch-off/switch-on) for all components.

- upgrade the Motor Module software.

- upgrade the Control Unit software.

For message value = 1002:

- perform safe acknowledgment, set the user agreement in both monitoring channels simultaneously (within 4 s).

For message value = 1003:

- check the mechanical system of the axis. It is possible that the axis was shifted when switched-off, and the last saved actual position no longer corresponds with the new actual position after the system has been powered up again.

- increase the tolerance for the actual value comparison when referencing (p9544).

Then check the actual values, perform a POWER ON and set the user agreement again.

For message value = 1004:

For 1., the following applies: Perform safe acknowledgment. Set the user agreement again.

For 2., the following applies: Perform safe acknowledgment. Only set the user agreement again if the axis has been referenced.

For message value = 1005:

- for safe motion monitoring functions without encoder: check the conditions for pulse enable.
- for safe motion monitoring functions with encoder: check the conditions for STO deselection.

Note:

For a Power Module, the test stop should always be performed when the pulses are enabled (independent of whether with encoder or without encoder).

For message value = 1007:

- check the PLC for the correct operating state (run state, basic program).

For message value = 1008:

- check whether incorrect or overlapping address ranges have been set in SINUMERIK machine data MD10393.

For message value = 1011:

- for diagnostics, refer to parameter (r9571).

For message value = 1012:

- upgrade the Sensor Module firmware to a more recent version.
- for 1-encoder systems, the following applies: check the encoder parameters for equality (p9515/p9315, p9519/p9319, p9523/p9323, p9524/p9324, p9525/p9325, p9529/p9329).
- for a 1-encoder system and 2-encoder system the following applies: in order to correctly copy the encoder parameters from p04xx, p9700 must be set to 46 and p9701 must be set to 172.
- for DQI encoders the following applies: If required, upgrade the firmware version of the Control Unit to a more recent version, which is released for DQI encoders.
- the parameterized encoder does not correspond to the connected encoder - replace the encoder.
- check the electrical cabinet design and cable routing for EMC compliance
- carry out a POWER ON (switch-off/switch-on) for all components or a warm restart (p0009 = 30, p0976 = 2, 3).
- replace the hardware.

For message value = 1014:

- check the encoder actual values. If required, increase the position tolerance (p9542) and/or cam tolerance (p9540).

For message value = 1020, 1021, 1024:

- check the communication link.
- if required, increase the monitoring cycle clock settings (p9500, p9511).
- carry out a POWER ON (switch-off/switch-on) for all components or a warm restart (p0009 = 30, p0976 = 2, 3).
- replace the hardware.

For message value = 1033, 1034:

- if required, upgrade the firmware version of the Control Unit to a more recent version, which is released for DQI encoders.

For message value = 1035, if one of the safety encoders was replaced:

- confirm the hardware replacement (p9700 = 29, p9701 = 236 or p9702 = 29).
- save all parameters (p0977 = 1 or p0971 = 1 or "copy RAM to ROM").
- acknowledge fault (e.g. binector input p2103).

For message value = 1039:

- check the conversion factors such as spindle pitch or gearbox ratios.

For message value = 1041:

- check whether the motor has sufficient current (>r9785[0]).
- reduce the minimum current (p9588).
- for synchronous motors increase the absolute value of p9783.
- check whether the function "Closed-loop controlled operation with HF signal injection" is activated (p1750.5 = 1) and if required, deactivate.

For message value = 1042:

- increase the ramp-function generator ramp-up/down time (p1120/p1121).
- check that the current/speed control is set correctly (torque-generating/field-generating current and actual speed value may not fluctuate).

- reduce the dynamic response of the setpoint value.
- check the absolute current and voltage values, and set the control behavior so that this is greater than 3% of the rated converter data in operation or in the case of a fault.
- increase the minimum current (p9588).

For message value = 1043:

- increase the voltage tolerance (p9589). When operating a reluctance motor, the controller settings are generally set to be more dynamic. If this message is output for the factory setting of p9589, then the acceleration limit should be increased as countermeasure (p9589 = 500 ... 1000 %). From experience, this provides a rugged response.
- increase the ramp-function generator ramp-up/down time (p1120/p1121).
- check that the current/speed control is set correctly (torque-generating/field-generating current and actual speed value may not fluctuate).
- reduce the dynamic response of the setpoint value.

For message value = 5000, 5014, 5023, 5024, 5030, 5031, 5032, 5042, 5043, 5052, 5053, 5068, 5072, 5073, 5082 ... 5087, 5090, 5091, 5122 ... 5125, 5132 ... 5135, 5140:

- carry out a POWER ON (switch-off/switch-on) for all components.
- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.
- upgrade firmware to later version.
- contact Technical Support.
- replace the Control Unit.

For message value = 5012:

- check the setting of the PROFIsafe address of the Control Unit (p9610) and that of the Motor Module (p9810). It is not permissible for the PROFIsafe address to be 0 or FFFF!

For message value = 5013, 5025:

- carry out a POWER ON (switch-off/switch-on) for all components.
- check the setting of the PROFIsafe address of the Control Unit (p9610) and that of the Motor Module (p9810).
- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.

For message value = 5022:

- check the setting of the values of the F parameters at the PROFIsafe slave (F_SIL, F_CRC_Length, F_Par_Version, F_Source_Add, F_Dest_add, F_WD_Time).

For message value = 5026:

- check the settings of the values of the F parameters and the F parameter CRC (CRC1) calculated from these at the PROFIsafe slave and update.

For message value = 5065:

- check the configuration and communication at the PROFIsafe slave (cons. No. / CRC).
- check the setting of the value for F parameter F_WD_Time on the PROFIsafe slave and increase if necessary.
- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.

For message value = 5066:

- check the setting of the value for F parameter F_WD_Time on the PROFIsafe slave and increase if necessary.
- evaluate diagnostic information in the F host.
- check PROFIsafe connection.

For message value = 6000 ... 6999:

Refer to the description of the message values in safety fault F01611.

For message value = 7000:

- increase the position tolerance (p9542/p9342).
- determine the actual position of CU (r9713[0]) and the second channel r9713[1], and check the difference for plausibility.
- reduce the difference of the actual position from CU (r9713[0]) and the second channel r9713[1] for a 2-encoder system.

For message value = 7001:

- increase the scaling value for the safe position in the 16 bit notation (p9574/p9374).
- if required, reduce the traversing range.

For message value = 7002:

- carry out a POWER ON (switch-off/switch-on) for all components.

- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.

This message can be acknowledged without a POWER ON as follows (safe acknowledgment):

- Terminal Module 54F (TM54F).

- onboard F-DI (only CU310-2).

- PROFIsafe.

- machine control panel.

For message value = 7003, 7004:

- if required, adapt the settings for the times for Tdp, Ti and To - or increase the monitoring clock cycle p9500 (rule Tdp = 2 x n x p9500, n= 1, 2, 3, ...).

See also: p9300 (SI Motion monitoring clock cycle (Motor Module)), p9500 (SI Motion monitoring clock cycle (Control Unit))

201712 <location>SI Motion P1 (CU): Defect in F-IO processing

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: When cross checking and comparing the two monitoring channels, the drive detected a difference between parameters or results of the F-IO processing and initiated a STOP F. One of the monitoring functions no longer reliably functions - i.e. safe operation is no longer possible.

The safety message C01711 with message value 0 is also displayed due to initiation of STOP F.

If at least one monitoring function is active, the safety message C01701 "SI Motion: STOP B initiated" is output after the parameterized timer has expired.

Message value (r9749, interpret decimal):

Number of the cross-compared data that resulted in this message.

- 1: SI discrepancy monitoring time inputs (p10002, p10102).
- 2: SI acknowledgment internal event input terminal (p10006, p10106).
- 3: SI STO input terminal (p10022, p10122).
- 4: SI SS1 input terminal (p10023, p10123).
- 5: SI SS2 input terminal (p10024, p10124).
- 6: SI SOS input terminal (p10025, p10125).
- 7: SI SLS input terminal (p10026, p10126).
- 8: SI SLS_Limit(1) input terminal (p10027, p10127).
- 9: SI SLS_Limit(2) input terminal (p10028, p10128).
- 10: SI Safe State signal selection (p10039, p10139).
- 11: SI F-DI input mode (p10040, p10140).
- 12: SI F-DO 0 signal sources (p10042, p10142).
- 13: Different states for static inactive signal sources (p10006, p10022 ... p10031).
- 14: SI discrepancy monitoring time outputs (p10002, p10102).
- 15: SI acknowledgment internal event (p10006, p10106).
- 16: SI test sensor feedback signal test mode selected for test stop (p10046, p10146, p10047, p10147).
- 17: SI delay time for test stop at DOs (p10001).
- 18 ... 25: SI test sensor feedback signal (p10046, p10146, p10047, p10147). Expected state of internal readback signal, generated from the selected test stop mode.
- 26 ... 33: SI test sensor feedback signal (p10046, p10146, p10047, p10147). Expected state of external readback signal, generated from the selected test stop mode.
- 34 ... 41: SI test sensor feedback signal (p10046, p10146, p10047, p10147). Expected state of second internal readback signal, generated from the selected test stop mode.
- 42: Internal data for processing the second internal readback signal, generated from the selected test stop mode (p10047, p10147).
- 43: Internal data for processing the internal readback signal, generated from the selected test stop mode (p10047, p10147).
- 44: Internal data for processing the external readback signal, generated from the selected test stop mode (p10047, p10147).
- 45: Internal data for initialization state of test stop mode, dependent upon test stop parameters.
- 46: SI digital inputs debounce time (p10017, p10117)
- 47: Selection F-DI for PROFIsafe (p10050, p10150)
- 48: Screen form of the F-DIs used (p10006, p10022 ... p10031).
- 49: SI SDI positive input terminal (p10030, p10130).
- 50: SI SDI negative input terminal (p10031, p10131).
- 51: SI SLP input terminal (p10032, p10132).
- 52: SI SLP select input terminal (p10033, p10133).
- 53: Internal data for retraction logic (p10009, p100109).
- 54: SI F-DI for retraction SLP (p10009, p100109).

Remedy:

- check parameterization in the parameters involved and correct if required.
- ensure equality by copying the SI data to the second channel and then carry out an acceptance test.
- check monitoring clock cycle in p9500 and p9300 for equality.

This message can be acknowledged without a POWER ON as follows (safe acknowledgment):

- onboard F-DI (only CU310-2).
- PROFIsafe.
- machine control panel.

See also: p9300 (SI Motion monitoring clock cycle (Motor Module)), p9500 (SI Motion monitoring clock cycle (Control Unit))

201714	<location>SI Motion P1 (CU): Safely-Limited Speed exceeded
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The drive has moved faster than that specified by the velocity limit value (p9531). The drive is stopped as a result of the configured stop response (p9563). Message value (r9749, interpret decimal): 100: SLS1 exceeded. 200: SLS2 exceeded. 300: SLS3 exceeded. 400: SLS4 exceeded. 1000: Encoder limit frequency exceeded.
Remedy:	- check the traversing/motion program in the control. - check limits for SLS and if required adapt accordingly (p9531). This message can be acknowledged without a POWER ON as follows (safe acknowledgment): - Terminal Module 54F (TM54F). - onboard F-DI (only CU310-2). - PROFIsafe. - machine control panel. Note: SI: Safety Integrated SLS: Safely-Limited Speed / SG: Safely reduced speed See also: p9531, p9563

201715	<location>SI Motion P1 (CU): Safely-Limited Position exceeded
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The axis has moved past a parameterized position that is monitored by the "SLP" function. Message value (r9749, interpret decimal): 10: SLP1 violated. 20: SLP2 violated.
Remedy:	- check the traversing/motion program in the control. - check the limits for "SLP" function and if required, adapt (p9534, p9535). This message can be acknowledged without a POWER ON as follows (safe acknowledgment): Prerequisite: - deselect "SLP" function and retract the axis into the permitted position range. Carry out a safe acknowledgment using one of the following options: - Terminal Module 54F (TM54F). - onboard F-DI (only CU310-2). - PROFIsafe. - machine control panel. Note: SI: Safety Integrated SLP: Safely-Limited Position / SE: Safe software limit switches See also: p9534, p9535

201716	<location>SI Motion P1 (CU): Tolerance for safe motion direction exceeded
Drive object:	HLA_828, SERVO_828, SERVO_COMBI

Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The tolerance for the "safe motion direction" function was exceeded. The drive is stopped as a result of the configured stop response (p9566). Message value (r9749, interpret decimal): 0: Tolerance for the "safe motion direction positive" function exceeded. 1: Tolerance for the "safe motion direction negative" function exceeded.
Remedy:	- check the traversing/motion program in the control. - check the tolerance for "SDI" function and if required, adapt (p9564). This message can be acknowledged without a POWER ON as follows (safe acknowledgment): Prerequisite: - deselect the "SDI" function and if required select again. Carry out a safe acknowledgment using one of the following options: - Terminal Module 54F (TM54F). - onboard F-DI (only CU310-2). - PROFIsafe. - machine control panel. Note: SDI: Safe Direction (safe motion direction) SI: Safety Integrated See also: p9564, p9565, p9566

201717 <location>SI Motion P1 (CU): SLA limit exceeded

Drive object:	SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The acceleration limit for the "Safely-Limited Acceleration" function was exceeded. The drive is stopped as a result of the configured stop response (p9579). Message value (r9749, interpret decimal): 0: The monitoring of the coarsely resolved acceleration has violated the acceleration limit. 1: The monitoring of the finely resolved acceleration and possibly filtered acceleration has violated the acceleration limit.
Remedy:	- check the traversing/motion program in the control. - check the acceleration limit for the "SLA" function and if required, adapt (p9578). - carry out a safe acknowledgment. For message value = 0: Analyze the causes using r9714[0] and r9714[3]. For message value = 1: Analyze the causes using r9789[0], r9789[1] and r9789[2]. Note: SI: Safety Integrated SLA: Safely-Limited Acceleration See also: p9578 (SI Motion SLA acceleration limit (CU))

201730 <location>SI Motion P1 (CU): Reference block for dynamic Safely-Limited Speed invalid

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)

Cause:	The reference block transferred via PROFIsafe is negative. A reference block is used to generate a referred velocity limit value based on the reference quantity "Velocity limit value SLS1" (p9531[0]). The drive is stopped as a result of the configured stop response (p9563[0]). Message value (r9749, interpret decimal): requested, invalid reference block.
Remedy:	In the PROFIsafe telegram, input data S_SLS_LIMIT_IST must be corrected. This message can be acknowledged without a POWER ON as follows (safe acknowledgment): - PROFIsafe. Note: SI: Safety Integrated SLS: Safely-Limited Speed / SG: Safely reduced speed

201745 <location>SI Motion P1 (CU): Checking braking torque for the brake test

Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	POWER ON (IMMEDIATELY)
Cause:	The scaling of the brake torque for the brake test can be changed using parameter p2003. An acceptance test must be carried out again for the braking test. This determines whether the braking test is still carried out with the correct braking torque.
Remedy:	- carry out a POWER ON (switch-off/switch-on) for all components. - repeat the acceptance test for the safe brake test if the brake test is used. See also: p2003

201750 <location>SI Motion P1 (CU): Hardware fault safety-relevant encoder

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The encoder that is used for the safety-relevant motion monitoring functions signals a hardware fault. Message value (r9749, interpret decimal): Encoder status word 1, encoder status word 2 that resulted in the message.
Remedy:	- check the encoder connection. - replace encoder. This message can be acknowledged without a POWER ON as follows (safe acknowledgment): - Terminal Module 54F (TM54F). - onboard F-DI (only CU310-2). - PROFIsafe. - machine control panel. Note regarding encoder replacement for a third-party motor: The serial number of the encoder must be copied in order to acknowledge this safety message. This can be realized using p0440 = 1 or p1990 = 1.

201751 <location>SI Motion P1 (CU): Effectivity test fault safety-relevant encoder

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)

Cause: The DRIVE-CLiQ encoder for safe motion monitoring signals an error for the effectivity tests.
Message value (r9749, interpret decimal):
Only for internal Siemens troubleshooting.

Remedy: - check the encoder connection.
- replace encoder.
This message can be acknowledged without a POWER ON as follows (safe acknowledgment):
- Terminal Module 54F (TM54F).
- onboard F-DI (only CU310-2).
- PROFIsafe.
- machine control panel.

201752 <location>SI Motion P1 (CU): reference position invalid

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The transferred reference position is invalid.
Message value (r9749, interpret decimal):
1: It is not possible to directly transfer the reference position (p9573=89).
2: It is not possible to transfer the reference position into the motion.

Remedy: - unpark axis/encoder.
- acknowledge encoder fault
- deactivate gearbox stage switchover.
- when referencing via the Safety Control Channel (SCC), enable the function "Referencing via SCC" (p9501.27/9301.27).
This message can be acknowledged as follows:
- motion monitoring functions integrated in the drive: Via Terminal Module 54F (TM54F) or PROFIsafe

201780 <location>SBT When selected, the brake is closed

Drive object: SERVO_828, SERVO_COMBI

Message value: Following brakes are closed: %1 bin

Reaction: NONE

Acknowledge: NONE

Cause: When selecting the brake test or starting the brake test, not all of the brakes were open.
Alarm value (r2124, interpret binary):
Bit 0 = 1:
The internal brake is closed.
Bit 1 = 1:
The external brake is closed (p10230.5, p10235.5, p10202).
Note:
The alarm is also issued, if a brake has not been configured in p10202.
SBT: Safe Brake Test
See also: p10202, p10230, p10235

Remedy: Open all brakes and reselect the brake test (p10230.0, p10235.0).

201781 <location>SBT brake opening time exceeded

Drive object: SERVO_828, SERVO_COMBI

Message value: Fault cause: %1 bin

Reaction: NONE

Acknowledge: NONE

Cause:	The maximum time (11 s) to open the brake during the brake test was exceeded. Possible causes: - during the brake test the drive went into a fault condition, and therefore the brake was closed by the drive. - for an external brake, the feedback signal "Brake closed" was signaled too long (p10230.5, p10235). Alarm value (r2124, interpret binary): Bit 0 = 1: Internal brake was not able to be opened. Bit 1 = 1: External brake was not able to be opened. Note: SBT: Safe Brake Test
Remedy:	- carry out a safe acknowledgment. - restart the brake test (p10230.1, p10235.1). See also: p10230, p10235

201782 <location>SBT brake test incorrect control

Drive object:	SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	NONE
Acknowledge:	NONE
Cause:	The brake test was canceled as a result of incorrect control. Alarm value (r2124, interpret binary): Alarm value 0: The brake test was canceled as a result of a fault (brake opening time or brake closing time exceeded). Bit 0: The safe brake test was canceled by resetting the brake test selection. Bit 1: The safe brake test was canceled by resetting the brake test start. Bit 2: The brake, which was selected at the start of the brake test, has not been configured in p10202. When starting the brake test, as a result of the test top selection, brake 1 is not configured as internal brake. There is a brake test configuration error. In this case, alarm A01785 is also output. Note: SBT: Safe Brake Test See also: p10202 (SI Motion SBT brake selection)
Remedy:	- check parameterization of the brake test (p10202). - check as to whether alarm A01785 is present, and if so, evaluate. - carry out a safe acknowledgment. - if required, restart the brake test.

201783 <location>SBT brake closing time exceeded

Drive object:	SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	NONE
Acknowledge:	NONE

Cause:	The maximum time (11 s) to close the brake during the brake test was exceeded. Alarm value (r2124, interpret binary): Bit 0 = 1: Internal brake was not able to be closed. Bit 1 = 1: External brake was not able to be closed. Note: SBT: Safe Brake Test
Remedy:	- When using an external brake, check that the feedback signal "brake closed" is correctly interconnected with the control word of the brake test (p10230.5, p10235.5). - When using an internal brake with external feedback signal, check whether the feedback signal is correctly interconnected with the extended brake control. - carry out a safe acknowledgment. - restart the brake test (p10230.1, p10235.1).

201784 <location>SBT brake test canceled with fault

Drive object: SERVO_828, SERVO_COMBI

Message value: Fault cause: %1

Reaction: NONE

Acknowledge: NONE

Cause: The safe brake test was canceled as a result of a fault.

Alarm value (r2124, interpret binary):

Bit 17 = 1: fault in the brake test sequence (cause, see bits 0 ... 10).

Bit 18 = 1: the internal brake is closed. It must be open when the external brake is tested (p10202).

Bit 19 = 1: the external brake is closed. It must be open when the internal brake is tested (p10202).

Bit 20 = 1: not all brakes are open (p10202).

Bit 21 = 1: axis position during the brake test not valid due to parking axis.

Bit 22 = 1: internal software error.

Bit 23 = 1: the permissible position range of the axis was violated with the brake closed (p10212/p10222).

Bit 24 = 1: the tested internal brake was opened while the brake test was active.

Bit 25 = 1: the tested external brake was opened while the brake test was active.

Bit 26 = 1: during the active brake test, the test torque left its tolerance bandwidth (20 %).

Cause for alarm value bit 17:

Bit 0 = 1: operation when selecting the brake test not enabled (r0899.2 = 0).

Bit 1 = 1: external fault occurred (e.g. the brake test that has already started is canceled by the user).

Bit 2 = 1: when selecting the brake test a brake is closed.

Bit 3 = 1: when determining the load torque a brake is closed.

Bit 4 = 1: A fault has occurred with stop response (e.g. OFF1, OFF2 or OFF3) - or the pulse enable was withdrawn (e.g. STO selected or operation no longer enabled).

Bit 5 = 1: when selecting the brake test the axis speed setpoint is too high.

Bit 6 = 1: the actual speed (r0063) of the axis is too high (e.g. brake does not hold during the brake test).

Bit 7 = 1: Incorrect speed controller mode (e.g. encoderless speed control or U/f operation).

Bit 8 = 1: closed-loop control not enabled or function generator active.

Bit 9 = 1: control does not switch over to the brake test (e.g. because PI speed control has not been parameterized).

Bit 10 = 1: torque limit reached (r1407.7, r1408.8).

Note:

SBT: Safe Brake Test

Remedy:

- remove the fault cause.
- carry out a safe acknowledgment.
- if required, restart the brake test.

For bit 17 = 1 with bit 6 = 1 or bit 23 = 1:
 If the brake closing time of the motor holding brake (p1217) has been set too low, then at the start of the brake test, the brake is closed too late. The brake closing time should be adapted (p1217).

201785 <location>SBT brake test configuration error

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: Error when parameterizing the brake test.
 In this configuration, the brake test cannot be started or cannot be started without error.
 Alarm value (r2124, interpret decimal):

1:
 No motion monitoring functions have been enabled.

2:
 Two internal brakes were configured (p10202).

4:
 No internal brakes were configured (p10202).

8:
 The brake test is configured for an internal brake, however the safety brake control is not enabled (p9602/p9802).

Note:
 From firmware version 5.1, SBT without SBC is also permitted for the internal brake.

16:
 The safe brake test and Safety without encoder are simultaneously enabled (p9306/p9506). This is not permissible.

32:
 The Safe Brake Test and vector U/f control is enabled. The safe brake test is not possible in this control mode.

Note:
 SBC: Safe Brake Control
 SBT: Safe Brake Test

Remedy: Check parameterization of the brake test.

201786 <location>SCC signal source changed

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: The signal source in p10235 or p10250 was changed.
 The new signal source is effective immediately.

Note:
 SCC: Safety Control Channel
 See also: p10235 (SI Safety Control Channel control word S_STW3B), p10250 (SI Safety Control Channel control word S_STW1B)

Remedy: Acknowledge fault.

201787 <location>SBT motor type different

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The motor type set for the safe brake test (p10204) does not match the motor type set via the function module (r0108.12).

Remedy: Adapt the motor type set for the safe brake test.

Note:

All of the parameters for the brake test, whose unit depends on the motor type, should be checked.

See also: p10204, p10209

201788 <location>SI: Automatic test stop waits for STO deselection via motion monitoring functions

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The automatic test stop (forced checking procedure) was not able to be carried out after powering up.

Possible causes:

- the STO function is selected via safe motion monitoring functions.

- a safety message is present, that resulted in a STO.

Note:

STO: Safe Torque Off

Remedy: - deselect STO via safe motion monitoring functions.

- remove the cause of the safety messages and acknowledge the messages.

Note:

The automatic test stop is performed after removing the cause.

201789 <location>SI: Automatic test stop and brake test when test stop is selected not permitted

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The parameterization of the automatic test stop (p9507.6/p9307.6) and the brake test when a test stop is selected (p10203 = 2) are not permissible.

The test stop is not automatically carried out when the powering up.

Remedy: - correct the parameter assignment.

- set p10203 not equal to 2 or deactivate the automatic test stop.

Note:

A warm restart or POWER ON is required to carry out the automatic test stop.

201794 <location>SI Motion: check modulo value for safe position via PROFIsafe

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: When parameterizing the modulo value for safe position via PROFIsafe (p9505) the position actual value can jump when the range that can be represented overflows.

Range that can be represented:

- 32-bit value: +/- 2048 revolutions

- 16-bit value: +/- 2048 revolutions (depending on p9574)

Remedy: Correct the parameter assignment.
 Set p9505 to 2^n revolutions - and to complete revolutions (i.e. a multiple of 360°).
Note:
 This alarm can be hidden for the case that the possible position actual value jump can be tolerated for the particular application, or does not represent a problem; for example because the parameterized modulo range fits "almost as integer number" in the range of ± 2048 revolutions that can be represented.
 To re-parameterize the alarm to "NO REPORT", it is not permissible that the alarm is present. As a consequence, the following sequence is required for the re-parameterization:
 - correct p9505 to 2^n .
 - re-parameterize the alarm using p2118 and p2119.
 - set p9505 back to the required value.

201795 <location>SI Motion P1 (CU): Wait time after exiting the safe pulse cancellation expired

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: After exiting safe pulse cancellation, within the wait time of 5 seconds, encoderless actual value sensing was not able to be activated for the extended functions without selection.
 A change is again made into the "safe pulse cancellation" state.

Remedy: - check missing enable signals, which prevent the drive control from being commissioned (r0046).
 - evaluate possible fault messages of the encoderless actual value sensing and remove.

201796 <location>SI P1 (CU): Wait for communication

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The drive waits for communication to be established to execute the safety-relevant motion monitoring functions.

Note:

STO is active in this state.

Alarm value (r2124, interpret decimal):

1: Wait for communication to be established to SINUMERIK.

2: Wait for communication to be established to TM54F.

3: Wait for communication to be established to PROFIsafe F-Host.

Remedy: If, after a longer period of time, the message is not automatically withdrawn, the following checks have to be made as appropriate:
For communication with SINUMERIK, the following applies:
- check any other PROFIBUS messages/signals present and remove their cause.
- check that assignment of the axes on the higher-level control to the drives in the drive unit is correct.
- check enable signal of the safety-relevant motion monitoring functions for the corresponding axis on the higher-level control and if required, set it.
For communication with TM54F, the following applies:
- check any other messages/signals present for DRIVE-CLiQ communication with the TM54F and remove their cause.
- check the setting of p10010. All the drive objects controlled by the TM54F must be listed.
For communication with PROFIsafe F-Host, the following applies:
- check any other PROFIsafe communication messages/signals present and evaluate them.
- check the operating state of the F-Host.
- check the communication connection to the F Host.
- check the communication connection to the Motor Module/Hydraulic Module. It must be ensured that when the Control Unit powers up, the Motor Module/Hydraulic Module is connected and at the latest is also switched-on with the Control Unit. Otherwise, if the Motor Module/Hydraulic Module is subsequently inserted or switched on, a POWER ON must be performed at the Control Unit.
Note:
STO: Safe Torque Off
See also: p9601, p9801, p10010

201797 <location>SI Motion P1 (CU): Axis not safely referenced

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The standstill position saved before switching off does not match the actual position determined at switch-on.
Message value (r9749, interpret decimal):
1: Axis not safely referenced.
2: User agreement missing.

Remedy: If safe automatic referencing is not possible the user must issue a user agreement for the new position using the softkey. This means that this position is then designated as safety-relevant.
Note:
SI: Safety Integrated

201798 <location>SI Motion P1 (CU): Test stop for motion monitoring functions running

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The forced checking procedure (test stop) for the safe motion monitoring functions is currently in progress.

Remedy: Not necessary.
The message is automatically withdrawn when the test stop has been completed.
Note:
SI: Safety Integrated

201799 <location>SI Motion P1 (CU): Acceptance test mode active

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The acceptance test mode is active. This means the following: - the setpoint velocity limiting is deactivated (r9733). - the standard limit switches are deactivated during the acceptance test for function SLP (SE) (for EPOS internal, otherwise via r10234). - for safety functions with SINUMERIK, the following applies: The POWER ON signals of the safety-relevant motion monitoring functions can be acknowledged during the acceptance test using the acknowledgment functions of the higher-level control.
Remedy:	Not necessary. The message is withdrawn when exiting the acceptance test mode. Note: SI: Safety Integrated SLP: Safely-Limited Position / SE: Safe software limit switches

201800	<location>DRIVE-CLiQ: Hardware/configuration error
Drive object:	All objects
Message value:	%1
Reaction:	Infeed: NONE (OFF1, OFF2) Servo: NONE (IASC/DCBRK, OFF1, OFF2, OFF3, STOP2) Hla: NONE (OFF1, OFF2, OFF3, STOP2)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	A DRIVE-CLiQ connection fault has occurred. Fault value (r0949, interpret decimal): 100 ... 107: Communication via DRIVE-CLiQ socket X100 ... X107 has not been switched to cyclic operation. The cause may be an incorrect structure or a configuration that results in an impossible bus timing. 10: Loss of the DRIVE-CLiQ connection. The cause may be, for example, that the DRIVE-CLiQ cable was withdrawn from the Control Unit or as a result of a short-circuit for motors with DRIVE-CLiQ. This fault can only be acknowledged in cyclic communication. 11: Repeated faults when detecting the connection. This fault can only be acknowledged in cyclic communication. 12: A connection was detected but the node ID exchange mechanism does not function. The reason is probably that the component is defective. This fault can only be acknowledged in cyclic communication.
Remedy:	For fault value = 100 ... 107: - ensure that the DRIVE-CLiQ components have the same firmware versions. - avoid longer topologies for short current controller sampling times. For fault value = 10: - check the DRIVE-CLiQ cables at the Control Unit. - remove any short-circuit for motors with DRIVE-CLiQ. - carry out a POWER ON. For fault value = 11: - check the electrical cabinet design and cable routing for EMC compliance For fault value = 12: - replace the component involved.

201839	<location>DRIVE-CLiQ diagnostics: cable fault to the component
Drive object:	All objects
Message value:	Component number: %1
Reaction:	NONE

Acknowledge:	NONE
Cause:	The fault counter (r9936[0...199]) to monitor the DRIVE-CLiQ connections/cables has been incremented. Alarm value (r2124, interpret decimal): Component number. Note: The component number specifies the component whose feeder cable from the direction of the Control Unit is faulted. The alarm is automatically withdrawn after 5 seconds, assuming that no other data transfer error has occurred. See also: r9936 (DRIVE-CLiQ diagnostic error counter connection)
Remedy:	- check the corresponding DRIVE-CLiQ cables. - check the electrical cabinet design and cable routing for EMC compliance

201840 <location>SMI: Component found without motor data

Drive object:	All objects
Message value:	Component number: %1
Reaction:	NONE
Acknowledge:	NONE
Cause:	An SMI/DQI without motor data has been found (e.g. SMI installed as replacement part). Alarm value (r2124, interpret decimal): Component number from target topology.
Remedy:	1. Download the SMI/DQI data (motor/encoder data) from the data backup again (p4690, p4691). 2. Carry out a POWER ON (switch-off/switch-on) for this component. Note: DQI: DRIVE-CLiQ Sensor Integrated SMI: SINAMICS Sensor Module Integrated See also: p4690 (SMI spare part component number), p4691 (SMI spare part save/download data)

201900 <location>PB/PN: Configuration telegram error

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE

Cause:	A controller attempts to establish a connection using an incorrect configuring telegram. Alarm value (r2124, interpret decimal):
1:	Connection established to more drive objects than configured in the device. The drive objects for process data exchange and their sequence are defined in p0978.
2:	Too many PZD data words for output or input to a drive object. The number of possible PZD items in a drive object is determined by the number of indices in r2050/p2051.
3:	Uneven number of bytes for input or output.
4:	Setting data for synchronization not accepted. For more information, see A01902.
211:	Unknown parameterizing block.
223:	Clock synchronization for the PZD interface set in p8815[0] is not permissible. More than one PZD interface is operated in clock synchronism.
253:	PN Shared Device: Illegal mixed configuration of PROFIsafe and PZD.
254:	PN Shared Device: Illegal double assignment of a slot/subslot.
255:	PN: Configured drive object and existing drive object do not match.
256:	PN: configured telegram cannot be set.
257:	PN Shared Device: Too many PZD data words for the output or input in the overall device.
500:	Illegal PROFIsafe configuration for the interface set in p8815[1]. More than one PZD interface is operated with PROFIsafe.
501:	PROFIsafe parameter error (e.g. F_dest).
502:	PROFIsafe telegram does not match.
503:	PROFIsafe connection is rejected as long as there is no isochronous connection (p8969).
	Additional values: Only for internal Siemens troubleshooting.

Remedy:	Check the bus configuration on the master and the slave sides. For alarm value = 1, 2: - check the list of the drive objects with process data exchange (p0978). Note: With p0978[x] = 0, all of the following drive objects in the list are excluded from the process data exchange. For alarm value = 2: - check the number of data words for output and input to a drive object. For alarm value = 211: - Ensure offline version <= online version. For alarm value = 223, 500: - check the setting in p8839 and p8815. - check for inserted but not configured CBE20. - ensure that only one PZD interface is operated in clock synchronism or with PROFIsafe. For alarm value = 255: - check configured drive objects. For alarm value = 256: - check the configured telegram. For alarm value = 257: - check the number of data words for output and input to the complete device. For alarm value = 501: - check the set PROFIsafe address (p9610). For alarm value = 502: - check the set PROFIsafe telegram (p60022, p9611).
----------------	---

201902	<location>PB/PN: clock cycle synchronous operation parameterization not permissible
---------------	--

Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	Parameterization for isochronous operation is not permissible. Alarm value (r2124, interpret decimal): 0: Bus cycle time Tdp < 0.5 ms. 1: Bus cycle time Tdp > 32 ms. 2: Bus cycle time Tdp is not an integer multiple of the current controller sampling time. 3: Instant of the actual value sensing Ti > Bus cycle time Tdp or Ti = 0. 4: Instant of the actual value sensing Ti is not an integer multiple of the current controller sampling time. 5: Instant of the setpoint acceptance To >= Bus cycle time Tdp or To = 0. 6: Instant of the setpoint acceptance To is not an integer multiple of the current controller sampling time. 7: Master application cycle time Tmapc is not an integer multiple of the speed controller sampling time. 8: Bus reserve bus cycle time Tdp - data exchange time Tdx less than two current controller sampling times. 10: Instant of the setpoint acceptance To <= data exchange time Tdx + current controller sampling time 11: Master application cycle time Tmapc > 14 x Tdp or Tmapc = 0. 12: PLL tolerance window Tpll_w > Tpll_w_max. 13: Bus cycle time Tdp is not a multiple of all basic clock cycles p0110[x]. 16: For COMM BOARD, the instant in time for the actual value sensing Ti is less than two current controller sampling times.

Remedy:

- Adapt the bus parameterization Tdp, Ti, To.
- adapt the sampling time for the current controller or speed controller.

For alarm value = 10:

- reduce Tdx by using fewer bus participants or shorter telegrams.

Note:

PB: PROFIBUS

PN: PROFINET

201903 <location>COMM INT: Receive configuration data invalid

Drive object: All objects

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The drive unit did not accept the receive configuration data.

Alarm value (r2124, interpret decimal):

Return value of the receive configuration data check.

1: Connection established to more drive objects than configured in the device. The drive objects for process data exchange and their sequence are defined in p0978.

2: Too many PZD data words for output or input to a drive object. The number of possible PZD items in a drive object is determined by the number of indices in r2050/p2051.

3: Uneven number of bytes for input or output.

4: Setting data for synchronization not accepted. For more information, see A01902.

5: Cyclic operation not active.

501: PROFIsafe parameter error (e.g. F_dest).

Additional values:

Only for internal Siemens troubleshooting.

Remedy: Check the receive configuration data.

For alarm value = 1, 2:

Check the list of the drive objects with process data exchange (p0978). With p0978[x] = 0, all of the following drive objects in the list are excluded from the process data exchange.

For alarm value = 2:

Check the number of data words for output and input to a drive object.

For alarm value = 501:

Check the set PROFIsafe address (p9610).

201910 <location>Fieldbus: setpoint timeout

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150

Message value: -

Reaction: Infeed: OFF2 (NONE, OFF1)

Servo: OFF3 (IASC/DCBRK, NONE, OFF1, OFF2, STOP2)

HLA: OFF3 (NONE, OFF1, OFF2, STOP2)

Acknowledge: IMMEDIATELY

Cause: The reception of setpoints from the fieldbus interface (onboard, PROFIBUS/PROFINET/USS) has been interrupted.

- bus connection interrupted.
- controller switched off.
- controller set into the STOP state.

See also: p2040

Remedy: Restore the bus connection and set the controller to RUN.

Note regarding PROFIBUS slave redundancy:

For operation on a Y link, it must be ensured that "DP alarm mode = DPV1" is set in the slave parameterization.

201911 <location>PB/PN: clock cycle synchronous operation clock cycle failure**Drive object:** All objects**Message value:** -**Reaction:**
Infeed: OFF1
Servo: OFF1 (OFF3)
Hla: OFF1 (OFF3)**Acknowledge:** IMMEDIATELY**Cause:** The global control telegram to synchronize the clock cycles has failed - in cyclic operation - for several DP clock cycles or has violated the time grid specified in the parameterizing telegram over several consecutive DP clock cycles (refer to the bus cycle time, Tdp and Tpllw).**Remedy:**
- check the physical bus configuration (cable, connector, terminating resistor, shielding, etc.).
- check whether communication was briefly or permanently interrupted.
- check the bus and controller for utilization level (e.g. bus cycle time Tdp was set too short).**Note:**

PB: PROFIBUS

PN: PROFINET

201912 <location>PB/PN: clock cycle synchronous operation sign-of-life failure**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** -**Reaction:**
Infeed: OFF1
Servo: OFF1 (OFF3)
Hla: OFF1 (OFF3)**Acknowledge:** IMMEDIATELY**Cause:** The maximum permissible number of errors in the controller sign-of-life (clock synchronous operation) has been exceeded in cyclic operation.**Remedy:**
- physically check the bus (cables, connectors, terminating resistor, shielding, etc.).
- correct the interconnection of the controller sign-of-life (p2045).
- check whether the controller correctly sends the sign-of-life (e.g. create a trace with STW2.12 ... STW2.15 and trigger signal ZSW1.3).
- check the permissible telegram failure rate (p0925).
- check the bus and controller for utilization level (e.g. bus cycle time Tdp was set too short).**Note:**

PB: PROFIBUS

PN: PROFINET

201913 <location>COMM INT: Monitoring time sign-of-life expired**Drive object:** All objects**Message value:** -**Reaction:**
Infeed: OFF1 (NONE, OFF2)
Servo: OFF1 (NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)**Acknowledge:** IMMEDIATELY**Cause:** The monitoring time for the sign-of-life counter has expired.

The connection between the drive and the higher-level control (SIMOTION, SINUMERIK) has been interrupted for the following reasons:

- the control was reset.
- the data transfer to the control was interrupted.

Remedy:
- wait until the control has re-booted.
- restore data transfer to the control.

201914	<location>COMM INT: Monitoring time configuration expired
Drive object:	All objects
Message value:	%1
Reaction:	Infeed: NONE (OFF1, OFF2) Servo: NONE (OFF1, OFF2, OFF3) Hla: NONE (OFF1, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	The monitoring time for the configuration has expired. Fault value (r0949, interpret decimal): 0: The transfer time of the send configuration data has been exceeded. 1: The transfer time of the receive configuration data has been exceeded.
Remedy:	- acknowledge faults that are present. - carry out a POWER ON (switch-off/switch-on) for all components. - upgrade firmware to later version. - contact Technical Support.
201915	<location>PB/PN: clock cycle synchronous operation sign-of-life failure drive object 1
Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	Group display for problems with the sign-of-life of the master (isochronous operation) on the drive object 1 (Control Unit). For central measurements, synchronism with the central master is lost.
Remedy:	Note: PB: PROFIBUS PN: PROFINET
201920	<location>PROFIBUS: Interruption cyclic connection
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The cyclic connection to the PROFIBUS master is interrupted.
Remedy:	Establish the PROFIBUS connection and activate the PROFIBUS master in the cyclic mode. Note: If there is no communication to a higher-level control system, then p2030 should be set = 0 to suppress this message.
201921	<location>PROFIBUS: Receive setpoints after To
Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	Output data of PROFIBUS master (setpoints) received at the incorrect instant in time within the PROFIBUS clock cycle.
Remedy:	- check bus configuration. - check parameters for clock cycle synchronization (ensure To > Tdx). Note: To: Time of setpoint acceptance Tdx: Data exchange time

201930	<location>PB/PN: current controller sampling time clock cycle synch. not equal
Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The current controller sampling time of all drives must be set the same for the clock cycle synchronous operation. Alarm value (r2124, interpret decimal): Number of the drive object with different current controller sampling time.
Remedy:	Set current controller sampling time to identical values (p0115[0]). Note: PB: PROFIBUS PN: PROFINET See also: p0115

201931	<location>PB/PN: speed controller sampling time clock cycle synch. not equal
Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The speed controller sampling time of all drives must be set the same for the clock cycle synchronous operation. Alarm value (r2124, interpret decimal): Number of the drive object with the different speed controller sampling time.
Remedy:	Set the speed controller sampling times to identical values (p0115[1]). Note: PB: PROFIBUS PN: PROFINET See also: p0115

201932	<location>PB/PN: clock cycle synchronization missing for DSC
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	There is no clock synchronization or clock synchronous sign of life and DSC is selected. Note: DSC: Dynamic Servo Control See also: p0922, p1190, p1191
Remedy:	Set clock synchronization across the bus configuration and transfer clock synchronous sign-of-life. See also: r2064 (PB/PN diagnostics clock cycle synchronism)

201940	<location>PB/PN: clock cycle synchronism not reached
Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE

Cause:	The bus is in the data exchange state and clock synchronous operation has been selected using the parameterizing telegram. It was not possible to synchronize to the clock cycle specified by the master. - the master does not send a clock synchronous global control telegram although clock synchronous operation was selected when configuring the bus. - the master is using another clock synchronous DP clock cycle than was transferred to the slave in the parameterizing telegram. - at least one drive object has a pulse enable (also not controlled from PROFIBUS/PROFINET).
Remedy:	- check the master application and bus configuration. - check the consistency between the clock cycle input when configuring the slave and clock cycle setting at the master. - check that no drive object has a pulse enable. Only enable the pulses after synchronizing the PROFIBUS/PROFINET drives. Note: PB: PROFIBUS PN: PROFINET

201941 <location>PB/PN: clock cycle signal missing when establishing bus communication

Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The bus is in the data exchange state and clock synchronous operation has been selected using the parameterizing telegram. The global control telegram for synchronization is not being received.
Remedy:	Check the master application and bus configuration. Note: PB: PROFIBUS PN: PROFINET

201943 <location>PB/PN: clock cycle signal error when establishing bus communication

Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The bus is in the data exchange state and clock synchronous operation has been selected using the parameterizing telegram. The global control telegram for synchronization is being irregularly received. - the master is sending an irregular global control telegram. - the master is using another clock synchronous DP clock cycle than was transferred to the slave in the parameterizing telegram.
Remedy:	- check the master application and bus configuration. - check the consistency between the clock cycle input when configuring the slave and clock cycle setting at the master. Note: PB: PROFIBUS PN: PROFINET

201944 <location>PB/PN: sign-of-life synchronism not reached

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The bus is in the data exchange state and clock synchronous operation has been selected using the parameterizing telegram. Synchronization with the master sign-of-life (STW2.12 ... STW2.15) could not be completed because the sign-of-life is changing differently to how it was configured in the Tmapc time grid.

Remedy:

- ensure that the master correctly increments the sign-of-life in the master application clock cycle Tmapc.
- correct the interconnection of the master sign-of-life (p2045).

Note:
PB: PROFIBUS
PN: PROFINET

201945 <location>PROFIBUS: Connection to the Publisher failed

Drive object: All objects
Message value: Fault cause: %1 bin
Reaction: NONE
Acknowledge: NONE
Cause: For PROFIBUS peer-to-peer data transfer, the connection to at least one Publisher has failed.
Alarm value (r2124, interpret binary):
Bit 0 = 1: Publisher with address in r2077[0], connection failed.
...
Bit 15 = 1: Publisher with address in r2077[15], connection failed.

Remedy:

- check the PROFIBUS cables.
- carry out a first commissioning of the Publisher that has the failed connection.

201946 <location>PROFIBUS: Connection to the Publisher aborted

Drive object: All objects
Message value: Fault cause: %1 bin
Reaction: Infeed: OFF1 (NONE, OFF2)
Servo: OFF1 (NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge: IMMEDIATELY (POWER ON)
Cause: At this drive object, the connection to at least one Publisher for PROFIBUS peer-to-peer data transfer in cyclic operation has been aborted.
Fault value (r0949, interpret binary):
Bit 0 = 1: Publisher with address in r2077[0], connection aborted.
...
Bit 15 = 1: Publisher with address in r2077[15], connection aborted.

Remedy:

- check the PROFIBUS cables.
- check the state of the Publisher that has the aborted connection.

201950 <location>PB/PN: clock cycle synchronous operation synchronization unsuccessful

Drive object: All objects
Message value: -
Reaction: OFF1 (NONE)
Acknowledge: IMMEDIATELY (POWER ON)
Cause: Synchronization of the internal clock cycle to the global control telegram has failed. The internal clock cycle exhibits an unexpected shift.

Remedy: Only for internal Siemens troubleshooting.

Note:
PB: PROFIBUS
PN: PROFINET

201951 <location>CU SYNC: Synchronization application clock cycle missing

Drive object: All objects
Message value: %1

Reaction:	OFF2 (NONE)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	If DRIVE-CLiQ components with different application clock cycle are operated on a DRIVE-CLiQ port, this requires synchronization with the Control Unit. This synchronization routine was unsuccessful. Fault value (r0949, interpret decimal): Only for internal Siemens troubleshooting.
Remedy:	- carry out a POWER ON (switch-off/switch-on) for all components. - upgrade the software of the DRIVE-CLiQ components. - upgrade the Control Unit software. Note: If a Controller Extension is being used (e.g. CX32, NX10), then the following applies: Check whether the Controller Extension is issuing error messages, and if required, remove these.

201952 <location>CU DRIVE-CLiQ: Synchronization of component not supported

Drive object:	All objects
Message value:	%1
Reaction:	OFF2 (NONE)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The existing system configuration requires that the connected DRIVE-CLiQ components support the synchronization between the basic clock cycle, DRIVE-CLiQ clock cycle and the application clock cycle. However, not all DRIVE-CLiQ components have this functionality. Fault value (r0949, interpret decimal): Component number of the first faulty DRIVE-CLiQ component.
Remedy:	Upgrade the firmware of the component specified in the fault value. Note: If required, also upgrade additional components in the DRIVE-CLiQ line.

201953 <location>CU SYNC: Synchronization not completed

Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	After the drive system is switched on, the synchronization between the basic clock cycle, DRIVE-CLiQ clock cycle and application clock cycle was started but was not completed within the selected time tolerance. Alarm value (r2124, interpret decimal): Only for internal Siemens troubleshooting.
Remedy:	Carry out a POWER ON (switch-off/switch-on) for all components. If the error occurs after the drive sampling times were changed, and if a Terminal Module 31 (TM31) is being used, the sampling times (p0115, p4099) should be set as integer multiples to the drive clock cycles (p0115).

201954 <location>CU DRIVE-CLiQ: Synchronization unsuccessful

Drive object:	All objects
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	Synchronization between the basic clock cycle, DRIVE-CLiQ clock cycle and application clock cycle was started and was not able to be successfully completed (e.g. after switch-on). Fault value (r0949, interpret decimal): Only for internal Siemens troubleshooting.

- Remedy:**
1. Remove the cause of a possible DRIVE-CLiQ fault.
 2. Initiate a new synchronization, e.g. as follows:
 - remove the PROFIBUS master and re-insert again.
 - restart the PROFIBUS master.
 - switch off the Control Unit and switch on again.
 - carry out a Control Unit hardware reset (RESET button, p0972).
 - carry out a parameter reset and download the saved parameters (p0009 = 30, p0976 = 2, 3).

201955 <location>CU DRIVE-CLiQ: Synchronization DO not completed

- Drive object:** All objects
- Message value:** %1
- Reaction:** NONE
- Acknowledge:** NONE
- Cause:** After the drive system is switched on, the synchronization between the basic clock cycle, DRIVE-CLiQ clock cycle and application clock cycle was started but was not completed within the selected time tolerance.
Alarm value (r2124, interpret decimal):
Only for internal Siemens troubleshooting.
- Remedy:** Carry out a POWER ON (switch-off/switch-on) for all components of the DO.

201970 <location>CBExx: cyclic connection interrupted

- Drive object:** A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
- Message value:** %1
- Reaction:** NONE
- Acknowledge:** NONE
- Cause:** The cyclic connection to the PROFINET controller is interrupted.
- Remedy:** Establish the PROFINET connection and activate the PROFINET controller in the cyclic mode.

201971 <location>CBExx: maximum number of controllers exceeded

- Drive object:** A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
- Message value:** Info 1: %1, Info 2: %2
- Reaction:** NONE
- Acknowledge:** NONE
- Cause:** A controller attempts to establish a connection to the drive, and as a consequence exceeds the permitted number of PROFINET connections.
The alarm is automatically withdrawn after approx. 30 seconds.
Alarm value (r2124, interpret hexadecimal):
yyyyxxxx hex: yyyy = info. 1, xxxx = info. 2
Info 1 = 0: number of RT connections exceeded
Info 1 > 0: number of IRT connections exceeded
Info 2: permitted number of connections
- Remedy:** Check the configuration of the PROFINET controllers.

201977 <location>CBE41: overtemperature alarm

- Drive object:** A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
- Message value:** -
- Reaction:** NONE
- Acknowledge:** NONE

Cause: The alarm threshold for the overtemperature of the Communication Board Ethernet 41 (CBE41) was reached.

Remedy:

- check the air intake for the Control Unit.
- check the Control Unit fan.

Note:

The alarm is automatically withdrawn once the limit value has been fallen below.

201978 <location>CBE41: overtemperature fault

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction:

Infeed: OFF2 (OFF1)

Servo: OFF3 (IASC/DCBRK, NONE, OFF1, OFF2, STOP2)

Hla: OFF3 (NONE, OFF1, OFF2, STOP2)

Acknowledge: POWER ON

Cause: The shutdown threshold for the overtemperature of the Communication Board Ethernet 41 (CBE41) was reached.

Note:

This fault results in the component being shut down.

As a consequence, communication via CBE41 is no longer possible.

Remedy:

- Switch-off the Control Unit and after a wait time, switch-on again.
- check the air intake for the Control Unit.
- check the Control Unit fan.
- Replace the component if the fault occurs again.

201979 <location>CBExx: internal error for cyclic data transfer

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The cyclic actual values and/or setpoints were not transferred within the specified times.

Alarm value (r2124, interpret hexadecimal):

Only for internal Siemens troubleshooting.

Remedy: Correctly set T_io_input or T_io_output.

201980 <location>PN: cyclic connection interrupted

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The cyclic connection to the PROFINET controller is interrupted.

Remedy: Establish the PROFINET connection and activate the PROFINET controller in the cyclic mode.

201981 <location>PN: Maximum number of controllers exceeded

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: Info 1: %1, Info 2: %2

Reaction: NONE

Acknowledge: NONE

Cause:	A controller attempts to establish a connection to the drive, and as a consequence exceeds the permitted number of PROFINET connections. The alarm is automatically withdrawn after approx. 30 seconds. Alarm value (r2124, interpret hexadecimal): yyyyxxxx hex: yyyy = info. 1, xxxx = info. 2 Info 1 = 0: number of RT connections exceeded Info 1 > 0: number of IRT connections exceeded Info 2: permitted number of connections
Remedy:	Check the configuration of the PROFINET controllers.

201982 <location>PN: second controller missing

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	Connections to two PROFINET controllers are expected. However, only the connection to a PROFINET controller is available or the controller is in the STOP state. - system redundancy is activated.
Remedy:	Check the PROFINET controller.

201983 <location>PN: system redundancy switchover running

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The "PROFINET system redundancy" function is configured and the connection between the primary control and drive device is interrupted. The backup controller assumes control of the drive device.
Remedy:	Not necessary. This alarm is automatically withdrawn after switchover has been completed.

201989 <location>PN: internal cyclic data transfer error

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The cyclic actual values and/or setpoints were not transferred within the specified times. Alarm value (r2124, interpret hexadecimal): Only for internal Siemens troubleshooting.
Remedy:	Correctly set T_io_input or T_io_output.

201990 <location>USS: PZD configuration error

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE

Cause:	The configuration of the process data (PZD) for the USS protocol is incorrect. Alarm value (r2124, interpret decimal): 2: PZD amount (p2022) too great for the first drive object (p978[0]). The number of possible PZD items in a drive object is determined by the number of indices in r2050/p2051.
Remedy:	For alarm value = 2: Check the amount of USS PZD (p2022) and the maximum PZD amount (r2050/p2051) for the first drive object (p0978[0]).

202000 <location>Function generator: Start not possible

Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The function generator has already been started.
Remedy:	Stop the function generator and restart again if necessary. Note: The alarm is reset as follows: - remove the cause of this alarm. - restart the function generator. See also: p4800 (Function generator control)

202005 <location>Function generator: Drive does not exist

Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The drive object specified for connection does not exist. See also: p4815 (Function generator drive number)
Remedy:	Use the existing drive object with the corresponding number. Note: The alarm is reset as follows: - remove the cause of this alarm. - restart the function generator. See also: p4815 (Function generator drive number)

202006 <location>Function generator: No drive specified for connection

Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	No drive specified for connection in p4815. See also: p4815 (Function generator drive number)
Remedy:	At least one drive to be connected must be specified in p4815. Note: The alarm is reset as follows: - remove the cause of this alarm. - restart the function generator. See also: p4815 (Function generator drive number)

202007 <location>Function generator: Drive not SERVO / VECTOR / DC_CTRL

Drive object:	All objects
----------------------	-------------

Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The drive object specified for connection is not a SERVO / VECTOR or DC_CTRL. See also: p4815 (Function generator drive number)
Remedy:	Use a SERVO / VECTOR / DC_CTRL drive object with the corresponding number. Note: The alarm is reset as follows: - remove the cause of this alarm. - restart the function generator.

202008 <location>Function generator: Drive specified a multiple number of times

Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The drive object specified for connection is already specified. Alarm value (r2124, interpret decimal): Drive object number of the drive object that is specified a multiple number of times.
Remedy:	Specify a different drive object. Note: The alarm is reset as follows: - remove the cause of this alarm. - restart the function generator.

202009 <location>Function generator: Illegal mode

Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The set operating mode (p1300) of the drive object is not permissible when using the function generator. Alarm value (r2124, interpret decimal): Number of the drive object involved.
Remedy:	Change the operating mode for this drive object to p1300 = 20 (encoderless speed control) or p1300 = 21 (speed control with encoder). Note: The alarm is reset as follows: - remove the cause of this alarm. - restart the function generator.

202010 <location>Function generator: Speed setpoint from the drive is not zero

Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The speed setpoint of a drive selected for connection is greater than the value for the standstill detection set using p1226.

Remedy: For all of the drives specified for connection, set the speed setpoints to zero.

Note:

The alarm is reset as follows:

- remove the cause of this alarm.
- restart the function generator.

202011 <location>Function generator: The actual drive speed is not zero

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, CU_NX_828, CU_NX_COMBI, HLA_828, HUB, S_INF_828, S_INF_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The speed actual value of a drive selected for connection is greater than the value for the standstill detection set using p1226.

Remedy: Set the relevant drives to zero speed before starting the function generator.

Note:

The alarm is reset as follows:

- remove the cause of this alarm.
- restart the function generator.

202015 <location>Function generator: Drive enable signals missing

Drive object: All objects

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The master control and/or enable signals are missing to connect to the specified drive.
See also: p4815 (Function generator drive number)

Remedy: Fetch the master control to the specified drive object and set all enable signals.

Note:

The alarm is reset as follows:

- remove the cause of this alarm.
- restart the function generator.

202016 <location>Function generator: Magnetizing running

Drive object: All objects

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: Magnetizing has not yet been completed on a drive object specified for connection.
Alarm value (r2124, interpret decimal):
Number of the drive object involved.
See also: p4815 (Function generator drive number)

Remedy: Wait for magnetizing of the motor (r0056.4).

Note:

The alarm is reset as follows:

- restart the function generator.
- See also: r0056 (Status word, closed-loop control)

202020 <location>Function generator: Parameter cannot be changed

Drive object: All objects

Message value: -

Reaction:	NONE
Acknowledge:	NONE
Cause:	This parameter setting cannot be changed when the function generator is active (p4800 = 1). See also: p4810, p4812, p4813, p4815, p4820, p4821, p4822, p4823, p4824, p4825, p4826, p4827, p4828, p4829
Remedy:	- stop the function generator before parameterizing (p4800 = 0). - if required, start the function generator (p4800 = 1). Note: The alarm is reset as follows: - remove the cause of this alarm. - restart the function generator. See also: p4800 (Function generator control)

202025 <location>Function generator: Period too short

Drive object:	A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, CU_NX_828, CU_NX_COMBI, HLA_828, HUB, S_INF_828, S_INF_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The value for the period is too short. See also: p4821 (Function generator period)
Remedy:	Check and adapt the value for the period. Note: The alarm is reset as follows: - remove the cause of this alarm. - restart the function generator. See also: p4821 (Function generator period)

202026 <location>Function generator: Pulse width too high

Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The selected pulse width is too high. The pulse width must be less than the period duration. See also: p4822 (Function generator pulse width)
Remedy:	Reduce pulse width. Note: The alarm is reset as follows: - remove the cause of this alarm. - restart the function generator. See also: p4821 (Function generator period), p4822 (Function generator pulse width)

202030 <location>Function generator: Physical address equals zero

Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The specified physical address is zero. See also: p4812 (Function generator physical address)

Remedy: Set a physical address with a value other than zero.
Note:
 The alarm is reset as follows:
 - remove the cause of this alarm.
 - restart the function generator.
 See also: p4812 (Function generator physical address)

202040 <location>Function generator: Illegal value for offset

Drive object: All objects
Message value: -
Reaction: NONE
Acknowledge: NONE
Cause: The value for the offset is higher than the value for the upper limit or lower than the value for the lower limit.
 See also: p4826 (Function generator offset)
Remedy: Adjust the offset value accordingly.
Note:
 The alarm is reset as follows:
 - remove the cause of this alarm.
 - restart the function generator.
 See also: p4826 (Function generator offset), p4828 (Function generator lower limit), p4829 (Function generator upper limit)

202041 <location>Function generator: Illegal value for bandwidth

Drive object: All objects
Message value: -
Reaction: NONE
Acknowledge: NONE
Cause: The bandwidth referred to the time slice clock cycle of the function generator has either been set too low or too high.
 Depending on the time slice clock cycle, the bandwidth is defined as follows:

$$\text{Bandwidth_max} = 1 / (2 \times \text{time slice clock cycle})$$

$$\text{Bandwidth_min} = \text{Bandwidth_max} / 100000$$
Example:
 Assumption: p4830 = 125 µs
 --> $\text{Bandwidth_max} = 1 / (2 \times 125 \mu\text{s}) = 4000 \text{ Hz}$
 --> $\text{Bandwidth_min} = 4000 \text{ Hz} / 100000 = 0.04 \text{ Hz}$
Note:
 p4823: Function generator bandwidth
 p4830: Function generator time slice clock cycle
 See also: p4823 (Function generator bandwidth), p4830 (Function generator time slice cycle)
Remedy: Check the value for the bandwidth and adapt accordingly.
Note:
 The alarm is reset as follows:
 - remove the cause of this alarm.
 - restart the function generator.

202047 <location>Function generator: Time slice clock cycle invalid

Drive object: All objects
Message value: -
Reaction: NONE
Acknowledge: NONE

Cause: The time slice clock cycle selected does not match any of the existing time slices.
See also: p4830 (Function generator time slice cycle)

Remedy: Enter an existing time slice clock cycle. The existing time slices can be read out via p7901.

Note:
The alarm is reset as follows:

- remove the cause of this alarm.
- restart the function generator.

See also: r7901 (Sampling times)

202050 <location>Trace: Start not possible

Drive object: All objects

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The trace has already been started.
See also: p4700 (Trace control)

Remedy: Stop the trace and, if necessary, start again.

202051 <location>Trace: recording not possible as a result of know-how protection

Drive object: All objects

Message value: initiating recorder: %1, parameter %2

Reaction: NONE

Acknowledge: NONE

Cause: TRACE recording is not possible as at least one signal or trigger signal being used is under know-how protection.
Alarm value (r2124, interpret hexadecimal):
bbbbaaaa hex:
aaaa = 1: recorder 0
aaaa = 2: recorder 1
aaaa = 3: recorders 0 and 1
bbbb = parameter number (hexadecimal), that was not able to be written to.
See also: p4700, p4711, p4730, p4731, p4732, p4733, p4734, p4735, p4736, p4737

Remedy:

- Temporarily activate or deactivate know-how protection (p7766).
- include the signal in the OEM exception list (p7763, p7764).
- Where relevant do not record the signal.

See also: p7763 (KHP OEM exception list number of indices for p7764), p7764 (KHP OEM exception list)

202055 <location>Trace: Recording time too short

Drive object: All objects

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The trace duration is too short.
The minimum is twice the value of the trace clock cycle.
See also: p4721 (Trace recording time)

Remedy: Check the selected recording time and, if necessary, adjust.

202056 <location>Trace: Recording cycle too short

Drive object: All objects

Message value: -

Reaction: NONE

Acknowledge:	NONE
Cause:	The selected recording cycle is shorter than the selected basic clock cycle 0 (p0110[0]). See also: p4720 (Trace recording cycle)
Remedy:	Increase the value for the trace cycle.

202057 <location>Trace: Time slice clock cycle invalid

Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The time slice clock cycle selected does not match any of the existing time slices. See also: p4723 (Trace time slice cycle)
Remedy:	Enter an existing time slice clock cycle. The existing time slices can be read out via p7901. See also: r7901 (Sampling times)

202058 <location>Trace: Time slice clock cycle for endless trace not valid

Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The selected time slice clock cycle cannot be used for the endless trace See also: p4723 (Trace time slice cycle)
Remedy:	Enter the clock cycle of an existing time slice with a cycle time ≥ 2 ms for up to 4 recording channels or ≥ 4 ms from 5 recording channels per trace. The existing time slices can be read out via p7901. See also: r7901 (Sampling times)

202059 <location>Trace: Time slice clock cycle for 2 x 8 recording channels not valid

Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The selected time slice clock cycle cannot be used for more than 4 recording channels. See also: p4723 (Trace time slice cycle)
Remedy:	Enter the clock cycle of an existing time slice with a cycle time ≥ 4 ms or reduce the number of recording channels to 4 per trace. The existing time slices can be read out via p7901. See also: r7901 (Sampling times)

202060 <location>Trace: Signal to be traced missing

Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	- a signal to be traced was not specified. - the specified signals are not valid. See also: p4730 (Trace record signal 0), p4731 (Trace record signal 1), p4732 (Trace record signal 2), p4733 (Trace record signal 3)
Remedy:	- specify the signal to be traced. - check whether the relevant signal can be traced.

202061 <location>Trace: Invalid signal

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, CU_NX_828, CU_NX_COMBI, HLA_828, HUB, S_INF_828, S_INF_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: - the specified signal does not exist.
- the specified signal can no longer be traced (recorded).
See also: p4730 (Trace record signal 0), p4731 (Trace record signal 1), p4732 (Trace record signal 2), p4733 (Trace record signal 3)

Remedy: - specify the signal to be traced.
- check whether the relevant signal can be traced.

202062 <location>Trace: Invalid trigger signal

Drive object: All objects

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: - a trigger signal was not specified.
- the specified signal does not exist.
- the specified signal is not a fixed-point signal.
- the specified signal cannot be used as a trigger signal for the trace.
See also: p4711 (Trace trigger signal)

Remedy: Specify a valid trigger signal.

202063 <location>Trace: Invalid data type

Drive object: All objects

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The specified data type to select a signal using a physical address is invalid.
See also: p4711 (Trace trigger signal), p4730 (Trace record signal 0), p4731 (Trace record signal 1), p4732 (Trace record signal 2), p4733 (Trace record signal 3)

Remedy: Use a valid data type.

202070 <location>Trace: Parameter cannot be changed

Drive object: All objects

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The trace parameter settings cannot be changed when the trace is active.
See also: p4700, p4710, p4711, p4712, p4713, p4714, p4715, p4716, p4720, p4721, p4722, p4730, p4731, p4732, p4733, p4780, p4781, p4782, p4783, p4789, p4795

Remedy: - stop the trace before parameterization.
- if required, start the trace.

202075 <location>Trace: Pretrigger time too long

Drive object: All objects

Message value: -

Reaction: NONE

Acknowledge:	NONE
Cause:	The selected pretrigger time must be shorter than the trace time. See also: p4721 (Trace recording time), p4722 (Trace trigger delay)
Remedy:	Check the pretrigger time setting and change if necessary.

202080	<location>Trace: Parameterization deleted due to unit changeover
Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	The trace parameterization in the drive unit was deleted due to a unit changeover or a change in the reference parameters.
Remedy:	Restart trace.

202085	<location>Message function: Parameterization error
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	parameter: %1, index:%2
Reaction:	NONE
Acknowledge:	NONE
Cause:	A parameterization error was identified when starting the variable message function. Alarm value (r2124, interpret decimal): yyxxxx dec: yy = index, xxxx = parameter See also: p3290, p3291, p3292, p3293, r3294, p3295, p3296, p3297, p3298, p3299
Remedy:	Correct the parameter and restart. Note: The alarm is automatically withdrawn when stopping, or when successfully starting the variable message function.

202095	<location>MTrace 0: multiple trace cannot be activated
Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The following functions or settings are not permissible in conjunction with a multiple trace (trace recorder 0): - measuring function - long-time trace - trigger condition "immediate recording start" (IMMEDIATE) - trigger condition "start with function generator" (FG_START)
Remedy:	- if required, deactivate the multiple trace (p4840[0] = 0). - deactivate function or setting that is not permissible

202096	<location>MTrace 0: cannot be saved
Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE

Cause:	It is not possible to save the measurement results of a multiple trace on the memory card (trace recorder 0). A multiple trace is not started or is canceled. Alarm value (r2124, interpret decimal): 1: Memory card cannot be accessed. - card is not inserted or is blocked by a mounted USB drive. 3: data save operation too slow. - a second trace has been completed before the measurement results of the first trace were able to be saved. - writing the measurement result files to the card is blocked by the parameter save. 4: Data save operation canceled. - for instance, the file required for the data save operation was not able to be found.
Remedy:	- insert or remove the memory card. - use a larger memory card. - configure a longer trace time or use an endless trace. - avoid saving parameters while a multiple trace is running. - check whether other functions are presently accessing measurement result files.

202097 <location>MTrace 1: multiple trace cannot be activated

Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The following functions or settings are not permissible in conjunction with a multiple trace (trace recorder 1): - measuring function - long-time trace - trigger condition "immediate recording start" (IMMEDIATE) - trigger condition "start with function generator" (FG_START)
Remedy:	- if required, deactivate the multiple trace (p4840[1] = 0). - deactivate function or setting that is not permissible

202098 <location>MTrace 1: cannot be saved

Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	It is not possible to save the measurement results of a multiple trace on the memory card (trace recorder 1). A multiple trace is not started or is canceled. Alarm value (r2124, interpret decimal): 1: Memory card cannot be accessed. - card is not inserted or is blocked by a mounted USB drive. 3: data save operation too slow. - a second trace has been completed before the measurement results of the first trace were able to be saved. - writing the measurement result files to the card is blocked by the parameter save. 4: Data save operation canceled. - for instance, the file required for the data save operation was not able to be found.
Remedy:	- insert or remove the memory card. - use a larger memory card. - configure a longer trace time or use an endless trace. - avoid saving parameters while a multiple trace is running. - check whether other functions are presently accessing measurement result files.

202099	<location>Trace: Insufficient Control Unit memory
Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The memory space still available on the Control Unit is no longer sufficient for the trace function.
Remedy:	Reduce the memory required, e.g. as follows: - reduce the trace time. - increase the trace clock cycle. - reduce the number of signals to be traced. See also: r4708 (Trace memory space required), r4799 (Trace memory location free)
202100	<location>Drive: Computing dead time current controller too short
Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The value in p0118 produces a dead time of one clock cycle because it is prior to setpoint availability. Possible causes: - a parameter backup with a version higher than 4.3 was loaded to a version less than or equal to 4.3. - the system properties after replacing a component no longer match the parameter assignment. Alarm value (r2134, floating point): Minimum value for p0118 where dead time no longer occurs.
Remedy:	- set p0118 to zero. - set p0118 to a value greater than or equal to the alarm value (for p1810.11 = 1) - set p0117 (from the device) to an automatic setting (p0117 = 1). - check the firmware versions of the components involved. See also: p0117 (Current controller computing dead time mode), p0118 (Current controller computing dead time)
202150	<location>TEC: Technology Extension cannot be loaded
Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The system was not able to load a Technology Extension. Alarm value (r2124, interpret hexadecimal): 10 hex (16 dec): The interface version in the DCB user library is not compatible to the DCC standard library that has been loaded. 12 hex (18 dec): A technology package was not able to be downloaded to a Control Unit because the warm restart necessary was not able to be performed. Only for internal Siemens troubleshooting.

Remedy:

- carry out a warm restart (p0009 = 30, p0976 = 2, 3).
- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade firmware to later version.
- contact Technical Support.

For alarm value = 10 hex (16 dec):
Load a compatible DCB user library (compatible to the interface of the DCC standard library).
For alarm value = 12 hex (18 dec):
Carry out a POWER ON (switch-off/switch-on) for all components.

Note:
DCB: Drive Control Block
DCC: Drive Control Chart
TEC: Technology Extension
See also: r4950, r4955, p4956, r4957

202151 <location>TEC: internal software error

Drive object: All objects
Message value: %1
Reaction: Infeed: OFF2 (NONE, OFF1)
Servo: OFF2 (NONE, OFF1, OFF3)
Hla: OFF2 (NONE, OFF1, OFF3)
Acknowledge: IMMEDIATELY (POWER ON)
Cause: An internal software error has occurred within a Technology Extension.
Fault value (r0949, interpret hexadecimal):
Only for internal Siemens troubleshooting.
Remedy:

- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade firmware to later version.
- contact Technical Support.
- replace the Control Unit.

Note:
TEC: Technology Extension
See also: r4950, r4955, p4956, r4957

202152 <location>TEC: insufficient memory

Drive object: All objects
Message value: %1
Reaction: OFF1
Acknowledge: IMMEDIATELY (POWER ON)
Cause: Too many functions have been configured on this Control Unit (e.g. too many drives, function modules, data sets, Technology Extensions, blocks, etc).
Fault value (r0949, interpret decimal):
Only for internal Siemens troubleshooting.
Remedy:

- change the configuration on this Control Unit (e.g. fewer drives, function modules, data sets, Technology Extensions, blocks, etc).
- use an additional Control Unit.

Note:
TEC: Technology Extension

202153 <location>TEC: technology function does not exist

Drive object: All objects
Message value: -
Reaction: NONE

Acknowledge:	IMMEDIATELY
Cause:	A technology function (e.g. Technology Extension, DCB library) does not exist on the drive device. When configuring, a technology function is activated, which does not exist on the drive device. This can occur when downloading a project or when powering up.
Remedy:	- load the required technology function to the drive device. - if required, deactivate the technology function not required in the configuration.
	Note: DCB: Drive Control Block TEC: Technology Extension

203000	<location>NVRAM fault on action
Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	A fault occurred during execution of action p7770 = 1 or 2 for the NVRAM data. Fault value (r0949, interpret hexadecimal): yyxx hex: yy = fault cause, xx = application ID yy = 1: The action p7770 = 1 is not supported by this version if Drive Control Chart (DCC) is activated for the drive object concerned. yy = 2: The data length of the specified application is not the same in the NVRAM and the backup. yy = 3: The data checksum in p7774 is not correct. yy = 4: No data available to load. See also: p7770 (NVRAM action)
Remedy:	- Perform the remedy according to the results of the troubleshooting. - if necessary, start the action again.

203001	<location>NVRAM checksum incorrect
Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	A checksum error occurred when evaluating the non-volatile data (NVRAM) on the Control Unit. The NVRAM data affected was deleted.
Remedy:	Carry out a POWER ON (switch-off/switch-on) for all components.

203500	<location>TM: Initialization
Drive object:	All objects
Message value:	%1
Reaction:	OFF1 (OFF2)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	When initializing the Terminal Modules, the terminals of the Control Unit or the Terminal Board 30, an internal software error has occurred. Fault value (r0949, interpret decimal): yxxx dex y = Only for internal Siemens troubleshooting xxx = component number (p0151)

Remedy:

- switch-off/switch-on the power supply for the Control Unit.
- check the DRIVE-CLiQ connection.
- if required, replace the Terminal Module.

The Terminal Module should be directly connected to a DRIVE-CLiQ socket of the Control Unit.
If the fault occurs again, replace the Terminal Module.

203501 <location>TM: Sampling time change

Drive object: All objects
Message value: -
Reaction: NONE
Acknowledge: NONE
Cause: The sampling times of the inputs/outputs were changed.
This change only becomes valid after the next boot.
Remedy: Carry out a POWER ON.

203505 <location>Analog input wire breakage

Drive object: A_INF_828, B_INF_828, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value: %1
Reaction: OFF1 (NONE, OFF2)
Acknowledge: IMMEDIATELY (POWER ON)
Cause: The wire-break monitoring for an analog input has responded.
Remedy: Check the wiring for interruptions.

203505 <location>Analog input wire breakage

Drive object: CU_LINK, CU_NX_828, CU_NX_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value: %1
Reaction: NONE
Acknowledge: IMMEDIATELY (POWER ON)
Cause: The wire-break monitoring for an analog input has responded.
The input value of the analog input has exceeded the threshold value parameterized in p4061[x].
Index x = 0: Analog input 0 (X521.1/X521.2)
Index x = 1: Analog input 1 (X521.3/X521.4)
Fault value (r0949, interpret decimal):
yxxx dec
y = analog input (0 = analog input 0 (AI 0), 1 = analog input 1 (AI 1))
xxx = component number (p0151)
Note:
For the following analog input type, the wire breakage monitoring is active:
p4056[x] = 3 (unipolar current input monitored (+4 ... +20 mA))
Remedy:

- check the wiring for interruptions.
- check the magnitude of the injected current - it is possible that the infed signal is too low.
- check the load resistor (250 Ohm).

Note:
The input current measured by the Terminal Module can be read out from r4052[x].
For p4056[x] = 3 (unipolar current input monitored (+4 ... +20 mA)) the following applies:
A current less than 4 mA is not displayed in r4052[x] - but instead r4052[x] = 4 mA is output.

203505 <location>CU: Analog input wire breakage

Drive object: CU_I_828, CU_I_COMBI
Message value: %1

Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The wire-break monitoring for an analog input has responded. The input value of the analog input has exceeded the threshold value parameterized in p0761[0]. p0756[0]: analog input 0 (X131.7/X131.8) Fault value (r0949, interpret decimal): Note: For the following analog input type, the wire breakage monitoring is active: p0756[0] = 3 (4 ... 20 mA with monitoring)
Remedy:	- check the wiring to the signal source for interruptions. - check the magnitude of the injected current - it is possible that the infed signal is too low. - check the load resistor (250 Ohm). Note: The input current measured by the analog input can be read in r0752[0]. For p756[0] = 3 (unipolar current input monitored (+4 ... +20 mA)) the following applies: A current less than 4 mA is not displayed in r752[0] - but instead r752[0] = 4 mA is output.

203506	<location>24 V power supply missing
Drive object:	A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The 24 V power supply for the digital outputs (X124) is missing.
Remedy:	Check the terminals for the power supply voltage (X124, L1+, M).

203507	<location>Digital output not set
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	Despite specification by the signal source the digital output has not been set. Possible causes: - power supply missing. - the digital output is in current limiting (e.g. due to short-circuit). - the digital output is being used for Safety Extended Functions. - the control has authority to access the digital output by means of direct access (see also r0729). Alarm value (r2124, interpret bitwise binary): Digital output involved (structured the same as r0747).
Remedy:	- check the 24 V power supply (e.g. X131.7 for CU305, ground is X131.8). - check the output terminals for short-circuits. - reset the signal source of the digital output for use by Safety Extended Functions. - carry out a POWER ON (switch-off/switch-on).

203507	<location>Digital output not set
Drive object:	CU_I_828, CU_I_COMBI, CU_LINK, HUB, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE

- Cause:** Despite specification by the signal source the digital output has not been set.
Possible causes:
- power supply missing.
 - the digital output is in current limiting (e.g. due to short-circuit).
 - the digital output is being used for Safety Extended Functions.
 - the control has authority to access the digital output by means of direct access (see also r0729).
- Alarm value (r2124, interpret bitwise binary):
Digital output involved (structured the same as r0747).
- Remedy:**
- check the 24 V power supply (e.g. X130.6 for CU310-2, ground is X130.5).
 - check the output terminals for short-circuits.
 - reset the signal source of the digital output for use by Safety Extended Functions.
 - carry out a POWER ON (switch-off/switch-on).

203510 <location>Calibration data not plausible

Drive object: A_INF_828, B_INF_828, CU_LINK, CU_NX_828, CU_NX_COMBI, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: During ramp-up, the Terminal Module 31 (TM31) calibration data is read in and checked for plausibility.
At least one calibration data point was determined to be invalid.
Alarm value (r2124, interpret binary):
Bit 1: 10 V value, analog input 0 invalid.
Bit 3: 10 V value, analog input 1 invalid.
Bit 4: Offset, analog output 0 invalid.
Bit 5: 10 V value, analog output 0 invalid.
Bit 6: Offset, analog output 1 invalid.
Bit 7: 10 V value, analog input 1 invalid.

Remedy:

- switch-off/switch-on the power supply for the Control Unit.
- check the DRIVE-CLiQ wiring.

Note:
If it reoccurs, then replace the module.
In principle, operation could continue.
The analog channel involved possibly does not achieve the specified accuracy.

203510 <location>CU: Calibration data not plausible

Drive object: CU_I_828, CU_I_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: During ramp-up, the Terminal Module 31 (TM31) calibration data is read in and checked for plausibility.
At least one calibration data point was determined to be invalid.
Alarm value (r2124, interpret binary):
Bit 1: 10 V value, analog input 0 invalid.
Bit 3: 10 V value, analog input 1 invalid.
Bit 4: Offset, analog output 0 invalid.
Bit 5: 10 V value, analog output 0 invalid.
Bit 6: Offset, analog output 1 invalid.
Bit 7: 10 V value, analog input 1 invalid.

Remedy:

- switch-off/switch-on the power supply for the Control Unit.
- check the DRIVE-CLiQ wiring.

Note:

If it reoccurs, then replace the module.

In principle, operation could continue.

The analog channel involved possibly does not achieve the specified accuracy.

203510 <location>TM: Calibration data not plausible

Drive object: TM120, TM150

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: During ramp-up, the Terminal Module 31 (TM31) calibration data is read in and checked for plausibility. At least one calibration data point was determined to be invalid.

Alarm value (r2124, interpret binary):

Bit 1: 10 V value, analog input 0 invalid.

Bit 3: 10 V value, analog input 1 invalid.

Bit 4: Offset, analog output 0 invalid.

Bit 5: 10 V value, analog output 0 invalid.

Bit 6: Offset, analog output 1 invalid.

Bit 7: 10 V value, analog input 1 invalid.

Remedy:

- switch-off/switch-on the power supply for the Control Unit.
- check the DRIVE-CLiQ wiring.

Note:

If it reoccurs, then replace the module.

In principle, operation could continue.

The analog channel involved possibly does not achieve the specified accuracy.

203550 <location>TM: Speed setpoint filter natural frequency > Shannon frequency

Drive object: All objects

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The natural filter frequency of the speed setpoint filter (p1417) is greater than or equal to the Shannon frequency. The Shannon frequency is calculated according to the following formula:

$$0.5 / p4099[3]$$

See also: p1417

Remedy: Reduce the natural frequency of the speed setpoint filter (PT2 low pass) (p1417).

203590 <location>TM: Module not ready

Drive object: All objects

Message value: %1

Reaction: Infeed: OFF2 (NONE)
Servo: NONE (IASC/DCBRK, OFF1, OFF2, OFF3, STOP2)
Hla: OFF2 (NONE)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The Terminal Module involved does not send a ready signal and no valid cyclic data.

Fault value (r0949, interpret decimal):

Drive object number of the Terminal Module involved.

Remedy:

- check the 24 V power supply.
- check the DRIVE-CLiQ wiring.
- check whether the sampling time of the drive object involved is not equal to zero (p4099[0]).

205000 <location>Power unit: Overtemperature heat sink AC inverter

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The alarm threshold for overtemperature at the inverter heat sink has been reached. The response is set using p0290. If the heat sink temperature exceeds the value set in p0292[0], then fault F30004 is output.

Remedy: Check the following:

- is the ambient temperature within the defined limit values?
- have the load conditions and the load duty cycle been appropriately dimensioned?
- has the cooling failed?

205001 <location>Power unit: Overtemperature depletion layer chip

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: Alarm threshold for overtemperature of the power semiconductor in the AC converter has been reached.

Note:

- the response is set using p0290.
- if the temperature of the barrier layer increases by the value set in p0292[1], then fault F30025 is initiated.

Remedy: Check the following:

- is the ambient temperature within the defined limit values?
- have the load conditions and the load duty cycle been appropriately dimensioned?
- has the cooling failed?
- pulse frequency too high?

See also: r0037, p0290

205002 <location>Power unit: Air intake overtemperature

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The alarm threshold for the air intake overtemperature has been reached. For air-cooled power units, the threshold is 42 °C (hysteresis 2 K). The response is set using p0290.

If the air intake temperature increases by an additional 13 K, then fault F30035 is output.

Remedy: Check the following:

- is the ambient temperature within the defined limit values?
- has the fan failed? Check the direction of rotation.

205003 <location>Power unit: Internal overtemperature

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause:	The alarm threshold for internal overtemperature has been reached. If the temperature inside the power unit increases by an additional 5 K, then fault F30036 is triggered.
Remedy:	Check the following: - is the ambient temperature within the defined limit values? - has the fan failed? Check the direction of rotation.

205004 <location>Power unit: Rectifier overtemperature

Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The alarm threshold for the overtemperature of the rectifier has been reached. The response is set using p0290. If the temperature of the rectifier increases by an additional 5 K, then fault F30037 is triggered.
Remedy:	Check the following: - is the ambient temperature within the defined limit values? - have the load conditions and the load duty cycle been appropriately dimensioned? - has the fan failed? Check the direction of rotation. - has a phase of the line supply failed? - is an arm of the supply (incoming) rectifier defective?

205005 <location>Cooling unit: Cooling medium flow rate too low

Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	Cooling unit: Alarm - flow rate has fallen below the alarm value
Remedy:	- check the feedback signals and parameter assignment (p0260 ... p0267). - check the coolant feed.

205006 <location>Power unit: Overtemperature thermal model

Drive object:	A_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The temperature difference between the chip and heat sink has exceeded the permissible limit value (blocksize power units only). Depending on p0290, an appropriate overload response is initiated. See also: r0037
Remedy:	Not necessary. This alarm is automatically withdrawn once the limit value has been fallen below. Note: If the alarm is not automatically withdrawn and the temperature continues to rise, this can result in fault F30024. See also: p0290 (Power unit overload response)

205007 <location>Power unit: Overtemperature thermal model (chassis PU)

Drive object:	A_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE

Cause:	The temperature difference between the chip and heat sink has exceeded the permissible limit value (r0293) (chassis power units only). Depending on p0290, an appropriate overload response is initiated. See also: r0037, r0293
Remedy:	Not necessary. This alarm is automatically withdrawn once the limit value has been fallen below. See also: p0290 (Power unit overload response)

205050 <location>Parallel circuit: Pulse enable in spite of pulse inhibit

Drive object:	A_INF_828, B_INF_828, S_INF_828
Message value:	%1
Reaction:	Infeed: OFF2 (NONE, OFF1)
Acknowledge:	IMMEDIATELY
Cause:	A power unit signals that the pulses are enabled although the pulses are inhibited. Fault value (r0949, interpret decimal): Number of the power unit involved.
Remedy:	The power unit is defective and must be replaced.

205051 <location>Parallel circuit: Power unit pulse enable missing

Drive object:	A_INF_828, B_INF_828, S_INF_828
Message value:	%1
Reaction:	Infeed: OFF2 (NONE, OFF1)
Acknowledge:	IMMEDIATELY
Cause:	For one or several power units, the pulses were not able to be enabled. Fault value (r0949, interpret decimal): Number of the power unit involved.
Remedy:	- acknowledge power unit faults that are still present. - inhibit the pulses of the power unit involved (p7001).

205052 <location>Parallel circuit: Illegal current asymmetry

Drive object:	A_INF_828, B_INF_828, S_INF_828
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The deviation of the individual currents of the power units exceeds the alarm threshold specified in p7010. Alarm value (r2124, interpret decimal): 1: Phase U. 2: Phase V. 3: Phase W.
Remedy:	- inhibit the pulses of the faulted power unit (p7001). - check the connecting cables. Loose contacts can cause current spikes. - the motor reactors are non-symmetrical or faulty and must be replaced. - the CTs must be calibrated or replaced.

205053 <location>Parallel circuit: Inadmissible DC link voltage asymmetry

Drive object:	A_INF_828, B_INF_828, S_INF_828
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The deviation of the DC link voltage measured values exceeds the alarm threshold specified in p7011.

Remedy:

- inhibit the pulses of the faulted power unit (p7001).
- check the DC link connecting cables.
- the DC link voltage measurement is incorrect and must be calibrated or renewed.

205054 <location>Parallel circuit: Power unit deactivated

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: For the drive object involved, fewer power units connected in parallel are active than exist in the target topology. Operation is only possible at reduced power (power derating).

Remedy: Re-activate the deactivated power units if required.

See also: p0125 (Activate/deactivate power unit components), p0895 (Activate/deactivate power unit components), p0897 (Parking axis selection)

205055 <location>Parallel connection: Power units with illegal code numbers

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: Parameter: %1

Reaction: OFF2 (NONE)

Acknowledge: IMMEDIATELY

Cause: The code numbers of the power units are not permissible.

For parallel circuit configurations, only power units with identical power unit data may be used.

Possible causes:

- the code numbers of the power units do not match.

For booksize drive units, the following additionally applies:

- a parallel connection is not possible for the power units being used.
- there are too many power units being used in the parallel connection.

Fault value (r0949, interpret decimal):

Parameter in which the inadmissible power unit code number was detected.

Remedy: - Use power units with the same code number.

For booksize drive units, the following additionally applies:

- use power units which are permitted for a parallel connection.
- reduce the number of power units being used in the parallel connection.

205056 <location>Parallel circuit: Power unit EEPROM versions differ

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: Parameter: %1

Reaction: OFF2 (NONE)

Acknowledge: IMMEDIATELY

Cause: The EEPROM versions of the power units do not match.

Fault value (r0949, interpret decimal):

Parameter in which the first different version number was detected.

Remedy: Use power units with the same EEPROM version.

Note:

For parallel circuit configurations, only power units with identical EEPROM versions may be used.

205057 <location>Parallel circuit: Power unit firmware versions differ

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: Parameter: %1

Reaction: OFF2 (NONE)

Acknowledge:	IMMEDIATELY
Cause:	The firmware versions of the power units connected in parallel do not match. Fault value (r0949, interpret decimal): Parameter in which the first different version number was detected.
Remedy:	Use power units with the same firmware version. For parallel circuit configurations, only power units with identical firmware versions may be used.

205058	<location>Parallel circuit: VSM EEPROM versions differ
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Parameter: %1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	The EEPROM versions of the Voltage Sensing Modules (VSM) do not match. Fault value (r0949, interpret decimal): Parameter in which the first different version number was detected.
Remedy:	For parallel circuit configurations, only Voltage Sensing Modules (VSM) with identical EEPROM versions may be used.

205059	<location>Parallel circuit: VSM firmware versions differ
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Parameter: %1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	The firmware versions of the Voltage Sensing Module (VSM) do not match. Fault value (r0949, interpret decimal): Parameter in which the first different version number was detected.
Remedy:	For parallel circuit configurations, only Voltage Sensing Modules (VSM) with identical firmware versions may be used.

205060	<location>Parallel circuit: Power unit firmware version does not match
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Parameter: %1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	Firmware from version V02.30.01.00 is required when connecting the power units in parallel.
Remedy:	Update the firmware of the power units (at least V02.30.01.00).

205061	<location>Infeed VSM count
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	The number of active Voltage Sensing Modules (VSM) for the drive object infeed with chassis power units is not correct. For A_Infeed, each active power unit must be assigned an active VSM also for a parallel circuit configuration. For S_Infeed, the active drive object, must be assigned at least one active VSM. Fault value (r0949, interpret decimal): Number of VSMs that are currently assigned to the drive object.
Remedy:	Adapts the number of active Voltage Sensing Modules (VSM).

205064	<location>Parallel connection: Pulse synchronization error
Drive object:	A_INF_828, S_INF_828

Message value: -
Reaction: Infeed: OFF2 (OFF1)
Acknowledge: POWER ON (IMMEDIATELY)
Cause: The pulse synchronization of at least one of the power units connected in parallel is incorrect.
Remedy: Restart the drive system.

205066 <location>Parallel connection: inadmissible asymmetry VSM voltage

Drive object: A_INF_828, S_INF_828
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: The deviation of the individual voltages of the Voltage Sensing Module (VSM) exceeds the alarm threshold set in p7324.
 Alarm value (r2124, interpret decimal):
 1: VSM voltage u1 - u2.
 2: VSM voltage u2 - u3.
Remedy:

- Check alarm threshold p7324, and if required, adapt.
- Check the connecting cables. Loose contacts can cause voltage spikes.
- Check the line connections, line circuit breaker and bypass contactors.
- Check filter reactors and filter capacitances. All parallel line filters must be of the same type, and must not have faulty reactors or capacitors.
- Deactivate the faulty Voltage Sensing Module (VSM) and faulty power unit (p7001), or if required, replace.

 See also: p7001 (Par_circuit power units enable), p7324 (Par_connection VSM voltage asymmetry alarm threshold)

205118 <location>Precharging contactor simultaneity monitoring time exceeded

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value: fault cause: %1, additional information: %2
Reaction: OFF2 (NONE, OFF1)
Acknowledge: IMMEDIATELY (POWER ON)
Cause: A feedback signal for the precharging contactor (ALM, SLM, BLM diode) or the line contactor (BLM thyristor) interconnected and the simultaneity monitoring (p0255[4, 6]) activated.
 After opening or closing a contactor of the parallel connection, after a monitoring time has elapsed, not all of the contactors have assumed the same state.
 Fault value (r0949, interpret binary):
 yyyyxxxx hex: yyyy = supplementary information, xxxx = fault cause
 Fault cause:
 Bit 0 = 1: simultaneity error when closing the contactors.
 Bit 1 = 1: simultaneity error when opening the contactors.
 Supplementary information:
 Bit 0 = 1: PDS0 contactor is closed.
 Bit 1 = 1: PDS1 contactor is closed.
 Bit 2 = 1: PDS2 contactor is closed.
 Bit 3 = 1: PDS3 contactor is closed.
 Bit 4 = 1: PDS4 contactor is closed.
 Bit 5 = 1: PDS5 contactor is closed.
 Bit 6 = 1: PDS6 contactor is closed.
 Bit 7 = 1: PDS7 contactor is closed.
 Note:
 ALM: Active Line Module
 BLM: Basic Line Module
 PDS: Power unit Data Set
 SLM: Smart Line Module

Remedy:

- check the monitoring time setting (p0255[4, 6]).
- check the wiring and control of the contactor.
- if required, replace the contactor.

See also: p0255 (Power unit contactor monitoring time)

205119 <location>Bypass contactor simultaneity monitoring time exceeded

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: fault cause: %1, additional information: %2

Reaction: OFF2 (NONE, OFF1)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: A feedback signal for the bypass contactor is interconnected and the simultaneity monitoring (p0255[5, 7]) activated. After opening or closing a contactor of the parallel connection, after a monitoring time has elapsed, not all of the contactors have assumed the same state.

Fault value (r0949, interpret binary):

yyyyxxxx hex: yyyy = supplementary information, xxxx = fault cause

Fault cause:

Bit 0 = 1: simultaneity error when closing the contactors.

Bit 1 = 1: simultaneity error when opening the contactors.

Supplementary information:

Bit 0 = 1: PDS0 contactor is closed.

Bit 1 = 1: PDS1 contactor is closed.

Bit 2 = 1: PDS2 contactor is closed.

Bit 3 = 1: PDS3 contactor is closed.

Bit 4 = 1: PDS4 contactor is closed.

Bit 5 = 1: PDS5 contactor is closed.

Bit 6 = 1: PDS6 contactor is closed.

Bit 7 = 1: PDS7 contactor is closed.

Note:

PDS: Power unit Data Set

Remedy:

- check the monitoring time setting (p0255[5, 7]).
- check the wiring and control of the contactor.
- if required, replace the contactor.

See also: p0255 (Power unit contactor monitoring time)

206000 <location>Infeed: Precharging monitoring time expired

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: -

Reaction: OFF2 (OFF1)

Acknowledge: IMMEDIATELY

Cause:	After the line contactor closes the power unit does not signal the READY state within the monitoring time (p0857). The end of the DC link precharging was not able to be completed for one of the following reasons: 1) There is no line supply voltage connected. 2) The line contactor/line side switch has not been closed. 3) The line supply voltage is too low. 4) Line supply voltage incorrectly set (p0210). 5) The precharging resistors are overheated as there were too many precharging operations per time unit. 6) The precharging resistors are overheated as the DC link capacitance is too high. 7) The precharging resistors are overheated because when there is no "ready for operation" (r0863.0) of the infeed unit, power is taken from the DC link. 8) The precharging resistors are overheated as the line contactor was closed during the DC link fast discharge through the Braking Module. 9) The DC link has either a ground fault or a short-circuit. 10) The precharging circuit is possibly defective (only for chassis units). See also: p0210 (Drive unit line supply voltage), p0857 (Power unit monitoring time)
Remedy:	In general: - check the line supply voltage at the connecting terminals. - check the line supply voltage setting (p0210). - check the monitoring time and, if required, increase (p0857). - where relevant, observe additional power unit messages/signals (e.g. F30027). - the following applies to booksize units: Wait (approx. 8 min.) until the precharging resistors have cooled down. For this purpose, preferably disconnect the infeed unit from the line supply. For 5): - carefully observe the permissible precharging frequency (refer to the appropriate Equipment Manual). For 6): - check the total capacitance of the DC link and reduce in accordance with the maximum permissible DC link capacitance if necessary (refer to the appropriate Equipment Manual) For 7): - interconnect the ready-for-operation signal from the infeed unit (r0863.0) in the enable logic of the drives connected to this DC link For 8): - check the connections of the external line contactor. The line contactor must be open during DC link fast discharge. For 9): - check the DC link for ground faults or short circuits.

206010 <location>Infeed: Power unit EP 24 V missing in operation

Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value:	-
Reaction:	OFF2 (OFF1)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	In operation, the pulse enable via terminal EP at the Line Module (X21.3, X21.4) was withdrawn. Note: EP: Enable Pulses (pulse enable)
Remedy:	- do not open the line side switch in operation - only when the pulses are inhibited. - check the wiring of terminal EP (X21.3, X21.4) at the Line Module to exclude any poor contacts.

206050 <location>Infeed: Smart Mode not supported

Drive object:	A_INF_828, S_INF_828, S_INF_COMBI
Message value:	-
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The power unit does not support the Smart Mode or pulse frequency wobulation is activated (p1810).

Remedy:

- set the suitable sampling time $250\ \mu\text{s} \leq p0115[0] \leq 400\ \mu\text{s}$ (e.g. by setting p0112 and p0115 to the factory setting).
- upgrade the power unit software and/or hardware for the Smart Mode. The availability of the Smart Mode function is displayed in r0192.
- when the software gating unit is activated ($p1810.2 = 1$ or $p1810.13 = 1$), then the Smart Mode is not permissible. Either the Smart Mode must be deactivated ($p3400.0 = 0$) or the software gating unit must be deactivated.
- for A_INF the following applies: deactivate the Smart Mode using $p3400.0 = 0$, and activate closed-loop voltage control with $p3400.3 = 1$. For booksize power units, it must be noted that for a supply voltage $p0210 > 415\ \text{V}$ only the Smart Mode is possible in the presetting. If DC link voltages above 660 V are permissible in the application, then voltage-controlled operation can be activated with p0280, p0210, p3400 and p3510. The information regarding p0210 should be carefully noted.

See also: r0192 (Power unit firmware properties 1)

206052 <location>Infeed: Filter temperature evaluation not supported

Drive object: A_INF_828, S_INF_828, S_INF_COMBI

Message value: -

Reaction: OFF2 (NONE)

Acknowledge: IMMEDIATELY

Cause: The power unit does not support filter temperature evaluation.
This feature (r0192.11) is required when an Active Interface Module is used as a line filter ($p0220 = 41 \dots 45$).

Remedy: Upgrade the firmware for the power unit to a later version.
See also: r0192 (Power unit firmware properties 1), p0220

206080 <location>Infeed: parameter error

Drive object: A_INF_828, S_INF_828, S_INF_COMBI

Message value: Parameter: %1

Reaction: OFF2 (NONE, OFF1)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: An infeed parameter is incorrectly set.
Fault value (r0949, interpret decimal):
Number of the parameter involved.
See also: p0220, p3665, p3667, p3668

Remedy: Appropriately change the parameter specified in the fault value.
See also: p0220, p3665, p3667, p3668

206100 <location>Infeed: Shutdown due to line supply undervoltage condition

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: %1

Reaction: OFF2 (OFF1)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The filtered (steady-state) value of the line supply voltage is less than the fault threshold (p0283).
Fault condition: $V_{\text{rms}} < p0283 * p0210$
Fault value (r0949, floating point):
Actual steady-state line supply voltage.
Note:
The occurrence of this fault is delayed by the time in p3492. If the fault is removed during this design time, then the power unit is not tripped (shut down).

See also: p0283 (Line supply undervoltage shutdown (trip) threshold), p3492 (Infeed, line supply undervoltage delay time)

Remedy:

- check the line supply.
- check the line supply voltage (p0210).
- check the threshold value (p0283).

206105	<location>Infeed: Line supply undervoltage
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The filtered (steady-state) value of line supply voltage is lower than the alarm threshold (p0282). Alarm condition: $V_{rms} < p0282 * p0210$ Alarm value (r2124, floating point): Actual steady-state line supply voltage. See also: p0282 (Line supply undervoltage alarm threshold)
Remedy:	- check the line supply. - check the line supply voltage (p0210). - check the alarm threshold (p0282).

206200	<location>Infeed: One or several line phases failed
Drive object:	A_INF_828, S_INF_828, S_INF_COMBI
Message value:	-
Reaction:	OFF2 (OFF1)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	Failure overvoltage in one or several line supply phases. The fault can be output in two operating states: 1. During the switch-on phase of the infeed unit. The measured line supply angle deviates from the regular characteristic for a 3-phase system - the PLL cannot be synchronized. The fault occurs immediately after switch-on if, when operating with a Voltage Sensing Module (VSM), the phase assignment L1, L2, L3 at the VSM differs from the phase assignment at the power unit. 2. While the infeed is operational. During an active line voltage alarm (A06205) or current symmetry alarm (A06206), an additional fault occurred, which resulted in a shutdown. Alarm values A06205 and A06206 could provide additional information about the cause of the shutdown. Possible causes: - voltage dip on the line side or phase failure or overvoltage lasting longer than 10 ms. - overload condition on the load side with peak current. - line reactor missing.
Remedy:	- check the line supply, terminals and fuses. - check the connection and size (rating) of the line line filter and/or the line commutating reactor. - check and correct the phase assignment at the VSM (X521 or X522) and at the power unit. - check the load. - if failed in operation, carefully note the previous alarm messages A06205/A06206 with alarm values. See also: p3463 (Infeed phase failure detection line supply angle change)

206205	<location>Infeed: Voltage dip in at least one line supply phase
Drive object:	A_INF_828, S_INF_828, S_INF_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE

Cause:	Voltage dip or overvoltage in one or several line supply phases has been detected in operation. The event is displayed in status parameter r3405.2. If nothing else is specified for the alarm values, then at the instant of the alarm, the pulses are inhibited for a minimum of 8 ms. Also for alarm values with pulse inhibit, the operating signal of the infeed remains in r0863.0. Alarm value (r2124, interpret bitwise binary): Bit 0: Line angle deviation due to a line supply fault (limit value p3463). Bit 2: Active current deviation. Bit 3: Line frequency deviation (limit values: 115 % * p0284, 85 % * p0285). Bit 4: Line overvoltage (limit value: 120 % * p0281 * p0210). Bit 5: Line undervoltage (limit value: 20 % * p0210). Bit 7: peak current event. Bit 8: Line supply angle deviation identified in the Smart Mode (p3400.0 = 1). In addition, for Extended Smart Mode (p3440.1 = 1) the following applies: pulses are not inhibited. Bit 9: DC link voltage dip identified in the Smart Mode (p3400.0 = 1). Bit 11: Line voltage detection error identified in the Smart Mode (p3400.0 = 1): Bit 12: Line voltage deviation identified in the Extended Smart Mode (p3400.0 = 1, p3440.1 = 1). Pulses are not inhibited. Bit 14: Recharging current fault.
Remedy:	When the alarm occurs, the following always applies: - check the line supply, terminals and fuses. - check the line supply quality and system fault level. - check the load. Dependent on the alarm value in r2124, the following also applies: For bit 0 = 1: Line fault occurred or poor/incorrect controller setting. For poor line quality or frequent line supply changeover operations, when required, limit value p3463 can be increased until the alarm value no longer occurs. For bit 2 = 1: Line fault occurred or poor/incorrect controller setting. - check the controller setting and load. For bit 3 = 1: Line fault occurred. For poor line quality or frequent line changeover operations, when required, limit values p0284 and p0285 can be increased until the alarm value no longer occurs. For bit 4 = 1: Line interrupted or line overvoltage has occurred. For bit 5 = 1: Line interrupted or line undervoltage occurred. For bit 7 = 1: Peak current shutdown due to a line fault, overload or incorrect/missing line reactor. For bit 8 = 1: Line fault occurred. For bit 9 = 1: Line undervoltage or overload. For bit 11 = 1: Fault in at least one line phase. For bit 12 = 1: Voltage fault in at least one line phase. Check the settings in p3444[2, 3]. For bit 14 = 1: Supply/infeed overload or a fault in at least one line phase. See also: r3405, p3463 (Infeed phase failure detection line supply angle change)

206206 <location>Infeed: Line currents asymmetrical alarm

Drive object: A_INF_828, S_INF_828, S_INF_COMBI

Message value: %1

Reaction:	NONE
Acknowledge:	NONE
Cause:	The asymmetry of the three line currents at the terminals of the power unit exceeds the set alarm threshold (p3465). Generally, the cause of current asymmetry is line voltage asymmetry or failure of a line phase (e.g. a fuse has ruptured or a terminal connection has become loose). As a consequence, the message is also signaled as possible phase failure in status parameter r3405.2. Cyclic power fluctuations in the DC link with the line frequency can also result in unequal rms values of the line currents. For this type of operating scenario, it is recommended that monitoring is deactivated (p3465[0, 3] = 0). Alarm value (r2134, floating point): Digits to the left of the decimal point: Highest rms phase current in amps. Decimal places: Quotient of the lowest and highest rms phase current value.
Remedy:	- check the line supply, terminals and fuses. - check the line supply quality and system fault level. - check the load. - check the settings in p3462 and p3465. See also: r3405, p3465 (Infeed current symmetry monitoring thresholds)

206207 <location>Infeed: Line currents asymmetrical

Drive object:	A_INF_828, S_INF_828, S_INF_COMBI
Message value:	%1
Reaction:	OFF1 (NONE, OFF2)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The asymmetry of the line currents is continuously too high. The most probable cause is failure of a line phase. Fault value (r2133, floating point): Digits to the left of the decimal point: Highest rms phase current in amps. Decimal places: Quotient of the lowest and highest rms phase current value.
Remedy:	- check the previous alarm A06206 and the alarm value. - check the line supply, terminals and fuses. - check the settings in p3462 and p3465. - check the connection and size (rating) of the line line filter and/or the line commutating reactor.

206208 <location>Infeed line: supply voltage asymmetrical

Drive object:	A_INF_828, S_INF_828, S_INF_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	Asymmetry of the voltages in the line phase too high. The most probable cause is failure of a line phase. Note: This message is only output when asymmetry monitoring is activated (p3640.1 = 1).
Remedy:	- check the line supply, terminals and fuses. - check the setting values for the phase asymmetry (p3647[0, 1]).

206210 <location>Infeed: Summation current too high

Drive object:	A_INF_828, S_INF_828, S_INF_COMBI
Message value:	%1

Reaction:	OFF2 (OFF1)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The smoothed total of the phase currents ($i_1 + i_2 + i_3$) is greater than 4 % of the maximum power unit current (r0209). Possible causes: - the DC link has a ground fault that results in a high summation current (r0069.6). The DC component in the line currents can damage/destroy the power unit, line reactor or line filter! - the zero point calibration of the current measurement was not carried out (p3491, A06602). - defective current measurement in the power unit. Fault value (r0949, floating point): Smoothed total of the phase currents.
Remedy:	- check the DC link for a low-ohmic or high-ohmic ground fault and if present, remove. - increase the monitoring time of the current offset measurement (p3491). - replace the power unit if necessary.

206211 <location>Infeed: Summation current impermissibly high

Drive object:	A_INF_828, S_INF_828
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The smoothed sum of the phase currents ($i_1 + i_2 + i_3$) is impermissibly high. The summed current has exceeded the parameterized threshold for the ground fault monitoring (p0287). Possible causes: - there is a ground fault that results in a high summation current (r0069.6). The DC component in the line currents can damage/destroy the power unit, line reactor or line filter! - the zero point calibration of the current measurement was not carried out (p3491, A06602). - the current measurement in the power unit is defective. Fault value (r0949, floating point): Smoothed total of the phase currents (peak value).
Remedy:	- check the line supply for ground faults and remove any that are present. - check the set threshold for the ground fault monitoring (p0287). - if required, replace the power unit. See also: p0287 (Ground fault monitoring shutdown threshold)

206215 <location>Infeed: Summation current too high

Drive object:	A_INF_828, S_INF_828, S_INF_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The smoothed total of the phase currents ($i_1 + i_2 + i_3$) is greater than 3 % of the maximum power unit current (r0209). Possible causes: - the DC link has a ground fault that results in a high summation current (r0069.6). The DC component in the line currents can damage/destroy the power unit, line reactor or line filter! - the zero point calibration of the current measurement was not carried out (p3491, A06602). - defective current measurement in the power unit. Alarm value (r2124, floating point): Smoothed total of the phase currents.
Remedy:	- check the DC link for a low-ohmic or high-ohmic ground fault and if present, remove. - increase the monitoring time of the current offset measurement (p3491). - replace the power unit if necessary.

206250	<location>Infeed: Defective capacitor(s) in at least one phase of line filter
Drive object:	A_INF_828, S_INF_828, S_INF_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	A change in the line filter capacitance was detected in at least one line phase. The voltages and phase currents of the line filter, measured using a VSM, indicate a deviation of the filter capacitances from the value parameterized in p0221. A change or a defect of the line filter capacitors results in a shift of the resonant frequencies and can result in severe damage to the drive system. Alarm value (r2124, floating point): The currently calculated capacitance in μF (rounded-off to an integer number). Note: The first decimal point specifies the number of the phase (1, 2, 3) where the capacitance deviates from the specified value.
Remedy:	- check the parameterized value of the filter capacitance (p0221). - check the correct wiring of the VSM: Differential voltages u12 and u23 must be available at the 100 V/690 V inputs of the VSM. The phase currents of the line filter must be available at the 10 V inputs via a current-voltage transformer. - check the alarm limits for the permissible filter capacitance deviation (p3676). - check the scaling of the line supply voltage measurement using the VSM (p3660). - check the scaling of the filter current measurement using the VSM (p3670). - check the line filter capacitors and if required, replace the line filter. For a parallel connection of power units, the following applies: - parameter r3677[0...2] indicates the average value of all filter capacitances. - parameters r7320[0...n], r7321[0...n] and r7322[0...n] indicate the capacitance of each individual filter. The defective filter can be localized by the particular VSM. Note: VSM: Voltage Sensing Module See also: p0221, p3660, p3670, p3676
206255	<location>Infeed: temperature threshold value not permissible
Drive object:	A_INF_828, S_INF_828, S_INF_COMBI
Message value:	%1
Reaction:	NONE (OFF1, OFF2)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	At least one temperature threshold value is set outside the permissible value range. For sensor type KTY84 (p3665 = 2) or PT1000 (p3665 = 6), the value range from 181 °C to 300 °C is not permissible. Fault value (r0949, interpret bitwise binary): The bit number corresponds to the number of the Voltage Sensing Module (VSM) involved. Bit 0: The value in p3667/p3668 is outside the permissible value range. For liquid-cooled Active Interface Modules (AIM, see p0220), the value range between 71 °C and 300 °C is also not permissible. Bit 1: The value in p5467[0]/p5468[0] is outside the permissible value range. Bit 2: The value in p5467[1]/p5468[1] is outside the permissible value range. See also: p3667, p3668, p5467 (VSM2 overtemperature alarm threshold), p5468 (VSM2 overtemperature shutdown threshold)
Remedy:	Set the temperature thresholds within the measuring range.

206260 <location>Infeed: Temperature in the line filter too high**Drive object:** A_INF_828, S_INF_828, S_INF_COMBI**Message value:** -**Reaction:** NONE**Acknowledge:** NONE

Cause: The temperature monitoring in the line filter has responded.
If the temperature remains too high during the complete monitoring time, this results in fault F06261.
Note:

The temperature monitoring is only available for an Active Interface Module.

Remedy:

- check whether the line filter type set in p0220[0] matches the line filter that is actually connected. Ensure that the line filter specified for the infeed being used is connected or correct the setting of the line filter type in p0220[0].
- temperature monitoring is mandatory for AIM line filters (refer to p0220). Ensure that the line filter temperature switch is correctly and reliably connected to input X21 of the infeed.
- reduce the ambient temperature of the line filter.
- reduce the load on the infeed and the filter module.
- check the magnitude of the line supply voltage.
- the internal fan of the filter module is defective. Replace the fan if necessary.
- defective temperature switch of the filter module. Replace the filter module if necessary.

206261 <location>Infeed: Temperature in the line filter permanently too high**Drive object:** A_INF_828, S_INF_828, S_INF_COMBI**Message value:** -**Reaction:** OFF2 (OFF1)**Acknowledge:** IMMEDIATELY

Cause: After the temperature monitoring responded, the temperature in the line filter was permanently exceeded.
Note:

The temperature monitoring is only available for an Active Interface Module (AIM).

Remedy:

- check whether the line filter type set in p0220[0] matches the line filter that is actually connected. Ensure that the line filter specified for the infeed being used is connected or correct the setting of the line filter type in p0220[0].
- temperature monitoring is mandatory for AIM line filters (refer to p0220). Ensure that the temperature switch in the line filter is correctly and reliably connected to input X21 of the infeed.
- reduce the ambient temperature of the line filter.
- reduce the load on the infeed and the line filter.
- check the magnitude of the line supply voltage.
- the internal fan of the line filter is defective. Replace the fan if necessary.
- defective temperature switch of the line filter. Replace the line filter if necessary.

206262 <location>Infeed: Temperature switch in the line filter open when switching on**Drive object:** A_INF_828, S_INF_828, S_INF_COMBI**Message value:** -**Reaction:** OFF2 (OFF1)**Acknowledge:** IMMEDIATELY

Cause: When switching on the infeed, the temperature in the line filter is too high. Switching on is prevented.

Remedy:

- check whether the line filter type set in p0220[0] matches the line filter that is actually connected. Ensure that the line filter specified for the infeed being used is connected or correct the setting of the line filter type in p0220[0].
- temperature monitoring is mandatory for AIM line filters (refer to p0220). Ensure that the temperature switch in the line filter is correctly and reliably connected to input X21 of the infeed.
- the filter temperature is too high. Allow the system to cool down.
- the internal fan of the line filter is defective. Replace the fan if necessary.
- defective temperature switch of the line filter. Replace the line filter if necessary.

206300	<location>Infeed: Line voltage too high at power on
Drive object:	A_INF_828, S_INF_828, S_INF_COMBI
Message value:	%1
Reaction:	OFF2 (NONE, OFF1)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The RMS line supply voltage V_{rms} was so high when switching on that controlled operation is not possible without exceeding the permissible maximum voltage in the DC link (p0280). Fault condition: $V_{rms} * 1.5 > p0280$. Fault value (r0949, floating point): Lowest possible controlled DC link voltage for the line supply voltage presently connected. See also: p0280 (DC link voltage maximum steady-state)
Remedy:	- check the line supply voltage - check the maximum DC link voltage and if required, increase (p0280). - check the line supply voltage and compare with the actual line supply voltage (p0210). - check whether the power unit is dimensioned for the line supply voltage actually being used. See also: p0210 (Drive unit line supply voltage), p0280 (DC link voltage maximum steady-state)
206301	<location>Infeed: Line supply overvoltage
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value:	Line supply voltage: %1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The filtered (steady-state) value of the rms line supply voltage V_{rms} is higher than the alarm threshold (p0281). Alarm condition: $V_{rms} > p0281 * p0210$. Alarm value (r2124, floating point): Actual steady-state line supply voltage. See also: p0281 (Line supply overvoltage alarm threshold)
Remedy:	- check the line supply. - check the line supply voltage (p0210). - check the alarm threshold (p0281). See also: p0210 (Drive unit line supply voltage), p0281 (Line supply overvoltage alarm threshold)
206310	<location>Infeed: Supply voltage (p0210) incorrectly parameterized
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value:	Line supply voltage: %1
Reaction:	NONE (OFF1, OFF2)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	After precharging was completed, the line supply voltage V_{rms} was calculated using the measured DC link voltage. This voltage V_{rms} is not within the tolerance range of the supply voltage. The following applies for the tolerance range: $85 \% * p0210 < V_{rms} < 110 \% * p0210$ Fault value (r0949, floating point): Line supply voltage V_{rms} present. See also: p0210 (Drive unit line supply voltage)
Remedy:	- check the parameterized supply voltage and if required change (p0210). - check the line supply voltage. See also: p0210 (Drive unit line supply voltage)
206310	<location>Supply voltage (p0210) incorrectly parameterized
Drive object:	SERVO_828, SERVO_COMBI
Message value:	-

Reaction:	NONE (OFF1, OFF2)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	For AC/AC drive units, the measured DC voltage lies outside the tolerance range after precharging has been completed. The following applies for the tolerance range: $1.16 * p0210 < r0070 < 1.6 * p0210$ Note: The fault can only be acknowledged when the drive is switched off. See also: p0210 (Drive unit line supply voltage)
Remedy:	- check the parameterized supply voltage and if required change (p0210). - check the line supply voltage. See also: p0210 (Drive unit line supply voltage)

206311 <location>Infeed: Supply voltage (p0210) incorrect

Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value:	Line supply voltage: %1
Reaction:	OFF2 (OFF1)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The line voltage nominal value indicated in p0210 is outside the nominal voltage range of the power unit. After precharging was completed, the actual line supply voltage V_{rms} was calculated using the measured DC link voltage. This voltage V_{rms} does not lie within the extended tolerance range of the supply voltage set in p0210. The following applies for the extended tolerance range: $75 \% * p0210 < V_{rms} < 120 \% * p0210$ Alarm value (r2124, floating point): Line supply voltage V_{rms} present. See also: p0210 (Drive unit line supply voltage)
Remedy:	- check the parameterized supply voltage and if required change (p0210). - check the line supply voltage. See also: p0210 (Drive unit line supply voltage)

206320 <location>Master/slave: 4-channel multiplexer control not valid

Drive object:	A_INF_828
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	Values 0, 1, 2, and 3 are valid to control the 4-channel multiplexer via connector input p3572. In this case, an invalid value was identified. The control remains effective with the previous value. Fault value (r0949, interpret decimal): Invalid value to control the multiplexer. See also: p3572 (Master/slave active current setpoint multiplexer selection)
Remedy:	- check the interconnection to control the multiplexer (CI: p3572). - check the signal source signal value of the BICO interconnection. See also: p3572 (Master/slave active current setpoint multiplexer selection)

206321 <location>Master/slave: 6-channel multiplexer control not valid

Drive object:	A_INF_828
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY

Cause:	For the 6-channel multiplexer control via connector input p3577 an invalid value was identified. Values of 0, 1, 2, 3, 4 and 5 are valid. The control remains effective with the previous value. Fault value (r0949, interpret decimal): Invalid value used to control the multiplexer. See also: p3577 (Master/slave current distribution factor multiplexer selection)
Remedy:	- check the interconnection to control the multiplexer (CI: p3577). - check the signal source signal value of the BICO interconnection.

206350 <location>Infeed: Measured line frequency too high

Drive object:	A_INF_828, S_INF_828, S_INF_COMBI
Message value:	Line frequency: %1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The actual line frequency f_{line} is higher than the parameterized alarm threshold ($f_{line} > p0211 * p0284$). The alarm can be output in two operating states: 1. During the switch-on phase of the infeed unit. Consequence: Synchronization of the infeed to the line supply is interrupted and is restarted. The alarm is reissued if the line frequency remains higher than the parameterized alarm threshold. 2. While the infeed is operational. Consequence: The infeed still remains in the operating state, alarm A06350 is output. This signifies a critical operational fault. Alarm value (r2124, floating point): Actual line frequency determined. See also: p0284 (Line supply frequency exceeded alarm threshold)
Remedy:	- check the parameterized line frequency and if required change (p0211). - check the alarm threshold (p0284). - check the line supply. - check the line supply quality. See also: p0211, p0284

206351 <location>Infeed: Measured line frequency too low

Drive object:	A_INF_828, S_INF_828, S_INF_COMBI
Message value:	Line frequency: %1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The actual line frequency f_{line} is lower than the parameterized alarm threshold ($f_{line} < p0211 * p0285$). The alarm can be output in two operating states: 1. During the switch-on phase of the infeed unit. Consequence: Synchronization of the infeed to the line supply is interrupted and is restarted. The alarm is reissued if the line frequency remains less than the parameterized alarm threshold. 2. While the infeed is operational. Consequence: The infeed remains in the "operating" (run) state and alarm A06351 is output. This signifies a critical operational fault. Alarm value (r2124, floating point): Actual line frequency determined. See also: p0285 (Line supply frequency undershot alarm threshold)

Remedy:

- check the parameterized line frequency and if required change (p0211).
- check the alarm threshold (p0285).
- check the line supply.
- check the line supply quality.

See also: p0211, p0285

206400 <location>Infeed: Line supply data identification selected/active

Drive object: A_INF_828, S_INF_828, S_INF_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The line supply data identification is selected and active.
The line inductance and the DC link capacitance are measured at the next pulse enable.
See also: p3410 (Infeed identification method)

Remedy: Not necessary.
This alarm is automatically withdrawn after the measurement has been completed.

206401 <location>Infeed: Transformer data identification/test mode selected/active

Drive object: A_INF_828

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: A transformer data identification type or a transformer test operation has been selected or is active.
Alarm value (r2124, interpret decimal):
11: Identification type 1 selected for transformer data (automatic determination of the magnetizing inductance).
12: Identification type 2 selected for transformer data (automatic determination of transformer phase shift and gain correction).
13: Identification type 3 selected for transformer data (determination of total leakage inductance of transformer during line data identification).
101: Test mode 1 selected.
102: Test mode 2 selected.
See also: p5480 (Transformer magnetization mode)

Remedy: Not necessary.
This alarm is automatically withdrawn after the identification has expired.

206500 <location>Infeed: Line synchronization not possible

Drive object: A_INF_828, S_INF_828, S_INF_COMBI

Message value: -

Reaction: OFF2 (OFF1)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The line synchronization is not possible within the monitoring time.
The infeed was re-synchronized to the line supply because it was interrupted due to an incorrect line frequency or due to excessively high line voltage distortion.
After 20 attempts, synchronization - and therefore also the switching-on operation - were interrupted.
Especially for ALM chassis units, one possible cause is that the bypass contactor or circuit breaker does not close.

Remedy:

- check the parameterized line frequency and if required change (p0211).
- check the setting of the threshold values (p0284, p0285).
- check the line supply.
- check the connecting terminals
- check the bypass contactor (if one is being used) and its associated control.
- check the state of the circuit breaker and its associated control.
- for significant line voltage distortion, after assessment by experts, the tolerance threshold p3457[2] can be adapted.

When using a Voltage Sensing Module (VSM):

- check the line supply connection at the terminals (X521, X522).
- check VSM activation (p0145, p3400).
- check the line supply quality.

Note:

In the case of chassis power units, the availability of correct VSM voltage measured values is imperative for line synchronization.

See also: p0211, p0284, p0285, p3457

206502 <location>Infeed: Unable to achieve line synchronization in transformer magnetization

Drive object: A_INF_828

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: Line synchronization is not possible within the monitoring time (p5481[2]).

Remedy:

- check the setting of the threshold value (p5485).
- check the setting of the maximum time (p5481[2])
- check the line supply quality.

See also: p5481 (Transformer magnetization times), p5485 (Transformer magnetization voltage thresholds)

206503 <location>Infeed: Line black start unsuccessful

Drive object: A_INF_828

Message value: %1

Reaction: OFF1 (NONE, OFF2)

Acknowledge: IMMEDIATELY (POWER ON)

Cause:

The line black start was unsuccessful.

Fault value (r0949, interpret decimal):

State of the black start (corresponds to r5482).

The following applies for fault value r0949 = 109:

At the start of a black start (p5581 = 1), a line supply was identified (frequency and voltage within the specified limits p0281 to p0285).

The following applies to all other fault values:

The maximum time for a black start (p5581[2]) was exceeded.

Remedy:

- check the conditions of a line black start.
- check the parameterization of the line black start.

See also: p5581 (Island grid times)

206504 <location>Infeed: Island line supply synchronization unsuccessful

Drive object: A_INF_828

Message value: %1

Reaction: NONE (OFF1, OFF2)

Acknowledge: IMMEDIATELY (POWER ON)

- Cause:** The island line supply synchronization was unsuccessful.
Alarm value (r2124, interpret decimal):
State, in which the island line supply synchronization has remained (corresponds to r5482).
See also: r5482 (Line synchronization status)
- Remedy:** - check the conditions for the island line supply synchronization.
- check the parameterization of the island line supply synchronization.
See also: p5581 (Island grid times)

206505 <location>Infeed: For transformer magnetization current limit exceeded

- Drive object:** A_INF_828
Message value: %1
Reaction: OFF1 (OFF2)
Acknowledge: IMMEDIATELY (POWER ON)
Cause: The current limit was exceeded when magnetizing the transformer ($r0068 > p5494[1] * r0207$).
Remedy: - check the setting of the current limit ($p5494[1]$)
- check the primary side of the transformer for a short-circuit.
- check the control and feedback signal of the circuit breaker.
See also: p5494 (Transformer magnetization scaling values)

206601 <location>Infeed: Current offset measurement interrupted

- Drive object:** A_INF_828, S_INF_828, S_INF_COMBI
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: Defective current measurement or a DC current is present during the offset measurement.
Alarm value (r2124, interpret decimal):
1: Excessively high phase current has occurred during the current offset calibration.
2: The measured current offset is greater than the 3% of the maximum permissible converter current (e.g. due to a ground fault in the DC link).
Remedy: For alarm value = 1:
- possible counter-measure if there is no line contactor: Power up an adequately long time before OFF1 = 1.
For alarm value = 2:
- defective current measurement or a DC current is present during the offset measurement.
- check the DC link for a ground fault.

206602 <location>Infeed: Current offset measurement not possible

- Drive object:** A_INF_828, S_INF_828, S_INF_COMBI
Message value: -
Reaction: NONE
Acknowledge: NONE
Cause: After an OFF1 = 1 no valid current offset measurement was able to be made within the monitoring time (p3491) before closing the line contactor. The current offset is set to 0.
See also: p3491 (Infeed I-offset measurement monitoring time)
Remedy: - check the DC link for a ground fault. A ground fault can destroy parts and components!
- check the monitoring time setting and if required increase (p3491). At least 100 ms is required for a valid measurement ($p3491 > 100$ ms).
Notice:
If there is no valid measurement, then under certain circumstances the quality of the DC link control will be reduced.
See also: p3491 (Infeed I-offset measurement monitoring time)

206700	<location>Infeed: Switch line contactor for load condition
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value:	-
Reaction:	NONE (OFF2)
Acknowledge:	IMMEDIATELY
Cause:	For an ON command, the infeed line contactor should be switched under load.
Remedy:	- do not load the DC link if the infeed has not issued an operating signal (r0863.0 = 1). - after the infeed has been switched off, all power units connected to the DC link should be switched off. To realize this, the operating signal of the infeed (r0863.0) must be suitably interconnected.
206800	<location>Infeed: Maximum steady-state DC link voltage reached
Drive object:	A_INF_828, S_INF_828, S_INF_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The DC link voltage setpoint has reached the maximum steady-state voltage parameterized in p0280. The DC link voltage is increased by the modulation depth reserve controller for the following reasons: - modulation depth reserve is too low (p3480). - line supply voltage is too high. - supply voltage (p0210) parameterized to be too low. - excessively high setpoint for the reactive line current.
Remedy:	- check the line supply voltage setting (p0210). - check the line supply for an overvoltage condition. - reduce the modulation depth reserve (p3480). - reduce the reactive current setpoint. See also: p0210 (Drive unit line supply voltage), p0280 (DC link voltage maximum steady-state), p3480 (Infeed modulation depth limit)
206810	<location>Infeed: DC link voltage alarm threshold fallen below
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	In operation, the DC link voltage has dropped to below the alarm threshold. The alarm threshold is obtained from the sum of p0279 and r0296. Note: When the alarm threshold is fallen below, this is also indicated using status bit r3405.7. Possible causes: - line supply voltage dip or another line supply fault. - overload of the infeed. - for Active Line Module: Controller incorrectly parameterized. See also: p0279 (DC link voltage offset alarm threshold), r0296 (DC link voltage undervoltage threshold), r3405
Remedy:	- check the line voltage and line supply quality. - reduce the power drawn, avoid step-like load changes - for Active Line Module: Adapt the controller parameterization (e.g. automatic line supply identification (p3410 = 4, 5)).
206849	<location>Infeed: Short-circuit operation active
Drive object:	A_INF_828
Message value:	-
Reaction:	NONE

Acknowledge: NONE

Cause: The current hysteresis controller sequence control has detected a short circuit (r5452, r5522). The absolute line supply voltage (r5444[0], r5512[0]) is below the short-circuit voltage limit (p5459[2], p5529[2]), and the current limitation is active (r5402.3 = 1, r5502.3 = 1).

Note:

The effective current limit is obtained from the parameterized overcurrent (p5453) and the hysteresis width (p5454).

Remedy:

- check the parameterization of the current hysteresis controller (p5453).
- check the line supply cables for a short-circuit.

206850 <location>Infeed: Short-circuit prevailing for too long

Drive object: A_INF_828

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The maximum permissible duration (p5458[1], p5528[1]) for the short-circuit has been exceeded. The short-circuit could not be cleared within this time.

Remedy:

- check the minimum time parameter setting (p5458[1], p5528[1]).
- check the line supply and fuses.

206851 <location>Infeed: Distributed infeed line monitoring tripped

Drive object: A_INF_828

Message value: %1

Reaction: OFF2 (NONE)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The line monitoring of the distributed line infeed has tripped.

Alarm value (r2124, interpret hexadecimal):

Corresponds to status word (r5542).

Remedy:

- check the line supply.
- check the parameterization of the line monitoring (p5540 ... p5559).

206855 <location>Infeed: Line filter monitor responded

Drive object: A_INF_828

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: A threshold value parameterized in p3678 has been exceeded or undershot in the line filter.

Fault value (r0949, interpret decimal):

0: Voltage threshold, alpha/beta voltage monitoring fallen below (p3678[0]).

2: Voltage threshold value of the phase voltage monitoring fallen below (p3678[0]).

x1:

Current threshold value exceeded (p3678[1]).

The 10th position codes the power unit number of the Active Interface Module involved.

Example:

01: overcurrent in line filter 1.

11: Overcurrent in line filter 2.

See also: p3678 (Filter monitoring threshold values), p3679 (Transformer filter monitoring times)

- Remedy:**
- check the parameterization of the threshold values for filter monitoring (p3678)).
 - check filter.
- For fault value = 0:
- check the parameterization of the voltage monitoring smoothing time (p3679[0]).
- For fault value = 1:
- check the parameterization of the current monitoring minimum time (p3679[1]).

206860 <location>Infeed: Function module activation not possible

Drive object: A_INF_828

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: Function module activation is not possible.

The power unit used has at least one of the following features:

- gating unit with current limiting control (r0192.19).
- gating unit with all-phase current limiting (r0192.30).

The affected function module is identified in fault value r0949 (the value of r0949 corresponds to the bit of parameter p0108).

r0949 = 7 "Dynamic grid support" function module

r0949 = 12: "Line droop control" function module

See also: r0192 (Power unit firmware properties 1)

- Remedy:**
- check whether the power unit used has the "gating unit with current limiting control" feature (r0192.19) or "gating unit with all-phase current limiting" feature (r0192.30).
 - if necessary, use a power unit that has at least one of these features.

206900 <location>Braking Module: Fault (1 -> 0)

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The Braking Module signals a fault (1 -> 0) via X21.4 ("booksize" format) or X21.5 ("chassis" format).

This signal is wired to a system digital input and correspondingly interconnected using binector input p3866[0...7].

Possible causes:

- wiring of the signal or BICO interconnection of the signal source incorrect.
- overtemperature
- electronics power supply missing.
- ground fault/short-circuit.
- internal component fault.

See also: p3866 (Braking Module fault)

- Remedy:**
- check binector input p3866[0...7] and the wiring from terminal X21.4 ("booksize" format) or X21.5 ("chassis" format).
 - reduce the number of braking operations.
 - check the 24 V power supply of the component.
 - check for a ground fault or short circuit.
 - replace the component if necessary.

206901 <location>Braking Module: Pre-alarm I2t shutdown

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The Braking Module "Booksize" format signals "Pre-alarm I2t shutdown" via terminal X21.3.
This signal is wired to a system digital input and correspondingly interconnected using binector input p3865[0...7].
Note:
This function is not supported for the "chassis" format.

Remedy: - reduce the number of braking operations.
- check binector input p3865[0...7] and the wiring from terminal X21.3 of the particular Braking Module.

206904 <location>Braking Module internal is inhibited

Drive object: B_INF_828
Message value: %1
Reaction: NONE
Acknowledge: NONE

Cause: The internal Braking Module was inhibited via binector input p3680 = 1 signal.
In the inhibited state, energy cannot be dissipated using the braking resistor.
See also: p3680 (Braking Module internal inhibit)

Remedy: Release the internal Braking Module (BI: p3680 = 0 signal).

206905 <location>Braking Module internal I2t shutdown alarm

Drive object: B_INF_828
Message value: %1
Reaction: NONE
Acknowledge: NONE

Cause: The internal Braking Module outputs an alarm due to the high I2t value.
80% of the maximum switch-on duration of the braking resistor has been reached.
Note:
This message is also displayed via BO: p3685.
See also: r3685 (Digital Braking Module: Pre-alarm I2t shutdown)

Remedy: Reduce the number of braking operations.

206906 <location>Braking Module internal fault

Drive object: B_INF_828
Message value: %1
Reaction: NONE
Acknowledge: IMMEDIATELY

Cause: The internal Braking Module outputs a fault due to overcurrent or an excessively high I2t value and is therefore inhibited.
Note:
This message is also displayed via BO: p3686.
Fault value (r0949, interpret bitwise binary):
Bit 0 = 1: I2t exceeded
Bit 1 = 1: overcurrent
See also: r3686 (Digital Braking Module fault)

Remedy: Reduce the number of braking operations.

206907 <location>Braking Module internal overtemperature

Drive object: B_INF_828
Message value: -
Reaction: OFF2 (NONE, OFF1)
Acknowledge: IMMEDIATELY

Cause:	The temperature sensor connected to the braking resistor signals an overtemperature. The Braking Module is still active. If the overtemperature persists for more than 60 s, fault F06908 is output, and the braking module is switched off. See also: r3687 (Digital Braking Module pre-alarm overtemperature)
Remedy:	- reduce the temperature at the sensor. - check the temperature sensor connection.

206908 <location>Braking Module internal overtemperature shutdown

Drive object:	B_INF_828
Message value:	-
Reaction:	OFF2 (OFF1)
Acknowledge:	IMMEDIATELY
Cause:	Braking module shut down due to overtemperature at the temperature sensor of the braking resistor. The overtemperature is detected by the sensor for longer than 60 s. See also: r3688 (Braking Module internal overtemperature shutdown)
Remedy:	- reduce the temperature at the sensor. - check the temperature sensor connection.

206909 <location>Braking Module internal Vce fault

Drive object:	B_INF_828
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	In the power unit, the monitoring of the collector-emitter voltage (U _{ce}) of the power semiconductor to control the braking resistor has responded. Possible causes: - short circuit at the braking resistor terminals. - defective power semiconductor in the braking resistor control. Note: Under certain circumstances, this fault is also output if a braking resistor is not connected, and the energy is fed back into the Braking Module. See also: r3689 (Digital Braking Module Uce fault)
Remedy:	- connect a braking resistor. - check the braking resistor connection. - check the braking resistor. - carry out a POWER ON (switch-off/switch-on). - replace the unit.

207011 <location>Drive: Motor overtemperature

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2 (NONE, OFF1, OFF3, STOP2)
Acknowledge:	IMMEDIATELY

Cause:	KTY84/PT1000: The motor temperature has exceeded the fault threshold (p0605) or the timer (p0606) after the alarm threshold was exceeded (p0604) has expired. PTC, bimetallic NC contact: The response threshold of 1650 Ohm was exceeded (for SME p4600 ... p4603 or for TM120 p4610 ... p4613 = 10, 30), or the timer (p0606) has expired after 1650 Ohm has been exceeded (for SME p4600 ... p4603 or for TM120 p4610 ... p4613 = 12, 32). Motor temperature model: The calculated motor temperature is too high. Possible causes: - motor overloaded. - motor ambient temperature too high. - PTC / bimetallic NC contact: Wire breakage or sensor not connected. - motor temperature model incorrectly parameterized. Hysteresis:2K Fault value (r0949, interpret decimal): 1, 2, 3, 4: Number of the temperature channel leading to the message (for SME/TM120 (p0601 = 10, 11)). 200: Motor temperature model 1 (I2t): temperature too high. 300: Motor temperature model 3: after the monitoring time has expired, the temperature is still higher than the alarm threshold. 301: Motor temperature model 3: temperature is too high, or the model has not been parameterized. 302: Motor temperature model 3: Encoder temperature is not within the valid range. See also: p0351, p0604, p0605, p0606, p0612, p0613, p0617, p0618, p0619, p0625, p0626, p0627, p0628
Remedy:	- reduce the motor load. - check the ambient temperature and the motor ventilation. - check the wiring and temperature sensor connection. - check monitoring limits. - check the encoder type (p0404). - check the motor type (p0300, p0301). - check activation of the motor temperature model (p0612). - check the motor temperature model parameters. - check the encoder (p0404). See also: p0351, p0604, p0605, p0606, p0612, p0617, p0618, p0619, p0625, p0626, p0627, p0628, r5397

207012 <location>Drive: Motor temperature model 1/3 overtemperature

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The motor temperature model 1/3 identified that the alarm threshold was exceeded. Hysteresis:2K Alarm value (r2124, interpret decimal): 200: Motor temperature model 1 (I2t): temperature too high. 300: Motor temperature model 3: temperature too high. See also: r0034, p0351, p0605, p0611, p0612, p0613

Remedy:

- check the motor load and if required, reduce.
- check the motor ambient temperature.
- check activation of the motor temperature model (p0612).

Motor temperature model 1 (I2t):

- check the thermal time constant (p0611).
- check alarm threshold.

Motor temperature model 3:

- check the motor type.
- check alarm threshold.
- check the model parameters.

See also: r0034 (Motor utilization thermal), p0351 (Piston position natural frequency minimum), p0605 (Mot_temp_mod 1/2 sensor threshold and temperature value), p0611 (I2t motor model thermal time constant), p0612 (Mot_temp_mod activation), r5397 (Mot_temp_mod 1/3 ambient temperature image p0613)

207013 <location>Drive: Motor temperature model configuration fault

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2 (NONE, OFF1, OFF3, STOP2)

Acknowledge: IMMEDIATELY

Cause: A fault has occurred in the configuration of the motor temperature model.

Fault value (r0949, interpret decimal):

300:

Motor temperature model 3: The sensor does not supply the necessary sensor temperature for the thermal model.

301:

Motor temperature model 3: The sensor type is unknown.

302:

Motor temperature model 3: At least one other temperature model was simultaneously activated.

303:

Motor temperature model unknown in the actual firmware version.

See also: p0300, p0301, p0404, p0612

Remedy:

- check the encoder type.
- check the motor type.
- check activation of the motor temperature model (p0612).
- check the parameters of the motor temperature model (p5350 and following).

See also: p0300, p0301, p0404, p0612

207014 <location>Drive: Motor temperature model configuration alarm

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: A fault has occurred in the configuration of the motor temperature model.

Alarm value (r2124, interpret decimal):

1:

All motor temperature models: It is not possible to save the model temperature

300:

Motor temperature model 3: Threshold value for alarm (r5398) is higher than the threshold value for fault (r5399).

See also: p0610 (Motor overtemperature response), p5390 (Mot_temp_mod 1/3 alarm threshold), p5391 (Mot_temp_mod 1/3 fault threshold)

Remedy:

- set the response for motor overtemperature to "Alarm and fault, no reduction of I_{max}" (p0610 = 2).
- check and correct the threshold values (r5398, r5399).

See also: p0610 (Motor overtemperature response), p5390 (Mot_temp_mod 1/3 alarm threshold), p5391 (Mot_temp_mod 1/3 fault threshold)

207015 <location>Drive: Motor temperature sensor alarm

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: An error was detected when evaluating the temperature sensor set in p0600 and p0601.
With the fault, the time in p0607 is started. If the fault is still present after this time has expired, then fault F07016 is output; however, at the earliest, 50 ms after alarm A07015.
Possible causes:

- wire breakage or sensor not connected (KTY: R > 1630 Ohm, PT1000: R > 1720 Ohm).
- measured resistance too low (PTC: R < 20 Ohm, KTY: R < 50 Ohm, PT1000: R < 603 Ohm).

Alarm value (r2124, interpret decimal):

- if SME/TM120 is selected (p0601 = 10, 11),
this is the number of the temperature channel leading to the message.

Remedy:

- make sure that the sensor is connected correctly.
- check the parameterization (p0600, p0601).
- check the setting of the lower threshold (p4622).

See also: r0035, p0600, p0601, p0607, p4622

207016 <location>Drive: Motor temperature sensor fault

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF1 (NONE, OFF2, OFF3, STOP2)

Acknowledge: IMMEDIATELY

Cause: An error was detected when evaluating the temperature sensor set in p0600 and p0601.

Possible causes:

- wire breakage or sensor not connected (KTY: R > 1630 Ohm, PT1000: R > 1720 Ohm).
- measured resistance too low (PTC: R < 20 Ohm, KTY: R < 50 Ohm, PT1000: R < 603 Ohm).

Note:

If alarm A07015 is present, the time in p0607 is started. If the fault is still present after this time has expired, then fault F07016 is output; however, at the earliest, 50 ms after alarm A07015.

Fault value (r0949, interpret decimal):

- if SME/TM120 is selected (p0601 = 10, 11),
this is the number of the temperature channel leading to the message.

See also: p0607 (Temperature sensor fault timer)

Remedy:

- make sure that the sensor is connected correctly.
- check the parameterization (p0600, p0601).
- induction motors: Deactivate temperature sensor fault (p0607 = 0).
- When TM120 and SMC/SME (p0601 = 10, 11) are being used, set the same sensor type on the drive (p4610 ... p4613) as for TM120.
- check the setting of the lower threshold (p4622).

See also: r0035, p0600, p0601, p0607, p4622

207017 <location>Additional temperature alarm threshold exceeded

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction:	NONE
Acknowledge:	NONE
Cause:	The additional temperature has exceeded the alarm threshold in p4102[0] The time in p4103 is also started with this alarm. Fault F07018 is output if the alarm is still active after this time has expired. - overtemperature (r4105 > p4102[0]). See also: p4100, p4102, p4103, r4105
Remedy:	- make sure that the sensor is connected correctly. - check parameterization (p4100).

207018 <location>Additional temperature fault threshold exceeded

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF1 (ENCODER, NONE, OFF2, OFF3, STOP2)
Acknowledge:	IMMEDIATELY
Cause:	The additional temperature has exceeded the fault threshold in p4102[1] Fault value (r0949, interpret decimal): 0: Overtemperature (r4105 > p4102[1] or r4105 > p4102[0] for longer than the time in p4103). 1: Wire breakage or sensor not connected (KTY: R > 1630 Ohm, PT1000: R > 1720 Ohm). Measured resistance too low (KTY: R < 50 Ohm, PT1000: R < 603 Ohm). See also: p4100, p4102, p4103, r4105
Remedy:	- make sure that the sensor is connected correctly. - check parameterization (p4100).

207080 <location>Drive: Incorrect control parameter

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	Parameter: %1
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The closed-loop control parameters have been parameterized incorrectly (e.g. p0356 = L_spread = 0). Fault value (r0949, interpret decimal): The fault value includes the parameter number involved. See also: p0310, p0311, p0341, p0344, p0350, p0354, p0356, p0358, p0360, p0400, p0404, p0408, p0640, p1082, p1300
Remedy:	Modify the parameter indicated in the fault value (r0949) (e.g. p0640 = current limit > 0). See also: p0311, p0341, p0344, p0350, p0354, p0356, p0358, p0360, p0400, p0404, p0408, p0640, p1082

207082 <location>Macro: Execution not possible

Drive object:	All objects
Message value:	Fault cause: %1, supplementary information: %2, preliminary parameter number: %3
Reaction:	NONE
Acknowledge:	IMMEDIATELY

Cause:	The macro cannot be executed. Fault value (r0949, interpret hexadecimal): ccccbbaa hex: cccc = preliminary parameter number, bb = supplementary information, aa = fault cause Fault causes for the trigger parameter itself: 19: Called file is not valid for the trigger parameter. 20: Called file is not valid for parameter 15. 21: Called file is not valid for parameter 700. 22: Called file is not valid for parameter 1000. 23: Called file is not valid for parameter 1500. 24: Data type of a TAG is incorrect (e.g. Index, number or bit is not U16). Fault causes for the parameters to be set: 25: Error level has an undefined value. 26: Mode has an undefined value. 27: A value was entered as string in the tag value that is not "DEFAULT". 31: Entered drive object type unknown. 32: A device was not able to be found for the determined drive object number. 34: A trigger parameter was recursively called. 35: It is not permissible to write to the parameter via macro. 36: Check, writing to a parameter unsuccessful, parameter can only be read, not available, incorrect data type, value range or assignment incorrect. 37: Source parameter for a BICO interconnection was not able to be determined. 38: An index was set for a non-indexed (or CDS-dependent) parameter. 39: No index was set for an indexed parameter. 41: A bit operation is only permissible for parameters with the parameter format DISPLAY_BIN. 42: A value not equal to 0 or 1 was set for a BitOperation. 43: Reading the parameter to be changed by the BitOperation was unsuccessful. 51: Factory setting for DEVICE may only be executed on the DEVICE. 61: The setting of a value was unsuccessful.
Remedy:	- check the parameter involved. - check the macro file and BICO interconnection. See also: p0015, p0700, p1000, p1500

207083 <location>Macro: ACX file not found

Drive object:	All objects
Message value:	Parameter: %1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	The ACX file (macro) to be executed was not able to be found in the appropriate directory. Fault value (r0949, interpret decimal): Parameter number with which the execution was started. See also: p0015, p0700, p1000, p1500
Remedy:	- check whether the file is saved in the appropriate directory on the memory card. Example: If p0015 is set to 1501, then the selected ACX file must be located in the following directory: ... /PMACROS/DEVICE/P15/PM001501.ACX

207084 <location>Macro: Condition for WaitUntil not fulfilled

Drive object:	All objects
Message value:	Parameter: %1
Reaction:	NONE

Acknowledge:	IMMEDIATELY
Cause:	The WaitUntil condition set in the macro was not fulfilled in a certain number of attempts. Fault value (r0949, interpret decimal): Parameter number for which the condition was set.
Remedy:	Check and correct the conditions for the WaitUntil loop.

207085 <location>Drive: Open-loop/closed-loop control parameters changed

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Parameter: %1
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	Open-loop/closed-loop control parameters have had to be changed. Possible causes: 1. As a result of other parameters, they have exceeded the dynamic limits. 2. They cannot be used due to the fact that the hardware detected not having certain features. 3. The value is estimated as the thermal time constant is missing. 4. Motor temperature model 1 is activated as thermal motor protection is missing. Fault value (r0949, interpret decimal): Changed parameter number. 340: The motor and control parameters were automatically calculated (p0340 = 1), because the vector control was subsequently activated as configuration (r0108.2). 611: The time constant for thermal motor model 1 was estimated. 612: Thermal motor model 1 was activated (p0612.0 = 1). 1800: A more favorable pulse frequency was preassigned. See also: p0640, p1082, p1300, p1800
Remedy:	Not necessary. It is not necessary to change the parameters as they have already been correctly limited.

207086 <location>Units changeover: Parameter limit violation due to reference value change

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Parameter: %1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	A reference parameter was changed in the system. This resulted in the fact that for the parameters involved, the selected value was not able to be written in the per unit notation. The values of the parameters were set to the corresponding violated minimum limit/maximum limit or to the factory setting. Possible causes: - the steady-state minimum limit/maximum limit or that defined in the application was violated. Fault value (r0949, parameter): Diagnostics parameter to display the parameters that were not able to be re-calculated. See also: p0304, p0305, p0310, p2000, p2001, p2002, p2003, r2004
Remedy:	Check the adapted parameter value and if required correct. See also: r9450 (Reference value change parameter with unsuccessful calculation)

207087 <location>Drive: Encoderless operation not possible for the selected pulse frequency

Drive object:	SERVO_828, SERVO_COMBI
Message value:	Parameter: %1

Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	Encoderless operation is not possible for the selected pulse frequency (p1800). Encoderless operation is activated under the following conditions: - the changeover speed for encoderless operation (p1404) is less than the maximum speed (p0322). - a control type with encoderless operation has been selected (p1300). - encoder faults of the motor encoder result in a fault response with encoderless operation (p0491). See also: p0491, p1300, p1404, p1800
Remedy:	Increase the pulse frequency (p1800). Note: In encoderless operation, the pulse frequency must be at least as high as one quarter of the current controller clock cycle frequency (1/p0115[0]).

207088	<location>Units changeover: Parameter limit violation due to units changeover
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Parameter: %1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	A changeover of units was initiated. This resulted in a violation of a parameter limit Possible causes for the violation of a parameter limit: - When rounding off a parameter corresponding to its decimal places, the steady-state minimum limit or maximum limit was violated. - inaccuracies for the data type "FloatingPoint". In these cases, when the minimum limit is violated then the parameter value is rounded up and when the maximum limited is violated the parameter value is rounded down. Fault value (r0949, interpret decimal): Diagnostics parameter r9451 to display all parameters whose value had to be adapted. See also: p0100 (IEC/NEMA Standards), p0349 (System of units motor equivalent circuit diagram data), p0505 (Selecting the system of units)
Remedy:	Check the adapted parameter values and if required correct. See also: r9451 (Units changeover adapted parameters)

207089	<location>Changing over units: Function module activation is blocked because the units have been changed over
Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	An attempt was made to activate a function module. This is not permissible if the units have already been changed over. See also: p0100 (IEC/NEMA Standards), p0349 (System of units motor equivalent circuit diagram data), p0505 (Selecting the system of units)
Remedy:	Restore units that have been changed over to the factory setting.

207090	<location>Drive: Upper torque limit less than the lower torque limit
Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2 (NONE, OFF1, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	The upper torque limit is lower than the lower torque limit.
Remedy:	P1 must be >= P2 if parameter P1 is connected to p1522 and parameter P2 to p1523.

207091	<location>Drive: determined current controller dynamic response invalid
Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	When one button tuning is activated ($p5300 = 1$), the current controller is measured after the pulses have been enabled. Evaluation has indicated that the current control loop was not appropriately set. Possible causes: - incorrectly set current controller. - PRBS amplitude set too high ($p5296$). Alarm value (r2124, interpret hexadecimal): 1: Dynamic response too low. 2: Current controller unstable. Note: PRBS: Pseudo Random Binary Signal (binary noise)
Remedy:	- the measurement can be repeated with a smaller excitation amplitude ($p5296$). - if required, adapt the current controller proportional gain ($p1715$).
207092	<location>Drive: moment of inertia estimator still not ready
Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The moment of inertia estimator has still not determined any valid values. The acceleration cannot be calculated. The moment of inertia estimator has stabilized, if the frictional values ($p1563$, $p1564$) as well as the moment of inertia value ($p1493$) have been determined and the appropriate status signal is set ($r1407.26 = 1$). The following parameters influence the response of the moment of the inertia estimator: $p1560$, $p1561$, $p1562$
Remedy:	Traverse the axis until the moment of inertia estimator has stabilized. This alarm is automatically withdrawn after the moment of inertia estimator has stabilized.
207093	<location>Drive: Test signal error
Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF3 (NONE, OFF1, OFF2)
Acknowledge:	IMMEDIATELY
Cause:	An error was identified when executing the "Test signal" function ($p5307.1 = 1$). The function was not executed or was canceled. Fault value (r0949, interpret decimal): 1: No distance limit has been defined ($p5308 = 0$). 2: The moment of inertia estimator has not stabilized in the parameterized time ($p5309$) ($r1407.26$). 3: The parameterized distance ($p5308$) was exceeded. 4: no motor encoder parameterized (closed-loop speed control without encoder). 5: Offset ($p5297$) is too high for the parameterized distance ($p5308$). 6: Pulse enable was withdrawn while traversing. 7: speed setpoint not equal to zero. See also: $p5307$ (Activate One Button Tuning test signal), $p5308$ (One Button Tuning test signal distance limiting), $p5309$ (One Button Tuning test signal duration)

Remedy:

- For fault value = 1:
 - Define distance limiting (p5308).
- For fault value = 2:
 - increase the duration or distance limiting (p5309, p5308).
- For fault value = 3:
 - check distance limiting (p5308).
- For fault value = 4:
 - configure speed control with encoder.
- For fault value = 5:
 - increase distance limit p5308 or reduce offset p5297.
 - the fault can only be acknowledged after p5300 was set = 0.
 - for the factory setting, a test signal duration of approximately 1.3 s is obtained. If an offset (p5297) of 60 rpm is set, for example, then this results in a distance of approximately 1.3 revolutions. As a consequence, a value must be parameterized in parameter p5308, which is longer than this distance + 10% controller reserve (e.g. p5308=515°). Further, the distance depends on the speed controller sampling time (p0115[1]) and the controller configuration (p5271).
- For fault value = 6:
 - keep the drive switched on until the "Test signal" function has been completely exited.
- For fault value = 7:
 - set the speed setpoint to zero. It is possible that the setpoint was entered from the control panel.

207094 <location>General parameter limit violation

Drive object: All objects

Message value: Parameter: %1

Reaction: NONE

Acknowledge: NONE

Cause: As a result of the violation of a parameter limit, the parameter value was automatically corrected.
Minimum limit violated --> parameter is set to the minimum value.
Maximum limit violated --> parameter is set to the maximum value.
Alarm value (r2124, interpret decimal):
Parameter number, whose value had to be adapted.

Remedy: Check the adapted parameter values and if required correct.

207095 <location>Drive: One Button Tuning activated

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The One Button Tuning function is active.
One Button Tuning is performed at the next switch-on command.
See also: p5300 (Autotuning selection)

Remedy: Not necessary.
The alarm is automatically withdrawn after One Button Tuning has been exited (p5300 = 0).

207097 <location>Drive: Test signal error distance limiting

Drive object: SERVO_828, SERVO_COMBI

Message value: Fault cause: %1, traversing distance: %2

Reaction: OFF3 (NONE, OFF1, OFF2)

Acknowledge: IMMEDIATELY

Cause:	An error was identified when executing the "Test signal" function (p5307.1 = 1) or auto tuning was selected (p5300 = 1). The function was not executed or was canceled. Fault value (r0949, interpret decimal): yyyyxxxx hex: yyyy = error cause, xxxx = traversing distance Fault cause = 4: - travel distance to the EPOS software limit switch is not sufficient. See also: p5307 (Activate One Button Tuning test signal), p5308 (One Button Tuning test signal distance limiting), p5309 (One Button Tuning test signal duration)
Remedy:	- enter the traversing path in parameter p5308 - or deselect the function involved in p5301. - for fault cause = 1, 2, shorter traversing paths may be possible. For fault cause = 1: - deselect bit 0 and bit 1 in parameter p5301. For fault cause = 2: - deselect bit 2 in parameter p5301. For fault cause = 3: - deselect bit 4 and bit 5 in parameter p5301. For fault cause = 4: - change the travel direction of One Button Tuning via p5308. - increase the clearance to the EPOS software limit switch by manually traversing.

207098 <location>Drive: One Button Tuning configuration error

Drive object:	SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	OFF3 (NONE, OFF1, OFF2)
Acknowledge:	IMMEDIATELY
Cause:	The requested One Button Tuning configuration (p5301) is not supported. Fault value (r0949, interpret binary): Bit 5: The function requires that the "Advanced Positioning Control" function module (APC) is activated. See also: p3700 (AVS/APC configuration), p5301 (One Button Tuning configuration)
Remedy:	For bit 5 = 1: - activate the "APC" function module (r0108.7 = 1). - activate the "APC without sensor on the load side" function (p3700.2 = 1).

207100 <location>Drive: Sampling times cannot be reset

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Parameter: %1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	When resetting drive parameter (p0976) sampling times cannot be reset using p0111, p0112, p0115. Fault value (r0949, interpret decimal): Parameter whose setting prevents the sampling times being reset. See also: r0110 (Basic sampling times)
Remedy:	- continue to work with the set sampling times. - before resetting the drive parameters, set the basic clock cycle p0110[0] to the original value. See also: r0110 (Basic sampling times)

207110 <location>Drive: Sampling times and basic clock cycle do not match

Drive object:	All objects
Message value:	Parameter: %1

Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	The parameterized sampling times do not match the basic clock cycle. Fault value (r0949, interpret decimal): The fault value specifies the parameter involved. See also: r0110, r0111, p0115
Remedy:	Enter the current controller sampling times so that they are identical to the basic clock cycle, e.g. by selecting p0112. Note which basic clock cycle is selected in p0111. The sampling times in p0115 can only be changed manually in the sampling times pre-setting "Expert" (p0112). See also: r0110, r0111, p0112, p0115

207140 <location>Drive: current controller sampling time for spindle does not match

Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The parameterized current controller sampling time for the spindle has been set too high.
Remedy:	Set the sampling time equal to or less than the value in r5034 (p0112, p0115). See also: p0112, p0115, r5034

207200 <location>Drive: Master control ON command present

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The ON/OFF1 command is present (no 0 signal). The command is either influenced via binector input p0840 (current CDS) or control word bit 0 via the master control.
Remedy:	Switch the signal via binector input p0840 (current CDS) or control word bit 0 via the master control to 0.

207220 <location>Drive: Master control by PLC missing

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	Infeed: OFF1 (NONE, OFF2) Servo: OFF1 (NONE, OFF2, OFF3, STOP2) Hla: OFF1 (NONE, OFF2, OFF3, STOP2)
Acknowledge:	IMMEDIATELY
Cause:	The "master control by PLC" signal was missing in operation. - interconnection of the binector input for "master control by PLC" is incorrect (p0854). - the higher-level control has withdrawn the "master control by PLC" signal. - data transfer via the fieldbus (master/drive) was interrupted.
Remedy:	- check the interconnection of the binector input for "master control by PLC" (p0854). - check the "master control by PLC" signal and, if required, switch in. - check the data transfer via the fieldbus (master/drive). Note: If the drive should continue to operate after withdrawing "master control by PLC" then fault response must be parameterized to NONE or the message type should be parameterized as alarm.

207300 <location>Drive: Line contactor feedback signal missing

Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value:	-

Reaction:	OFF2 (NONE)
Acknowledge:	IMMEDIATELY
Cause:	- the line contactor was not able to be closed within the time in p0861. - the line contactor was not able to be opened within the time in p0861. - the line contactor dropped out during operation - the line contactor has closed although the drive converter is switched off.
Remedy:	- check the setting of p0860. - check the feedback circuit from the line contactor. - increase the monitoring time in p0861. - for G150LE (power expansion)/G150HP (High Power), the following applies: If, contrary to the appropriate specifications, the circuit breakers are monitored using the line contactor control of drive object B_INF then, for B_INF, parameter p0869.1 must be set = 0. See also: p0860 (Line contactor feedback signal), p0861 (Line contactor monitoring time)

207300 <location>Drive: Line contactor feedback signal missing

Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2 (NONE)
Acknowledge:	IMMEDIATELY
Cause:	- the line contactor was not able to be closed within the time in p0861. - the line contactor was not able to be opened within the time in p0861. - the line contactor dropped out during operation - the line contactor has closed although the drive converter is switched off.
Remedy:	- check the setting of p0860. - check the feedback circuit from the line contactor. - increase the monitoring time in p0861. See also: p0860 (Line contactor feedback signal), p0861 (Line contactor monitoring time)

207320 <location>Drive: Automatic restart interrupted

Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	- the specified number of restart attempts (p1211) has been completely used up because within the monitoring time (p1213) the faults were not able to be acknowledged. The number of restart attempts (p1211) is decremented at each new start attempt. - the monitoring time for the power unit has expired (p0857). - when exiting commissioning or at the end of the motor identification routine or the speed controller optimization, the drive unit is not automatically switched on again. Fault value (r0949, interpret hexadecimal): Only for internal Siemens troubleshooting.
Remedy:	- increase the number of restart attempts (p1211). The actual number of starting attempts is displayed in r1214. - increase the delay time in p1212 and/or the monitoring time in p1213. - either increase or disable the monitoring time of the power unit (p0857).

207321 <location>Drive: Automatic restart active

Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE

Cause:	The automatic restart (AR) is active. When the line supply returns and/or the causes of the existing faults are removed the drive is automatically restarted. The pulses are enabled and the motor starts to rotate.
Remedy:	- the automatic restart (AR) should, if required, be inhibited (p1210 = 0). - an automatic restart can be directly interrupted by withdrawing the switch-on command (BI: p0840).

207329 <location>Drive: kT estimator, kT(iq) characteristic or voltage compensation does not function

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: A function of the function module "extended torque control" (r0108.1) was activated - however the (complete) function is not available.

Alarm value (r2124, interpret decimal):

1 ... 3: The kT estimator is active (p1780.3 = 1) without a functioning compensation of the voltage emulation error in the drive converter. This means that the accuracy is severely restricted.

1: The drive converter voltage emulation error "final value" is 0 (p1952).

2: The drive converter voltage emulation error "current offset" is 0 (p1953).

3: The compensation of the voltage emulation error is disabled (p1780.8 = 0).

4: The kT estimator (p1780.3 = 1), the kT(iq) characteristic (p1780.9 = 1) or the compensation of the voltage emulation error (p1780.8 = 1) was activated without activating the function module "extended torque control" (when the function module is activated, the following must apply: r0108.1 = 1).

5: the kT(iq) characteristic has been activated (p1780.9 = 1). However, the kT characteristic value kT1 is 0 (p0645). The function is not active.

Remedy: For alarm value = 1, 2:

- carry out an identification of the voltage emulation error in the drive converter (p1909.14 = 1, p1910 = 1).
- set the parameter to compensate the voltage emulation error in the drive converter (p1952, p1953).

For alarm value = 3:

- enable the compensation of the voltage emulation error in the drive converter (p1780.8 = 1).

For alarm value = 4:

- activate the function module "extended torque control" (r0108.1 = 1) or deactivate the corresponding functions (p1780.3 = 0, p1780.8 = 0, p1780.9 = 0).

For alarm value = 5:

- determine the parameters of the kT characteristic (p0645 ... p0648) using the rotating measurement (p1959.6, p1960).
- enter the parameters of the kT characteristic (p0645 ... p0648) (if known).
- if necessary, deactivate the kT characteristic (p1780.9 = 0).

207334 <location>Function not possible

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF1 (NONE, OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause: For this configuration, the selected function is not possible.

Fault value (r0949, interpret decimal):

0:

Function "Travel to fixed end stop" (p1545) was selected, although encoderless operation or U/f operation is active.

Remedy: For fault value = 0:

- Operate the closed-loop speed control with an encoder.
- If necessary, deselect function "Travel to fixed stop".

207350 <location>Drive: Measuring probe parameterized to a digital output

Drive object: All objects

Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The measuring probe is connected to a bi-directional digital input/output and the terminal is set as output. Alarm value (r2124, interpret decimal): 8: DI/DO 8 (X122.9/X132.1) 9: DI/DO 9 (X122.10/X132.2) 10: DI/DO 10 (X122.12/X132.3) 11: DI/DO 11 (X122.13/X132.4) 12: DI/DO 12 (X132.9) 13: DI/DO 13 (X132.10) 14: DI/DO 14 (X132.12) 15: DI/DO 15 (X132.13) Regarding the terminal designation: The first designation is valid for CU320, the second for CU305.
Remedy:	- set the terminal as input (p0728). - deselect the measuring probe (p0488, p0489, p0580).

207351	<location>Drive: Measuring probe parameterized to a digital output
Drive object:	SERVO_828
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The measuring probe is connected to a bi-directional digital input/output and the terminal is set as output. Alarm value (r2124, interpret decimal): 0: DI/DO 0 distributed (X3.2) 1: DI/DO 1 distributed (X3.4)
Remedy:	- set the terminal as input (p4028). - deselect the probe (p0488, p0489). See also: p0488, p0489, p4028

207354	<location>Drive: Cogging torque compensation not possible
Drive object:	SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1, drive data set: %2
Reaction:	NONE
Acknowledge:	NONE

Cause:	Cogging torque compensation is selected and is not (completely) supported. Alarm value (r2124, interpret hexadecimal): yyyyxx hex: yyyy = fault cause, xx = drive data set yyyy = 1: The encoder evaluation does not support this function. yyyy = 2: The encoder has no absolute information. yyyy = 3: The motor has no encoder (p0187 = 99). yyyy = 3: The motor has no encoder (p0187 = 99). yyyy = 4: Learning was activated (p5251) for closed-loop control without encoder (p1300 = 20 or p1404 < 12 rpm or 12 m/min - or p1317 = 1). yyyy = 5: The internal table is active; however, period p5253 has not been set equal to 1.
Remedy:	If required, deselect the cogging torque compensation (p5250 = 0). For fault cause = 1: Use an absolute encoder or an encoder evaluation that supports the function (r0459.13 = 1). If required, upgrade the firmware to a newer version (version 04.50.30.01 or higher is required). For fault cause = 2: Use an encoder with absolute information (absolute track, unique zero mark, resolver with one pole pair). The function cannot be tested as long as the encoder is not reset after learning (encoder fault, parking, POWER ON). Continuous use is not recommended. For fault cause = 3: Only select cogging torque compensation for operation with motor encoder. For fault cause = 4: Activate learning, only for operation with encoder (p1300, p1404, p1317). For fault cause = 5: - set period p5253 = 1. - activate the external table and learning (p5250.0 = 1, p5251). See also: p5250 (Compensation configuration), p5251 (Activate learn cogging torque compensation)

207355 <location>Drive: cogging torque compensation error when learning

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF1 (NONE, OFF2)
Acknowledge:	IMMEDIATELY
Cause:	A cogging torque compensation error has occurred while learning. Fault value (r0949, interpret decimal): 1: The learning velocity is too high. - rotating: absolute value greater than 5 [rpm] - linear: absolute value greater than 0.5 [m/min] 2: The commutation angle offset (p0431) is incorporated in the position and was changed.

Remedy: For fault value = 1:
Repeat learning with the lower velocity setpoint.
Recommended speeds:
- rotating 2 [rpm]
- linear 0.1 [m/min]
For fault value = 2:
New learning required, which must be saved.
See also: p5250 (Compensation configuration), p5251 (Activate learn cogging torque compensation)

207356 **<location>Drive: Cogging torque compensation motor or encoder serial number different**

Drive object: SERVO_828, SERVO_COMBI

Message value: Fault cause: %1, drive data set: %2

Reaction: NONE

Acknowledge: NONE

Cause: Cogging torque compensation is activated via external table (p5260, p5261) (p5250.0 = 1), not active or incorrectly parameterized.
Alarm value (r2124, interpret hexadecimal):
yyyyxx hex: yyyy = fault cause, xx = drive data set
yyyy = 1:
Motor or encoder were replaced, or external table was not learned.
yyyy = 2:
Cogging torque compensation via external table was activated for more than one motor data set, and the serial numbers do not match. There is only one external table.
yyyy = 3:
Cogging torque compensation via external table was activated for more than one motor data set, and p0826 indicates that different motors are involved. There is only one external table.
yyyy = 4:
Cogging torque compensation via external table was activated for data sets with different encoder data sets (EDS). Cogging torque compensation with external table only supports one encoder.

Remedy: For fault cause = 1:
Relearn cogging torque table (p5251).
For fault cause = 2:
Only activate cogging torque compensation with external table for motor data sets (MDS) with the same motor (p5250.0).
For fault cause = 3:
Only activate cogging torque compensation with external table for motor data sets (MDS) with the same motor (p5250.0). For the same motor, set p0826 to the same value.
For fault cause = 4:
Only activate cogging torque compensation with external table for data sets with the same encoder (p5250.0, p0187).
See also: p5250 (Compensation configuration), p5251 (Activate learn cogging torque compensation)

207400 **<location>Drive: DC link voltage maximum controller active**

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The DC link voltage controller has been activated because of the upper switch-in threshold (p1244).
A system deviation can occur between the setpoint and actual speed.
See also: r0056 (Status word, closed-loop control), p1240 (Vdc controller or Vdc monitoring configuration)

Remedy: Not necessary.
This alarm is automatically withdrawn after the upper threshold has been distinctly exceeded.
Otherwise, apply the following measures:

- use a Braking Module or regenerative feedback unit.
- increase the ramp-down times (p1121, p1135).
- shut down the Vdc_max controller (p1240 = 0).

207402 <location>Drive: DC link voltage minimum controller active

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The DC link voltage controller has been activated due to the lower switch-in threshold (p1248).
A system deviation can occur between the setpoint and actual speed.
A possible cause can be e.g. that the line supply has failed.
See also: r0056 (Status word, closed-loop control), p1240 (Vdc controller or Vdc monitoring configuration), p1248 (DC link voltage threshold lower)

Remedy: Not necessary.
This alarm is automatically withdrawn after the lower threshold has been distinctly exceeded.
Otherwise, apply the following measures:

- check the line supply and infeed.
- increase the ramp-up times (p1120).
- shut down the Vdc_min controller (p1240 = 0).

207403 <location>Drive: Lower DC link voltage threshold reached

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF1 (NONE, OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause: The DC link voltage monitoring is active (p1240 = 5, 6) and the lower DC link voltage threshold (p1248) was reached in the "Operation" state.

Remedy:

- check the line supply voltage.
- check the infeed.
- reduce the lower DC link threshold (p1248).
- switch out (disable) the DC link voltage monitoring (p1240 = 0).

207404 <location>Drive: Upper DC link voltage threshold reached

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2 (NONE, OFF1, OFF3)

Acknowledge: IMMEDIATELY

Cause: The DC link voltage monitoring is active (p1240 = 4, 6) and the upper DC link voltage threshold (p1244) was reached in the "Operation" state.

Remedy:

- check the line supply voltage.
- check the infeed unit or the Braking Module.
- increase the upper DC link voltage threshold (p1244).
- if necessary, deactivate the DC link voltage monitoring (p1240 = 0).

207405 <location>Drive: Kinetic buffering minimum speed fallen below

Drive object: SERVO_828, SERVO_COMBI

Message value:	-
Reaction:	OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2)
Acknowledge:	IMMEDIATELY
Cause:	During kinetic buffering the speed fell below minimum speed (p1257 or p1297 for vector drives with U/f control) and the line supply did not return.
Remedy:	Check the speed threshold for the Vdc_min controller (kinetic buffering) (p1257, p1297).

207410 <location>Drive: Current controller output limited

Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2 (NONE, OFF1)
Acknowledge:	IMMEDIATELY
Cause:	The condition " $I_{act} = 0$ and $U_q_set_1$ longer than 16 ms at its limit" is present and can be caused by the following: - motor not connected or motor contactor open. - no DC link voltage present. - Motor Module defective.
Remedy:	- connect the motor or check the motor contactor. - check the DC link voltage (r0070). - check the Motor Module.

207411 <location>Drive: Flux controller output limited

Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2 (NONE, OFF1)
Acknowledge:	IMMEDIATELY
Cause:	The specified flux setpoint cannot be reached, although the set maximum field current is specified (p1603). - incorrect motor data. - motor data and motor configuration (star-delta) do not match. - the current limit has been set too low for the motor (p0640, p0323, p1603). - induction motor (encoderless, open-loop controlled) in I2t limiting. - the Motor Module is too small.
Remedy:	- correct the motor data. - check the motor configuration. - correct the current limits (p0640, p0323, p1603). - reduce the induction motor load. - if required, use a larger Motor Module.

207412 <location>Drive: Commutation angle incorrect (motor model)

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	ENCODER (NONE, OFF2)
Acknowledge:	IMMEDIATELY

Cause:	An incorrect commutation angle was detected that can result in a positive coupling in the speed controller. Possible causes: - the phase sequence of the output phases for the motor is incorrect (e.g. the phases are interchanged). - the motor encoder is incorrectly adjusted with respect to the magnet position. - the motor encoder is damaged. - the angular commutation offset is incorrectly set (p0431). - data to calculate the motor model has been incorrectly set (p0356 (motor-stator leakage inductance) and/or p0350 (motor-stator resistance) and/or p0352 (cable resistance)). - the changeover speed for the motor model is too low (p1752). The monitoring function only becomes effective above the changeover speed. - pole position identification might have calculated an incorrect value when activated (p1982 = 1). - the motor encoder speed signal is faulted. - the control loop is instable due to incorrect parameterization. Fault value (r0949, interpret decimal): SERVO: 0: The comparison of the pole position angle from the encoder and motor model resulted in an excessively high value (p1778[1] > 80 ° electrical). 1: - VECTOR: 0: The comparison of the pole position angle from the encoder and motor model resulted in an excessively high value (> 45 ° electrical). 1: The change in the speed signal from the motor encoder has changed by > p0492 within a current controller clock cycle.
Remedy:	- check the phase sequence for the motor, and if required, correct (wiring, p1820). - if the encoder mounting was changed - re-adjust the encoder. - replace the defective motor encoder. - correctly set the angular commutation offset (p0431). If required, determine using p1990. - correctly set the motor stator resistance, cable resistance and motor-stator leakage inductance (p0350, p0352, p0356). Calculate the cable resistance from the cross-section and length, check the inductance and stator resistance using the motor data sheet, measure the stator resistance, e.g. using a multimeter - and if required, again identify the values using the stationary motor data identification (p1910). - increase the changeover speed for the motor model (p1752). The monitoring is completely deactivated for p1752 > p1082 (maximum speed). - with pole position identification activated (p1982 = 1) check the procedure for pole position identification (p1980) and force a new pole position identification procedure by means of deselection followed by selection (p1982 = 0 -> 1). Note: For High Dynamic Motors (1FK7xxx-7xxx), for applications with a higher current, if necessary, the monitoring should be disabled. See also: r1778 (Motor model flux angle difference)

207413 <location>Drive: Commutation angle incorrect (pole position identification)

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: ENCODER (NONE, OFF2)

Acknowledge: IMMEDIATELY

Cause: An incorrect commutation angle was detected that can result in a positive coupling in the speed controller.

Within the pole position identification routine (p1982 = 2):

- a difference of > 45 ° electrical to the encoder angle was determined.

For VECTOR, within the encoder adjustment (p1990 = 2):

- a difference of > 6 ° electrical to the encoder angle was determined.

- Remedy:**
- correctly set the angular commutation offset (p0431).
 - re-adjust the motor encoder after the encoder has been replaced.
 - replace the defective motor encoder.
 - check the pole position identification routine. If the pole position identification routine is not suitable for this motor type, then disable the plausibility check (p1982 = 0).

207414 <location>Drive: Encoder serial number changed

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: ENCODER (NONE, OFF2)

Acknowledge: IMMEDIATELY

Cause: The serial number of the motor encoder of a synchronous motor has changed. The change was only checked for encoders with serial number (e.g. EnDat encoders) and build-in motors (e.g. p0300 = 401) or third-party motors (p0300 = 2).

Cause 1:

- the encoder was replaced.

Cause 2:

- a third-party, built-in or linear motor was re-commissioned.

Cause 3:

- the motor with integrated and adjusted encoder was replaced.

Cause 4:

- the firmware was updated to a version that checks the encoder serial number.

Note:

With closed-loop position control, the serial number is accepted when starting the adjustment (p2507 = 2).

When the encoder is adjusted (p2507 = 3), the serial number is checked for changes and if required, the adjustment is reset (p2507 = 1).

Proceed as follows to hide serial number monitoring:

- set the following serial numbers for the corresponding Encoder Data Set: p0441 = FF, p0442 = 0, p0443 = 0, p0444 = 0, p0445 = 0.

- parameterize F07414 as message type N (p2118, p2119).

Remedy: For causes 1, 2:

Carry out an automatic adjustment using the pole position identification routine. Acknowledge fault. Initiate the pole position identification routine with p1990 = 1. Then check that the pole position identification routine is correctly executed.

SERVO:

If a pole position identification technique is selected in p1980, and if p0301 does not contain a motor type with an encoder adjusted in the factory, then p1990 is automatically activated.

or

Set the adjustment via p0431. In this case, the new serial number is automatically accepted.

or

Mechanically adjust the encoder. Accept the new serial number with p0440 = 1.

For causes 3, 4:

Accept the new serial number with p0440 = 1.

207415 <location>Drive: Angular commutation offset transfer running

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: NONE

Cause: The angular commutation offset was automatically determined using p1990 = 1.

This fault causes the pulses to be suppressed - this is necessary to transfer the angular commutation offset to p0431.

See also: p1990 (Encoder adjustment determine angular commutation offset)

Remedy: The fault can be acknowledged without any additional measures.

207419 <location>Drive: Current setpoint filter adaptation error**Drive object:** SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:** OFF1 (OFF2, OFF3)**Acknowledge:** IMMEDIATELY

Cause: An error has occurred when configuring or when using the "Current setpoint filter adaptation" function.
Fault value (r0949, interpret binary):
Bit 0: a filter has still not been assigned (p5281).
Bit 1: the assigned filter belongs to the "Extended current setpoint filter" function module that has not been activated (r0108.21).
Bit 2: the assigned filter is a type or has a characteristic, which is unsuitable for adaptation.
Bit 3: the assigned filter has not been activated (p1656, p5200).
Bit 4 ... 15: internal fault occurred.
Bit 16 ... 31: number of the drive data set with fault.
See also: p5280 (Current setpoint filter adaptation configuration), p5281 (Current setpoint filter adaptation assignment)

Remedy: The message can always be removed by deactivating adaptation (p5280 = 0, -1).
If adaptation is to remain active, then the countermeasure should be applied depending on the particular fault value.
For bit 0:
Assign the filter (p5281).
For bit 1:
activate the "Extended current setpoint filter" function module (r0108.21).
For bit 2:
Set the filter type "General filter 2nd order" and set the characteristic of a bandstop filter.
For bit 3:
Activate filter (p1656, p5200).
For bits 4 ... 15:
- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade firmware to later version.
See also: p5280 (Current setpoint filter adaptation configuration), p5281 (Current setpoint filter adaptation assignment)

207420 <location>Drive: Current setpoint filter natural frequency > Shannon frequency**Drive object:** A_INF_828**Message value:** %1**Reaction:** NONE (OFF1, OFF2)**Acknowledge:** IMMEDIATELY (POWER ON)

Cause: One of the filter natural frequencies is greater than the Shannon frequency.
The Shannon frequency is calculated according to the following formula: $0.5 / p0115[0]$
Fault value (r0949, interpret binary):
Bit 3: Filter 4 (p1673, p1675)
Bit 16: Filter 5 (p5202, p5204)
Bit 18: Filter 7 (p5212, p5214)

Remedy: - reduce the numerator or denominator natural frequency of the current setpoint filter involved.
- reduce the current controller sampling time (p0115[0]).
- switch out the filter involved (p1656).

207420 <location>Drive: Current setpoint filter natural frequency > Shannon frequency**Drive object:** SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:** NONE (OFF1, OFF2, OFF3)**Acknowledge:** IMMEDIATELY (POWER ON)

Cause:	One of the filter natural frequencies is greater than the Shannon frequency. The Shannon frequency is calculated according to the following formula: $0.5 / p0115[0]$ Fault value (r0949, interpret binary): Bit 0: Filter 1 (p1658, p1660) Bit 1: Filter 2 (p1663, p1665) Bit 2: Filter 3 (p1668, p1670) Bit 3: Filter 4 (p1673, p1675) Bit 8 ... 15: Data set number (starting from zero) Bit 16: Filter 5 (p5202, p5204) - extended current setpoint filter (r0108.21) Bit 17: Filter 6 (p5207, p5209) - extended current setpoint filter (r0108.21) Bit 18: Filter 7 (p5212, p5214) - extended current setpoint filter (r0108.21) Bit 19: Filter 8 (p5217, p5219) - extended current setpoint filter (r0108.21) Bit 20: Filter 9 (p5222, p5224) - extended current setpoint filter (r0108.21) Bit 21: Filter 10 (p5227, p5229) - extended current setpoint filter (r0108.21)
Remedy:	- reduce the numerator or denominator natural frequency of the current setpoint filter involved. - reduce the current controller sampling time (p0115[0]). - switch out the filter involved (p1656).

207421 <location>Drive: Speed filter natural frequency > Shannon frequency

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE (OFF1, OFF2, OFF3)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	One of the filter natural frequencies is greater than the Shannon frequency. The Shannon frequency is calculated according to the following formula: $0.5 / p0115[1]$ Fault value (r0949, interpret binary): Bit 0: Filter 1 (p1417, p1419) Bit 1: Filter 2 (p1423, p1425) Bit 4: Actual value filter (p1447, p1449) Bit 8 ... 15: Data set number (starting from zero)
Remedy:	- reduce the numerator or denominator natural frequency of the speed setpoint filter involved. - reduce the speed controller sampling time (p0115[1]). - switch off the filter involved (p1413, p1414).

207422 <location>Drive: Reference model natural frequency > Shannon frequency

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE (OFF1, OFF2, OFF3)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The natural filter frequency of the PT2 element for the reference model (p1433) is greater than the Shannon frequency. The Shannon frequency is calculated according to the following formula: $0.5 / p0115[1]$
Remedy:	- reduce the natural frequency of PT2 element for reference model (p1433). - reduce the speed controller sampling time (p0115[1]).

207429 <location>Drive: DSC without encoder not possible

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)

Cause: The function DSC (Dynamic Servo Control) was activated although there is no encoder.
See also: p1191 (DSC position controller gain KPC), p1192 (DSC encoder selection)

Remedy: Check the encoder selection configuration (p1192).

Note:
If there is no encoder and connector input p1191 (DSC position controller gain) is interconnected, then connector input p1191 must have a 0 signal.

207430 <location>Drive: Changeover to open-loop torque controlled operation not possible

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2 (NONE, OFF1, OFF3)

Acknowledge: IMMEDIATELY

Cause: For encoderless operation, the converter cannot change over to closed-loop torque-controlled operation (BI: p1501).

Remedy: Do not attempt to cover over to closed-loop torque-controlled operation.

207431 <location>Drive: Changeover to encoderless operation not possible

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2 (OFF1)

Acknowledge: IMMEDIATELY

Cause: For closed-loop torque control, the converter cannot change over to encoderless operation (p1404).

Remedy: Do not attempt to change over to encoderless operation.

207432 <location>Drive: Motor without overvoltage protection

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2 (OFF1)

Acknowledge: IMMEDIATELY

Cause: In the case of a fault at maximum speed, the motor can generate an overvoltage that can destroy the drive system.
Fault value (r0949, interpret hexadecimal):
Associated Drive Data Set (DDS).

Remedy:	Overvoltage protection can be implemented in the following ways: 1. Limit the maximum speed (p1082) without any additional protection. The maximum speed without protection is calculated as follows: Rotary synchronous motors: $p1082 \text{ [rpm]} \leq 11.695 * r0297/p0316 \text{ [Nm/A]}$ Linear motors: $p1082 \text{ [m/min]} \leq 73.484 * r0297/p0316 \text{ [N/A]}$ Rotary synchronous motor connected to the high-frequency converter: $p1082 \text{ [rpm]} \leq 4.33165E9 * (-p0316 + \sqrt{p0316^2 + 4.86E-9 * (r0297 * r0313)^2 * (r0377 - p0233) \text{ [mH]} * p0234 \text{ [}\mu\text{F}]}) / (r0297 * r0313^2 * (r0377 - p0233) \text{ [mH]} * p0234 \text{ [}\mu\text{F]})$ Linear motor connected to the high-frequency converter: $p1082 \text{ [m/min]} \leq 689.403 * p0315 * (\sqrt{p0316^2 * p0315^2 + 0.191865 * r0297^2 * (r0377 - p0233) \text{ [mH]} * p0234 \text{ [}\mu\text{F]}}) / (r0297 * (r0377 - p0233) \text{ [mH]} * p0234 \text{ [}\mu\text{F]})$ Rotary induction motor connected to the high-frequency converter: $p1082 \text{ [rpm]} \leq \text{maximum} (2.11383E5 / (r0313 * \sqrt{(r0377 \text{ [mH]} + r0382 \text{ [mH]}) * p0234 \text{ [}\mu\text{F]}}); 0.6364 * r0297 * p0311 \text{ [rpm]} / p0304)$ 2. Use a Voltage Protection Module (VPM) in conjunction with the function "Safe Torque Off" (p9601, p9801 – only for synchronous motors). When using a synchronous motor with VPM at the high-frequency converter, the following must apply: $p1082 \text{ [rpm]} \leq p0348 * (r0377 + p0233) / p0233$ When a fault condition exists, the VPM short-circuits the motors. During the short-circuit, the pulses must be suppressed - this means that the terminals for the function "Safe Torque Off" (STO) must be connected to the VPM. When using a VPM, p0643 must be set to 1. 3. Activate the internal voltage protection (p1231 = 3, only for synchronous motors). In so doing, the following hardware preconditions must be fulfilled: - the infeed of the group must be capable of energy recovery (Active Line Module, Smart Line Module), and the energy recovery power of the infeed must not be less than the maximum utilized S1 power of the synchronous motor. - For Control Unit and infeed, a 24 V power supply other than that for the Motor Module must be used with the voltage protection activated. The 24 V power supply of this Motor Module must be DC link buffered (e.g. CSM). - a Braking Module with a correspondingly configured braking resistor must be available at the DC link. - the synchronous motor must be short-circuit proof. See also: p0643 (Overvoltage protection for synchronous motors), p1231 (Armature short-circuit / DC braking configuration)
----------------	---

207433	<location>Drive: Closed-loop control with encoder is not possible as the encoder has not been unparked
Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE (OFF1, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	The changeover to closed-loop control with encoder is not possible as the encoder has not been unparked.
Remedy:	- check whether the encoder firmware supports the "parking" function (r0481.6 = 1). - upgrade the firmware. Note: For long-stator motors (p3870.0 = 1), the following applies: The encoder must have completed the unparking procedure (r3875.0 = 1) before a changeover can be made to closed-loop control with encoder. The encoder is unparked using binector input p3876 = 0/1 signal and remains until a 0 signal in this state.
207434	<location>Drive: It is not possible to change the direction of rotation with the pulses enabled
Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2
Acknowledge:	IMMEDIATELY

Cause: A drive data set was selected - with the pulses enabled - which has a different parameterized direction of rotation (p1821). It is only possible to change the motor direction of rotation using p1821 when the pulses are inhibited.

Remedy: - change over the drive data set with the pulses inhibited.
- ensure that the changeover to a drive data set does not result in the motor direction of rotation being changed (i.e. for these drive data sets, the same value must be in p1821).
See also: p1821

207435 <location>Drive: Setting the ramp-function generator for sensorless vector control

Drive object: HLA_828

Message value: Parameter: %1

Reaction: Hla: OFF2 (NONE, OFF1, OFF3)

Acknowledge: IMMEDIATELY

Cause: During operation with sensorless vector control (r1407.1) the ramp-function generator was stopped (p1141) or bypassed (p1122). An internal setting command of the ramp-function generator output caused the set setpoint speed to be frozen or was not able to be realized.

The drive is switched-on with flying restart activated (p1200), and at the same time the ramp-function generator is bypassed (p1122).

Remedy: - deactivate the holding command for the ramp-function generator (p1141).
- do not bypass the ramp-function generator (p1122).
- suppress the fault (p2101, p2119). This is necessary if the ramp-function generator is held using jogging and the speed setpoint is simultaneously inhibited (r0898.6).

Note:

For sensorless vector control it is not practical to read in the main setpoint of the speed control via p1155 or p1160 (p0922). In this case, the main setpoint should be injected before the ramp-function generator (p1070). The reason for this is that the ramp-function generator output is automatically set when transitioning from closed-loop speed controlled into open-loop speed controlled operation.

207439 <location>Drive: Function not supported

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2 (NONE)

Acknowledge: IMMEDIATELY

Cause: The power unit does not support the selected function.

Fault value (r0949, interpret decimal):

1:

The function "Current controller dynamic response higher" is selected (p1810.11 = 1), however, this is not supported by the power unit (r0192.27 = 0).

- firmware of the booksize power unit is not up-to-date.
- blocksize power unit was used.

2:

The function "Current controller dynamic response higher" is selected (p1810.11 = 1), however, this is not supported by the safety technology without encoder (9506 = 1, 3).

3:

The function "DC link voltage compensation in the power unit" is selected (p1810.1 = 1), however, this is not supported by the power unit (r0192.28 = 0).

Remedy:

For fault value = 1:

- if necessary, upgrade the firmware of the booksize power unit to a later version (version ≥ 4.4).

Note:

If the firmware has already been automatically upgraded, then only a POWER ON (switch-off/switch-on) is required.

- Use a booksize power unit (version ≥ 4.4).

For fault value = 2:

- if an encoder with Safety position actual values sensing is available (r0458[0...2].19 = 1), reparameterize the encoderless safety technology (p9506 = 1, 3) to safety technology with encoder (p9506 = 0).

For fault value = 1, 2:

- Deselect the function "Current controller dynamics higher" (p1810.11 = 0) and if required, set the current, speed and position controller again or calculate (p0340 = 4).

For fault value = 3:

- if necessary, upgrade the firmware of the blocksize power unit to a later version (version ≥ 4.6).
- deselect the "DC link voltage compensation in the power unit" function (p1810.1 = 0).

See also: r0192, p1810, p9506

207448 **<location>Load gear: Position tracking, linear axis has exceeded the maximum range**

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: -

Reaction: Infeed: NONE
 Servo: OFF1 (NONE, OFF2, OFF3)
 Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause: For a configured linear axis/no modulo axis, the currently effective motor encoder (encoder 1) has exceeded the maximum possible traversing range.

For the configured linear axis, the maximum traversing range is defined to be $64 \times (+/- 32 \times)$ of p0421. It should be read in p2721 and interpreted as the number of load revolutions.

Note:

Only the motor encoder in the currently effective drive data set is monitored here. The actual effective drive data set is displayed in x = r0051 and the corresponding motor encoder is specified in p0187[x].

Remedy: The fault should be resolved as follows:

- select encoder commissioning (p0010 = 4).
- reset position tracking, position (p2720.2 = 1).
- deselect encoder commissioning (p0010 = 0).

The fault should then be acknowledged and the absolute encoder adjusted.

207449 **<location>Load gear: Position tracking actual position outside tolerance window**

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: %1

Reaction: Infeed: NONE
 Servo: OFF1 (NONE, OFF2, OFF3)
 Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause:	When switched off, the currently effective motor encoder was moved through a distance greater than was parameterized in the tolerance window. It is possible that there is no longer any reference between the mechanical system and encoder. Note: Only the motor encoder in the currently effective drive data set is monitored here. The actual effective drive data set is displayed in x = r0051 and the corresponding motor encoder is specified in in p0187[x]. Fault value (r0949, interpret decimal): Deviation (difference) to the last encoder position in increments of the absolute value after the measuring gear - if one is being used. The sign designates the traversing direction. Note: The deviation (difference) found is also displayed in r2724. See also: p2722 (Load gear position tracking tolerance window), r2724 (Load gear position difference)
Remedy:	Reset the position tracking as follows: - select encoder commissioning (p0010 = 4). - reset position tracking, position (p2720.2 = 1). - deselect encoder commissioning (p0010 = 0). The fault should then be acknowledged and, if necessary, the absolute encoder adjusted (p2507). See also: p0010

207500 <location>Drive: Power unit data set PDS not configured

Drive object:	All objects
Message value:	Drive data set: %1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	Only for controlled line supply infeed/regenerative feedback units: The power unit data set was not configured - this means that a data set number was not entered into the drive data set. Fault value (r0949, interpret decimal): Drive data set number of p0185.
Remedy:	The index of the power unit data set associated with the drive data set should be entered into p0185.

207501 <location>Drive: Motor Data Set MDS not configured

Drive object:	All objects
Message value:	Drive data set: %1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	Only for power units: The motor data set was not configured - this means that a data set number was not entered into the associated drive data set. Fault value (r0949, interpret decimal): The fault value includes the drive data set number of p0186.
Remedy:	The index of the motor data set associated with the drive data set should be entered into p0186. See also: p0186 (Motor Data Sets (MDS) number)

207502 <location>Drive: Encoder Data Set EDS not configured

Drive object:	All objects
Message value:	Drive data set: %1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY

Cause:	Only for power units: The encoder data set was not configured - this means that a data set number was not entered into the associated drive data set. Fault value (r0949, interpret decimal): The fault value includes the drive data set number of p0187, p0188 and p0189. The fault value is increased by 100 * encoder number (e.g. for p0189: Fault value 3xx with xx = data set number).
Remedy:	The index of the encoder data set associated with the drive data set should be entered into p0187 (1st encoder), p0188 (2nd encoder) and p0189 (3rd encoder).

207504 <location>Drive: Motor data set is not assigned to a drive data set

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	A motor data set is not assigned to a drive object. All of the existing motor data sets in the drive data sets must be assigned using the MDS number (p0186[0...n]). There must be at least as many drive data sets as motor data sets. Alarm value (r2124, interpret decimal): Number of the motor data set that has not been assigned.
Remedy:	In the drive data sets, assign the non-assigned motor data set using the MDS number (p0186[0...n]). - check whether all of the motor data sets are assigned to drive data sets. - if required, delete superfluous motor data sets. - if required, set up new drive data sets and assign to the corresponding motor data sets. See also: p0186 (Motor Data Sets (MDS) number)

207509 <location>Drive: Component assignment missing

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	A Drive Data Set (DDS) is assigned to a Motor Data Set (MDS) or Encoder Data Set (EDS) that does not have a component number. Fault value (r0949, interpret decimal): nnmmmmxxyy nn: Number of the MDS/EDS. mmm: Parameter number of the missing component number. xx: Number of the DDS that is assigned to the MDS/EDS. yyy: Parameter number that references the MDS/EDS. Example: p0186[7] = 5: DDS 7 is assigned MDS 5. p0131[5] = 0: There is no component number set in MDS 5. Alarm value = 0513107186
Remedy:	In the drive data sets, no longer assign MDS/EDS using p0186, p0187, p0188, p0189 or set a valid component number. See also: p0131, p0141, p0142, p0186, p0187, p0188, p0189

207510 <location>Drive: Identical encoder in the drive data set

Drive object:	All objects
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY

Cause:	More than one encoder with identical component number is assigned to a single drive data set. In one drive data set, it is not permissible that identical encoders are operated together. Fault value (r0949, interpret decimal): $1000 * \text{first identical encoder} + 100 * \text{second identical encoder} + \text{drive data set}$. Example: Fault value = 1203 means: In drive data set 3, the first (p0187[3]) and second encoder (p0188[3]) are identical.
Remedy:	Assign the drive data set to different encoders. See also: p0141, p0187 (Encoder 1 encoder data set number), p0188 (Encoder 2 encoder data set number), p0189 (Encoder 3 encoder data set number)

207511 <location>Drive: Encoder used a multiple number of times

Drive object:	All objects
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	Each encoder may only be assigned to one drive and within a drive must - in each drive data set - either always be encoder 1, always encoder 2 or always encoder 3. This unique assignment has been violated. Fault value (r0949, interpret decimal): The two parameters in coded form, that refer to the same component number. First parameter: Index: First and second decimal place (99 for EDS, not assigned DDS) Parameter number: Third decimal place (1 for p0187, 2 for p0188, 3 for p0189, 4 for EDS not assigned DDS) Drive number: Fourth and fifth decimal place Second parameter: Index: Sixth and seventh decimal place (99 for EDS, not assigned DDS) Parameter number: Eighth decimal place (1 for p0187, 2 for p0188, 3 for p0189, 4 for EDS, not assigned DDS) Drive number: Ninth and tenth decimal place See also: p0141
Remedy:	Correct the double use of a component number using the two parameters coded in the fault value.

207512 <location>Drive: Encoder data set changeover cannot be parameterized

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	Using p0141, a changeover of the encoder data set is prepared that is illegal. In this firmware release, an encoder data set changeover is only permitted for the components in the actual topology. Fault value (r0949, interpret decimal): Incorrect EDS data set number. See also: p0187 (Encoder 1 encoder data set number), p0188 (Encoder 2 encoder data set number), p0189 (Encoder 3 encoder data set number)
Remedy:	Every encoder data set must be assigned its own dedicated DRIVE-CLiQ socket. The component numbers of the encoder interfaces (p0141) must have different values within a drive object. The following must apply: p0141[0] not equal to p0141[1] not equal to ... not equal to p0141[n]

207514 <location>Drive: Data structure does not correspond to the interface module

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE

Acknowledge:	NONE
Cause:	The interface mode "SIMODRIVE 611 universal" was set (p2038 = 1) and the data structure does not correspond to this mode. The following settings are possible, depending on the number of data sets: Number of DDS/MDS (p0180/p0130): p0186 1/1: p0186[0] = 0 2/2: p0186[0] = 0, p0186[1] = 1 4/4: p0186[0] = 0, p0186[1] = 1, p0186[2] = 2, p0186[3] = 3 8/8: p0186[0] = 0, p0186[1] = 1, p0186[2] = 2 ... p0186[7] = 7 16/16: p0186[0] = 0, p0186[1] = 1, p0186[2] = 2 ... p0186[15] = 15 32/32: p0186[0] = 0, p0186[1] = 1, p0186[2] = 2 ... p0186[31] = 31 2/1: p0186[0, 1] = 0 4/2: p0186[0, 1] = 0, p0186[1, 2] = 1 8/4: p0186[0, 1] = 0, p0186[1, 2] = 1, p0186[3, 4] = 2, p0186[5, 6] = 3 16/8: p0186[0, 1] = 0, p0186[1, 2] = 1, p0186[3, 4] = 2 ... p0186[14, 15] = 7 32/16: p0186[0, 1] = 0, p0186[1, 2] = 1, p0186[3, 4] = 2 ... p0186[30, 31] = 15 4/1: p0186[0, 1, 2, 3] = 0 8/2: p0186[0, 1, 2, 3] = 0, p0186[4, 5, 6, 7] = 1 16/4: p0186[0, 1, 2, 3] = 0, p0186[4, 5, 6, 7] = 1, p0186[8, 9, 10, 11] = 2, p0186[12, 13, 14, 15] = 3 32/8: p0186[0, 1, 2, 3] = 0, p0186[4, 5, 6, 7] = 1, p0186[8, 9, 10, 11] = 2 ... p0186[28, 29, 30, 31] = 7 8/1: p0186[0...7] = 0 16/2: p0186[0...7] = 0, p0186[8...15] = 1 32/4: p0186[0...7] = 0, p0186[8...15] = 1, p0186[16...23] = 2, p0186[24...31] = 3 16/1: p0186[0...15] = 0 32/2: p0186[0...15] = 0, p0186[16...31] = 1 32/1: p0186[0...31] = 0 9/2: p0186[0...7] = 0, p0186[8] = 1 10/2: p0186[0...7] = 0, p0186[8, 9] = 1 12/2: p0186[0...7] = 0, p0186[8...11] = 1 See also: p0180, p0186, p2038
Remedy:	- check the data structure according to the possible settings mentioned in the cause. - check the interface mode (p2038).

207515	<location>Drive: Power unit and motor incorrectly connected
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	A power unit (via PDS) was assigned to a motor (via MDS) in a drive data set that is not connected in the target topology. It is possible that a motor has not been assigned to the power unit (p0131). Fault value (r0949, interpret decimal): Number of the incorrectly parameterized drive data set.
Remedy:	- assign the drive data set to a combination of motor and power unit permitted by the target topology. - adapt the target topology. - if required, for a missing motor, recreate the component (drive Wizard). See also: p0121 (Power unit component number), p0131 (Motor component number), p0186 (Motor Data Sets (MDS) number)

207516	<location>Drive: Re-commission the data set
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE

Acknowledge:	IMMEDIATELY
Cause:	The assignment between the drive data set and motor data set (p0186) or between the drive data set and the encoder data set was modified (p0187). This is the reason that the drive data set must re-commissioned. Fault value (r0949, interpret decimal): Drive data set to be re-commissioned.
Remedy:	Commission the drive data set specified in the fault value (r0949).

207517 <location>Drive: Encoder data set changeover incorrectly parameterized

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	In at least two drive data sets (DDS), the same motor data set (MDS) is assigned different encoder data sets (EDS) for the motor encoder. In various DDSs, it is not permissible for an MDS to have different motor encoders. The following parameterization therefore results results in an error: DDS0: p0186[0] = 0, p0187[0] = 0 DDS1: p0186[1] = 0, p0187[1] = 1 Fault value (r0949, interpret decimal): The lower 16 bits indicate the first DDS. The upper 16 bits indicate the second DDS.
Remedy:	Create two MDS with the same motor data in order to operate one motor with different motor encoders. Example: DDS0: p0186[0] = 0, p0187[0] = 0 DDS1: p0186[1] = 1, p0187[1] = 1

207518 <location>Drive: Motor data set changeover incorrectly parameterized

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	The system has identified that two motor data sets were incorrectly parameterized. Parameter r0313 (calculated from p0314, p0310, p0311), r0315 and p1982 may only have different values if the motor data sets are assigned different motors. p0827 is used to assign the motors and/contactors. It is not possible to toggle between motor data sets. Fault value (r0949, interpret hexadecimal): xxxxyyyy: xxxx: First DDS with assigned MDS, yyyy: Second DDS with assigned MDS
Remedy:	Correct the parameterization of the motor data sets.

207519 <location>Drive: Motor changeover incorrectly parameterized

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	With the setting p0833.0 = 1, a motor changeover via the application is selected. This is the reason that p0827 must have different values in the appropriate motor data set. Alarm value (r2124, interpret hexadecimal): xxxxyyyy: xxxx: First MDS, yyyy: Second MDS
Remedy:	- parameterize the appropriate motor data sets differently (p0827). - select the setting p0833.0 = 0 (motor changeover via the drive).

207520	<location>Drive: Motor cannot be changed over
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The motor cannot be changed over. Alarm value (r2124, interpret decimal): 1: The contactor for the motor that is presently active cannot be opened, because for a synchronous motor, the speed (r0063) is greater than the speed at the start of field weakening (p0348). As long as r0063 > p0348, the current in the motor does not decay in spite of the pulses being suppressed. 2: The "contactor opened" feedback signal was not detected within 1 s. 3: The "contactor closed" feedback signal was not detected within 1 s.
Remedy:	For alarm value = 1: Set the speed lower than the speed at the start of field weakening (r0063 < p0348). For alarm value = 2, 3: Check the feedback signals of the contactor involved.
207530	<location>Drive: Drive Data Set DDS not present
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The selected drive data set is not available (p0837 > p0180). The drive data set was not changed over. See also: p0180, p0820, p0821, p0822, p0823, p0824, r0837
Remedy:	- select the existing drive data set. - set up additional drive data sets.
207531	<location>Drive: Command Data Set CDS not present
Drive object:	All objects
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The selected command data set is not available (p0836 > p0170). The command data set was not changed over. See also: p0810, r0836
Remedy:	- select the existing command data set. - set up additional command data sets.
207532	<location>Drive: Encoderless control not commissioned
Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	Encoderless operation was set as fault response to encoder faults (p0491). However, the encoderless control has not yet been commissioned. Note: In at least one drive data set (DDS) the load moment of inertia is zero (p1498 = 0). See also: p0491 (Motor encoder fault response ENCODER)

Remedy: Commission the encoderless control.
Perform the following steps to facilitate a simple setting:

- the speed controller must have already been optimized for operation with encoder (e.g. the optimized P gain is in p1460).
- set the load moment of inertia (p1498, e.g. using function module "Moment of inertia estimator/OBT" or "AST" for SINUMERIK).
- set the current setpoint for open-loop controlled operation without encoder (p1612) for static loads (e.g. vertical axis without weight compensation, preset value plus torque-generating current (r0077) for the base load).
- set the speed controller.

p1470 = optimized p1460/16 for sampling time = 125 µs (P gain)
p1470 = optimized p1460/25 for sampling time = 62.5 µs (P gain)
p1470 = optimized p1460/30 for sampling time = 31.25 µs (P gain)
p1472 = 140 ms (integral time, default value).
p1451 = 10 ms (speed actual value smoothing encoderless operation).

- set encoderless operation current reduction: $p0642 = 2 * p0318 / p0640$ (for a result > 100%, 100% should be entered).
- if the motor moment of inertia changes significantly, then the moment of inertia estimator should be activated using function module "Moment of inertia estimator/OBT".
- save the set values in a non-volatile fashion (copy RAM to ROM).
- test the function while moving with $p4642 = 1$ (encoder fault, test function).

Note:
The following must be set if Safety Extended Functions with encoder in the 1-encoder system are enabled:

- No STOP A after encoder fault for 1-encoder Safety ($p9516.4 = 1$).
- Transition time STOP F to STOP B is long enough to brake the motor ($p9555$).

If the result is not satisfactory, then encoderless operation must be manually optimized (e.g. temporarily switch over to encoderless operation using $p1300 = 20$).

Information about the moment of inertia estimator and encoderless operation is provided in the following reference:
SINAMICS S120 Function Manual Drive Functions

207541 <location>Drive: Data set changeover not possible

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The selected drive data set changeover and the assigned motor changeover are not possible and are not carried out.
For synchronous motors, the motor contactor may only be switched for actual speeds less than the speed at the start of field weakening ($r0063 < p0348$).
See also: r0063, p0348

Remedy: Reduce the speed to below the speed at the start of field weakening ($r0063 < p0348$).

207550 <location>Drive: Not possible to reset encoder parameters

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: When carrying out a factory setting (e.g. using $p0970 = 1$), it was not possible to reset the encoder parameters. The encoder parameters are directly read out of the encoder via DRIVE-CLiQ.
Alarm value (r2124, interpret decimal):
Component number of the encoder involved.

Remedy:

- repeat the operation.
- check the DRIVE-CLiQ connection.

207551	<location>Drive encoder: No commutation angle information
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1, drive data set: %2
Reaction:	Servo: OFF2 (IASC/DCBRK) Hla: OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The commutation angle information is missing. This means that synchronous motors cannot be controlled (closed-loop control) Fault value (r0949, interpret decimal): yyyyxxx dec: yyyy = fault cause, xxxx = drive data set yyyy = 1 dec: The motor encoder used does not supply an absolute commutation angle. yyyy = 2 dec: The selected ratio of the measuring gear does not match the motor pole pair number.
Remedy:	For fault cause = 1: - check the encoder parameterization (p0404). - use an encoder with track C/D, EnDat interface of Hall sensors. - use an encoder with sinusoidal A/B track for which the motor pole pair number (r0313) multiplied by the gear ratio (p0432/p0433) is less than the encoder pulse number (p0408) – or is an integer multiple of the encoder pulse number (p0408). - activate the pole position identification routine (p1982 = 1). For fault cause = 2: - the quotient of the pole pair number divided by the ratio of the measuring gear must be an integer number: (p0314 * p0433) / p0432. Note: For operation with track C/D, this quotient must be less than 8. See also: p0402 (Gearbox type selection), p0404 (Encoder configuration effective), p0432 (Gearbox factor encoder revolutions), p0433 (Gearbox factor motor/load revolutions)
207552	<location>Drive encoder: Encoder configuration not supported
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1, component number: %2, encoder data set: %3
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2) Hla: OFF2 (NONE, OFF1, OFF3, STOP2)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The requested encoder configuration is not supported. Only bits may be requested in p0404 that are signaled as being supported by the encoder evaluation in r0456. Fault value (r0949, interpret decimal): ccccbaa hex: cccc = fault cause, bb = component number, aa = encoder data set cccc = 1: encoder sin/cos with absolute track (is supported by SME25). cccc = 3: Square-wave encoder (this is supported by SMC30). cccc = 4: sin/cos encoder (this is supported by SMC20, SMI20, SME20, SME25). cccc = 10: DRIVE-CLiQ encoder (is supported by DQI). cccc = 12: sin/cos encoder with reference mark (this is supported by SME20). cccc = 15: Commutation with zero mark for separately excited synchronous motors with VECTORMV. cccc = 23: Resolver (this is supported by SMC10, SMI10). cccc = 65535: Other function (compare r0456 and p0404). See also: p0404 (Encoder configuration effective), r0456 (Encoder configuration supported)
Remedy:	- check the encoder parameterization (p0400, p0404). - use the matching encoder evaluation (r0456).

207553 <location>Drive encoder: Sensor Module configuration not supported**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** Encoder data set: %1, first incorrect bit: %2, incorrect parameter: %3**Reaction:**
Infeed: OFF2 (NONE, OFF1)
Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2)
Hla: OFF2 (NONE, OFF1, OFF3, STOP2)**Acknowledge:** IMMEDIATELY (POWER ON)**Cause:**
The Sensor Module does not support the requested configuration.
For incorrect p0430 (cc = 0), the following applies:
- in p0430 (requested functions), at least 1 bit was set that is not set in r0458 (supported functions) (exception: Bit 19, 28, 29, 30, 31).
- p1982 > 0 (pole position identification requested), but r0458.16 = 0 (pole position identification not supported).
For incorrect p0437 (cc = 1), the following applies:
- in p0437 (requested functions), at least 1 bit was set that is not set in r0459 (supported functions).
Fault value (r0949, interpret hexadecimal):
ddccbbaa hex
aa: encoder data set number
bb: first incorrect bit
cc: incorrect parameter
cc = 0: incorrect parameter is p0430
cc = 1: incorrect parameter is p0437
cc = 2: incorrect parameter is r0459
cc = 3: incorrect parameter is p0454
dd: reserved (always 0)
Remedy:
- check the encoder parameterization (p0430, p0437, p0454).
- check the pole position identification routine (p1982).
- use the matching encoder evaluation (r0458, r0459).
See also: p0430, p0437, r0458, r0459, p1982

207555 <location>Drive encoder: Configuration position tracking**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** Component number: %1, encoder data set: %2, drive data set: %3, fault cause: %4**Reaction:**
Infeed: OFF2 (NONE, OFF1)
Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2)
Hla: OFF2 (NONE, OFF1, OFF3, STOP2)**Acknowledge:** IMMEDIATELY (POWER ON)

Cause:	For position tracking, the configuration is not supported. Position tracking can only be activated for absolute encoders. For linear axes, it is not possible to simultaneously activate the position tracking for load and measuring gears. Fault value (r0949, interpret hexadecimal): ddccbbaa hex aa = encoder data set bb = component number cc = drive data set dd = fault cause dd = 00 hex = 0 dec An absolute encoder is not being used. dd = 01 hex = 1 dec Position tracking cannot be activated because the memory of the internal NVRAM is not sufficient or a Control Unit does not have an NVRAM. dd = 02 hex = 2 dec For a linear axis, the position tracking was activated for the load and measuring gear. dd = 03 hex = 3 dec Position tracking cannot be activated because position tracking with another gear ratio, axis type or tolerance window has already been detected for this encoder data set. dd = 04 hex = 4 dec A linear encoder is being used. See also: p0404 (Encoder configuration effective), p0411 (Measuring gear configuration)
Remedy:	For fault value 0: - use an absolute encoder. For fault value 1: - use a Control Unit with sufficient NVRAM. For fault value = 2, 4: - if necessary, deselect the position tracking (p0411 for the measuring gear, p2720 for the load gear). For fault value 3: - Only activate position tracking of the load gear in the same encoder data set if the gear ratio (p2504, p2505), axis type (p2720.1) and tolerance window (p2722) are also the same. These parameters must be the same in all drive data sets, which use the same motor encoder (p187).

207556	<location>Measuring gear: Position tracking, maximum actual value exceeded
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, encoder data set: %2
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	When the position tracking of the measuring gear is configured, the drive/encoder identifies a maximum possible absolute position actual value (r0483) that cannot be represented within 32 bits. Maximum value: $p0408 * p0412 * 2^{p0419}$ Fault value (r0949, interpret decimal): aaaayyxx hex: yy = component number, xx = encoder data set See also: p0408, p0412 (Measuring gear absolute encoder rotary revolutions virtual), p0419 (Fine resolution absolute value Gx_XIST2 (in bits))
Remedy:	- reduce the fine resolution (p0419). - reduce the multiturn resolution (p0412). See also: p0412 (Measuring gear absolute encoder rotary revolutions virtual), p0419 (Fine resolution absolute value Gx_XIST2 (in bits))

207560	<location>Drive encoder: Number of pulses is not to the power of two
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: Encoder data set: %1
Reaction: Infeed: OFF2 (NONE, OFF1)
Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2)
Hla: OFF2 (NONE, OFF1, OFF3, STOP2)
Acknowledge: IMMEDIATELY (POWER ON)
Cause: For rotary absolute encoders, the pulse number in p0408 must be to the power of two.
Fault value (r0949, interpret decimal):
The fault value includes the encoder data set number involved.
Remedy: - check the parameterization (p0408, p0404.1, r0458.5).
- upgrade the Sensor Module firmware if necessary

207561 <location>Drive encoder: Number of multiturn pulses is not to the power of two

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value: Encoder data set: %1
Reaction: Infeed: OFF2 (NONE, OFF1)
Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2)
Hla: OFF2 (NONE, OFF1, OFF3, STOP2)
Acknowledge: IMMEDIATELY (POWER ON)
Cause: The multiturn resolution in p0421 must be to the power of two.
Fault value (r0949, interpret decimal):
The fault value includes the encoder data set number involved.
Remedy: - check the parameterization (p0421, p0404.1, r0458.5).
- upgrade the Sensor Module firmware if necessary

207562 <location>Drive, encoder: Position tracking, incremental encoder not possible

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value: Fault cause: %1, component number: %2, encoder data set: %3
Reaction: Infeed: OFF2 (NONE, OFF1)
Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2)
Hla: OFF2 (NONE, OFF1, OFF3, STOP2)
Acknowledge: IMMEDIATELY (POWER ON)
Cause: The requested position tracking for incremental encoders is not supported.
Fault value (r0949, interpret hexadecimal):
ccccbbaa hex
aa = encoder data set
bb = component number
cccc = fault cause
cccc = 00 hex = 0 dec
The encoder type does not support the "Position tracking incremental encoder" function.
cccc = 01 hex = 1 dec
Position tracking cannot be activated because the memory of the internal NVRAM is not sufficient or a Control Unit does not have an NVRAM.
cccc = 04 hex = 4 dec
A linear encoder is used that does not support the "position tracking" function.
See also: p0404 (Encoder configuration effective), p0411 (Measuring gear configuration), r0456 (Encoder configuration supported)
Remedy: - check the encoder parameterization (p0400, p0404).
- use a Control Unit with sufficient NVRAM.
- if required, deselect position tracking for the incremental encoder (p0411.3 = 0).

207563	<location>Drive encoder: XIST1_ERW configuration incorrect
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1, encoder data set: %2
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2) Hla: OFF2 (NONE, OFF1, OFF3, STOP2)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	An incorrect configuration was identified for the "Absolute position for incremental encoder" function. Fault value (r0949, interpret decimal): Fault cause: 1 (= 01 hex): The "Absolute value for incremental encoder" function is not supported (r0459.13 = 0). Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): yyxx dec: yy = fault cause, xx = encoder data set See also: r0459, p4652
Remedy:	For fault value = 1: - upgrade the Sensor Module firmware version. - check the mode (p4652 = 1, 3 requires the property r0459.13 = 1).

207565	<location>Drive: Encoder error in PROFIdrive encoder interface 1
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	An encoder error was signaled for encoder 1 via the PROFIdrive encoder interface (G1_ZSW.15). Alarm value (r2124, interpret decimal): Error code from G1_XIST2, refer to the description regarding r0483. Note: This alarm is only output if p0480[0] is not equal to zero. Encoder control word Gn_STW signal source (p0480[0...2], n = encoder 1, 2, 3) Encoder status word Gn_ZSW (r0481[0...2], n = encoder 1, 2, 3)
Remedy:	Acknowledge the encoder error using the encoder control word (G1_STW.15 = 1).

207566	<location>Drive: Encoder error in PROFIdrive encoder interface 2
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	An encoder error was signaled for encoder 2 via the PROFIdrive encoder interface (G2_ZSW.15). Alarm value (r2124, interpret decimal): Error code from G2_XIST2, refer to the description regarding r0483. Note: This alarm is only output if p0480[1] is not equal to zero. Encoder control word Gn_STW signal source (p0480[0...2], n = encoder 1, 2, 3) Encoder status word Gn_ZSW (r0481[0...2], n = encoder 1, 2, 3)
Remedy:	Acknowledge the encoder error using the encoder control word (G2_STW.15 = 1).

207567	<location>Drive: Encoder error in PROFIdrive encoder interface 3
Drive object:	HLA_828, SERVO_828, SERVO_COMBI

Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	An encoder error was signaled for encoder 3 via the PROFIdrive encoder interface (G3_ZSW.15). Alarm value (r2124, interpret decimal): Error code from G3_XIST2, refer to the description regarding r0483. Note: This alarm is only output if p0480[2] is not equal to zero. Encoder control word Gn_STW signal source (p0480[0...2], n = encoder 1, 2, 3) Encoder status word Gn_ZSW (r0481[0...2], n = encoder 1, 2, 3)
Remedy:	Acknowledge the encoder error using the encoder control word (G3_STW.15 = 1).

207569 <location>Enc identification active

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	During encoder identification (waiting) with p0400 = 10100, the encoder could still not be identified. Either the wrong encoder has been installed or no encoder has been installed, the wrong encoder cable has been connected or no encoder cable has been connected to the Sensor Module, or the DRIVE-CLiQ component has not been connected. Note: Encoder identification must be supported by the encoder and is possible in the following cases: - Encoder with EnDat interface. - Encoder with SSI interface. - Motor with DRIVE-CLiQ.
Remedy:	- check and, if necessary, connect the encoder / encoder cable. - check and, if necessary, establish the DRIVE-CLiQ connection. - for SSI encoders, carry out the required operator actions (see the Function Manual). - in the case of encoders that cannot be identified (e.g. encoders without EnDat interface), enter the correct encoder type in p0400.

207570 <location>Encoder identification data transfer running

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2
Acknowledge:	NONE
Cause:	The encoder type was automatically determined using p0400 = 10100. Note: This fault causes the pulses to be suppressed - this is necessary to transfer the encoder parameterization to p0400 and the following. See also: p0400 (Encoder type selection)
Remedy:	Acknowledge the fault without taking additional measures.

207575 <location>Drive: Motor encoder not ready

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	Infeed: OFF2 Servo: OFF2 (ENCODER) Hla: OFF2 (ENCODER)
Acknowledge:	IMMEDIATELY

Cause:	The motor encoder signals that it is not ready. - initialization of encoder 1 (motor encoder) was unsuccessful. - the function "parking encoder" is active (encoder control word G1_STW.14 = 1). - the encoder interface (Sensor Module) is deactivated (p0145). - the Sensor Module is defective.
Remedy:	Evaluate other queued faults via encoder 1.

207576 <location>Drive: Encoderless operation due to a fault active

Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	Encoderless operation is active due to a fault (r1407.13 = 1). Note: The behavior for faults has been set to ENCODER fault response in p0491. See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- remove the cause of a possible encoder fault. - carry out a POWER ON (switch-off/switch-on) for all components.

207580 <location>Drive: No Sensor Module with matching component number

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Encoder data set: %1
Reaction:	NONE
Acknowledge:	NONE
Cause:	A Sensor Module with the component number specified in p0141 was not found. Alarm value (r2124, interpret decimal): Encoder data set involved (index of p0141).
Remedy:	Correct parameter p0141.

207750 <location>Drive: Parameter invalid

Drive object:	HLA_828
Message value:	Parameter: %1, index: %2, fault cause: %3
Reaction:	OFF1 (OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	A parameter value has been set that is not valid, or was not correctly entered. Fault value (r0949, interpret hexadecimal): ccbbaaaa hex: cc = fault cause, bb = index, aaaa = parameter cc = 0: parameter has the value zero that is not permitted. cc = 1: piston rod greater than piston diameter. cc = 2: cylinder without piston rod (p0311 = 0 and p0312 = 0). cc = 3: position overflow possible in the traversing range (check p0407 and p0313 and if required, reduce p0418).
Remedy:	Set the specified parameters to a correct value.

207751 <location>Drive: valve does not respond

Drive object:	HLA_828
Message value:	-
Reaction:	OFF2 (NONE, OFF1, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	A valve with a valve feedback signal was parameterized (p0218.2 = 1), however the valve does not follow the setpoint.

- Remedy:**
- correct the configuration for the valve without valve feedback signal (p0218.2 = 0).
 - check the valve natural frequency (p0216).
 - for the incorrect sign, invert the valve actual value (p0218.3).
 - check the valve and valve connection.

207752 <location>Drive: Piston position not possible

Drive object: HLA_828

Message value: -

Reaction: OFF1 (NONE, OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause: The piston was calibrated (p0476 not equal to 0) and the absolute position is available (p1407.3 = 1). However, the piston position (r0094) is not plausible (negative or higher than the stroke in p0313).

- Remedy:**
- check position inversion (p0410.1).
 - check direction convention: piston position (r0094) must be zero, if the piston is located at the A side. When moving from the A to the B side, velocity and position increase must be positive.
 - check the piston calibration, and if required, recalibrate the piston with the piston at the A side (p1909.1 = 1).
 - when replacing the encoder, recalibrate the piston.
 - when shifting the machine zero point, recalibrate the piston.

Note:

Before acknowledging the fault, set p0476 = 0. Then calibrate the piston again (p1909.1 = 1 with the piston completely retracted or set p1959.2 = 1 and p1960 = 1).

See also: r0094, p0476 (Piston zero point calibration value)

207753 <location>Drive: No valid pressure actual value available

Drive object: HLA_828

Message value: -

Reaction: OFF2 (NONE, OFF1, OFF3)

Acknowledge: IMMEDIATELY

Cause:

- the "force controller", "force limiting" or "stiction compensation" is activated (p1400), and at least one of the two required pressure sensors for pressure actual value A or B is not supplying a valid value. The two pressure actual values A and B are required for the functions listed above.

- the system pressure adaptation function for the speed controller is activated (p1400.15 = 1) and no system pressure measured value (r0069) is available. A system pressure measured value is required for this function.

- Remedy:**
- check pressure sensors and wiring for pressure actual values A and B (X241 or X242).
 - check offset correction values for pressure actual values A and B (p0241, p0243).
 - if required, deselect the function "force controller", "force limiting" or "stiction compensation" (p1400).

207754 <location>Drive: Incorrect shutoff valve configuration

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause:	An incorrect shutoff valve configuration was detected. Fault value (r0949, interpret decimal): 100: Enable Safety Integrated (p9601/p9801), but p0218.0 = 0 (shutoff valve not available). 101: The manipulated variable inhibit time is set less than the wait time to evaluate the feedback signal contacts when switching on the shutoff valve (p0230 < p9625[0]/p9825[0]). 102: The manipulated variable inhibit time is set less than the wait time to evaluate the feedback signal contacts when switching off the shutoff valve (p0230 < p9625[1]/p9825[1]).
Remedy:	For fault value = 100: Check the enable of Safety Integrated and the shutoff valve (p9601/p9801, p0218.0). For fault value = 101: Set the manipulated variable inhibit time higher than the wait time to evaluate the feedback signal contacts when switching on the shutoff valve (p0230 > p9625[0]/p9825[0]). For fault value = 102: Set the manipulated variable inhibit time higher than the wait time to evaluate the feedback signal contacts when switching off the shutoff valve (p0230 > p9625[1]/p9825[1]). See also: p0230, p9625 (SI HLA shutoff valve wait time (CU)), p9825 (SI HLA shutoff valve wait time (MM))

207755	<location>Drive: travel to fixed end stop without force controller
Drive object:	HLA_828
Message value:	-
Reaction:	OFF3 (NONE, OFF1, OFF2)
Acknowledge:	IMMEDIATELY
Cause:	The function "Travel to fixed end stop" (p1545) was selected, although no "Force controller" or no "Force limiting" has been activated (p1400). With these settings, the drive would be traversed with maximum force against the end stop.
Remedy:	- if required, deactivate the "Travel to end stop" function (p1545). - activate the force controller (p1400.14 = 1). or - activate force limiting, mode 1 or mode 2 (p1400.0 = 1, p1400.1 = 1).

207756	<location>Drive: Filter natural frequency > Shannon frequency
Drive object:	HLA_828
Message value:	%1
Reaction:	NONE (OFF1, OFF2, OFF3)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	One of the filter natural frequencies is greater than the Shannon frequency. The Shannon frequency is calculated according to the following formula: $0.5 / p0115[0]$ Fault value (r0949, interpret binary): Bit 0: Manipulated variable filter 1 (p1658, p1660) Bit 1: Manipulated variable filter 2 (p1663, p1665) Bit 3: Manipulated variable filter (p1800, p1805) Bit 4: Precontrol filter (p1721, p1727)
Remedy:	- reduce the numerator or denominator natural frequency of the current setpoint filter involved. - reduce controller sampling time (p0115[0]). - deactivate the filter involved

207800	<location>Drive: No power unit present
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-

Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	The power unit parameters cannot be read or no parameters are stored in the power unit. It is possible that the DRIVE-CLiQ cable between the Control Unit and power unit is interrupted or defective. Note: This fault also occurs if an incorrect topology was selected in the commissioning tool and this parameterization is then downloaded to the Control Unit. See also: r0200 (Power unit code number actual)
Remedy:	- carry out a POWER ON (switch-off/switch-on) for all components. - check the DRIVE-CLiQ cable between the Control Unit and power unit. - check the power unit and replace if necessary. - check the Control Unit, and if required replace it. - after correcting the topology, the parameters must be again downloaded using the commissioning tool.

207801 <location>Drive: Motor overcurrent

Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2 (NONE, OFF1, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	The permissible motor limit current was exceeded. - effective current limit set too low. - current controller not correctly set. - motor was braked with an excessively high stall torque correction factor. - U/f operation: Up ramp was set too short or the load is too high. - U/f operation: Short-circuit in the motor cable or ground fault. - U/f operation: Motor current does not match the current of Motor Module. Note: Synchronous motor: Limit current= 1.3 x p0323 Induction motor: Limit current= 1.3 x r0209
Remedy:	- check the current limits (p0323, p0640). - check the current controller (p1715, p1717). - reduce the stall torque correction factor (p0326). - increase the up ramp (p1318) or reduce the load. - check the motor and motor cables for short-circuit and ground fault. - check the Motor Module and motor combination.

207802 <location>Drive: Infeed or power unit not ready

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2 (NONE)
Acknowledge:	IMMEDIATELY
Cause:	After an internal switch-on command, the infeed or drive does not signal ready. - monitoring time is too short. - DC link voltage is not present. - associated infeed or drive of the signaling component is defective. - supply voltage incorrectly set.
Remedy:	- increase the monitoring time (p0857). - ensure that there is a DC link voltage. Check the DC link busbar. Enable the infeed. - replace the associated infeed or drive of the signaling component. - check the line supply voltage setting (p0210). See also: p0857 (Power unit monitoring time)

207805 <location>Infeed: Power unit overload I2t**Drive object:** A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI**Message value:** -**Reaction:** NONE**Acknowledge:** NONE**Cause:** The alarm threshold for I2t overload (p0294) of the power unit has been exceeded.**Remedy:**
- reduce the continuous load.
- adapt the load duty cycle.

207805 <location>Drive: Power unit overload I2t**Drive object:** SERVO_828, SERVO_COMBI**Message value:** -**Reaction:** NONE**Acknowledge:** NONE**Cause:** The alarm threshold for I2t overload (p0294) of the power unit has been exceeded.
The response parameterized in p0290 becomes active.
See also: p0290 (Power unit overload response)**Remedy:**
- reduce the continuous load.
- adapt the load duty cycle.
- check the assignment of the rated currents of the motor and Motor Module.

207808 <location>HF Damping Module: damping not ready**Drive object:** HLA_828, SERVO_828**Message value:** %1**Reaction:** OFF2 (NONE, OFF1, OFF3)**Acknowledge:** IMMEDIATELY**Cause:** When switching on or in the switched-on state, the HF Damping Module does not return a ready signal.
Fault value (r0949, interpret hexadecimal):
1: Fault at switch-on identified.
2: Fault during operation identified.**Remedy:**
- check the DRIVE-CLiQ wiring to the HF Damping Module.
- check the 24 V supply voltage.
- if required, replace the HF Damping Module.
Note:
HF Damping Module

207810 <location>Drive: Power unit EEPROM without rated data**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** -**Reaction:** NONE**Acknowledge:** IMMEDIATELY**Cause:** No rated data are stored in the power unit EEPROM.
See also: p0205, r0206 (Rated power unit power), r0207 (Rated power unit current), r0208 (Rated power unit line supply voltage), r0209 (Power unit maximum current)**Remedy:** Replace the power unit or inform Siemens Customer Service.

207815 <location>Drive: Power unit has been changed**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI**Message value:** Parameter: %1

Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	The code number of the actual power unit does not match the saved number. This only occurs if the comparator in p9906 or p9908 is not at 2 (low) or 3 (minimum). Fault value (r0949, interpret decimal): Number of the incorrect parameter. See also: r0200 (Power unit code number actual), p0201 (Power unit code number)
Remedy:	Connect the original power unit and switch on the Control Unit again (POWER ON) or set p0201 to r0200 and exit commissioning with p0010 = 0. For infeeds, the following applies: Line reactors or line filters must be used that are specified for the new power unit. A line supply and DC link identification routine (p3410 = 5) must then be carried out. It is not possible to change the power unit without re-commissioning the system if the type of infeed (A_Infeed, B_Infeed, S_Infeed), the type of construction/design (booksize, chassis) or the voltage class differ between the old and new power units. For inverters, the following applies: If the new power unit is accepted, then if required, the current limit (p0640) can be reduced by a lower maximum current of the power unit (r0209) (torque limits stay the same). If not only the power unit is changed, but also the motor, then the motor must be re-commissioned (e.g. using p0010 = 1). This is also necessary if motor data is still to be downloaded via DRIVE-CLiQ. See also: r0200 (Power unit code number actual)

207815 <location>Drive: Power unit has been changed

Drive object:	SERVO_828, SERVO_COMBI
Message value:	Parameter: %1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	The code number of the actual power unit does not match the saved number. This only occurs if the comparator in p9906 or p9908 is not at 2 (low) or 3 (minimum). Fault value (r0949, interpret decimal): Number of the incorrect parameter. See also: r0200 (Power unit code number actual), p0201 (Power unit code number)
Remedy:	Connect the original power unit and switch on the Control Unit again (POWER ON) or set p0201 to r0200 and exit commissioning with p0010 = 0. For infeeds, the following applies: Line reactors or line filters must be used that are specified for the new power unit. A line supply and DC link identification routine (p3410 = 5) must then be carried out. It is not possible to change the power unit without re-commissioning the system if the type of infeed (A_Infeed, B_Infeed, S_Infeed), the type of construction/design (booksize, chassis) or the voltage class differ between the old and new power units. For inverters, the following applies: If the new power unit is accepted, then if required, the current limit (p0640) can be reduced by a lower maximum current of the power unit (r0209) (torque limits stay the same). If not only the power unit is changed, but also the motor, then the motor must be re-commissioned (e.g. using p0010 = 1). This is also necessary if motor data is still to be downloaded via DRIVE-CLiQ. If the comparison stage in p9906 is set to 2, 3, then commissioning can be exited (p0010 = 0) and the fault acknowledged. See also: r0200 (Power unit code number actual)

207820 <location>Drive: Temperature sensor not connected

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE

Cause:	The temperature sensor for monitoring the motor temperature, specified in p0600, is not available. Alarm value (r2124, interpret decimal): 1: p0601 = 10 (SME), but in p0600 - not evaluated via encoder is selected. 2: p0600 = 10 (BICO), but the signal source (p0603) is not interconnected. 3: p0601 = 11 (BICO), but in p0600 - not evaluated via BICO interconnection is selected (20 or 21). 4: p0601 = 11 (BICO) and p4610-p4613 > 0, but the associated signal source (p0608, p0609) is not interconnected. 5: Component with sensor evaluation not present or has been removed in the meantime. 6: Evaluation via Motor Module not possible (r0192.21).
Remedy:	For alarm value = 1: - in p0600 set an encoder with temperature sensor. For alarm value = 2: - interconnect p0603 with the temperature signal. For alarm value = 3, 4: - set the available temperature sensor (p0600, p0601). - set p4610 ... p4613 = 0 (no sensor), or interconnect p0608 or p0609 with an external temperature signal. For alarm value = 5: - connect the component with the temperature sensor. Check the DRIVE-CLiQ connection. For alarm value = 6: - update the Motor Module firmware. Connect temperature sensor via encoder. See also: p0600 (Motor temperature sensor for monitoring), p0601

207840 <location>Drive: Infeed operation missing

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2 (NONE)
Acknowledge:	IMMEDIATELY
Cause:	The signal "infeed operation" is not present although the enable signals for the drive have been present for longer than the parameterized monitoring time (p0857). - infeed not operational. - interconnection of the binector input for the ready signal is either incorrect or missing (p0864). - infeed is presently carrying out a line supply identification routine.
Remedy:	- bring the infeed into an operational state. - check the interconnection of the binector input for the signal "infeed operation" (p0864). - increase the monitoring time (p0857). - wait until the infeed has completed the line supply identification routine. See also: p0857 (Power unit monitoring time), p0864

207841 <location>Drive: Infeed operation withdrawn

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3) Hla: OFF2 (NONE, OFF1, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	The signal "infeed operation" was withdrawn in operation. - interconnection of the binector input for the signal "infeed operation" is either incorrect or missing (p0864). - the enable signals of the infeed were disabled. - due to a fault, the infeed withdraws the signal "infeed operation".

Remedy:

- check the interconnection of the binector input for the "infeed operation" signal (p0864).
- check the enable signals of the infeed and if required, enable.
- remove and acknowledge an infeed fault.

Note:

If this drive is intended to back up the DC link regeneratively, then the fault response must be parameterized for NONE, OFF1 or OFF3, so that the drive can continue to operate even after the infeed fails.

207850 <location>External alarm 1

Drive object: All objects

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The condition for "External alarm 1" is satisfied.

Note:

The "External alarm 1" is initiated by a 1/0 edge via binector input p2112.

See also: p2112 (External alarm 1)

Remedy: Eliminate the causes of this alarm.

207851 <location>External alarm 2

Drive object: All objects

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The condition for "External alarm 2" is satisfied.

Note:

The "External alarm 2" is initiated by a 1/0 edge via binector input p2116.

See also: p2116 (External alarm 2)

Remedy: Eliminate the causes of this alarm.

207852 <location>External alarm 3

Drive object: All objects

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The condition for "External alarm 3" is satisfied.

Note:

The "External alarm 3" is initiated by a 1/0 edge via binector input p2117.

See also: p2117 (External alarm 3)

Remedy: Eliminate the causes of this alarm.

207860 <location>External fault 1

Drive object: All objects

Message value: -

Reaction:

- Infeed: OFF2 (NONE, OFF1)
- Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2)
- Hla: OFF2 (NONE, OFF1, OFF3, STOP2)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The condition for "External fault 1" is satisfied.
Note:
 The "External fault 1" is initiated by a 1/0 edge via binector input p2106.
 See also: p2106 (External fault 1)

Remedy:

- eliminate the causes of this fault.
- acknowledge fault.

207861 <location>External fault 2

Drive object: All objects

Message value: -

Reaction: Infeed: OFF2 (NONE, OFF1)
 Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2)
 Hla: OFF2 (NONE, OFF1, OFF3, STOP2)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The condition for "External fault 2" is satisfied.
Note:
 The "External fault 2" is initiated by a 1/0 edge via binector input p2107.
 See also: p2107 (External fault 2)

Remedy:

- eliminate the causes of this fault.
- acknowledge fault.

207862 <location>External fault 3

Drive object: All objects

Message value: -

Reaction: Infeed: OFF2 (NONE, OFF1)
 Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2)
 Hla: OFF2 (NONE, OFF1, OFF3, STOP2)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The condition for "External fault 3" is satisfied.
Note:
 The "External fault 3" is initiated by a 1/0 edge via the following parameters.
 - AND logic operation, binector input p2108, p3111, p3112.
 - switch-on delay p3110.
 See also: p2108, p3110, p3111, p3112

Remedy:

- eliminate the causes of this fault.
- acknowledge fault.

207890 <location>Internal voltage protection / internal armature short-circuit with STO active

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The internal armature short-circuit (p1231 = 4) is not possible as Safe Torque Off (STO) is enabled. The pulses cannot be enabled.

Remedy: Switch out the internal armature short-circuit (p1231=0) or deactivate Safe Torque Off (p9501 = p9561 = 0).
Note:
 STO: Safe Torque Off / SH: Safe standstill

207900 <location>Drive: Motor blocked/speed controller at its limit

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value:	-
Reaction:	OFF2 (NONE, OFF1, OFF3, STOP2)
Acknowledge:	IMMEDIATELY
Cause:	Motor has been operating at the torque limit longer than the time specified in p2177 and below the speed threshold in p2175. This signal can also be initiated if the speed actual value is oscillating and the speed controller output repeatedly goes to its limit. See also: p2175, p2177
Remedy:	- check that the motor can freely move. - check the effective torque limit (r1538, r1539). - check the parameter, message "Motor blocked" and if required, correct (p2175, p2177). - check the inversion of the actual value (p0410). - check the motor encoder connection. - check the encoder pulse number (p0408). - for SERVO with encoderless operation and motors with low power ratings (< 300 W), increase the pulse frequency (p1800). - after deselecting the "Basic positioner" (EPOS) function mode, check the motoring (p1528) and regenerative (p1529) torque limit and modify again. - blocksize device: for encoderless operation and a current controller sampling time p0115[0] < 80 µs, either set the pulse frequency of p1800 = 1 / p0115[0] or increase the switchover speed of the model p1755.

207901 <location>Drive: Motor overspeed

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	Servo: OFF2 (IASC/DCBRK) Hla: OFF2
Acknowledge:	IMMEDIATELY
Cause:	The maximum permissible speed was either positively or negatively exceeded. The maximum permissible positive speed is formed as follows: Minimum (p1082, Cl: p1085) + p2162 The maximum permissible negative speed is formed as follows: Maximum (-p1082, Cl: 1088) - p2162
Remedy:	The following applies for a positive direction of rotation: - check r1084 and if required, correct p1082, Cl:p1085 and p2162. The following applies for a negative direction of rotation: - check r1087 and if required, correct p1082, Cl:p1088 and p2162.

207902 <location>Drive: Motor stalled

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2)
Acknowledge:	IMMEDIATELY
Cause:	The system has identified that the motor has stalled for a time longer than is set in p2178. Fault value (r0949, interpret decimal): 1: Stall detection using r1408.11 (p1744, p0492). 2: Stall detection using r1408.12 (p1745) or via the flux difference (r0083 ... r0084). 3: Stall detection using r0056.11 (only for separately excited synchronous motors).

Remedy:	For closed-loop speed and torque control with speed encoder, the following applies: - check the speed signal (interrupted cable, polarity, pulse number, broken encoder shaft). - check the speed encoder, if another speed encoder was selected using the data set changeover. This must be connected to the same motor that is controlled for the data set changeover. If there is no fault, then the fault tolerance (p1744 and p0492) can be increased. For closed-loop speed and torque control without speed encoder, the following applies: - check whether the drive in the open-loop controlled mode (r1750.0) stalls under load. If yes, then increase the current setpoint using p1610. - check whether the drive stalls due to the load if the speed setpoint is still zero. If yes, then increase the current setpoint using p1610. - if the motor excitation (magnetizing) time (r0346) was significantly reduced, then it should be increased again. - check the current limits (p0640, r0067). If the current limits are too low, then the drive cannot be magnetized. - check the current controller (p1715, p1717) and the speed adaptation controller (p1764, p1767). If the dynamic response was significantly reduced, then this should be increased again. - check the speed encoder, if another speed encoder was selected using the data set changeover. This must be connected to the motor that is controlled for the data set changeover. If there is no fault, then the fault tolerance (p1745) or the delay time (p2178) can be increased. For separately excited synchronous motors (closed-loop control with speed encoder), the following applies: - check the speed signal (interrupted cable, polarity, pulse number). - ensure the correct motor parameterization (rating plate and equivalent circuit diagram parameters). - check the excitation equipment and the interface to the closed-loop control. - encoder the highest possible dynamic response of the closed-loop excitation current control. - check the speed control for any tendency to oscillate and if resonance effects occur, use a bandstop filter. - do not exceed the maximum speed (p2162). If there is no fault, then the delay time can be increased (p2178).
----------------	---

207903	<location>Drive: Motor speed deviation
Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The absolute value of the speed difference from the two setpoints (p2151, p2154) and the speed actual value (r2169) exceeds the tolerance threshold (p2163) longer than tolerated (p2164, p2166). The alarm is only enabled for p2149.0 = 1. Possible causes could be: - the load torque is greater than the torque setpoint. - when accelerating, the torque/current/power limit is reached. If the limits are not sufficient, then it is possible that the drive has been dimensioned too small. - for closed-loop torque control, the speed setpoint does not track the speed actual value. - for active Vdc controller. For U/f control, the overload condition is detected as the I_{max} controller is active. See also: p2149 (Monitoring configuration)
Remedy:	- increase p2163 and/or p2166. - increase the torque/current/power limits. - for closed-loop torque control: The speed setpoint should track the speed actual value. - deactivate alarm with p2149.0 = 0.

207904	<location>External armature short-circuit: Contactor feedback signal "Closed" missing
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2 (NONE)
Acknowledge:	IMMEDIATELY

Cause: When closing, the contactor feedback signal (p1235) did not issue the signal "Closed" (r1239.1 = 1) within the monitoring time (p1236).

Remedy:

- check that the contactor feedback signal is correctly connected (p1235).
- check the logic of the contactor feedback signal (r1239.1 = 1: "Closed", r1239.1 = 0: "Open").
- increase the monitoring time (p1236).
- if required, set the external armature short-circuit without contactor feedback signal (p1231 = 2).

207905 <location>External armature short-circuit: Contactor feedback signal "Open" missing

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2 (NONE)

Acknowledge: IMMEDIATELY

Cause: When opening, the contactor feedback signal (p1235) did not issue the signal "Open" (r1239.1 = 0) within the monitoring time (p1236).

Remedy:

- check that the contactor feedback signal is correctly connected (p1235).
- check the logic of the contactor feedback signal (r1239.1 = 1: "Closed", r1239.1 = 0: "Open").
- increase the monitoring time (p1236).
- if required, set the external armature short-circuit without contactor feedback signal (p1231 = 2).

207906 <location>Armature short-circuit / internal voltage protection: Parameterization error

Drive object: SERVO_828, SERVO_COMBI

Message value: Fault cause: %1, motor data set: %2

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The armature short-circuit is incorrectly parameterized.

Fault value (r0949, interpret decimal):

zzzzyyxx: zzzz = fault cause, xx = motor data set

zzzz = 0001 hex = 1 dec:

A permanent-magnet synchronous motor has not been selected.

zzzz = 0002 hex = 2 dec:

No induction motor selected.

zzzz = 0065 hex = 101 dec:

External armature short-circuit: Output (r1239.0) not wired.

zzzz = 0066 hex = 102 dec:

External armature short-circuit with contactor feedback signal: No feedback signal connected (BI:p1235). The feedback signal must be interconnected in all command data sets (CDS).

zzzz = 0067 hex = 103 dec:

External armature short-circuit without contactor feedback signal: Wait time when opening (p1237) is 0.

zzzz = 00C9 hex = 201 dec:

Internal voltage protection: The maximum output current of the Motor Module (r0209) is less than 1.8 x motor short-circuit current (r0331).

zzzz = 00CA hex = 202 dec:

Internal voltage protection: A Motor Module in booksize or chassis format is not being used.

zzzz = 00CB hex = 203 dec:

Internal voltage protection: The motor short-circuit current (p0320) is greater than the maximum motor current (p0323).

zzzz = 00CC hex = 204 dec:

Internal voltage protection: The activation (p1231 = 4) is not given for all motor data sets with synchronous motors (p0300 = 2xx, 4xx).

Remedy:	For fault value = 1: - an armature short-circuit / voltage protection is only permissible for permanent-magnetic synchronous motors. The highest position of the motor type in p0300 must either be 2 or 4. For fault value = 101: - the contactor for the external armature short-circuit configuration should be controlled using output signal r1239.0. For instance, the signal can be connected to an output terminal via binector input p0738. Before this fault can be acknowledged, p1231 must be set again. For fault value = 102: - if the external armature short circuit is selected with contactor feedback signal (p1231 = 1), then the feedback signal must be connected to an input terminal (e.g. r0722.x) and then interconnected to binector input p1235. - alternatively, the external armature short-circuit without contactor feedback signal (p1231 = 2) can be selected. For fault value = 103: - if the external armature short-circuit without contactor feedback signal (p1231 = 2) is selected, then a delay time must be parameterized in p1237. This time must always be greater than the actual contactor opening time, as otherwise the Motor Module would be short-circuited! For fault value = 201: - a Motor Module with a higher maximum current or a motor with a lower short-circuit current must be used. The maximum Motor Module current must be higher than 1.8 x short-circuit current of the motor. For fault value = 202: - for internal voltage protection, use a Motor Module in booksize or chassis format. For fault value = 203: - for internal voltage protection, only use short-circuit proof motors. For fault value = 204: - the internal voltage protection must either be activated for all motor data sets with synchronous motors (p0300 = 2xx, 4xx) (p1231 = 3) or it must be deactivated for all motor data sets (p1231 not equal to 3). This therefore ensures that the protection cannot be accidentally withdrawn as a result of a data set changeover. The fault can only be acknowledged if this condition is fulfilled.
----------------	---

207907	<location>Internal armature short-circuit: Motor terminals are not at zero potential after pulse suppression
Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	The function "Internal voltage protection" (p1231 = 3) was activated. The following must be observed: - when the internal voltage protection is active, after pulse suppression, all of the motor terminals are at half of the DC link voltage (without an internal voltage protection, the motor terminals are at zero potential)! - it is only permissible to use motors that are short-circuit proof (p0320 < p0323). - the Motor Module must be able to continually conduct 180% short-circuit current (r0331) of the motor (r0289). - the internal voltage protection cannot be interrupted due to a fault response. If an overcurrent condition occurs during the active, internal voltage protection, then this can destroy the Motor Module and/or the motor. - if the Motor Module does not support the autonomous, internal voltage protection (r0192.10 = 0), in order to ensure safe, reliable functioning when the line supply fails, an external 24 V power supply (UPS) must be used for the components. - if the Motor Module does support the autonomous, internal voltage protection (r0192.10 = 1), in order to ensure safe, reliable functioning when the line supply fails, the 24 V power supply for the components must be provided through a Control Supply Module. - if the internal voltage protection is active, it is not permissible that the motor is driven by the load for a longer period of time (e.g. as a result of loads that move the motor or another coupled motor).
Remedy:	Not necessary. This a note for the user.

207908	<location>Internal armature short-circuit active
Drive object:	SERVO_828, SERVO_COMBI

Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The Motor Module signals that the motor is short-circuited through the power semiconductors (r1239.5 = 1). The pulses cannot be enabled. The internal armature short-circuit is selected (p1231 = 4):
Remedy:	For synchronous motors, the armature short-circuit braking is activated with binector input p1230 = 1 signal. See also: p1230 (Armature short-circuit / DC braking activation), p1231 (Armature short-circuit / DC braking configuration)

207909 <location>Internal voltage protection: Deactivation only effective after POWER ON

Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	POWER ON
Cause:	The deactivation of the internal voltage protection (p1231 not equal to 3) only becomes effective after POWER ON. The status signal r1239.6 = 1 indicates that the internal voltage protection is ready.
Remedy:	Not necessary. This a note for the user.

207910 <location>Drive: Motor overtemperature

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	KTY84/PT1000: The motor temperature has exceeded the alarm threshold (p0604, p0616). PTC: The response threshold of 1650 Ohm was exceeded. Alarm value (r2124, interpret decimal): this is the number of the temperature channel leading to the message. See also: p0604, p0612, p0617, p0618, p0619, p0625, p0626, p0627, p0628
Remedy:	- check the motor load. - check the motor ambient temperature and cooling. - check PTC or bimetallic NC contact. - check the monitoring limits (p0604, p0605). - activate/check the parameters of the motor temperature model (p0612, p0626 and following). See also: p0612, p0617, p0618, p0619, p0625, p0626, p0627, p0628

207913 <location>Excitation current outside the tolerance range

Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	The difference between the excitation current actual value and setpoint has exceeded the tolerance: $\text{abs}(r1641 - r1626) > p3201 + p3202$ The cause of this fault is again reset for $\text{abs}(r1641 - r1626) < p3201$.
Remedy:	- check the parameterization (p1640, p3201, p3202). - check the interfaces to the excitation equipment (r1626, p1640). - check the excitation equipment.

207914 <location>Flux out of tolerance**Drive object:** SERVO_828, SERVO_COMBI**Message value:** -**Reaction:** OFF2**Acknowledge:** IMMEDIATELY**Cause:** The difference between the flux actual value and setpoint has exceeded the tolerance: $\text{abs}(r0084 - r1598) > p3204 + p3205$ The cause of this fault is again reset for $\text{abs}(r0084 - r1598) < p3204$.

The fault is only issued after the delay time in p3206 has expired.

Remedy: - check the parameterization (p3204, p3205).

- check the interfaces to the excitation equipment (r1626, p1640).

- check the excitation equipment.

- check the flux control (p1590, p1592, p1597).

- check the control for oscillation and take the appropriate counter measures (e.g. optimize the speed control loop, parameterize a bandstop filter).

207918 <location>Three-phase setpoint generator operation selected/active**Drive object:** A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** -**Reaction:** NONE**Acknowledge:** NONE**Cause:** Only for separately excited synchronous motors (p0300 = 5):

The actual open-loop/closed-loop control mode is I/f control (open-loop) with a fixed current (p1300 = 18).

The speed is entered via the setpoint channel and the current setpoint is given by the minimum current (p1620).

It must be ensured that in this mode, the control dynamic performance is very limited. This is the reason that longer ramp-up times should be set for the setpoint speed than for normal operation.

Remedy: Select another open-loop/closed-loop control mode

See also: p1300 (Open-loop/closed-loop control operating mode)

207927 <location>DC braking active**Drive object:** SERVO_828, SERVO_COMBI**Message value:** -**Reaction:** NONE**Acknowledge:** NONE**Cause:** The motor is braked with DC current. DC braking is active.

1)

A message with response DCBRK is active. The motor is braked with the braking current set in p1232 for the duration set in p1233. If the standstill threshold p1226 is undershot, then braking is prematurely canceled.

2)

DC braking has been activated at binector input p1230 with the DC braking set (p1230 = 4). Braking current p1232 is injected until this binector input becomes inactive.

Remedy: Not necessary.

This alarm is automatically withdrawn after DC braking.

207928 <location>Internal voltage protection initiated**Drive object:** SERVO_828, SERVO_COMBI**Message value:** -**Reaction:** OFF2**Acknowledge:** IMMEDIATELY

Cause:	The Motor Module signals that the motor is short-circuited through the power semiconductors (r1239.5 = 1). The pulses cannot be enabled. The internal voltage protection is selected (p1231 = 3).
Remedy:	If the Motor Module supports the autonomous internal voltage protection (r0192.10 = 1), then the Motor Module automatically decides - using the DC link voltage - as to whether the armature short-circuit should be activated. The armature short-circuit is activated and response OFF2 is initiated if the DC link voltage exceeds 800 V. If the DC link voltage falls below 450 V, then the armature short-circuit is withdrawn. If the motor is still in a critical speed range, the armature short-circuit is re-activated once the DC link voltage exceeds the threshold of 800 V. If the autonomous (independent) internal voltage protection is active (r1239.5 = 1) and the line supply returns (450 V < DC link voltage < 800 V), the armature short-circuit is withdrawn after 3 minutes.

207930 <location>Drive: Brake control error

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	The Control Unit has detected a brake control error. - motor cable is not shielded correctly. - defect in the brake control circuit of the Motor Module. Fault value (r0949, interpret decimal): 10, 11: Fault in "open holding brake" operation. - no brake connected or wire breakage (check whether brake opens for p1278 = 1). - ground fault in brake cable. - S120M: brake opened via terminal X4.1 for mounting purposes (this is only permissible when the power supply voltage is switched off). 20: Fault in "brake open" state. - short-circuit in brake winding. 30, 31: Fault in "close holding brake" operation. - no brake connected or wire breakage (check whether brake opens for p1278 = 1). - short-circuit in brake winding. 40: Fault in "brake closed" state. 50: Fault in the brake control circuit of the Control Unit or communication fault between the Control Unit and Motor Module (brake control diagnostics). 80: When using the Safe Brake Adapter (SBA), a fault has occurred in the brake control of the Control Unit. See also: p1278 (Brake control diagnostics evaluation)

- Remedy:**
- check the motor holding brake connection.
 - for a parallel connection, check the setting of the power unit data set to control the holding brake (p7015).
 - check the function of the motor holding brake.
 - check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.
 - check that the electrical cabinet design and cable routing are in compliance with EMC regulations (e.g. shield of the motor cable and brake conductors are connected with the shield connecting plate and the motor connectors are tightly screwed to the housing).
 - replace the Motor Module involved.
- Operation with Safe Brake Module:
- check the Safe Brake Module connection.
 - replace the Safe Brake Module.
- Operation with Safe Brake Adapter (SBA):
- check the SBA connection and if required, replace the SBA.
- See also: p1215 (Motor holding brake configuration), p1278 (Brake control diagnostics evaluation)

207931 <location>Brake does not open

- Drive object:** SERVO_828, SERVO_COMBI
- Message value:** -
- Reaction:** NONE
- Acknowledge:** NONE
- Cause:** This alarm is output for r1229.4 = 1.
See also: p1216 (Motor holding brake opening time), r1229 (Motor holding brake status word)
- Remedy:**
- check the functionality of the motor holding brake.
 - check the feedback signal (p1223).

207932 <location>Brake does not close

- Drive object:** SERVO_828, SERVO_COMBI
- Message value:** -
- Reaction:** NONE
- Acknowledge:** NONE
- Cause:** This alarm is output for r1229.5 = 1.
For r1229.5 = 1, OFF1/OFF3 are suppressed to prevent the drive accelerating by a load that drives the motor - whereby OFF2 remains effective.
See also: p1217 (Motor holding brake closing time), r1229 (Motor holding brake status word)
- Remedy:**
- check the functionality of the motor holding brake.
 - check the feedback signal (p1222).

207934 <location>Drive: S120 Combi motor holding brake configuration

- Drive object:** SERVO_828, SERVO_COMBI
- Message value:** %1
- Reaction:** NONE (OFF1, OFF2, OFF3)
- Acknowledge:** IMMEDIATELY (POWER ON)

Cause:	A connected motor holding brake has been detected with an S120 Combi. However, this brake has not been assigned to just one Combi feed drive and, therefore, brake control is not configured (correctly). Fault value (r0949, interpret decimal): 0: No motor holding brake is assigned (p1215 = 0 or 3 on all S120 Combi feed drives). 1: More than one motor holding brake has been assigned (p1215 = 1 or 2 on more than one S120 Combi feed drive) - or there is more than one DRIVE-CLiQ motor with motor holding brake. 2: Brake was accidentally assigned to the spindle (p1215 = 1); this is not permitted for this software release. 3: An attempt was made to enable the function "Safe Brake Control" (SBC, p9602 = p9802 = 1) for the spindle. This is not permitted for this software release.
Remedy:	Check whether the motor holding brake has been assigned to one S120 Combi feed drive exclusively (p1215 = 1 or 2). The fault will only be withdrawn once the motor holding brake has been assigned to just one of the S120 Combi feed drives (p1215 = 1 or 2 for this one drive). From this point, the motor holding brake will be controlled by this drive. See also: p1215 (Motor holding brake configuration)

207935 <location>Drive: Incorrect motor holding brake configuration

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE (OFF1, OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause: An incorrect motor holding brake configuration was detected.

Fault value (r0949, interpret decimal):

0:

A motor holding brake was detected where the brake control has not been configured (p1215 = 0).

The brake control configuration was set to "motor holding brake the same as sequence control" (p1215 = 1) (only when commissioning for the first time).

For a chassis unit with Safe Brake Adapter (SBA), the interconnection p9621 = r9872.3 was established (only when commissioning for the first time).

For a parallel connection, the power unit was set in p7015, to which the motor holding brake is connected (only when commissioning for the first time).

1:

A motor holding brake was detected where the brake control has not been configured (p1215 = 0).

The brake control configuration was left at "No motor holding brake available" (p1215 = 0).

11:

The identification had detected more than one motor holding brake for a parallel connection.

12:

For the parallel connection, in p0121 there is no valid component number for the power unit data set that is set in p7015.

13:

With the "Safe Brake Control" (SBC) function activated, an attempt was made to change the value in p7015.

14:

For a parallel connection, the power units set in p7015 cannot be addressed.

Remedy:

- For fault value = 0:
 - no remedy required.
- For fault value = 1:
 - if required change the motor holding brake configuration (p1215 = 1, 2).
 - if this fault value unexpectedly occurs, then the motor connections should be checked in order to rule out that they have been interchanged.
- For fault value = 11:
 - For a parallel connection, only connect one motor holding brake.
- For fault value = 12:
 - Check the setting of the power unit data set for a parallel connection (p7015).
- For fault value = 13:
 - Before changing p7015, deactivate the "Safe Brake Control" function (SBC) (p9602).
- For fault value = 14:
 - Check whether the power unit supports the brake control for a parallel connection (r9771.14).
 - Check whether there is a DRIVE-CLiQ communication error between the Control Unit and the power unit involved and, if required, carry out a diagnostics routine for the faults identified.

See also: p1215 (Motor holding brake configuration)

207950 <location>Drive: Incorrect motor parameter

Drive object: SERVO_828, SERVO_COMBI

Message value: Parameter: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause:

- the motor parameters were incorrectly entered while commissioning (e.g. p0300 = 0, no motor)
- the braking resistor has still not been parameterized - commissioning cannot be completed.

Fault value (r0949, interpret decimal):

Parameter number involved.

300 (CU250S-2):

For this control mode, the motor type is not supported.

307:

The following motor parameters could be incorrect:

p0304, p0305, p0307, p0308, p0309

See also: p0300, p0301, p0304, p0305, p0307, p0310, p0311, p0314, p0315, p0316, p0320, p0322, p0323

Remedy: Compare the motor data with the rating plate data and if required, correct.

For fault value = 300 (CU250S-2):

Operate a motor type supported by the selected control mode.

207955 <location>Drive: Motor has been changed

Drive object: SERVO_828, SERVO_COMBI

Message value: Parameter: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: The code number of the actual motor with DRIVE-CLiQ does not match the saved number. The code numbers of the bearings, gearbox or brake do not match the saved numbers.

Fault value (r0949, interpret decimal):

Number of the incorrect parameter

See also: p0301 (Motor code number selection), r0302 (Motor code number of motor with DRIVE-CLiQ)

Remedy: Connect the original motor, switch on the Control Unit again (POWER ON) and exit quick commissioning with p0010 = 0.
Or: set p0300 = 10100, without recommissioning (only if the motor data have not changed)
Or: set p0300 = 10000 (load the parameters from the motor with DRIVE-CLiQ) and re-commission. The data for bearings, gearbox and brake are reloaded.
Quick commissioning (p0010 = 1) is automatically exited with p3900 > 0.
If quick commissioning was exited with p0010 = 0, then an automatic controller calculation (p0340 = 1) is not carried out.

207956 <location>Drive: Motor code does not match the list (catalog) motor

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: The motor code of the connected motor with DRIVE-CLiQ does not match the possible list motor types (see selection in p0300).

The connected motor with DRIVE-CLiQ might not be supported by this firmware version.

Fault value (r0949, interpret decimal):

Motor code of the connected motor with DRIVE-CLiQ.

Note:

The first three digits of the motor code generally correspond to the list motor type.

Remedy: Use a motor with DRIVE-CLiQ and the matching motor code.

207960 <location>Drive: Incorrect friction characteristic

Drive object: SERVO_828, SERVO_COMBI

Message value: Parameter: %1

Reaction: NONE

Acknowledge: NONE

Cause: The friction characteristic is incorrect.

Alarm value (r2124, interpret decimal):

1:

Incorrect parameter format.

1538:

The friction torque is greater than the maximum from the upper effective torque limit (p1538) and zero. This is the reason that the output of the friction characteristic (r3841) is limited to this value.

1539:

The friction torque is less than the minimum from the lower effective torque limit (p1539) and zero. This is the reason that the output of the friction characteristic (r3841) is limited to this value.

3820 ... 3829:

Incorrect parameter number. The speeds entered in the parameters for the friction characteristic do not correspond to the following condition:

$0.0 < p3820 < p3821 < \dots < p3829 \leq p0322$ or $p1082$, if $p0322 = 0$

Therefore the output of the friction characteristic (r3841) is set to zero.

3830 ... 3839:

Incorrect parameter number. The torques entered in the parameters for the friction characteristic do not correspond to the following condition:

$0 \leq p3830, p3831 \dots p3839 \leq p0333$

Therefore the output of the friction characteristic (r3841) is set to zero.

See also: r3840 (Friction characteristic status word)

Remedy: Fulfill the conditions for the friction characteristic.
 For alarm value = 1538:
 Check the upper effective torque limit (e.g. in the field weakening range).
 For alarm value = 1539:
 Check the lower effective torque limit (e.g. in the field weakening range).
 For alarm value = 3820 ... 3839:
 Fulfill the conditions to set the parameters of the friction characteristic.
 If the motor data (e.g. the maximum speed p0322) are changed during commissioning (p0010 = 1, 3), then the technological limits and threshold values, dependent on this, must be re-calculated by selecting p0340= 5.

207961 <location>Drive: Record friction characteristic activated

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The automatic friction characteristic record is activated.
 The friction characteristic is recorded at the next switch-on command.
 When plotting the friction characteristic, it is not possible to save the parameters (p0971, p0977).

Remedy: Not necessary.
 The alarm is automatically withdrawn after the friction characteristic recording has been successfully completed or recording has been deactivated (p3845 = 0).

207963 <location>Drive: Record friction characteristic canceled

Drive object: SERVO_828, SERVO_COMBI

Message value: Parameter: %1

Reaction: OFF1

Acknowledge: IMMEDIATELY

Cause: The conditions to record the friction characteristic are not fulfilled.
 Fault value (r0949, interpret decimal):
 0046: Missing enable signals (r0046).
 1082: The highest speed value to be approached (p3829) is greater than the maximum speed (p1082).
 1084: The highest speed value to be approached (p3829) is greater than the maximum speed (r1084, p1083, p1085).
 1087: The highest speed value to be approached (p3829) is greater than the maximum speed (r1087, p1086, p1088).
 1110: Friction characteristic record, negative direction selected (p3845) and negative direction inhibited (p1110).
 1111: Friction characteristic record, positive direction selected (p3845) and positive direction inhibited (p1111).
 1198: Friction characteristic record selected (p3845 > 0) and negative (p1110) and positive directions (p1111) inhibited (r1198).
 1300: The control mode (p1300) has not been set to closed-loop speed control.
 1755: For encoderless closed-loop control (p1300 = 20), the lowest speed value to be approached (p3820) is less than or equal to the changeover speed, open-loop controlled operation (p1755).
 1910: Motor data identification activated.
 1960: Speed controller optimization activated.
 3820 ... 3829: speed (p382x) cannot be approached.
 3840: Friction characteristic incorrect.
 3845: Friction characteristic record deselected.

Remedy: Fulfill the conditions to record the friction characteristic.

For fault value = 0046:

- establish missing enable signals.

For fault value = 1082, 1084, 1087:

- Select the highest speed value to be approached (p3829) less than or equal to the maximum speed (p1082, r1084, r1087).
- Re-calculate the speed points along the friction characteristic (p0340 = 5).

For fault value = 1110:

- Select the friction characteristic record, positive direction (p3845).

For fault value = 1111:

- Select the friction characteristic record, negative direction (p3845).

For fault value = 1198:

- Enable the permitted direction (p1110, p1111, r1198).

For fault value = 1300:

- set the control mode (p1300) on the closed-loop speed control (p1300 = 20, 21).

For fault value = 1755:

- For encoderless closed-loop speed control (p1300 = 20) select the lowest speed value to be approached (p3820) greater than the changeover speed of open-loop controlled operation (p1755).
- Re-calculate the speed points along the friction characteristic (p0340 = 5).

For fault value = 1910:

- Exit the motor data identification routine (p1910).

For fault value = 1960:

- Exit the speed controller optimization routine (p1960).

For fault value 3820 ... 3829:

- check the load at speed p382x.
- check the speed signal (r0063) for oscillation at speed p382x. Check the settings of the speed controller if applicable.

For fault value = 3840:

- Make the friction characteristic error-free (p3820 ... p3829, p3830 ... p3839, p3840).

For fault value = 3845:

- Activate the friction characteristic record (p3845).

207965 <location>Drive: Save required

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The angular commutation offset (p0431) was re-defined and has still not been saved.
In order to permanently accept the new value, it must be saved in a non-volatile fashion (p0971, p0977).
See also: p0431 (Angular commutation offset), p1990 (Encoder adjustment determine angular commutation offset)

Remedy: Not necessary.
This alarm is automatically withdrawn after the data has been saved.
See also: p0971 (Save drive object parameters), p0977 (Save all parameters)

207966 <location>Drive: Check the commutation angle

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2 (NONE)

Acknowledge: IMMEDIATELY

Cause: The speed actual value was inverted and the associated angular commutation offset is not equal to zero and is therefore possibly incorrect.

Remedy: Angular commutation offset after the actual value inversion or determine it again (p1990=1).

207971	<location>Drive: Angular commutation offset determination activated
Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The automatic determination of the angular commutation offset (encoder adjustment) is activated (p1990 = 1). Note: The automatic determination is carried out at the next switch-on command. For SERVO and fault F07414 present, the following applies: The determination of the angular commutation offset is automatically activated (p1990 = 1), if a pole position identification technique is set in p1980. See also: p1990 (Encoder adjustment determine angular commutation offset)
Remedy:	Not necessary. The alarm is automatically withdrawn after successful determination or for the setting p1990 = 0.

207979	<location>Drive: pole position identification calibration required
Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The pole position identification was not successful as the calibration values for the current measurement are not correct.
Remedy:	Replace the Motor Module involved.

207980	<location>Drive: Rotating measurement activated
Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The rotating measurement is activated. For the rotating measurement, the motor can accelerate up to the maximum speed and with maximum torque. Only the parameterized current limit (p0640) and the maximum speed (p1082) are effective. The behavior of the motor can be influenced using the direction inhibit (p1959.14, p1959.15) and the ramp-up/ramp-down time (p1958). The rotating measurement is carried out at the next switch-on command. See also: p1960
Remedy:	Not necessary. The alarm is automatically withdrawn after the rotating measurement has been successfully completed or for the setting p1960 = 0. Note: If a POWER ON or a warm restart is performed with motor data identification selected, the motor data identification request will be lost. If motor data identification is required, it will need to be selected again manually following ramp-up.

207990	<location>Drive: Identification incorrect
Drive object:	HLA_828
Message value:	%1
Reaction:	OFF1 (NONE, OFF2)
Acknowledge:	IMMEDIATELY

- Cause:** A fault has occurred during the identification routine.
Fault value (r0949, interpret decimal):
- 1: piston calibration without absolute position (p1407.3 = 0).
 - 2: determining the control sense without moving in both directions.
 - 3: determining the control sense without a clear result.
 - 4: determining the valve offset without moving.
 - 5: traversing range identification without absolute position or piston calibration.
 - 6: the measured piston stroke differs from the parameterized piston stroke (p0313) by more than 20 %.
 - 7: For the characteristic measurement, the drive comes to a standstill before reaching the parameterized free distance.
 - 8: The loop gain of the force controller is incorrect. At the positive end stop, pA (r0067) < pB (r0068).
 - 10: There are less than 10 measuring points not equal to zero on one of the two characteristic sides (r1962). The measured characteristic is not evaluated.
 - 100: Position and speed actual value inversion differ (p0410).
 - 101: Start of measuring range > end of measuring range (p1955[0] > p1955[1]).
 - 102: Minimum measuring travel > maximum measuring travel (p1956[0] > p1956[1]).
 - 190: Velocity setpoint is not zero.

Remedy:	For fault value = 1: - reference (home) the drive before calibrating the piston (p1407.3 must be = 1). For fault value = 2, 3: - drive must be able to be moved. - check system pressure and shutoff valves. - increase the settling time (p1958[1]). For fault value = 4: - drive must be able to be moved. - check system pressure and shutoff valves. For fault value = 5: - reference (home) the drive before the traversing range identification (p1407.3 must be = 1) and calibrate the piston (p1909.1 = 1 or p1959.2 = 1 and p1960 = 1). For fault value = 6: - there is an obstruction in the traversing range. If necessary, remove the obstruction. If the measuring travel with obstruction is sufficient, no measure has to be applied. - the piston stroke was incorrectly parameterized. If the actual piston stroke is less than the parameterized stroke, correct it (p0313). A piston stroke that has been parameterized too low, is automatically corrected. - the selected search voltage is not sufficient for one direction in order to overcome the existing piston or guide friction. Check the setting of the search voltage to identify the valve characteristic, and if required, increase (p1955[2, 3]). For fault value = 7: - piston calibration was incorrectly carried out. Correct the piston calibration or automatically calibrate it (p1959.2 = 1 and p1960 = 1). - the minimum or maximum parameterized measuring travel cannot be traversed as there is an obstruction in the path or the piston stroke was incorrectly parameterized. If required, correct the measuring travel (p1956[0], p1956[1]), correct the piston stroke or automatically calibrate it (p1959.x = 1 and p1960 = 1). - drive cannot be traversed, because the shutoff valve does not open, the system pressure is not available, encoder or valve are not connected. Check the shutoff valve, system pressure, encoder and valve connection. For fault value = 8: - interchange the connectors of pressure sensors A and B or invert the direction of motion (p1820, p0410) and repeat the complete moving measurement. - check the reference values for pressure sensors (p0240, p0242). For fault value = 10: - check the connection between the encoder and cylinder. - measuring distance too short, if required lengthen (p1956[0], p1956[1]). - measuring time too long, if required shorten (p1958[0], p1958[1], p1958[2]). - increase the number of measuring points to a minimum of 20 (p1957[0]). For fault value = 100: - set the position and speed actual value inversion the same (p0410 = 0 or p0410 = 3). For fault value = 101: - start of measuring range must be parameterized less than the end of measuring range (p1955[0] > p1955[1]). For fault value = 102: - minimum measuring distance must be parameterized less than the maximum measuring distance (p1956[0] > p1956[1]). For fault value = 190: - during the identification, the velocity setpoint must be zero.
----------------	---

207990 <location>Drive: Incorrect motor data identification

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2 (NONE, OFF1)
Acknowledge:	IMMEDIATELY

Cause:	A fault has occurred during the identification routine. Fault value (r0949, interpret decimal): 10: Data set changeover during motor data identification. 101: Voltage amplitude even at 30% maximum current amplitude is too low to measure the inductance. 102, 104: Voltage limiting while measuring the inductance. 103: Maximum frequency exceeded during the rotating inductance measurement. 110: Motor not finely synchronized before the rotating measurement. 111: The zero mark is not received within 2 revolutions. 112: Fine synchronization is not realized within 8 seconds after the zero mark has been passed. 113: The power, torque or current limit is zero. 115: U/f control is active. 120: Error when evaluating the magnetizing inductance. 125: Cable resistance greater than the total resistance. 126: Series inductance greater than the total leakage inductance. 127: Identified leakage inductance negative. 128: Identified stator resistance negative. 129: Identified rotor resistance negative. 130: Drive data set changeover during the motor data identification routine. 140: The setpoint channel inhibits both directions. 150: The holding brake is closed using command "Unconditionally close holding brake" (p0858). 151: The determined force due to weight is higher than the rated motor torque (p0333). 152: The torque precontrol channel (CI: p1511) is already interconnected. 153: The saturation characteristic cannot be approximated and evaluated. 154: The optimum flux characteristic cannot be determined from the saturation characteristic. 160: Accelerating time when determining kT, moment of inertia or reluctance torque too short or too long. 161: When measuring the kT characteristic, constants kT1, kT3, kT5 and kT7 were not able to be determined (p0645 ... p0648), as too few points were measured. 165: The current limit was reduced below the measurement current while determining the reluctance torque. 173: Internal problem. 180: identification speed (maximum speed, rated speed, 0.9 x p0348) less than p1755 or no DC link voltage available. 181: Zero speed at the end of the measurement of periodic position errors. 182: No complete mechanical revolution at to the end of the measurement of periodic position errors. 190: Speed setpoint not equal to zero. 191: An actual speed of zero is not reached. 192: Speed setpoint not reached. 193: Inadmissible motion of the motor when identifying the voltage emulation error. 194: Supplementary torque (r1515) not equal to zero. 195: Closed-loop torque control active. 200, 201: Not possible to identify the voltage emulation error characteristic of the drive converter (p1952, p1953).
---------------	--

Remedy:

For fault value = 10:

- do not initiate a data set changeover during the motor data identification.

For fault value = 101:

- increase current limit (p0640) or torque limit (p1520, p1521).
- check current controller gain (p1715).
- reduce current controller sampling time (p0115).

It may be impossible to completely identify the L characteristic, as required current amplitude is too high.

- suppress meas. (p1909, p1959).

For fault value = 102, 104:

- reduce current limit (p0640).
- check current controller P gain.
- suppress meas. (p1909, p1959).

For fault value = 103:

- increase external moment of inertia (if possible).
- reduce current controller sampling time (p0115).
- suppress meas. (p1909, p1959).

For fault value = 110:

- before rotating measurement, traverse motor over zero mark.

For fault value = 111:

- it is possible that encoder does not have zero mark. Correct setting in p0404.15.
- encoder pulse number was incorrectly entered. Correct setting in p0408.
- if zero mark signal is defective, replace encoder.

For fault value = 112:

- upgrade encoder software.

For fault value = 113:

- check the limits (p0640, p1520, p1521, p1530, p1531), correct the zero values.

For fault value = 115:

- deselect U/f control (p1317 = 0).

For fault value = 120:

- check current controller P gain (p1715) and if required, reduce.
- increase the pulse frequency (p1800).

For fault value = 125:

- reduce cable resistance (p0352).

For fault value = 126:

- reduce series inductance (p0353).

For fault = 127, 128, 129:

- it is possible that current controller is oscillating. Reduce the P gain (p1715).
- if required, reduce the current limit (p0640).

For fault value = 130:

- do not initiate a drive data set changeover during motor ident. routine.

For fault value = 140:

- before the measurement, enable at least one direction (p1110 = 0 or p1111 = 0 or p1959.14 = 1 or p1959.15 = 1).

For fault value = 150:

- if necessary withdraw command "Unconditionally close holding brake" (BI: p0858 = 0 signal).

For fault value = 151:

- the motor cannot continuously hold the force due to weight. Either reduce the force due to weight or use a motor with a higher rated torque.

For fault value = 152:

- add the measured force due to weight (p1532) to the signal source of p1511.
- if necessary withdraw the BICO interconnection from p1511 (p1511 = 0), and repeat the measurement.

For fault value = 153/154:

- optimum characteristic was not able to be evaluated and activated. If necessary contact the service department, and attach the values of r1962[0...9] and r1963[0...9].

For fault value = 160:

- extend accelerating time when determining kT, moment of inertia and reluctance torque, e.g. by increasing max. speed (p1082), increasing moment of inertia or reducing max. current (p0640).
- in encoderless operation with load moment of inertia, parameterize the load moment of inertia (p1498).
- reduce the ramp-up time (p1958).
- increase speed controller P gain (p1460).
- suppress meas. (p1959).

For fault value = 161:

- reduce the ramp-up time (p1958).
- increase max. speed (p1082).
- reduce current limit (p0640).
- if required, do not activate the kT characteristic (p1780.9 = 0).

For fault value = 165:

- decrease max. current (p0640).

For fault value = 173:

-

For fault value = 180:

- switch-on the infeed
- increase max. speed (p1082).
- reduce p1755.
- suppress meas. (p1909, p1959).

For fault value = 181, 182:

- increase max. speed (p1082).
- if required, deactivate the measurement (p1959.0 = 0).

Note:

- to measure periodic position errors, the encoder must have absolute position information (unique zero mark, distance-coded zero marks, absolute encoder, 1-pole resolver p5263.10).

For fault value = 190:

- set speed setpoint to zero.

For fault value = 191:

- do not start motor data identification routine while motor is still rotating.

For fault value = 192:

- check closed-loop speed control (motor rotor may be locked or closed-loop speed control is not functioning).
- for p1215 = 1, 3 (brake the same as the sequence control) check the control sense (p0410.0).
- ensure that enable signals are present during measurement.
- remove any pulling loads from motor.
- increase max. current (p0640).
- reduce max. speed (p1082).
- suppress meas. (p1959).

For fault value = 193:

- the motor has moved through more than 5 ° electrical (r0093). Lock motor rotor at one of these pole position angles (r0093): 90 °, 210 ° or 330 ° (+/-5 °) and then start identification.

For fault value = 194:

- switch out all supplementary torques (e.g. CI: p1511).
- for hanging/suspended axes: Lock motor rotor at one of these pole position angles (r0093): 90 °, 210 ° or 330 ° (+/-1 °) and then start identification.

For fault value = 195:

- deselect closed-loop torque control (p1300 = 21 or 20, or set the signal source in p1501 to a 0 signal).

For fault value = 200, 201:

- set pulse frequency to 0.5 x current controller frequency (e.g. 4 kHz for a current controller sampling time = 125 us).
- reduce cable length between Motor Module and motor.
- read-out measured values (r1950, r1951) and therefore determine suitable values for p1952, p1953 according to your own estimation.

207991	<location>Drive: Data identification activated
Drive object:	HLA_828
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	Data identification is activated. Data identification is performed at the next switch-on command. When doing this, the drive moves. See also: p1910, p1960
Remedy:	Not necessary. The alarm is automatically withdrawn after the data identification routine has been successfully completed or for the setting p1910 = 0 or p1960 = 0. If a POWER ON or a warm restart is performed with motor data identification selected, the motor data identification request will be lost. If motor data identification is required, it will need to be selected again manually following ramp-up.
207991	<location>Drive: Motor data identification activated
Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The motor data identification routine is activated. The motor data identification routine is carried out at the next switch-on command. See also: p1910, p1960
Remedy:	Not necessary. The alarm is automatically withdrawn after the motor data identification routine has been successfully completed or for the setting p1910 = 0 or p1960 = 0. If a POWER ON or a warm restart is performed with motor data identification selected, the motor data identification request will be lost. If motor data identification is required, it will need to be selected again manually following ramp-up.
207993	<location>Drive: Incorrect direction of rotation of the field or encoder actual value inversion
Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2 (NONE)
Acknowledge:	IMMEDIATELY
Cause:	Either the direction of the rotating field or the encoder actual value has an incorrect sign. The motor data identification automatically changed the actual value inversion (p0410) in order to correct the control sense. This can result in a direction of rotation change. Note: To acknowledge this fault, the correctness of the direction of rotation must first be acknowledged with p1910 = -2.
Remedy:	Check the direction of rotation (also for the position controller, if one is being used). If the direction of rotation is correct, the following applies: No additional measures are required (except set p1910 = -2 and acknowledge fault). If the direction of rotation is incorrect, the following applies: To change the direction of rotation, two phases must be interchanged and the motor identification routine must be repeated.
207995	<location>Drive: Pole position identification not successful
Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY

Cause: The pole position identification routine was unsuccessful.
 Fault value (r0949, interpret decimal):

- 1: No current is established.
- 2: The starting current is not zero.
- 3: The selected max. distance was exceeded (p1981).
- 4x: The measuring signal does not permit a clear evaluation.
- 5: The max. current was exceeded during the measurement.
- 6: The current measurement must be re-calibrated.
- 7x: The Sensor Module does not support the pole position identification routine.
- 8: The pole position identification routine current required is greater than the max. current.
- 9: The set pole position identification routine current is zero.
- 10: Data set changeover during the pole position identification.
- 11: The encoder adjustment to determine the commutation angle is active (p1990 = 1) and the encoder without zero mark is not finely synchronized or does not have any valid data.
- 100: motion-based pole position identification, 1st and 2nd Measurements differ. Motor blocked or current (p1993) too low.
- 101: Motion-based position position identification, insufficient motion, motor blocked or current (p1993) too low.
- 102: Motion-based pole position identification, brake is being used and is closed. The motion-based position position identification in conjunction with the brake is not permitted.
- 103: Motion-based pole position identification without encoder.
- 104: Motion-based pole position identification, speed actual value not zero after stabilizing time.
- 200: Elasticity-based pole position identification, internal error in the arctan calculation (0/0).
- 201: Elasticity-based pole position identification, too few measuring points that can be evaluated.
- 202: Elasticity-based pole position identification, outliers in the measurement series.
- 203: Elasticity-based pole position identification, maximum rotation without current.
- 204: Elasticity-based pole position identification, no positive edge found.
- 205: Elasticity-based pole position identification, the result of the Fourier transformation differs by more than 480 ° electrical / p3093 from the rough estimate.
- 206: Elasticity-based pole position identification, plausibility test unsuccessful.
- 207: Elasticity-based pole position identification, no negative measured value found.

It is possible that all measured values are identical. The expected deflection was not able to be reached, either because the expectation is too high or not enough current was able to be established.

- 208: Elasticity-based pole position identification, measuring current is 0.
- 209: Elasticity-based pole position identification, the selected max. distance was exceeded (p3095).
- 210: Elasticity-based pole position identification without encoder.

250 ... 260:
 Elasticity-based pole position identification, more than 3 attempts have been made and fault value 200 ... 210 output.

Example:
 Fault value= 253 --> more than 3 attempts have been made and fault value 203 output.

Remedy:

For fault value = 1:

- check the motor connection and DC link voltage.
- for the following parameters, set practical values that are not zero (p0325, p0329).

For fault value = 1, 2:

- in the case of a large computing time load (e.g. 6 drives with Safety Integrated), set the computing dead time of the current controller to late transfers (p0117 = 3).

For fault value = 3:

- increase the max. distance (p1981).
- reduce the currents for the pole position identification routine (p0325, p0329).
- stop the motor in order to carry out the pole position identification routine.

For fault value = 5:

- reduce the currents for the pole position identification routine (p0325, p0329).

For fault value = 6:

- re-calibrate the Motor Module.

For fault value = 8:

- reduce the currents for the pole position identification routine (p0329, p0325, p1993).
- the power unit cannot provide the necessary pole position identification routine current ($p0209 < p0329$, p0325, p1993), replace the power unit with a power unit with a higher max. current.

For fault value = 9:

- enter a value not equal to zero in the pole position identification routine current (p0329, p0325, p1993).

For fault value = 10:

- do not initiate a data set changeover during the pole position identification.

For fault value = 11:

- for incremental encoders without commutation with zero mark ($p0404.15 = 0$), it does not make sense to adjust the encoder to determine the commutation angle ($p1990 = 1$). In this case, the function should be deselected ($p1990 = 0$) or, for an encoder with suitable zero mark, commutation with zero mark should be selected ($p0404.15 = 1$).
- for absolute encoders, only adjust the encoder to determine the commutation angle ($p1990 = 1$) if the encoder supplies commutation information and is finely synchronized ($p1992.8 = 1$ and $p1992.10 = 1$). The encoder is possibly parked, deactivated (p0145), not ready for operation or signals a fault condition.
- deselect the encoder adjustment to determine the commutation angle (set p1990 to 0).

For fault value = 40 ... 49:

- increase the currents for the pole position identification routine (p0325, p0329).
- stop the motor in order to carry out the pole position identification routine.
- select another technique for pole position identification routine (p1980).
- use another motor, absolute encoder or Hall sensors.

For fault value = 70 ... 79:

- upgrade the software in the Sensor Module.

For fault value = 100, 101:

- check and ensure that the motor is free to move.
- increase the current for motion-based pole position identification (p1993).

For fault value = 102:

- if the motor is to be operated with a brake: Select a different technique to identify the pole position (p1980).
- if the motor can be operated without a brake: Open the brake ($p1215 = 2$).

For fault value = 103:

- the motion-based pole position identification can only be carried out using an encoder. Connect an encoder or select another technique for pole position identification routine (p1980).

For fault value = 104:

- pole position identification, increase the smoothing time, motion-based (p1997).
- pole position identification, increase the rise time, motion-based (p1994).
- pole position identification, check the gain, motion-based (p1995).
- pole position identification, check the integral time, motion-based (p1996).
- for motor encoders with track A/B sq-wave ($p0404.3 = 1$) and flank time measurement ($p0430.20 = 0$), disable the integral time ($p1996 = 0$).

For fault value = 200:

- check parameter setting (p3090 ... p3096).

For fault value = 201:

- check parameter setting (p3090 ... p3096).
- reduce p3094.

For fault value = 202:

- check parameter setting (p3090 ... p3096).
- fault has occurred during the identification. Repeat the measurement.
- check the brake or brake control.

For fault value = 203:

- check the brake or brake control.
- check the measuring current (p3096).
- increase p3094.

For fault value = 204:

- check parameter setting (p3090 ... p3096).

For fault value = 205:

- check parameter setting (p3090 ... p3096).

For fault value = 206:

- check parameter setting (p3090 ... p3096).
- fault has occurred during the identification. Repeat the measurement.
- check the brake or brake control.

For fault value = 207:

- reduce the expected deflection (p3094).
- increase the measuring current (p3096).

For fault value = 208:

- set the measuring current (p3096).

For fault value = 209:

- check parameter setting p3095.
- check the brake or brake control.

For fault value = 210:

- the elasticity-based pole position identification can only be carried out using an encoder. Connect an encoder or select another technique for pole position identification routine (p1980).

For fault value = 250 ... 260:

- check parameter setting (p3090 ... p3096, p1980).

207996 <location>Drive: Pole position identification routine not carried out

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: ENCODER (OFF2)

Acknowledge: IMMEDIATELY

Cause: In operation, the operating mode that requires a pole position identification was changed over, which is not possible in this state.

- the drive was changed over, flying, from encoderless operation to operation with encoder without having previously carried out a pole position identification for the encoder. p1404 is then at a value between zero and the max. speed and the pulses in the speed range above p1404 were enabled without a pole position ident. routine having been previously carried out in operation with encoder.

- in operation, an EDS changeover was made to an encoder where it is necessary to carry out a pole position identification. However, this has still not been carried out (p1982 = 1 or 2 and p1992.7 = 0).

Remedy: - for a flying changeover between operation with and without encoder with pole position identification after POWER ON or commissioning (p0010 not equal to zero) enable the pulses once at zero speed. This means that the pole position identification routine is carried out and the result is available for operation.

- carry out the EDS changeover with the pulses inhibited, or, before the changeover, carry out a pole position identification using this data set.

207998	<location>Drive: Motor data identification active on another drive
Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The motor data identification is activated on the drive object specified in the alarm value, and interlocks the other drive objects so they cannot be switched on. Alarm value (r2124, interpret decimal): Drive object with the active motor data identification. See also: p1910, p1960
Remedy:	- wait for the complete execution of the motor data identification of the drive object designated in the alarm value. - deselect the motor data identification for the drive object designated in the alarm value (p1910 = 0 or p1960 = 0).
207999	<location>Drive: Motor data identification cannot be activated
Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	Closed-loop control is enabled on a SERVO drive object type. To select motor data identification, pulses must be suppressed for all SERVO drive objects. Alarm value (r2124, interpret decimal): Drive object with enabled closed-loop control.
Remedy:	Withdraw the pulse enable on all drives and re-activate the motor data identification.
208000	<location>TB: +/-15 V power supply faulted
Drive object:	A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, CU_NX_828, CU_NX_COMBI, HUB, S_INF_828, S_INF_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	Infeed: NONE (OFF1, OFF2) Servo: NONE (IASC/DCBRK, OFF1, OFF2, OFF3, STOP2) Hla: NONE (OFF1, OFF2, OFF3, STOP2)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	Terminal Board 30 detects an incorrect internal power supply voltage. Fault value (r0949, interpret decimal): 0: Error when testing the monitoring circuit. 1: Fault in normal operation.
Remedy:	- replace Terminal Board 30. - replace Control Unit.
208010	<location>TB: Analog-digital converter
Drive object:	A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, CU_NX_828, CU_NX_COMBI, HUB, S_INF_828, S_INF_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	-
Reaction:	Infeed: NONE (OFF1, OFF2) Servo: NONE (IASC/DCBRK, OFF1, OFF2, OFF3, STOP2) Hla: NONE (OFF1, OFF2)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The analog/digital converter on Terminal Board 30 has not supplied any converted data.
Remedy:	- check the power supply. - replace Terminal Board 30.

208500	<location>COMM BOARD: Monitoring time configuration expired
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	Infeed: OFF1 (OFF2) Servo: OFF1 (OFF2, OFF3) Hla: OFF1 (OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	The monitoring time for the configuration has expired. Fault value (r0949, interpret decimal): 0: The transfer time of the send configuration data has been exceeded. 1: The transfer time of the receive configuration data has been exceeded.
Remedy:	Check communications link.
208501	<location>PN/COMM BOARD: Setpoint timeout
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	-
Reaction:	Infeed: OFF1 (OFF2) Servo: OFF3 (IASC/DCBRK, NONE, OFF1, OFF2, STOP2) Hla: OFF3 (NONE, OFF1, OFF2, STOP2)
Acknowledge:	IMMEDIATELY
Cause:	The reception of setpoints from the COMM BOARD has been interrupted. - bus connection interrupted. - controller switched off. - controller set into the STOP state. - COMM BOARD defective.
Remedy:	- Restore the bus connection and set the controller to RUN. - if the error is repeated, check the update time set in the bus configuration (HW Config).
208502	<location>PN/COMM BOARD: Monitoring time sign-of-life expired
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	-
Reaction:	Infeed: OFF1 (OFF2) Servo: OFF1 (OFF2, OFF3) Hla: OFF1 (OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	The monitoring time for the sign-of-life counter has expired. The connection to the COMM BOARD was interrupted.
Remedy:	- check communications link. - check COMM BOARD.
208504	<location>PN/COMM BOARD: Internal cyclic data transfer error
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE

Cause: The cyclic actual and/or setpoint values were not transferred within the specified times.
Alarm value (r2124, interpret decimal):
Only for internal Siemens troubleshooting.

Remedy: Check the parameterizing telegram (Ti, To, Tdp, etc.).

208510 <location>PN/COMM BOARD: Send configuration data invalid

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1

Reaction: Infeed: OFF1 (OFF2)
Servo: OFF1 (OFF2, OFF3)
Hla: OFF1 (OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause: COMM BOARD did not accept the send-configuration data.
Fault value (r0949, interpret decimal):
Return value of the send-configuration data check.

Remedy: Check the send configuration data.

208511 <location>PN/COMM BOARD: Receive configuration data invalid

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The drive unit did not accept the receive configuration data.
Alarm value (r2124, interpret decimal):
Return value of the receive configuration data check.

- 1: Connection established to more drive objects than configured in the device. The drive objects for process data exchange and their sequence are defined in p0978.
- 2: Too many PZD data words for output or input to a drive object. The number of possible PZD items in a drive object is determined by the number of indices in r2050/p2051 for PZD IF1, and in r8850/p8851 for PZD IF2.
- 3: Uneven number of bytes for input or output.
- 4: Setting data for synchronization not accepted. For more information, see A01902.
- 5: Cyclic operation not active.
- 17: CBE20 Shared Device: Configuration of the F-CPU has been changed.
- 223: Illegal clock synchronization for the PZD interface set in p8815[0].
- 257: PN Shared Device: Too many PZD data words for output or input in the overall device.
- 500: Illegal PROFIsafe configuration for the interface set in p8815[1].
- 501: PROFIsafe parameter error (e.g. F_dest).
- 503: PROFIsafe connection is rejected as long as there is no isochronous connection (p8969).

Additional values:
Only for internal Siemens troubleshooting.

Remedy: Check the receive configuration data.
For alarm value = 1, 2:
- check the list of the drive objects with process data exchange (p0978). With p0978[x] = 0, all of the following drive objects in the list are excluded from the process data exchange.
For alarm value = 2:
- check the number of data words for output and input to a drive object.
For alarm value = 17:
- CBE20 Shared Device: Unplug/plug A-CPU.
For alarm value = 223, 500:
- check the setting in p8839 and p8815.
- ensure that only one PZD interface is operated in clock synchronism or with PROFIsafe.
For alarm value = 257:
- check the number of data words for output and input to the complete device.
For alarm value = 501:
- check the set PROFIsafe address (p9610).

208520 <location>PN/COMM BOARD: Non-cyclic channel error

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: The memory or the buffer status of the non-cyclic channel has an error.
Alarm value (r2124, interpret decimal):
0: Error in the buffer status.
1: Error in the memory.
Remedy: Check communications link.

208526 <location>PN/COMM BOARD: No cyclic connection

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value: -
Reaction: NONE
Acknowledge: NONE
Cause: There is no cyclic connection to the control.
Remedy: Establish the cyclic connection and activate the control with cyclic operation.
For PROFINET, check the parameters "Name of Station" and "IP of Station" (r61000, r61001).
If a CBE20 is inserted and PROFIBUS is to communicate via PZD Interface 1, then this must be parameterized using the STARTER commissioning tool or directly using p8839.

208530 <location>PN/COMM BOARD: Message channel error

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: The memory or the buffer status of the message channel has an error.
Alarm value (r2124, interpret decimal):
0: Error in the buffer status.
1: Error in the memory.
Remedy: Check communications link.

208531	<location>CBE20 POWER ON required
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	At least one parameter of the CBE20 (e.g. a parameter associated with SINAMICS Link) was changed as a result of a project download. A POWER ON is required to activate the values. Note: CBE20: Communication Board Ethernet 20
Remedy:	Back up the parameters and carry out a POWER ON (switch-off/switch-on).
208550	<location>PZD Interface Hardware assignment error
Drive object:	A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The assignment of the hardware to the PZD interface has been incorrectly parameterized. Alarm value (r2124, interpret decimal): 1: Only one of the two indices is not equal to 99 (automatic). 2: Both PZD interfaces are assigned to the same hardware. 3: Assigned COMM BOARD missing. 4: CBC10 is assigned to interface 1.
Remedy:	Check the parameterization and if required, correct (p8839).
208560	<location>IE: Syntax error in configuration file
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	A syntax error has been detected in the ASCII configuration file for the Industrial Ethernet interface (X127). The saved configuration file has not been loaded. Note: IE: Industrial Ethernet
Remedy:	- Check the interface configuration (p8900 and following), correct if necessary, and activate (p8905 = 1). - Save the parameters for interface configuration (e.g. p8905 = 2) or - reinitialize the station using the "Edit Ethernet node" screen form (e.g. with STARTER commissioning tool).
208561	<location>IE: Consistency error affecting adjustable parameters
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE

Cause:	A consistency error was detected when activating the configuration (p8905) for the Industrial Ethernet interface (X127). Alarm value (r2124, interpret decimal): 0: general consistency error 1: error in the IP configuration (IP address, subnet mask or standard gateway). 2: Error in the station names. 5: standard gateway is also set at the PROFINET onboard interface. 6: the station name is also set at the PROFINET onboard interface. 7: IP address is located in the same subnet as the IP address of the PROFINET onboard interface. Note: For alarm value = 0, 1, 2, 5, 7 the following applies: the configuration was not changed. For alarm value = 6 the following applies: The new configuration was however activated. IE: Industrial Ethernet
Remedy:	- check the required interface configuration (p8900 and following), correct if necessary, and activate (p8905). or - reinitialize the station using the "Edit Ethernet node" screen form (e.g. with STARTER commissioning tool).

208562 <location>PROFINET: Syntax error in configuration file

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	A syntax error has been detected in the ASCII configuration file for the onboard PROFINET interface. The saved configuration file has not been loaded.
Remedy:	- Check the interface configuration (p8920 and following), correct if necessary, and activate (p8925 = 1). - Save the parameters for interface configuration (e.g. p8925 = 2). or - reinitialize the station using the "Edit Ethernet node" screen form (e.g. with STARTER commissioning tool).

208563 <location>PROFINET: Consistency error affecting adjustable parameters

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	A consistency error was detected when activating the configuration (p8925) for the PROFINET interface. Alarm value (r2124, interpret decimal): 0: general consistency error 1: error in the IP configuration (IP address, subnet mask or standard gateway). 2: Name of station error. 3: DHCP was not able to be activated, as a cyclic PROFINET connection already exists. 4: a cyclic PROFINET connection is not possible as DHCP is activated. 5: standard gateway is also set at the Industrial Ethernet interface (X127). 6: standard station name is also set at the Industrial Ethernet interface (X127). 7: IP address is located in the same subnet as the IP address of the Industrial Ethernet interface (X127). Note: For alarm value = 0, 1, 2, 3, 4, 5, 7, the following applies: the configuration was not changed. For alarm value = 6 the following applies: The new configuration was however activated. DHCP: Dynamic Host Configuration Protocol

Remedy:

- check the required interface configuration (p8940 and following), correct if necessary, and activate (p8945).
- or
- reinitialize the station using the "Edit Ethernet node" screen form (e.g. with STARTER commissioning tool).

208564 <location>PN/COMM BOARD: syntax error in the configuration file

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: A syntax error has been detected in the ASCII configuration file for the Communication Board Ethernet 20/25/41 (CBE20/CBE25/CBE41). The saved configuration file has not been loaded.

Remedy:

- Correct and activate the CBExx configuration (p8940 and following) (p8945 = 2).
- Reinitialize the CBExx (e.g. using the STARTER commissioning tool)

Note:

The configuration is not applied until the next POWER ON!

208565 <location>PNCOMM BOARD: Consistency error affecting adjustable parameters

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: A consistency error was detected when activating the configuration (p8945) for the Communication Board Ethernet 20/25/41 (CBE20/CBE25/CBE41).

Alarm value (r2124, interpret decimal):

0: general consistency error

1: error in the IP configuration (IP address, subnet mask or standard gateway).

2: Error in the station names.

3: DHCP was not able to be activated, as a cyclic PROFINET connection already exists.

4: a cyclic PROFINET connection is not possible as DHCP is activated.

Note:

For all alarm values, the following applies: currently set configuration has not been activated.

DHCP: Dynamic Host Configuration Protocol

Remedy:

- check the required interface configuration (p8940 and following), correct if necessary, and activate (p8945).
- or
- reinitialize the station using the "Edit Ethernet node" screen form (e.g. with STARTER commissioning tool).

208700 <location>CAN: Communications error

Drive object: A_INF_828, B_INF_828, CU_LINK, HUB, S_INF_828, S_INF_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1

Reaction: Infeed: NONE (OFF1, OFF2)

Servo: OFF3 (NONE, OFF1, OFF2)

Hla: OFF3 (NONE, OFF1, OFF2)

Acknowledge: IMMEDIATELY

Cause:	A CAN communications error has occurred. Fault value (r0949, interpret decimal): 1: The error counter for the send telegrams has exceeded the BUS OFF value 255. The bus disables the CAN controller. - bus cable short circuit. - incorrect baud rate. - incorrect bit timing. 2: The master no longer interrogated the CAN node status longer than for its "life time". The "life time" is obtained from the "guard time" (p8604[0]) multiplied by the "life time factor" (p8604[1]). - bus cable interrupted. - bus cable not connected. - incorrect baud rate. - incorrect bit timing. - master fault. See also r8843.2 IF2 PZD status - fieldbus running. Note: The fault response can be set as required using p8641.
Remedy:	- check the bus cable - check the baud rate (p8622). - check the bit timing (p8623). - check the master. The CAN controller must be manually restarted with p8608 = 1 after the cause of the fault has been resolved!

208701 <location>CAN: NMT state change

Drive object:	A_INF_828, B_INF_828, CU_LINK, HUB, S_INF_828, S_INF_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	Infeed: OFF2 Servo: OFF3 Hla: OFF3
Acknowledge:	IMMEDIATELY
Cause:	A CANopen NMT state transition from "operational" to "pre-operational" or after "stopped". Fault value (r0949, interpret decimal): 1: CANopen NMT state transition from "operational" to "pre-operational". 2: CANopen NMT state transition from "operational" to "stopped". Note: In the NMT state "pre-operational", process data cannot be transferred and in the NMT state "stopped", no process data and no service data can be transferred.
Remedy:	Not necessary. Acknowledge the fault and continue operation.

208702 <location>CAN: RPDO Timeout

Drive object:	A_INF_828, B_INF_828, CU_LINK, HUB, S_INF_828, S_INF_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	-
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: OFF3 (NONE, OFF1, OFF2) Hla: OFF3 (NONE, OFF1, OFF2)
Acknowledge:	IMMEDIATELY
Cause:	The monitoring time of the CANopen RPDO telegram has expired because the bus connection was either interrupted or the CANopen Master was switched-off. See also r8843.0 IF2 PZD status - setpoint failure or r8843.2 IF2 PZD status - fieldbus running.

Remedy:

- check the bus cable
- check the master.
- If required, increase the monitoring time (p8699).

208703 <location>CAN: Maximum number of drive objects exceeded

Drive object: A_INF_828, B_INF_828, CU_LINK, HUB, S_INF_828, S_INF_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction:

Infeed: OFF2 (NONE, OFF1)

Servo: OFF3 (NONE, OFF1, OFF2)

Hla: OFF3 (NONE, OFF1, OFF2)

Acknowledge: IMMEDIATELY

Cause: The maximum number of 8 drive objects with the "CAN" function module was exceeded.

Note:

In the CANopen standard, a maximum of 8 CANopen device modules (drive objects with function module "CAN") are defined for each CANopen slave.

Remedy:

- New commissioning of maximum 8 drive objects with the "CAN" function module in the topology.
- For the drive objects, if required, deselect the "CAN" function module (r0108.29).

208751 <location>CAN: Telegram loss

Drive object: A_INF_828, B_INF_828, CU_LINK, HUB, S_INF_828, S_INF_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The CAN controller has lost a receive message.

Alarm value (r2124, interpret decimal):

Hardware channel in the CAN controller.

0: Firmware version < 5.2 (no reference to the original hardware channel).

1: NMT command message

2: SYNC message

3: NMT error control message

7 ... 31: RPDO message

32: SDO message

Remedy:

- increase the cycle times of the received messages.
- CANopen reduce sampling time (p8848).

See also: p8848 (IF2 PZD sampling time)

208752 <location>CAN: Error counter for error passive exceeded

Drive object: A_INF_828, B_INF_828, CU_LINK, HUB, S_INF_828, S_INF_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The error counter for the send or receive telegrams has exceeded the value 127.

Remedy:

- check the bus cable
- set a higher baud rate (p8622).
- check the bit timing and if required optimize (p8623).

208753 <location>CAN: Message buffer overflow

Drive object: A_INF_828, B_INF_828, CU_LINK, HUB, S_INF_828, S_INF_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: A message buffer overflow.
Alarm value (r2124, interpret decimal):
1: Non-cyclic send buffer (SDO response buffer) overflow.
2: Non-cyclic receive buffer (SDO receive buffer) overflow.
3: Cyclic send buffer (PDO send buffer) overflow.

Remedy: - check the bus cable.
- set a higher baud rate (p8622).
- check the bit timing and if required optimize (p8623).
For alarm value = 2:
- reduce the cycle times of the SDO receive messages.
- SDO request from master only after SDO feedback for previous SDO request.

208754 <location>CAN: Incorrect communications mode

Drive object: A_INF_828, B_INF_828, CU_LINK, HUB, S_INF_828, S_INF_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: In the "operational" mode, an attempt was made to change parameters p8700 ... p8737.

Remedy: Change to the "pre-operational" or "stopped" mode.

208755 <location>CAN: Object cannot be mapped

Drive object: A_INF_828, B_INF_828, CU_LINK, HUB, S_INF_828, S_INF_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The CANopen object is not provided for the Process Data Object (PDO) Mapping.

Remedy: Use a CANopen object intended for the PDO mapping or enter 0.

The following objects can be mapped in the Receive Process Data Object (RPDO) or Transmit Process Data Object (TPDO):

- RPDO: 6040 hex, 6060 hex, 60FF hex, 6071 hex; 5800 hex - 580F hex; 5820 hex - 5827 hex

- TPDO: 6041 hex, 6061 hex, 6063 hex, 6069 hex, 606B hex, 606C hex, 6074 hex; 5810 hex - 581F hex; 5830 hex - 5837 hex

Only sub-index 0 of the specified objects can be mapped.

Note:

As long as A08755 is present, the COB-ID cannot be set to valid.

208756 <location>CAN: Number of mapped bytes exceeded

Drive object: A_INF_828, B_INF_828, CU_LINK, HUB, S_INF_828, S_INF_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The number of bytes of the mapped objects exceeds the telegram size for net data. A max. of 8 bytes is permissible.

Remedy: Map fewer objects or objects with a smaller data type.

208757 <location>CAN: Set COB-ID invalid

Drive object: A_INF_828, B_INF_828, CU_LINK, HUB, S_INF_828, S_INF_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: For online operation, the appropriate COB-ID must be set invalid before mapping.

Example:

Mapping for RPDO 1 should be changed (p8710[0]).

--> set p8700[0] = C00006E0 hex (invalid COB-ID)

--> set p8710[0] as required.

--> p8700[0] enter a valid COB-ID

Remedy: Set the COB-ID to invalid.

208758 <location>CAN: Maximum number of valid PDO exceeded

Drive object: A_INF_828, B_INF_828, CU_LINK, HUB, S_INF_828, S_INF_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: An attempt was made to exceed the maximum number of valid PDO.

Alarm value (r2124, interpret decimal):

1:

An attempt was made to exceed the total number of valid RPDO of all CANopen supported drive objects.

As a result of the hardware, the limit is 25 valid RPDO.

2:

An attempt was made to exceed the total number of valid TPDO of all CANopen supported drive objects.

The limit is defined by the following ratio:

CAN sampling time (p8848) / CAN minimum processing time (r8739)

Note:

RPDO: Receive Process Data Object

TPDO: Transmit Process Data Object

Remedy: Comply with the limit for the maximum number of valid RPDO or TPDO.

Apply one of the following options to delete the alarm:

- successfully write to the COB ID index of a PDO communication parameter (p870x[0], p872x[0]).

- change CANopen NMT state.

- execute CANopen NMT command reset node.

- execute CANopen NMT command reset communication.

- carry out a warm restart (p0009 = 30, p0976 = 2).

- carry out a POWER ON (switch-off/switch-on).

Note:

The remaining available RPDO or TPDO are indicated in r8742.

208759 <location>CAN: PDO COB-ID already available

Drive object: A_INF_828, B_INF_828, CU_LINK, HUB, S_INF_828, S_INF_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: Parameter: %1

Reaction: NONE

Acknowledge: NONE

Cause: An existing PDO COB-ID was allocated.

Alarm value (r2124, interpret decimal):

Parameter number.

Note:

The COB-ID is included in index zero (p870x[0], p872x[0]).

Remedy: Select another PDO COB-ID.

208760 <location>CAN: maximum size of the IF PZD exceeded

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: The maximum size of the IF PZD was exceeded.
Alarm value (r2124, interpret decimal):
1: error for IF PZD receive.
2: error for IF PZD send.
Note:
IF: interface
Remedy: Map fewer process data in PDO.
Apply one of the following options to delete the alarm:
- POWER ON (switch-off/switch-on).
- carry out a warm restart (p0009 = 30, p0976 = 2).
- execute CANopen NMT command reset node.
- change CANopen NMT state.
- delete alarm buffer [0...7] (p2111 = 0).

208800 <location>PROFenergy energy-saving mode active

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: The PROFenergy energy-saving mode is active
Alarm value (r2124, interpret decimal):
Mode ID of the active PROFenergy energy-saving mode.
Remedy: The alarm is automatically withdrawn when the energy-saving mode is exited.
Note:
The energy-saving mode is exited after the following events:
- the PROFenergy command end_pause is received from the higher-level control.
- the higher-level control has changed into the STOP operating state.
- the PROFINET connection to the higher-level control has been disconnected.

209000 <location>Web server user incorrectly configured

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: An error occurred when configuring the web server user.
Fault value (r0949, interpret decimal):
0: No admin password
1: Invalid admin password
2: Invalid SINAMICS password
Remedy: Correct the user configuration, enter a correct password.

213000 <location>License not adequate

Drive object: All objects
Message value: %1
Reaction: OFF2

Acknowledge:	IMMEDIATELY
Cause:	- For the converter, the options that require a license are being used but the licenses are not sufficient. - an error occurred when checking the existing licenses. Fault value (r0949, interpret decimal): 0: The existing license is not sufficient. 1: An adequate license was not able to be determined as the memory card with the required licensing data was withdrawn in operation. 2: An adequate license was not able to be determined as there is no licensing data available on the memory card. 3: An adequate license was not able to be determined as there is a checksum error in the license key. 4: An internal error occurred when checking the license.
Remedy:	For fault value = 0: Additional licenses are required and these must be activated (p9920, p9921). For fault value = 1: With the system powered down, re-insert the memory card that matches the system. For fault value = 2: Enter and activate the license key (p9920, p9921). For fault value = 3: Compare the license key (p9920) entered with the license key on the Certificate of License. Re-enter the license key and activate (p9920, p9921). For fault value = 4: - carry out a POWER ON. - upgrade firmware to later version. - contact Technical Support. Note: An overview of the converter functions requiring a license can be displayed using a commissioning tool in the online mode. Depending on the commissioning tool, you can obtain the necessary licenses (serial number, license Key, Trial License Mode).

213001	<location>Error in license checksum
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	When checking the checksum of the license key, an error was detected.
Remedy:	Compare the license key (p9920) entered with the license key on the Certificate of License. Re-enter the license key and activate (p9920, p9921).

213009	<location>Licensing Technology Extension not licensed
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	OFF1
Acknowledge:	IMMEDIATELY
Cause:	At least one Technology Extension that requires a license does not have a license.
	Note: Refer to r4955 and p4955 for information about the installed Technology Extensions.

Remedy:

- enter and activate the license key for Technology Extensions that require a license (p9920, p9921).
- if necessary, deactivate Technology Extensions that are not licensed (p4956).

213010 <location>Licensing function module not licensed

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1

Reaction: OFF1

Acknowledge: IMMEDIATELY

Cause: At least one function module requiring a license is not licensed.
Fault value (r0949, interpret hexadecimal):
Bit x = 1: The corresponding function module does not have a license.
Note:
Assigning bit number to function module, see p0108 or r0108.

Remedy:

- enter and activate the license key for function modules that require a license license (p9920, p9921).
- if necessary, deactivate unlicensed function modules (p0108, r0108).

213020 <location>Licensing not sufficient in the control

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: OFF1

Acknowledge: IMMEDIATELY

Cause: For the drive unit, the options that require a license are being used but the licenses are not sufficient.

Remedy:

- enter and activate the license key for options that require a license.
- if necessary, deactivate unlicensed options.

213021 <location>Licensing for output frequencies > 550 Hz missing

Drive object: All objects

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: Configuring the converter results in an output frequency greater than 550 Hz. This function requires a license. The "High Output Frequency" license is required.

Note:

- in this specific case, the output frequency is limited to 550 Hz.
- the "Trial License" function is not effective for license "High Output Frequency".

Remedy:

- enter and activate the license key for "High Output Frequency" and activate (p9920, p9921).
- if necessary operate the motor below the output frequency of 550 Hz.

213030 <location>Trial License activated

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The "Trial License" function was activated. One of the available periods is expiring.

Remedy: Not necessary.
The alarm is automatically withdrawn after the periods have expired.

213031	<location>Trial License period expired
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	One of the available periods of the "Trial License" function has expired.
Remedy:	- if required, start an additional period (p9918 = 1). - deactivate functions requiring a license. - appropriately license the drive unit. Note: A license that is not adequate will only become evident after the next time the system runs up.

213032	<location>Trial License last period activated
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The "Trial License" function was activated. The last of the available periods is expiring.
Remedy:	Not necessary. The alarm is automatically withdrawn after the last period has expired.

213033	<location>Trial License last period expired
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The last period of the "Trial License" function has expired. No additional periods available.
Remedy:	- deactivate functions requiring a license. - appropriately license the drive unit. Note: A license that is not adequate will only become evident after the next time the system runs up.

213100	<location>Know-how protection: Copy protection error
Drive object:	All objects
Message value:	%1
Reaction:	OFF1
Acknowledge:	IMMEDIATELY
Cause:	The know-how protection with copy protection for the memory card is active. An error has occurred when checking the memory card. Fault value (r0949, interpret decimal): 0: A memory card is not inserted. 2: An invalid memory card is inserted. 3: The memory card is being used in another Control Unit. 12: An invalid memory card is inserted (OEM input incorrect, p7769). 13: The memory card is being used in another Control Unit (OEM input incorrect, p7759).

Remedy: For fault value = 0:
- insert the correct memory card and carry out POWER ON.
For fault value = 2, 3, 12, 13:
- contact the responsible OEM.
- Deactivate copy protection (p7765) and acknowledge the fault (p3981).
- Deactivate know-how protection (p7766 ... p7768) and acknowledge the fault (p3981).
Note:
In general, the copy protection can only be changed when know-how protection is deactivated.
KHP: Know-How Protection
See also: p3981 (Acknowledge drive object faults)

213101 <location>Know-how protection: Copy protection cannot be activated

Drive object: All objects
Message value: %1
Reaction: NONE
Acknowledge: IMMEDIATELY
Cause: An error occurred when attempting to activate the copy protection for the memory card.
Fault value (r0949, interpret decimal):
0: A memory card is not inserted.
Note:
KHP: Know-How Protection
Remedy: - insert the memory card and carry out POWER ON.
- Try to activate copy protection again (p7765).

213102 <location>Know-how protection: Consistency error of the protected data

Drive object: All objects
Message value: %1
Reaction: OFF1
Acknowledge: IMMEDIATELY
Cause: An error was identified when checking the consistency of the protected files. As a consequence, the project on the memory card cannot be run.
Fault value (r0949, interpret hexadecimal):
yyyyxxx hex: yyyy = object number, xxx = fault cause
xxx = 1:
A file has a checksum error.
xxx = 2:
The files are not consistent with one another.
xxx = 3:
The project files, which were loaded into the file system via load (download from the memory card), are inconsistent.
Note:
KHP: Know-How Protection
Remedy: - Replace the project on the memory card or replace project files for download from the memory card.
- Restore the factory setting and download again.

230001 <location>Power unit: Overcurrent

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value: Fault cause: %1 bin
Reaction: OFF2
Acknowledge: IMMEDIATELY

Cause:	The power unit has detected an overcurrent condition. - closed-loop control is incorrectly parameterized. - motor has a short-circuit or fault to ground (frame). - U/f operation: Up ramp set too low. - U/f operation: Rated motor current is significantly greater than that of the Motor Module. - infeed: High discharge and post-charging currents for line voltage dip. - infeed: High post-charging currents for overload when motoring and DC link voltage dip. - infeed: Short-circuit currents at switch-on as there is no commutating reactor. - power cables are not correctly connected. - the power cables exceed the maximum permissible length. - power unit defective. - line phase interrupted. Additional causes for a parallel switching device (r0108.15 = 1): - a power unit has tripped (switched off) due to a ground fault. - the closed-loop circulating current control is either too slow or has been set too fast. Fault value (r0949, interpret bitwise binary): Bit 0: Phase U. Bit 1: Phase V. Bit 2: Phase W. Bit 3: Overcurrent in the DC link. Note: Fault value = 0 means that the phase with overcurrent is not recognized (e.g. for blocksize device).
Remedy:	- check the motor data - if required, carry out commissioning. - check the motor circuit configuration (star/delta). - U/f operation: Increase up ramp. - U/f operation: Check the assignment of the rated currents of the motor and Motor Module. - infeed: Check the line supply quality. - infeed: Reduce the motor load. - infeed: Check the correct connection of the line filter and the line commutating reactor. - check the power cable connections. - check the power cables for short-circuit or ground fault. - check the length of the power cables. - replace power unit. - check the line supply phases. For a parallel switching device (r0108.15 = 1) the following additionally applies: - check the ground fault monitoring thresholds (p0287). - check the setting of the closed-loop circulating current control (p7036, p7037).

230002	<location>Power unit: DC link voltage overvoltage
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	The power unit has detected overvoltage in the DC link. - motor regenerates too much energy. - device supply voltage too high. - when operating with a Voltage Sensing Module (VSM), the phase assignment L1, L2, L3 at the VSM differs from the phase assignment at the power unit. - line phase interrupted. Fault value (r0949, interpret decimal): DC link voltage at the time of trip [0.1 V].

Remedy:

- increase the ramp-down time
- activate the DC link voltage controller (p1240)
- use a brake resistor or Active Line Module
- increase the current limit of the infeed or use a larger component (for the Active Line Module)
- check the device supply voltage
- check and correct the phase assignment at the VSM and at the power unit
- check the line supply phases.

See also: p0210 (Drive unit line supply voltage), p1240 (Vdc controller or Vdc monitoring configuration)

230003 <location>Power unit: DC link voltage undervoltage

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The power unit has detected an undervoltage condition in the DC link.

- line supply failure
- line supply voltage below the permissible value.
- line supply infeed failed or interrupted.
- line phase interrupted.

Note:

The monitoring threshold for undervoltage in the DC link is indicated in r0296.

Remedy:

- check the line supply voltage
- check the line supply infeed and observe the fault messages relating to it (if there are any)
- check the line supply phases.
- check the line supply voltage setting (p0210).
- booksized units: check the setting of p0278.

Note:

The ready signal for the infeed (r0863) must be interconnected to the associated drive inputs (p0864).

See also: p0210 (Drive unit line supply voltage)

230004 <location>Power unit: Overtemperature heat sink AC inverter

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The temperature of the power unit heat sink has exceeded the permissible limit value.

- insufficient cooling, fan failure.
- overload.
- ambient temperature too high.
- pulse frequency too high.

Fault value (r0949, interpret decimal):

Temperature [0.01 °C].

Remedy:

- check whether the fan is running.
- check the fan elements.
- check whether the ambient temperature is in the permissible range.
- check the motor load.
- reduce the pulse frequency if this is higher than the rated pulse frequency.

Notice:

This fault can only be acknowledged after the alarm threshold for alarm A05000 has been undershot.

See also: p1800

230005	<location>Power unit: Overload I2t
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	The power unit was overloaded (r0036 = 100 %). - the permissible rated power unit current was exceeded for an inadmissibly long time. - the permissible load duty cycle was not maintained. Fault value (r0949, interpret decimal): I2t [100 % = 16384].
Remedy:	- reduce the continuous load. - adapt the load duty cycle. - check the motor and power unit rated currents. See also: r0036, r0206, p0307
230006	<location>Power unit: Thyristor Control Board
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	The Thyristor Control Board (TCB) of the Basic Line Module signals a fault. - there is no line supply voltage. - the line contactor is not closed. - the line supply voltage is too low. - line supply frequency outside the permissible range (45 ... 66 Hz). - there is a DC link short-circuit. - there is a DC link short-circuit (during the precharging phase). - the motor either has a short-circuit or insulation fault (from an inverter connected to the DC link). - voltage supply for the Thyristor Control Board outside the nominal range (5 ... 18 V) and line voltage >30 V. - there is an internal fault in the Thyristor Control Board.
Remedy:	The faults must be saved in the Thyristor Control Board and must be acknowledged. To do this, the supply voltage of the Thyristor Control Board must be switched out for at least 10 s! - check the line supply voltage - check or energize the line contactor. - check the monitoring time and, if required, increase (p0857). - if required, observe additional power unit messages/signals. - check the DC link regarding short-circuit or ground fault. - check the motor regarding short-circuit or ground fault. - evaluate diagnostic LEDs for the Thyristor Control Board.
230008	<location>Power unit: Sign-of-life error cyclic data
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	Infeed: NONE (OFF1, OFF2) Servo: NONE (OFF1, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	The Control Unit has not punctually updated the cyclic setpoint telegram to the power unit. The number of consecutive tolerated sign of life errors has exceeded the fault threshold (p7789) set in the power unit.

Remedy:

- for projects with the VECTOR drive object, check whether p0117 = 6 has been set on the Control Unit.
- increase the fault threshold (p7789).
- check the Motor Module, and if required replace.

See also: p0117 (Current controller computing dead time mode)

230010 <location>Power unit: Sign-of-life error cyclic data

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: A DRIVE-CLiQ communication error has occurred between the Control Unit and the power unit involved.
The cyclic setpoint telegrams of the Control Unit were not received on time by the power unit for at least one clock cycle.

Remedy: Check the Motor Module and if required, replace.

230011 <location>Power unit: Line phase failure in main circuit

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2 (OFF1)

Acknowledge: IMMEDIATELY

Cause: At the power unit, the DC link voltage ripple has exceeded the permissible limit value.
Possible causes:

- a line phase has failed.
- the 3 line phases are inadmissibly asymmetrical.
- the capacitance of the DC link capacitor forms a resonance frequency with the line inductance and the reactor integrated in the power unit.
- the fuse of a phase of a main circuit has ruptured.
- a motor phase has failed.
- for power units operated on a single phase, the permissible active power was exceeded.

Fault value (r0949, interpret decimal):
Only for internal Siemens troubleshooting.

Remedy:

- check the main circuit fuses.
- check whether a single-phase load is distorting the line voltages.
- Detune the resonant frequency with the line inductance by using an upstream line reactor.
- Dampen the resonant frequency with the line inductance by switching over the DC link voltage compensation in the software (see p1810) – or increase the smoothing (see p1806). However, this can have a negative impact on the torque ripple at the motor output.
- check the motor feeder cables.

230012 <location>Power unit: Temperature sensor wire breakage

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF1 (OFF2)

Acknowledge: IMMEDIATELY

Cause:	The connection to a temperature sensor in the power unit is interrupted. Fault value (r0949, interpret binary): Bit 0: Module slot (electronics slot) Bit 1: Air intake Bit 2: Inverter 1 Bit 3: Inverter 2 Bit 4: Inverter 3 Bit 5: Inverter 4 Bit 6: Inverter 5 Bit 7: Inverter 6 Bit 8: Rectifier 1 Bit 9: Rectifier 2 Bit 14: Capacitor air discharge Bit 15: Liquid intake
Remedy:	Contact Technical Support.

230013	<location>Power unit: Temperature sensor short circuit
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF1 (OFF2)
Acknowledge:	IMMEDIATELY
Cause:	A temperature sensor in the power unit is short-circuited. Fault value (r0949, interpret binary): Bit 0: Module slot (electronics slot) Bit 1: Air intake Bit 2: Inverter 1 Bit 3: Inverter 2 Bit 4: Inverter 3 Bit 5: Inverter 4 Bit 6: Inverter 5 Bit 7: Inverter 6 Bit 8: Rectifier 1 Bit 9: Rectifier 2 Bit 14: Capacitor air discharge Bit 15: Liquid intake
Remedy:	Contact Technical Support.

230015	<location>Power unit: Phase failure motor cable
Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2 (NONE, OFF1, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	A phase failure in the motor feeder cable was detected. The signal can also be output in the following case: - the motor is correctly connected, however the closed-speed control is instable and therefore an oscillating torque is generated. Note: Chassis power units do not feature phase failure monitoring.
Remedy:	- check the motor feeder cables. - check the speed controller settings.

230016 <location>Power unit: Load supply switched off**Drive object:** SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE**Cause:** The DC link voltage is too low.
Alarm value (r2124, interpret decimal):
DC link voltage at the time of the trip [V].**Remedy:** - switch on load supply.
- check the line supply if necessary.

230017 <location>Power unit: 26.5 V supply voltage fault**Drive object:** HLA_828**Message value:** %1**Reaction:** OFF2**Acknowledge:** IMMEDIATELY**Cause:** For a drive that has been enabled, it has been identified that the 26.5 V supply voltage for the Hydraulic Module has a fault (X271).
Permissible range: 26.0 ... 27.0 V
Fault value (r0949, interpret decimal):
Voltage value [0.1 V].**Remedy:** - check the 26.5 V supply voltage (X271).

230017 <location>Power unit: Hardware current limit has responded too often**Drive object:** A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** Fault cause: %1 bin**Reaction:** OFF2**Acknowledge:** IMMEDIATELY**Cause:** The hardware current limitation in the relevant phase (see A30031, A30032, A30033) has responded too often. The number of times the limit has been exceeded depends on the design and type of power unit.

For infeed units, the following applies:

- closed-loop control is incorrectly parameterized.
- load on the infeed is too high.
- Voltage Sensing Module incorrectly connected.
- line reactor missing or the incorrect type.
- power unit defective.

The following applies to Motor Modules:

- closed-loop control is incorrectly parameterized.
- fault in the motor or in the power cables.
- the power cables exceed the maximum permissible length.
- motor load too high
- power unit defective.

Fault value (r0949, interpret binary):

Bit 3: phase U

Bit 4: phase V

Bit 5: phase W

Additional bits:

Only for internal Siemens troubleshooting.

Note:

Fault value = 0 means that the phase with current limiting is not recognized (e.g. for blocksize device).

- Remedy:** For infeed units, the following applies:
- check the controller settings and reset and identify the controller if necessary (p0340 = 2, p3410 = 5)
 - reduce the load and increase the DC link capacitance or use a higher-rating infeed if necessary
 - check the connection of the optional Voltage Sensing Module
 - check the connection and technical data of the commutating reactor.
 - check the power cables for short-circuit or ground fault.
 - replace power unit.
- The following applies to Motor Modules:
- check the motor data and if required, recalculate the controller parameters (p0340 = 3). As an alternative, run a motor data identification (p1910 = 1, p1960 = 1).
 - check the motor circuit configuration (star-delta).
 - check the motor load.
 - check the power cable connections.
 - check the power cables for short-circuit or ground fault.
 - check the length of the power cables.
 - replace power unit.

230020 <location>Power unit: Configuration not supported

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: fault cause: %1, additional information: %2

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: A configuration is requested that is not supported by the power unit.

Fault value (r0949, interpret hexadecimal):

yyyyxxxx hex: xxxx = fault cause, yyyy = additional information (internal Siemens)

xxxx = 0: Autonomous operation is requested but is not supported.

xxxx = 1: The requested DRIVE-CLiQ timing is not permissible.

xxxx = 2: A PM260 has been detected with PS-ASIC version 2. This combination is not supported.

xxxx = 3: Initialization was not able to be successfully completed. It is possible that the Control Unit was withdrawn from the Power Module before or during power up.

xxxx = 4: The combination of power unit and Control Unit or Control Unit Adapter is not supported.

xxxx = 5: The higher current controller dynamic performance is not supported.

xxxx = 6: it is not permitted to operate the Motor Module with this Control Unit and firmware version.

Remedy:

For fault cause = 0:

If required, deactivate an active internal voltage protection (p1231).

For fault cause = 1:

Update the Control Unit firmware or change the DRIVE-CLiQ topology.

For fault cause = 2:

Replace the power unit with a PM260 with PS-ASIC version 3 (or higher).

For fault cause = 3, 4:

Insert a Control Unit or Control Unit Adapter (CUAxx) on an appropriate Power Module and perform a POWER ON for the Control Unit or the Control Unit Adapter.

For fault cause = 5:

- use a booksize format power unit.

- for a Double Motor Module operate the two drive controls with the same current controller sampling time (p0115[0]). Otherwise, the higher current controller dynamics can only be activated on the drive with the longer sampling time.

- if required, deselect the higher current controller dynamic performance (p1810.11 = 0). After deselecting the computing dead time, recalculate the controller gains (p0340 = 4). If required, optimize the speed controller.

For fault cause = 6:

- use a suitable Motor Module.

- use a Control Unit with approved firmware version.

See also: p0115, p1231, p1810

230021 <location>Power unit: Ground fault**Drive object:** A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:** OFF2**Acknowledge:** IMMEDIATELY**Cause:** The power has detected a ground fault.

Possible causes:

- ground fault in the power cables.
- ground fault at the motor.
- CT defective.
- when the brake closes, this causes the hardware DC current monitoring to respond.
- short-circuit at the braking resistor.
- the closed-loop circulating current control for devices connected in parallel ($r0108.15 = 1$) is either too slow or has been set too fast.

Note:

For power units, a ground fault is also emulated in $r3113.5$.Fault value ($r0949$, interpret decimal):

0:

- the hardware DC current monitoring has responded.
- short-circuit at the braking resistor.

> 0:

Absolute value, total current amplitude [$20479 = r0209 * 1.4142$].**Remedy:**

- check the power cable connections.
- check the motor.
- check the CT.
- check the cables and contacts of the brake connection (a wire is possibly broken).
- check the braking resistor.

For parallel switching devices ($r0108.15 = 1$) the following additionally applies:

- check the ground fault monitoring thresholds ($p0287$).
- check the setting of the closed-loop circulating current control ($p7036$, $p7037$).

See also: $p0287$ (Ground fault monitoring shutdown threshold)

230022 <location>Power unit: Monitoring U_{ce}**Drive object:** A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** Fault cause: %1 bin**Reaction:** OFF2**Acknowledge:** POWER ON**Cause:** In the power unit, the monitoring of the collector-emitter voltage (U_{ce}) of the semiconductor has responded.

Possible causes:

- fiber-optic cable interrupted.
- power supply of the IGBT gating module missing.
- short-circuit at the power unit output.
- defective semiconductor in the power unit.

Fault value ($r0949$, interpret binary):

Bit 0: Short-circuit in phase U

Bit 1: Short circuit in phase V

Bit 2: Short-circuit in phase W

Bit 3: Light transmitter enable defective

Bit 4: U_{ce} group fault signal interruptedSee also: $r0949$ (Fault value)

- Remedy:**
- check the fiber-optic cable and if required, replace.
 - check the power supply of the IGBT gating module (24 V).
 - check the power cable connections.
 - select the defective semiconductor and replace.

230024 <location>Power unit: Overtemperature thermal model

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The temperature difference between the heat sink and chip has exceeded the permissible limit value.

- the permissible load duty cycle was not maintained.
- insufficient cooling, fan failure.
- overload.
- ambient temperature too high.
- pulse frequency too high.

See also: r0037

- Remedy:**
- adapt the load duty cycle.
 - check whether the fan is running.
 - check the fan elements.
 - check whether the ambient temperature is in the permissible range.
 - check the motor load.
 - reduce the pulse frequency if this is higher than the rated pulse frequency.

230025 <location>Power unit: Chip overtemperature

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The chip temperature of the semiconductor has exceeded the permissible limit value.

- the permissible load duty cycle was not maintained.
- insufficient cooling, fan failure.
- overload.
- ambient temperature too high.
- pulse frequency too high.

Fault value (r0949, interpret decimal):

Temperature difference between the heat sink and chip [0.01 °C].

- Remedy:**
- adapt the load duty cycle.
 - check whether the fan is running.
 - check the fan elements.
 - check whether the ambient temperature is in the permissible range.
 - check the motor load.
 - reduce the pulse frequency if this is higher than the rated pulse frequency.

Notice:

This fault can only be acknowledged after the alarm threshold for alarm A05001 has been undershot.

See also: r0037

230027 <location>Power unit: Precharging DC link time monitoring

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: Enable signals: %1, Status: %2

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The power unit DC link was not able to be precharged within the expected time.

- 1) There is no line supply voltage connected.
- 2) The line contactor/line side switch has not been closed.
- 3) The line supply voltage is too low.
- 4) Line supply voltage incorrectly set (p0210).
- 5) The precharging resistors are overheated as there were too many precharging operations per time unit.
- 6) The precharging resistors are overheated as the DC link capacitance is too high.
- 7) The precharging resistors are overheated because when there is no "ready for operation" (r0863.0) of the infeed unit, power is taken from the DC link.
- 8) The precharging resistors are overheated as the line contactor was closed during the DC link fast discharge through the Braking Module.
- 9) The DC link has either a ground fault or a short-circuit.
- 10) The precharging circuit is possibly defective (only for chassis units).
- 11) Infeed is defective and/or fuse has ruptured in the Motor Module (only Booksize units).

Fault value (r0949, interpret binary):

yyyyxxxx hex:

yyyy = power unit state

0: Fault status (wait for OFF and fault acknowledgment).

1: Restart inhibit (wait for OFF).

2: Overvoltage condition detected -> change into the fault state.

3: Undervoltage condition detected -> change into the fault state.

4: Wait for bridging contactor to open -> change into the fault state.

5: Wait for bridging contactor to open -> change into restart inhibit.

6: Wait for bypass contactor to open

7: Commissioning.

8: Ready for precharging.

9: Precharging started, DC link voltage lower than the minimum switch-on voltage

10: Precharging, DC link voltage end of precharging still not detected

11: Wait for the end of the de-bounce time of the main contactor after precharging has been completed.

12: Precharging completed, ready for pulse enable.

13: It was detected that the STO terminal was energized at the power unit

xxxx = Missing internal enable signals, power unit (inverted bit-coded, FFFF hex -> all internal enable signals available)

Bit 0: Power supply of the IGBT gating shut down.

Bit 1: Ground fault detected.

Bit 2: Peak current intervention.

Bit 3: I2t exceeded.

Bit 4: Thermal model overtemperature calculated.

Bit 5: (heat sink, gating module, power unit) overtemperature measured.

Bit 6: Reserved.

Bit 7: Overvoltage detected.

Bit 8: Power unit has completed precharging, ready for pulse enable.

Bit 9: STO terminal missing.

Bit 10: Overcurrent detected.

Bit 11: Armature short-circuit active.

Bit 12: DRIVE-CLiQ fault active.

Bit 13: Vce fault detected, transistor de-saturated due to overcurrent/short-circuit.

Bit 14: Undervoltage detected.

See also: p0210 (Drive unit line supply voltage)

Remedy:	In general: - check the line supply voltage at the input terminals. - check the line supply voltage setting (p0210). For booksize drive units, the following applies: - wait (approx. 8 minutes) until the precharging resistors have cooled down. For this purpose, preferably disconnect the infeed unit from the line supply. For 5): - carefully observe the permissible precharging frequency (refer to the appropriate Manual). For 6): - check the total capacitance of the DC link and reduce in accordance with the maximum permissible DC link capacitance if necessary (refer to the appropriate Manual). For 7): - interconnect the ready-for-operation signal from the infeed unit (r0863.0) in the enable logic of the drives connected to this DC link For 8): - check the connections of the external line contactor. The line contactor must be open during DC link fast discharge. For 9): - check the DC link for ground faults or short circuits. For 11): - check the DC link voltage of the infeed (r0070) and Motor Modules (r0070). If the DC link voltage generated by the infeed (or external) is not displayed for the Motor Modules (r0070), then a fuse has ruptured in the Motor Module. See also: p0210 (Drive unit line supply voltage)
----------------	--

230030	<location>Power unit: Internal overtemperature alarm
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The temperature inside the drive converter has exceeded the permissible temperature limit. - insufficient cooling, fan failure. - overload. - ambient temperature too high. Alarm value (r2124, interpret decimal): Only for internal Siemens troubleshooting.
Remedy:	- possibly use an additional fan. - check whether the ambient temperature is in the permissible range. Notice: This alarm is automatically withdrawn once the permissible temperature limit value has been fallen below minus 5 K.

230031	<location>Power unit: Hardware current limiting in phase U
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE

Cause:	Hardware current limit for phase U responded. The pulsing in this phase is inhibited for one pulse period. - closed-loop control is incorrectly parameterized. - fault in the motor or in the power cables. - the power cables exceed the maximum permissible length. - motor load too high - power unit defective. Note: Alarm A30031 is always output if, for a Power Module, the hardware current limiting of phase U, V or W responds.
Remedy:	- check the motor data and if required, recalculate the control parameters (p0340 = 3). As an alternative, run a motor data identification (p1910 = 1, p1960 = 1). - check the motor circuit configuration (star/delta). - check the motor load. - check the power cable connections. - check the power cables for short-circuit or ground fault. - check the length of the power cables.

230032 <location>Power unit: Hardware current limiting in phase V

Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	Hardware current limit for phase V responded. The pulsing in this phase is inhibited for one pulse period. - closed-loop control is incorrectly parameterized. - fault in the motor or in the power cables. - the power cables exceed the maximum permissible length. - motor load too high - power unit defective. Note: Alarm A30031 is always output if, for a Power Module, the hardware current limiting of phase U, V or W responds.
Remedy:	Check the motor data and if required, recalculate the control parameters (p0340 = 3). As an alternative, run a motor data identification (p1910 = 1, p1960 = 1). - check the motor circuit configuration (star/delta). - check the motor load. - check the power cable connections. - check the power cables for short-circuit or ground fault. - check the length of the power cables.

230033 <location>Power unit: Hardware current limiting in phase W

Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	Hardware current limit for phase W responded. The pulsing in this phase is inhibited for one pulse period. - closed-loop control is incorrectly parameterized. - fault in the motor or in the power cables. - the power cables exceed the maximum permissible length. - motor load too high - power unit defective. Note: Alarm A30031 is always output if, for a Power Module, the hardware current limiting of phase U, V or W responds.

- Remedy:**
- check the motor data and if required, recalculate the control parameters (p0340 = 3). As an alternative, run a motor data identification (p1910 = 1, p1960 = 1).
 - check the motor circuit configuration (star/delta).
 - check the motor load.
 - check the power cable connections.
 - check the power cables for short-circuit or ground fault.
 - check the length of the power cables.

230034 <location>Power unit: Internal overtemperature

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The alarm threshold for internal overtemperature has been reached.
 If the temperature inside the power unit increases up to the fault threshold, then fault F30036 is triggered.

- ambient temperature might be too high.
- insufficient cooling, fan failure.

Alarm value (r2124, interpret binary):

- Bit 0 = 1: Overtemperature in the control electronics area.
- Bit 1 = 1: Overtemperature in the power electronics area.
- Bit 2 = 1: Overtemperature in the processor area.
- Bit 3 = 1: Overtemperature in the processor area.
- Bit 4 = 1: Overtemperature when the internal fan is defective.
- Bit 5 = 1: Intake air overtemperature.

- Remedy:**
- check the ambient temperature.
 - check the fan for the inside of the unit.

230035 <location>Power unit: Air intake overtemperature

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF1 (OFF2)

Acknowledge: IMMEDIATELY

Cause: The air intake in the power unit has exceeded the permissible temperature limit.
 For air-cooled power units, the temperature limit is at 55 °C.

- ambient temperature too high.
- insufficient cooling, fan failure.

Fault value (r0949, interpret decimal):
 Temperature [0.01 °C].

- Remedy:**
- check whether the fan is running.
 - check the fan elements.
 - check whether the ambient temperature is in the permissible range.
- Notice:**
 This fault can only be acknowledged after the alarm threshold for alarm A05002 has been undershot.

230036 <location>Power unit: Internal overtemperature

Drive object: All objects

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause:	The temperature inside the converter has exceeded the permissible limit value. - insufficient cooling, fan failure. - overload. - ambient temperature too high. Fault value (r0949, interpret binary): - Bit 0 = 1: Overtemperature in the control electronics area. - Bit 1 = 1: Overtemperature in the power electronics area. - Bit 2 = 1: Overtemperature in the processor area. - Bit 3 = 1: Overtemperature in the processor area. - Bit 4 = 1: Overtemperature when the internal fan is defective. - Bit 5 = 1: Intake air overtemperature.
Remedy:	- check the internal fan. - check the fan elements. - check whether the ambient temperature is in the permissible range. Notice: This fault can only be acknowledged once the permissible temperature limit minus 5 K has been fallen below.

230037	<location>Power unit: Rectifier overtemperature
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	The temperature in the rectifier of the power unit has exceeded the permissible temperature limit. - insufficient cooling, fan failure. - overload. - ambient temperature too high. - line supply phase failure. Fault value (r0949, interpret decimal): Temperature [0.01 °C].
Remedy:	- check whether the fan is running. - check the fan elements. - check whether the ambient temperature is in the permissible range. - check the motor load. - check the line supply phases. Notice: This fault can only be acknowledged after the alarm threshold for alarm A05004 has been undershot.

230038	<location>Power unit: Capacitor fan monitoring
Drive object:	B_INF_828
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The capacitor fan signals a fault.
Remedy:	Replace the capacitor fan in the power unit.

230039	<location>Power unit: Failure capacitor fan
Drive object:	B_INF_828
Message value:	%1
Reaction:	OFF1
Acknowledge:	IMMEDIATELY

Cause: The capacitor fan has failed.
Remedy: Replace the capacitor fan in the power unit.

230040 <location>Power unit: Undervolt 24 V

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value: %1
Reaction: OFF2
Acknowledge: IMMEDIATELY (POWER ON)
Cause: The undervoltage threshold of the 24 V power supply for the power unit was fallen below for longer than 3 ms.
Note:
 - for booksize power units, the undervoltage threshold is 15 V.
 - for all other power units, the undervoltage threshold depends on the power unit, and is not displayed.
Fault value (r0949, interpret decimal):
 24 V voltage [0.1 V].
Remedy:
 - check the power supply of the power unit.
 - carry out a POWER ON (switch-off/switch-on) for the component.

230040 <location>Power unit: Undervolt 24/48 V

Drive object: SERVO_828, SERVO_COMBI
Message value: Channel: %1, voltage: %2 [0.1 V]
Reaction: OFF2
Acknowledge: IMMEDIATELY (POWER ON)
Cause: The undervoltage threshold of the 24 V power supply for the power unit was fallen below for longer than 3 ms.
Note:
 - for booksize power units, the undervoltage threshold is 15 V.
 - for CU310-2, CUA31 and CUA32 the undervoltage threshold is 16 V.
 - for all other power units (e.g. S120M), the undervoltage threshold depends on the power unit, and is not displayed.
Fault value (r0949, interpret hexadecimal):
 yyxxxx hex: yy = channel, xxxx = voltage [0.1 V]
 yy = 0: 24 V power supply
 yy = 1: 48 V power supply
Remedy:
 - check the power supply of the power unit.
 - carry out a POWER ON (switch-off/switch-on) for the component.

230041 <location>Power unit: Undervoltage 24 V alarm

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: For the power unit power supply, the lower threshold has been violated.
Alarm value (r2124, interpret hexadecimal):
 Only for internal Siemens troubleshooting.
Remedy:
 - check the power supply of the power unit.
 - carry out a POWER ON (switch-off/switch-on) for the component.

230041 <location>Power unit: Undervolt 24/48 V alarm

Drive object: SERVO_828, SERVO_COMBI
Message value: Channel: %1, voltage: %2 [0.1 V]
Reaction: NONE

Acknowledge: NONE

Cause: For the power unit power supply, the lower threshold has been violated.
Alarm value (r2124, interpret hexadecimal):
yyxxxx hex: yy = channel, xxxx = voltage [0.1 V]
yy = 0: 24 V power supply
yy = 1: 48 V power supply

Remedy: - check the power supply of the power unit.
- carry out a POWER ON (switch-off/switch-on) for the component.

230042 <location>Power unit: Fan has reached the maximum operating hours

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The maximum operating time of at least one fan will soon be reached, or has already been exceeded.
Alarm value (r2124, interpret binary):
Bit 0 = 1:
The operating hours counter of the heat sink fan will reach the maximum operating time in 500 hours. After 500 hours has elapsed, bit 0 is cleared and bit 2 is set in the alarm value.
Bit 1 = 1:
The wear counter of the heat sink fan has reached 99 %. The remaining service life is 1%. After this 1% has elapsed, bit 1 is cleared and bit 2 is set in the alarm value.
Bit 2 = 1:
The operating hours counter of the heat sink fan has exceeded the maximum operating time - and/or the wear counter has exceeded 100%.
Bit 8 = 1:
The operating hours counter of the fan inside the device will reach the maximum operating time in 500 hours. After 500 hours has elapsed, bit 8 is cleared and bit 10 is set in the alarm value.
Bit 10 = 1:
The operating hours counter of the fan inside the device has exceeded the maximum operating time.

Remedy: For the fan involved, carry out the following:
- replace the fan.
- reset the operating hours counter (p0251, p0254).
See also: p0251 (Power unit heat sink fan operating hours counter), p0252 (Power unit heat sink fan operating time maximum), p0254 (Operating hours counter power unit fan inside the converter), r0277 (Power unit heat sink fan wear counter)

230043 <location>Power unit: Overvolt 24 V

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: POWER ON

Cause: For the power unit power supply, the upper threshold has been violated.
Fault value (r0949, interpret decimal):
24 V voltage [0.1 V].

Remedy: Check the power supply of the power unit.

230043 <location>Power unit: Overvolt 24/48 V

Drive object: SERVO_828, SERVO_COMBI

Message value: Channel: %1, voltage: %2 [0.1 V]

Reaction: OFF2

Acknowledge: POWER ON

Cause: For the power unit power supply, the upper threshold has been violated.
 Fault value (r0949, interpret hexadecimal):
 yyxxxx hex: yy = channel, xxxx = voltage [0.1 V]
 yy = 0: 24 V power supply
 yy = 1: 48 V power supply

Remedy: Check the power supply of the power unit.

230044 <location>Power unit: Overvoltage 24 V alarm

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: For the power unit power supply, the upper threshold has been violated.
 Alarm value (r2124, interpret decimal):
 Only for internal Siemens troubleshooting.

Remedy: Check the power supply of the power unit.

230044 <location>Power unit: Overvolt 24/48 V alarm

Drive object: SERVO_828, SERVO_COMBI

Message value: Channel: %1, voltage: %2 [0.1 V]

Reaction: NONE

Acknowledge: NONE

Cause: For the power unit power supply, the upper threshold has been violated.
 Alarm value (r2124, interpret hexadecimal):
 yyxxxx hex: yy = channel, xxxx = voltage [0.1 V]
 yy = 0: 24 V power supply
 yy = 1: 48 V power supply

Remedy: Check the power supply of the power unit.

230045 <location>Power unit: Supply undervoltage

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: Power supply fault in the power unit.
 - the voltage monitor signals an undervoltage fault on the module.
 The following applies for CU31x:
 - the voltage monitoring on the DAC board signals an undervoltage fault on the module.

Remedy:
 - check the power supply of the power unit.
 - carry out a POWER ON (switch-off/switch-on) for the component.
 - replace the module if necessary.

230045 <location>Power unit: Supply undervoltage

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause:	Power supply fault in the power unit. - the voltage monitor signals an undervoltage fault on the module. The following applies for CU31x: - the voltage monitoring on the DAC board signals an undervoltage fault on the module. For S120M, the following applies: - this message is displayed for undervoltage or overvoltage.
Remedy:	- check the power supply of the power unit. - carry out a POWER ON (switch-off/switch-on) for the component. - replace the module if necessary.

230046 <location>Power unit: Undervoltage alarm

Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	Before the last restart, a problem occurred at the power unit power supply. The voltage monitor in the internal FPGA of the PSA signals an undervoltage fault on the module. Alarm value (r2124, interpret decimal): Only for internal Siemens troubleshooting.
Remedy:	- check the 24 V DC voltage supply to power unit. - carry out a POWER ON (switch-off/switch-on) for the component. - replace the module if necessary.

230046 <location>Power unit: Undervoltage alarm

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	Before the last restart, a problem occurred at the power unit power supply. The voltage monitor in the internal FPGA of the PSA signals an undervoltage fault on the module. Alarm value (r2124, interpret decimal): Register value of the voltage fault register.
Remedy:	- check the 24 V DC voltage supply to power unit. - carry out a POWER ON (switch-off/switch-on) for the component. - replace the module if necessary.

230047 <location>Cooling unit: Cooling medium flow rate too low

Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	The flow rate of the cooling unit has fallen below the fault threshold.
Remedy:	- check the feedback signals and parameter assignment (p0260 ... p0267). - check the coolant feed. - check the thermal conductivity of the coolant. - check the coolant concentration.

230048 <location>Power unit: fan defective

Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin

Reaction:	NONE
Acknowledge:	NONE
Cause:	The feedback signal from a fan indicates a fault. - fan defective. - fan blocked. - feedback signal inaccurate. - fan power supply interrupted (only for r0193.13 = 1 and heat sink fan) Alarm value (r2124, interpret binary): Bit 0 = 1: heat sink fan Bit 1 = 1: fan inside the device Note: - for firmware version < 5.1 of the power unit, the alarm value is always 0. The alarm then refers to the heat sink fan. - for r0193.13 = 1, fault F30058 is output instead of this alarm for heat sink fans, if the pulses are inhibited or the fault occurs within 10 s after the fan runs up when the pulses are enabled. - for r0193.13 = 1, fault F30059 is output instead of this alarm for fans inside the unit, if the air intake temperature (r0037[3]) has exceeded a specific threshold.
Remedy:	- check the fan involved. - if required, replace the fan. - check the fan power supply and if required switch on (only for r0193.13 = 1 and heat sink fan). Note: If the alarm has been withdrawn, this does not necessarily mean that the cause of the fault has been resolved. It is also possible that the software switched off the fan, and therefore can no longer evaluate the feedback signal.

230049	<location>Power unit: Internal fan faulty
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The internal fan has failed.
Remedy:	Check the internal fan and replace if necessary.

230050	<location>Power unit: 24 V supply overvoltage
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2
Acknowledge:	POWER ON
Cause:	The voltage monitor signals an overvoltage fault on the module.
Remedy:	- check the 24 V power supply. - replace the module if necessary.

230051	<location>Power unit: Motor holding brake short circuit detected
Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	A short-circuit at the motor holding brake terminals has been detected. Fault value (r0949, interpret decimal): Only for internal Siemens troubleshooting.
Remedy:	- check the motor holding brake for a short-circuit. - check the connection and cable for the motor holding brake.

230052 <location>EEPROM data error

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value: %1
Reaction: OFF2
Acknowledge: POWER ON
Cause: EEPROM data error of the power unit module.
Fault value (r0949, interpret decimal):
0, 2, 3, 4:
The EEPROM data read in from the power unit module are incorrect.
1:
EEPROM data is not compatible to the firmware of the power unit application.
Additional values:
Only for internal Siemens troubleshooting.
Remedy: For fault value = 0, 2, 3, 4:
Replace the power unit module or update the EEPROM data.
For fault value = 1:
The following applies for CU31x and CUA31:
Update the firmware \SIEMENS\SINAMICS\CODE\SAC\cu31xi.ufw (cua31.ufw)

230053 <location>FPGA data faulty

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value: %1
Reaction: NONE
Acknowledge: POWER ON
Cause: The FPGA data of the power unit are faulty. This can be caused, for example, if a firmware update is interrupted.
Remedy: Replace the power unit or update of the FPGA data by updating the firmware.
Note:
If this fault occurs after a firmware update, then update the firmware again.

230054 <location>Power unit: Undervoltage when opening the brake

Drive object: HLA_828, SERVO_828, SERVO_COMBI
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: When the brake is being opened, it is detected that the power supply voltage is less than 21.4 V
Alarm value (r2124, interpret decimal):
Supply voltage fault [0.1 V].
Example:
Alarm value = 195 --> voltage = 19.5 V
Remedy: Check the 24 V voltage for stability and value.

230055 <location>Power unit: Braking chopper overcurrent

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value: -
Reaction: OFF2
Acknowledge: IMMEDIATELY
Cause: An overcurrent condition has occurred in the braking chopper.

Remedy:

- check whether the braking resistor has a short circuit.
- for an external braking resistor, check whether the resistor may have been dimensioned too small.

Note:

The braking chopper is only enabled again at pulse enable after the fault has been acknowledged.

230057 <location>Power unit: Line asymmetry

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause:

Frequencies have been detected on the DC link voltage that would suggest line asymmetry or failure of a line phase. It is also possible that a motor phase has failed.

Fault F30011 is output if the alarm is present and at the latest after 5 minutes.

The precise duration depends on the power unit type and the particular frequencies. For booksize and chassis power units, the duration also depends on how long the alarm has been active.

Alarm value (r2124, interpret decimal):

Only for internal Siemens troubleshooting.

Remedy:

- check the line phase connection.
- check the motor feeder cable connections.

If there is no phase failure of the line or motor, then line asymmetry is involved.

- reduce the power in order to avoid fault F30011.

230058 <location>Power unit: heat sink fan defective

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2 (NONE, OFF1)

Acknowledge: IMMEDIATELY

Cause:

The feedback signal from the heat sink fan signals a fault.

- fan defective.
- fan blocked.
- feedback signal inaccurate.
- fan power supply interrupted (only for r0193.13 = 1)

Remedy:

- check the heat sink fan and replace if necessary.
- check the fan power supply and if required switch on (only for r0193.13 = 1)
- if, for an S120 Combi, a separately driven fan with feedback signal is used, then check its wiring (X12.2 or X13.2).

Note:

- if a separately driven fan without feedback signal is used for an S120 Combi, instead of the feedback signal of the fan, a connection to ground must be established (X12.1/2 or X13.1/2).
- if the fault can be acknowledged, this does not necessarily mean that the cause of the fault has been resolved. It is also possible that the software switched off the fan, and therefore can no longer evaluate the feedback signal.

230059 <location>Power unit: Internal fan faulty

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause:

The internal power unit fan has failed and is possibly defective.

Remedy:

Check the internal fan and replace if necessary.

Note:

- If the fault can be acknowledged, this does not necessarily mean that the cause of the fault has been resolved. It is also possible that the software switched off the fan, and therefore can no longer evaluate the feedback signal.

230060 <location>Precharge contactor state monitoring**Drive object:** A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** Fault cause: %1 bin**Reaction:** OFF2 (NONE, OFF1)**Acknowledge:** IMMEDIATELY (POWER ON)**Cause:** A feedback signal for the precharging contactor (ALM, SLM, BLM diode) or the line contactor (BLM thyristor) interconnected and the monitoring activated.

After switching-in/switching-out the contactor, a correct feedback signal was not received within the monitoring time set in p0255[0, 2].

Fault value (r0949, interpret binary):

Bit 0: The time set in p0255[0, 2] was exceeded when switching-in/switching-out the contactor.

Bit 1: The precharging contactor was opened while precharging or in the infeed mode (BLM thyristor).

Bit 2: The precharging contactor was switched-in in the OFF state or during infeed operation.

Remedy: - check the monitoring time setting (p0255[0, 2]).

- check the contactor wiring and activation.

- replace the contactor.

See also: p0255 (Power unit contactor monitoring time)

230061 <location>Bridging contactor monitoring**Drive object:** A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** Fault cause: %1 bin**Reaction:** OFF2 (NONE, OFF1)**Acknowledge:** IMMEDIATELY (POWER ON)**Cause:** A feedback signal for the bypass contactor is interconnected and the monitoring activated.

After switching-in/switching-out the contactor, a correct feedback signal was not received within the monitoring time set in p0255[1, 3].

Fault value (r0949, interpret binary):

Bit 0: The time set in p0255[1, 3] was exceeded when switching-in/switching-out the contactor.

Bit 1: The bypass contactor was opened in operation.

Bit 2: The bypass contactor was switched-in in the OFF state or during precharging.

Remedy: - check the monitoring time setting (p0255[1, 3]).

- check the contactor wiring and activation.

- replace the contactor.

See also: p0255 (Power unit contactor monitoring time)

230066 <location>Power unit: overtemperature, alarm capacitor air discharge**Drive object:** A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE**Cause:** The air discharged from the DC link capacitor has exceeded the alarm threshold.

- ambient temperature too high.

- insufficient cooling, fan failure.

Alarm value (r2124, interpret decimal):

Temperature when reaching the alarm threshold [0.01 °C].

Note:

If operation is unchanged, then the permissible limit value can be exceeded. In this case, fault F30067 is output and the pulses inhibited.

Remedy:

- check whether the fan is running.
- check the fan elements.
- check whether the ambient temperature is in the permissible range.

Note:
This alarm is only withdrawn after the alarm threshold has been fallen below - and the corresponding hysteresis.

230067 <location>Power unit: overtemperature, fault capacitor air discharge

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The air discharged from the DC link capacitor has exceeded the permissible limit.

- ambient temperature too high.

- insufficient cooling, fan failure.

Fault value (r0949, interpret decimal):

Temperature when reaching the limit value [0.01 °C].

Remedy:

- check whether the fan is running.
- check the fan elements.
- check whether the ambient temperature is in the permissible range.

Note:

This fault can only be acknowledged after the limit value has been fallen below, and the corresponding hysteresis (5 K).

230068 <location>Power unit: undertemperature inverter heat sink

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The actual inverter heat sink temperature is below the permissible minimum value.

Possible causes:

- the power unit is being operated at an ambient temperature that lies below the permissible range.

- the temperature sensor evaluation is defective.

Fault value (r0949, interpret decimal):

Inverter heat sink temperature [0.1 °C].

Remedy:

- ensure that higher ambient temperatures prevail.
- replace the power unit.

230070 <location>Cycle requested by the power unit module not supported

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: A cycle is requested that is not supported by the power unit.

Fault value (r0949, interpret hexadecimal):

0: The current control cycle is not supported.

1: The DRIVE-CLiQ cycle is not supported.

2: Internal timing problem (clearance between RX and TX instants too low).

3: Internal timing problem (TX instant too early).

Remedy: The power unit only supports the following cycles:
62.5 µs, 125 µs, 250 µs and 500 µs
For fault value = 0:
Set a permitted current control cycle.
For fault value = 1:
Set a permitted DRIVE-CLiQ cycle.
For fault value = 2, 3:
Contact the manufacturer (you may have an incompatible firmware version).

230071 <location>No new actual values received from the power unit

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The number of actual value telegrams from the power unit module that have failed has exceeded the permissible number.

Remedy: Check the interface (adjustment and locking) to the power unit module.

230072 <location>Setpoints can no longer be transferred to the power unit

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The following applies for CU31x and CUA31:
More than one setpoint telegram was not able to be transferred to the power unit module.

Remedy: The following applies for CU31x and CUA31:
Check the interface (adjustment and locking) to the power unit module.

230073 <location>Actual value/setpoint preprocessing no longer synchronous

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: Communication with the power unit module is no longer in synchronism with the current control cycle.

Remedy: Wait until synchronization is re-established.

230074 <location>Communication error between the Control Unit and Power Module

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause:	Communications between the Control Unit (CU) and Power Module (PM) via the interface no longer possible. The CU may have been withdrawn or is incorrectly inserted. Fault value (r0949, interpret hexadecimal): 0 hex: - a Control Unit with external 24 V supply was withdrawn from the Power Module during operation. - with the Power Module switched off, the external 24 V supply for the Control Unit was interrupted for some time. 1 hex: The Control Unit was withdrawn from the Power Module during operation, although the encoderless safe motion monitoring functions are enabled. This is not supported. After re-inserting the Control Unit in operation, communications to the Power Module no longer possible. 20A hex: The Control Unit was inserted on a Power Module, which has another code number. 20B hex: The Control Unit was inserted on a Power Module, which although it has the same code number, has a different serial number. 601 hex: The Control Unit was inserted on a Power Module, whose power/performance class (chassis unit) is not supported.
Remedy:	Reinsert the Control Unit (CU) or the Control Unit Adapter (CUAxx) onto the original Power Module and continue operation. If required, carry out a POWER ON for the CU and/or the CUA.

230075 <location>Configuration of the power unit unsuccessful

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	A communication error has occurred while configuring the power unit using the Control Unit. The cause is not clear. Fault value (r0949, interpret decimal): 0: The output filter initialization was unsuccessful. 1: Activation/deactivation of the regenerative feedback functionality was unsuccessful. 2: Activation/deactivation of the chopper function was unsuccessful.
Remedy:	- acknowledge the fault and continue operation. - if the fault reoccurs, carry out a POWER ON (switch-off/switch-on). - if required, replace the power unit.

230076 <location>Power unit: thermal overload internal braking resistor alarm

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The energy absorbed by the internal braking resistor has exceeded the alarm threshold of 80 %. If the power unit is still operated in the generator mode, then this can reach the shutdown threshold. To avoid overheating of the braking resistor, use of the braking resistor is inhibited and alarm A30077 is output. Alarm value (r2124, interpret decimal): Energy absorbed by the braking resistor [Ws].
Remedy:	Reduce the power when generating. Note: For a DC link coupling, the generating power of all of the coupled power units must be taken into consideration.

230077 <location>Power unit: thermal overload internal braking resistor**Drive object:** SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE**Cause:** The internal braking resistor is thermally overloaded. This is the reason that its use was inhibited.

Alarm value (r2124, interpret decimal):

Energy absorbed by the braking resistor [Ws].

Remedy: Reduce the power when generating.

Note:

- once the internal braking resistor has thermally recovered, it is enabled for further use.

- for a DC link coupling, the generating power of all the coupled power units must be taken into consideration.

230078 <location>Power unit: defective fan or line reactor has overheated**Drive object:** SERVO_828, SERVO_COMBI**Message value:** -**Reaction:** OFF2**Acknowledge:** IMMEDIATELY**Cause:** The temperature monitoring of the internal braking resistor or the line reactor has responded. In addition to the OFF2 response, the use of the internal braking resistor was inhibited.

Note:

- an overtemperature condition of the internal braking resistor can only be initiated as a result of a defective fan.

- an overtemperature condition of the line reactor can occur when a DC link coupling is used – and if the power when motoring, which is fed into the DC link - is not evenly distributed across the rectifiers of the power units.

Remedy: - check the converter fan and replace if necessary.

- reduce the motoring power.

230079 <location>Power unit: referred to the supply voltage, the DC link voltage is too high**Drive object:** SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE**Cause:** The alarm is output if the following conditions are simultaneously satisfied:

1. The device supply voltage (p0210) was reduced.

2. A DC link voltage is present, which is too high when referred to the new supply voltage.

DC link precharging cannot be completed as this could place some converter components at risk.

Alarm value (r2124, interpret decimal):

Voltage value to which the DC link voltage must, in the meantime, be reduced in order to complete precharging [V].

See also: p0210 (Drive unit line supply voltage)

Remedy: As a minimum, reduce the DC link voltage to the voltage specified in the alarm value.

Note:

The alarm is automatically withdrawn if the DC link voltage drops below the voltage specified in the alarm value.

Fault F07802 is output if an attempt is made to enable the pulses even though an alarm is active.

230080 <location>Power unit: Current increasing too quickly**Drive object:** A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** Fault cause: %1 bin**Reaction:** OFF2**Acknowledge:** IMMEDIATELY

Cause:	The power unit has detected an excessive rate of rise in the overvoltage range. - closed-loop control is incorrectly parameterized. - motor has a short-circuit or fault to ground (frame). - U/f operation: Up ramp set too low. - U/f operation: rated current of motor much greater than that of power unit. - infeed: High discharge and post-charging currents for line voltage dip. - infeed: High post-charging currents for overload when motoring and DC link voltage dip. - infeed: Short-circuit currents at switch-on as there is no commutating reactor. - power cables are not correctly connected. - power cables exceed the maximum permissible length. - power unit defective. Additional causes for a parallel switching device (r0108.15 = 1): - a power unit has tripped (switched off) due to a ground fault. - the closed-loop circulating current control is either too slow or has been set too fast. Fault value (r0949, interpret bitwise binary): Bit 0: Phase U. Bit 1: Phase V. Bit 2: Phase W.
Remedy:	- check the motor data - if required, carry out commissioning. - check the motor circuit configuration (star-delta) - U/f operation: Increase up ramp. - U/f operation: Check assignment of rated currents of motor and power unit. - infeed: Check the line supply quality. - infeed: Reduce the motor load. - infeed: Correct connection of the line reactor. - check the power cable connections. - check the power cables for short-circuit or ground fault. - check the length of the power cables. - replace power unit. For a parallel switching device (r0108.15 = 1) the following additionally applies: - check the ground fault monitoring thresholds (p0287). - check the setting of the closed-loop circulating current control (p7036, p7037).

230081	<location>Power unit: Switching operations too frequent
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	OFF2
Acknowledge:	IMMEDIATELY

- Cause:**
- The power unit has executed too many switching operations for current limitation.
 - closed-loop control is incorrectly parameterized.
 - motor has a short-circuit or fault to ground (frame).
 - U/f operation: Up ramp set too low.
 - U/f operation: rated current of motor much greater than that of power unit.
 - infeed: High discharge and post-charging currents for line voltage dip.
 - infeed: High post-charging currents for overload when motoring and DC link voltage dip.
 - infeed: Short-circuit currents at switch-on as there is no commutating reactor.
 - power cables are not correctly connected.
 - power cables exceed the maximum permissible length.
 - power unit defective.

Additional causes for a parallel switching device (r0108.15 = 1):

- a power unit has tripped (switched off) due to a ground fault.
- the closed-loop circulating current control is either too slow or has been set too fast.

Fault value (r0949, interpret bitwise binary):

Bit 0: Phase U.

Bit 1: Phase V.

Bit 2: Phase W.

- Remedy:**
- check the motor data - if required, carry out commissioning.
 - check the motor circuit configuration (star-delta)
 - U/f operation: Increase up ramp.
 - U/f operation: Check assignment of rated currents of motor and power unit.
 - infeed: Check the line supply quality.
 - infeed: Reduce the motor load.
 - infeed: Correct connection of the line reactor.
 - check the power cable connections.
 - check the power cables for short-circuit or ground fault.
 - check the length of the power cables.
 - replace power unit.
- For a parallel switching device (r0108.15 = 1) the following additionally applies:
- check the ground fault monitoring thresholds (p0287).
 - check the setting of the closed-loop circulating current control (p7036, p7037).

230082 <location>Power unit: cooling medium flow rate too low alarm threshold

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The flow rate is too low, and has fallen below the specified alarm threshold. If the flow rate is still too low after the specified time has expired, then fault F30083 is output.

- Remedy:**
- check the coolant flow rate.
 - check the thermal conductivity of the coolant.
 - check the coolant concentration.

230083 <location>Power unit: cooling medium flow rate too low fault threshold

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The flow rate is too low, and has fallen below the specified fault threshold.

Remedy:

- check the coolant flow rate.
- check the thermal conductivity of the coolant.
- check the coolant concentration.

230086 <location>Power unit: coolant temperature has exceeded the alarm threshold

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The coolant temperature has exceeded the specified alarm threshold.
If the coolant temperature increases up to the specified fault threshold, then fault F30087 is output.
Alarm value (r2124, interpret decimal):
Coolant temperature.

Remedy: Check the cooling system and the ambient conditions.

230087 <location>Power unit: coolant temperature has exceeded the fault threshold

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The coolant temperature has exceeded the specified fault threshold.
Fault value (r0949, interpret decimal):
Coolant temperature.

Remedy: Check the cooling system and the ambient conditions.

230105 <location>PU: Actual value sensing fault

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: At least one incorrect actual value channel was detected on the Power Stack Adapter (PSA).
The incorrect actual value channels are displayed in the following diagnostic parameters.

Remedy: Evaluate the diagnostic parameters.
If the actual value channel is incorrect, check the components and if required, replace.

230314 <location>Power unit: 24 V power supply overloaded by PM

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The 24 V power supply through the Power Module (PM) is overloaded.
An external 24 V power supply via X124 on the Control Unit is not connected.

Remedy: Connect an external 24 V power supply via X124 at the Control Unit.

230315 <location>Power unit: 24 V power supply overloaded by PM

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The 24 V power supply through the Power Module (PM) is overloaded.
An external 24 V power supply via X124 on the Control Unit is not connected.

Remedy: Connect an external 24 V power supply via X124 at the Control Unit.

230502 **<location>Power unit: DC link overvoltage**

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The power unit has detected overvoltage in the DC link on a pulse inhibit.
- device supply voltage too high.
- line reactor incorrectly dimensioned.
Alarm value (r0949, interpret decimal):
DC link voltage [1 bit = 100 mV].
See also: r0070

Remedy: - check the device supply voltage (p0210).
- check the dimensioning of the line reactor.
See also: p0210 (Drive unit line supply voltage)

230600 **<location>SI P2: STOP A initiated**

Drive object: HLA_828

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The drive-integrated "Safety Integrated" function in monitoring channel 2 has detected a fault and initiated a STOP A (STO via the safety switch-off signal path of monitoring channel 2).
- forced checking procedure (test stop) of the safety switch-off signal path of monitoring channel 2 unsuccessful.
- subsequent response to fault F30611 (defect in a monitoring channel).
Fault value (r0949, interpret decimal):
0: stop request from the Control Unit.
1005: STO active although STO not selected and there is no internal STOP A present.
1010: STO inactive although STO is selected or an internal STOP A is present.
9999: Subsequent response to fault F30611.

Remedy: - select Safe Torque Off and deselect again.
- carry out a POWER ON (switch-off/switch-on) for all components.
- replace Hydraulic Module involved.
For fault value = 9999:
- carry out diagnostics for fault F30611.
Note:
CU: Control Unit
SI: Safety Integrated
STO: Safe Torque Off / SH: Safe standstill

230600 **<location>SI P2: STOP A initiated**

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause:	The drive-integrated "Safety Integrated" function in monitoring channel 2 has detected a fault and initiated a STOP A (STO via the safety switch-off signal path of monitoring channel 2). - forced checking procedure (test stop) of the safety switch-off signal path of monitoring channel 2 unsuccessful. - subsequent response to fault F30611 (defect in a monitoring channel). Fault value (r0949, interpret decimal): 0: Stop request from the Control Unit. 1005: - STO active, although STO not selected and there is no internal STOP A active. - For a Power Module with "STO via terminals at the Power Module" (STO_A/STO_B), these terminals are active (DIP switch to "ON"). However, the "STO via terminals at the Power Module" function has not been enabled (p9601.7 = p9801.7 = 0). 1010: STO inactive although STO is selected or an internal STOP A is present. 1011: internal error for STO deselected in monitoring channel 2. 1020: Internal software error in the "Internal voltage protection" function. The "internal voltage protection" function is withdrawn. A STOP A that cannot be acknowledged is initiated. 9999: Subsequent response to fault F30611.
Remedy:	- select Safe Torque Off and deselect again. - carry out a POWER ON (switch-off/switch-on) for all components. - replace the Motor Module involved. For fault value = 1005: - deactivate terminals STO_A/STO_B on the Power Module (set both DIP-switches to "OFF") or enable the "STO via terminals at the Power Module" function. For fault value = 9999: - carry out diagnostics for fault F30611. Note: CU: Control Unit MM: Motor Module SI: Safety Integrated STO: Safe Torque Off / SH: Safe standstill

230611 <location>SI P2: Defect in a monitoring channel

Drive object:	HLA_828
Message value:	%1
Reaction:	NONE (OFF1, OFF2, OFF3)
Acknowledge:	IMMEDIATELY (POWER ON)

- Cause:** The drive-integrated "Safety Integrated" function on processor 2 has detected a fault in the data cross-check between the two monitoring channels and has initiated a STOP F.
- As a result of this fault, after the parameterized transition has expired (p9858), fault F30600 is output (SI MM: STOP A initiated).
- Fault value (r0949, interpret decimal):
- 0: Stop request from the other monitoring channel.
 - 1 ... 999:
Number of the cross-compared data that resulted in this fault. This number is also displayed in r9895.
 - 1: SI monitoring clock cycle (r9780, r9880).
 - 2: SI enable safety functions (p9601, p9801). Crosswise data comparison is only carried out for the supported bits.
 - 3: SI SGE changeover discrepancy time (p9650, p9850).
 - 4: SI transition period STOP F to STOP A (p9658, p9858).
 - 6: SI Motion enable, safety-relevant functions (p9501, internal value).
 - 7: SI delay time of STO for Safe Stop 1 (p9652, p9852).
 - 8: SI PROFIsafe address (p9610, p9810).
 - 9: SI debounce time for STO/SBC/SS1 (p9651, p9851).
 - 10: SI delay time for initiating STO for ESR (p9697, p9897).
 - 11: SI HLA shutoff valve feedback signal contact configuration (p9626, p9826).
 - 12: SI HLA shutoff valve wait time switch-on (p9625[0], p9825[0]).
 - 13: SI HLA shutoff valve wait time switch-off (p9625[1], p9825[1]).
 - 14: SI PROFIsafe telegram selection (p9611, p9811).
 - 15: SI PROFIsafe bus failure response (p9612, p9812).
 - 1000: Watchdog timer has expired.
- Within the time of approx. 5 x p9650, alternatively, the following was defined:
- the signal at terminal STO of the Hydraulic Module continually changed with time intervals less than or equal to the discrepancy time (p9650/p9850).
 - via PROFIsafe/TM54F, STO (also as subsequent response) was continually selected and deselected with time intervals less than or equal to the discrepancy time (p9650/p9850).
- 1001, 1002: Initialization error, change timer / check timer.
 - 1950: Module temperature outside the permissible temperature range.
 - 1951: Module temperature not plausible.
 - 2000: Status of the STO selection for both monitoring channels different.
 - 2001: Feedback signal of STO shutdown for both monitoring channels different.
 - 2002: Status of the delay timer SS1 for both monitoring channels different (status of the timer in p9650/p9850).
 - 2003: Status of the STO terminal for both monitoring channels different.
 - 6000 ... 6999:
Error in the PROFIsafe control.
- For these fault values, the failsafe control signals (Failsafe Values) are transferred to the safety functions. If "STOP B after failure of the PROFIsafe communication" (p9812) is parameterized, the transfer of the Failsafe Values is delayed.
- The significance of the individual message values is described in safety message C01611.

Remedy:	For fault value = 1 ... 5 and 7 ... 999: - check the cross data comparison that resulted in a STOP F. - carry out a POWER ON (switch-off/switch-on) for all components. - upgrade the Hydraulic Module software. - upgrade the Control Unit software. For fault value = 6: - carry out a POWER ON (switch-off/switch-on) for all components. - upgrade the Hydraulic Module software. - upgrade the Control Unit software. For fault value = 1000: - check the wiring of the safety-relevant inputs (SGE) on the Control Unit (contact problems). - PROFIsafe: Remove contact problems/faults at the PROFIBUS master/PROFINET controller. - check the wiring of the failsafe inputs at the TM54F (contact problems). - check the discrepancy time, and if required, increase the value (p9650/p9850). For fault value = 1001, 1002: - carry out a POWER ON (switch-off/switch-on) for all components. - upgrade the Hydraulic Module software. - upgrade the Control Unit software. For fault value = 1950: - operate the module in the permissible range. - check the module fan, replace the Hydraulic Module involved. For fault value = 1951: - operate the module in the permissible range. - replace Hydraulic Module involved. For fault value = 2000, 2001, 2002, 2003: - check the discrepancy time, and if required, increase the value (p9650/p9850, p9652/p9852). - check the wiring of the safety-relevant inputs (SGE) (contact problems). - check why STO was selected in r9872. When the SMM functions are active (p9501 = 1), STO can also be selected using these functions. - replace Hydraulic Module involved. Note: This fault can be acknowledged after removing the cause of the error and after correct selection/deselection of STO. For fault value = 6000 ... 6999: Refer to the description of the message values in safety message C01611. Note: CU: Control Unit ESR: Extended Stop and Retract HM: Hydraulic Module. SGE: Safety-relevant input SI: Safety Integrated SMM: Safe Motion Monitoring SS1: Safe Stop 1 (corresponds to Stop Category 1 acc. to EN60204) STO: Safe Torque Off / SH: Safe standstill
----------------	---

230611 <location>SI P2: Defect in a monitoring channel

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE (OFF1, OFF2, OFF3)
Acknowledge:	IMMEDIATELY (POWER ON)

Cause: The drive-integrated "Safety Integrated" function on processor 2 has detected a fault in the data cross-check between the two monitoring channels and has initiated a STOP F.

As a result of this fault, after the parameterized transition has expired (p9858), fault F30600 is output (SI MM: STOP A initiated).

Fault value (r0949, interpret decimal):

0: Stop request from another monitoring channel.

1 ... 999:

Number of the cross-compared data that resulted in this fault. This number is also displayed in r9895.

1: SI monitoring clock cycle (r9780, r9880).

2: SI enable safety functions (p9601, p9801). Crosswise data comparison is only carried out for the supported bits.

3: SI SGE changeover discrepancy time (p9650, p9850).

4: SI transition period STOP F to STOP A (p9658, p9858).

5: SI enable Safe Brake Control (p9602, p9802).

6: SI Motion enable, safety-relevant functions (p9501, internal value).

7: SI delay time of STO for Safe Stop 1 (p9652, p9852).

8: SI PROFIsafe address (p9610, p9810).

9: SI debounce time for STO/SBC/SS1 (p9651, p9851).

10: SI delay time for initiating STO for ESR (p9697, p9897).

11: SI Safe Brake Adapter mode, BICO interconnection (p9621, p9821).

12: SI Safe Brake Adapter relay ON time (p9622[0], p9822[0]).

13: SI Safe Brake Adapter relay OFF time (p9622[1], p9822[1]).

14: SI PROFIsafe telegram selection (p9611, p9811).

15: SI PROFIsafe bus failure response (p9612, p9812).

1000: Watchdog timer has expired.

Within the time of approx. 5 x p9650, alternatively, the following was defined:

- the signal at terminal EP of the Motor Module continually changed with time intervals less than or equal to the discrepancy time (p9650/p9850).
- via PROFIsafe/TM54F, STO (also as subsequent response) was continually selected and deselected with time intervals less than or equal to the discrepancy time (p9650/p9850).
- safe pulse cancellation (r9723.9 - also as subsequent response) was continually selected and deselected with time intervals less than or equal to the discrepancy time (p9650/p9850).

1001, 1002: Initialization error, change timer / check timer.

1950: Module temperature outside the permissible temperature range.

1951: Module temperature not plausible.

1952: S120M: hardware access fault.

1953: Module temperature outside the permissible temperature range.

1954: Module temperature not plausible.

2000: Status of the STO selection for both monitoring channels different.

2001: Feedback signal of STO shutdown for both monitoring channels different. This value can also subsequently occur as a result of other faults.

2002: Status of the delay timer SS1 for both monitoring channels different (status of the timer in p9650/p9850).

2003: Status of the STO terminal for both monitoring channels different.

2004: Forced checking procedure of the switch-off signal path of the second channel unsuccessful.

2005: Forced checking procedure of the switch-off signal path of the second channel unsuccessful.

6000 ... 6999:

Error in the PROFIsafe control.

For these fault values, the failsafe control signals (Failsafe Values) are transferred to the safety functions. If "STOP B after failure of the PROFIsafe communication" (p9812) is parameterized, the transfer of the Failsafe Values is delayed.

The significance of the individual message values is described in safety message C01611.

Remedy:

For fault value = 1 ... 5 and 7 ... 999:

- check the cross data comparison that resulted in a STOP F.
- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade the Motor Module software.
- upgrade the Control Unit software.

For fault value = 6:

- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade the Motor Module software.
- upgrade the Control Unit software.

For fault value = 1000:

- check the wiring of the safety-relevant inputs (SGE) on the Control Unit (contact problems).
- PROFIsafe: Remove contact problems/faults at the PROFIBUS master/PROFINET controller.
- check the wiring of the failsafe inputs at the TM54F (contact problems).
- check the discrepancy time, and if required, increase the value (p9650/p9850).

For fault value = 1001, 1002:

- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade the Motor Module software.
- upgrade the Control Unit software.

For fault value = 1950:

- operate the module in the permissible range.
- check the module fan, replace the Motor Module involved.

For fault value = 1951:

- operate the module in the permissible range.
- replace the Motor Module involved.

For fault value = 1952:

- replace the Motor Module involved.

For fault value = 2000, 2001, 2002, 2003:

- check the discrepancy time, and if required, increase the value (p9650/p9850, p9652/p9852).
- check the wiring of the safety-relevant inputs (SGE) (contact problems).
- check why STO was selected in r9872. When the SMM functions are active (p9501 = 1), STO can also be selected using these functions.

For fault value 2004, 2005:

- replace the Motor Module involved.
- replace the Motor Module involved.
- diagnose the other active faults and resolve the causes.

Note:

This fault can be acknowledged after removing the cause of the error and after correct selection/deselection of STO.

For fault value = 6000 ... 6999:

Refer to the description of the message values in safety message C01611.

Note:

CU: Control Unit

EP: Enable Pulses (pulse enable)

ESR: Extended Stop and Retract

MM: Motor Module

SGE: Safety-relevant input

SI: Safety Integrated

SMM: Safe Motion Monitoring

SS1: Safe Stop 1

STO: Safe Torque Off / SH: Safe standstill

230620 <location>SI P2: Safe Torque Off active**Drive object:** HLA_828, SERVO_828, SERVO_COMBI**Message value:** -**Reaction:** NONE**Acknowledge:** NONE**Cause:** The "Safe Torque Off" (STO) function of the basic functions has been selected in monitoring channel 2 using the input terminal and is active.**Note:**

- this message does not result in a safety stop response.
- this message is not output when STO is selected using the Extended Functions.

Remedy: Not necessary.**Note:**

MM: Motor Module

SI: Safety Integrated

STO: Safe Torque Off / SH: Safe standstill

230621 <location>SI P2: Safe Stop 1 active**Drive object:** HLA_828, SERVO_828, SERVO_COMBI**Message value:** -**Reaction:** NONE**Acknowledge:** NONE**Cause:** The "Safe Stop 1" function (SS1) was selected in monitoring channel 2 and is active.**Note:**

This message does not result in a safety stop response.

Remedy: Not necessary.**Note:**

MM: Motor Module

SI: Safety Integrated

SS1: Safe Stop 1

230625 <location>SI P2: Sign-of-life error in safety data**Drive object:** HLA_828, SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:** OFF2**Acknowledge:** IMMEDIATELY (POWER ON)**Cause:** The drive-integrated "Safety Integrated" function in monitoring channel 2 has detected an error in the sign-of-life of the safety data between the two monitoring channels and initiated a STOP A.

- there is either a DRIVE-CLiQ communication error or communication has failed.
- a time slice overflow of the safety software has occurred.
- the enable of the safety functions in both monitoring channels is inconsistent (p9601 = 0, p9801 <> 0).

Fault value (r0949, interpret decimal):

Only for internal Siemens troubleshooting.

- Remedy:**
- select Safe Torque Off and deselect again.
 - carry out a POWER ON (switch-off/switch-on) for all components.
 - check whether there is a DRIVE-CLiQ communication error between the two monitoring channels and, if required, carry out a diagnostics routine for the faults identified.
 - deselect all drive functions that are not absolutely necessary.
 - reduce the number of drives.
 - check the electrical cabinet design and cable routing for EMC compliance
 - check the enable of the safety functions for both of the monitoring channels and if required, correct (p9601, p9801).
- Note:**
- P2: processor 2
- SI: Safety Integrated

230630	<location>SI P2: Brake control error
Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The "Safety Integrated" function integrated in the drive on the Motor Module (MM) has detected a brake control error and initiated a STOP A. - motor cable is not shielded correctly. - defect in the brake control circuit of the Motor Module. Fault value (r0949, interpret decimal): 10: Fault in "open holding brake" operation. - parameter p1278 incorrectly set. - no brake connected or wire breakage (check whether brake releases for p1278 = 1 and p9602/p9802 = 0 (SBC deactivated)). - ground fault in brake cable. 30: Fault in "close holding brake" operation. - no brake connected or wire breakage (check whether brake releases for p1278 = 1 and p9602/p9802 = 0 (SBC deactivated)). - short-circuit in brake winding. 40: Fault in "brake closed" state. 60, 70: Fault in the brake control circuit of the Control Unit or communication fault between the Control Unit and Motor Module (brake control). 81: Safe Brake Adapter: Fault in "brake closed" state. 82: Safe Brake Adapter: Fault for the operation "open brake". 83: Safe Brake Adapter: Fault for the operation "close brake". 84, 85: Safe Brake Adapter: Fault in the brake control circuit of the Control Unit or communication fault between the Control Unit and Motor Module (brake control). 90: Brake released for service purposes (X4). 91: Fault in "open holding brake" operation. - no brake connected or wire breakage (check whether brake releases for p1278 = 1 and p9602/p9802 = 0 (SBC deactivated)).

Remedy:

- check parameter p1278 (for SBC, only p1278 = 0 is permissible).
- select Safe Torque Off and deselect again.
- check the motor holding brake connection.
- check the function of the motor holding brake.
- check whether there is a DRIVE-CLiQ communication error between the Control Unit and the Motor Module involved and, if required, carry out a diagnostics routine for the faults identified.
- check that the electrical cabinet design and cable routing are in compliance with EMC regulations (e.g. shield of the motor cable and brake conductors are connected with the shield connecting plate and the motor connectors are tightly screwed to the housing).
- replace the Motor Module involved.

Operation with Safe Brake Module or Safe Brake Adapter:

- check the Safe Brake Module or Safe Brake Adapter connection.
- Replace the Safe Brake Module or Safe Brake Adapter.

Note:

MM: Motor Module
SBC: Safe Brake Control
SI: Safety Integrated

230631	<location>Brake control: External release active
Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	For mounting purposes, the brake is supplied with voltage via terminal X4.1 and released.
Remedy:	If required, again remove the power supply at X4.1.

230632	<location>SI P2: shutoff valve control/feedback signal error
Drive object:	HLA_828
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)

Cause:	The drive-integrated "Safety Integrated" function on the Hydraulic Module (monitoring channel 2) has detected a fault for the control/feedback signal of the shutoff valve and initiated a STOP A. Possible causes: - shutoff valve either not connected or not correctly connected (X272). - feedback signal of the shutoff valve either not connected or not correctly connected (X281/X282). - feedback signal of the shutoff valve incorrectly set (p9626/p9826). - shutoff valve defective. - Hydraulic Module defective. Fault value (r0949, interpret decimal): 10: Fault in the "Open shutoff valve" operation. 30: Fault in the "Close shutoff valve" operation. 40: Fault in the "Shutoff valve closed" state. 60, 70: Fault in the control of the cutoff valve or communication error between the Control Unit and the Hydraulic Module. 81: Feedback signal of the shutoff valve: Fault in the "Shutoff valve closed" state. 82: Feedback signal of the shutoff valve: Fault when "Opening shutoff valve". 83: Feedback signal of the shutoff valve: Fault when "Closing shutoff valve". 84: Feedback signal of the shutoff valve: Fault in the control of the shutoff valve or communication error between the Control Unit and the Hydraulic Module.
Remedy:	- check the shutoff valve connection (X272). - check the feedback signals of the shutoff valve (X281, X282). - check the configuration of the feedback signals of the shutoff valve (p9626/p9826). - check for EMC-compliant control cabinet design and cable routing (e.g. use shielded cables and connect the shield). - if necessary, replace the shutoff valve. - if necessary, replace the Hydraulic Module. See also: p9626 (SI HLA shutoff valve feedback signal contact configuration (CU)), p9826 (SI HLA shutoff valve feedback signal contact configuration (MM))

230640	<location>SI P2: Fault in the switch-off signal path of the second channel
Drive object:	HLA_828
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The Hydraulic Module has detected a communications error with the higher-level control or the TM54F to transfer the safety-relevant information. Note: This fault results in a STOP A that can be acknowledged. Alarm value (r2124, interpret decimal): Only for internal Siemens troubleshooting.

Remedy: For the higher-level control, the following applies:

- check the PROFIsafe address in the higher-level control and Hydraulic Module and if required, align.
- save all parameters (p0977 = 1).
- carry out a POWER ON (switch-off/switch-on) for all components.

For TM54F, carry out the following steps:

- start the copy function for the node identifier (p9700 = 1D hex).
- acknowledge hardware CRC (p9701 = EC hex).
- save all parameters (p0977 = 1).
- carry out a POWER ON (switch-off/switch-on) for all components.

For a parallel connection, the following applies:

- check the PROFIsafe address in both monitoring channels and if required, align.
- save all parameters (p0977 = 1).
- carry out a POWER ON (switch-off/switch-on) for all components.

The following generally applies:

- upgrade the Hydraulic Module software.

Note:
MM: Motor Module
SI: Safety Integrated
See also: p9810 (SI PROFIsafe address (Motor Module))

230640 <location>SI P2: Fault in the switch-off signal path of the second channel

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The Motor Module has detected a communication error with the higher-level control or the TM54F to transfer the safety-relevant information or there is a communication error between Motor Modules connected in parallel.

Note:

This fault results in a STOP A that can be acknowledged.

Alarm value (r2124, interpret decimal):

Only for internal Siemens troubleshooting.

Remedy: For the higher-level control, the following applies:

- check the PROFIsafe address in the higher-level control and Motor Modules and if required, align.
- save all parameters (p0977 = 1).
- carry out a POWER ON (switch-off/switch-on) for all components.

For TM54F, carry out the following steps:

- start the copy function for the node identifier (p9700 = 1D hex).
- acknowledge hardware CRC (p9701 = EC hex).
- save all parameters (p0977 = 1).
- carry out a POWER ON (switch-off/switch-on) for all components.

For a parallel connection, the following applies:

- check the PROFIsafe address in both monitoring channels and if required, align.
- save all parameters (p0977 = 1).
- carry out a POWER ON (switch-off/switch-on) for all components.

The following generally applies:

- upgrade the Motor Module software.

Note:
MM: Motor Module
SI: Safety Integrated
See also: p9810 (SI PROFIsafe address (Motor Module))

230649 <location>SI P2: Internal software error**Drive object:** HLA_828, SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:** OFF2**Acknowledge:** IMMEDIATELY (POWER ON)**Cause:** An internal error in the Safety Integrated software in monitoring channel 2 has occurred.

Note:

This fault results in a STOP A that cannot be acknowledged.

Fault value (r0949, interpret hexadecimal):

Only for internal Siemens troubleshooting.

Remedy:

- carry out a POWER ON (switch-off/switch-on) for all components.
- re-commission the Safety Integrated Function and carry out a POWER ON.
- upgrade the Motor Module/Hydraulic Module software.
- contact Technical Support.
- replace the Motor Module/Hydraulic Module.

Note:

MM: Motor Module

SI: Safety Integrated

230650 <location>SI P2: Acceptance test required**Drive object:** HLA_828, SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:** OFF2**Acknowledge:** IMMEDIATELY (POWER ON)**Cause:** The "Safety Integrated" function on monitoring channel 2 requires an acceptance test.

Note:

This fault results in a STOP A that can be acknowledged.

Fault value (r0949, interpret decimal):

130: Safety parameters for monitoring channel 2 not available.

Note:

This fault value is always output when Safety Integrated is commissioned for the first time.

1000: Reference and actual checksum in monitoring channel 2 are not identical (booting).

- as a result of the changed current controller sampling time (p0115[0]), the clock cycle time for the Safety Integrated Basic Functions (r9880) was adapted.

- safety parameters set offline and loaded into the Control Unit.

- a download was made to the SINAMICS, whose firmware versions in monitoring channel 2 did not correspond to the latest version. The request to switch off the DRIVE-CLiQ component A1007 was present after the download.

- at least one checksum-checked piece of data is defective.

2000: Reference and actual checksum in monitoring channel 2 are not identical (commissioning mode).

- reference checksum on monitoring channel 2 incorrectly entered (p9899 not equal to r9898).

2003: Acceptance test is required as a safety parameter has been changed.

2005: The safety logbook has identified that the safety checksums have changed. An acceptance test is required.

3003: Acceptance test is required as a hardware-related safety parameter has been changed.

9999: Subsequent response of another safety-related fault that occurred when booting that requires an acceptance test.

Remedy:

For fault value = 130:

- carry out safety commissioning routine.

For fault value = 1000:

- check the Safety Integrated Basic Functions (r9880) and adapt the reference checksum (p9899).
- again carry out safety commissioning routine.
- Using STARTER, activate the safety parameters for the drive involved (change settings, copy parameters, activate settings).
- switch off and switch on the drive unit and DRIVE-CLiQ components. If A30650 is still present, repeat the download.
- replace the memory card or Control Unit.

For fault value = 2000:

- check the safety parameters on monitoring channel 2 and adapt the reference checksum (p9899).

For fault value = 2003, 2005:

- carry out an acceptance test and generate an acceptance report.

The procedure when carrying out an acceptance test as well as an example of the acceptance report are provided in the following literature:

SINAMICS S120 Function Manual Safety Integrated

For fault value = 3003:

- carry out the function checks for the modified hardware and generate an acceptance report.

The procedure when carrying out an acceptance test as well as an example of the acceptance report are provided in the following literature:

SINAMICS S120 Function Manual Safety Integrated

For fault value = 9999:

- carry out diagnostics for the other safety-related fault that is present.

Note:

MM: Motor Module

SI: Safety Integrated

See also: p9799 (SI reference checksum SI parameters (Control Unit)), p9899 (SI reference checksum SI parameters (Motor Module))

230651 <location>SI P2: Synchronization with Control Unit unsuccessful

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The drive-integrated "Safety Integrated" function requires synchronization of the safety time slices in both monitoring channels. This synchronization routine was unsuccessful.

Note:

This fault results in a STOP A that cannot be acknowledged.

Fault value (r0949, interpret decimal):

Only for internal Siemens troubleshooting.

Remedy:

- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade the Motor Module/Hydraulic Module software.
- upgrade the Control Unit software.

Note:

MM: Motor Module

SI: Safety Integrated

230652 <location>SI P2: Illegal monitoring clock cycle

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause:	The Safety Integrated monitoring clock cycle cannot be maintained due to the communication conditions requested in the system. Note: This fault results in a STOP A that cannot be acknowledged. Fault value (r0949, interpret decimal): Only for internal Siemens troubleshooting.
Remedy:	- if fault F01652 simultaneously occurs, apply the remedy/countermeasure described there. - upgrade the firmware of the Motor Module/Hydraulic Module to a later version. Note: MM: Motor Module P2: processor 2 SI: Safety Integrated

230655 <location>SI P2: Align monitoring functions

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	An error has occurred when aligning the Safety Integrated monitoring functions of both monitoring channels. No common set of supported SI monitoring functions was able to be determined. - there is either a DRIVE-CLiQ communication error or communication has failed. - Safety Integrated software releases on the Control Unit and Motor Module/Hydraulic Module are not compatible with one another. Note: This fault results in a STOP A that cannot be acknowledged. Fault value (r0949, interpret hexadecimal): Only for internal Siemens troubleshooting.
Remedy:	- carry out a POWER ON (switch-off/switch-on) for all components. - upgrade the Motor Module/Hydraulic Module software. - upgrade the Control Unit software. - check the electrical cabinet design and cable routing for EMC compliance Note: CU: Control Unit MM: Motor Module SI: Safety Integrated

230656 <location>SI P2: Motor Module parameter error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	When accessing the Safety Integrated parameters for monitoring channel 2 in the non-volatile memory, an error has occurred. Note: This fault results in a STOP A that can be acknowledged. Fault value (r0949, interpret decimal): 129: - safety parameters for monitoring channel 2 corrupted. - drive with enabled safety functions was possibly copied offline using the commissioning tool and the project downloaded. 131: Internal software error on the Control Unit. 255: Internal Motor Module/Hydraulic Module software error.

Remedy:

- re-commission the safety functions.
- upgrade the Control Unit software.
- upgrade the Motor Module/Hydraulic Module software.
- replace the memory card or Control Unit.

For fault value = 129:

- activate the safety commissioning mode (p0010 = 95).
- adapt the PROFIsafe address (p9610).
- start the copy function for SI parameters (p9700 = D0 hex).
- acknowledge data change (p9701 = DC hex).
- exit the safety commissioning mode (p0010 = 0).
- save all parameters (p0977 = 1 or "copy RAM to ROM").
- carry out a POWER ON (switch-off/switch-on) for all components.

Note:
MM: Motor Module
SI: Safety Integrated

230657 **<location>SI P2: PROFIsafe telegram number invalid**

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: POWER ON

Cause: The PROFIsafe telegram number set in p9811 is not valid.
When PROFIsafe is enabled (p9801.3 = 1), then a telegram number greater than zero must be entered in p9811.

Note:
This fault does not result in a safety stop response.
See also: p9611 (SI PROFIsafe telegram selection (Control Unit)), p60022 (PROFIsafe telegram selection)

Remedy: Check the telegram number setting (p9811).

230659 **<location>SI P2: Write request for parameter rejected**

Drive object: HLA_828

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The write request for one or several Safety Integrated parameters in monitoring channel 2 was rejected.

Note:
This fault does not result in a safety stop response.
Fault value (r0949, interpret decimal):

- 10: An attempt was made to enable the STO function although this cannot be supported.
- 13: An attempt was made to enable the SS1 function although this cannot be supported.
- 14: An attempt was made to enable the safe motion monitoring function with the higher-level control, although this cannot be supported.
- 15: An attempt was made to enable the motion monitoring functions integrated in the drive although these cannot be supported.
- 16: An attempt was made to enable the PROFIsafe communication - although this cannot be supported or the version of the PROFIsafe driver used on both monitoring channels is different.
- 18: An attempt was made to enable the PROFIsafe function for Basic Functions although this cannot be supported.
- 19: For ESR, an attempt was made to enable the delay for pulse suppression, although this cannot be supported.
- 27: An attempt was made to activate the Basic Functions by controlling via TM54F although this is not supported.
- 29: An attempt was made to parameterize the fault response for PROFIsafe failure to STOP B although this cannot be supported.
- 33: Safety functions without selection are not supported (p9601.5, p9801.5).

See also: r9771 (SI common functions (Control Unit)), r9871 (SI common functions (Motor Module))

Remedy:

For fault value = 10, 13, 14, 15, 16, 18, 19:

- check whether there are faults in the safety function alignment between the two monitoring channels (F01655, F30655) and if required, carry out diagnostics for the faults involved.
- use a Hydraulic Module that supports the required function.
- upgrade the Hydraulic Module software.
- upgrade the Control Unit software.

For fault value = 29:

- check whether p9612 and p9812 are set; if required, correct the settings.
- use a Hydraulic Module that supports the required function.
- upgrade the Hydraulic Module software.
- upgrade the Control Unit software.

Note:

SI: Safety Integrated

SS1: Safe Stop 1 (corresponds to Stop Category 1 acc. to EN60204)

STO: Safe Torque Off / SH: Safe standstill

230659 <location>SI P2: Write request for parameter rejected

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The write request for one or several Safety Integrated parameters in monitoring channel 2 was rejected.

Note:

This fault does not result in a safety stop response.

Fault value (r0949, interpret decimal):

10: An attempt was made to enable the STO function although this cannot be supported.

11: An attempt was made to enable the SBC function although this cannot be supported.

13: An attempt was made to enable the SS1 function although this cannot be supported.

14: An attempt was made to enable the safe motion monitoring function with the higher-level control, although this cannot be supported.

15: An attempt was made to enable the motion monitoring functions integrated in the drive although these cannot be supported.

16: An attempt was made to enable the PROFIsafe communication - although this cannot be supported or the version of the PROFIsafe driver used on both monitoring channels is different.

18: An attempt was made to enable the PROFIsafe function for Basic Functions although this cannot be supported.

19: For ESR, an attempt was made to enable the delay for pulse suppression, although this cannot be supported.

27: An attempt was made to activate the Basic Functions by controlling via TM54F although this is not supported.

28: An attempt was made to enable the "STO via terminals at the Power Module" function although this cannot be supported.

29: An attempt was made to parameterize the STOP B as stop response for PROFIsafe failure, although this cannot be supported.

See also: r9771 (SI common functions (Control Unit)), r9871 (SI common functions (Motor Module))

Remedy:

For fault value = 10, 11, 13, 14, 15, 16, 18, 19, 27:

- check whether there are faults in the safety function alignment between the two monitoring channels (F01655, F30655) and if required, carry out diagnostics for the faults involved.
- use a Motor Module that supports the required function.
- upgrade the Motor Module software.
- upgrade the Control Unit software.

For fault value = 28:

- use the power unit with the feature "STO via terminals at the Power Module".

For fault value = 29:

- use a Motor Module that supports the required function.
- upgrade the Motor Module software.
- upgrade the Control Unit software.
- If required, parameterize the stop response for PROFIsafe failure to STOP A (p9612 = p9812 = 0).

Note:

CU: Control Unit
ESR: Extended Stop and Retract
MM: Motor Module
SBC: Safe Brake Control
SI: Safety Integrated
SS1: Safe Stop 1
STO: Safe Torque Off / SH: Safe standstill

230664 <location>Error while booting

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1

Reaction: OFF2

Acknowledge: POWER ON

Cause: An error has occurred during booting.
Fault value (r0949, interpret hexadecimal):
Only for internal Siemens troubleshooting.

Remedy:

- carry out a POWER ON (switch-off/switch-on).
- upgrade firmware to later version.
- contact Technical Support.

230665 <location>SI P2: System is defective

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: A system defect was detected before the last boot or in the actual one. The system might have been rebooted (reset).
Fault value (r0949, interpret hexadecimal):
2 hex:

- parameters p9500 and p9300 are not the same (if Safety message C30711 is displayed at the same time).

200000 hex, 400000 hex:

- fault in the actual booting/operation.

Additional values:

- defect before the last time that the system booted.

Remedy:

- carry out a POWER ON (switch-off/switch-on).
- upgrade firmware to later version.
- contact Technical Support.

For fault value = 2:

- check parameters p9500 and p9300 to see if they are the same (if Safety message C30711 is displayed at the same time).

For fault value = 400000 hex:

- ensure that the Control Unit is connected to the Power Module.

230666 <location>SI Motion P2: Steady-state (static) 1 signal at the F-DI for safe acknowledgment

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: A logical 1 signal is present at the F-DI configured in p10106 for more than 10 seconds.
If, at the F-DI no acknowledgment was performed for safe acknowledgment, then a steady-state logical and 0 signal must be present. This avoids unintentional safety-relevant acknowledgment (or the "Internal Event Acknowledge" signal) if a wire breaks or one of the two digital inputs bounces.

Remedy: Set the failsafe digital input (F-DI) to a logical 0 signal (p10106).

Note:

F-DI: Failsafe Digital Input

230672 <location>SI P2: Control Unit software incompatible

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The existing Control Unit software does not support the safe drive-based motion monitoring function.

Note:

This fault results in a STOP A that cannot be acknowledged.

Fault value (r0949, interpret decimal):

Only for internal Siemens troubleshooting.

Remedy:

- check whether there are faults in the safety function alignment between the two monitoring channels (F01655, F30655) and if required, carry out diagnostics for the faults involved.

- use a Control Unit that supports the safe motion monitoring function.

- upgrade the Control Unit software.

Note:

SI: Safety Integrated

230674 <location>SI Motion P2: Safety function not supported by PROFIsafe telegram

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: POWER ON

Cause:	The monitoring function enabled in p9301 and p9801 is not supported by the currently set PROFIsafe telegram (p9811). Note: This fault does not result in a safety stop response. Fault value (r0949, interpret bitwise binary): Bit 4 = 1: SS2ESR via PROFIsafe is not supported (p9301.4). Bit 18 = 1: SS2E via PROFIsafe is not supported (p9301.18). Bit 24 = 1: Transfer SLS limit value via PROFIsafe not supported (p9301.24). Bit 25 = 1: Transfer safe position (SP) via PROFIsafe is not supported (p9301.25). Bit 26 = 1: Gearbox stage switchover via PROFIsafe is not supported (p9301.26). Bit 28 = 1: SCA via PROFIsafe is not supported (p9301.28).
Remedy:	- deselect the monitoring function involved (p9301, p9801). - set the matching PROFIsafe telegram (p9811). Note: SCA: Safe Cam SI: Safety Integrated SLS: Safely-Limited Speed SP: Safe Position SS2E: Safe Stop 2 External (Safe Stop 2 with external stop, external STOP D) SS2ESR: Safe Stop 2 Extended Stop and Retract

230680 <location>SI Motion P2: Checksum error safety monitoring functions

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The actual checksum calculated by the Motor Module/Hydraulic Module and entered in r9398 via the safety-relevant parameters does not match the reference checksum saved in p9399 at the last machine acceptance. Safety-relevant parameters have been changed or a fault is present. Note: This fault results in a STOP A that can be acknowledged. Fault value (r0949, interpret decimal): 0: Checksum error for SI parameters for motion monitoring. 1: Checksum error for SI parameters for component assignment.
Remedy:	- check the safety-relevant parameters and if required, correct. - set the reference checksum to the actual checksum. - execute the function "Copy RAM to ROM". - perform a POWER ON if safety parameters requiring a POWER ON have been modified. - carry out an acceptance test.

230681 <location>SI Motion P1: Incorrect parameter value

Drive object:	HLA_828
Message value:	Parameter: %1, supplementary information: %2
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)

Cause: The parameter cannot be parameterized with this value.

Note:
 This message does not result in a safety stop response.
 Fault value (r0949, interpret decimal):
 yyyyxxxx dec: yyyy = supplementary information, xxxx = parameter
 yyyy = 0:
 No additional information available.
 xxxx = 9301:
 It is not permissible to enable the function "n < nx hysteresis and filtering" (p9301.16) in conjunction with the function "Extended functions without selection" (p9801.5).
 xxxx = 9301 and yyyy = 8:
 Referencing via SCC (p9301.27 = 1) is enabled without enabling absolute motion monitoring functions (p9301.1 or p9301.2).
 xxxx = 9301 and yyyy = 11:
 Safe function SS2E (p9301.18 = 1) is enabled without enabling PROFIsafe.
 xxxx = 9301 and yyyy = 14:
 "Synchronous safe position via PROFIsafe" is enabled (p9301.29 = 1), without enabling "Safe position via PROFIsafe" (p9301.25).
 xxxx = 9301 and yyyy = 17:
 "Synchronous safe position via PROFIsafe" is enabled (p9301.29 = 1) and "Safety without encoder" is enabled (p9306).
 xxxx = 9301 and yyyy = 19:
 SLA (p9301.20 = 1) is enabled with encoderless actual value sensing (p9306 equal to 1 or 3).
 xxxx = 9301 and yyyy = 20:
 SLA (p9301.20 = 1) is enabled with a 2-encoder system (p9326 not equal to 1).
 xxxx = 9801 and yyyy = 12: SCA (p9301.28 = 1) is enabled without enabling PROFIsafe.
 xxxx = 9334 or 9335:
 The limit values of SLP have been set too high (absolute values).
 xxxx = 9378:
 SLA is enabled (p9301.20 = 1). Acceleration limit is too low (p9378). Acceleration resolution is no longer sufficient (r9790) (the minimum limit is 3x the acceleration resolution r9790[0] in v5.1 / 10x the acceleration resolution r9790[1] from v5.2 and higher).
 xxxx = 9801 and yyyy = 1:
 If motion monitoring functions integrated in the drive (p9801.2 = 1) and extended functions without selection (p9801.5 = 1) are activated, then PROFIsafe (p9801.3 = 1) is not possible.
 xxxx = 9801 and yyyy = 2:
 Extended functions without selection (p9801.5 = 1) are enabled without enabling motion monitoring functions integrated in the drive (p9801.2).
 xxxx = 9801 and yyyy = 5:
 Transfer of the SLS limit value via PROFIsafe (p9301.24) has been enabled, without enabling PROFIsafe.
 xxxx = 9801 and yyyy = 6:
 Transfer of the safe position via PROFIsafe (p9301.25) has been enabled without enabling PROFIsafe.
 xxxx = 9801 and yyyy = 7:
 Safe switchover of the gearbox stages (p9301.26 = 1) has been enabled without enabling PROFIsafe.
 xxxx = 9801 and yyyy = 18:
 SLA (p9301.20 = 1) is enabled without enabling PROFIsafe.
 xxxx = 9801 and yyyy = 21:
 SS2ESR (p9301.4 = 1) is enabled without enabling PROFIsafe.

Remedy: Correct parameter (if required, also on another monitoring channel, p9601).

Note:
For different values in the two monitoring channels, start the copy function for SI parameters on the drive (p9700 = 57 hex).
For xxxx = 9301:
Correct parameters p9501.16 and p9301.16 or deselect the extended functions without selection (p9801.5).
For xxxx = 9301 and yyyy = 14:
Inhibit "Synchronous safe position via PROFIsafe" function (p9301.29 = 0), or enable "Safe position via PROFIsafe" (p9301.25).
For xxxx = 9301 and yyyy = 17:
Inhibit "Synchronous safe position via PROFIsafe" function (p9301.29 = 0), or set "Safety with encoder" (p9306).
For xxxx = 9301 and yyyy = 19:
Inhibit SLA (p9301.20) or activate actual value sensing with encoder (p9306 equal to 0 or 2).
For xxxx = 9301 and yyyy = 20:
Inhibit SLA (p9301.20) or activate a single-encoder system (p9326 equal to 1).
If xxxx = 9501 and yyyy = 8:
Inhibit referencing via SCC (p9501.27 = 1) or enable an absolute motion monitoring function (p9501.1 or p9501.2).
For xxxx = 9501 and yyyy = 11: inhibit SS2E (p9501.18) or enable PROFIsafe.
For xxxx = 9501 and yyyy = 12: inhibit SCA (p9501.28) or enable PROFIsafe.
For xxxx = 9317:
Further, p9316.0 should be checked.
If xxxx = 9334 or 9335:
Reduce the limit values (absolute values) of SLP.
For xxxx = 9378:
- observe the information in r9790.
For xxxx = 9801:
yyyy = 1:
Only enable motion monitoring functions integrated in the drive (p9801.2 = 1) and extended functions without selection (p9801.5 = 1) – or only PROFIsafe (p9801.3 = 1).
yyyy = 2:
Enable motion monitoring functions integrated in the drive (p9801.2 = 1).
yyyy = 5:
To transfer the SLS limit values via PROFIsafe (p9301.24 = 1), also enable PROFIsafe (p9801.3 = 1) and motion monitoring functions integrated in the drive (p9801.2 = 1).
yyyy = 6:
For the safe position via PROFIsafe (p9301.25 = 1), also enable PROFIsafe (p9801.3 = 1) and motion monitoring functions integrated in the drive (p9801.2 = 1).
yyyy = 7:
For safe switchover of gearbox stages (p9301.26 = 1) also enable PROFIsafe (p9801.3 = 1) and motion monitoring functions integrated in the drive (p9801.2 = 1).
yyyy = 18:
For Safely-Limited Acceleration monitoring (p9301.20 = 1), also enable PROFIsafe (p9801.3 = 1) and the motion monitoring functions integrated in the drive (p9801.2 = 1).
yyyy = 21:
For Safe Stop 2 Extended Stop and Retract (p9301.4), also enable PROFIsafe (p9801.3 = 1) and motion monitoring functions integrated in the drive (p9801.2 = 1).

230681 <location>SI Motion P1: Incorrect parameter value

Drive object: SERVO_828, SERVO_COMBI
Message value: Parameter: %1, supplementary information: %2
Reaction: OFF2
Acknowledge: IMMEDIATELY (POWER ON)

Cause:	The parameter cannot be parameterized with this value. Note: This message does not result in a safety stop response. Fault value (r0949, interpret decimal): yyyyxxx dec: yyyy = supplementary information, xxx = parameter yyyy = 0: No additional information available. xxxx = 9301: It is not permissible to enable the function "n < nx hysteresis and filtering" (p9301.16) in conjunction with the function "Extended functions without selection" (p9801.5). xxxx = 9301 and yyyy = 8: Referencing via SCC (p9301.27 = 1) is enabled without enabling absolute motion monitoring functions (p9301.1 or p9301.2). xxxx = 9301 and yyyy = 14: "Synchronous safe position via PROFIsafe" is enabled (p9301.29 = 1), without enabling "Safe position via PROFIsafe" (p9301.25). xxxx = 9301 and yyyy = 17: "Synchronous safe position via PROFIsafe" is enabled (p9301.29 = 1) and "Safety without encoder" is enabled (p9306). xxxx = 9301 and yyyy = 19: SLA (p9301.20 = 1) is enabled with encoderless actual value sensing (p9306 equal to 1 or 3). xxxx = 9301 and yyyy = 20: SLA (p9301.20 = 1) is enabled with a 2-encoder system (p9326 not equal to 1). xxxx = 9334 or 9335: The limit values of SLP have been set too high (absolute values). xxxx = 9347: The hysteresis tolerance is not permissible. xxxx = 9378: SLA is enabled (p9301.20 = 1). Acceleration limit is too low (p9378). The acceleration resolution is no longer sufficient (r9790). The minimum limit is 3x the acceleration resolution r9790[0] in v5.1 / 10x the acceleration resolution r9790[1] from v5.2 and higher. xxxx = 9385: For Safety without encoder and synchronous motor, p9385 must be set to 4. xxxx = 9801 and yyyy = 1: If motion monitoring functions integrated in the drive (p9801.2 = 1) and extended functions without selection (p9801.5 = 1) are activated, then PROFIsafe (p9801.3 = 1) is not possible. xxxx = 9801 and yyyy = 2: Extended functions without selection (p9801.5 = 1) are enabled without enabling motion monitoring functions integrated in the drive (p9801.2). xxxx = 9801 and yyyy = 3: Onboard F-DI are enabled without enabling motion monitoring functions integrated in the drive (p9801.2). xxxx = 9801 and yyyy = 5: Transfer of the SLS limit value via PROFIsafe (p9301.24) has been enabled, without enabling PROFIsafe. xxxx = 9801 and yyyy = 6: Transfer of the safe position via PROFIsafe (p9301.25) has been enabled without enabling PROFIsafe. xxxx = 9801 and yyyy = 7: Safe switchover of the gearbox stages (p9301.26 = 1) has been enabled without enabling PROFIsafe. xxxx = 9801 and yyyy = 11: SS2E (p9301.18 = 1) is enabled without enabling PROFIsafe. xxxx = 9801 and yyyy = 12: SCA (p9301.28 = 1) is enabled without enabling PROFIsafe. xxxx = 9801 and yyyy = 18: SLA (p9301.20 = 1) is enabled without enabling PROFIsafe. xxxx = 9801 and yyyy = 21:
---------------	--

SS2ESR (p9301.4 = 1) is enabled without enabling PROFIsafe.

Remedy: Correct parameter (if required, also on another monitoring channel, p9601).

Note:
For different values in the two monitoring channels, start the copy function for SI parameters on the drive (p9700 = 57 hex).
For xxxx = 9301:
Correct parameters p9501.16 and p9301.16 or deselect the extended functions without selection (p9801.5).
For xxxx = 9301 and yyyy = 14:
Inhibit "Synchronous safe position via PROFIsafe" function (p9301.29 = 0), or enable "Safe position via PROFIsafe" (p9301.25).
For xxxx = 9301 and yyyy = 17:
Inhibit "Synchronous safe position via PROFIsafe" function (p9301.29 = 0), or set "Safety with encoder" (p9306).
For xxxx = 9301 and yyyy = 19:
Inhibit SLA (p9301.20) or activate actual value sensing with encoder (p9306 equal to 0 or 2).
For xxxx = 9301 and yyyy = 20:
Inhibit SLA (p9301.20) or activate a single-encoder system (p9326 equal to 5).
If xxxx = 9501 and yyyy = 8:
Inhibit referencing via SCC (p9501.27 = 1) or enable an absolute motion monitoring function (p9501.1 or p9501.2).
For xxxx = 9317:
Further, p9316.0 should be checked.
If xxxx = 9334 or 9335:
Reduce the limit values (absolute values) of SLP.
For xxxx = 9347:
With hysteresis/filtering enabled (p9301.16 = 1), the following applies:
- set parameters p9346 and p9347 according to the following rule: $p9347 \leq 0.75 \times p9346$;
- the following rule must also be adhered to when actual value synchronization (p9301.3 = 1) is enabled: $p9347 \geq p9349$;
For xxxx = 9378:
- observe the information in r9790.
For xxxx = 9801:
yyyy = 1:
Only enable motion monitoring functions integrated in the drive (p9801.2 = 1) and extended functions without selection (p9801.5 = 1) – or only PROFIsafe (p9801.3 = 1).
yyyy = 2, 3:
Enable motion monitoring functions integrated in the drive (p9801.2 = 1).
yyyy = 5:
To transfer the SLS limit values via PROFIsafe (p9301.24 = 1), also enable PROFIsafe (p9801.3 = 1) and motion monitoring functions integrated in the drive (p9801.2 = 1).
yyyy = 6:
For the safe position via PROFIsafe (p9301.25 = 1), also enable PROFIsafe (p9801.3 = 1) and motion monitoring functions integrated in the drive (p9801.2 = 1).
yyyy = 7:
For safe switchover of gearbox stages (p9301.26 = 1) also enable PROFIsafe (p9801.3 = 1) and motion monitoring functions integrated in the drive (p9801.2 = 1).
yyyy = 18:
For Safely-Limited Acceleration monitoring (p9301.20 = 1), also enable PROFIsafe (p9801.3 = 1) and the motion monitoring functions integrated in the drive (p9801.2 = 1).
yyyy = 21:
For Safe Stop 2 Extended Stop and Retract (p9301.4), also enable PROFIsafe (p9801.3 = 1) and motion monitoring functions integrated in the drive (p9801.2 = 1).

230682 **<location>SI Motion P2: Monitoring function not supported**

Drive object: HLA_828

Message value: %1

Reaction: OFF2

Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The monitoring function enabled in p9301, p9501, p9601 or p9801 is not supported in this firmware version. Note: This message does not result in a safety stop response. Fault value (r0949, interpret decimal): 2: Monitoring function SCA not supported (p9301.7 and p9301.8 ... 15). 3: Monitoring function SLS override not supported (p9301.5). 6: Enable actual value synchronization not supported (p9301.3). 9: Monitoring function not supported by the firmware or enable bit not used. 12: This Control Unit does not support operation of safety functions with a higher-level control (e.g. SINUMERIK). 14: Monitoring function SLA and ncSI not supported. 30: The firmware version of the Hydraulic Module is older than the version of the Control Unit. 50: Shortening the switchover times for SOS (p9569/p9369, p9567/p9367) is not supported. 53: Function SS2E not supported (p9306 = 18). 54: SCA function not supported (p9301.28). 57: "Synchronous transfer safe position" function not supported (p9301.29). 58: "Safety limited acceleration" function (SLA) not supported (p9301.20).
Remedy:	- deselect the monitoring function involved (p9301, p9501, p9601, p9801). - upgrade the Hydraulic Module firmware. Note: SCA: Safe Cam / SN: Safe software cam SI: Safety Integrated SLS: Safely-Limited Speed / SG: Safely reduced speed SS2E: Safety Stop 2 external (external STOP D) See also: p9301, p9501, p9503, p9601, p9801, r9871

230682	<location>SI Motion P2: Monitoring function not supported
Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)

Cause:	The monitoring function enabled in p9301, p9501, p9601, p9801, p9306, p9506, p9307 or p9507 is not supported in this firmware version. Note: This message does not result in a safety stop response. Fault value (r0949, interpret decimal): 1: Monitoring function SLP not supported (p9301.1). 2: Monitoring function SCA not supported (p9301.7 and p9301.8 ... 15). 3: Monitoring function SLS override not supported (p9301.5). 4: Monitoring function external ESR activation not supported (p9301.4). 5: Monitoring function F-DI in PROFIsafe not supported (p9301.30). 6: Enable actual value synchronization not supported (p9301.3). 9: Monitoring function not supported by the firmware or enable bit not used. 12: This Control Unit does not support operation of safety functions with a higher-level control (e.g. SINUMERIK). 14: Monitoring function SLA and ncSI not supported. 24: Monitoring function SDI not supported. 26: Hysteresis and filtering for SSM monitoring function without an encoder not supported (p9301.16). 27: This hardware does not support onboard F-DI and F-DO. 30: The firmware version of the Motor Module is older than the version of the Control Unit. 33: Safety functions without selection not supported (p9601.5, p9801.5). 34: This module does not support safe position via PROFIsafe. 36: Function "SS1E" not supported. 39: This module or software version of the CU/MM does not support safe gearbox stage switchover (p9501.26). 44: this module/this software version does not support referencing via the Safety Control Channel (p9501.27). 45: Deactivating SOS/SLS during an external STOP A is not supported (p9301.23). 50: Shortening the switchover times for SOS (p9569/p9369, p9567/p9367) is not supported. 52: "SBR with encoder" function is not supported (p9306 = 2). 53: function SS2E not supported (p9301.18). 54: SCA function not supported (p9301.28). 57: "Synchronous transfer safe position via PROFIsafe" function not supported (p9301.29). 58: "SLA" function not supported (p9301.20).
Remedy:	- deselect monitoring function involved (p9301, p9501, p9601, p9801, p9307, p9507, p9506, p9306). - Upgrade the Motor Module firmware. Note: ESR: Extended Stop and Retract F-DI: Failsafe Digital Input SBR: Safe Brake Ramp (safe brake ramp monitoring) SCA: Safe Cam / SN: Safe software cam SDI: Safe Direction (safe motion direction) SI: Safety Integrated SLP: Safely-Limited Position / SE: Safe software limit switches SLS: Safely-Limited Speed / SG: Safely reduced speed SP: Safe Position SS1E: Safe Stop 1 External (Safe Stop 1 with external stop) SS2E: Safe Stop 2 External (Safe Stop 2 with external stop, external STOP D) See also: p9301, p9501, p9503, p9601, p9801, r9871

230683 **<location>SI Motion P2: SOS/SLS enable missing**

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)

Cause:	The safety-relevant basic function "SOS/SLS" is not enabled in p9301 although other safety-relevant monitoring functions are enabled. Note: This message does not result in a safety stop response.
Remedy:	Enable the function "SOS/SLS" (p9301.0) and carry out a POWER ON. Note: SI: Safety Integrated SLS: Safely-Limited Speed / SG: Safely reduced speed SOS: Safe Operating Stop / SBH: Safe operating stop See also: p9301 (SI Motion enable safety functions (Motor Module))

230684 <location>SI Motion P2: Safely-Limited Position limit values interchanged

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	For the function "Safely-Limited Position" (SLP), a lower value is in p9334 than in p9335. Note: This fault does not result in a safety stop response. Fault value (r0949, interpret decimal): 1: Limit values SLP1 interchanged. 2: Limit values SLP2 interchanged. See also: p9334, p9335
Remedy:	- correct the lower and upper limit values (p9335, p9334). - carry out a POWER ON (switch-off/switch-on). Note: SI: Safety Integrated SLP: Safely-Limited Position / SE: Safe software limit switches

230685 <location>SI Motion P2: Safely-Limited Speed limit value too high

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The limit value for the function "Safely-Limited Speed" (SLS) is greater than the speed that corresponds to an encoder limit frequency of 500 kHz. Note: This message does not result in a safety stop response. Fault value (r0949, interpret decimal): Maximum permissible speed.
Remedy:	Correct the limit values for SLS and carry out a POWER ON. Note: SI: Safety Integrated SLS: Safely-Limited Speed / SG: Safely reduced speed See also: p9331 (SI Motion SLS limit values (Motor Module))

230686 <location>SI Motion: Illegal parameterization cam position

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2

Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	At least one enabled "Safety Cam" (SCA) is parameterized in p9336 or p9337 too close to the tolerance range around the modulo position. - the minus position value of a cam must be greater than the lower modulo limit + cam tolerance (p9340) + position tolerance (p9342). - the plus position value of a cam must be less than the upper modulo limit - cam tolerance (p9340) - position tolerance (p9342). - when the modulo position is parameterized (p9305 > 0), the lower modulo limit = 0, the upper modulo limit = p9305. - the cam length of cam x = p9336[x] - p9337[x] is less than the cam tolerance + position tolerance (= p9340 + p9342). This also means that cams of the minus position value must be less than the plus position value. Note: This fault does not result in a safety stop response. Fault value (r0949, interpret decimal): Number of the "Safe Cam" with an illegal position. See also: p9501 (SI Motion enable safety functions (Control Unit))
Remedy:	Correct the cam position and carry out a POWER ON. Note: SCA: Safe Cam SI: Safety Integrated See also: p9536, p9537

230688 <location>SI Motion P2: Actual value synchronization not permissible

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	- it is not permissible to enable actual value synchronization for a 1-encoder system. - it is not permissible to simultaneously enable actual value synchronization and a monitoring function with absolute reference (SCA/SLP). - it is not permissible to simultaneously enable actual value synchronization and safe position via PROFIsafe. Note: This fault results in a STOP A that cannot be acknowledged.
Remedy:	- either deselect the "actual value synchronization" function or parameterize a 2-encoder system. - either deselect the function "actual value synchronization" or the monitoring functions with absolute reference (SCA/SLP) and carry out a POWER ON. - either deselect the "actual value synchronization" function or do not enable "Safe position via PROFIsafe". Note: SCA: Safe Cam / SN: Safe software cam SI: Safety Integrated SLP: Safely-Limited Position / SE: Safe software limit switches SP: Safe Position See also: p9501, p9526

230692 <location>SI Motion P2: Parameter value not permitted for encoderless

Drive object:	SERVO_828, SERVO_COMBI
Message value:	Parameter: %1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)

Cause:	The parameter cannot be parameterized with this value if encoderless motion monitoring functions have been parameterized in p9306. Note: This message does not result in a safety stop response. Fault value (r0949, interpret decimal): Parameter number with the incorrect value. See also: p9301 (SI Motion enable safety functions (Motor Module))
Remedy:	- correct the parameter specified in the fault value. - if necessary, deselect encoderless motion monitoring functions (p9306). See also: p9301, p9501

230693 <location>SI P2: Safety parameter settings changed, warm restart/POWER ON required

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	Safety parameters have been changed; these will only take effect following a warm restart or POWER ON. Alarm value (r2124, interpret decimal): Parameter number of the safety parameter which has changed, necessitating a warm restart or POWER ON.
Remedy:	- carry out a warm restart (p0009 = 30, p0976 = 2, 3). - carry out a POWER ON (switch-off/switch-on) for all components. Note: Before performing an acceptance test, a POWER ON must be carried out for all components.

230700 <location>SI Motion P2: STOP A initiated

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF2
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The drive is stopped via a STOP A (STO via the safety switch-off signal path of the Control Unit). Possible causes: - stop request from the Control Unit. - STO not active after parameterized time (p9357) after test stop selection. - subsequent response to the message C30706 "SI Motion MM: SAM/SBR limit exceeded". - subsequent response to the message C30714 "SI Motion MM: Safely-Limited Speed exceeded". - subsequent response to the message C30701 "SI Motion MM: STOP B initiated". - subsequent response to the message C01715 "SI Motion CU: Safely-Limited Position exceeded". - subsequent response to the message C30716 "SI Motion MM: tolerance for safe motion direction exceeded".

- Remedy:**
- remove the cause to the fault on the Control Unit.
 - check the value in p9357, if required, increase the value.
 - check the switch-off signal path of the Control Unit (check DRIVE-CLiQ communication).
 - carry out a diagnostics routine for message C30706.
 - carry out a diagnostics routine for message C30714.
 - carry out a diagnostics routine for message C30701.
 - carry out a diagnostics routine for message C30715.
 - carry out a diagnostics routine for message C30716.
 - replace the Motor Module, Power Module or Hydraulic Module.
 - replace Control Unit.

This message can be acknowledged without a POWER ON as follows (safe acknowledgment):

- Terminal Module 54F (TM54F).
- onboard F-DI (only CU310-2).
- PROFIsafe.
- machine control panel.

Note:

SAM: Safe Acceleration Monitor (safe acceleration monitoring)

SBR: Safe Brake Ramp (safe brake ramp monitoring)

SI: Safety Integrated

230701 <location>SI Motion P2: STOP B initiated

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE (OFF3)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The drive is stopped via a STOP B (braking along the OFF3 ramp).

As a result of this fault, after the time parameterized in p9356 has expired or after the speed threshold parameterized in p9360 has been fallen below, message C30700 "SI Motion MM: STOP A initiated" is output.

Possible causes:

- stop request from the Control Unit.
- subsequent response to the message C30714 "SI Motion MM: Safely-Limited Speed exceeded".
- subsequent response to the message C30711 "SI Motion MM: Defect in a monitoring channel".
- subsequent response to the message C30707 "SI Motion MM: tolerance for safe operating stop exceeded".
- subsequent response to the message C01715 "SI Motion CU: Safely-Limited Position exceeded".
- subsequent response to the message C30716 "SI Motion MM: tolerance for safe motion direction exceeded".

- Remedy:**
- remove the cause to the fault on the Control Unit.
 - carry out a diagnostics routine for message C30714.
 - carry out a diagnostics routine for message C30711.
 - carry out a diagnostics routine for message C30707.
 - carry out a diagnostics routine for message C30715.
 - carry out a diagnostics routine for message C30716.
- This message can be acknowledged without a POWER ON as follows (safe acknowledgment):
- Terminal Module 54F (TM54F).
 - onboard F-DI (only CU310-2).
 - PROFIsafe.
 - machine control panel.
- Note:**
- SI: Safety Integrated

230706 <location>SI Motion P2: SAM/SBR limit exceeded

Drive object: HLA_828

Message value:	-
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	Motion monitoring functions with encoder (p9306 = 0): - after initiating STOP B (SS1) or STOP C (SS2), the speed has exceeded the selected tolerance. The drive is shut down by the message C30700 "SI Motion MM: STOP A initiated".
Remedy:	Check the braking behavior and, if necessary, adapt the parameterization of the parameter settings of the "SAM" or the "SBR" function. This message can be acknowledged without a POWER ON as follows (safe acknowledgment): - Terminal Module 54F (TM54F). - onboard F-DI (only CU310-2). - PROFIsafe. - machine control panel. Note: SAM: Safe Acceleration Monitor (safe acceleration monitoring) SBR: Safe Brake Ramp (safe ramp monitoring) SI: Safety Integrated See also: p9348, p9381, p9382, p9383, p9548

230706	<location>SI Motion P2: SAM/SBR limit exceeded
Drive object:	SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	Motion monitoring functions with encoder (p9306 = 0) or encoderless with set acceleration monitoring (SAM, p9306 = 3): - after initiating STOP B (SS1) or STOP C (SS2), the speed has exceeded the selected tolerance. Motion monitoring functions encoderless with set brake ramp monitoring (SBR p9306 = 1): - after initiating STOP B (SS1) or SLS changeover to the lower speed level, the speed has exceeded the selected tolerance. The drive is shut down by the message C30700 "SI Motion MM: STOP A initiated".
Remedy:	Check the braking behavior and, if necessary, adapt the parameterization of the parameter settings of the "SAM" or the "SBR" function. This message can be acknowledged without a POWER ON as follows (safe acknowledgment): - Terminal Module 54F (TM54F). - onboard F-DI (only CU310-2). - PROFIsafe. - machine control panel. Note: SAM: Safe Acceleration Monitor (safe acceleration monitoring) SBR: Safe Brake Ramp (safe ramp monitoring) SI: Safety Integrated See also: p9348, p9381, p9382, p9383, p9548

230707	<location>SI Motion P2: Tolerance for safe operating stop exceeded
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The actual position has distanced itself further from the target position than the standstill tolerance. The drive is shut down by the message C30701 "SI Motion MM: STOP B initiated".

Remedy:

- check whether safety faults are present and if required carry out the appropriate diagnostic routines for the particular faults.
- check whether the standstill tolerance matches the accuracy and control dynamic performance of the axis.

This message can be acknowledged without a POWER ON as follows (safe acknowledgment):

- Terminal Module 54F (TM54F).
- onboard F-DI (only CU310-2).
- PROFIsafe.
- machine control panel.

Note:

SI: Safety Integrated
SOS: Safe Operating Stop / SBH: Safe operating stop
See also: p9530

230708 <location>SI Motion P2: STOP C initiated

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: STOP2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The drive is stopped via a STOP C (braking along the OFF3 ramp).
"Safe Operating Stop" (SOS) is activated after the parameterized time has expired.
Possible causes:

- stop request from the higher-level control.
 - subsequent response to the message C30714 "SI Motion MM: Safely-Limited Speed exceeded".
 - subsequent response to the message C01715 "SI Motion CU: Safely-Limited Position exceeded".
 - subsequent response to the message C30716 "SI Motion MM: tolerance for safe motion direction exceeded".
- See also: p9552 (SI Motion transition time STOP C to SOS (SBH) (Control Unit))

Remedy:

- remove the cause of the fault at the control.
- carry out a diagnostics routine for messages C30714, C30715, C30716.

This message can be acknowledged without a POWER ON as follows (safe acknowledgment):

- Terminal Module 54F (TM54F).
- onboard F-DI (only CU310-2).
- PROFIsafe.
- machine control panel.

Note:

SI: Safety Integrated
SOS: Safe Operating Stop / SBH: Safe operating stop

230709 <location>SI Motion P2: STOP D initiated

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The drive is stopped via a STOP D (braking along the path).
"Safe Operating Stop" (SOS) is activated after the parameterized time has expired.
Possible causes:

- stop request from the Control Unit.
- subsequent response to the message C30714 "SI Motion MM: Safely-Limited Speed exceeded".
- subsequent response to the message C01715 "SI Motion CU: Safely-Limited Position exceeded".
- subsequent response to the message C30716 "SI Motion MM: tolerance for safe motion direction exceeded".

See also: p9353 (SI Motion transition time STOP D to SOS (Motor Module)), p9553 (SI Motion transition time STOP D to SOS (SBH) (Control Unit))

Remedy:

- remove the cause of the fault at the control.
- carry out a diagnostics routine for messages C30714, C30715, C30716.

This message can be acknowledged without a POWER ON as follows (safe acknowledgment):

- Terminal Module 54F (TM54F).
- onboard F-DI (only CU310-2).
- PROFIsafe.
- machine control panel.

Note:

SI: Safety Integrated

SOS: Safe Operating Stop / SBH: Safe operating stop

230710 <location>SI Motion P2: STOP E initiated

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The drive is stopped via a STOP E (retraction motion).
 "Safe Operating Stop" (SOS) is activated after the parameterized time has expired.
 Possible causes:

- stop request from the higher-level control.
- subsequent response to the message C30714 "SI Motion MM: Safely-Limited Speed exceeded".
- subsequent response to the message C01715 "SI Motion CU: Safely-Limited Position exceeded".
- subsequent response to the message C30716 "SI Motion MM: tolerance for safe motion direction exceeded".

See also: p9354 (SI Motion transition time STOP E to SOS (Motor Module)), p9554 (SI Motion transition time STOP E to SOS (SBH) (Control Unit))

Remedy:

- remove the cause of the fault at the control.
- carry out a diagnostics routine for messages C30714, C30715, C30716.

This message can be acknowledged without a POWER ON as follows (safe acknowledgment):

- Terminal Module 54F (TM54F).
- onboard F-DI (only CU310-2).
- PROFIsafe.
- machine control panel.

Note:

SI: Safety Integrated

SOS: Safe Operating Stop / SBH: Safe operating stop

230711 <location>SI Motion P2: Defect in a monitoring channel

Drive object: HLA_828

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: When cross-comparing the two monitoring channels, the drive detected a difference between the input data or results of the monitoring functions and initiated a STOP F. One of the monitoring functions no longer reliably functions - i.e. safe operation is no longer possible.

If at least one monitoring function is active, then after the parameterized timer has expired, the message C30701 "SI Motion: STOP B initiated" is output. The message is output with message value 1031 when the Sensor Module hardware is replaced. The following message values may also occur in the following cases if the cause that is explicitly mentioned does not apply:

- differently parameterized cycle times (p9500/p9300, p9511/p9311).
- excessively fast cycle times (p9500/p9300, p9511/p9311).
- incorrect synchronization.

Message value (r9749, interpret decimal):

0 ... 999:

Number of the cross-compared data that resulted in this message.

The significance of the individual message values is described in safety message C01711 of the Control Unit.

1000: Watchdog timer has expired. Too many signal changes have occurred at safety-relevant inputs.

1001: Initialization error of watchdog timer.

1002:

User agreement after the timer has expired different.

The user agreement is not consistent. After a time of 4 s has expired, the status of the user agreement is different in both monitoring channels.

1003: Reference tolerance exceeded. When the user agreement is set, the difference between the new reference point that has been determined after power up (absolute encoder) or reference point approach (distance-coded or incremental measuring system) and the safe actual position (saved value + traversing distance) is greater than the reference tolerance (p9344). In this case, the user agreement is withdrawn.

1004:

Plausibility error for user agreement.

1. If the user agreement has already been set, then the setting is initiated again. In this case, the user agreement is withdrawn.
2. The user agreement was set, although the axis has still not been referenced.

1005: STO already active for test stop selection.

1011: Acceptance test status between the monitoring channels differ.

1012: Plausibility violation of the encoder actual value.

1014: fault when synchronizing the SGA for the "Safe cam" function

1015: Gearbox switchover (bit 27 in PROFIsafe telegram) takes longer than 2 min.

1020: Cyc. communication failure between the monit. channels.

1021: Cyc. communication failure between the monit. channel and Sensor Module.

1023: Error in the effectiveness test in the DRIVE-CLiQ encoder.

1024: Sign-of-life error for HTL/TTL encoders.

1030: Encoder fault detected from another monitoring channel.

1031:

- data transfer error between the monitoring channel and the Sensor Module (p9526/p9326).
- the Sensor Module for the second channel was replaced.
- the encoder for the second channel has been incorrectly parameterized.

1045: CRC of the standstill position incorrect.

5000 ... 5140:

PROFIsafe message values.

For these message values, the failsafe control signals (Failsafe Values) are transferred to the safety functions. The significance of the individual message values is described in safety message C01711 of the Control Unit.

6000 ... 6166:

PROFIsafe message values (PROFIsafe driver for PROFIBUS DP V1/V2 and PROFINET).

For these message values, the failsafe control signals (Failsafe Values) are transferred to the safety functions. The significance of the individual message values is described in safety fault F01611 of the Control Unit.

7000 ... 7002:

Message values of the "Safe position via PROFIsafe" function.

See also: p9555 (SI Motion transition time STOP F to STOP B (Control Unit)), r9725 (SI Motion diagnostics STOP F)

Remedy:

For message value = 1002:

- perform safe acknowledgment, set the user agreement in both monitoring channels simultaneously (within 4 s).

For message value = 1003:

- check the mechanical system of the axis. It is possible that the axis was shifted when switched-off, and the last saved actual position no longer corresponds with the new actual position after the system has been powered up again.
- increase the tolerance for the actual value comparison when referencing (p9344).

Then check the actual values, perform a POWER ON and set the user agreement again.

For message value = 1004:

For 1., the following applies: Perform safe acknowledgment. Set the user agreement again.

For 2., the following applies: Perform safe acknowledgment. Only set the user agreement again if the axis has been referenced.

For message value = 1005:

- check the conditions for deselecting STO.

For message value = 1012:

- upgrade the Sensor Module firmware to a more recent version.
- for 1-encoder systems, the following applies: check the encoder parameters for equality (p9515/p9315, p9519/p9319, p9523/p9323, p9524/p9324, p9525/p9325, p9529/p9329).
- for a 1-encoder system and 2-encoder system the following applies: in order to correctly copy the encoder parameters from p04xx, p9700 must be set to 46 and p9701 must be set to 172.
- for DQI encoders the following applies: If required, upgrade the firmware version of the Control Unit to a more recent version, which is released for DQI encoders.
- the parameterized encoder does not correspond to the connected encoder - replace the encoder.
- check the electrical cabinet design and cable routing for EMC compliance
- carry out a POWER ON (switch-off/switch-on) for all components or a warm restart (p0009 = 30, p0976 = 2, 3).
- replace the hardware.

For message value = 1014:

- check the encoder actual values. If required, increase the position tolerance (p9342) and/or the cam tolerance (p9340).

For message value = 1024:

- check the communication link.
- increase the monitoring cycle clock settings (p9500, p9511).
- carry out a POWER ON (switch-off/switch-on) for all components.
- replace the hardware.

For message value = 1030:

- check the encoder connection.
- if required, replace the encoder.

For message value = 1031:

When replacing a Sensor Module, carry out the following steps:

- start the copy function for the node identifier on the drive (p9700 = 1D hex).
- acknowledge the hardware CRC on the drive (p9701 = EC hex).
- save all parameters (p0977 = 1).
- carry out a POWER ON (switch-off/switch-on) for all components.

Adapt the encoder parameterization for the second channel as follows:

- set the encoder type (p0400).
- activate the safety commissioning mode (p0010 = 95).
- start the copy function for encoder parameters (p9700 = 46).
- exit the safety commissioning mode (p0010 = 0).
- save the parameters in a non-volatile fashion (copy RAM to ROM).
- carry out a POWER ON (switch-off/switch-on) for all components.

The following always applies:

- check the encoder connection.
- if required, replace the encoder.

For message value = 6000 ... 6999:

- the significance of the individual message values is described in safety fault F01611 of the Control Unit.

For other message values:

- the significance of the individual message values is described in safety message C01711.

Note:

This message can be acknowledged via the Terminal Module 54F (TM54F) or PROFIsafe.

See also: p9300 (SI Motion monitoring clock cycle (Motor Module)), p9500 (SI Motion monitoring clock cycle (Control Unit))

230711 <location>SI Motion P2: Defect in a monitoring channel

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

- Cause:** When cross-comparing the two monitoring channels, the drive detected a difference between the input data or results of the monitoring functions and initiated a STOP F. One of the monitoring functions no longer reliably functions - i.e. safe operation is no longer possible.
- If at least one monitoring function is active, then after the parameterized timer has expired, the message C30701 "SI Motion: STOP B initiated" is output. The message is output with message value 1031 when the Sensor Module hardware is replaced. The following message values may also occur in the following cases if the cause that is explicitly mentioned does not apply:
- differently parameterized cycle times (p9500/p9300, p9511/p9311).
 - differently parameterized axis types (p9502/p9302).
 - excessively fast cycle times (p9500/p9300, p9511/p9311).
 - incorrect synchronization.
- Message value (r9749, interpret decimal):
- 0 ... 999:
- Number of the cross-compared data that resulted in this message.
- The significance of the individual message values is described in safety message C01711 of the Control Unit.
- 1000: Watchdog timer has expired. Too many signal changes have occurred at safety-relevant inputs.
- 1001: Initialization error of watchdog timer.
- 1002:
- User agreement after the timer has expired different.
- The user agreement is not consistent. After a time of 4 s has expired, the status of the user agreement is different in both monitoring channels.
- 1003: Reference tolerance exceeded. When the user agreement is set, the difference between the new reference point that has been determined after power up (absolute encoder) or reference point approach (distance-coded or incremental measuring system) and the safe actual position (saved value + traversing distance) is greater than the reference tolerance (p9344). In this case, the user agreement is withdrawn.
- 1004:
- Plausibility error for user agreement.
1. If the user agreement has already been set, then the setting is initiated again. In this case, the user agreement is withdrawn.
 2. The user agreement was set, although the axis has still not been referenced.
- 1005:
- for safe motion monitoring functions without encoder: pulses already suppressed for test stop selection.
 - for safe motion monitoring functions with encoder: STO already active for test stop selection.
- 1011: Acceptance test status between the monitoring channels differ.
- 1012: Plausibility violation of the encoder actual value.
- 1014: fault when synchronizing the SGA for the "Safe cam" function
- 1015: Gearbox switchover (bit 27 in PROFIsafe telegram) takes longer than 2 min.
- 1020: Cyc. communication failure between the monit. channels.
- 1021: Cyc. communication failure between the monit. channel and Sensor Module.
- 1023: Error in the effectiveness test in the DRIVE-CLiQ encoder.
- 1024: Sign-of-life error for HTL/TTL encoders.
- 1030: Encoder fault detected from another monitoring channel.
- 1031:
- data transfer error between the monitoring channel and the Sensor Module (p9526/p9326).
 - the Sensor Module for the second channel was replaced.
 - the encoder for the second channel has been incorrectly parameterized.
- 1040: Pulses suppressed with active encoderless monitoring functions.
- 1041: Current absolute value too low (encoderless)
- 1042: Current/voltage plausibility error
- 1043: Too many acceleration phases
- 1044: Current actual values plausibility error.
- 1045: CRC of the standstill position incorrect.
- 5000 ... 5140:
- PROFIsafe message values.
- For these message values, the failsafe control signals (Failsafe Values) are transferred to the safety functions.

The significance of the individual message values is described in safety message C01711 of the Control Unit.

6000 ... 6166:

PROFIsafe message values (PROFIsafe driver for PROFIBUS DP V1/V2 and PROFINET).

For these message values, the failsafe control signals (Failsafe Values) are transferred to the safety functions. If "STOP B after failure of the PROFIsafe communication" (p9812) is parameterized, the transfer of the Failsafe Values is delayed.

The significance of the individual message values is described in safety fault F01611 of the Control Unit.

7000: Difference of the safe position is greater than the parameterized tolerance (p9542/p9342).

7001: Scaling value for the safe position in the 16 bit notation, too low (p9574/p9374).

7002: Cycle counter for transferring the safe position is different in both monitoring channels.

See also: p9555 (SI Motion transition time STOP F to STOP B (Control Unit)), r9725 (SI Motion diagnostics STOP F)

Remedy:

For message value = 1002:

- perform safe acknowledgment, set the user agreement in both monitoring channels simultaneously (within 4 s).

For message value = 1003:

- check the mechanical system of the axis. It is possible that the axis was shifted when switched-off, and the last saved actual position no longer corresponds with the new actual position after the system has been powered up again.
- increase the tolerance for the actual value comparison when referencing (p9344).

Then check the actual values, perform a POWER ON and set the user agreement again.

For message value = 1004:

For 1., the following applies: Perform safe acknowledgment. Set the user agreement again.

For 2., the following applies: Perform safe acknowledgment. Only set the user agreement again if the axis has been referenced.

For message value = 1005:

- for safe motion monitoring functions without encoder: check the conditions for pulse enable.
- for safe motion monitoring functions with encoder: check the conditions for STO deselection.

Note:

For a Power Module, the test stop should always be performed when the pulses are enabled (independent of whether with encoder or without encoder).

For message value = 1012:

- upgrade the Sensor Module firmware to a more recent version.
- for 1-encoder systems, the following applies: check the encoder parameters for equality (p9515/p9315, p9519/p9319, p9523/p9323, p9524/p9324, p9525/p9325, p9529/p9329).
- for a 1-encoder system and 2-encoder system the following applies: in order to correctly copy the encoder parameters from p04xx, p9700 must be set to 46 and p9701 must be set to 172.
- for DQI encoders the following applies: If required, upgrade the firmware version of the Control Unit to a more recent version, which is released for DQI encoders.
- the parameterized encoder does not correspond to the connected encoder - replace the encoder.
- check the electrical cabinet design and cable routing for EMC compliance
- carry out a POWER ON (switch-off/switch-on) for all components or a warm restart (p0009 = 30, p0976 = 2, 3).
- replace the hardware.

For message value = 1014:

- check the encoder actual values. If required, increase the position tolerance (p9342) and/or the cam tolerance (p9340).

For message value = 1024:

- check the communication link.
- if required, increase the monitoring cycle clock settings (p9500, p9511).
- carry out a POWER ON (switch-off/switch-on) for all components.
- replace the hardware.

For message value = 1030:

- check the encoder connection.
- if required, replace the encoder.

For message value = 1031:

When replacing a Sensor Module, carry out the following steps:

- start the copy function for the node identifier on the drive (p9700 = 1D hex).
- acknowledge the hardware CRC on the drive (p9701 = EC hex).
- save all parameters (p0977 = 1).
- carry out a POWER ON (switch-off/switch-on) for all components.

Adapt the encoder parameterization for the second channel as follows:

- set the encoder type (p0400).
- activate the safety commissioning mode (p0010 = 95).
- start the copy function for encoder parameters (p9700 = 46).
- exit the safety commissioning mode (p0010 = 0).
- save the parameters in a non-volatile fashion (copy RAM to ROM).
- carry out a POWER ON (switch-off/switch-on) for all components.

The following always applies:

- check the encoder connection.
- if required, replace the encoder.

For message value = 1040:

- deselect encoderless monitoring functions, select and deselect STO.
- if monitoring function "SLS" is active, issue a pulse enable within 5 s of deselecting STO.

For message value = 6000 ... 6999:

- the significance of the individual message values is described in safety fault F01611 of the Control Unit.

For other message values:

- the significance of the individual message values is described in safety message C01711.

This message can be acknowledged without a POWER ON as follows (safe acknowledgment):

- Terminal Module 54F (TM54F).
- onboard F-DI (only CU310-2).
- PROFIsafe.
- machine control panel.

See also: p9300 (SI Motion monitoring clock cycle (Motor Module)), p9500 (SI Motion monitoring clock cycle (Control Unit))

230712 <location>SI Motion P2: Defect in F-IO processing

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: When cross checking and comparing the two monitoring channels, the drive detected a difference between parameters or results of the F-IO processing and initiated a STOP F. One of the monitoring functions no longer reliably functions - i.e. safe operation is no longer possible.

The safety message C30711 with message value 0 is also displayed due to initiation of STOP F.

If at least one monitoring function is active, the safety message C30701 "SI Motion: STOP B initiated" is output after the parameterized timer has expired.

Message value (r9749, interpret decimal):

Number of the cross-compared data that resulted in this message.

Refer to the description of the message values in safety message C01712.

Remedy:

- check parameterization in the parameters involved and correct if required.
- ensure equality by copying the SI data to the second channel and then carry out an acceptance test.
- check monitoring clock cycle for equality (p9500, p9300).

This message can be acknowledged without a POWER ON as follows (safe acknowledgment):

- onboard F-DI (only CU310-2).
- PROFIsafe.
- machine control panel.

See also: p9300 (SI Motion monitoring clock cycle (Motor Module)), p9500 (SI Motion monitoring clock cycle (Control Unit))

230714 <location>SI Motion P2: Safely-Limited Speed exceeded

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The drive had moved faster than that specified by the velocity limit value (p9331). The drive is stopped as a result of the configured stop response (p9363).

Message value (r9749, interpret decimal):

- 100: SLS1 exceeded.
- 200: SLS2 exceeded.
- 300: SLS3 exceeded.
- 400: SLS4 exceeded.
- 1000: Encoder limit frequency exceeded.

Remedy:

- check the traversing/motion program in the control.
- check the limits for "SLS" function and if required, adapt (p9331).

This message can be acknowledged without a POWER ON as follows (safe acknowledgment):

- Terminal Module 54F (TM54F).
- onboard F-DI (only CU310-2).
- PROFIsafe.
- machine control panel.

Note:

SI: Safety Integrated

SLS: Safely-Limited Speed / SG: Safely reduced speed

See also: p9331 (SI Motion SLS limit values (Motor Module)), p9363 (SI Motion SLS stop response (Motor Module))

230715 <location>SI Motion P2: Safely-Limited Position exceeded

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The axis has moved past a parameterized position that is monitored by the "SLP" function.
 Message value (r9749, interpret decimal):
 10: SLP1 violated.
 20: SLP2 violated.

Remedy:

- check the traversing/motion program in the control.
- check the limits for "SLP" function and if required, adapt (p9534, p9535).

This message can be acknowledged without a POWER ON as follows (safe acknowledgment):

Prerequisite:

- deselect "SLP" function and retract the axis into the permitted position range.

Carry out a safe acknowledgment using one of the following options:

- Terminal Module 54F (TM54F).
- onboard F-DI (only CU310-2).
- PROFIsafe.
- machine control panel.

Note:

SI: Safety Integrated

SLP: Safely-Limited Position / SE: Safe software limit switches

See also: p9334, p9335

230716 <location>SI Motion P2: Tolerance for safe motion direction exceeded

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The tolerance for the "safe motion direction" function was exceeded. The drive is stopped as a result of the configured stop response (p9366).
 Message value (r9749, interpret decimal):
 0: Tolerance for the "safe motion direction positive" function exceeded.
 1: Tolerance for the "safe motion direction negative" function exceeded.

Remedy:

- check the traversing/motion program in the control.
- check the tolerance for "SDI" function and if required, adapt (p9364).

This message can be acknowledged without a POWER ON as follows (safe acknowledgment):

Prerequisite:

- deselect the "SDI" function and if required select again.

Carry out a safe acknowledgment using one of the following options:

- Terminal Module 54F (TM54F).
- onboard F-DI (only CU310-2).
- PROFIsafe.
- machine control panel.

Note:

SDI: Safe Direction (safe motion direction)

SI: Safety Integrated

See also: p9364, p9365, p9366

230717 <location>SI Motion P2: SLA limit exceeded

Drive object: SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The acceleration limit for the "Safely-Limited Acceleration" function was exceeded. The drive is stopped as a result of the configured stop response (p9379).

Message value (r9749, interpret decimal):

0: The monitoring of the coarsely resolved acceleration has violated the acceleration limit.

1: The monitoring of the finely resolved acceleration and possibly filtered acceleration has violated the acceleration limit.

Remedy:

- check the traversing/motion program in the control.
- check the acceleration limit for the "SLA" function and if required, adapt (p9378).
- carry out a safe acknowledgment.

For message value = 0:

Analyze the causes using r9714[0] and r9714[3].

For message value = 1:

Analyze the causes using r9789[0], r9789[1] and r9789[2].

Note:

SI: Safety Integrated

SLA: Safely-Limited Acceleration

See also: p9378 (SI Motion SLA acceleration limit (MM)), p9379 (SI Motion SLA stop response (Motor Module))

230730 <location>SI Motion P2: Reference block for dynamic Safely-Limited Speed invalid

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The reference block transferred via PROFIsafe is negative.

A reference block is used to generate a referred velocity limit value based on the reference quantity "Velocity limit value SLS1" (p9331[0]).

The drive is stopped as a result of the configured stop response (p9363[0]).

Message value (r9749, interpret decimal):

requested, invalid reference block.

Remedy: In the PROFIsafe telegram, input data S_SLS_LIMIT_IJT must be corrected.
 This message can be acknowledged without a POWER ON as follows (safe acknowledgment):
 - PROFIsafe.
Note:
 SI: Safety Integrated
 SLS: Safely-Limited Speed

230788 <location>Automatic test stop: wait for STO deselection via SMM

Drive object: HLA_828, SERVO_828, SERVO_COMBI
Message value: -
Reaction: NONE
Acknowledge: NONE
Cause: The automatic test stop was not able to be carried out after powering up.
 Possible causes:
 - the STO function is selected via Safety Extended Functions.
 - a safety message is present, that resulted in a STO.
Note:
 STO: Safe Torque Off
Remedy: - Deselect STO via Safety Extended Functions.
 - remove the cause of the safety messages and acknowledge the messages.
Note:
 The automatic test stop is performed after removing the cause.

230797 <location>SI Motion P2: Axis not safely referenced

Drive object: HLA_828, SERVO_828, SERVO_COMBI
Message value: %1
Reaction: NONE
Acknowledge: IMMEDIATELY (POWER ON)
Cause: The standstill position saved before switching off does not match the actual position determined at switch-on.
 Message value (r9749, interpret decimal):
 1: Axis not safely referenced.
 2: User agreement missing.
Remedy: If safe automatic referencing is not possible the user must issue a user agreement for the new position using the softkey.
 This mean that this position is then designated as safety-relevant.
Note:
 SI: Safety Integrated

230798 <location>SI Motion P2: Test stop for motion monitoring functions running

Drive object: HLA_828, SERVO_828, SERVO_COMBI
Message value: -
Reaction: NONE
Acknowledge: IMMEDIATELY (POWER ON)
Cause: The forced checking procedure (test stop) for the safe motion monitoring functions is currently in progress.
Remedy: Not necessary.
 The message is automatically withdrawn when the test stop has been completed.
Note:
 SI: Safety Integrated

230799 <location>SI Motion P2: Acceptance test mode active

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value:	-
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The acceptance test mode is active. This means the following: - the setpoint velocity limiting is deactivated (r9733). - the standard limit switches are deactivated during the acceptance test for function SLP (for EPOS internal, otherwise via r10234).
Remedy:	Not necessary. The message is automatically withdrawn when exiting the acceptance test mode. Note: SI: Safety Integrated SLP: Safely-Limited Position

230800 <location>Power unit: Group signal

Drive object:	All objects
Message value:	-
Reaction:	OFF2
Acknowledge:	NONE
Cause:	The power unit has detected at least one fault.
Remedy:	Evaluate the other messages that are presently available.

230801 <location>Power unit DRIVE-CLiQ: Sign-of-life missing

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Control Unit to the power unit concerned. The computing time load might be too high. Fault cause: 10 (= 0A hex): The sign-of-life bit in the receive telegram is not set. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- deselect functions that are not required. - if required, increase the sampling times (p0112, p0115). - replace the component involved (power unit, Control Unit).

230802 <location>Power unit: Time slice overflow

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	A time slice overflow has occurred. Fault value (r0949, interpret decimal): xx: time slice number
Remedy:	- carry out a POWER ON (switch-off/switch-on) for all components. - upgrade firmware to later version. - contact Technical Support.

230804 <location>Power unit: CRC**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:**
Infeed: OFF2 (OFF1)
Servo: OFF2 (OFF1, OFF3)
Hla: OFF2 (OFF1, OFF3)**Acknowledge:** IMMEDIATELY**Cause:** A checksum error (CRC error) has occurred for the power unit.**Remedy:**
- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade firmware to later version.
- contact Technical Support.

230805 <location>Power unit: EEPROM checksum error**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:** OFF2**Acknowledge:** IMMEDIATELY**Cause:**
Internal parameter data is corrupted.
Fault value (r0949, interpret decimal):
01: EEPROM access error.
02: Too many blocks in the EEPROM.
03: Safety EEPROM data error.

...

20: Safety EEPROM data error.

Remedy: Replace the power unit involved.

230809 <location>Power unit: Switching information not valid**Drive object:** A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** -**Reaction:** OFF2**Acknowledge:** IMMEDIATELY**Cause:**
For 3P gating unit, the following applies:
The last switching status word in the setpoint telegram is identified by the end ID. Such an end ID was not found.**Remedy:**
- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade firmware to later version.
- contact Technical Support.

230810 <location>Power unit: Watchdog timer**Drive object:** A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** -**Reaction:** NONE**Acknowledge:** NONE**Cause:** When booting it was detected that the cause of the previous reset was an SAC watchdog timer overflow.**Remedy:**
- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade firmware to later version.
- contact Technical Support.

230820 <location>Power unit DRIVE-CLiQ: Telegram error**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value:	Component number: %1, fault cause: %2
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Control Unit to the power unit concerned. Fault cause: 1 (= 01 hex): Checksum error (CRC error). 2 (= 02 hex): Telegram is shorter than specified in the length byte or in the receive list. 3 (= 03 hex): Telegram is longer than specified in the length byte or in the receive list. 4 (= 04 hex): The length of the receive telegram does not match the receive list. 5 (= 05 hex): The type of the receive telegram does not match the receive list. 6 (= 06 hex): The address of the component in the telegram and in the receive list do not match. 7 (= 07 hex): A SYNC telegram is expected - but the received telegram is not a SYNC telegram. 8 (= 08 hex): No SYNC telegram is expected - but the received telegram is one. 9 (= 09 hex): The error bit in the receive telegram is set. 16 (= 10 hex): The receive telegram is too early. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON (switch-off/switch-on). - check the electrical cabinet design and cable routing for EMC compliance - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

230835 <location>Power unit DRIVE-CLiQ: Cyclic data transfer error

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Control Unit to the power unit concerned. The nodes do not send and receive in synchronism. Fault cause: 33 (= 21 hex): The cyclic telegram has not been received. 34 (= 22 hex): Timeout in the telegram receive list. 64 (= 40 hex): Timeout in the telegram send list. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON. - replace the component involved (power unit, Control Unit).

230836	<location>Power unit DRIVE-CLiQ: Send error for DRIVE-CLiQ data
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Control Unit to the power unit concerned. Data were not able to be sent. Fault cause: 65 (= 41 hex): Telegram type does not match send list. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON.
230837	<location>Power unit DRIVE-CLiQ: Component fault
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded. Fault cause: 32 (= 20 hex): Error in the telegram header. 35 (= 23 hex): Receive error: The telegram buffer memory contains an error. 66 (= 42 hex): Send error: The telegram buffer memory contains an error. 67 (= 43 hex): Send error: The telegram buffer memory contains an error. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...). - check the electrical cabinet design and cable routing for EMC compliance - if required, use another DRIVE-CLiQ socket (p9904). - replace the component involved.
230845	<location>Power unit DRIVE-CLiQ: Cyclic data transfer error
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Control Unit to the power unit concerned. Fault cause: 11 (= 0B hex): Synchronization error during alternating cyclic data transfer. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause

Remedy: Carry out a POWER ON (switch-off/switch-on).

230850 <location>Power unit: Internal software error

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction:
Infeed: OFF1 (NONE, OFF2)
Servo: OFF1 (NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: POWER ON

Cause:
An internal software error has occurred in the power unit.
Fault value (r0949, interpret decimal):
Only for internal Siemens troubleshooting.

Remedy:
- replace power unit.
- if required, upgrade the firmware in the power unit.
- contact Technical Support.

230851 <location>Power unit DRIVE-CLiQ (CU): Sign-of-life missing

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: Component number: %1, fault cause: %2

Reaction:
Infeed: OFF2 (NONE, OFF1)
Servo: OFF2 (NONE, OFF1, OFF3)
Hla: OFF2 (NONE, OFF1, OFF3)

Acknowledge: IMMEDIATELY

Cause:
A DRIVE-CLiQ communication error has occurred from the power unit to the Control Unit involved.
The DRIVE-CLiQ component did not set the sign-of-life to the Control Unit.
Fault cause:
10 (= 0A hex):
The sign-of-life bit in the receive telegram is not set.
Note regarding the message value:
The individual information is coded as follows in the message value (r0949/r2124):
0000yyxx hex: yy = component number, xx = error cause

Remedy:
- deselect functions that are not required.
- if required, increase the sampling times (p0112, p0115).
- replace the component involved (power unit, Control Unit).

230853 <location>Power unit: Sign-of-life error cyclic data

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause:
The power unit has detected that the cyclic setpoint telegrams of the Control Unit have not been updated on time. At least two sign-of-life errors have occurred within the window set in p7788.

Remedy:
- reduce the size of the window (p7788) for monitoring.
- check the Motor Module, and if required replace.

230860 <location>Power unit DRIVE-CLiQ (CU): Telegram error

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: Component number: %1, fault cause: %2

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause:	A DRIVE-CLiQ communication error has occurred from the power unit to the Control Unit involved. Fault cause: 1 (= 01 hex): Checksum error (CRC error). 2 (= 02 hex): Telegram is shorter than specified in the length byte or in the receive list. 3 (= 03 hex): Telegram is longer than specified in the length byte or in the receive list. 4 (= 04 hex): The length of the receive telegram does not match the receive list. 5 (= 05 hex): The type of the receive telegram does not match the receive list. 6 (= 06 hex): The address of the power unit in the telegram and in the receive list do not match. 9 (= 09 hex): The DRIVE-CLiQ communication from the DRIVE-CLiQ component involved to the Control Unit signals that the supply voltage has failed. 16 (= 10 hex): The receive telegram is too early. 17 (= 11 hex): CRC error and the receive telegram is too early. 18 (= 12 hex): The telegram is shorter than that specified in the length byte or in the receive list and the receive telegram is too early. 19 (= 13 hex): The telegram is longer than that specified in the length byte or in the receive list and the receive telegram is too early. 20 (= 14 hex): The length of the receive telegram does not match the receive list and the receive telegram is too early. 21 (= 15 hex): The type of the receive telegram does not match the receive list and the receive telegram is too early. 22 (= 16 hex): The address of the power unit in the telegram and in the receive list does not match and the receive telegram is too early. 25 (= 19 hex): The error bit in the receive telegram is set and the receive telegram is too early. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON (switch-off/switch-on). - check the electrical cabinet design and cable routing for EMC compliance - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

230875	<location>Power unit: power supply voltage failed
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF2
Acknowledge:	IMMEDIATELY

Cause:	The DRIVE-CLiQ communication from the DRIVE-CLiQ component involved to the Control Unit signals that the supply voltage has failed. Fault cause: 9 (= 09 hex): The power supply voltage for the components has failed. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON (switch-off/switch-on). - check the power supply voltage wiring for the DRIVE-CLiQ component (interrupted cable, contacts, ...). - check the dimensioning of the power supply for the DRIVE-CLiQ component.

230885 <location>CU DRIVE-CLiQ (CU): Cyclic data transfer error

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the power unit to the Control Unit involved. The nodes do not send and receive in synchronism. Fault cause: 26 (= 1A hex): Sign-of-life bit in the receive telegram not set and the receive telegram is too early. 33 (= 21 hex): The cyclic telegram has not been received. 34 (= 22 hex): Timeout in the telegram receive list. 64 (= 40 hex): Timeout in the telegram send list. 98 (= 62 hex): Error at the transition to cyclic operation. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the power supply voltage of the component involved. - carry out a POWER ON. - replace the component involved.

230886 <location>PU DRIVE-CLiQ (CU): Error when sending DRIVE-CLiQ data

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the power unit to the Control Unit involved. Data were not able to be sent. Fault cause: 65 (= 41 hex): Telegram type does not match send list. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON.

230887	<location>Power unit DRIVE-CLiQ (CU): Component fault
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	Fault detected on the DRIVE-CLiQ component (power unit) involved. Faulty hardware cannot be excluded. Fault cause: 32 (= 20 hex): Error in the telegram header. 35 (= 23 hex): Receive error: The telegram buffer memory contains an error. 66 (= 42 hex): Send error: The telegram buffer memory contains an error. 67 (= 43 hex): Send error: The telegram buffer memory contains an error. 96 (= 60 hex): Response received too late during runtime measurement. 97 (= 61 hex): Time taken to exchange characteristic data too long. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...). - check the electrical cabinet design and cable routing for EMC compliance - if required, use another DRIVE-CLiQ socket (p9904). - replace the component involved.

230895	<location>PU DRIVE-CLiQ (CU): Alternating cyclic data transfer error
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2) Hla: OFF2 (NONE, OFF1, OFF3, STOP2)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the power unit to the Control Unit involved. Fault cause: 11 (= 0B hex): Synchronization error during alternating cyclic data transfer. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON (switch-off/switch-on).

230896	<location>Power unit DRIVE-CLiQ (CU): Inconsistent component properties
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2) Hla: OFF2 (NONE, OFF1, OFF3, STOP2)
Acknowledge:	IMMEDIATELY

Cause:	The properties of the DRIVE-CLiQ component (power unit), specified by the fault value, have changed in an incompatible fashion with respect to the properties when booted. One cause can be, e.g. that a DRIVE-CLiQ cable or DRIVE-CLiQ component has been replaced. Fault value (r0949, interpret decimal): Component number.
Remedy:	- carry out a POWER ON. - when a component is replaced, the same component type and if possible the same firmware version should be used. - when a cable is replaced, only cables whose length is the same as or as close as possible to the length of the original cables should be used (ensure compliance with the maximum cable length).

230899 <location>Power unit: Unknown fault

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	New message: %1
Reaction:	Infeed: NONE (OFF1, OFF2) Servo: NONE (IASC/DCBRK, OFF1, OFF2, OFF3, STOP2) Hla: NONE (OFF1, OFF2, OFF3, STOP2)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	A fault occurred on the power unit that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit. Fault value (r0949, interpret decimal): Fault number. Note: If required, the significance of this new fault can be read about in a more recent description of the Control Unit.
Remedy:	- replace the firmware on the power unit by an older firmware version (r0128). - upgrade the firmware on the Control Unit (r0018).

230903 <location>Power unit: I2C bus error occurred

Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Infeed: NONE (OFF1, OFF2) Servo: NONE (IASC/DCBRK, OFF1, OFF2, OFF3, STOP2)
Acknowledge:	IMMEDIATELY
Cause:	Communications error with an EEPROM or an analog/digital converter. Fault value (r0949, interpret hexadecimal): 80000000 hex: - internal software error. 00000001 hex ... 0000FFFF hex: - module fault.
Remedy:	For fault value = 80000000 hex: - upgrade firmware to later version. For fault value = 00000001 hex ... 0000FFFF hex: - replace the module.

230907 <location>Power unit: FPGA configuration unsuccessful

Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2)
Acknowledge:	IMMEDIATELY
Cause:	During initialization within the power unit, an internal software error has occurred.

Remedy:

- if required, upgrade the firmware in the power unit.
- replace power unit.
- contact Technical Support.

230919 <location>Power unit: Temperature monitoring failed

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The temperature monitoring in the power unit has failed.
 Fault-free operation of the drive system is no longer guaranteed.
 Alarm value (r2124, interpret binary):
 Bit 0: Sensor 1 for the internal temperature can no longer be evaluated.
 Bit 1: Sensor 2 for the internal temperature can no longer be evaluated.

Remedy: Replace the power unit immediately.

230920 <location>Power unit: Temperature sensor fault

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: When evaluating the temperature sensor, an error occurred.
 Alarm value (r2124, interpret decimal):
 1: Wire breakage or sensor not connected.
 KTY: R > 1630 Ohm, PT100: R > 375 Ohm, PT1000: R > 1720 Ohm
 2: Measured resistance too low.
 PTC: R < 20 Ohm, KTY: R < 50 Ohm, PT100: R < 30 Ohm, PT1000: R < 603 Ohm
 Note:
 A temperature sensor is connected to the following terminals:
 - "Booksize" format: X21.1/.2 or X22.1/.2
 - "Chassis" format: X41.4/.3
 Information on temperature sensors is provided in the following literature for example:
 SINAMICS S120 Function Manual Drive Functions

Remedy:

- make sure that the sensor is connected correctly.
- replace the sensor.

230930 <location>Power unit: Component trace has saved data

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: Trace data was saved in the component.

Remedy: Not necessary.

Note:

For p7792= 1, the trace data of the component can be written to the memory card.

230950 <location>Power unit: Internal software error

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: POWER ON

Cause: An internal software error has occurred.
Fault value (r0949, interpret decimal):
Information about the fault source.
Only for internal Siemens troubleshooting.

Remedy: - if necessary, upgrade the firmware in the power unit to a later version.
- contact Technical Support.

230999 <location>Power unit: Unknown alarm

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: New message: %1

Reaction: NONE

Acknowledge: NONE

Cause: An alarm occurred on the power unit that cannot be interpreted by the Control Unit firmware.
This can occur if the firmware on this component is more recent than the firmware on the Control Unit.
Alarm value (r2124, interpret decimal):
Alarm number.
Note:
If required, the significance of this new alarm can be read about in a more recent description of the Control Unit.

Remedy: - replace the firmware on the power unit by an older firmware version (r0128).
- upgrade the firmware on the Control Unit (r0018).

231100 <location>Encoder 1: Zero mark distance error

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Infeed: NONE (OFF1, OFF2)
Servo: ENCODER (IASC/DCBRK, NONE, OFF1, OFF2, OFF3, STOP2)
Hla: ENCODER (NONE, OFF1, OFF2, OFF3, STOP2)

Acknowledge: PULSE INHIBIT

Cause: The measured zero mark distance does not correspond to the parameterized zero mark distance.
For distance-coded encoders, the zero mark distance is determined from zero marks detected pairs. This means that if a zero mark is missing, depending on the pair generation, this cannot result in a fault and also has no effect in the system.
The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder).
Fault value (r0949, interpret decimal):
Last measured zero mark distance in increments (4 increments = 1 encoder pulse).
The sign designates the direction of motion when detecting the zero mark distance.
See also: p0491 (Motor encoder fault response ENCODER)

Remedy: - check that the encoder cables are routed in compliance with EMC.
- check the plug connections.
- check the encoder type (encoder with equidistant zero marks).
- adapt the parameter for the distance between zero marks (p0424, p0425).
- if message output above speed threshold, reduce filter time if necessary (p0438).
- replace the encoder or encoder cable.

231101 <location>Encoder 1: Zero mark failed

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Infeed: NONE (OFF1, OFF2)
Servo: ENCODER (IASC/DCBRK, NONE, OFF1, OFF2, OFF3, STOP2)
Hla: ENCODER (NONE, OFF1, OFF2, OFF3, STOP2)

Acknowledge:	PULSE INHIBIT
Cause:	The 1.5 x parameterized zero mark distance was exceeded. The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder). Fault value (r0949, interpret decimal): Number of increments after POWER ON or since the last zero mark that was detected (4 increments = 1 encoder pulse). See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - check the encoder type (encoder with equidistant zero marks). - adapt the parameter for the clearance between zero marks (p0425). - if message output above speed threshold, reduce filter time if necessary (p0438). - when p0437.1 is active, check p4686. - replace the encoder or encoder cable.

231103 <location>Encoder 1: Signal level zero mark (track R) outside tolerance

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	R track: %1
Reaction:	Infeed: NONE Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	PULSE INHIBIT
Cause:	The zero mark signal level (track R) does not lie within the tolerance bandwidth for encoder 1. The fault can be initiated when the unipolar voltage level is exceeded (RP/RN) or if the differential amplitude is undershot. Fault value (r0949, interpret hexadecimal): yyyyxxxx hex: yyyy = 0, xxxx = Signal level, track R (16 bits with sign) The response thresholds of the unipolar signal levels of the encoder are between < 1400 mV and > 3500 mV. The response threshold for the differential signal level of the encoder is < -1600 mV. A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec. Note: The analog value of the amplitude error is not measured at the same time with the hardware fault output by the Sensor Module. The fault value can only be represented between -32768 ... 32767 dec (-770 ... 770 mV). The signal level is not evaluated unless the following conditions are satisfied: - Sensor Module properties available (r0459.31 = 1). - monitoring active (p0437.31 = 1). See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- check the speed range; frequency characteristic (amplitude characteristic) of the measuring equipment might not be sufficient for the speed range - check that the encoder cables and shielding are routed in compliance with EMC. - check the plug connections and contacts of the encoder cable. - check the encoder type (encoder with zero marks). - check whether the zero mark is connected and the signal cables RP and RN have been connected correctly (not connected with the incorrect polarity). - replace the encoder cable. - if the coding disk is soiled or the lighting aged, replace the encoder.

231110 <location>Encoder 1: Serial communications error

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin

Reaction:	Infeed: NONE Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	PULSE INHIBIT
Cause:	There is an error in the transfer of the serial communication protocol between the encoder and internal or external evaluation module. Fault value (r0949, interpret binary): For an EnDat 2.1 encoder, the significance of the fault value is as follows: Bit 0: Alarm bit in the position protocol. Bit 1: Incorrect quiescent level on the data line. Bit 2: Encoder does not respond (does not supply a start bit within 50 ms). Bit 3: CRC error: The checksum in the protocol from the encoder does not match the data. Bit 4: Encoder acknowledgment error: The encoder incorrectly understood the task (request) or cannot execute it. Bit 5: Internal error in the serial driver: An illegal mode command was requested. Bit 6: Timeout when cyclically reading. Bit 7: Timeout for the register communication. Bit 8: Protocol is too long (e.g. > 64 bits). Bit 9: Receive buffer overflow. Bit 10: Frame error when reading twice. Bit 11: Parity error. Bit 12: Data line signal level error during the monoflop time. Bit 13: Data line incorrect. Bit 14: Fault for the register communication. Bit 15: Internal communication error. Note: For an EnDat 2.2 encoder, the significance of the fault value for F3x135 (x = 1, 2, 3) is described.

Remedy:	For fault value, bit 0 = 1: - Enc defect F31111 may provide additional details. For fault value, bit 1 = 1: - incorrect encoder type / replace the encoder or encoder cable. For fault value, bit 2 = 1: - incorrect encoder type / replace the encoder or encoder cable. For fault value, bit 3 = 1: - EMC / connect the cable shield, replace the encoder or encoder cable. For fault value, bit 4 = 1: - EMC / connect the cable shield, replace the encoder or encoder cable, replace the Sensor Module. For fault value, bit 5 = 1: - EMC / connect the cable shield, replace the encoder or encoder cable, replace the Sensor Module. For fault value, bit 6 = 1: - Update Sensor Module firmware. For fault value, bit 7 = 1: - incorrect encoder type / replace the encoder or encoder cable. For fault value, bit 8 = 1: - check parameterization (p0429.2). For fault value, bit 9 = 1: - EMC / connect the cable shield, replace the encoder or encoder cable, replace the Sensor Module. For fault value, bit 10 = 1: - check parameterization (p0429.2, p0449). For fault value, bit 11 = 1: - check parameterization (p0436). For fault value, bit 12 = 1: - check parameterization (p0429.6). For fault value, bit 13 = 1: - check data line. For fault value, bit 14 = 1: - incorrect encoder type / replace the encoder or encoder cable.
----------------	---

231111 <location>Encoder 1: Encoder signals an internal error (detailed information)

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin, additional information: %2
Reaction:	Infeed: NONE Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	PULSE INHIBIT

Cause:	The encoder error word provides detailed information (error bit). For p0404.8 = 0, the following applies: Fault value for internal Siemens troubleshooting. For p0404.8 = 1, the following applies: Fault value (r0949, interpret binary): yyyyxxx hex: yyyy = supplementary information, xxx = fault cause yyyy = 0: Bit 0: Lighting system failed. Bit 1: Signal amplitude too low. Bit 2: Position value incorrect. Bit 3: Encoder power supply overvoltage condition. Bit 4: Encoder power supply undervoltage condition. Bit 5: Encoder power supply overcurrent condition. Bit 6: The battery must be changed. See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	For yyyy = 0: For fault value, bit 0 = 1: Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor. For fault value, bit 1 = 1: Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor. For fault value, bit 2 = 1: Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor. For fault value, bit 3 = 1: 5 V power supply voltage fault. When using an SMC: Check the plug-in cable between the encoder and SMC or replace the SMC. When a motor encoder with a direct DRIVE-CLiQ connection is used: Replace the motor. For fault value, bit 4 = 1: 5 V power supply voltage fault. When using an SMC: Check the plug-in cable between the encoder and SMC or replace the SMC. When using a motor with DRIVE-CLiQ: Replace the motor. For fault value, bit 5 = 1: Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor. For fault value, bit 6 = 1: The battery must be changed (only for encoders with battery back-up). For yyyy = 1: Encoder is defective. Replace encoder.

231112	<location>Encoder 1: Encoder signals an internal error
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Infeed: NONE Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	PULSE INHIBIT
Cause:	The encoder signals an internal error via serial protocol. Fault value (r0949, interpret binary): Bit 0: Fault bit in the position protocol.
Remedy:	For fault value, bit 0 = 1: In the case of an EnDat encoder, F31111 may provide further details.

231115	<location>Encoder 1: Signal level track A or B too low
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	A track: %1, B-track: %2
Reaction:	Infeed: NONE Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	PULSE INHIBIT
Cause:	The signal level (root from $A^2 + B^2$) of the encoder falls below the permissible limit value. Fault value (r0949, interpret hexadecimal): yyyyxxxx hex: yyyy = Signal level, track B (16 bits with sign). xxxx = Signal level, track A (16 bits with sign). The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %). The response threshold is < 170 mV (input frequency <= 256 kHz) or < 120 mV (input frequency > 256 kHz). A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec. Note for Sensor Modules for resolvers (e.g. SMC10): The nominal signal level is at 2900 mV (2.0 Vrms). The response threshold is < 1070 mV. A signal level of 2900 mV peak value corresponds to the numerical value 6666 hex = 26214 dec. Note: The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module. See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- check that the encoder cables and shielding are routed in compliance with EMC. - check the plug connections. - replace the encoder or encoder cable. - check the Sensor Module (e.g. contacts). The following applies to measuring systems without their own bearing system: - adjust the scanning head and check the bearing system of the measuring wheel. The following applies for measuring systems with their own bearing system: - ensure that the encoder housing is not subject to any axial force.
231116	<location>Encoder 1: Signal level track A or B too low
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	A track: %1, B-track: %2
Reaction:	Infeed: NONE Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	IMMEDIATELY
Cause:	The signal level of the rectified encoder signals A and B of the encoder fall below the permissible limit value. Fault value (r0949, interpret hexadecimal): yyyyxxxx hex: yyyy = Signal level, track B (16 bits with sign). xxxx = Signal level, track A (16 bits with sign). The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %). The response threshold is < 130 mV. A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec. Note: The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module. See also: p0491 (Motor encoder fault response ENCODER)

- Remedy:**
- check that the encoder cables and shielding are routed in compliance with EMC.
 - check the plug connections.
 - replace the encoder or encoder cable.
 - check the Sensor Module (e.g. contacts).

231117 <location>Encoder 1: Inversion error signals A/B/R

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: Fault cause: %1 bin

Reaction: Infeed: NONE
Servo: ENCODER (IASC/DCBRK, NONE)
Hla: ENCODER (NONE)

Acknowledge: IMMEDIATELY

Cause: For a square-wave encoder (bipolar, double ended) signals A*, B* and R* are not inverted with respect to signals A, B and R.
Fault value (r0949, interpret binary):
Bits 0 ... 15: Only for internal Siemens troubleshooting.
Bit 16: Error track A.
Bit 17: Error track B.
Bit 18: Error track R.
Note:
For SMC30 (only Article No. 6SL3055-0AA00-5CA0 and 6SL3055-0AA00-5CA1), CUA32 and CU310-2, the following applies:
A square-wave encoder without track R is used and track monitoring (p0405.2 = 1) is activated.
See also: p0491 (Motor encoder fault response ENCODER)

- Remedy:**
- check the encoder/cable.
 - Does the encoder supply signals and the associated inverted signals?
- Note:
For SMC30 (only Article Number 6SL3055-0AA00-5CA0 and 6SL3055-0AA00-5CA1), the following applies:
- check the setting of p0405 (p0405.2 = 1 is only possible if the encoder is connected at X520).
For a square-wave encoder without track R, the following jumpers must be set for the connection at X520 (SMC30), X220 (CUA32) or X23 (CU310-2):
- pin 10 (reference signal R) <--> pin 7 (encoder power supply, ground)
- pin 11 (reference signal R inverted) <--> pin 4 (encoder power supply)

231118 <location>Encoder 1: Speed change not plausible

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Infeed: NONE
Servo: ENCODER (IASC/DCBRK, NONE)
Hla: ENCODER (NONE)

Acknowledge: PULSE INHIBIT

Cause: For an HTL/TTL encoder, the speed change has exceeded the value in p0492 over several sampling cycles.
The change to the averaged speed actual value - if applicable - is monitored in the current controller sampling time.
Encoder 1 is used as motor encoder and can be effective has fault response to change over to encoderless operation.
Fault value (r0949, interpret decimal):
Only for internal Siemens troubleshooting.
See also: p0491, p0492

- Remedy:**
- check the tachometer feeder cable for interruptions.
 - check the grounding of the tachometer shielding.
 - if required, increase the maximum speed difference per sampling cycle (p0492).

231120	<location>Encoder 1: Encoder power supply fault
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	Infeed: NONE Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	PULSE INHIBIT
Cause:	An encoder power supply fault was detected. Fault value (r0949, interpret binary): Bit 0: Undervoltage condition on the sense line. Bit 1: Overcurrent condition for the encoder power supply. Bit 2: Overcurrent condition for encoder power supply on cable resolver excitation negative. Bit 3: Overcurrent condition for encoder power supply on cable resolver excitation positive. Bit 4: The 24 V power supply through the Power Module (PM) is overloaded. Bit 5: Overcurrent at the EnDat connection of the converter. Bit 6: Overvoltage at the EnDat connection of the converter. Bit 7: Hardware fault at the EnDat connection of the converter. Note: If the encoder cables 6FX2002-2EQ00-.... and 6FX2002-2CH00-.... are interchanged, this can result in the encoder being destroyed because the pins of the operating voltage are reversed. See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	For fault value, bit 0 = 1: - correct encoder cable connected? - check the plug connections of the encoder cable. - SMC30: Check the parameterization (p0404.22). For fault value, bit 1 = 1: - correct encoder cable connected? - replace the encoder or encoder cable. For fault value, bit 2 = 1: - correct encoder cable connected? - replace the encoder or encoder cable. For fault value, bit 3 = 1: - correct encoder cable connected? - replace the encoder or encoder cable. For fault value, bit 5 = 1: - Measuring unit correctly connected at the converter? - Replace the measuring unit or the cable to the measuring unit. For fault value, bit 6, 7 = 1: - Replace the defective EnDat 2.2 converter.
231121	<location>Encoder 1: Determined commutation position incorrect
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	Infeed: NONE Servo: ENCODER (NONE) Hla: ENCODER (NONE)
Acknowledge:	PULSE INHIBIT
Cause:	A commutation position actual value sensing error was detected. See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	Replace the motor with DRIVE-CLiQ or the appropriate Sensor Module.

231122 <location>Encoder 1: Sensor Module hardware fault**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:**
Infeed: NONE
Servo: ENCODER
Hla: ENCODER**Acknowledge:** IMMEDIATELY**Cause:**
An internal Sensor Module hardware fault was detected.
Fault value (r0949, interpret decimal):
1: Reference voltage error.
2: Internal undervoltage.
3: Internal overvoltage.**Remedy:** Replace the motor with DRIVE-CLiQ or the appropriate Sensor Module.

231123 <location>Encoder 1: Signal level A/B outside tolerance**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** Fault cause: %1 bin**Reaction:**
Infeed: NONE
Servo: ENCODER (IASC/DCBRK, NONE)
Hla: ENCODER (NONE)**Acknowledge:** PULSE INHIBIT**Cause:**
The unipolar level (AP/AN or BP/BN) for encoder 1 is outside the permissible tolerance.
Fault value (r0949, interpret binary):
Bit 0 = 1: Either AP or AN outside the tolerance.
Bit 16 = 1: Either BP or BN outside the tolerance.
The unipolar nominal signal level of the encoder must lie in the range 2500 mV +/- 500 mV.
The response thresholds are < 1700 mV and > 3300 mV.
Note:
The signal level is not evaluated unless the following conditions are satisfied:
- Sensor Module properties available (r0459.31 = 1).
- monitoring active (p0437.31 = 1).
See also: p0491 (Motor encoder fault response ENCODER)
Remedy:
- make sure that the encoder cables and shielding are installed in an EMC-compliant manner.
- check the plug connections and contacts of the encoder cable.
- check the short-circuit of a signal cable with mass or the operating voltage.
- replace the encoder cable.

231125 <location>Encoder 1: Signal level track A or B too high**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** A track: %1, B-track: %2**Reaction:**
Infeed: NONE
Servo: ENCODER (IASC/DCBRK, NONE)
Hla: ENCODER (NONE)**Acknowledge:** PULSE INHIBIT

Cause:	The signal level (root from $A^2 + B^2$) of the encoder exceeds the permissible limit value. Fault value (r0949, interpret hexadecimal): yyyyxxxx hex: yyyy = Signal level, track B (16 bits with sign). xxxx = Signal level, track A (16 bits with sign). The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %). The response threshold is > 750 mV. A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec. Note for Sensor Modules for resolvers (e.g. SMC10): The nominal signal level is at 2900 mV (2.0 Vrms). The response threshold is > 3582 mV. A signal level of 2900 mV peak value corresponds to the numerical value 6666 hex = 26214 dec. Note: The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module. See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- check that the encoder cables and shielding are routed in compliance with EMC. - replace the encoder or encoder cable.

231126 <location>Encoder 1: Signal level track A or B too high

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Amplitude: %1, Angle: %2
Reaction:	Infeed: NONE Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	PULSE INHIBIT
Cause:	The signal level ($A + B$) of the encoder exceeds the permissible limit value. Fault value (r0949, interpret hexadecimal): yyyyxxxx hex: yyyy = Angle xxxx = amplitude, i.e. root of $A^2 + B^2$ (16 bits without sign) The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %). The response threshold for ($A + B$) is > 1120 mV or the root of $(A^2 + B^2) > 955$ mV. A signal level of 500 mV peak value corresponds to the numerical value of 299A hex = 10650 dec. The angle 0 ... FFFF hex corresponds to 0 ... 360 degrees of the fine position. Zero degrees is present at the negative zero crossover of track B. Note: The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module. See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- check that the encoder cables and shielding are routed in compliance with EMC. - replace the encoder or encoder cable.

231129 <location>Encoder 1: Position difference hall sensor/track C/D and A/B too large

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Infeed: NONE Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	PULSE INHIBIT

Cause:	The error for track C/D is greater than $\pm 15^\circ$ mechanical or $\pm 60^\circ$ electrical or the error for the Hall signals is greater than $\pm 60^\circ$ electrical. One period of track C/D corresponds to 360° mechanical. One period of the Hall signal corresponds to 360° electrical. The monitoring responds if, for example, Hall sensors are connected as equivalent for the C/D tracks with the incorrect rotational sense or supply values that are not accurate enough. After the fine synchronization using one reference mark or 2 reference marks for distance-coded encoders, this fault is no longer initiated, but instead, Alarm A31429. Fault value (r0949, interpret decimal): For track C/D, the following applies: Measured deviation as mechanical angle (16 bits with sign, 182 dec corresponds to 1°). For Hall signals, the following applies: Measured deviation as electrical angle (16 bits with sign, 182 dec corresponds to 1°). See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- track C or D not connected. - correct the direction of rotation of the Hall sensor possibly connected as equivalent for track C/D. - check that the encoder cables are routed in compliance with EMC. - check the adjustment of the Hall sensor.

231130	<location>Encoder 1: Zero mark and position error from the coarse synchronization
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Angular deviation, electrical: %1, angle, mechanical: %2
Reaction:	Infeed: NONE Servo: ENCODER (IASC/DCBRK, NONE, OFF1, OFF2, OFF3, STOP2) Hla: ENCODER (NONE, OFF1, OFF2, OFF3, STOP2)
Acknowledge:	PULSE INHIBIT
Cause:	After initializing the pole position using track C/D, Hall signals or pole position identification routine, the zero mark was detected outside the permissible range. For distance-coded encoders, the test is carried out after passing 2 zero marks. Fine synchronization was not carried out. When initializing via track C/D (p0404) then it is checked whether the zero mark occurs in an angular range of $\pm 18^\circ$ mechanical. When initializing via Hall sensors (p0404) or pole position identification (p1982) it is checked whether the zero mark occurs in an angular range of $\pm 60^\circ$ electrical. Fault value (r0949, interpret hexadecimal): yyyyxxxx hex yyyy: Determined mechanical zero mark position (can only be used for track C/D). xxxx: Deviation of the zero mark from the expected position as electrical angle. Scaling: 32768 dec = 180° See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- check p0431 and, if necessary, correct (trigger via p1990 = 1 if necessary). - check that the encoder cables are routed in compliance with EMC. - check the plug connections. - if the Hall sensor is used as an equivalent for track C/D, check the connection. - check the connection of track C or D. - replace the encoder or encoder cable.

231131	<location>Encoder 1: Position deviation incremental/absolute too high
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Infeed: NONE Servo: ENCODER (IASC/DCBRK, NONE, OFF1, OFF2, OFF3, STOP2) Hla: ENCODER (NONE, OFF1, OFF2, OFF3, STOP2)

Acknowledge:	PULSE INHIBIT
Cause:	Absolute encoder: When cyclically reading the absolute position, an excessively high difference to the incremental position was detected. The absolute position that was read is rejected. Limit value for the deviation: - EnDat encoder: Is supplied from the encoder and is a minimum of 2 quadrants (e.g. EQI 1325 > 2 quadrants, EQN 1325 > 50 quadrants). - other encoders: 15 pulses = 60 quadrants. Incremental encoder: When the zero pulse is passed, a deviation in the incremental position was detected. For equidistant zero marks, the following applies: - the first zero mark passed supplies the reference point for all subsequent checks. The other zero marks must have n times the distance referred to the first zero mark. For distance-coded zero marks, the following applies: - the first zero mark pair supplies the reference point for all subsequent checks. The other zero mark pairs must have the expected distance to the first zero mark pair. Fault value (r0949, interpret decimal): Deviation in quadrants (1 pulse = 4 quadrants). See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - replace the encoder or encoder cable. - check whether the coding disk is dirty or there are strong ambient magnetic fields. - adapt the parameter for the clearance between zero marks (p0425). - if message output above speed threshold, reduce filter time if necessary (p0438).

231135	<location>Encoder 1: Fault when determining the position (single turn)
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	Infeed: NONE Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	PULSE INHIBIT

Cause:	The encoder has identified a position determination fault (singleturn) and supplies status information bit by bit in an internal status/fault word. Some of these bits cause this fault to be triggered. Other bits are status displays. The status/fault word is displayed in the fault value. Note regarding the bit designation: The first designation is valid for DRIVE-CLiQ encoders, the second for EnDat 2.2 encoders. Fault value (r0949, interpret binary): Bit 0: F1 (safety status display). Bit 1: F2 (safety status display). Bit 2: Reserved (lighting). Bit 3: Reserved (signal amplitude). Bit 4: Reserved (position value). Bit 5: Reserved (overvoltage). Bit 6: Reserved (undervoltage)/hardware fault EnDat supply (--> F3x110, x = 1, 2, 3). Bit 7: Reserved (overcurrent)/EnDat encoder withdrawn when not in the parked state (--> F3x110, x = 1, 2, 3). Bit 8: Reserved (battery)/overcurrent EnDat supply (--> F3x110, x = 1, 2, 3). Bit 9: Reserved/overvoltage EnDat supply (--> F3x110, x = 1, 2, 3). Bit 11: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 12: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 13: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 14: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 15: Internal communication error (--> F3x110, x = 1, 2, 3). Bit 16: Lighting (--> F3x135, x = 1, 2, 3). Bit 17: Signal amplitude (--> F3x135, x = 1, 2, 3). Bit 18: Singleturn position 1 (--> F3x135, x = 1, 2, 3). Bit 19: Overvoltage (--> F3x135, x = 1, 2, 3). Bit 20: Undervoltage (--> F3x135, x = 1, 2, 3). Bit 21: Overcurrent (--> F3x135, x = 1, 2, 3). Bit 22: Temperature exceeded (--> F3x405, x = 1, 2, 3). Bit 23: Singleturn position 2 (safety status display). Bit 24: Singleturn system (--> F3x135, x = 1, 2, 3). Bit 25: Singleturn power down (--> F3x135, x = 1, 2, 3). Bit 26: Multiturn position 1 (--> F3x136, x = 1, 2, 3). Bit 27: Multiturn position 2 (--> F3x136, x = 1, 2, 3). Bit 28: Multiturn system (--> F3x136, x = 1, 2, 3). Bit 29: Multiturn power down (--> F3x136, x = 1, 2, 3). Bit 30: Multiturn overflow/underflow (--> F3x136, x = 1, 2, 3). Bit 31: Multiturn battery (reserved).
Remedy:	- determine the detailed cause of the fault using the fault value. - replace the encoder if necessary. Note: An EnDat 2.2 encoder may only be removed and inserted in the "Park" state. If an EnDat 2.2 encoder was removed when not in the "Park" state, then after inserting the encoder, a POWER ON (switch-off/switch-on) is necessary to acknowledge the fault.

231136	<location>Encoder 1: Fault when determining the position (multiturn)
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	Infeed: NONE Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	PULSE INHIBIT

Cause:	The encoder has identified a position determination fault (multiturn) and supplies status information bit by bit in an internal status/fault word. Some of these bits cause this fault to be triggered. Other bits are status displays. The status/fault word is displayed in the fault value. Note regarding the bit designation: The first designation is valid for DRIVE-CLiQ encoders, the second for EnDat 2.2 encoders. Fault value (r0949, interpret binary): Bit 0: F1 (safety status display). Bit 1: F2 (safety status display). Bit 2: Reserved (lighting). Bit 3: Reserved (signal amplitude). Bit 4: Reserved (position value). Bit 5: Reserved (overvoltage). Bit 6: Reserved (undervoltage)/hardware fault EnDat supply (--> F3x110, x = 1, 2, 3). Bit 7: Reserved (overcurrent)/EnDat encoder withdrawn when not in the parked state (--> F3x110, x = 1, 2, 3). Bit 8: Reserved (battery)/overcurrent EnDat supply (--> F3x110, x = 1, 2, 3). Bit 9: Reserved/overvoltage EnDat supply (--> F3x110, x = 1, 2, 3). Bit 11: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 12: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 13: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 14: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 15: Internal communication error (--> F3x110, x = 1, 2, 3). Bit 16: Lighting (--> F3x135, x = 1, 2, 3). Bit 17: Signal amplitude (--> F3x135, x = 1, 2, 3). Bit 18: Singleturn position 1 (--> F3x135, x = 1, 2, 3). Bit 19: Overvoltage (--> F3x135, x = 1, 2, 3). Bit 20: Undervoltage (--> F3x135, x = 1, 2, 3). Bit 21: Overcurrent (--> F3x135, x = 1, 2, 3). Bit 22: Temperature exceeded (--> F3x405, x = 1, 2, 3). Bit 23: Singleturn position 2 (safety status display). Bit 24: Singleturn system (--> F3x135, x = 1, 2, 3). Bit 25: Singleturn power down (--> F3x135, x = 1, 2, 3). Bit 26: Multiturn position 1 (--> F3x136, x = 1, 2, 3). Bit 27: Multiturn position 2 (--> F3x136, x = 1, 2, 3). Bit 28: Multiturn system (--> F3x136, x = 1, 2, 3). Bit 29: Multiturn power down (--> F3x136, x = 1, 2, 3). Bit 30: Multiturn overflow/underflow (--> F3x136, x = 1, 2, 3). Bit 31: Multiturn battery (reserved).
Remedy:	- determine the detailed cause of the fault using the fault value. - replace the encoder if necessary. Note: An EnDat 2.2 encoder may only be removed and inserted in the "Park" state. If an EnDat 2.2 encoder was removed when not in the "Park" state, then after inserting the encoder, a POWER ON (switch-off/switch-on) is necessary to acknowledge the fault.

231137	<location>Encoder 1: Fault when determining the position (single turn)
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	Infeed: NONE Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	PULSE INHIBIT

Cause: A position determination fault has occurred in the DRIVE-CLiQ encoder.
Fault value (r0949, interpret binary):
yyxxxxxx hex: yy = encoder version, xxxxxx = bit coding of the fault cause

For yy = 8 (0000 1000 bin), the following applies:

- Bit 1: Signal monitoring (sin/cos).
- Bit 8: F1 (safety status display) error position word 1.
- Bit 9: F2 (safety status display) error position word 2.
- Bit 16: LED monitoring.
- Bit 17: Fault when determining the position (multiturn).
- Bit 18: Single-step capability monitoring singleturn from the Safety channel.
- Bit 19: ECRC, configuration error in the safety channel.
- Bit 23: Temperature outside the limit values.

For yy = 11 (0000 1011 bin), the following applies:

- Bit 0: Position word 1 difference between rotation counter and software counter (XC_ERR).
- Bit 1: Position word 1 track error of the incremental signals (LIS_ERR).
- Bit 2: Position word 1 error when aligning between incremental track signals and absolute value (ST_ERR).
- Bit 3: Maximum permissible temperature exceeded (TEMP_ERR).
- Bit 4: Power supply overvoltage (MON_OVR_VOLT).
- Bit 5: Power supply overcurrent (MON_OVR_CUR).
- Bit 6: Power supply undervoltage (MON_UND_VOLT).
- Bit 7: Rotation error counter (MT_ERR).
- Bit 8: F1 (safety status display) error position word 1.
- Bit 9: F2 (safety status display) error position word 2.
- Bit 11: Position word 1 status bit: singleturn position OK (ADC_ready).
- Bit 12: Position word 1 status bit: rotation counter OK (MT_ready).
- Bit 13: Position word 1 memory error (MEM_ERR).
- Bit 14: Position word 1 absolute position error (MLS_ERR).
- Bit 15: position word 1 LED error, lighting unit error (LED_ERR).
- Bit 18: Position word 2 error when aligning between incremental track signals and absolute value (ST_ERR).
- Bit 21: Position word 2 memory error (MEM_ERR).
- Bit 22: Position word 2 absolute position error (MLS_ERR).
- Bit 23: position word 2 LED error, lighting unit error (LED_ERR).

For yy = 12 (0000 1100 bin), the following applies:

- Bit 8: encoder fault.
- Bit 10: error in the internal position data transport.

For yy = 14 (0000 1110 bin), the following applies:

- Bit 0: Position word 1 temperature outside limit value.
- Bit 1: Position word 1 position determination error (multiturn).
- Bit 2: Position word 1 FPGA error.
- Bit 3: Position word 1 velocity error.
- Bit 4: Position word 1 communication error between FPGAs/error in the incremental signal.
- Bit 5: Position word 1 timeout absolute value/error when determining the position (singleturn).
- Bit 6: Position word 1 internal hardware fault (clock/power monitor IC/power).
- Bit 7: Position word 1 internal error (FPGA communication/FPGA parameterization/self-test/software).
- Bit 8: F1 (safety status display) error position word 1.
- Bit 9: F2 (safety status display) error position word 2.
- Bit 16: Position word 2 temperature outside limit value.
- Bit 17: Position word 2 position determination error (multiturn).

Bit 18: Position word 2 FPGA error.
Bit 19: Position word 2 velocity error.
Bit 20: Position word 2 communication error between FPGAs.
Bit 21: Position word 2 position determination error (singleturn).
Bit 22: Position word 2 internal hardware fault (clock/power monitor IC/power).
Bit 23: Position word 2 internal error (self-test/software).

Note:

For an encoder version that is not described here, please contact the encoder manufacturer for more detailed information on the bit coding.

Remedy:

- determine the detailed cause of the fault using the fault value.
- if required, replace the DRIVE-CLiQ encoder.

231138 **<location>Encoder 1: Fault when determining the position (multiturn)**

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: Fault cause: %1 bin

Reaction: Infeed: NONE

 Servo: ENCODER (IASC/DCBRK, NONE)

 Hla: ENCODER (NONE)

Acknowledge: PULSE INHIBIT

Cause: A position determination fault has occurred in the DRIVE-CLiQ encoder.
Fault value (r0949, interpret binary):
yyxxxxxx hex: yy = encoder version, xxxxxx = bit coding of the fault cause

For yy = 8 (0000 1000 bin), the following applies:

- Bit 1: Signal monitoring (sin/cos).
- Bit 8: F1 (safety status display) error position word 1.
- Bit 9: F2 (safety status display) error position word 2.
- Bit 16: LED monitoring.
- Bit 17: Fault when determining the position (multiturn).
- Bit 19: ECRC, configuration error in the safety channel.
- Bit 23: Temperature outside the limit values.

For yy = 11 (0000 1011 bin), the following applies:

- Bit 0: Position word 1 difference between rotation counter and software counter (XC_ERR).
- Bit 1: Position word 1 track error of the incremental signals (LIS_ERR).
- Bit 2: Position word 1 error when aligning between incremental track signals and absolute value (ST_ERR).
- Bit 3: Maximum permissible temperature exceeded (TEMP_ERR).
- Bit 4: Power supply overvoltage (MON_OVR_VOLT).
- Bit 5: Power supply overcurrent (MON_OVR_CUR).
- Bit 6: Power supply undervoltage (MON_UND_VOLT).
- Bit 7: Rotation error counter (MT_ERR).
- Bit 8: F1 (safety status display) error position word 1.
- Bit 9: F2 (safety status display) error position word 2.
- Bit 11: Position word 1 status bit: singleturn position OK (ADC_ready).
- Bit 12: Position word 1 status bit: rotation counter OK (MT_ready).
- Bit 13: Position word 1 memory error (MEM_ERR).
- Bit 14: Position word 1 absolute position error (MLS_ERR).
- Bit 15: position word 1 LED error, lighting unit error (LED_ERR).
- Bit 18: Position word 2 error when aligning between incremental track signals and absolute value (ST_ERR).
- Bit 21: Position word 2 memory error (MEM_ERR).
- Bit 22: Position word 2 absolute position error (MLS_ERR).
- Bit 23: position word 2 LED error, lighting unit error (LED_ERR).

For yy = 14 (0000 1110 bin), the following applies:

- Bit 0: Position word 1 temperature outside limit value.
- Bit 1: Position word 1 position determination error (multiturn).
- Bit 2: Position word 1 FPGA error.
- Bit 3: Position word 1 velocity error.
- Bit 4: Position word 1 communication error between FPGAs/error in the incremental signal.
- Bit 5: Position word 1 timeout absolute value/error when determining the position (singleturn).
- Bit 6: Position word 1 internal hardware fault (clock/power monitor IC/power).
- Bit 7: Position word 1 internal error (FPGA communication/FPGA parameterization/self-test/software).
- Bit 8: F1 (safety status display) error position word 1.
- Bit 9: F2 (safety status display) error position word 2.
- Bit 16: Position word 2 temperature outside limit value.
- Bit 17: Position word 2 position determination error (multiturn).
- Bit 18: Position word 2 FPGA error.
- Bit 19: Position word 2 velocity error.
- Bit 20: Position word 2 communication error between FPGAs.
- Bit 21: Position word 2 position determination error (singleturn).
- Bit 22: Position word 2 internal hardware fault (clock/power monitor IC/power).

Bit 23: Position word 2 internal error (self-test/software).

Note:

For an encoder version that is not described here, please contact the encoder manufacturer for more detailed information on the bit coding.

Remedy:

- determine the detailed cause of the fault using the fault value.
- if required, replace the DRIVE-CLiQ encoder.

231142 <location>Encoder 1: Battery voltage fault

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction:

Infeed: ENCODER (NONE, OFF1, OFF2)

Servo: ENCODER (IASC/DCBRK, NONE, OFF1, OFF2, OFF3, STOP2)

Hla: ENCODER (NONE, OFF1, OFF2, OFF3, STOP2)

Acknowledge: IMMEDIATELY

Cause: When switched-off, the encoder uses a battery to back up the multturn information. The battery voltage is no longer sufficient to check the multturn information.

Remedy: Replace battery.

231150 <location>Encoder 1: Initialization error

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction:

Infeed: NONE

Servo: ENCODER (IASC/DCBRK, NONE, OFF1, OFF2, OFF3, STOP2)

Hla: ENCODER (NONE, OFF1, OFF2, OFF3, STOP2)

Acknowledge: PULSE INHIBIT

Cause: Encoder functionality selected in p0404 cannot be executed.

Fault value (r0949, interpret hexadecimal):

Encoder malfunction.

The bit assignment corresponds to that of p0404 (e.g. bit 5 set: Error track C/D).

See also: p0404 (Encoder configuration effective), p0491 (Motor encoder fault response ENCODER)

Remedy:

- check that p0404 is correctly set.
- check the encoder type used (incremental/absolute) and for SMCxx, the encoder cable.
- if relevant, note additional fault messages that describe the fault in detail.

231151 <location>Encoder 1: Encoder speed for initialization AB too high

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction:

Infeed: NONE

Servo: ENCODER (IASC/DCBRK, NONE, OFF1, OFF2, OFF3, STOP2)

Hla: ENCODER (NONE, OFF1, OFF2, OFF3, STOP2)

Acknowledge: PULSE INHIBIT

Cause: The encoder speed is too high while initializing the Sensor Module.

Remedy: Reduce the speed of the encoder accordingly during initialization.

If necessary, deactivate monitoring (p0437.29).

See also: p0437 (Sensor Module configuration extended)

231152 <location>Encoder 1: Max. signal frequency (track A/B) exceeded

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction:	Infeed: ENCODER (NONE, OFF1, OFF2) Servo: ENCODER (IASC/DCBRK, NONE, OFF1, OFF2, OFF3, STOP2) Hla: ENCODER (NONE, OFF1, OFF2, OFF3, STOP2)
Acknowledge:	PULSE INHIBIT
Cause:	The maximum signal frequency of the encoder evaluation has been exceeded. Fault value (r0949, interpret decimal): Actual signal frequency in Hz. See also: p0408
Remedy:	- reduce the speed. - Use an encoder with a lower pulse number (p0408).

231153 <location>Encoder 1: Identification error

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	An error has occurred when identifying the encoder (waiting) p0400 = 10100. The connected encoder was not able to be identified. Fault value (r0949, interpret binary): Bit 0: Data length incorrect. See also: p0400 (Encoder type selection)
Remedy:	Manually configure the encoder according to the data sheet.

231160 <location>Encoder 1: Analog sensor channel A failed

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Infeed: ENCODER (NONE) Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	PULSE INHIBIT
Cause:	The input voltage of the analog sensor is outside the permissible limits. Fault value (r0949, interpret decimal): 1: Input voltage outside detectable measuring range. 2: Input voltage outside the measuring range set in (p4673). 3: The absolute value of the input voltage has exceeded the range limit (p4676).
Remedy:	For fault value = 1: - check the output voltage of the analog sensor. For fault value = 2: - check the voltage setting for each encoder period (p4673). For fault value = 3: - check the range limit setting and increase it if necessary (p4676).

231161 <location>Encoder 1: Analog sensor channel B failed

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Infeed: ENCODER (NONE) Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	PULSE INHIBIT

Cause: The input voltage of the analog sensor is outside the permissible limits.
 Fault value (r0949, interpret decimal):
 1: Input voltage outside detectable measuring range.
 2: Input voltage outside the selected measuring range (p4675).
 3: The absolute value of the input voltage has exceeded the range limit (p4676).

Remedy: For fault value = 1:
 - check the output voltage of the analog sensor.
 For fault value = 2:
 - check the voltage setting for each encoder period (p4675).
 For fault value = 3:
 - check the range limit setting and increase it if necessary (p4676).

231163 <location>Encoder 1: Analog sensor position value exceeds limit value

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Infeed: ENCODER (NONE)
 Servo: ENCODER (IASC/DCBRK, NONE)
 Hla: ENCODER (NONE)

Acknowledge: PULSE INHIBIT

Cause: The position value has exceeded the permissible range of -0.5 ... +0.5.
 Fault value (r0949, interpret decimal):
 1: Position value from the LVDT sensor.
 2: Position value from the encoder characteristic.

Remedy: For fault value = 1:
 - check the LVDT ratio (p4678).
 - check the reference signal connection at track B.
 For fault value = 2:
 - check the coefficients of the characteristic (p4663 ... p4666).

231400 <location>Encoder 1: Zero mark distance error (alarm threshold exceeded)

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The measured zero mark distance does not correspond to the parameterized zero mark distance.
 For distance-coded encoders, the zero mark distance is determined from zero marks detected pairs. This means that if a zero mark is missing, depending on the pair generation, this cannot result in a fault and also has no effect in the system.
 The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder).
 Alarm value (r2124, interpret decimal):
 Last measured zero mark distance in increments (4 increments = 1 encoder pulse).
 The sign designates the direction of motion when detecting the zero mark distance.

Remedy: - check that the encoder cables are routed in compliance with EMC.
 - check the plug connections.
 - check the encoder type (encoder with equidistant zero marks).
 - adapt the parameter for the distance between zero marks (p0424, p0425).
 - replace the encoder or encoder cable.

231401 <location>Encoder 1: Zero mark failed (alarm threshold exceeded)

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction:	NONE
Acknowledge:	NONE
Cause:	The 1.5x parameterized zero mark distance was exceeded without a zero mark being detected. The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder). Alarm value (r2124, interpret decimal): Number of increments after POWER ON or since the last zero mark that was detected (4 increments = 1 encoder pulse).
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - check the encoder type (encoder with equidistant zero marks). - adapt the parameter for the clearance between zero marks (p0425). - replace the encoder or encoder cable.

231405 <location>Encoder 1: Temperature in the encoder evaluation exceeded

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	temperature: [0.1 degrees C] %1, temperature sensor number: %2
Reaction:	Infeed: NONE (OFF1, OFF2) Servo: ENCODER (IASC/DCBRK, NONE, OFF1, OFF2, OFF3, STOP2) HLA: ENCODER (NONE, OFF1, OFF2, OFF3, STOP2)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	An inadmissibly high temperature was detected in the encoder electronics or the encoder evaluation. Fault value (r0949, interpret hexadecimal): yyxxxx hex: yy = temperature sensor number, xxxx = measured module temperature in 0.1 °C.
Remedy:	Reduce the ambient temperature for the DRIVE-CLiQ connection of the motor.

231407 <location>Encoder 1: Function limit reached

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The encoder has reached one of its function limits. A service is recommended. Alarm value (r2124, interpret decimal): 1: Incremental signals 3: Absolute track 4: Code connection
Remedy:	Perform service. Replace the encoder if necessary. Note: The actual functional reserve of an encoder can be displayed via r4651. See also: p4650 (Encoder functional reserve component number), r4651 (Encoder functional reserve)

231410 <location>Encoder 1: Communication error (encoder and Sensor Module)

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	NONE
Acknowledge:	NONE

Cause:	Serial communication protocol transfer error between the encoder and evaluation module. Alarm value (r2124, interpret binary): Bit 0: Alarm bit in the position protocol. Bit 1: Incorrect quiescent level on the data line. Bit 2: Encoder does not respond (does not supply a start bit within 50 ms). Bit 3: CRC error: The checksum in the protocol from the encoder does not match the data. Bit 4: Encoder acknowledgment error: The encoder incorrectly understood the task (request) or cannot execute it. Bit 5: Internal error in the serial driver: An illegal mode command was requested. Bit 6: Timeout when cyclically reading. Bit 8: Protocol is too long (e.g. > 64 bits). Bit 9: Receive buffer overflow. Bit 10: Frame error when reading twice. Bit 11: Parity error. Bit 12: Data line signal level error during the monoflop time.
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - replace encoder.

231411 <location>Encoder 1: Encoder signals an internal alarm (detailed information)

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin, additional information: %2
Reaction:	NONE
Acknowledge:	NONE
Cause:	The absolute encoder fault word includes alarm bits that have been set. Alarm value (r2124, interpret binary): yyyyxxxx hex: yyyy = supplementary information, xxxx = fault cause yyyy = 0: Bit 0: Frequency exceeded (speed too high). Bit 1: Temperature exceeded. Bit 2: Control reserve, lighting system exceeded. Bit 3: Battery discharged. Bit 4: Reference point passed. yyyy = 1: Bit 0: Signal amplitude outside the control range. Bit 1: Error multiturn interface Bit 2: Internal data error (singleturn/multiturn not with single steps). Bit 3: Error EEPROM interface. Bit 4: SAR_converter error. Bit 5: Fault for the register data transfer. Bit 6: Internal error identified at the error pin (nErr). Bit 7: Temperature threshold exceeded or fallen below. See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	Replace encoder.

231412 <location>Encoder 1: Encoder signals an internal alarm

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE

- Cause:** The encoder signals an internal alarm via serial protocol.
 Alarm value (r2124, interpret binary):
 Bit 0: Fault bit in the position protocol.
 Bit 1: Alarm bit in the position protocol.
- Remedy:**
- carry out a POWER ON (switch-off/switch-on) for all components.
 - check that the encoder cables are routed in compliance with EMC.
 - check the plug connections.
 - replace encoder.

231414 <location>Encoder 1: Signal level track C or D out of tolerance

- Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
- Message value:** C track: %1, D track: %2
- Reaction:** NONE
- Acknowledge:** NONE
- Cause:** The signal level ($C^2 + D^2$) of track C or D of the encoder or from the Hall signals, is not within the tolerance bandwidth.
 Alarm value (r2124, interpret hexadecimal):
 yyyyxxxx hex:
 yyyy = Signal level, track D (16 bits with sign).
 xxxx = Signal level, track C (16 bits with sign).
 The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).
 The response thresholds are < 230 mV (observe the frequency response of the encoder) and > 750 mV.
 A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.
 Note:
 If the amplitude is not within the tolerance bandwidth, then it cannot be used to initialize the start position.
- Remedy:**
- check that the encoder cables are routed in compliance with EMC.
 - check the plug connections.
 - replace the encoder or encoder cable.
 - check the Sensor Module (e.g. contacts).
 - check the Hall sensor box.

231415 <location>Encoder 1: Signal level track A or B outside tolerance (alarm)

- Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
- Message value:** Amplitude: %1, Angle: %2
- Reaction:** NONE
- Acknowledge:** NONE

Cause:	The signal level (root from $A^2 + B^2$) of the encoder is outside the permissible tolerance. Alarm value (r2124, interpret hexadecimal): yyyyxxxx hex: yyyy = Angle xxxx = amplitude, i.e. root of $A^2 + B^2$ (16 bits without sign) The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %). The response threshold is < 230 mV (observe the frequency response of the encoder). A signal level of 500 mV peak value corresponds to the numerical value 299A hex = 10650 dec. The angle 0 ... FFFF hex corresponds to 0 ... 360 degrees of the fine position. Zero degrees is present at the negative zero crossover of track B. Note for Sensor Modules for resolvers (e.g. SMC10): The nominal signal level is at 2900 mV (2.0 Vrms). The response threshold is < 1414 mV (1.0 Vrms). A signal level of 2900 mV peak value corresponds to the numerical value 3333 hex = 13107 dec. Note: The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module. See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- check the speed range, frequency characteristic (amplitude characteristic) of the measuring equipment is not sufficient for the speed range. - check that the encoder cables and shielding are routed in compliance with EMC. - check the plug connections. - replace the encoder or encoder cable. - check the Sensor Module (e.g. contacts). - if the coding disk is soiled or the lighting aged, replace the encoder.

231418 <location>Encoder 1: Speed change not plausible (alarm)

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	For an HTL/TTL encoder, the speed change has exceeded the value in p0492 over several sampling cycles. The change to the averaged speed actual value - if applicable - is monitored in the current controller sampling time. Alarm value (r2124, interpret decimal): Only for internal Siemens troubleshooting. See also: p0492
Remedy:	- check the tachometer feeder cable for interruptions. - check the grounding of the tachometer shielding. - if required, increase the setting of p0492.

231419 <location>Encoder 1: Track A or B outside tolerance

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE

Cause:	The amplitude/phase/offset correction for track A or B is at the limit. Amplitude error correction: $\text{Amplitude B} / \text{Amplitude A} = 0.78 \dots 1.27$ Phase: <84 degrees or >96 degrees SMC20: Offset correction: ± 140 mV SMC10: Offset correction: ± 650 mV Alarm value (r2124, interpret hexadecimal): xxxx1: Minimum of the offset correction, track B xxxx2: Maximum of the offset correction, track B xxx1x: Minimum of the offset correction, track A xxx2x: Maximum of the offset correction, track A xx1xx: Minimum of the amplitude correction, track B/A xx2xx: Maximum of the amplitude correction, track B/A x1xxx: Minimum of the phase error correction x2xxx: Maximum of the phase error correction 1xxxx: Minimum of the cubic correction 2xxxx: Maximum of the cubic correction See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- check mechanical mounting tolerances for encoders without their own bearings (e.g. toothed-wheel encoders). - check the plug connections (also the transition resistance). - check the encoder signals. - replace the encoder or encoder cable.

231421 <location>Encoder 1: Determined commutation position incorrect (alarm)

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	A commutation position actual value sensing error was detected. Alarm value (r2124, interpret decimal): 3: The absolute position of the serial protocol and track A/B differ by half an encoder pulse. The absolute position must have its zero position in the quadrants in which both tracks are negative. In the case of a fault, the position can be incorrect by one encoder pulse.
Remedy:	For alarm value = 3: - For a standard encoder with cable, contact the manufacturer where relevant. - correct the assignment of the tracks to the position value that is serially transferred. To do this, the two tracks must be connected, inverted, at the Sensor Module (interchange A with A* and B with B*) or, for a programmable encoder, check the zero offset of the position.

231422 <location>Encoder 1: Pulses per revolution square-wave encoder outside tolerance bandwidth

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The measured zero mark distance does not correspond to the parameterized zero mark distance. This alarm is triggered with active square-wave encoder PPR correction and re-parameterized fault 31131 if the accumulator contains larger values than p4683 or p4684. The zero mark distance for zero mark monitoring is set in p0425 (rotary encoder). Alarm value (r2124, interpret decimal): accumulated differential pulses in encoder pulses. See also: p0491 (Motor encoder fault response ENCODER)

- Remedy:**
- check that the encoder cables are routed in compliance with EMC.
 - check the plug connections.
 - check the encoder type (encoder with equidistant zero marks).
 - adapt the parameter for the distance between zero marks (p0424, p0425).
 - replace the encoder or encoder cable.

231429 <location>Encoder 1: Position difference hall sensor/track C/D and A/B too large

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The error for track C/D is greater than $\pm 15^\circ$ mechanical or $\pm 60^\circ$ electrical or the error for the Hall signals is greater than $\pm 60^\circ$ electrical.

One period of track C/D corresponds to 360° mechanical.

One period of the Hall signal corresponds to 360° electrical.

The monitoring responds if, for example, Hall sensors are connected as equivalent for the C/D tracks with the incorrect rotational sense or supply values that are not accurate enough.

Alarm value (r2124, interpret decimal):

For track C/D, the following applies:

Measured deviation as mechanical angle (16 bits with sign, 182 dec corresponds to 1°).

For Hall signals, the following applies:

Measured deviation as electrical angle (16 bits with sign, 182 dec corresponds to 1°).

See also: p0491 (Motor encoder fault response ENCODER)

- Remedy:**
- track C or D not connected.
 - correct the direction of rotation of the Hall sensor possibly connected as equivalent for track C/D.
 - check that the encoder cables are routed in compliance with EMC.
 - check the adjustment of the Hall sensor.

231431 <location>Encoder 1: Position deviation incremental/absolute too high (alarm)

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: When the zero pulse is passed, a deviation in the incremental position was detected.

For equidistant zero marks, the following applies:

- the first zero mark passed supplies the reference point for all subsequent checks. The other zero marks must have n times the distance referred to the first zero mark.

For distance-coded zero marks, the following applies:

- the first zero mark pair supplies the reference point for all subsequent checks. The other zero mark pairs must have the expected distance to the first zero mark pair.

Alarm value (r2124, interpret decimal):

Deviation in quadrants (1 pulse = 4 quadrants).

See also: p0491 (Motor encoder fault response ENCODER)

- Remedy:**
- check that the encoder cables are routed in compliance with EMC.
 - check the plug connections.
 - replace the encoder or encoder cable.
 - Clean coding disk or remove strong magnetic fields.

231432 <location>Encoder 1: Rotor position adaptation corrects deviation

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction:	NONE
Acknowledge:	NONE
Cause:	On track A/B, pulses have been lost or too many have been counted. These pulses are presently being corrected. Alarm value (r2124, interpret decimal): Last measured deviation of zero mark in increments (4 increments = 1 encoder pulse). The sign designates the direction of motion when detecting the zero mark distance.
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - replace the encoder or encoder cable. - check encoder limit frequency. - adapt the parameter for the distance between zero marks (p0424, p0425).

231442 <location>Encoder 1: Battery voltage alarm threshold reached

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	When switched-off, the encoder uses a battery to back up the multturn information. The multturn information can no longer be buffered if the battery voltage drops even further.
Remedy:	Replace battery.

231443 <location>Encoder 1: Signal level track C/D outside tolerance (alarm)

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	NONE
Acknowledge:	NONE
Cause:	The unipolar level (CP/CN or DP/DN) for encoder 1 is outside the permissible tolerance. Alarm value (r2124, interpret binary): Bit 0 = 1: Either CP or CN outside the tolerance. Bit 16 = 1: Either DP or DN outside the tolerance. The unipolar nominal signal level of the encoder must lie in the range 2500 mV +/- 500 mV. The response thresholds are < 1700 mV and > 3300 mV. Note: The signal level is not evaluated unless the following conditions are satisfied: - Sensor Module properties available (r0459.31 = 1). - monitoring active (p0437.31 = 1). See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- check that the encoder cables and shielding are routed in compliance with EMC. - check the plug connections and contacts of the encoder cable. - are the C/D tracks connected correctly (have the signal cables CP and CN or DP and DN been interchanged)? - replace the encoder cable.

231460 <location>Encoder 1: Analog sensor channel A failed

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE

Cause:	The input voltage of the analog sensor is outside the permissible limits. Alarm value (r2124, interpret decimal): 1: Input voltage outside detectable measuring range. 2: Input voltage outside measuring range set in p4673. 3: The absolute value of the input voltage has exceeded the range limit (p4676).
Remedy:	For alarm value = 1: - check the output voltage of the analog sensor. For alarm value = 2: - check the voltage setting for each encoder period (p4673). For alarm value = 3: - check the range limit setting and increase it if necessary (p4676).

231461	<location>Encoder 1: Analog sensor channel B failed
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The input voltage of the analog sensor is outside the permissible limits. Alarm value (r2124, interpret decimal): 1: Input voltage outside detectable measuring range. 2: Input voltage outside the selected measuring range (p4675). 3: The absolute value of the input voltage has exceeded the range limit (p4676).
Remedy:	For alarm value = 1: - check the output voltage of the analog sensor. For alarm value = 2: - check the voltage setting for each encoder period (p4675). For alarm value = 3: - check the range limit setting and increase it if necessary (p4676).

231462	<location>Encoder 1: Analog sensor no channel active
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	Channel A and B are not activated for the analog sensor.
Remedy:	- activate channel A and/or channel B (p4670). - check the encoder configuration (p0404.17). See also: p4670 (Analog sensor configuration)

231463	<location>Encoder 1: Analog sensor position value exceeds limit value
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The position value has exceeded the permissible range of -0.5 ... +0.5. Alarm value (r2124, interpret decimal): 1: Position value from the LVDT sensor. 2: Position value from the encoder characteristic.

Remedy: For alarm value = 1:
- check the LVDT ratio (p4678).
- check the reference signal connection at track B.
For alarm value = 2:
- check the coefficients of the characteristic (p4663 ... p4666).

231470 <location>Encoder 1: Encoder signals an internal error (X521.7)

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value: -
Reaction: NONE
Acknowledge: NONE
Cause: For the Sensor Module Cabinet 30 (SMC30), a dirty encoder is signaled via a 0 signal at terminal X521.7.
Remedy: - check the plug connections.
- replace the encoder or encoder cable.

231500 <location>Encoder 1: Position tracking traversing range exceeded

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value: -
Reaction: Infeed: OFF1 (NONE, OFF2)
Servo: OFF1 (NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge: IMMEDIATELY
Cause: For a configured linear axis without modulo correction, the drive/encoder has exceeded the maximum possible traversing range. The value should be read in p0412 and interpreted as the number of motor revolutions.
For p0411.0 = 1, the maximum traversing range for the configured linear axis is defined to be 64x (+/- 32x) of p0421.
For p0411.3 = 1, the maximum traversing range for the configured linear axis is preset (default value) to the highest possible value and is +/-p0412/2 (rounded off to complete revolutions). The highest possible value depends on the pulse number (p0408) and the fine resolution (p0419).
Remedy: The fault should be resolved as follows:
- select encoder commissioning (p0010 = 4).
- reset the position tracking as follows (p0411.2 = 1).
- deselect encoder commissioning (p0010 = 0).
The fault should then be acknowledged and the absolute encoder adjusted.

231501 <location>Encoder 1: Position tracking encoder position outside tolerance window

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value: %1
Reaction: Infeed: OFF1 (NONE, OFF2)
Servo: OFF1 (NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge: IMMEDIATELY
Cause: When switched off, the drive/encoder was moved through a distance greater than was parameterized in the tolerance window. It is possible that there is no longer any reference between the mechanical system and encoder.
Fault value (r0949, interpret decimal):
Deviation (difference) to the last encoder position in increments of the absolute value.
The sign designates the traversing direction.
Note:
The deviation (difference) found is also displayed in r0477.
See also: p0413 (Measuring gear position tracking tolerance window), r0477 (Measuring gear position difference)

Remedy: Reset the position tracking as follows:

- select encoder commissioning (p0010 = 4).
- reset the position tracking as follows (p0411.2 = 1).
- deselect encoder commissioning (p0010 = 0).

The fault should then be acknowledged and, if necessary, the absolute encoder adjusted (p2507).
See also: p0010

231502 <location>Encoder 1: Encoder with measuring gear without valid signals

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: Infeed: OFF1 (OFF2)
Servo: OFF1 (OFF2, OFF3)
Hla: OFF1 (OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause: The encoder with measuring gear no longer provides any valid signals.

Remedy: It must be ensured that all of the encoders, with mounted measuring gear, provide valid actual values in operation.

231503 <location>Encoder 1: Position tracking cannot be reset

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: Infeed: OFF1 (NONE, OFF2)
Servo: OFF1 (NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause: The position tracking for the measuring gear cannot be reset.

Remedy: The fault should be resolved as follows:

- select encoder commissioning (p0010 = 4).
- reset the position tracking as follows (p0411.2 = 1).
- deselect encoder commissioning (p0010 = 0).

The fault should then be acknowledged and the absolute encoder adjusted.

231700 <location>Encoder 1: Functional safety monitoring initiated

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: Fault cause: %1 bin

Reaction: NONE

Acknowledge: NONE

Cause: Functional safety was activated. Self-test of the DRIVE-CLiQ encoder has detected a fault.
Alarm value (r2124, interpret binary):
Bit x = 1: Effectivity test x unsuccessful.

Remedy: Replace encoder.

231800 <location>Encoder 1: Group signal

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: Infeed: OFF2 (NONE)
Servo: ENCODER (IASC/DCBRK, NONE)
Hla: ENCODER (NONE)

Acknowledge: NONE

Cause: The motor encoder has detected at least one fault.
See also: p0491 (Motor encoder fault response ENCODER)

Remedy: Evaluate the other messages that are presently available.

231801 **<location>Encoder 1 DRIVE-CLiQ: Sign-of-life missing**

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: Component number: %1, fault cause: %2

Reaction: Infeed: OFF2 (NONE)
Servo: ENCODER (IASC/DCBRK, NONE)
Hla: ENCODER (NONE)

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder involved.
Fault cause:
10 (= 0A hex):
The sign-of-life bit in the receive telegram is not set.
Note regarding the message value:
The individual information is coded as follows in the message value (r0949/r2124):
0000yyxx hex: yy = component number, xx = error cause
See also: p0491 (Motor encoder fault response ENCODER)

Remedy: - check the electrical cabinet design and cable routing for EMC compliance
- replace the component involved.

231802 **<location>Encoder 1: Time slice overflow**

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Infeed: OFF2 (NONE)
Servo: ENCODER (IASC/DCBRK, NONE)
Hla: ENCODER (NONE)

Acknowledge: IMMEDIATELY

Cause: A time slice overflow has occurred in encoder 1.
Fault value (r0949, interpret hexadecimal):
yx hex: y = function involved (Siemens-internal fault diagnostics), x = time slice involved
x = 9:
Time slice overflow of the fast (current controller clock cycle) time slice.
x = A:
Time slice overflow of the average time slice.
x = C:
Time slice overflow of the slow time slice.
yx = 3E7:
Timeout when waiting for SYNO (e.g. unexpected return to non-cyclic operation).
See also: p0491 (Motor encoder fault response ENCODER)

Remedy: Increase the current controller sampling time
Note:
For a current controller sampling time = 31.25 µs, use an SMx20 with Article No. 6SL3055-0AA00-5xA3.

231804 **<location>Encoder 1: Sensor Module checksum error**

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction:	Infeed: OFF2 (NONE) Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	POWER ON (IMMEDIATELY)
Cause:	A checksum error has occurred when reading-out the program memory on the Sensor Module. Fault value (r0949, interpret hexadecimal): yyyyxxxx hex yyyy: Memory area involved. xxxx: Difference between the checksum at POWER ON and the actual checksum. See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- carry out a POWER ON (switch-off/switch-on). - upgrade firmware to later version (>= V2.6 HF3, >= V4.3 SP2, >= V4.4). - check whether the permissible ambient temperature for the component is maintained. - replace the Sensor Module.

231805	<location>Encoder 1: EEPROM checksum error
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Infeed: OFF2 (NONE) Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	IMMEDIATELY
Cause:	Data in the EEPROM corrupted . Fault value (r0949, interpret hexadecimal): 01: EEPROM access error. 02: Too many blocks in the EEPROM. See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	Replace the module.

231806	<location>Encoder 1: Initialization error
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Infeed: OFF2 (NONE) Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	PULSE INHIBIT

Cause:	The encoder was not successfully initialized. Fault value (r0949, interpret binary): Bit 0, 1: Encoder initialization with the motor rotating has failed (deviation involving coarse and fine position in encoder pulses/4). Bit 2: Mid-voltage matching for track A unsuccessful. Bit 3: Mid-voltage matching for track B unsuccessful. Bit 4: Mid-voltage matching for acceleration input unsuccessful. Bit 5: Mid-voltage matching for track safety A unsuccessful. Bit 6: Mid-voltage matching for track safety B unsuccessful. Bit 7: Mid-voltage matching for track C unsuccessful. Bit 8: Mid-voltage matching for track D unsuccessful. Bit 9: Mid-voltage matching for track R unsuccessful. Bit 10: The difference in mid-voltages between A and B is too great (> 0.5 V) Bit 11: The difference in mid-voltages between C and D is too great (> 0.5 V) Bit 12: The difference in mid-voltages between safety A and safety B is too great (> 0.5 V) Bit 13: The difference in mid-voltages between A and safety B is too great (> 0.5 V) Bit 14: The difference in mid-voltages between B and safety A is too great (> 0.5 V) Bit 15: The standard deviation of the calculated mid-voltages is too great (> 0.3 V) Bit 16: Internal fault - fault when reading a register (CAFE) Bit 17: Internal fault - fault when writing a register (CAFE) Bit 18: Internal fault: No mid-voltage matching available Bit 19: Internal error - ADC access error. Bit 20: Internal error - no zero crossover found. Bit 28: Error while initializing the EnDat 2.2 measuring unit. Bit 29: Error when reading out the data from the EnDat 2.2 measuring unit. Bit 30: EEPROM checksum of the EnDat 2.2 measuring unit incorrect. Bit 31: Data of the EnDat 2.2 measuring unit inconsistent. Note: Bit 0, 1: Up to 6SL3055-0AA00-5*A0 Bits 2 ... 20: 6SL3055-0AA00-5*A1 and higher See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	Acknowledge fault. If the fault cannot be acknowledged: Bits 2 ... 9: Check encoder power supply. Bits 2 ... 14: Check the corresponding cable. Bit 15 with no other bits: Check track R, check settings in p0404. Bit 28: Check the cable between the EnDat 2.2 converter and the measuring unit. Bit 29 ... 31: Replace the defective measuring unit.

231811	<location>Encoder 1: Encoder serial number changed
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE

Cause:	The serial number of the motor encoder of a synchronous motor has changed. The change was only checked for encoders with serial number (e.g. EnDat encoders) and built-in motors (e.g. p0300 = 401) or third-party motors (p0300 = 2). Cause 1: - the encoder was replaced. Cause 2: - a third-party, built-in or linear motor was re-commissioned. Cause 3: - the motor with integrated and adjusted encoder was replaced. Cause 4: - the firmware was updated to a version that checks the encoder serial number. Note: With closed-loop position control, the serial number is accepted when starting the adjustment (p2507 = 2). When the encoder is adjusted (p2507 = 3), the serial number is checked for changes and if required, the adjustment is reset (p2507 = 1). Proceed as follows to hide serial number monitoring: - set the following serial numbers for the corresponding Encoder Data Set: p0441= FF, p0442 = 0, p0443 = 0, p0444 = 0, p0445 = 0. - parameterize F07414 as message type N (p2118, p2119). See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	For causes 1, 2: Carry out an automatic adjustment using the pole position identification routine. Acknowledge fault. Initiate the pole position identification routine with p1990 = 1. Then check that the pole position identification routine is correctly executed. SERVO: If a pole position identification technique is selected in p1980, and if p0301 does not contain a motor type with an encoder adjusted in the factory, then p1990 is automatically activated. or Set the adjustment via p0431. In this case, the new serial number is automatically accepted. or Mechanically adjust the encoder. Accept the new serial number with p0440 = 1. For causes 3, 4: Accept the new serial number with p0440 = 1.

231812 <location>Encoder 1: Requested cycle or RX/TX timing not supported

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	A cycle requested from the Control Unit or RX/TX timing is not supported. Fault value (r0949, interpret decimal): 0: Application cycle is not supported. 1: DRIVE-CLiQ cycle is not supported. 2: Distance between RX and TX instants in time too low. 3: TX instant in time too early.
Remedy:	Carry out a POWER ON (switch-off/switch-on) for all components.

231813 <location>Encoder 1: Hardware logic unit failed

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	Infeed: NONE Servo: ENCODER (IASC/DCBRK, NONE) HLA: ENCODER (NONE)
Acknowledge:	PULSE INHIBIT

Cause: The logic unit of the DRIVE-CLiQ encoder has failed.
Fault value (r0949, interpret binary):
Bit 0: ALU watchdog has responded.
Bit 1: ALU has detected a sign-of-life error.

Remedy: When the error reoccurs, replace the encoder.

231820 <location>Encoder 1 DRIVE-CLiQ: Telegram error

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: Component number: %1, fault cause: %2

Reaction: Infeed: OFF2
Servo: ENCODER (IASC/DCBRK, NONE)
Hla: ENCODER (NONE)

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder concerned.
Fault cause:
1 (= 01 hex):
Checksum error (CRC error).
2 (= 02 hex):
Telegram is shorter than specified in the length byte or in the receive list.
3 (= 03 hex):
Telegram is longer than specified in the length byte or in the receive list.
4 (= 04 hex):
The length of the receive telegram does not match the receive list.
5 (= 05 hex):
The type of the receive telegram does not match the receive list.
6 (= 06 hex):
The address of the component in the telegram and in the receive list do not match.
7 (= 07 hex):
A SYNC telegram is expected - but the received telegram is not a SYNC telegram.
8 (= 08 hex):
No SYNC telegram is expected - but the received telegram is one.
9 (= 09 hex):
The error bit in the receive telegram is set.
16 (= 10 hex):
The receive telegram is too early.
Note regarding the message value:
The individual information is coded as follows in the message value (r0949/r2124):
0000yyxx hex: yy = component number, xx = error cause
See also: p0491 (Motor encoder fault response ENCODER)

Remedy: - carry out a POWER ON (switch-off/switch-on).
- check the electrical cabinet design and cable routing for EMC compliance
- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

231835 <location>Encoder 1 DRIVE-CLiQ: Cyclic data transfer error

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: Component number: %1, fault cause: %2

Reaction: Infeed: OFF2
Servo: ENCODER (IASC/DCBRK, NONE)
Hla: ENCODER (NONE)

Acknowledge: IMMEDIATELY

Cause:	A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder concerned. The nodes do not send and receive in synchronism. Fault cause: 33 (= 21 hex): The cyclic telegram has not been received. 34 (= 22 hex): Timeout in the telegram receive list. 64 (= 40 hex): Timeout in the telegram send list. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- carry out a POWER ON. - replace the component involved.

231836 <location>Encoder 1 DRIVE-CLiQ: Send error for DRIVE-CLiQ data

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Infeed: OFF2 Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder involved. Data were not able to be sent. Fault cause: 65 (= 41 hex): Telegram type does not match send list. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	Carry out a POWER ON.

231837 <location>Encoder 1 DRIVE-CLiQ: Component fault

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Infeed: OFF2 Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	IMMEDIATELY

Cause:	Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded. Fault cause: 32 (= 20 hex): Error in the telegram header. 35 (= 23 hex): Receive error: The telegram buffer memory contains an error. 66 (= 42 hex): Send error: The telegram buffer memory contains an error. 67 (= 43 hex): Send error: The telegram buffer memory contains an error. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...). - check the electrical cabinet design and cable routing for EMC compliance - if required, use another DRIVE-CLiQ socket (p9904). - replace the component involved.

231845	<location>Encoder 1 DRIVE-CLiQ: Cyclic data transfer error
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Infeed: OFF2 Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder involved. Fault cause: 11 (= 0B hex): Synchronization error during alternating cyclic data transfer. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	Carry out a POWER ON (switch-off/switch-on).

231850	<location>Encoder 1: Encoder evaluation internal software error
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Infeed: OFF2 (NONE) Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	POWER ON

Cause:	An internal software error has occurred in the Sensor Module of encoder 1. Fault value (r0949, interpret decimal): 1: Background time slice is blocked. 2: Checksum over the code memory is not OK. 10000: OEM memory of the EnDat encoder contains data that cannot be interpreted. 11000 ... 11499: Descriptive data from EEPROM incorrect. 11500 ... 11899: Calibration data from EEPROM incorrect. 11900 ... 11999: Configuration data from EEPROM incorrect. 12000 ... 12008: communication with analog/digital converter faulted. 16000: DRIVE-CLiQ encoder initialization application error. 16001: DRIVE-CLiQ encoder initialization ALU error. 16002: DRIVE-CLiQ encoder HSI / SISI initialization error. 16003: DRIVE-CLiQ encoder safety initialization error. 16004: DRIVE-CLiQ encoder internal system error. See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- replace the Sensor Module. - if required, upgrade the firmware in the Sensor Module. - contact Technical Support.

231851 <location>Encoder 1 DRIVE-CLiQ (CU): Sign-of-life missing

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Infeed: NONE (OFF1, OFF2) Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 1) involved to the Control Unit. The DRIVE-CLiQ component did not set the sign-of-life to the Control Unit. Fault cause: 10 (= 0A hex): The sign-of-life bit in the receive telegram is not set. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- Upgrade the firmware of the component involved. - carry out a POWER ON (switch-off/switch-on) for the component involved.

231860 <location>Encoder 1 DRIVE-CLiQ (CU): Telegram error

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Infeed: NONE (OFF1, OFF2) Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	IMMEDIATELY

Cause:	A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 1) involved to the Control Unit. Fault cause: 1 (= 01 hex): Checksum error (CRC error). 2 (= 02 hex): Telegram is shorter than specified in the length byte or in the receive list. 3 (= 03 hex): Telegram is longer than specified in the length byte or in the receive list. 4 (= 04 hex): The length of the receive telegram does not match the receive list. 5 (= 05 hex): The type of the receive telegram does not match the receive list. 6 (= 06 hex): The address of the power unit in the telegram and in the receive list do not match. 9 (= 09 hex): The DRIVE-CLiQ communication from the DRIVE-CLiQ component involved to the Control Unit signals that the supply voltage has failed. 16 (= 10 hex): The receive telegram is too early. 17 (= 11 hex): CRC error and the receive telegram is too early. 18 (= 12 hex): The telegram is shorter than that specified in the length byte or in the receive list and the receive telegram is too early. 19 (= 13 hex): The telegram is longer than that specified in the length byte or in the receive list and the receive telegram is too early. 20 (= 14 hex): The length of the receive telegram does not match the receive list and the receive telegram is too early. 21 (= 15 hex): The type of the receive telegram does not match the receive list and the receive telegram is too early. 22 (= 16 hex): The address of the power unit in the telegram and in the receive list does not match and the receive telegram is too early. 25 (= 19 hex): The error bit in the receive telegram is set and the receive telegram is too early. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON (switch-off/switch-on). - check the electrical cabinet design and cable routing for EMC compliance - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

231875	<location>Encoder 1: power supply voltage failed
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Infeed: OFF2 Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	IMMEDIATELY

Cause:	The DRIVE-CLiQ communication from the DRIVE-CLiQ component involved to the Control Unit signals that the supply voltage has failed. Fault cause: 9 (= 09 hex): The power supply voltage for the components has failed. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON (switch-off/switch-on). - check the power supply voltage wiring for the DRIVE-CLiQ component (interrupted cable, contacts, ...). - check the dimensioning of the power supply for the DRIVE-CLiQ component.

231885 <location>Encoder 1 DRIVE-CLiQ (CU): Cyclic data transfer error

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Infeed: NONE (OFF1, OFF2) Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 1) involved to the Control Unit. The nodes do not send and receive in synchronism. Fault cause: 26 (= 1A hex): Sign-of-life bit in the receive telegram not set and the receive telegram is too early. 33 (= 21 hex): The cyclic telegram has not been received. 34 (= 22 hex): Timeout in the telegram receive list. 64 (= 40 hex): Timeout in the telegram send list. 98 (= 62 hex): Error at the transition to cyclic operation. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the power supply voltage of the component involved. - carry out a POWER ON (switch-off/switch-on). - replace the component involved.

231886 <location>Encoder 1 DRIVE-CLiQ (CU): Error when sending DRIVE-CLiQ data

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Infeed: NONE (OFF1, OFF2) Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	IMMEDIATELY

Cause:	A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 1) involved to the Control Unit. Data were not able to be sent. Fault cause: 65 (= 41 hex): Telegram type does not match send list. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON. - check whether the firmware version of the encoder (r0148) matches the firmware version of Control Unit (r0018).

231887 <location>Encoder 1 DRIVE-CLiQ (CU): Component fault

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Infeed: NONE (OFF1, OFF2) Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	IMMEDIATELY
Cause:	Fault detected on the DRIVE-CLiQ component involved (Sensor Module for encoder 1). Faulty hardware cannot be excluded. Fault cause: 32 (= 20 hex): Error in the telegram header. 35 (= 23 hex): Receive error: The telegram buffer memory contains an error. 66 (= 42 hex): Send error: The telegram buffer memory contains an error. 67 (= 43 hex): Send error: The telegram buffer memory contains an error. 96 (= 60 hex): Response received too late during runtime measurement. 97 (= 61 hex): Time taken to exchange characteristic data too long. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...). - check the electrical cabinet design and cable routing for EMC compliance - if required, use another DRIVE-CLiQ socket (p9904). - replace the component involved.

231895 <location>Encoder 1 DRIVE-CLiQ (CU): Alternating cyclic data transfer error

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Infeed: NONE (OFF1, OFF2) Servo: ENCODER (IASC/DCBRK, NONE) Hla: ENCODER (NONE)
Acknowledge:	IMMEDIATELY

Cause:	A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 1) involved to the Control Unit. Fault cause: 11 (= 0B hex): Synchronization error during alternating cyclic data transfer. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON.

231896	<location>Encoder 1 DRIVE-CLiQ (CU): Inconsistent component properties
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Component number: %1
Reaction:	Infeed: NONE (OFF1, OFF2) Servo: OFF2 (ENCODER, IASC/DCBRK, NONE, OFF1, OFF3, STOP2) Hla: OFF2 (ENCODER, NONE, OFF1, OFF3, STOP2)
Acknowledge:	IMMEDIATELY
Cause:	The properties of the DRIVE-CLiQ component (Sensor Module for encoder 1), specified by the fault value, have changed in an incompatible fashion with respect to the properties when booted. One cause can be, e.g. that a DRIVE-CLiQ cable or DRIVE-CLiQ component has been replaced. Fault value (r0949, interpret decimal): Component number.
Remedy:	- carry out a POWER ON. - when a component is replaced, the same component type and if possible the same firmware version should be used. - when a cable is replaced, only cables whose length is the same as or as close as possible to the length of the original cables should be used (ensure compliance with the maximum cable length).

231899	<location>Encoder 1: Unknown fault
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	New message: %1
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: ENCODER (IASC/DCBRK, NONE, OFF1, OFF2, OFF3, STOP2) Hla: ENCODER (NONE, OFF1, OFF2, OFF3, STOP2)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	A fault occurred on the Sensor Module for encoder 1 that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit. Fault value (r0949, interpret decimal): Fault number. Note: If required, the significance of this new fault can be read about in a more recent description of the Control Unit. See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- replace the firmware on the Sensor Module by an older firmware version (r0148). - upgrade the firmware on the Control Unit (r0018).

231902	<location>Encoder 1: SPI-BUS error occurred
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	Error when operating the internal SPI bus. Alarm value (r2124, interpret hexadecimal): Only for internal Siemens troubleshooting.

Remedy:

- replace the Sensor Module.
- if required, upgrade the firmware in the Sensor Module.
- contact Technical Support.

231903 <location>Encoder 1: I2C-BUS error occurred

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: Error when operating the internal I2C bus.
Alarm value (r2124, interpret hexadecimal):
Only for internal Siemens troubleshooting.

Remedy:

- replace the Sensor Module.
- if required, upgrade the firmware in the Sensor Module.
- contact Technical Support.

231905 <location>Encoder 1: Encoder parameterization error

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: Parameter: %1, supplementary information: %2

Reaction: Infeed: OFF2 (NONE, OFF1)

Servo: ENCODER (IASC/DCBRK, NONE, OFF1, OFF2, OFF3, STOP2)

Hla: ENCODER (NONE, OFF1, OFF2, OFF3, STOP2)

Acknowledge: IMMEDIATELY

Cause:	An error was identified in the encoder parameterization. It is possible that the parameterized encoder type does not match the connected encoder. The parameter involved can be determined as follows: - determine the parameter number using the fault value (r0949). - determine the parameter index (p0187). Fault value (r0949, interpret decimal): yyyyxxx dec: yyyy = supplementary information, xxx = parameter xxx = 421: For an EnDat/SSI encoder, the absolute position in the protocol must be less than or equal to 30 bits. yyyy = 0: No additional information available. yyyy = 1: The component does not support HTL level (p0405.1 = 0) combined with track monitoring A/B <> -A/B (p0405.2 = 1). yyyy = 2: A code number for an identified encoder has been entered into p0400, however, no identification was carried out. Please start a new encoder identification. yyyy = 3: A code number for an identified encoder has been entered into p0400, however, no identification was carried out. Please select a listed encoder in p0400 with a code number < 10000. yyyy = 4: This component does not support SSI encoders (p0404.9 = 1) without track A/B. yyyy = 5: For SQW encoder, value in p4686 greater than in p0425. yyyy = 6: DRIVE-CLiQ encoder cannot be used with this firmware version. yyyy = 7: For an SQW encoder, the XIST1 correction (p0437.2) is only permitted for equidistant zero marks. yyyy = 8: The motor pole pair width is not supported by the linear scale being used. yyyy = 9: The length of the position in the EnDat protocol may be a maximum of 32 bits. yyyy = 10: The connected encoder is not supported. yyyy = 11: The hardware does not support track monitoring. See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- check whether the connected encoder type matches the encoder that has been parameterized. - correct the parameter specified by the fault value (r0949) and p0187. - re parameter number = 314: - check the pole pair number and measuring gear ratio. The quotient of the "pole pair number" divided by the "measuring gear ratio" must be less than or equal to 1000 ((r0313 * p0433) / p0432 <= 1000).

231912	<location>Encoder 1: Device combination is not permissible
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Infeed: ENCODER (NONE) Servo: ENCODER (IASC/DCBRK, NONE) HLA: ENCODER (NONE)
Acknowledge:	PULSE INHIBIT

Cause:	The selected device combination is not supported. Fault value (r0949, interpret decimal): 1003: The connected measuring unit cannot be operated with the EnDat 2.2 converter. For instance, the measuring unit has a pulse number/resolution of 2^n. 1005: The type of measuring unit (incremental) is not supported by the EnDat 2.2 converter. 1006: The maximum duration of the EnDat transfer (31.25 μs) was exceeded. 2001: The set combination of current controller cycle, DP cycle and Safety cycle is not supported by the EnDat 2.2 converter. 2002: The resolution of the linear measuring unit does not match the pole pair width of the linear motor Pole pair width, minimum = $p0422 * 2^{20}$
Remedy:	For fault value = 1003, 1005, 1006: - Use a measuring unit that is permissible. For fault value = 2001: - set a permissible cycle combination (if required, use standard settings). For fault value = 2002: - Use a measuring unit with a lower resolution (p0422).

231915 <location>Encoder 1: Encoder configuration error

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The configuration for encoder 1 is incorrect. Alarm value (r2124, interpret decimal): 1: Re-parameterization between fault/alarm is not permissible. 2: The cyclic DQ receive telegram is too long and is limited. 3: The cyclic DQ send telegram is too long and is limited. 419: When the fine resolution Gx_XIST2 is configured, the encoder identifies a maximum possible absolute position actual value (r0483) that can no longer be represented within 32 bits.
Remedy:	For alarm value = 1: No re-parameterization between fault/alarm. For alarm value = 419: Reduce the fine resolution (p0419) or deactivate the monitoring (p0437.25), if the complete multiturn range is not required.

231916 <location>Encoder 1: Encoder parameterization error

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Parameter: %1, supplementary information: %2
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: ENCODER (IASC/DCBRK, NONE, OFF1, OFF2, OFF3, STOP2) Hla: ENCODER (NONE, OFF1, OFF2, OFF3, STOP2)
Acknowledge:	IMMEDIATELY

Cause:	An encoder parameter was detected as being incorrect. It is possible that the parameterized encoder type does not match the connected encoder. The parameter involved can be determined as follows: - determine the parameter number using the fault value (r0949). - determine the parameter index (p0187). Fault value (r0949, interpret decimal): Parameter number. See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- check whether the connected encoder type matches the encoder that has been parameterized. - correct the parameter specified by the fault value (r0949) and p0187.

231920 <location>Encoder 1: Temperature sensor fault (motor)

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1, channel number: %2
Reaction:	NONE
Acknowledge:	NONE
Cause:	The motor detected a fault when evaluating the temperature sensor. Fault cause: 1 (= 01 hex): Wire breakage or sensor not connected. KTY: R > 1630 Ohm, PT1000: R > 1720 Ohm 2 (= 02 hex): Measured resistance too low. PTC: R < 20 Ohm, KTY: R < 50 Ohm, PT1000: R < 603 Ohm Additional values: Only for internal Siemens troubleshooting. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = channel number, xx = error cause See also: p0491 (Motor encoder fault response ENCODER)
Remedy:	- check that the encoder cable is the correct type and is correctly connected. - check the temperature sensor selection in p0600 to p0603. - replace the Sensor Module (hardware defect or incorrect calibration data).

231930 <location>Encoder 1: Data logger has saved data

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	For the activated function "Data logger" (p0437.0 = 1) a fault has occurred with the Sensor Module. This alarm indicates that the diagnostics data corresponding to the fault was saved on the memory card. The diagnostics data is saved in the following folder: /USER/SINAMICS/DATA/SMTRC00.BIN ... /USER/SINAMICS/DATA/SMTRC07.BIN /USER/SINAMICS/DATA/SMTRCIDX.TXT The following information is contained in the TXT file: - Display of the last written BIN file. - Number of write operations that are still possible (from 10000 downwards). Note: Only Siemens can evaluate the BIN files.

Remedy: Not necessary.
This alarm is automatically withdrawn.
The data logger is ready to record the next fault case.

231940 <location>Encoder 1: Spindle sensor S1 voltage incorrect

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The voltage of analog sensor S1 is outside the permissible range.
Alarm value (r2124, interpret decimal):
Signal level from sensor S1.
Note:
A signal level of 500 mV corresponds to the numerical value 500 dec.

Remedy: - check the clamped tool.
- check the tolerance and if required, adapt (p5040).
- check the thresholds and if required, adapt (p5041).
- check analog sensor S1 and connections.
See also: p5040 (Spindle voltage threshold values tolerance), p5041 (Spindle voltage threshold values)

231950 <location>Encoder 1: Internal software error

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: ENCODER (OFF2)

Acknowledge: POWER ON

Cause: An internal software error has occurred.
Fault value (r0949, interpret decimal):
The fault value contains information regarding the fault source.
Only for internal Siemens troubleshooting.

Remedy: - if necessary, upgrade the firmware in the Sensor Module to a later version.
- contact Technical Support.

231999 <location>Encoder 1: Unknown alarm

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: New message: %1

Reaction: NONE

Acknowledge: NONE

Cause: A alarm has occurred on the Sensor Module for encoder 1 that cannot be interpreted by the Control Unit firmware.
This can occur if the firmware on this component is more recent than the firmware on the Control Unit.
Alarm value (r2124, interpret decimal):
Alarm number.
Note:
If required, the significance of this new alarm can be read about in a more recent description of the Control Unit.
See also: p0491 (Motor encoder fault response ENCODER)

Remedy: - replace the firmware on the Sensor Module by an older firmware version (r0148).
- upgrade the firmware on the Control Unit (r0018).

232100 <location>Encoder 2: Zero mark distance error

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2) Hla: OFF1 (NONE, OFF2, OFF3, STOP2)
Acknowledge:	PULSE INHIBIT
Cause:	The measured zero mark distance does not correspond to the parameterized zero mark distance. For distance-coded encoders, the zero mark distance is determined from zero marks detected pairs. This means that if a zero mark is missing, depending on the pair generation, this cannot result in a fault and also has no effect in the system. The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder). Fault value (r0949, interpret decimal): Last measured zero mark distance in increments (4 increments = 1 encoder pulse). The sign designates the direction of motion when detecting the zero mark distance.
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - check the encoder type (encoder with equidistant zero marks). - adapt the parameter for the distance between zero marks (p0424, p0425). - if message output above speed threshold, reduce filter time if necessary (p0438). - replace the encoder or encoder cable.

232101	<location>Encoder 2: Zero mark failed
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2) Hla: OFF1 (NONE, OFF2, OFF3, STOP2)
Acknowledge:	PULSE INHIBIT
Cause:	The 1.5 x parameterized zero mark distance was exceeded. The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder). Fault value (r0949, interpret decimal): Number of increments after POWER ON or since the last zero mark that was detected (4 increments = 1 encoder pulse).
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - check the encoder type (encoder with equidistant zero marks). - adapt the parameter for the clearance between zero marks (p0425). - if message output above speed threshold, reduce filter time if necessary (p0438). - when p0437.1 is active, check p4686. - replace the encoder or encoder cable.

232103	<location>Encoder 2: Signal level zero track (track R) outside tolerance
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	R track: %1
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY

Cause:	The zero mark signal level (track R) does not lie within the tolerance bandwidth for encoder 2. The fault can be initiated when the unipolar voltage level is exceeded (RP/RN) or if the differential amplitude is undershot. Fault value (r0949, interpret hexadecimal): yyyyxxxx hex: yyyy = 0, xxxx = Signal level, track R (16 bits with sign) The response thresholds of the unipolar signal levels of the encoder are between < 1400 mV and > 3500 mV. The response threshold for the differential signal level of the encoder is < -1600 mV. A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec. Note: The analog value of the amplitude error is not measured at the same time with the hardware fault output by the Sensor Module. The fault value can only be represented between -32768 ... 32767 dec (-770 ... 770 mV). The signal level is not evaluated unless the following conditions are satisfied: - Sensor Module properties available (r0459.31 = 1). - monitoring active (p0437.31 = 1).
Remedy:	- check the speed range; frequency characteristic (amplitude characteristic) of the measuring equipment might not be sufficient for the speed range - check that the encoder cables and shielding are routed in compliance with EMC. - check the plug connections and contacts of the encoder cable. - check the encoder type (encoder with zero marks). - check whether the zero mark is connected and the signal cables RP and RN have been connected correctly (not connected with the incorrect polarity). - replace the encoder cable. - if the coding disk is soiled or the lighting aged, replace the encoder.

232110 <location>Encoder 2: Serial communications error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	PULSE INHIBIT
Cause:	There is an error in the transfer of the serial communication protocol between the encoder and internal or external evaluation module. Fault value (r0949, interpret binary): For an EnDat 2.1 encoder, the significance of the fault value is as follows: Bit 0: Alarm bit in the position protocol. Bit 1: Incorrect quiescent level on the data line. Bit 2: Encoder does not respond (does not supply a start bit within 50 ms). Bit 3: CRC error: The checksum in the protocol from the encoder does not match the data. Bit 4: Encoder acknowledgment error: The encoder incorrectly understood the task (request) or cannot execute it. Bit 5: Internal error in the serial driver: An illegal mode command was requested. Bit 6: Timeout when cyclically reading. Bit 7: Timeout for the register communication. Bit 8: Protocol is too long (e.g. > 64 bits). Bit 9: Receive buffer overflow. Bit 10: Frame error when reading twice. Bit 11: Parity error. Bit 12: Data line signal level error during the monoflop time. Bit 13: Data line incorrect. Bit 14: Fault for the register communication. Bit 15: Internal communication error. Note: For an EnDat 2.2 encoder, the significance of the fault value for F3x135 (x = 1, 2, 3) is described.

Remedy:	For fault value, bit 0 = 1: - Enc defect F31111 may provide additional details. For fault value, bit 1 = 1: - incorrect encoder type / replace the encoder or encoder cable. For fault value, bit 2 = 1: - incorrect encoder type / replace the encoder or encoder cable. For fault value, bit 3 = 1: - EMC / connect the cable shield, replace the encoder or encoder cable. For fault value, bit 4 = 1: - EMC / connect the cable shield, replace the encoder or encoder cable, replace the Sensor Module. For fault value, bit 5 = 1: - EMC / connect the cable shield, replace the encoder or encoder cable, replace the Sensor Module. For fault value, bit 6 = 1: - Update Sensor Module firmware. For fault value, bit 7 = 1: - incorrect encoder type / replace the encoder or encoder cable. For fault value, bit 8 = 1: - check parameterization (p0429.2). For fault value, bit 9 = 1: - EMC / connect the cable shield, replace the encoder or encoder cable, replace the Sensor Module. For fault value, bit 10 = 1: - check parameterization (p0429.2, p0449). For fault value, bit 11 = 1: - check parameterization (p0436). For fault value, bit 12 = 1: - check parameterization (p0429.6). For fault value, bit 13 = 1: - check data line. For fault value, bit 14 = 1: - incorrect encoder type / replace the encoder or encoder cable.
----------------	---

232111 <location>Encoder 2: Encoder signals an internal error (detailed information)

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin, additional information: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	PULSE INHIBIT
Cause:	The encoder error word provides detailed information (error bit). For p0404.8 = 0, the following applies: Fault value for internal Siemens troubleshooting. For p0404.8 = 1, the following applies: Fault value (r0949, interpret binary): yyyyxxx hex: yyyy = supplementary information, xxx = fault cause yyyy = 0: Bit 0: Lighting system failed. Bit 1: Signal amplitude too low. Bit 2: Position value incorrect. Bit 3: Encoder power supply overvoltage condition. Bit 4: Encoder power supply undervoltage condition. Bit 5: Encoder power supply overcurrent condition. Bit 6: The battery must be changed.

Remedy:

For yyyy = 0:

For fault value, bit 0 = 1:
Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor.

For fault value, bit 1 = 1:
Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor.

For fault value, bit 2 = 1:
Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor.

For fault value, bit 3 = 1:
5 V power supply voltage fault.
When using an SMC: Check the plug-in cable between the encoder and SMC or replace the SMC.
When a motor encoder with a direct DRIVE-CLiQ connection is used: Replace the motor.

For fault value, bit 4 = 1:
5 V power supply voltage fault.
When using an SMC: Check the plug-in cable between the encoder and SMC or replace the SMC.
When using a motor with DRIVE-CLiQ: Replace the motor.

For fault value, bit 5 = 1:
Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor.

For fault value, bit 6 = 1:
The battery must be changed (only for encoders with battery back-up).

For yyyy = 1:
Encoder is defective. Replace encoder.

232112 <location>Encoder 2: Encoder signals an internal error

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: PULSE INHIBIT

Cause: The encoder signals a set error bit via the serial protocol.
Fault value (r0949, interpret binary):
Bit 0: Fault bit in the position protocol.

Remedy: For fault value, bit 0 = 1:
In the case of an EnDat encoder, F31111 may provide further details.

232115 <location>Encoder 2: Signal level track A or B too low

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: A track: %1, B-track: %2

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: PULSE INHIBIT

Cause:	The signal level (root from $A^2 + B^2$) of the encoder falls below the permissible limit value. Fault value (r0949, interpret hexadecimal): yyyyxxxx hex: yyyy = Signal level, track B (16 bits with sign). xxxx = Signal level, track A (16 bits with sign). The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %). The response threshold is < 170 mV (input frequency ≤ 256 kHz) or < 120 mV (input frequency > 256 kHz). A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec. Note for Sensor Modules for resolvers (e.g. SMC10): The nominal signal level is at 2900 mV (2.0 Vrms). The response threshold is < 1070 mV. A signal level of 2900 mV peak value corresponds to the numerical value 6666 hex = 26214 dec. Note: The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.
Remedy:	- check that the encoder cables and shielding are routed in compliance with EMC. - check the plug connections. - replace the encoder or encoder cable. - check the Sensor Module (e.g. contacts). The following applies to measuring systems without their own bearing system: - adjust the scanning head and check the bearing system of the measuring wheel. The following applies for measuring systems with their own bearing system: - ensure that the encoder housing is not subject to any axial force.

232116 <location>Encoder 2: Signal level track A or B too low

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	A track: %1, B-track: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	The signal level of the rectified encoder signals A and B of the encoder fall below the permissible limit value. Fault value (r0949, interpret hexadecimal): yyyyxxxx hex: yyyy = Signal level, track B (16 bits with sign). xxxx = Signal level, track A (16 bits with sign). The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %). The response threshold is < 130 mV. A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec. Note: The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.
Remedy:	- check that the encoder cables and shielding are routed in compliance with EMC. - check the plug connections. - replace the encoder or encoder cable. - check the Sensor Module (e.g. contacts).

232117 <location>Encoder 2: Inversion error signals A/B/R

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY

Cause:	For a square-wave encoder (bipolar, double ended) signals A*, B* and R* are not inverted with respect to signals A, B and R. Fault value (r0949, interpret binary): Bits 0 ... 15: Only for internal Siemens troubleshooting. Bit 16: Error track A. Bit 17: Error track B. Bit 18: Error track R. Note: For SMC30 (only Article No. 6SL3055-0AA00-5CA0 and 6SL3055-0AA00-5CA1), CUA32 and CU310-2, the following applies: A square-wave encoder without track R is used and track monitoring (p0405.2 = 1) is activated.
Remedy:	- check the encoder/cable. - Does the encoder supply signals and the associated inverted signals? Note: For SMC30 (only Article Number 6SL3055-0AA00-5CA0 and 6SL3055-0AA00-5CA1), the following applies: - check the setting of p0405 (p0405.2 = 1 is only possible if the encoder is connected at X520). For a square-wave encoder without track R, the following jumpers must be set for the connection at X520 (SMC30), X220 (CUA32) or X23 (CU310-2): - pin 10 (reference signal R) <--> pin 7 (encoder power supply, ground) - pin 11 (reference signal R inverted) <--> pin 4 (encoder power supply)

232118 <location>Encoder 2: Speed change not plausible

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	PULSE INHIBIT
Cause:	For an HTL/TTL encoder, the speed change has exceeded the value in p0492 over several sampling cycles. The change to the averaged speed actual value - if applicable - is monitored in the current controller sampling time. Fault value (r0949, interpret decimal): Only for internal Siemens troubleshooting. See also: p0492
Remedy:	- check the tachometer feeder cable for interruptions. - check the grounding of the tachometer shielding. - if required, increase the maximum speed difference per sampling cycle (p0492).

232120 <location>Encoder 2: Encoder power supply fault

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	PULSE INHIBIT

Cause:	An encoder power supply fault was detected. Fault value (r0949, interpret binary): Bit 0: Undervoltage condition on the sense line. Bit 1: Overcurrent condition for the encoder power supply. Bit 2: Overcurrent condition for encoder power supply on cable resolver excitation negative. Bit 3: Overcurrent condition for encoder power supply on cable resolver excitation positive. Bit 4: The 24 V power supply through the Power Module (PM) is overloaded. Bit 5: Overcurrent at the EnDat connection of the converter. Bit 6: Overvoltage at the EnDat connection of the converter. Bit 7: Hardware fault at the EnDat connection of the converter. Note: If the encoder cables 6FX2002-2EQ00-.... and 6FX2002-2CH00-.... are interchanged, this can result in the encoder being destroyed because the pins of the operating voltage are reversed.
Remedy:	For fault value, bit 0 = 1: - correct encoder cable connected? - check the plug connections of the encoder cable. - SMC30: Check the parameterization (p0404.22). For fault value, bit 1 = 1: - correct encoder cable connected? - replace the encoder or encoder cable. For fault value, bit 2 = 1: - correct encoder cable connected? - replace the encoder or encoder cable. For fault value, bit 3 = 1: - correct encoder cable connected? - replace the encoder or encoder cable. For fault value, bit 5 = 1: - Measuring unit correctly connected at the converter? - Replace the measuring unit or the cable to the measuring unit. For fault value, bit 6, 7 = 1: - Replace the defective EnDat 2.2 converter.

232121 <location>Encoder 2: Determined commutation position incorrect

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF1 (NONE, OFF2, OFF3)
Acknowledge:	PULSE INHIBIT
Cause:	A commutation position actual value sensing error was detected.
Remedy:	Replace the motor with DRIVE-CLiQ or the appropriate Sensor Module.

232122 <location>Encoder 2: Sensor Module hardware fault

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF1
Acknowledge:	IMMEDIATELY
Cause:	An internal Sensor Module hardware fault was detected. Fault value (r0949, interpret decimal): 1: Reference voltage error. 2: Internal undervoltage. 3: Internal overvoltage.
Remedy:	Replace the motor with DRIVE-CLiQ or the appropriate Sensor Module.

232123 <location>Encoder 2: Signal level A/B outside tolerance**Drive object:** HLA_828, SERVO_828, SERVO_COMBI**Message value:** Fault cause: %1 bin**Reaction:** Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)**Acknowledge:** IMMEDIATELY

Cause: The unipolar level (AP/AN or BP/BN) for encoder 2 is outside the permissible tolerance.
Fault value (r0949, interpret binary):
Bit 0 = 1: Either AP or AN outside the tolerance.
Bit 16 = 1: Either BP or BN outside the tolerance.
The unipolar nominal signal level of the encoder must lie in the range 2500 mV +/- 500 mV.
The response thresholds are < 1700 mV and > 3300 mV.
Note:
The signal level is not evaluated unless the following conditions are satisfied:
- Sensor Module properties available (r0459.31 = 1).
- monitoring active (p0437.31 = 1).

Remedy: - make sure that the encoder cables and shielding are installed in an EMC-compliant manner.
- check the plug connections and contacts of the encoder cable.
- check the short-circuit of a signal cable with mass or the operating voltage.
- replace the encoder cable.

232125 <location>Encoder 2: Signal level track A or B too high**Drive object:** HLA_828, SERVO_828, SERVO_COMBI**Message value:** A track: %1, B-track: %2**Reaction:** Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2)
Hla: OFF1 (NONE, OFF2, OFF3, STOP2)**Acknowledge:** PULSE INHIBIT

Cause: The signal level (root from $A^2 + B^2$) of the encoder exceeds the permissible limit value.
Fault value (r0949, interpret hexadecimal):
yyyyxxxx hex:
yyyy = Signal level, track B (16 bits with sign).
xxxx = Signal level, track A (16 bits with sign).
The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).
The response threshold is > 750 mV.
A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.
Note for Sensor Modules for resolvers (e.g. SMC10):
The nominal signal level is at 2900 mV (2.0 Vrms).
The response threshold is > 3582 mV.
A signal level of 2900 mV peak value corresponds to the numerical value 6666 hex = 26214 dec.
Note:
The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.

Remedy: - check that the encoder cables and shielding are routed in compliance with EMC.
- replace the encoder or encoder cable.

232126 <location>Encoder 2: Signal level track A or B too high**Drive object:** HLA_828, SERVO_828, SERVO_COMBI**Message value:** Amplitude: %1, Angle: %2**Reaction:** Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2)
Hla: OFF1 (NONE, OFF2, OFF3, STOP2)

Acknowledge:	PULSE INHIBIT
Cause:	The signal level ($A + B$) of the encoder exceeds the permissible limit value. Fault value (r0949, interpret hexadecimal): yyyyxxxx hex: yyyy = Angle xxxx = amplitude, i.e. root of $A^2 + B^2$ (16 bits without sign) The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV $-25/+20\%$). The response threshold for ($A + B$) is > 1120 mV or the root of $(A^2 + B^2) > 955$ mV. A signal level of 500 mV peak value corresponds to the numerical value of 299A hex = 10650 dec. The angle 0 ... FFFF hex corresponds to 0 ... 360 degrees of the fine position. Zero degrees is present at the negative zero crossover of track B. Note: The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.
Remedy:	- check that the encoder cables and shielding are routed in compliance with EMC. - replace the encoder or encoder cable.

232129	<location>Encoder 2: Position difference hall sensor/track C/D and A/B too large
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	PULSE INHIBIT
Cause:	The error for track C/D is greater than $\pm 15^\circ$ mechanical or $\pm 60^\circ$ electrical or the error for the Hall signals is greater than $\pm 60^\circ$ electrical. One period of track C/D corresponds to 360° mechanical. One period of the Hall signal corresponds to 360° electrical. The monitoring responds if, for example, Hall sensors are connected as equivalent for the C/D tracks with the incorrect rotational sense or supply values that are not accurate enough. After the fine synchronization using one reference mark or 2 reference marks for distance-coded encoders, this fault is no longer initiated, but instead, Alarm A32429. Fault value (r0949, interpret decimal): For track C/D, the following applies: Measured deviation as mechanical angle (16 bits with sign, 182 dec corresponds to 1°). For Hall signals, the following applies: Measured deviation as electrical angle (16 bits with sign, 182 dec corresponds to 1°).
Remedy:	- track C or D not connected. - correct the direction of rotation of the Hall sensor possibly connected as equivalent for track C/D. - check that the encoder cables are routed in compliance with EMC. - check the adjustment of the Hall sensor.

232130	<location>Encoder 2: Zero mark and position error from the coarse synchronization
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Angular deviation, electrical: %1, angle, mechanical: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2) Hla: OFF1 (NONE, OFF2, OFF3, STOP2)
Acknowledge:	PULSE INHIBIT

Cause:	After initializing the pole position using track C/D, Hall signals or pole position identification routine, the zero mark was detected outside the permissible range. For distance-coded encoders, the test is carried out after passing 2 zero marks. Fine synchronization was not carried out. When initializing via track C/D (p0404) then it is checked whether the zero mark occurs in an angular range of $\pm 18^\circ$ mechanical. When initializing via Hall sensors (p0404) or pole position identification (p1982) it is checked whether the zero mark occurs in an angular range of $\pm 60^\circ$ electrical. Fault value (r0949, interpret hexadecimal): yyyyxxxx hex yyyy: Determined mechanical zero mark position (can only be used for track C/D). xxxx: Deviation of the zero mark from the expected position as electrical angle. Scaling: 32768 dec = 180°
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - if the Hall sensor is used as an equivalent for track C/D, check the connection. - check the connection of track C or D. - replace the encoder or encoder cable.

232131 <location>Encoder 2: Position deviation incremental/absolute too high

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2) Hla: OFF1 (NONE, OFF2, OFF3, STOP2)
Acknowledge:	PULSE INHIBIT
Cause:	Absolute encoder: When cyclically reading the absolute position, an excessively high difference to the incremental position was detected. The absolute position that was read is rejected. Limit value for the deviation: - EnDat encoder: Is supplied from the encoder and is a minimum of 2 quadrants (e.g. EQI 1325 > 2 quadrants, EQN 1325 > 50 quadrants). - other encoders: 15 pulses = 60 quadrants. Incremental encoder: When the zero pulse is passed, a deviation in the incremental position was detected. For equidistant zero marks, the following applies: - the first zero mark passed supplies the reference point for all subsequent checks. The other zero marks must have n times the distance referred to the first zero mark. For distance-coded zero marks, the following applies: - the first zero mark pair supplies the reference point for all subsequent checks. The other zero mark pairs must have the expected distance to the first zero mark pair. Fault value (r0949, interpret decimal): Deviation in quadrants (1 pulse = 4 quadrants).
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - replace the encoder or encoder cable. - check whether the coding disk is dirty or there are strong ambient magnetic fields. - adapt the parameter for the clearance between zero marks (p0425). - if message output above speed threshold, reduce filter time if necessary (p0438).

232135 <location>Encoder 2: Fault when determining the position (single turn)

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin

Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	PULSE INHIBIT
Cause:	The encoder has identified a position determination fault (singleturn) and supplies status information bit by bit in an internal status/fault word. Some of these bits cause this fault to be triggered. Other bits are status displays. The status/fault word is displayed in the fault value. Note regarding the bit designation: The first designation is valid for DRIVE-CLiQ encoders, the second for EnDat 2.2 encoders. Fault value (r0949, interpret binary): Bit 0: F1 (safety status display). Bit 1: F2 (safety status display). Bit 2: Reserved (lighting). Bit 3: Reserved (signal amplitude). Bit 4: Reserved (position value). Bit 5: Reserved (overvoltage). Bit 6: Reserved (undervoltage)/hardware fault EnDat supply (--> F3x110, x = 1, 2, 3). Bit 7: Reserved (overcurrent)/EnDat encoder withdrawn when not in the parked state (--> F3x110, x = 1, 2, 3). Bit 8: Reserved (battery)/overcurrent EnDat supply (--> F3x110, x = 1, 2, 3). Bit 9: Reserved/overvoltage EnDat supply (--> F3x110, x = 1, 2, 3). Bit 11: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 12: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 13: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 14: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 15: Internal communication error (--> F3x110, x = 1, 2, 3). Bit 16: Lighting (--> F3x135, x = 1, 2, 3). Bit 17: Signal amplitude (--> F3x135, x = 1, 2, 3). Bit 18: Singleturn position 1 (--> F3x135, x = 1, 2, 3). Bit 19: Overvoltage (--> F3x135, x = 1, 2, 3). Bit 20: Undervoltage (--> F3x135, x = 1, 2, 3). Bit 21: Overcurrent (--> F3x135, x = 1, 2, 3). Bit 22: Temperature exceeded (--> F3x405, x = 1, 2, 3). Bit 23: Singleturn position 2 (safety status display). Bit 24: Singleturn system (--> F3x135, x = 1, 2, 3). Bit 25: Singleturn power down (--> F3x135, x = 1, 2, 3). Bit 26: Multiturn position 1 (--> F3x136, x = 1, 2, 3). Bit 27: Multiturn position 2 (--> F3x136, x = 1, 2, 3). Bit 28: Multiturn system (--> F3x136, x = 1, 2, 3). Bit 29: Multiturn power down (--> F3x136, x = 1, 2, 3). Bit 30: Multiturn overflow/underflow (--> F3x136, x = 1, 2, 3). Bit 31: Multiturn battery (reserved).
Remedy:	- determine the detailed cause of the fault using the fault value. - replace the encoder if necessary. Note: An EnDat 2.2 encoder may only be removed and inserted in the "Park" state. If an EnDat 2.2 encoder was removed when not in the "Park" state, then after inserting the encoder, a POWER ON (switch-off/switch-on) is necessary to acknowledge the fault.

232136 <location>Encoder 2: Fault when determining the position (multiturn)

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Fault cause: %1 bin

Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	PULSE INHIBIT
Cause:	The encoder has identified a position determination fault (multiturn) and supplies status information bit by bit in an internal status/fault word. Some of these bits cause this fault to be triggered. Other bits are status displays. The status/fault word is displayed in the fault value. Note regarding the bit designation: The first designation is valid for DRIVE-CLiQ encoders, the second for EnDat 2.2 encoders. Fault value (r0949, interpret binary): Bit 0: F1 (safety status display). Bit 1: F2 (safety status display). Bit 2: Reserved (lighting). Bit 3: Reserved (signal amplitude). Bit 4: Reserved (position value). Bit 5: Reserved (overvoltage). Bit 6: Reserved (undervoltage)/hardware fault EnDat supply (--> F3x110, x = 1, 2, 3). Bit 7: Reserved (overcurrent)/EnDat encoder withdrawn when not in the parked state (--> F3x110, x = 1, 2, 3). Bit 8: Reserved (battery)/overcurrent EnDat supply (--> F3x110, x = 1, 2, 3). Bit 9: Reserved/overvoltage EnDat supply (--> F3x110, x = 1, 2, 3). Bit 11: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 12: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 13: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 14: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 15: Internal communication error (--> F3x110, x = 1, 2, 3). Bit 16: Lighting (--> F3x135, x = 1, 2, 3). Bit 17: Signal amplitude (--> F3x135, x = 1, 2, 3). Bit 18: Singleturn position 1 (--> F3x135, x = 1, 2, 3). Bit 19: Overvoltage (--> F3x135, x = 1, 2, 3). Bit 20: Undervoltage (--> F3x135, x = 1, 2, 3). Bit 21: Overcurrent (--> F3x135, x = 1, 2, 3). Bit 22: Temperature exceeded (--> F3x405, x = 1, 2, 3). Bit 23: Singleturn position 2 (safety status display). Bit 24: Singleturn system (--> F3x135, x = 1, 2, 3). Bit 25: Singleturn power down (--> F3x135, x = 1, 2, 3). Bit 26: Multiturn position 1 (--> F3x136, x = 1, 2, 3). Bit 27: Multiturn position 2 (--> F3x136, x = 1, 2, 3). Bit 28: Multiturn system (--> F3x136, x = 1, 2, 3). Bit 29: Multiturn power down (--> F3x136, x = 1, 2, 3). Bit 30: Multiturn overflow/underflow (--> F3x136, x = 1, 2, 3). Bit 31: Multiturn battery (reserved).
Remedy:	- determine the detailed cause of the fault using the fault value. - replace the encoder if necessary. Note: An EnDat 2.2 encoder may only be removed and inserted in the "Park" state. If an EnDat 2.2 encoder was removed when not in the "Park" state, then after inserting the encoder, a POWER ON (switch-off/switch-on) is necessary to acknowledge the fault.

232137 <location>Encoder 2: Fault when determining the position (single turn)

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Fault cause: %1 bin

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: PULSE INHIBIT

Cause: A position determination fault has occurred in the DRIVE-CLiQ encoder.
Fault value (r0949, interpret binary):
yyxxxxxx hex: yy = encoder version, xxxxxx = bit coding of the fault cause

For yy = 8 (0000 1000 bin), the following applies:

- Bit 1: Signal monitoring (sin/cos).
- Bit 8: F1 (safety status display) error position word 1.
- Bit 9: F2 (safety status display) error position word 2.
- Bit 16: LED monitoring.
- Bit 17: Fault when determining the position (multiturn).
- Bit 18: Single-step capability monitoring singleturn from the Safety channel.
- Bit 19: ECRC, configuration error in the safety channel.
- Bit 23: Temperature outside the limit values.

For yy = 11 (0000 1011 bin), the following applies:

- Bit 0: Position word 1 difference between rotation counter and software counter (XC_ERR).
- Bit 1: Position word 1 track error of the incremental signals (LIS_ERR).
- Bit 2: Position word 1 error when aligning between incremental track signals and absolute value (ST_ERR).
- Bit 3: Maximum permissible temperature exceeded (TEMP_ERR).
- Bit 4: Power supply overvoltage (MON_OVR_VOLT).
- Bit 5: Power supply overcurrent (MON_OVR_CUR).
- Bit 6: Power supply undervoltage (MON_UND_VOLT).
- Bit 7: Rotation error counter (MT_ERR).
- Bit 8: F1 (safety status display) error position word 1.
- Bit 9: F2 (safety status display) error position word 2.
- Bit 11: Position word 1 status bit: singleturn position OK (ADC_ready).
- Bit 12: Position word 1 status bit: rotation counter OK (MT_ready).
- Bit 13: Position word 1 memory error (MEM_ERR).
- Bit 14: Position word 1 absolute position error (MLS_ERR).
- Bit 15: position word 1 LED error, lighting unit error (LED_ERR).
- Bit 18: Position word 2 error when aligning between incremental track signals and absolute value (ST_ERR).
- Bit 21: Position word 2 memory error (MEM_ERR).
- Bit 22: Position word 2 absolute position error (MLS_ERR).
- Bit 23: position word 2 LED error, lighting unit error (LED_ERR).

For yy = 12 (0000 1100 bin), the following applies:

- Bit 8: encoder fault.
- Bit 10: error in the internal position data transport.

For yy = 14 (0000 1110 bin), the following applies:

- Bit 0: Position word 1 temperature outside limit value.
- Bit 1: Position word 1 position determination error (multiturn).
- Bit 2: Position word 1 FPGA error.
- Bit 3: Position word 1 velocity error.
- Bit 4: Position word 1 communication error between FPGAs/error in the incremental signal.
- Bit 5: Position word 1 timeout absolute value/error when determining the position (singleturn).
- Bit 6: Position word 1 internal hardware fault (clock/power monitor IC/power).
- Bit 7: Position word 1 internal error (FPGA communication/FPGA parameterization/self-test/software).
- Bit 8: F1 (safety status display) error position word 1.
- Bit 9: F2 (safety status display) error position word 2.
- Bit 16: Position word 2 temperature outside limit value.
- Bit 17: Position word 2 position determination error (multiturn).

Bit 18: Position word 2 FPGA error.
Bit 19: Position word 2 velocity error.
Bit 20: Position word 2 communication error between FPGAs.
Bit 21: Position word 2 position determination error (singleturn).
Bit 22: Position word 2 internal hardware fault (clock/power monitor IC/power).
Bit 23: Position word 2 internal error (self-test/software).

Note:

For an encoder version that is not described here, please contact the encoder manufacturer for more detailed information on the bit coding.

Remedy:

- determine the detailed cause of the fault using the fault value.
- if required, replace the DRIVE-CLiQ encoder.

232138 **<location>Encoder 2: Fault when determining the position (multiturn)**

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Fault cause: %1 bin

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
 Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: PULSE INHIBIT

Cause: A position determination fault has occurred in the DRIVE-CLiQ encoder.
Fault value (r0949, interpret binary):
yyxxxxx hex: yy = encoder version, xxxxxx = bit coding of the fault cause

For yy = 8 (0000 1000 bin), the following applies:

- Bit 1: Signal monitoring (sin/cos).
- Bit 8: F1 (safety status display) error position word 1.
- Bit 9: F2 (safety status display) error position word 2.
- Bit 16: LED monitoring.
- Bit 17: Fault when determining the position (multiturn).
- Bit 19: ECRC, configuration error in the safety channel.
- Bit 23: Temperature outside the limit values.

For yy = 11 (0000 1011 bin), the following applies:

- Bit 0: Position word 1 difference between rotation counter and software counter (XC_ERR).
- Bit 1: Position word 1 track error of the incremental signals (LIS_ERR).
- Bit 2: Position word 1 error when aligning between incremental track signals and absolute value (ST_ERR).
- Bit 3: Maximum permissible temperature exceeded (TEMP_ERR).
- Bit 4: Power supply overvoltage (MON_OVR_VOLT).
- Bit 5: Power supply overcurrent (MON_OVR_CUR).
- Bit 6: Power supply undervoltage (MON_UND_VOLT).
- Bit 7: Rotation error counter (MT_ERR).
- Bit 8: F1 (safety status display) error position word 1.
- Bit 9: F2 (safety status display) error position word 2.
- Bit 11: Position word 1 status bit: singleturn position OK (ADC_ready).
- Bit 12: Position word 1 status bit: rotation counter OK (MT_ready).
- Bit 13: Position word 1 memory error (MEM_ERR).
- Bit 14: Position word 1 absolute position error (MLS_ERR).
- Bit 15: position word 1 LED error, lighting unit error (LED_ERR).
- Bit 18: Position word 2 error when aligning between incremental track signals and absolute value (ST_ERR).
- Bit 21: Position word 2 memory error (MEM_ERR).
- Bit 22: Position word 2 absolute position error (MLS_ERR).
- Bit 23: position word 2 LED error, lighting unit error (LED_ERR).

For yy = 14 (0000 1110 bin), the following applies:

- Bit 0: Position word 1 temperature outside limit value.
- Bit 1: Position word 1 position determination error (multiturn).
- Bit 2: Position word 1 FPGA error.
- Bit 3: Position word 1 velocity error.
- Bit 4: Position word 1 communication error between FPGAs/error in the incremental signal.
- Bit 5: Position word 1 timeout absolute value/error when determining the position (singleturn).
- Bit 6: Position word 1 internal hardware fault (clock/power monitor IC/power).
- Bit 7: Position word 1 internal error (FPGA communication/FPGA parameterization/self-test/software).
- Bit 8: F1 (safety status display) error position word 1.
- Bit 9: F2 (safety status display) error position word 2.
- Bit 16: Position word 2 temperature outside limit value.
- Bit 17: Position word 2 position determination error (multiturn).
- Bit 18: Position word 2 FPGA error.
- Bit 19: Position word 2 velocity error.
- Bit 20: Position word 2 communication error between FPGAs.
- Bit 21: Position word 2 position determination error (singleturn).
- Bit 22: Position word 2 internal hardware fault (clock/power monitor IC/power).

Bit 23: Position word 2 internal error (self-test/software).

Note:

For an encoder version that is not described here, please contact the encoder manufacturer for more detailed information on the bit coding.

Remedy:

- determine the detailed cause of the fault using the fault value.
- if required, replace the DRIVE-CLiQ encoder.

232142 <location>Encoder 2: Battery voltage fault

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2)
Hla: OFF1 (NONE, OFF2, OFF3, STOP2)

Acknowledge: IMMEDIATELY

Cause: When switched-off, the encoder uses a battery to back up the multiturn information. The battery voltage is no longer sufficient to check the multiturn information.

Remedy: Replace battery.

232150 <location>Encoder 2: Initialization error

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2)
Hla: OFF1 (NONE, OFF2, OFF3, STOP2)

Acknowledge: PULSE INHIBIT

Cause: Encoder functionality selected in p0404 cannot be executed.
Fault value (r0949, interpret hexadecimal):
Encoder malfunction.

The bit assignment corresponds to that of p0404 (e.g. bit 5 set: Error track C/D).

Remedy:

- check that p0404 is correctly set.
- check the encoder type used (incremental/absolute) and for SMCxx, the encoder cable.
- if relevant, note additional fault messages that describe the fault in detail.

232151 <location>Encoder 2: Encoder speed for initialization AB too high

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2)
Hla: OFF1 (NONE, OFF2, OFF3, STOP2)

Acknowledge: PULSE INHIBIT

Cause: The encoder speed is too high while initializing the Sensor Module.

Remedy: Reduce the speed of the encoder accordingly during initialization.
If necessary, deactivate monitoring (p0437.29).
See also: p0437 (Sensor Module configuration extended)

232152 <location>Encoder 2: Max. signal frequency (track A/B) exceeded

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2)
Hla: OFF1 (NONE, OFF2, OFF3, STOP2)

Acknowledge: PULSE INHIBIT

Cause: The maximum signal frequency of the encoder evaluation has been exceeded.
Fault value (r0949, interpret decimal):
Actual input frequency in Hz.
See also: p0408

Remedy: - reduce the speed.
- Use an encoder with a lower pulse number (p0408).

232153 <location>Encoder 2: Identification error

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: An error has occurred when identifying the encoder (waiting) p0400 = 10100.
The connected encoder was not able to be identified.
Fault value (r0949, interpret binary):
Bit 0: Data length incorrect.
See also: p0400 (Encoder type selection)

Remedy: Manually configure the encoder according to the data sheet.

232160 <location>Encoder 2: Analog sensor channel A failed

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Servo: OFF1 (IASC/DCBRK, NONE)
Hla: OFF1 (NONE)

Acknowledge: PULSE INHIBIT

Cause: The input voltage of the analog sensor is outside the permissible limits.
Fault value (r0949, interpret decimal):
1: Input voltage outside detectable measuring range.
2: Input voltage outside the measuring range set in (p4673).
3: The absolute value of the input voltage has exceeded the range limit (p4676).

Remedy: For fault value = 1:
- check the output voltage of the analog sensor.
For fault value = 2:
- check the voltage setting for each encoder period (p4673).
For fault value = 3:
- check the range limit setting and increase it if necessary (p4676).

232161 <location>Encoder 2: Analog sensor channel B failed

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Servo: OFF1 (IASC/DCBRK, NONE)
Hla: OFF1 (NONE)

Acknowledge: PULSE INHIBIT

Cause: The input voltage of the analog sensor is outside the permissible limits.
Fault value (r0949, interpret decimal):
1: Input voltage outside detectable measuring range.
2: Input voltage outside the selected measuring range (p4675).
3: The absolute value of the input voltage has exceeded the range limit (p4676).

Remedy:

- For fault value = 1:
 - check the output voltage of the analog sensor.
- For fault value = 2:
 - check the voltage setting for each encoder period (p4675).
- For fault value = 3:
 - check the range limit setting and increase it if necessary (p4676).

232163 <location>Encoder 2: Analog sensor position value exceeds limit value

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Servo: OFF1 (IASC/DCBRK, NONE)
Hla: OFF1 (NONE)

Acknowledge: PULSE INHIBIT

Cause: The position value has exceeded the permissible range of -0.5 ... +0.5.
Fault value (r0949, interpret decimal):
1: Position value from the LVDT sensor.
2: Position value from the encoder characteristic.

Remedy:

- For fault value = 1:
 - check the LVDT ratio (p4678).
 - check the reference signal connection at track B.
- For fault value = 2:
 - check the coefficients of the characteristic (p4663 ... p4666).

232400 <location>Encoder 2: Zero mark distance error (alarm threshold exceeded)

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The measured zero mark distance does not correspond to the parameterized zero mark distance.
For distance-coded encoders, the zero mark distance is determined from zero marks detected pairs. This means that if a zero mark is missing, depending on the pair generation, this cannot result in a fault and also has no effect in the system.
The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder).
Alarm value (r2124, interpret decimal):
Last measured zero mark distance in increments (4 increments = 1 encoder pulse).
The sign designates the direction of motion when detecting the zero mark distance.

Remedy:

- check that the encoder cables are routed in compliance with EMC.
- check the plug connections.
- check the encoder type (encoder with equidistant zero marks).
- adapt the parameter for the distance between zero marks (p0424, p0425).
- replace the encoder or encoder cable.

232401 <location>Encoder 2: Zero mark failed (alarm threshold exceeded)

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The 1.5x parameterized zero mark distance was exceeded without a zero mark being detected.
The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder).
Alarm value (r2124, interpret decimal):
Number of increments after POWER ON or since the last zero mark that was detected (4 increments = 1 encoder pulse).

- Remedy:**
- check that the encoder cables are routed in compliance with EMC.
 - check the plug connections.
 - check the encoder type (encoder with equidistant zero marks).
 - adapt the parameter for the clearance between zero marks (p0425).
 - replace the encoder or encoder cable.

232405 <location>Encoder 2: Temperature in the encoder evaluation exceeded

- Drive object:** HLA_828, SERVO_828, SERVO_COMBI
- Message value:** temperature: [0.1 degrees C] %1, temperature sensor number: %2
- Reaction:** Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2)
Hla: OFF1 (NONE, OFF2, OFF3, STOP2)
- Acknowledge:** IMMEDIATELY (POWER ON)
- Cause:** An inadmissibly high temperature was detected in the encoder electronics or the encoder evaluation.
Fault value (r0949, interpret hexadecimal):
yyxxxx hex: yy = temperature sensor number, xxxx = measured module temperature in 0.1 °C.
- Remedy:** Reduce the ambient temperature for the DRIVE-CLiQ connection of the motor.

232407 <location>Encoder 2: Function limit reached

- Drive object:** HLA_828, SERVO_828, SERVO_COMBI
- Message value:** %1
- Reaction:** NONE
- Acknowledge:** NONE
- Cause:** The encoder has reached one of its function limits. A service is recommended.
Alarm value (r2124, interpret decimal):
1: Incremental signals
3: Absolute track
4: Code connection
- Remedy:** Perform service. Replace the encoder if necessary.
Note:
The actual functional reserve of an encoder can be displayed via r4651.
See also: p4650 (Encoder functional reserve component number), r4651 (Encoder functional reserve)

232410 <location>Encoder 2: Communication error (encoder and Sensor Module)

- Drive object:** HLA_828, SERVO_828, SERVO_COMBI
- Message value:** Fault cause: %1 bin
- Reaction:** NONE
- Acknowledge:** NONE

Cause:	Serial communication protocol transfer error between the encoder and evaluation module. Alarm value (r2124, interpret binary): Bit 0: Alarm bit in the position protocol. Bit 1: Incorrect quiescent level on the data line. Bit 2: Encoder does not respond (does not supply a start bit within 50 ms). Bit 3: CRC error: The checksum in the protocol from the encoder does not match the data. Bit 4: Encoder acknowledgment error: The encoder incorrectly understood the task (request) or cannot execute it. Bit 5: Internal error in the serial driver: An illegal mode command was requested. Bit 6: Timeout when cyclically reading. Bit 8: Protocol is too long (e.g. > 64 bits). Bit 9: Receive buffer overflow. Bit 10: Frame error when reading twice. Bit 11: Parity error. Bit 12: Data line signal level error during the monoflop time.
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - replace encoder.

232411 <location>Encoder 2: Encoder signals an internal alarm (detailed information)

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin, additional information: %2
Reaction:	NONE
Acknowledge:	NONE
Cause:	The absolute encoder fault word includes alarm bits that have been set. Alarm value (r2124, interpret binary): yyyyxxx hex: yyyy = supplementary information, xxxx = fault cause yyyy = 0: Bit 0: Frequency exceeded (speed too high). Bit 1: Temperature exceeded. Bit 2: Control reserve, lighting system exceeded. Bit 3: Battery discharged. Bit 4: Reference point passed. yyyy = 1: Bit 0: Signal amplitude outside the control range. Bit 1: Error multiturn interface Bit 2: Internal data error (singleturn/multiturn not with single steps). Bit 3: Error EEPROM interface. Bit 4: SAR converter error. Bit 5: Fault for the register data transfer. Bit 6: Internal error identified at the error pin (nErr). Bit 7: Temperature threshold exceeded or fallen below.
Remedy:	Replace encoder.

232412 <location>Encoder 2: Encoder signals an internal alarm

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE

- Cause:** The encoder signals an internal alarm via serial protocol.
Alarm value (r2124, interpret binary):
Bit 0: Fault bit in the position protocol.
Bit 1: Alarm bit in the position protocol.
- Remedy:**
- carry out a POWER ON (switch-off/switch-on) for all components.
 - check that the encoder cables are routed in compliance with EMC.
 - check the plug connections.
 - replace encoder.

232414 <location>Encoder 2: Signal level track C or D out of tolerance

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: C track: %1, D track: %2

Reaction: NONE

Acknowledge: NONE

Cause: The signal level ($C^2 + D^2$) of track C or D of the encoder or from the Hall signals, is not within the tolerance bandwidth.
Alarm value (r2124, interpret hexadecimal):
yyyyxxxx hex:
yyyy = Signal level, track D (16 bits with sign).
xxxx = Signal level, track C (16 bits with sign).
The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).
The response thresholds are < 230 mV (observe the frequency response of the encoder) and > 750 mV.
A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.
Note:

If the amplitude is not within the tolerance bandwidth, then it cannot be used to initialize the start position.

Remedy:

- check that the encoder cables are routed in compliance with EMC.
- check the plug connections.
- replace the encoder or encoder cable.
- check the Sensor Module (e.g. contacts).
- check the Hall sensor box.

232415 <location>Encoder 2: Signal level track A or B outside tolerance (alarm)

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Amplitude: %1, Angle: %2

Reaction: NONE

Acknowledge: NONE

Cause: The signal level (root from $A^2 + B^2$) of the encoder is outside the permissible tolerance.

Alarm value (r2124, interpret hexadecimal):

yyyyxxxx hex:

yyyy = Angle

xxxx = amplitude, i.e. root of $A^2 + B^2$ (16 bits without sign)

The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).

The response threshold is < 230 mV (observe the frequency response of the encoder).

A signal level of 500 mV peak value corresponds to the numerical value 299A hex = 10650 dec.

The angle 0 ... FFFF hex corresponds to 0 ... 360 degrees of the fine position. Zero degrees is present at the negative zero crossover of track B.

Note for Sensor Modules for resolvers (e.g. SMC10):

The nominal signal level is at 2900 mV (2.0 Vrms). The response threshold is < 1414 mV (1.0 Vrms).

A signal level of 2900 mV peak value corresponds to the numerical value 3333 hex = 13107 dec.

Note:

The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.

- Remedy:**
- check the speed range, frequency characteristic (amplitude characteristic) of the measuring equipment is not sufficient for the speed range.
 - check that the encoder cables and shielding are routed in compliance with EMC.
 - check the plug connections.
 - replace the encoder or encoder cable.
 - check the Sensor Module (e.g. contacts).
 - if the coding disk is soiled or the lighting aged, replace the encoder.

232418 <location>Encoder 2: Speed change not plausible (alarm)

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: For an HTL/TTL encoder, the speed change has exceeded the value in p0492 over several sampling cycles.
The change to the averaged speed actual value - if applicable - is monitored in the current controller sampling time.
Alarm value (r2124, interpret decimal):
Only for internal Siemens troubleshooting.
See also: p0492

- Remedy:**
- check the tachometer feeder cable for interruptions.
 - check the grounding of the tachometer shielding.
 - if required, increase the setting of p0492.

232419 <location>Encoder 2: Track A or B outside tolerance

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The amplitude/phase/offset correction for track A or B is at the limit.
Amplitude error correction: $\text{Amplitude B} / \text{Amplitude A} = 0.78 \dots 1.27$
Phase: <84 degrees or >96 degrees
SMC20: Offset correction: +/-140 mV
SMC10: Offset correction: +/-650 mV
Alarm value (r2124, interpret hexadecimal):
xxxx1: Minimum of the offset correction, track B
xxxx2: Maximum of the offset correction, track B
xxx1x: Minimum of the offset correction, track A
xxx2x: Maximum of the offset correction, track A
xx1xx: Minimum of the amplitude correction, track B/A
xx2xx: Maximum of the amplitude correction, track B/A
x1xxx: Minimum of the phase error correction
x2xxx: Maximum of the phase error correction
1xxxx: Minimum of the cubic correction
2xxxx: Maximum of the cubic correction

- Remedy:**
- check mechanical mounting tolerances for encoders without their own bearings (e.g. toothed-wheel encoders).
 - check the plug connections (also the transition resistance).
 - check the encoder signals.
 - replace the encoder or encoder cable.

232421 <location>Encoder 2: Determined commutation position incorrect (alarm)

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction:	NONE
Acknowledge:	NONE
Cause:	A commutation position actual value sensing error was detected. Alarm value (r2124, interpret decimal): 3: The absolute position of the serial protocol and track A/B differ by half an encoder pulse. The absolute position must have its zero position in the quadrants in which both tracks are negative. In the case of a fault, the position can be incorrect by one encoder pulse.
Remedy:	For alarm value = 3: - For a standard encoder with cable, contact the manufacturer where relevant. - correct the assignment of the tracks to the position value that is serially transferred. To do this, the two tracks must be connected, inverted, at the Sensor Module (interchange A with A* and B with B*) or, for a programmable encoder, check the zero offset of the position.

232422 <location>Encoder 2: Pulses per revolution square-wave encoder outside tolerance bandwidth

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The measured zero mark distance does not correspond to the parameterized zero mark distance. This alarm is triggered with active square-wave encoder PPR correction and re-parameterized fault 31131 if the accumulator contains larger values than p4683 or p4684. The zero mark distance for zero mark monitoring is set in p0425 (rotary encoder). Alarm value (r2124, interpret decimal): accumulated differential pulses in encoder pulses.
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - check the encoder type (encoder with equidistant zero marks). - adapt the parameter for the distance between zero marks (p0424, p0425). - replace the encoder or encoder cable.

232429 <location>Encoder 2: Position difference hall sensor/track C/D and A/B too large

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The error for track C/D is greater than +/-15 ° mechanical or +/-60 ° electrical or the error for the Hall signals is greater than +/-60 ° electrical. One period of track C/D corresponds to 360 ° mechanical. One period of the Hall signal corresponds to 360 ° electrical. The monitoring responds if, for example, Hall sensors are connected as equivalent for the C/D tracks with the incorrect rotational sense or supply values that are not accurate enough. Alarm value (r2124, interpret decimal): For track C/D, the following applies: Measured deviation as mechanical angle (16 bits with sign, 182 dec corresponds to 1 °). For Hall signals, the following applies: Measured deviation as electrical angle (16 bits with sign, 182 dec corresponds to 1 °).
Remedy:	- track C or D not connected. - correct the direction of rotation of the Hall sensor possibly connected as equivalent for track C/D. - check that the encoder cables are routed in compliance with EMC. - check the adjustment of the Hall sensor.

232431	<location>Encoder 2: Position deviation incremental/absolute too high (alarm)
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	When the zero pulse is passed, a deviation in the incremental position was detected. For equidistant zero marks, the following applies: - the first zero mark passed supplies the reference point for all subsequent checks. The other zero marks must have n times the distance referred to the first zero mark. For distance-coded zero marks, the following applies: - the first zero mark pair supplies the reference point for all subsequent checks. The other zero mark pairs must have the expected distance to the first zero mark pair. Alarm value (r2124, interpret decimal): Deviation in quadrants (1 pulse = 4 quadrants).
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - replace the encoder or encoder cable. - Clean coding disk or remove strong magnetic fields.
232432	<location>Encoder 2: Rotor position adaptation corrects deviation
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	On track A/B, pulses have been lost or too many have been counted. These pulses are presently being corrected. Alarm value (r2124, interpret decimal): Last measured deviation of zero mark in increments (4 increments = 1 encoder pulse). The sign designates the direction of motion when detecting the zero mark distance.
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - replace the encoder or encoder cable. - check encoder limit frequency. - adapt the parameter for the distance between zero marks (p0424, p0425).
232442	<location>Encoder 2: Battery voltage alarm threshold reached
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	When switched-off, the encoder uses a battery to back up the multiturn information. The multiturn information can no longer be buffered if the battery voltage drops even further.
Remedy:	Replace battery.
232443	<location>Encoder 2: Signal level track C/D outside tolerance (alarm)
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	NONE
Acknowledge:	NONE

- Cause:** The unipolar level (CP/CN or DP/DN) for encoder 2 is outside the permissible tolerance.
Alarm value (r2124, interpret binary):
Bit 0 = 1: Either CP or CN outside the tolerance.
Bit 16 = 1: Either DP or DN outside the tolerance.
The unipolar nominal signal level of the encoder must lie in the range 2500 mV +/- 500 mV.
The response thresholds are < 1700 mV and > 3300 mV.
Note:
The signal level is not evaluated unless the following conditions are satisfied:
- Sensor Module properties available (r0459.31 = 1).
- monitoring active (p0437.31 = 1).
- Remedy:** - check that the encoder cables and shielding are routed in compliance with EMC.
- check the plug connections and contacts of the encoder cable.
- are the C/D tracks connected correctly (have the signal cables CP and CN or DP and DN been interchanged)?
- replace the encoder cable.

232460 <location>Encoder 2: Analog sensor channel A failed

- Drive object:** HLA_828, SERVO_828, SERVO_COMBI
Message value: %1
Reaction: NONE
Acknowledge: NONE
- Cause:** The input voltage of the analog sensor is outside the permissible limits.
Alarm value (r2124, interpret decimal):
1: Input voltage outside detectable measuring range.
2: Input voltage outside measuring range set in p4673.
3: The absolute value of the input voltage has exceeded the range limit (p4676).
- Remedy:** For alarm value = 1:
- check the output voltage of the analog sensor.
For alarm value = 2:
- check the voltage setting for each encoder period (p4673).
For alarm value = 3:
- check the range limit setting and increase it if necessary (p4676).

232461 <location>Encoder 2: Analog sensor channel B failed

- Drive object:** HLA_828, SERVO_828, SERVO_COMBI
Message value: %1
Reaction: NONE
Acknowledge: NONE
- Cause:** The input voltage of the analog sensor is outside the permissible limits.
Alarm value (r2124, interpret decimal):
1: Input voltage outside detectable measuring range.
2: Input voltage outside the selected measuring range (p4675).
3: The absolute value of the input voltage has exceeded the range limit (p4676).
- Remedy:** For alarm value = 1:
- check the output voltage of the analog sensor.
For alarm value = 2:
- check the voltage setting for each encoder period (p4675).
For alarm value = 3:
- check the range limit setting and increase it if necessary (p4676).

232462	<location>Encoder 2: Analog sensor no channel active
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	Channel A and B are not activated for the analog sensor.
Remedy:	- activate channel A and/or channel B (p4670). - check the encoder configuration (p0404.17). See also: p4670 (Analog sensor configuration)
232463	<location>Encoder 2: Analog sensor position value exceeds limit value
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The position value has exceeded the permissible range of -0.5 ... +0.5. Alarm value (r2124, interpret decimal): 1: Position value from the LVDT sensor. 2: Position value from the encoder characteristic.
Remedy:	For alarm value = 1: - check the LVDT ratio (p4678). - check the reference signal connection at track B. For alarm value = 2: - check the coefficients of the characteristic (p4663 ... p4666).
232470	<location>Encoder 2: Encoder signals an internal error (X521.7)
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	For the Sensor Module Cabinet 30 (SMC30), a dirty encoder is signaled via a 0 signal at terminal X521.7.
Remedy:	- check the plug connections. - replace the encoder or encoder cable.
232500	<location>Encoder 2: Position tracking traversing range exceeded
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	For a configured linear axis without modulo correction, the drive/encoder has exceeded the maximum possible traversing range. The value should be read in p0412 and interpreted as the number of motor revolutions. For p0411.0 = 1, the maximum traversing range for the configured linear axis is defined to be 64x (+/- 32x) of p0421. For p0411.3 = 1, the maximum traversing range for the configured linear axis is preset (default value) to the highest possible value and is +/-p0412/2 (rounded off to complete revolutions). The highest possible value depends on the pulse number (p0408) and the fine resolution (p0419).
Remedy:	The fault should be resolved as follows: - select encoder commissioning (p0010 = 4). - reset the position tracking as follows (p0411.2 = 1). - deselect encoder commissioning (p0010 = 0). The fault should then be acknowledged and the absolute encoder adjusted.

232501	<location>Encoder 2: Position tracking encoder position outside tolerance window
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	When switched off, the drive/encoder was moved through a distance greater than was parameterized in the tolerance window. It is possible that there is no longer any reference between the mechanical system and encoder. Fault value (r0949, interpret decimal): Deviation (difference) to the last encoder position in increments of the absolute value. The sign designates the traversing direction. Note: The deviation (difference) found is also displayed in r0477. See also: p0413 (Measuring gear position tracking tolerance window), r0477 (Measuring gear position difference)
Remedy:	Reset the position tracking as follows: - select encoder commissioning (p0010 = 4). - reset the position tracking as follows (p0411.2 = 1). - deselect encoder commissioning (p0010 = 0). The fault should then be acknowledged and, if necessary, the absolute encoder adjusted (p2507). See also: p0010
232502	<location>Encoder 2: Encoder with measuring gear without valid signals
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF1 (OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	The encoder with measuring gear no longer provides any valid signals.
Remedy:	It must be ensured that all of the encoders, with mounted measuring gear, provide valid actual values in operation.
232503	<location>Encoder 2: Position tracking cannot be reset
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	The position tracking for the measuring gear cannot be reset.
Remedy:	The fault should be resolved as follows: - select encoder commissioning (p0010 = 4). - reset the position tracking as follows (p0411.2 = 1). - deselect encoder commissioning (p0010 = 0). The fault should then be acknowledged and the absolute encoder adjusted.
232700	<location>Encoder 2: Effectivity test does not supply the expected value
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	NONE
Acknowledge:	NONE
Cause:	The DRIVE-CLiQ encoder fault word supplies fault bits that have been set. Alarm value (r2124, interpret binary): Bit x = 1: Effectivity test x unsuccessful.
Remedy:	Replace encoder.

232800 <location>Encoder 2: Group signal

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: NONE

Cause: The motor encoder has detected at least one fault.

Remedy: Evaluates other actual messages.

232801 <location>Encoder 2 DRIVE-CLiQ: Sign-of-life missing

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Component number: %1, fault cause: %2

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder involved.
Fault cause:
10 (= 0A hex):
The sign-of-life bit in the receive telegram is not set.
Note regarding the message value:
The individual information is coded as follows in the message value (r0949/r2124):
0000yyxx hex: yy = component number, xx = error cause

Remedy: - check the electrical cabinet design and cable routing for EMC compliance
- replace the component involved.

232802 <location>Encoder 2: Time slice overflow

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause: A time slice overflow has occurred in encoder 2.
Fault value (r0949, interpret hexadecimal):
yx hex: y = function involved (Siemens-internal fault diagnostics), x = time slice involved
x = 9:
Time slice overflow of the fast (current controller clock cycle) time slice.
x = A:
Time slice overflow of the average time slice.
x = C:
Time slice overflow of the slow time slice.
yx = 3E7:
Timeout when waiting for SYNO (e.g. unexpected return to non-cyclic operation).

Remedy: Increase the current controller sampling time
Note:
For a current controller sampling time = 31.25 µs, use an SMx20 with Article No. 6SL3055-0AA00-5xA3.

232804 <location>Encoder 2: Sensor Module checksum error

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	POWER ON (IMMEDIATELY)
Cause:	A checksum error has occurred when reading-out the program memory on the Sensor Module. Fault value (r0949, interpret hexadecimal): yyyyxxxx hex yyyy: Memory area involved. xxxx: Difference between the checksum at POWER ON and the actual checksum.
Remedy:	- carry out a POWER ON (switch-off/switch-on). - upgrade firmware to later version (>= V2.6 HF3, >= V4.3 SP2, >= V4.4). - check whether the permissible ambient temperature for the component is maintained. - replace the Sensor Module.

232805 <location>Encoder 2: EEPROM checksum error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	Data in the EEPROM corrupted . Fault value (r0949, interpret hexadecimal): 01: EEPROM access error. 02: Too many blocks in the EEPROM.
Remedy:	Replace the module.

232806 <location>Encoder 2: Initialization error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	PULSE INHIBIT

Cause:	The encoder was not successfully initialized. Fault value (r0949, interpret binary): Bit 0, 1: Encoder initialization with the motor rotating has failed (deviation involving coarse and fine position in encoder pulses/4). Bit 2: Mid-voltage matching for track A unsuccessful. Bit 3: Mid-voltage matching for track B unsuccessful. Bit 4: Mid-voltage matching for acceleration input unsuccessful. Bit 5: Mid-voltage matching for track safety A unsuccessful. Bit 6: Mid-voltage matching for track safety B unsuccessful. Bit 7: Mid-voltage matching for track C unsuccessful. Bit 8: Mid-voltage matching for track D unsuccessful. Bit 9: Mid-voltage matching for track R unsuccessful. Bit 10: The difference in mid-voltages between A and B is too great (> 0.5 V) Bit 11: The difference in mid-voltages between C and D is too great (> 0.5 V) Bit 12: The difference in mid-voltages between safety A and safety B is too great (> 0.5 V) Bit 13: The difference in mid-voltages between A and safety B is too great (> 0.5 V) Bit 14: The difference in mid-voltages between B and safety A is too great (> 0.5 V) Bit 15: The standard deviation of the calculated mid-voltages is too great (> 0.3 V) Bit 16: Internal fault - fault when reading a register (CAFE) Bit 17: Internal fault - fault when writing a register (CAFE) Bit 18: Internal fault: No mid-voltage matching available Bit 19: Internal error - ADC access error. Bit 20: Internal error - no zero crossover found. Bit 28: Error while initializing the EnDat 2.2 measuring unit. Bit 29: Error when reading out the data from the EnDat 2.2 measuring unit. Bit 30: EEPROM checksum of the EnDat 2.2 measuring unit incorrect. Bit 31: Data of the EnDat 2.2 measuring unit inconsistent. Note: Bit 0, 1: Up to 6SL3055-0AA00-5*A0 Bits 2 ... 20: 6SL3055-0AA00-5*A1 and higher
Remedy:	Acknowledge fault. If the fault cannot be acknowledged: Bits 2 ... 9: Check encoder power supply. Bits 2 ... 14: Check the corresponding cable. Bit 15 with no other bits: Check track R, check settings in p0404. Bit 28: Check the cable between the EnDat 2.2 converter and the measuring unit. Bit 29 ... 31: Replace the defective measuring unit.

232811	<location>Encoder 2: Encoder serial number changed
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The encoder serial number has changed. The change is only checked for encoders with serial number (e.g. EnDat encoders). - the encoder was replaced. Note: With closed-loop position control, the serial number is accepted when starting the adjustment (p2507 = 2). When the encoder is adjusted (p2507 = 3), the serial number is checked for changes and if required, the adjustment is reset (p2507 = 1). Proceed as follows to hide serial number monitoring: - set the following serial numbers for the corresponding Encoder Data Set: p0441 = FF, p0442 = 0, p0443 = 0, p0444 = 0, p0445 = 0.

Remedy: Mechanically adjust the encoder. Accept the new serial number with p0440 = 1.

232812 <location>Encoder 2: Requested cycle or RX-/TX timing not supported

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: A cycle requested from the Control Unit or RX/TX timing is not supported.
Fault value (r0949, interpret decimal):
0: Application cycle is not supported.
1: DRIVE-CLiQ cycle is not supported.
2: Distance between RX and TX instants in time too low.
3: TX instant in time too early.

Remedy: Carry out a POWER ON (switch-off/switch-on) for all components.

232813 <location>Encoder 2: Hardware logic unit failed

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Fault cause: %1 bin

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: PULSE INHIBIT

Cause: The logic unit of the DRIVE-CLiQ encoder has failed.
Fault value (r0949, interpret binary):
Bit 0: ALU watchdog has responded.
Bit 1: ALU has detected a sign-of-life error.

Remedy: When the error reoccurs, replace the encoder.

232820 <location>Encoder 2 DRIVE-CLiQ: Telegram error

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Component number: %1, fault cause: %2

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder concerned.

Fault cause:

1 (= 01 hex):

Checksum error (CRC error).

2 (= 02 hex):

Telegram is shorter than specified in the length byte or in the receive list.

3 (= 03 hex):

Telegram is longer than specified in the length byte or in the receive list.

4 (= 04 hex):

The length of the receive telegram does not match the receive list.

5 (= 05 hex):

The type of the receive telegram does not match the receive list.

6 (= 06 hex):

The address of the component in the telegram and in the receive list do not match.

7 (= 07 hex):

A SYNC telegram is expected - but the received telegram is not a SYNC telegram.

8 (= 08 hex):

No SYNC telegram is expected - but the received telegram is one.

9 (= 09 hex):

The error bit in the receive telegram is set.

16 (= 10 hex):

The receive telegram is too early.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy:

- carry out a POWER ON (switch-off/switch-on).

- check the electrical cabinet design and cable routing for EMC compliance

- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

232835 <location>Encoder 2 DRIVE-CLiQ: Cyclic data transfer error

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Component number: %1, fault cause: %2

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)

HLA: OFF1 (NONE, OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder concerned. The nodes do not send and receive in synchronism.

Fault cause:

33 (= 21 hex):

The cyclic telegram has not been received.

34 (= 22 hex):

Timeout in the telegram receive list.

64 (= 40 hex):

Timeout in the telegram send list.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy:

- carry out a POWER ON.

- replace the component involved.

232836 <location>Encoder 2 DRIVE-CLiQ: Send error for DRIVE-CLiQ data**Drive object:** HLA_828, SERVO_828, SERVO_COMBI**Message value:** Component number: %1, fault cause: %2**Reaction:** Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)**Acknowledge:** IMMEDIATELY**Cause:** A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder involved. Data were not able to be sent.

Fault cause:

65 (= 41 hex):

Telegram type does not match send list.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy: Carry out a POWER ON.

232837 <location>Encoder 2 DRIVE-CLiQ: Component fault**Drive object:** HLA_828, SERVO_828, SERVO_COMBI**Message value:** Component number: %1, fault cause: %2**Reaction:** Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)**Acknowledge:** IMMEDIATELY**Cause:** Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded.

Fault cause:

32 (= 20 hex):

Error in the telegram header.

35 (= 23 hex):

Receive error: The telegram buffer memory contains an error.

66 (= 42 hex):

Send error: The telegram buffer memory contains an error.

67 (= 43 hex):

Send error: The telegram buffer memory contains an error.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy:

- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).
- check the electrical cabinet design and cable routing for EMC compliance
- if required, use another DRIVE-CLiQ socket (p9904).
- replace the component involved.

232845 <location>Encoder 2 DRIVE-CLiQ: Cyclic data transfer error**Drive object:** HLA_828, SERVO_828, SERVO_COMBI**Message value:** Component number: %1, fault cause: %2**Reaction:** Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)**Acknowledge:** IMMEDIATELY

Cause:	A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder involved. Fault cause: 11 (= 0B hex): Synchronization error during alternating cyclic data transfer. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON (switch-off/switch-on).

232850 <location>Encoder 2: Encoder evaluation internal software error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	POWER ON
Cause:	An internal software error has occurred in the Sensor Module of encoder 2. Fault value (r0949, interpret decimal): 1: Background time slice is blocked. 2: Checksum over the code memory is not OK. 10000: OEM memory of the EnDat encoder contains data that cannot be interpreted. 11000 ... 11499: Descriptive data from EEPROM incorrect. 11500 ... 11899: Calibration data from EEPROM incorrect. 11900 ... 11999: Configuration data from EEPROM incorrect. 12000 ... 12008: communication with analog/digital converter faulted. 16000: DRIVE-CLiQ encoder initialization application error. 16001: DRIVE-CLiQ encoder initialization ALU error. 16002: DRIVE-CLiQ encoder HISI / SISI initialization error. 16003: DRIVE-CLiQ encoder safety initialization error. 16004: DRIVE-CLiQ encoder internal system error.
Remedy:	- replace the Sensor Module. - if required, upgrade the firmware in the Sensor Module. - contact Technical Support.

232851 <location>Encoder 2 DRIVE-CLiQ (CU): Sign-of-life missing

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 2) involved to the Control Unit. The DRIVE-CLiQ component did not set the sign-of-life to the Control Unit. Fault cause: 10 (= 0A hex): The sign-of-life bit in the receive telegram is not set. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- Upgrade the firmware of the component involved. - carry out a POWER ON (switch-off/switch-on) for the component involved.

232860 **<location>Encoder 2 DRIVE-CLiQ (CU): Telegram error****Drive object:** HLA_828, SERVO_828, SERVO_COMBI**Message value:** Component number: %1, fault cause: %2**Reaction:** Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)**Acknowledge:** IMMEDIATELY**Cause:** A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 2) involved to the Control Unit.

Fault cause:

1 (= 01 hex):

Checksum error (CRC error).

2 (= 02 hex):

Telegram is shorter than specified in the length byte or in the receive list.

3 (= 03 hex):

Telegram is longer than specified in the length byte or in the receive list.

4 (= 04 hex):

The length of the receive telegram does not match the receive list.

5 (= 05 hex):

The type of the receive telegram does not match the receive list.

6 (= 06 hex):

The address of the power unit in the telegram and in the receive list do not match.

9 (= 09 hex):

The DRIVE-CLiQ communication from the DRIVE-CLiQ component involved to the Control Unit signals that the supply voltage has failed.

16 (= 10 hex):

The receive telegram is too early.

17 (= 11 hex):

CRC error and the receive telegram is too early.

18 (= 12 hex):

The telegram is shorter than that specified in the length byte or in the receive list and the receive telegram is too early.

19 (= 13 hex):

The telegram is longer than that specified in the length byte or in the receive list and the receive telegram is too early.

20 (= 14 hex):

The length of the receive telegram does not match the receive list and the receive telegram is too early.

21 (= 15 hex):

The type of the receive telegram does not match the receive list and the receive telegram is too early.

22 (= 16 hex):

The address of the power unit in the telegram and in the receive list does not match and the receive telegram is too early.

25 (= 19 hex):

The error bit in the receive telegram is set and the receive telegram is too early.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy:

- carry out a POWER ON (switch-off/switch-on).
- check the electrical cabinet design and cable routing for EMC compliance
- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

232875 **<location>Encoder 2: power supply voltage failed****Drive object:** HLA_828, SERVO_828, SERVO_COMBI**Message value:** Component number: %1, fault cause: %2**Reaction:** Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge:	IMMEDIATELY
Cause:	The DRIVE-CLiQ communication from the DRIVE-CLiQ component involved to the Control Unit signals that the supply voltage has failed. Fault cause: 9 (= 09 hex): The power supply voltage for the components has failed. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON (switch-off/switch-on). - check the power supply voltage wiring for the DRIVE-CLiQ component (interrupted cable, contacts, ...). - check the dimensioning of the power supply for the DRIVE-CLiQ component.

232885 <location>Encoder 2 DRIVE-CLiQ (CU): Cyclic data transfer error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 2) involved to the Control Unit. The nodes do not send and receive in synchronism. Fault cause: 26 (= 1A hex): Sign-of-life bit in the receive telegram not set and the receive telegram is too early. 33 (= 21 hex): The cyclic telegram has not been received. 34 (= 22 hex): Timeout in the telegram receive list. 64 (= 40 hex): Timeout in the telegram send list. 98 (= 62 hex): Error at the transition to cyclic operation. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the power supply voltage of the component involved. - carry out a POWER ON (switch-off/switch-on). - replace the component involved.

232886 <location>Encoder 2 DRIVE-CLiQ (CU): Error when sending DRIVE-CLiQ data

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY

Cause:	A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 2) involved to the Control Unit. Data were not able to be sent. Fault cause: 65 (= 41 hex): Telegram type does not match send list. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON.

232887 <location>Encoder 2 DRIVE-CLiQ (CU): Component fault

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	Fault detected on the DRIVE-CLiQ component involved (Sensor Module for encoder 2). Faulty hardware cannot be excluded. Fault cause: 32 (= 20 hex): Error in the telegram header. 35 (= 23 hex): Receive error: The telegram buffer memory contains an error. 66 (= 42 hex): Send error: The telegram buffer memory contains an error. 67 (= 43 hex): Send error: The telegram buffer memory contains an error. 96 (= 60 hex): Response received too late during runtime measurement. 97 (= 61 hex): Time taken to exchange characteristic data too long. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...). - check the electrical cabinet design and cable routing for EMC compliance - if required, use another DRIVE-CLiQ socket (p9904). - replace the component involved.

232895 <location>Encoder 2 DRIVE-CLiQ (CU): Alternating cyclic data transfer error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 2) involved to the Control Unit. Fault cause: 11 (= 0B hex): Synchronization error during alternating cyclic data transfer. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause

Remedy: Carry out a POWER ON.

232896 <location>Encoder 2 DRIVE-CLiQ (CU): Inconsistent component properties

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Component number: %1

Reaction: Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2)
Hla: OFF2 (NONE, OFF1, OFF3, STOP2)

Acknowledge: IMMEDIATELY

Cause: The properties of the DRIVE-CLiQ component (Sensor Module for encoder 2), specified by the fault value, have changed in an incompatible fashion with respect to the properties when booted. One cause can be, e.g. that a DRIVE-CLiQ cable or DRIVE-CLiQ component has been replaced.

Fault value (r0949, interpret decimal):

Component number.

Remedy:

- carry out a POWER ON.
- when a component is replaced, the same component type and if possible the same firmware version should be used.
- when a cable is replaced, only cables whose length is the same as or as close as possible to the length of the original cables should be used (ensure compliance with the maximum cable length).

232899 <location>Encoder 2: Unknown fault

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: New message: %1

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2)
Hla: OFF1 (NONE, OFF2, OFF3, STOP2)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: A fault occurred on the Sensor Module for encoder 2 that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit.

Fault value (r0949, interpret decimal):

Fault number.

Note:

If required, the significance of this new fault can be read about in a more recent description of the Control Unit.

Remedy:

- replace the firmware on the Sensor Module by an older firmware version (r0148).
- upgrade the firmware on the Control Unit (r0018).

232902 <location>Encoder 2: SPI-BUS error occurred

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: Error when operating the internal SPI bus.
Alarm value (r2124, interpret hexadecimal):
Only for internal Siemens troubleshooting.

Remedy:

- replace the Sensor Module.
- if required, upgrade the firmware in the Sensor Module.
- contact Technical Support.

232903 <location>Encoder 2: I2C-BUS error occurred

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

- Cause:** Error when operating the internal I2C bus.
Alarm value (r2124, interpret hexadecimal):
Only for internal Siemens troubleshooting.
- Remedy:** - replace the Sensor Module.
- if required, upgrade the firmware in the Sensor Module.
- contact Technical Support.

232905 <location>Encoder 2: Encoder parameterization error

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Parameter: %1, supplementary information: %2

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2)
Hla: OFF1 (NONE, OFF2, OFF3, STOP2)

Acknowledge: IMMEDIATELY

- Cause:** An error was identified in the encoder parameterization.
It is possible that the parameterized encoder type does not match the connected encoder.
The parameter involved can be determined as follows:
- determine the parameter number using the fault value (r0949).
 - determine the parameter index (p0187).
- Fault value (r0949, interpret decimal):
yyyyxxxx dec: yyyy = supplementary information, xxxx = parameter
xxxx = 421:
- For an EnDat/SSI encoder, the absolute position in the protocol must be less than or equal to 30 bits.
- yyyy = 0:
No additional information available.
- yyyy = 1:
The component does not support HTL level (p0405.1 = 0) combined with track monitoring A/B <> -A/B (p0405.2 = 1).
- yyyy = 2:
A code number for an identified encoder has been entered into p0400, however, no identification was carried out. Please start a new encoder identification.
- yyyy = 3:
A code number for an identified encoder has been entered into p0400, however, no identification was carried out. Please select a listed encoder in p0400 with a code number < 10000.
- yyyy = 4:
This component does not support SSI encoders (p0404.9 = 1) without track A/B.
- yyyy = 5:
For SQW encoder, value in p4686 greater than in p0425.
- yyyy = 6:
DRIVE-CLiQ encoder cannot be used with this firmware version.
- yyyy = 7:
For an SQW encoder, the XIST1 correction (p0437.2) is only permitted for equidistant zero marks.
- yyyy = 8:
The motor pole pair width is not supported by the linear scale being used.
- yyyy = 9:
The length of the position in the EnDat protocol may be a maximum of 32 bits.
- yyyy = 10:
The connected encoder is not supported.
- yyyy = 11:
The hardware does not support track monitoring.

- Remedy:**
- check whether the connected encoder type matches the encoder that has been parameterized.
 - correct the parameter specified by the fault value (r0949) and p0187.
 - re parameter number = 314:
 - check the pole pair number and measuring gear ratio. The quotient of the "pole pair number" divided by the "measuring gear ratio" must be less than or equal to 1000 ($(r0313 * p0433) / p0432 \leq 1000$).

232912 <location>Encoder 2: Device combination is not permissible

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Servo: OFF1 (IASC/DCBRK, NONE)
Hla: OFF1 (NONE)

Acknowledge: PULSE INHIBIT

Cause: The selected device combination is not supported.

Fault value (r0949, interpret decimal):

1003:

The connected measuring unit cannot be operated with the EnDat 2.2 converter. For instance, the measuring unit has a pulse number/resolution of 2^n .

1005:

The type of measuring unit (incremental) is not supported by the EnDat 2.2 converter.

1006:

The maximum duration of the EnDat transfer (31.25 μ s) was exceeded.

2001:

The set combination of current controller cycle, DP cycle and Safety cycle is not supported by the EnDat 2.2 converter.

2002:

The resolution of the linear measuring unit does not match the pole pair width of the linear motor

Pole pair width, minimum = $p0422 * 2^{20}$

Remedy:

For fault value = 1003, 1005, 1006:

- Use a measuring unit that is permissible.

For fault value = 2001:

- set a permissible cycle combination (if required, use standard settings).

For fault value = 2002:

- Use a measuring unit with a lower resolution (p0422).

232915 <location>Encoder 2: Encoder configuration error

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The configuration for encoder 2 is incorrect.

Alarm value (r2124, interpret decimal):

1:

Re-parameterization between fault/alarm is not permissible.

2:

The cyclic DQ receive telegram is too long and is limited.

3:

The cyclic DQ send telegram is too long and is limited.

419:

When the fine resolution Gx_XIST2 is configured, the encoder identifies a maximum possible absolute position actual value (r0483) that can no longer be represented within 32 bits.

Remedy: For alarm value = 1:
No re-parameterization between fault/alarm.
For alarm value = 419:
Reduce the fine resolution (p0419) or deactivate the monitoring (p0437.25), if the complete multiturn range is not required.

232916 <location>Encoder 2: Encoder parameterization error

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Parameter: %1, supplementary information: %2

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2)
Hla: OFF1 (NONE, OFF2, OFF3, STOP2)

Acknowledge: IMMEDIATELY

Cause: An encoder parameter was detected as being incorrect.
It is possible that the parameterized encoder type does not match the connected encoder.
The parameter involved can be determined as follows:
- determine the parameter number using the fault value (r0949).
- determine the parameter index (p0187).
Fault value (r0949, interpret decimal):
Parameter number.

Remedy: - check whether the connected encoder type matches the encoder that has been parameterized.
- correct the parameter specified by the fault value (r0949) and p0187.

232920 <location>Encoder 2: Temperature sensor fault (motor)

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Fault cause: %1, channel number: %2

Reaction: NONE

Acknowledge: NONE

Cause: The motor detected a fault when evaluating the temperature sensor.
Fault cause:
1 (= 01 hex):
Wire breakage or sensor not connected.
KTY: R > 1630 Ohm, PT1000: R > 1720 Ohm
2 (= 02 hex):
Measured resistance too low.
PTC: R < 20 Ohm, KTY: R < 50 Ohm, PT1000: R < 603 Ohm
Additional values:
Only for internal Siemens troubleshooting.
Note regarding the message value:
The individual information is coded as follows in the message value (r0949/r2124):
0000yyxx hex: yy = channel number, xx = error cause

Remedy: - check that the encoder cable is the correct type and is correctly connected.
- check the temperature sensor selection in p0600 to p0603.
- replace the Sensor Module (hardware defect or incorrect calibration data).

232930 <location>Encoder 2: Data logger has saved data

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause:	For the activated function "Data logger" (p0437.0 = 1) a fault has occurred with the Sensor Module. This alarm indicates that the diagnostics data corresponding to the fault was saved on the memory card. The diagnostics data is saved in the following folder: /USER/SINAMICS/DATA/SMTRC00.BIN ... /USER/SINAMICS/DATA/SMTRC07.BIN /USER/SINAMICS/DATA/SMTRCIDX.TXT The following information is contained in the TXT file: - Display of the last written BIN file. - Number of write operations that are still possible (from 10000 downwards). Note: Only Siemens can evaluate the BIN files.
Remedy:	Not necessary. This alarm is automatically withdrawn. The data logger is ready to record the next fault case.

232940 <location>Encoder 2: Spindle sensor S1 voltage incorrect

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The voltage of analog sensor S1 is outside the permissible range. Alarm value (r2124, interpret decimal): Signal level from sensor S1. Note: A signal level of 500 mV corresponds to the numerical value 500 dec.
Remedy:	- check the clamped tool. - check the tolerance and if required, adapt (p5040). - check the thresholds and if required, adapt (p5041). - check analog sensor S1 and connections. See also: p5040 (Spindle voltage threshold values tolerance), p5041 (Spindle voltage threshold values)

232950 <location>Encoder 2: Internal software error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF1 (OFF2)
Acknowledge:	POWER ON
Cause:	An internal software error has occurred. Fault value (r0949, interpret decimal): Information about the fault source. Only for internal Siemens troubleshooting.
Remedy:	- if necessary, upgrade the firmware in the Sensor Module to a later version. - contact Technical Support.

232999 <location>Encoder 2: Unknown alarm

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	New message: %1
Reaction:	NONE
Acknowledge:	NONE

Cause:	A alarm has occurred on the Sensor Module for encoder 2 that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit. Alarm value (r2124, interpret decimal): Alarm number. Note: If required, the significance of this new alarm can be read about in a more recent description of the Control Unit.
Remedy:	- replace the firmware on the Sensor Module by an older firmware version (r0148). - upgrade the firmware on the Control Unit (r0018).

233100 <location>Encoder 3: Zero mark distance error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2) Hla: OFF1 (NONE, OFF2, OFF3, STOP2)
Acknowledge:	PULSE INHIBIT
Cause:	The measured zero mark distance does not correspond to the parameterized zero mark distance. For distance-coded encoders, the zero mark distance is determined from zero marks detected pairs. This means that if a zero mark is missing, depending on the pair generation, this cannot result in a fault and also has no effect in the system. The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder). Fault value (r0949, interpret decimal): Last measured zero mark distance in increments (4 increments = 1 encoder pulse). The sign designates the direction of motion when detecting the zero mark distance.
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - check the encoder type (encoder with equidistant zero marks). - adapt the parameter for the distance between zero marks (p0424, p0425). - if message output above speed threshold, reduce filter time if necessary (p0438). - replace the encoder or encoder cable.

233101 <location>Encoder 3: Zero mark failed

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2) Hla: OFF1 (NONE, OFF2, OFF3, STOP2)
Acknowledge:	PULSE INHIBIT
Cause:	The 1.5 x parameterized zero mark distance was exceeded. The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder). Fault value (r0949, interpret decimal): Number of increments after POWER ON or since the last zero mark that was detected (4 increments = 1 encoder pulse).
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - check the encoder type (encoder with equidistant zero marks). - adapt the parameter for the clearance between zero marks (p0425). - if message output above speed threshold, reduce filter time if necessary (p0438). - when p0437.1 is active, check p4686. - replace the encoder or encoder cable.

233103 <location>Encoder 3: Signal level zero track (track R) outside tolerance

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	R track: %1

Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	The zero mark signal level (track R) does not lie within the tolerance bandwidth for encoder 1. The fault can be initiated when the unipolar voltage level is exceeded (RP/RN) or if the differential amplitude is undershot. Fault value (r0949, interpret hexadecimal): yyyyxxxx hex: yyyy = 0, xxxx = Signal level, track R (16 bits with sign) The response thresholds of the unipolar signal levels of the encoder are between < 1400 mV and > 3500 mV. The response threshold for the differential signal level of the encoder is < -1600 mV. A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec. Note: The analog value of the amplitude error is not measured at the same time with the hardware fault output by the Sensor Module. The fault value can only be represented between -32768 ... 32767 dec (-770 ... 770 mV). The signal level is not evaluated unless the following conditions are satisfied: - Sensor Module properties available (r0459.31 = 1). - monitoring active (p0437.31 = 1).
Remedy:	- check the speed range; frequency characteristic (amplitude characteristic) of the measuring equipment might not be sufficient for the speed range - check that the encoder cables and shielding are routed in compliance with EMC. - check the plug connections and contacts of the encoder cable. - check the encoder type (encoder with zero marks). - check whether the zero mark is connected and the signal cables RP and RN have been connected correctly (not connected with the incorrect polarity). - replace the encoder cable. - if the coding disk is soiled or the lighting aged, replace the encoder.

233110 <location>Encoder 3: Serial communications error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	PULSE INHIBIT

Cause:	There is an error in the transfer of the serial communication protocol between the encoder and internal or external evaluation module. Fault value (r0949, interpret binary): For an EnDat 2.1 encoder, the significance of the fault value is as follows: Bit 0: Alarm bit in the position protocol. Bit 1: Incorrect quiescent level on the data line. Bit 2: Encoder does not respond (does not supply a start bit within 50 ms). Bit 3: CRC error: The checksum in the protocol from the encoder does not match the data. Bit 4: Encoder acknowledgment error: The encoder incorrectly understood the task (request) or cannot execute it. Bit 5: Internal error in the serial driver: An illegal mode command was requested. Bit 6: Timeout when cyclically reading. Bit 7: Timeout for the register communication. Bit 8: Protocol is too long (e.g. > 64 bits). Bit 9: Receive buffer overflow. Bit 10: Frame error when reading twice. Bit 11: Parity error. Bit 12: Data line signal level error during the monoflop time. Bit 13: Data line incorrect. Bit 14: Fault for the register communication. Bit 15: Internal communication error. Note: For an EnDat 2.2 encoder, the significance of the fault value for F3x135 (x = 1, 2, 3) is described.
Remedy:	For fault value, bit 0 = 1: - Enc defect F31111 may provide additional details. For fault value, bit 1 = 1: - incorrect encoder type / replace the encoder or encoder cable. For fault value, bit 2 = 1: - incorrect encoder type / replace the encoder or encoder cable. For fault value, bit 3 = 1: - EMC / connect the cable shield, replace the encoder or encoder cable. For fault value, bit 4 = 1: - EMC / connect the cable shield, replace the encoder or encoder cable, replace the Sensor Module. For fault value, bit 5 = 1: - EMC / connect the cable shield, replace the encoder or encoder cable, replace the Sensor Module. For fault value, bit 6 = 1: - Update Sensor Module firmware. For fault value, bit 7 = 1: - incorrect encoder type / replace the encoder or encoder cable. For fault value, bit 8 = 1: - check parameterization (p0429.2). For fault value, bit 9 = 1: - EMC / connect the cable shield, replace the encoder or encoder cable, replace the Sensor Module. For fault value, bit 10 = 1: - check parameterization (p0429.2, p0449). For fault value, bit 11 = 1: - check parameterization (p0436). For fault value, bit 12 = 1: - check parameterization (p0429.6). For fault value, bit 13 = 1: - check data line. For fault value, bit 14 = 1: - incorrect encoder type / replace the encoder or encoder cable.

233111	<location>Encoder 3: Encoder signals an internal error (detailed information)
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin, additional information: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	PULSE INHIBIT
Cause:	The encoder error word provides detailed information (error bit). For p0404.8 = 0, the following applies: Fault value for internal Siemens troubleshooting. For p0404.8 = 1, the following applies: Fault value (r0949, interpret binary): yyyyxxx hex: yyyy = supplementary information, xxxx = fault cause yyyy = 0: Bit 0: Lighting system failed. Bit 1: Signal amplitude too low. Bit 2: Position value incorrect. Bit 3: Encoder power supply overvoltage condition. Bit 4: Encoder power supply undervoltage condition. Bit 5: Encoder power supply overcurrent condition. Bit 6: The battery must be changed.
Remedy:	For yyyy = 0: For fault value, bit 0 = 1: Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor. For fault value, bit 1 = 1: Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor. For fault value, bit 2 = 1: Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor. For fault value, bit 3 = 1: 5 V power supply voltage fault. When using an SMC: Check the plug-in cable between the encoder and SMC or replace the SMC. When a motor encoder with a direct DRIVE-CLiQ connection is used: Replace the motor. For fault value, bit 4 = 1: 5 V power supply voltage fault. When using an SMC: Check the plug-in cable between the encoder and SMC or replace the SMC. When using a motor with DRIVE-CLiQ: Replace the motor. For fault value, bit 5 = 1: Encoder is defective. Replace the encoder, where the motor encoder has a direct DRIVE-CLiQ socket: Replace the motor. For fault value, bit 6 = 1: The battery must be changed (only for encoders with battery back-up). For yyyy = 1: Encoder is defective. Replace encoder.
233112	<location>Encoder 3: Encoder signals an internal error
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	PULSE INHIBIT
Cause:	The encoder signals a set error bit via the serial protocol. Fault value (r0949, interpret binary): Bit 0: Fault bit in the position protocol.

Remedy: For fault value, bit 0 = 1:
In the case of an EnDat encoder, F31111 may provide further details.

233115 <location>Encoder 3: Signal level track A or B too low

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: A track: %1, B-track: %2

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: PULSE INHIBIT

Cause: The signal level (root from $A^2 + B^2$) of the encoder falls below the permissible limit value.

Fault value (r0949, interpret hexadecimal):

yyyyxxxx hex:

yyyy = Signal level, track B (16 bits with sign).

xxxx = Signal level, track A (16 bits with sign).

The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).

The response threshold is < 170 mV (input frequency ≤ 256 kHz) or < 120 mV (input frequency > 256 kHz).

A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.

Note for Sensor Modules for resolvers (e.g. SMC10):

The nominal signal level is at 2900 mV (2.0 Vrms). The response threshold is < 1070 mV.

A signal level of 2900 mV peak value corresponds to the numerical value 6666 hex = 26214 dec.

Note:

The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.

Remedy:

- check that the encoder cables and shielding are routed in compliance with EMC.
- check the plug connections.
- replace the encoder or encoder cable.
- check the Sensor Module (e.g. contacts).

The following applies to measuring systems without their own bearing system:

- adjust the scanning head and check the bearing system of the measuring wheel.

The following applies for measuring systems with their own bearing system:

- ensure that the encoder housing is not subject to any axial force.

233116 <location>Encoder 3: Signal level track A or B too low

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: A track: %1, B-track: %2

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause: The signal level of the rectified encoder signals A and B of the encoder fall below the permissible limit value.

Fault value (r0949, interpret hexadecimal):

yyyyxxxx hex:

yyyy = Signal level, track B (16 bits with sign).

xxxx = Signal level, track A (16 bits with sign).

The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).

The response threshold is < 130 mV.

A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.

Note:

The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.

- Remedy:**
- check that the encoder cables and shielding are routed in compliance with EMC.
 - check the plug connections.
 - replace the encoder or encoder cable.
 - check the Sensor Module (e.g. contacts).

233117 <location>Encoder 3: Inversion error signals A/B/R

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Fault cause: %1 bin

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause: For a square-wave encoder (bipolar, double ended) signals A*, B* and R* are not inverted with respect to signals A, B and R.

Fault value (r0949, interpret binary):

Bits 0 ... 15: Only for internal Siemens troubleshooting.

Bit 16: Error track A.

Bit 17: Error track B.

Bit 18: Error track R.

Note:

For SMC30 (only Article No. 6SL3055-0AA00-5CA0 and 6SL3055-0AA00-5CA1), CUA32 and CU310-2, the following applies:

A square-wave encoder without track R is used and track monitoring (p0405.2 = 1) is activated.

- Remedy:**
- check the encoder/cable.
 - Does the encoder supply signals and the associated inverted signals?

Note:

For SMC30 (only Article Number 6SL3055-0AA00-5CA0 and 6SL3055-0AA00-5CA1), the following applies:

- check the setting of p0405 (p0405.2 = 1 is only possible if the encoder is connected at X520).

For a square-wave encoder without track R, the following jumpers must be set for the connection at X520 (SMC30), X220 (CUA32) or X23 (CU310-2):

- pin 10 (reference signal R) <--> pin 7 (encoder power supply, ground)
- pin 11 (reference signal R inverted) <--> pin 4 (encoder power supply)

233118 <location>Encoder 3: Speed change not plausible

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: PULSE INHIBIT

Cause: For an HTL/TTL encoder, the speed change has exceeded the value in p0492 over several sampling cycles.

The change to the averaged speed actual value - if applicable - is monitored in the current controller sampling time.

Fault value (r0949, interpret decimal):

Only for internal Siemens troubleshooting.

See also: p0492

- Remedy:**
- check the tachometer feeder cable for interruptions.
 - check the grounding of the tachometer shielding.
 - if required, increase the maximum speed difference per sampling cycle (p0492).

233120 <location>Encoder 3: Encoder power supply fault

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Fault cause: %1 bin

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: PULSE INHIBIT

Cause: An encoder power supply fault was detected.

Fault value (r0949, interpret binary):

Bit 0: Undervoltage condition on the sense line.

Bit 1: Overcurrent condition for the encoder power supply.

Bit 2: Overcurrent condition for encoder power supply on cable resolver excitation negative.

Bit 3: Overcurrent condition for encoder power supply on cable resolver excitation positive.

Bit 4: The 24 V power supply through the Power Module (PM) is overloaded.

Bit 5: Overcurrent at the EnDat connection of the converter.

Bit 6: Overvoltage at the EnDat connection of the converter.

Bit 7: Hardware fault at the EnDat connection of the converter.

Note:

If the encoder cables 6FX2002-2EQ00-.... and 6FX2002-2CH00-.... are interchanged, this can result in the encoder being destroyed because the pins of the operating voltage are reversed.

Remedy: For fault value, bit 0 = 1:

- correct encoder cable connected?
- check the plug connections of the encoder cable.
- SMC30: Check the parameterization (p0404.22).

For fault value, bit 1 = 1:

- correct encoder cable connected?
- replace the encoder or encoder cable.

For fault value, bit 2 = 1:

- correct encoder cable connected?
- replace the encoder or encoder cable.

For fault value, bit 3 = 1:

- correct encoder cable connected?
- replace the encoder or encoder cable.

For fault value, bit 5 = 1:

- Measuring unit correctly connected at the converter?
- Replace the measuring unit or the cable to the measuring unit.

For fault value, bit 6, 7 = 1:

- Replace the defective EnDat 2.2 converter.

233121 <location>Encoder 3: Determined commutation position incorrect

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF1 (NONE, OFF2, OFF3)

Acknowledge: PULSE INHIBIT

Cause: A commutation position actual value sensing error was detected.

Remedy: Replace the motor with DRIVE-CLiQ or the appropriate Sensor Module.

233122 <location>Encoder 3: Sensor Module hardware fault

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF1

Acknowledge: IMMEDIATELY

Cause: An internal Sensor Module hardware fault was detected.

Fault value (r0949, interpret decimal):

1: Reference voltage error.

2: Internal undervoltage.

3: Internal overvoltage.

Remedy: Replace the motor with DRIVE-CLiQ or the appropriate Sensor Module.

233123 <location>Encoder 3: Signal level A/B outside tolerance

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Fault cause: %1 bin

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause: The unipolar level (AP/AN or BP/BN) for encoder 3 is outside the permissible tolerance.
Fault value (r0949, interpret binary):
Bit 0 = 1: Either AP or AN outside the tolerance.
Bit 16 = 1: Either BP or BN outside the tolerance.
The unipolar nominal signal level of the encoder must lie in the range 2500 mV +/- 500 mV.
The response thresholds are < 1700 mV and > 3300 mV.
Note:
The signal level is not evaluated unless the following conditions are satisfied:
- Sensor Module properties available (r0459.31 = 1).
- monitoring active (p0437.31 = 1).

Remedy:

- make sure that the encoder cables and shielding are installed in an EMC-compliant manner.
- check the plug connections and contacts of the encoder cable.
- check the short-circuit of a signal cable with mass or the operating voltage.
- replace the encoder cable.

233125 <location>Encoder 3: Signal level track A or B too high

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: A track: %1, B-track: %2

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2)
Hla: OFF1 (NONE, OFF2, OFF3, STOP2)

Acknowledge: PULSE INHIBIT

Cause: The signal level (root from $A^2 + B^2$) of the encoder exceeds the permissible limit value.
Fault value (r0949, interpret hexadecimal):
yyyyxxxx hex:
yyyy = Signal level, track B (16 bits with sign).
xxxx = Signal level, track A (16 bits with sign).
The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).
The response threshold is > 750 mV.
A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.
Note for Sensor Modules for resolvers (e.g. SMC10):
The nominal signal level is at 2900 mV (2.0 Vrms).
The response threshold is > 3582 mV.
A signal level of 2900 mV peak value corresponds to the numerical value 6666 hex = 26214 dec.
Note:
The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.

Remedy:

- check that the encoder cables and shielding are routed in compliance with EMC.
- replace the encoder or encoder cable.

233126 <location>Encoder 3: Signal level track A or B too high

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Amplitude: %1, Angle: %2

Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2) Hla: OFF1 (NONE, OFF2, OFF3, STOP2)
Acknowledge:	PULSE INHIBIT
Cause:	The signal level ($ A + B $) of the encoder exceeds the permissible limit value. Fault value (r0949, interpret hexadecimal): yyyyxxxx hex: yyyy = Angle xxxx = amplitude, i.e. root of $A^2 + B^2$ (16 bits without sign) The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV $-25/+20\%$). The response threshold for ($ A + B $) is > 1120 mV or the root of $(A^2 + B^2) > 955$ mV. A signal level of 500 mV peak value corresponds to the numerical value of 299A hex = 10650 dec. The angle 0 ... FFFF hex corresponds to 0 ... 360 degrees of the fine position. Zero degrees is present at the negative zero crossover of track B. Note: The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.
Remedy:	- check that the encoder cables and shielding are routed in compliance with EMC. - replace the encoder or encoder cable.

233129 <location>Encoder 3: Position difference hall sensor/track C/D and A/B too large

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	PULSE INHIBIT
Cause:	The error for track C/D is greater than $\pm 15^\circ$ mechanical or $\pm 60^\circ$ electrical or the error for the Hall signals is greater than $\pm 60^\circ$ electrical. One period of track C/D corresponds to 360° mechanical. One period of the Hall signal corresponds to 360° electrical. The monitoring responds if, for example, Hall sensors are connected as equivalent for the C/D tracks with the incorrect rotational sense or supply values that are not accurate enough. After the fine synchronization using one reference mark or 2 reference marks for distance-coded encoders, this fault is no longer initiated, but instead, Alarm A33429. Fault value (r0949, interpret decimal): For track C/D, the following applies: Measured deviation as mechanical angle (16 bits with sign, 182 dec corresponds to 1°). For Hall signals, the following applies: Measured deviation as electrical angle (16 bits with sign, 182 dec corresponds to 1°).
Remedy:	- track C or D not connected. - correct the direction of rotation of the Hall sensor possibly connected as equivalent for track C/D. - check that the encoder cables are routed in compliance with EMC. - check the adjustment of the Hall sensor.

233130 <location>Encoder 3: Zero mark and position error from the coarse synchronization

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Angular deviation, electrical: %1, angle, mechanical: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2) Hla: OFF1 (NONE, OFF2, OFF3, STOP2)
Acknowledge:	PULSE INHIBIT

Cause:	After initializing the pole position using track C/D, Hall signals or pole position identification routine, the zero mark was detected outside the permissible range. For distance-coded encoders, the test is carried out after passing 2 zero marks. Fine synchronization was not carried out. When initializing via track C/D (p0404) then it is checked whether the zero mark occurs in an angular range of $\pm 18^\circ$ mechanical. When initializing via Hall sensors (p0404) or pole position identification (p1982) it is checked whether the zero mark occurs in an angular range of $\pm 60^\circ$ electrical. Fault value (r0949, interpret hexadecimal): yyyyxxx hex yyyy: Determined mechanical zero mark position (can only be used for track C/D). xxxx: Deviation of the zero mark from the expected position as electrical angle. Scaling: 32768 dec = 180°
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - if the Hall sensor is used as an equivalent for track C/D, check the connection. - check the connection of track C or D. - replace the encoder or encoder cable.

233131	<location>Encoder 3: Position deviation incremental/absolute too high
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2) Hla: OFF1 (NONE, OFF2, OFF3, STOP2)
Acknowledge:	PULSE INHIBIT
Cause:	Absolute encoder: When cyclically reading the absolute position, an excessively high difference to the incremental position was detected. The absolute position that was read is rejected. Limit value for the deviation: - EnDat encoder: Is supplied from the encoder and is a minimum of 2 quadrants (e.g. EQI 1325 > 2 quadrants, EQN 1325 > 50 quadrants). - other encoders: 15 pulses = 60 quadrants. Incremental encoder: When the zero pulse is passed, a deviation in the incremental position was detected. For equidistant zero marks, the following applies: - the first zero mark passed supplies the reference point for all subsequent checks. The other zero marks must have n times the distance referred to the first zero mark. For distance-coded zero marks, the following applies: - the first zero mark pair supplies the reference point for all subsequent checks. The other zero mark pairs must have the expected distance to the first zero mark pair. Fault value (r0949, interpret decimal): Deviation in quadrants (1 pulse = 4 quadrants).
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - replace the encoder or encoder cable. - check whether the coding disk is dirty or there are strong ambient magnetic fields. - adapt the parameter for the clearance between zero marks (p0425). - if message output above speed threshold, reduce filter time if necessary (p0438).

233135	<location>Encoder 3: Fault when determining the position (singleturn)
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin

Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	PULSE INHIBIT
Cause:	The encoder has identified a position determination fault (singleturn) and supplies status information bit by bit in an internal status/fault word. Some of these bits cause this fault to be triggered. Other bits are status displays. The status/fault word is displayed in the fault value. Note regarding the bit designation: The first designation is valid for DRIVE-CLiQ encoders, the second for EnDat 2.2 encoders. Fault value (r0949, interpret binary): Bit 0: F1 (safety status display). Bit 1: F2 (safety status display). Bit 2: Reserved (lighting). Bit 3: Reserved (signal amplitude). Bit 4: Reserved (position value). Bit 5: Reserved (overvoltage). Bit 6: Reserved (undervoltage)/hardware fault EnDat supply (--> F3x110, x = 1, 2, 3). Bit 7: Reserved (overcurrent)/EnDat encoder withdrawn when not in the parked state (--> F3x110, x = 1, 2, 3). Bit 8: Reserved (battery)/overcurrent EnDat supply (--> F3x110, x = 1, 2, 3). Bit 9: Reserved/overvoltage EnDat supply (--> F3x110, x = 1, 2, 3). Bit 11: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 12: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 13: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 14: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 15: Internal communication error (--> F3x110, x = 1, 2, 3). Bit 16: Lighting (--> F3x135, x = 1, 2, 3). Bit 17: Signal amplitude (--> F3x135, x = 1, 2, 3). Bit 18: Singleturn position 1 (--> F3x135, x = 1, 2, 3). Bit 19: Overvoltage (--> F3x135, x = 1, 2, 3). Bit 20: Undervoltage (--> F3x135, x = 1, 2, 3). Bit 21: Overcurrent (--> F3x135, x = 1, 2, 3). Bit 22: Temperature exceeded (--> F3x405, x = 1, 2, 3). Bit 23: Singleturn position 2 (safety status display). Bit 24: Singleturn system (--> F3x135, x = 1, 2, 3). Bit 25: Singleturn power down (--> F3x135, x = 1, 2, 3). Bit 26: Multiturn position 1 (--> F3x136, x = 1, 2, 3). Bit 27: Multiturn position 2 (--> F3x136, x = 1, 2, 3). Bit 28: Multiturn system (--> F3x136, x = 1, 2, 3). Bit 29: Multiturn power down (--> F3x136, x = 1, 2, 3). Bit 30: Multiturn overflow/underflow (--> F3x136, x = 1, 2, 3). Bit 31: Multiturn battery (reserved).
Remedy:	- determine the detailed cause of the fault using the fault value. - replace the encoder if necessary. Note: An EnDat 2.2 encoder may only be removed and inserted in the "Park" state. If an EnDat 2.2 encoder was removed when not in the "Park" state, then after inserting the encoder, a POWER ON (switch-off/switch-on) is necessary to acknowledge the fault.

233136 <location>Encoder 3: Fault when determining the position (multiturn)

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Fault cause: %1 bin

Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	PULSE INHIBIT
Cause:	The encoder has identified a position determination fault (multiturn) and supplies status information bit by bit in an internal status/fault word. Some of these bits cause this fault to be triggered. Other bits are status displays. The status/fault word is displayed in the fault value. Note regarding the bit designation: The first designation is valid for DRIVE-CLiQ encoders, the second for EnDat 2.2 encoders. Fault value (r0949, interpret binary): Bit 0: F1 (safety status display). Bit 1: F2 (safety status display). Bit 2: Reserved (lighting). Bit 3: Reserved (signal amplitude). Bit 4: Reserved (position value). Bit 5: Reserved (overvoltage). Bit 6: Reserved (undervoltage)/hardware fault EnDat supply (--> F3x110, x = 1, 2, 3). Bit 7: Reserved (overcurrent)/EnDat encoder withdrawn when not in the parked state (--> F3x110, x = 1, 2, 3). Bit 8: Reserved (battery)/overcurrent EnDat supply (--> F3x110, x = 1, 2, 3). Bit 9: Reserved/overvoltage EnDat supply (--> F3x110, x = 1, 2, 3). Bit 11: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 12: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 13: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 14: Reserved/internal communication error (--> F3x110, x = 1, 2, 3). Bit 15: Internal communication error (--> F3x110, x = 1, 2, 3). Bit 16: Lighting (--> F3x135, x = 1, 2, 3). Bit 17: Signal amplitude (--> F3x135, x = 1, 2, 3). Bit 18: Singleturn position 1 (--> F3x135, x = 1, 2, 3). Bit 19: Overvoltage (--> F3x135, x = 1, 2, 3). Bit 20: Undervoltage (--> F3x135, x = 1, 2, 3). Bit 21: Overcurrent (--> F3x135, x = 1, 2, 3). Bit 22: Temperature exceeded (--> F3x405, x = 1, 2, 3). Bit 23: Singleturn position 2 (safety status display). Bit 24: Singleturn system (--> F3x135, x = 1, 2, 3). Bit 25: Singleturn power down (--> F3x135, x = 1, 2, 3). Bit 26: Multiturn position 1 (--> F3x136, x = 1, 2, 3). Bit 27: Multiturn position 2 (--> F3x136, x = 1, 2, 3). Bit 28: Multiturn system (--> F3x136, x = 1, 2, 3). Bit 29: Multiturn power down (--> F3x136, x = 1, 2, 3). Bit 30: Multiturn overflow/underflow (--> F3x136, x = 1, 2, 3). Bit 31: Multiturn battery (reserved).
Remedy:	- determine the detailed cause of the fault using the fault value. - replace the encoder if necessary. Note: An EnDat 2.2 encoder may only be removed and inserted in the "Park" state. If an EnDat 2.2 encoder was removed when not in the "Park" state, then after inserting the encoder, a POWER ON (switch-off/switch-on) is necessary to acknowledge the fault.

233137 <location>Encoder 3: Fault when determining the position (singleturn)

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Fault cause: %1 bin

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: PULSE INHIBIT

Cause: A position determination fault has occurred in the DRIVE-CLiQ encoder.
 Fault value (r0949, interpret binary):
 yyyyyxxx hex: yy = encoder version, xxxxxx = bit coding of the fault cause

 For yy = 8 (0000 1000 bin), the following applies:

Bit 1: Signal monitoring (sin/cos).
 Bit 8: F1 (safety status display) error position word 1.
 Bit 9: F2 (safety status display) error position word 2.
 Bit 16: LED monitoring.
 Bit 17: Fault when determining the position (multiturn).
 Bit 18: Single-step capability monitoring singleturn from the Safety channel.
 Bit 19: ECRC, configuration error in the safety channel.
 Bit 23: Temperature outside the limit values.

 For yy = 11 (0000 1011 bin), the following applies:

Bit 0: Position word 1 difference between rotation counter and software counter (XC_ERR).
 Bit 1: Position word 1 track error of the incremental signals (LIS_ERR).
 Bit 2: Position word 1 error when aligning between incremental track signals and absolute value (ST_ERR).
 Bit 3: Maximum permissible temperature exceeded (TEMP_ERR).
 Bit 4: Power supply overvoltage (MON_OVR_VOLT).
 Bit 5: Power supply overcurrent (MON_OVR_CUR).
 Bit 6: Power supply undervoltage (MON_UND_VOLT).
 Bit 7: Rotation error counter (MT_ERR).
 Bit 8: F1 (safety status display) error position word 1.
 Bit 9: F2 (safety status display) error position word 2.
 Bit 11: Position word 1 status bit: singleturn position OK (ADC_ready).
 Bit 12: Position word 1 status bit: rotation counter OK (MT_ready).
 Bit 13: Position word 1 memory error (MEM_ERR).
 Bit 14: Position word 1 absolute position error (MLS_ERR).
 Bit 15: position word 1 LED error, lighting unit error (LED_ERR).
 Bit 18: Position word 2 error when aligning between incremental track signals and absolute value (ST_ERR).
 Bit 21: Position word 2 memory error (MEM_ERR).
 Bit 22: Position word 2 absolute position error (MLS_ERR).
 Bit 23: position word 2 LED error, lighting unit error (LED_ERR).

 For yy = 12 (0000 1100 bin), the following applies:

Bit 8: encoder fault.
 Bit 10: error in the internal position data transport.

 For yy = 14 (0000 1110 bin), the following applies:

Bit 0: Position word 1 temperature outside limit value.
 Bit 1: Position word 1 position determination error (multiturn).
 Bit 2: Position word 1 FPGA error.
 Bit 3: Position word 1 velocity error.
 Bit 4: Position word 1 communication error between FPGAs/error in the incremental signal.
 Bit 5: Position word 1 timeout absolute value/error when determining the position (singleturn).
 Bit 6: Position word 1 internal hardware fault (clock/power monitor IC/power).
 Bit 7: Position word 1 internal error (FPGA communication/FPGA parameterization/self-test/software).
 Bit 8: F1 (safety status display) error position word 1.
 Bit 9: F2 (safety status display) error position word 2.
 Bit 16: Position word 2 temperature outside limit value.
 Bit 17: Position word 2 position determination error (multiturn).

Bit 18: Position word 2 FPGA error.

Bit 19: Position word 2 velocity error.

Bit 20: Position word 2 communication error between FPGAs.

Bit 21: Position word 2 position determination error (singleturn).

Bit 22: Position word 2 internal hardware fault (clock/power monitor IC/power).

Bit 23: Position word 2 internal error (self-test/software).

Note:

For an encoder version that is not described here, please contact the encoder manufacturer for more detailed information on the bit coding.

Remedy:

- determine the detailed cause of the fault using the fault value.
- if required, replace the DRIVE-CLiQ encoder.

233138 <location>Encoder 3: Fault when determining the position (multiturn)

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Fault cause: %1 bin

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
 Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: PULSE INHIBIT

Cause: A position determination fault has occurred in the DRIVE-CLiQ encoder.
 Fault value (r0949, interpret binary):
 yyyyyxxx hex: yy = encoder version, xxxxxx = bit coding of the fault cause

 For yy = 8 (0000 1000 bin), the following applies:

Bit 1: Signal monitoring (sin/cos).
 Bit 8: F1 (safety status display) error position word 1.
 Bit 9: F2 (safety status display) error position word 2.
 Bit 16: LED monitoring.
 Bit 17: Fault when determining the position (multiturn).
 Bit 19: ECRC, configuration error in the safety channel.
 Bit 23: Temperature outside the limit values.

 For yy = 11 (0000 1011 bin), the following applies:

Bit 0: Position word 1 difference between rotation counter and software counter (XC_ERR).
 Bit 1: Position word 1 track error of the incremental signals (LIS_ERR).
 Bit 2: Position word 1 error when aligning between incremental track signals and absolute value (ST_ERR).
 Bit 3: Maximum permissible temperature exceeded (TEMP_ERR).
 Bit 4: Power supply overvoltage (MON_OVR_VOLT).
 Bit 5: Power supply overcurrent (MON_OVR_CUR).
 Bit 6: Power supply undervoltage (MON_UND_VOLT).
 Bit 7: Rotation error counter (MT_ERR).
 Bit 8: F1 (safety status display) error position word 1.
 Bit 9: F2 (safety status display) error position word 2.
 Bit 11: Position word 1 status bit: singleturn position OK (ADC_ready).
 Bit 12: Position word 1 status bit: rotation counter OK (MT_ready).
 Bit 13: Position word 1 memory error (MEM_ERR).
 Bit 14: Position word 1 absolute position error (MLS_ERR).
 Bit 15: position word 1 LED error, lighting unit error (LED_ERR).
 Bit 18: Position word 2 error when aligning between incremental track signals and absolute value (ST_ERR).
 Bit 21: Position word 2 memory error (MEM_ERR).
 Bit 22: Position word 2 absolute position error (MLS_ERR).
 Bit 23: position word 2 LED error, lighting unit error (LED_ERR).

 For yy = 14 (0000 1110 bin), the following applies:

Bit 0: Position word 1 temperature outside limit value.
 Bit 1: Position word 1 position determination error (multiturn).
 Bit 2: Position word 1 FPGA error.
 Bit 3: Position word 1 velocity error.
 Bit 4: Position word 1 communication error between FPGAs/error in the incremental signal.
 Bit 5: Position word 1 timeout absolute value/error when determining the position (singleturn).
 Bit 6: Position word 1 internal hardware fault (clock/power monitor IC/power).
 Bit 7: Position word 1 internal error (FPGA communication/FPGA parameterization/self-test/software).
 Bit 8: F1 (safety status display) error position word 1.
 Bit 9: F2 (safety status display) error position word 2.
 Bit 16: Position word 2 temperature outside limit value.
 Bit 17: Position word 2 position determination error (multiturn).
 Bit 18: Position word 2 FPGA error.
 Bit 19: Position word 2 velocity error.
 Bit 20: Position word 2 communication error between FPGAs.
 Bit 21: Position word 2 position determination error (singleturn).
 Bit 22: Position word 2 internal hardware fault (clock/power monitor IC/power).

Bit 23: Position word 2 internal error (self-test/software).

Note:

For an encoder version that is not described here, please contact the encoder manufacturer for more detailed information on the bit coding.

Remedy:

- determine the detailed cause of the fault using the fault value.
- if required, replace the DRIVE-CLiQ encoder.

233142 <location>Encoder 3: Battery voltage fault

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: -

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2)
Hla: OFF1 (NONE, OFF2, OFF3, STOP2)

Acknowledge: IMMEDIATELY

Cause: When switched-off, the encoder uses a battery to back up the multturn information. The battery voltage is no longer sufficient to check the multturn information.

Remedy: Replace battery.

233150 <location>Encoder 3: Initialization error

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2)
Hla: OFF1 (NONE, OFF2, OFF3, STOP2)

Acknowledge: PULSE INHIBIT

Cause: Encoder functionality selected in p0404 cannot be executed.
Fault value (r0949, interpret hexadecimal):
Encoder malfunction.
The bit assignment corresponds to that of p0404 (e.g. bit 5 set: Error track C/D).

Remedy:

- check that p0404 is correctly set.
- check the encoder type used (incremental/absolute) and for SMCxx, the encoder cable.
- if relevant, note additional fault messages that describe the fault in detail.

233151 <location>Encoder 3: Encoder speed for initialization AB too high

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2)
Hla: OFF1 (NONE, OFF2, OFF3, STOP2)

Acknowledge: PULSE INHIBIT

Cause: The encoder speed is too high while initializing the Sensor Module.

Remedy: Reduce the speed of the encoder accordingly during initialization.
If necessary, deactivate monitoring (p0437.29).
See also: p0437 (Sensor Module configuration extended)

233152 <location>Encoder 3: Max. signal frequency (track A/B) exceeded

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2)
Hla: OFF1 (NONE, OFF2, OFF3, STOP2)

Acknowledge: PULSE INHIBIT

Cause:	The maximum signal frequency of the encoder evaluation has been exceeded. Fault value (r0949, interpret decimal): Actual input frequency in Hz. See also: p0408
Remedy:	- reduce the speed. - Use an encoder with a lower pulse number (p0408).

233153 <location>Encoder 3: Identification error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	An error has occurred when identifying the encoder (waiting) p0400 = 10100. The connected encoder was not able to be identified. Fault value (r0949, interpret binary): Bit 0: Data length incorrect. See also: p0400 (Encoder type selection)
Remedy:	Manually configure the encoder according to the data sheet.

233160 <location>Encoder 3: Analog sensor channel A failed

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE) Hla: OFF1 (NONE)
Acknowledge:	PULSE INHIBIT
Cause:	The input voltage of the analog sensor is outside the permissible limits. Fault value (r0949, interpret decimal): 1: Input voltage outside detectable measuring range. 2: Input voltage outside the measuring range set in (p4673). 3: The absolute value of the input voltage has exceeded the range limit (p4676).
Remedy:	For fault value = 1: - check the output voltage of the analog sensor. For fault value = 2: - check the voltage setting for each encoder period (p4673). For fault value = 3: - check the range limit setting and increase it if necessary (p4676).

233161 <location>Encoder 3: Analog sensor channel B failed

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE) Hla: OFF1 (NONE)
Acknowledge:	PULSE INHIBIT
Cause:	The input voltage of the analog sensor is outside the permissible limits. Fault value (r0949, interpret decimal): 1: Input voltage outside detectable measuring range. 2: Input voltage outside the selected measuring range (p4675). 3: The absolute value of the input voltage has exceeded the range limit (p4676).

Remedy:

For fault value = 1:

- check the output voltage of the analog sensor.

For fault value = 2:

- check the voltage setting for each encoder period (p4675).

For fault value = 3:

- check the range limit setting and increase it if necessary (p4676).

233163 <location>Encoder 3: Analog sensor position value exceeds limit value

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Servo: OFF1 (IASC/DCBRK, NONE)
Hla: OFF1 (NONE)

Acknowledge: PULSE INHIBIT

Cause: The position value has exceeded the permissible range of -0.5 ... +0.5.
Fault value (r0949, interpret decimal):
1: Position value from the LVDT sensor.
2: Position value from the encoder characteristic.

Remedy:

For fault value = 1:

- check the LVDT ratio (p4678).
- check the reference signal connection at track B.

For fault value = 2:

- check the coefficients of the characteristic (p4663 ... p4666).

233400 <location>Encoder 3: Zero mark distance error (alarm threshold exceeded)

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The measured zero mark distance does not correspond to the parameterized zero mark distance.
For distance-coded encoders, the zero mark distance is determined from zero marks detected pairs. This means that if a zero mark is missing, depending on the pair generation, this cannot result in a fault and also has no effect in the system.
The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder).
Alarm value (r2124, interpret decimal):
Last measured zero mark distance in increments (4 increments = 1 encoder pulse).
The sign designates the direction of motion when detecting the zero mark distance.

Remedy:

- check that the encoder cables are routed in compliance with EMC.
- check the plug connections.
- check the encoder type (encoder with equidistant zero marks).
- adapt the parameter for the distance between zero marks (p0424, p0425).
- replace the encoder or encoder cable.

233401 <location>Encoder 3: Zero mark failed (alarm threshold exceeded)

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The 1.5x parameterized zero mark distance was exceeded without a zero mark being detected.
The zero mark distance for the zero mark monitoring is set in p0425 (rotary encoder) or p0424 (linear encoder).
Alarm value (r2124, interpret decimal):
Number of increments after POWER ON or since the last zero mark that was detected (4 increments = 1 encoder pulse).

- Remedy:**
- check that the encoder cables are routed in compliance with EMC.
 - check the plug connections.
 - check the encoder type (encoder with equidistant zero marks).
 - adapt the parameter for the clearance between zero marks (p0425).
 - replace the encoder or encoder cable.

233405 <location>Encoder 3: Temperature in the encoder evaluation exceeded

- Drive object:** HLA_828, SERVO_828, SERVO_COMBI
- Message value:** temperature: [0.1 degrees C] %1, temperature sensor number: %2
- Reaction:** Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2)
Hla: OFF1 (NONE, OFF2, OFF3, STOP2)
- Acknowledge:** IMMEDIATELY (POWER ON)
- Cause:** An inadmissibly high temperature was detected in the encoder electronics or the encoder evaluation.
Fault value (r0949, interpret hexadecimal):
yyxxxx hex: yy = temperature sensor number, xxxx = measured module temperature in 0.1 °C.
- Remedy:** Reduce the ambient temperature for the DRIVE-CLiQ connection of the motor.

233407 <location>Encoder 3: Function limit reached

- Drive object:** HLA_828, SERVO_828, SERVO_COMBI
- Message value:** %1
- Reaction:** NONE
- Acknowledge:** NONE
- Cause:** The encoder has reached one of its function limits. A service is recommended.
Alarm value (r2124, interpret decimal):
1: Incremental signals
3: Absolute track
4: Code connection
- Remedy:** Perform service. Replace the encoder if necessary.
Note:
The actual functional reserve of an encoder can be displayed via r4651.
See also: p4650 (Encoder functional reserve component number), r4651 (Encoder functional reserve)

233410 <location>Encoder 3: Communication error (encoder and Sensor Module)

- Drive object:** HLA_828, SERVO_828, SERVO_COMBI
- Message value:** Fault cause: %1 bin
- Reaction:** NONE
- Acknowledge:** NONE

Cause:	Serial communication protocol transfer error between the encoder and evaluation module. Alarm value (r2124, interpret binary): Bit 0: Alarm bit in the position protocol. Bit 1: Incorrect quiescent level on the data line. Bit 2: Encoder does not respond (does not supply a start bit within 50 ms). Bit 3: CRC error: The checksum in the protocol from the encoder does not match the data. Bit 4: Encoder acknowledgment error: The encoder incorrectly understood the task (request) or cannot execute it. Bit 5: Internal error in the serial driver: An illegal mode command was requested. Bit 6: Timeout when cyclically reading. Bit 8: Protocol is too long (e.g. > 64 bits). Bit 9: Receive buffer overflow. Bit 10: Frame error when reading twice. Bit 11: Parity error. Bit 12: Data line signal level error during the monoflop time.
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - replace encoder.

233411 <location>Encoder 3: Encoder signals an internal alarm (detailed information)

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin, additional information: %2
Reaction:	NONE
Acknowledge:	NONE
Cause:	The absolute encoder fault word includes alarm bits that have been set. Alarm value (r2124, interpret binary): yyyyxxxx hex: yyyy = supplementary information, xxxx = fault cause yyyy = 0: Bit 0: Frequency exceeded (speed too high). Bit 1: Temperature exceeded. Bit 2: Control reserve, lighting system exceeded. Bit 3: Battery discharged. Bit 4: Reference point passed. yyyy = 1: Bit 0: Signal amplitude outside the control range. Bit 1: Error multiturn interface Bit 2: Internal data error (singleturn/multiturn not with single steps). Bit 3: Error EEPROM interface. Bit 4: SAR converter error. Bit 5: Fault for the register data transfer. Bit 6: Internal error identified at the error pin (nErr). Bit 7: Temperature threshold exceeded or fallen below.
Remedy:	Replace encoder.

233412 <location>Encoder 3: Encoder signals an internal alarm

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE

- Cause:** The encoder signals an internal alarm via serial protocol.
Alarm value (r2124, interpret binary):
Bit 0: Fault bit in the position protocol.
Bit 1: Alarm bit in the position protocol.
- Remedy:**
- carry out a POWER ON (switch-off/switch-on) for all components.
 - check that the encoder cables are routed in compliance with EMC.
 - check the plug connections.
 - replace encoder.

233414 <location>Encoder 3: Signal level track C or D out of tolerance

- Drive object:** HLA_828, SERVO_828, SERVO_COMBI
- Message value:** C track: %1, D track: %2
- Reaction:** NONE
- Acknowledge:** NONE
- Cause:** The signal level ($C^2 + D^2$) of track C or D of the encoder or from the Hall signals, is not within the tolerance bandwidth.
Alarm value (r2124, interpret hexadecimal):
yyyyxxxx hex:
yyyy = Signal level, track D (16 bits with sign).
xxxx = Signal level, track C (16 bits with sign).
The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).
The response thresholds are < 230 mV (observe the frequency response of the encoder) and > 750 mV.
A signal level of 500 mV peak value corresponds to the numerical value 5333 hex = 21299 dec.
Note:
If the amplitude is not within the tolerance bandwidth, then it cannot be used to initialize the start position.
- Remedy:**
- check that the encoder cables are routed in compliance with EMC.
 - check the plug connections.
 - replace the encoder or encoder cable.
 - check the Sensor Module (e.g. contacts).
 - check the Hall sensor box.

233415 <location>Encoder 3: Signal level track A or B outside tolerance (alarm)

- Drive object:** HLA_828, SERVO_828, SERVO_COMBI
- Message value:** Amplitude: %1, Angle: %2
- Reaction:** NONE
- Acknowledge:** NONE
- Cause:** The signal level (root from $A^2 + B^2$) of the encoder is outside the permissible tolerance.
Alarm value (r2124, interpret hexadecimal):
yyyyxxxx hex:
yyyy = Angle
xxxx = amplitude, i.e. root of $A^2 + B^2$ (16 bits without sign)
The nominal signal level of the encoder must lie in the range 375 mV to 600 mV (500 mV -25/+20 %).
The response threshold is < 230 mV (observe the frequency response of the encoder).
A signal level of 500 mV peak value corresponds to the numerical value 299A hex = 10650 dec.
The angle 0 ... FFFF hex corresponds to 0 ... 360 degrees of the fine position. Zero degrees is present at the negative zero crossover of track B.
Note for Sensor Modules for resolvers (e.g. SMC10):
The nominal signal level is at 2900 mV (2.0 Vrms). The response threshold is < 1414 mV (1.0 Vrms).
A signal level of 2900 mV peak value corresponds to the numerical value 3333 hex = 13107 dec.
Note:
The analog values of the amplitude error are not measured at the same time with the hardware fault output by the Sensor Module.

- Remedy:**
- check the speed range, frequency characteristic (amplitude characteristic) of the measuring equipment is not sufficient for the speed range.
 - check that the encoder cables and shielding are routed in compliance with EMC.
 - check the plug connections.
 - replace the encoder or encoder cable.
 - check the Sensor Module (e.g. contacts).
 - if the coding disk is soiled or the lighting aged, replace the encoder.

233418 <location>Encoder 3: Speed change not plausible (alarm)

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: For an HTL/TTL encoder, the speed change has exceeded the value in p0492 over several sampling cycles.
The change to the averaged speed actual value - if applicable - is monitored in the current controller sampling time.
Alarm value (r2124, interpret decimal):
Only for internal Siemens troubleshooting.
See also: p0492

- Remedy:**
- check the tachometer feeder cable for interruptions.
 - check the grounding of the tachometer shielding.
 - if required, increase the setting of p0492.

233419 <location>Encoder 3: Track A or B outside tolerance

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The amplitude/phase/offset correction for track A or B is at the limit.
Amplitude error correction: $\text{Amplitude B} / \text{Amplitude A} = 0.78 \dots 1.27$
Phase: <84 degrees or >96 degrees
SMC20: Offset correction: +/-140 mV
SMC10: Offset correction: +/-650 mV
Alarm value (r2124, interpret hexadecimal):
xxxx1: Minimum of the offset correction, track B
xxxx2: Maximum of the offset correction, track B
xxx1x: Minimum of the offset correction, track A
xxx2x: Maximum of the offset correction, track A
xx1xx: Minimum of the amplitude correction, track B/A
xx2xx: Maximum of the amplitude correction, track B/A
x1xxx: Minimum of the phase error correction
x2xxx: Maximum of the phase error correction
1xxxx: Minimum of the cubic correction
2xxxx: Maximum of the cubic correction

- Remedy:**
- check mechanical mounting tolerances for encoders without their own bearings (e.g. toothed-wheel encoders).
 - check the plug connections (also the transition resistance).
 - check the encoder signals.
 - replace the encoder or encoder cable.

233421 <location>Encoder 3: Determined commutation position incorrect (alarm)

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction:	NONE
Acknowledge:	NONE
Cause:	A commutation position actual value sensing error was detected. Alarm value (r2124, interpret decimal): 3: The absolute position of the serial protocol and track A/B differ by half an encoder pulse. The absolute position must have its zero position in the quadrants in which both tracks are negative. In the case of a fault, the position can be incorrect by one encoder pulse.
Remedy:	For alarm value = 3: - For a standard encoder with cable, contact the manufacturer where relevant. - correct the assignment of the tracks to the position value that is serially transferred. To do this, the two tracks must be connected, inverted, at the Sensor Module (interchange A with A* and B with B*) or, for a programmable encoder, check the zero offset of the position.

233422 <location>Encoder 3: Pulses per revolution square-wave encoder outside tolerance bandwidth

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The measured zero mark distance does not correspond to the parameterized zero mark distance. This alarm is triggered with active square-wave encoder PPR correction and re-parameterized fault 31131 if the accumulator contains larger values than p4683 or p4684. The zero mark distance for zero mark monitoring is set in p0425 (rotary encoder). Alarm value (r2124, interpret decimal): accumulated differential pulses in encoder pulses.
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - check the encoder type (encoder with equidistant zero marks). - adapt the parameter for the distance between zero marks (p0424, p0425). - replace the encoder or encoder cable.

233429 <location>Encoder 3: Position difference hall sensor/track C/D and A/B too large

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The error for track C/D is greater than +/-15 ° mechanical or +/-60 ° electrical or the error for the Hall signals is greater than +/-60 ° electrical. One period of track C/D corresponds to 360 ° mechanical. One period of the Hall signal corresponds to 360 ° electrical. The monitoring responds if, for example, Hall sensors are connected as equivalent for the C/D tracks with the incorrect rotational sense or supply values that are not accurate enough. Alarm value (r2124, interpret decimal): For track C/D, the following applies: Measured deviation as mechanical angle (16 bits with sign, 182 dec corresponds to 1 °). For Hall signals, the following applies: Measured deviation as electrical angle (16 bits with sign, 182 dec corresponds to 1 °).
Remedy:	- track C or D not connected. - correct the direction of rotation of the Hall sensor possibly connected as equivalent for track C/D. - check that the encoder cables are routed in compliance with EMC. - check the adjustment of the Hall sensor.

233431	<location>Encoder 3: Position deviation incremental/absolute too high (alarm)
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	When the zero pulse is passed, a deviation in the incremental position was detected. For equidistant zero marks, the following applies: - the first zero mark passed supplies the reference point for all subsequent checks. The other zero marks must have n times the distance referred to the first zero mark. For distance-coded zero marks, the following applies: - the first zero mark pair supplies the reference point for all subsequent checks. The other zero mark pairs must have the expected distance to the first zero mark pair. Alarm value (r2124, interpret decimal): Deviation in quadrants (1 pulse = 4 quadrants).
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - replace the encoder or encoder cable. - Clean coding disk or remove strong magnetic fields.
233432	<location>Encoder 3: Rotor position adaptation corrects deviation
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	On track A/B, pulses have been lost or too many have been counted. These pulses are presently being corrected. Alarm value (r2124, interpret decimal): Last measured deviation of zero mark in increments (4 increments = 1 encoder pulse). The sign designates the direction of motion when detecting the zero mark distance.
Remedy:	- check that the encoder cables are routed in compliance with EMC. - check the plug connections. - replace the encoder or encoder cable. - check encoder limit frequency. - adapt the parameter for the distance between zero marks (p0424, p0425).
233442	<location>Encoder 3: Battery voltage alarm threshold reached
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	When switched-off, the encoder uses a battery to back up the multiturn information. The multiturn information can no longer be buffered if the battery voltage drops even further.
Remedy:	Replace battery.
233443	<location>Encoder 3: Signal level track C/D outside tolerance (alarm)
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	NONE
Acknowledge:	NONE

Cause:	The unipolar level (CP/CN or DP/DN) for encoder 3 is outside the permissible tolerance. Alarm value (r2124, interpret binary): Bit 0 = 1: Either CP or CN outside the tolerance. Bit 16 = 1: Either DP or DN outside the tolerance. The unipolar nominal signal level of the encoder must lie in the range 2500 mV +/- 500 mV. The response thresholds are < 1700 mV and > 3300 mV. Note: The signal level is not evaluated unless the following conditions are satisfied: - Sensor Module properties available (r0459.31 = 1). - monitoring active (p0437.31 = 1).
Remedy:	- check that the encoder cables and shielding are routed in compliance with EMC. - check the plug connections and contacts of the encoder cable. - are the C/D tracks connected correctly (have the signal cables CP and CN or DP and DN been interchanged)? - replace the encoder cable.

233460 <location>Encoder 3: Analog sensor channel A failed

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The input voltage of the analog sensor is outside the permissible limits. Alarm value (r2124, interpret decimal): 1: Input voltage outside detectable measuring range. 2: Input voltage outside measuring range set in p4673. 3: The absolute value of the input voltage has exceeded the range limit (p4676).
Remedy:	For alarm value = 1: - check the output voltage of the analog sensor. For alarm value = 2: - check the voltage setting for each encoder period (p4673). For alarm value = 3: - check the range limit setting and increase it if necessary (p4676).

233461 <location>Encoder 3: Analog sensor channel B failed

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The input voltage of the analog sensor is outside the permissible limits. Alarm value (r2124, interpret decimal): 1: Input voltage outside detectable measuring range. 2: Input voltage outside the selected measuring range (p4675). 3: The absolute value of the input voltage has exceeded the range limit (p4676).
Remedy:	For alarm value = 1: - check the output voltage of the analog sensor. For alarm value = 2: - check the voltage setting for each encoder period (p4675). For alarm value = 3: - check the range limit setting and increase it if necessary (p4676).

233462 <location>Encoder 3: Analog sensor no channel active

Drive object: HLA_828, SERVO_828, SERVO_COMBI
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: Channel A and B are not activated for the analog sensor.
Remedy:
- activate channel A and/or channel B (p4670).
- check the encoder configuration (p0404.17).
See also: p4670 (Analog sensor configuration)

233463 <location>Encoder 3: Analog sensor position value exceeds limit value

Drive object: HLA_828, SERVO_828, SERVO_COMBI
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: The position value has exceeded the permissible range of -0.5 ... +0.5.
Alarm value (r2124, interpret decimal):
1: Position value from the LVDT sensor.
2: Position value from the encoder characteristic.
Remedy:
For alarm value = 1:
- check the LVDT ratio (p4678).
- check the reference signal connection at track B.
For alarm value = 2:
- check the coefficients of the characteristic (p4663 ... p4666).

233470 <location>Encoder 3: Encoder signals an internal error (X521.7)

Drive object: HLA_828, SERVO_828, SERVO_COMBI
Message value: -
Reaction: NONE
Acknowledge: NONE
Cause: For the Sensor Module Cabinet 30 (SMC30), a dirty encoder is signaled via a 0 signal at terminal X521.7.
Remedy:
- check the plug connections.
- replace the encoder or encoder cable.

233500 <location>Encoder 3: Position tracking traversing range exceeded

Drive object: HLA_828, SERVO_828, SERVO_COMBI
Message value: -
Reaction: OFF1 (NONE, OFF2, OFF3)
Acknowledge: IMMEDIATELY
Cause: For a configured linear axis without modulo correction, the drive/encoder has exceeded the maximum possible traversing range. The value should be read in p0412 and interpreted as the number of motor revolutions.
For p0411.0 = 1, the maximum traversing range for the configured linear axis is defined to be 64x (+/- 32x) of p0421.
For p0411.3 = 1, the maximum traversing range for the configured linear axis is preset (default value) to the highest possible value and is +/-p0412/2 (rounded off to complete revolutions). The highest possible value depends on the pulse number (p0408) and the fine resolution (p0419).
Remedy: The fault should be resolved as follows:
- select encoder commissioning (p0010 = 4).
- reset the position tracking as follows (p0411.2 = 1).
- deselect encoder commissioning (p0010 = 0).
The fault should then be acknowledged and the absolute encoder adjusted.

233501	<location>Encoder 3: Position tracking encoder position outside tolerance window
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	When switched off, the drive/encoder was moved through a distance greater than was parameterized in the tolerance window. It is possible that there is no longer any reference between the mechanical system and encoder. Fault value (r0949, interpret decimal): Deviation (difference) to the last encoder position in increments of the absolute value. The sign designates the traversing direction. Note: The deviation (difference) found is also displayed in r0477. See also: p0413 (Measuring gear position tracking tolerance window), r0477 (Measuring gear position difference)
Remedy:	Reset the position tracking as follows: - select encoder commissioning (p0010 = 4). - reset the position tracking as follows (p0411.2 = 1). - deselect encoder commissioning (p0010 = 0). The fault should then be acknowledged and, if necessary, the absolute encoder adjusted (p2507). See also: p0010
233502	<location>Encoder 3: Encoder with measuring gear without valid signals
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF1 (OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	The encoder with measuring gear no longer provides any valid signals.
Remedy:	It must be ensured that all of the encoders, with mounted measuring gear, provide valid actual values in operation.
233503	<location>Encoder 3: Position tracking cannot be reset
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	The position tracking for the measuring gear cannot be reset.
Remedy:	The fault should be resolved as follows: - select encoder commissioning (p0010 = 4). - reset the position tracking as follows (p0411.2 = 1). - deselect encoder commissioning (p0010 = 0). The fault should then be acknowledged and the absolute encoder adjusted.
233700	<location>Encoder 3: Effectivity test does not supply the expected value
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	NONE
Acknowledge:	NONE
Cause:	The DRIVE-CLiQ encoder fault word supplies fault bits that have been set. Alarm value (r2124, interpret binary): Bit x = 1: Effectivity test x unsuccessful.
Remedy:	Replace encoder.

233800 <location>Encoder 3: Group signal

Drive object: HLA_828, SERVO_828, SERVO_COMBI
Message value: -
Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge: NONE
Cause: The motor encoder has detected at least one fault.
Remedy: Evaluate the other messages that are presently available.

233801 <location>Encoder 3 DRIVE-CLiQ: Sign-of-life missing

Drive object: HLA_828, SERVO_828, SERVO_COMBI
Message value: Component number: %1, fault cause: %2
Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge: IMMEDIATELY
Cause: A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder involved.
Fault cause:
10 (= 0A hex):
The sign-of-life bit in the receive telegram is not set.
Note regarding the message value:
The individual information is coded as follows in the message value (r0949/r2124):
0000yyxx hex: yy = component number, xx = error cause
Remedy:
- check the electrical cabinet design and cable routing for EMC compliance
- replace the component involved.

233802 <location>Encoder 3: Time slice overflow

Drive object: HLA_828, SERVO_828, SERVO_COMBI
Message value: %1
Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge: IMMEDIATELY
Cause: A time slice overflow has occurred in encoder 3.
Fault value (r0949, interpret hexadecimal):
yx hex: y = function involved (Siemens-internal fault diagnostics), x = time slice involved
x = 9:
Time slice overflow of the fast (current controller clock cycle) time slice.
x = A:
Time slice overflow of the average time slice.
x = C:
Time slice overflow of the slow time slice.
yx = 3E7:
Timeout when waiting for SYNO (e.g. unexpected return to non-cyclic operation).
Remedy: Increase the current controller sampling time
Note:
For a current controller sampling time = 31.25 µs, use an SMx20 with Article No. 6SL3055-0AA00-5xA3.

233804 <location>Encoder 3: Sensor Module checksum error

Drive object: HLA_828, SERVO_828, SERVO_COMBI
Message value: %1

Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	POWER ON (IMMEDIATELY)
Cause:	A checksum error has occurred when reading-out the program memory on the Sensor Module. Fault value (r0949, interpret hexadecimal): yyyyxxxx hex yyyy: Memory area involved. xxxx: Difference between the checksum at POWER ON and the actual checksum.
Remedy:	- carry out a POWER ON (switch-off/switch-on). - upgrade firmware to later version (>= V2.6 HF3, >= V4.3 SP2, >= V4.4). - check whether the permissible ambient temperature for the component is maintained. - replace the Sensor Module.

233805 <location>Encoder 3: EEPROM checksum error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	Data in the EEPROM corrupted . Fault value (r0949, interpret hexadecimal): 01: EEPROM access error. 02: Too many blocks in the EEPROM.
Remedy:	Replace the module.

233806 <location>Encoder 3: Initialization error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	PULSE INHIBIT

Cause:	The encoder was not successfully initialized. Fault value (r0949, interpret binary): Bit 0, 1: Encoder initialization with the motor rotating has failed (deviation involving coarse and fine position in encoder pulses/4). Bit 2: Mid-voltage matching for track A unsuccessful. Bit 3: Mid-voltage matching for track B unsuccessful. Bit 4: Mid-voltage matching for acceleration input unsuccessful. Bit 5: Mid-voltage matching for track safety A unsuccessful. Bit 6: Mid-voltage matching for track safety B unsuccessful. Bit 7: Mid-voltage matching for track C unsuccessful. Bit 8: Mid-voltage matching for track D unsuccessful. Bit 9: Mid-voltage matching for track R unsuccessful. Bit 10: The difference in mid-voltages between A and B is too great (> 0.5 V) Bit 11: The difference in mid-voltages between C and D is too great (> 0.5 V) Bit 12: The difference in mid-voltages between safety A and safety B is too great (> 0.5 V) Bit 13: The difference in mid-voltages between A and safety B is too great (> 0.5 V) Bit 14: The difference in mid-voltages between B and safety A is too great (> 0.5 V) Bit 15: The standard deviation of the calculated mid-voltages is too great (> 0.3 V) Bit 16: Internal fault - fault when reading a register (CAFE) Bit 17: Internal fault - fault when writing a register (CAFE) Bit 18: Internal fault: No mid-voltage matching available Bit 19: Internal error - ADC access error. Bit 20: Internal error - no zero crossover found. Bit 28: Error while initializing the EnDat 2.2 measuring unit. Bit 29: Error when reading out the data from the EnDat 2.2 measuring unit. Bit 30: EEPROM checksum of the EnDat 2.2 measuring unit incorrect. Bit 31: Data of the EnDat 2.2 measuring unit inconsistent. Note: Bit 0, 1: Up to 6SL3055-0AA00-5*A0 Bits 2 ... 20: 6SL3055-0AA00-5*A1 and higher
Remedy:	Acknowledge fault. If the fault cannot be acknowledged: Bits 2 ... 9: Check encoder power supply. Bits 2 ... 14: Check the corresponding cable. Bit 15 with no other bits: Check track R, check settings in p0404. Bit 28: Check the cable between the EnDat 2.2 converter and the measuring unit. Bit 29 ... 31: Replace the defective measuring unit.

233811 <location>Encoder 3: Encoder serial number changed

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The encoder serial number has changed. The change is only checked for encoders with serial number (e.g. EnDat encoders). - the encoder was replaced. Note: With closed-loop position control, the serial number is accepted when starting the adjustment (p2507 = 2). When the encoder is adjusted (p2507 = 3), the serial number is checked for changes and if required, the adjustment is reset (p2507 = 1). Proceed as follows to hide serial number monitoring: - set the following serial numbers for the corresponding Encoder Data Set: p0441 = FF, p0442 = 0, p0443 = 0, p0444 = 0, p0445 = 0.

Remedy: Mechanically adjust the encoder. Accept the new serial number with p0440 = 1.

233812 <location>Encoder 3: Requested cycle or RX-/TX timing not supported

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: A cycle requested from the Control Unit or RX/TX timing is not supported.

Fault value (r0949, interpret decimal):

0: Application cycle is not supported.

1: DRIVE-CLiQ cycle is not supported.

2: Distance between RX and TX instants in time too low.

3: TX instant in time too early.

Remedy: Carry out a POWER ON (switch-off/switch-on) for all components.

233813 <location>Encoder 3: Hardware logic unit failed

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Fault cause: %1 bin

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)

Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: PULSE INHIBIT

Cause: The logic unit of the DRIVE-CLiQ encoder has failed.

Fault value (r0949, interpret binary):

Bit 0: ALU watchdog has responded.

Bit 1: ALU has detected a sign-of-life error.

Remedy: When the error reoccurs, replace the encoder.

233820 <location>Encoder 3 DRIVE-CLiQ: Telegram error

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Component number: %1, fault cause: %2

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)

Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder concerned.

Fault cause:

1 (= 01 hex):

Checksum error (CRC error).

2 (= 02 hex):

Telegram is shorter than specified in the length byte or in the receive list.

3 (= 03 hex):

Telegram is longer than specified in the length byte or in the receive list.

4 (= 04 hex):

The length of the receive telegram does not match the receive list.

5 (= 05 hex):

The type of the receive telegram does not match the receive list.

6 (= 06 hex):

The address of the component in the telegram and in the receive list do not match.

7 (= 07 hex):

A SYNC telegram is expected - but the received telegram is not a SYNC telegram.

8 (= 08 hex):

No SYNC telegram is expected - but the received telegram is one.

9 (= 09 hex):

The error bit in the receive telegram is set.

16 (= 10 hex):

The receive telegram is too early.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy:

- carry out a POWER ON (switch-off/switch-on).
- check the electrical cabinet design and cable routing for EMC compliance
- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

233835 <location>Encoder 3 DRIVE-CLiQ: Cyclic data transfer error

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Component number: %1, fault cause: %2

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3)

Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder concerned. The nodes do not send and receive in synchronism.

Fault cause:

33 (= 21 hex):

The cyclic telegram has not been received.

34 (= 22 hex):

Timeout in the telegram receive list.

64 (= 40 hex):

Timeout in the telegram send list.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy:

- carry out a POWER ON.
- replace the component involved.

233836	<location>Encoder 3 DRIVE-CLiQ: Send error for DRIVE-CLiQ data
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder involved. Data were not able to be sent. Fault cause: 65 (= 41 hex): Telegram type does not match send list. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON.

233837	<location>Encoder 3 DRIVE-CLiQ: Component fault
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded. Fault cause: 32 (= 20 hex): Error in the telegram header. 35 (= 23 hex): Receive error: The telegram buffer memory contains an error. 66 (= 42 hex): Send error: The telegram buffer memory contains an error. 67 (= 43 hex): Send error: The telegram buffer memory contains an error. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...). - check the electrical cabinet design and cable routing for EMC compliance - if required, use another DRIVE-CLiQ socket (p9904). - replace the component involved.

233845	<location>Encoder 3 DRIVE-CLiQ: Cyclic data transfer error
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY

Cause:	A DRIVE-CLiQ communication error has occurred from the Control Unit to the encoder involved. Fault cause: 11 (= 0B hex): Synchronization error during alternating cyclic data transfer. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON (switch-off/switch-on).

233850 <location>Encoder 3: Encoder evaluation internal software error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	POWER ON
Cause:	An internal software error has occurred in the Sensor Module of encoder 3. Fault value (r0949, interpret decimal): 1: Background time slice is blocked. 2: Checksum over the code memory is not OK. 10000: OEM memory of the EnDat encoder contains data that cannot be interpreted. 11000 ... 11499: Descriptive data from EEPROM incorrect. 11500 ... 11899: Calibration data from EEPROM incorrect. 11900 ... 11999: Configuration data from EEPROM incorrect. 12000 ... 12008: communication with analog/digital converter faulted. 16000: DRIVE-CLiQ encoder initialization application error. 16001: DRIVE-CLiQ encoder initialization ALU error. 16002: DRIVE-CLiQ encoder HISI / SISI initialization error. 16003: DRIVE-CLiQ encoder safety initialization error. 16004: DRIVE-CLiQ encoder internal system error.
Remedy:	- replace the Sensor Module. - if required, upgrade the firmware in the Sensor Module. - contact Technical Support.

233851 <location>Encoder 3 DRIVE-CLiQ (CU): Sign-of-life missing

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 3) involved to the Control Unit. The DRIVE-CLiQ component did not set the sign-of-life to the Control Unit. Fault cause: 10 (= 0A hex): The sign-of-life bit in the receive telegram is not set. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- Upgrade the firmware of the component involved. - carry out a POWER ON (switch-off/switch-on) for the component involved.

233860	<location>Encoder 3 DRIVE-CLiQ (CU): Telegram error
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 3) involved to the Control Unit. Fault cause: 1 (= 01 hex): Checksum error (CRC error). 2 (= 02 hex): Telegram is shorter than specified in the length byte or in the receive list. 3 (= 03 hex): Telegram is longer than specified in the length byte or in the receive list. 4 (= 04 hex): The length of the receive telegram does not match the receive list. 5 (= 05 hex): The type of the receive telegram does not match the receive list. 6 (= 06 hex): The address of the power unit in the telegram and in the receive list do not match. 9 (= 09 hex): The DRIVE-CLiQ communication from the DRIVE-CLiQ component involved to the Control Unit signals that the supply voltage has failed. 16 (= 10 hex): The receive telegram is too early. 17 (= 11 hex): CRC error and the receive telegram is too early. 18 (= 12 hex): The telegram is shorter than that specified in the length byte or in the receive list and the receive telegram is too early. 19 (= 13 hex): The telegram is longer than that specified in the length byte or in the receive list and the receive telegram is too early. 20 (= 14 hex): The length of the receive telegram does not match the receive list and the receive telegram is too early. 21 (= 15 hex): The type of the receive telegram does not match the receive list and the receive telegram is too early. 22 (= 16 hex): The address of the power unit in the telegram and in the receive list does not match and the receive telegram is too early. 25 (= 19 hex): The error bit in the receive telegram is set and the receive telegram is too early. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON (switch-off/switch-on). - check the electrical cabinet design and cable routing for EMC compliance - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).
233875	<location>Encoder 3: power supply voltage failed
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge:	IMMEDIATELY
Cause:	The DRIVE-CLiQ communication from the DRIVE-CLiQ component involved to the Control Unit signals that the supply voltage has failed. Fault cause: 9 (= 09 hex): The power supply voltage for the components has failed. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON (switch-off/switch-on). - check the power supply voltage wiring for the DRIVE-CLiQ component (interrupted cable, contacts, ...). - check the dimensioning of the power supply for the DRIVE-CLiQ component.

233885 <location>Encoder 3 DRIVE-CLiQ (CU): Cyclic data transfer error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 3) involved to the Control Unit. The nodes do not send and receive in synchronism. Fault cause: 26 (= 1A hex): Sign-of-life bit in the receive telegram not set and the receive telegram is too early. 33 (= 21 hex): The cyclic telegram has not been received. 34 (= 22 hex): Timeout in the telegram receive list. 64 (= 40 hex): Timeout in the telegram send list. 98 (= 62 hex): Error at the transition to cyclic operation. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the power supply voltage of the component involved. - carry out a POWER ON (switch-off/switch-on). - replace the component involved.

233886 <location>Encoder 3 DRIVE-CLiQ (CU): Error when sending DRIVE-CLiQ data

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY

Cause:	A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 3) involved to the Control Unit. Data were not able to be sent. Fault cause: 65 (= 41 hex): Telegram type does not match send list. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON.

233887 <location>Encoder 3 DRIVE-CLiQ (CU): Component fault

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	Fault detected on the DRIVE-CLiQ component involved (Sensor Module for encoder 3). Faulty hardware cannot be excluded. Fault cause: 32 (= 20 hex): Error in the telegram header. 35 (= 23 hex): Receive error: The telegram buffer memory contains an error. 66 (= 42 hex): Send error: The telegram buffer memory contains an error. 67 (= 43 hex): Send error: The telegram buffer memory contains an error. 96 (= 60 hex): Response received too late during runtime measurement. 97 (= 61 hex): Time taken to exchange characteristic data too long. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...). - check the electrical cabinet design and cable routing for EMC compliance - if required, use another DRIVE-CLiQ socket (p9904). - replace the component involved.

233895 <location>Encoder 3 DRIVE-CLiQ (CU): Alternating cyclic data transfer error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3) Hla: OFF1 (NONE, OFF2, OFF3)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Sensor Module (encoder 3) involved to the Control Unit. Fault cause: 11 (= 0B hex): Synchronization error during alternating cyclic data transfer. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause

Remedy: Carry out a POWER ON.

233896 <location>Encoder 3 DRIVE-CLiQ (CU): Inconsistent component properties

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: Component number: %1

Reaction: Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2)
Hla: OFF2 (NONE, OFF1, OFF3, STOP2)

Acknowledge: IMMEDIATELY

Cause: The properties of the DRIVE-CLiQ component (Sensor Module for encoder 3), specified by the fault value, have changed in an incompatible fashion with respect to the properties when booted. One cause can be, e.g. that a DRIVE-CLiQ cable or DRIVE-CLiQ component has been replaced.

Fault value (r0949, interpret decimal):

Component number.

Remedy:

- carry out a POWER ON.
- when a component is replaced, the same component type and if possible the same firmware version should be used.
- when a cable is replaced, only cables whose length is the same as or as close as possible to the length of the original cables should be used (ensure compliance with the maximum cable length).

233899 <location>Encoder 3: Unknown fault

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: New message: %1

Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2)
Hla: OFF1 (NONE, OFF2, OFF3, STOP2)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: A fault occurred on the Sensor Module for encoder 3 that cannot be interpreted by the Control Unit firmware.

This can occur if the firmware on this component is more recent than the firmware on the Control Unit.

Fault value (r0949, interpret decimal):

Fault number.

Note:

If required, the significance of this new fault can be read about in a more recent description of the Control Unit.

Remedy:

- replace the firmware on the Sensor Module by an older firmware version (r0148).
- upgrade the firmware on the Control Unit (r0018).

233902 <location>Encoder 3: SPI-BUS error occurred

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: Error when operating the internal SPI bus.
Alarm value (r2124, interpret hexadecimal):
Only for internal Siemens troubleshooting.

Remedy:

- replace the Sensor Module.
- if required, upgrade the firmware in the Sensor Module.
- contact Technical Support.

233903 <location>Encoder 3: I2C-BUS error occurred

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause:	Error when operating the internal I2C bus. Alarm value (r2124, interpret hexadecimal): Only for internal Siemens troubleshooting.
Remedy:	- replace the Sensor Module. - if required, upgrade the firmware in the Sensor Module. - contact Technical Support.

233905 <location>Encoder 3: Encoder parameterization error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Parameter: %1, supplementary information: %2
Reaction:	Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2) Hla: OFF1 (NONE, OFF2, OFF3, STOP2)
Acknowledge:	IMMEDIATELY
Cause:	An error was identified in the encoder parameterization. It is possible that the parameterized encoder type does not match the connected encoder. The parameter involved can be determined as follows: - determine the parameter number using the fault value (r0949). - determine the parameter index (p0187). Fault value (r0949, interpret decimal): yyyyxxx dec: yyyy = supplementary information, xxxx = parameter xxxx = 421: For an EnDat/SSI encoder, the absolute position in the protocol must be less than or equal to 30 bits. yyyy = 0: No additional information available. yyyy = 1: The component does not support HTL level (p0405.1 = 0) combined with track monitoring A/B <> -A/B (p0405.2 = 1). yyyy = 2: A code number for an identified encoder has been entered into p0400, however, no identification was carried out. Please start a new encoder identification. yyyy = 3: A code number for an identified encoder has been entered into p0400, however, no identification was carried out. Please select a listed encoder in p0400 with a code number < 10000. yyyy = 4: This component does not support SSI encoders (p0404.9 = 1) without track A/B. yyyy = 5: For SQW encoder, value in p4686 greater than in p0425. yyyy = 6: DRIVE-CLiQ encoder cannot be used with this firmware version. yyyy = 7: For an SQW encoder, the XIST1 correction (p0437.2) is only permitted for equidistant zero marks. yyyy = 8: The motor pole pair width is not supported by the linear scale being used. yyyy = 9: The length of the position in the EnDat protocol may be a maximum of 32 bits. yyyy = 10: The connected encoder is not supported. yyyy = 11: The hardware does not support track monitoring.

- Remedy:**
- check whether the connected encoder type matches the encoder that has been parameterized.
 - correct the parameter specified by the fault value (r0949) and p0187.
 - re parameter number = 314:
 - check the pole pair number and measuring gear ratio. The quotient of the "pole pair number" divided by the "measuring gear ratio" must be less than or equal to 1000 ((r0313 * p0433) / p0432 <= 1000).

233912 <location>Encoder 3: Device combination is not permissible

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: Servo: OFF1 (IASC/DCBRK, NONE)
Hla: OFF1 (NONE)

Acknowledge: PULSE INHIBIT

Cause: The selected device combination is not supported.

Fault value (r0949, interpret decimal):

1003:

The connected measuring unit cannot be operated with the EnDat 2.2 converter. For instance, the measuring unit has a pulse number/resolution of 2^n .

1005:

The type of measuring unit (incremental) is not supported by the EnDat 2.2 converter.

1006:

The maximum duration of the EnDat transfer (31.25 μ s) was exceeded.

2001:

The set combination of current controller cycle, DP cycle and Safety cycle is not supported by the EnDat 2.2 converter.

2002:

The resolution of the linear measuring unit does not match the pole pair width of the linear motor

Pole pair width, minimum = $p0422 * 2^{20}$

Remedy: For fault value = 1003, 1005, 1006:

- Use a measuring unit that is permissible.

For fault value = 2001:

- set a permissible cycle combination (if required, use standard settings).

For fault value = 2002:

- Use a measuring unit with a lower resolution (p0422).

233915 <location>Encoder 3: Encoder configuration error

Drive object: HLA_828, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The configuration for encoder 3 is incorrect.

Alarm value (r2124, interpret decimal):

1:

Re-parameterization between fault/alarm is not permissible.

2:

The cyclic DQ receive telegram is too long and is limited.

3:

The cyclic DQ send telegram is too long and is limited.

419:

When the fine resolution Gx_XIST2 is configured, the encoder identifies a maximum possible absolute position actual value (r0483) that can no longer be represented within 32 bits.

Remedy: For alarm value = 1:
No re-parameterization between fault/alarm.
For alarm value = 419:
Reduce the fine resolution (p0419) or deactivate the monitoring (p0437.25), if the complete multiturn range is not required.

233916 <location>Encoder 3: Encoder parameterization error

Drive object: HLA_828, SERVO_828, SERVO_COMBI
Message value: Parameter: %1, supplementary information: %2
Reaction: Servo: OFF1 (IASC/DCBRK, NONE, OFF2, OFF3, STOP2)
 Hla: OFF1 (NONE, OFF2, OFF3, STOP2)
Acknowledge: IMMEDIATELY
Cause: An encoder parameter was detected as being incorrect.
 It is possible that the parameterized encoder type does not match the connected encoder.
 The parameter involved can be determined as follows:
 - determine the parameter number using the fault value (r0949).
 - determine the parameter index (p0187).
 Fault value (r0949, interpret decimal):
 Parameter number.
Remedy: - check whether the connected encoder type matches the encoder that has been parameterized.
 - correct the parameter specified by the fault value (r0949) and p0187.

233920 <location>Encoder 3: Temperature sensor fault (motor)

Drive object: HLA_828, SERVO_828, SERVO_COMBI
Message value: Fault cause: %1, channel number: %2
Reaction: NONE
Acknowledge: NONE
Cause: The motor detected a fault when evaluating the temperature sensor.
 Fault cause:
 1 (= 01 hex):
 Wire breakage or sensor not connected.
 KTY: R > 1630 Ohm, PT1000: R > 1720 Ohm
 2 (= 02 hex):
 Measured resistance too low.
 PTC: R < 20 Ohm, KTY: R < 50 Ohm, PT1000: R < 603 Ohm
 Additional values:
 Only for internal Siemens troubleshooting.
 Note regarding the message value:
 The individual information is coded as follows in the message value (r0949/r2124):
 0000yyxx hex: yy = channel number, xx = error cause
Remedy: - check that the encoder cable is the correct type and is correctly connected.
 - check the temperature sensor selection in p0600 to p0603.
 - replace the Sensor Module (hardware defect or incorrect calibration data).

233930 <location>Encoder 3: Data logger has saved data

Drive object: HLA_828, SERVO_828, SERVO_COMBI
Message value: -
Reaction: NONE
Acknowledge: NONE

Cause:	For the activated function "Data logger" (p0437.0 = 1) a fault has occurred with the Sensor Module. This alarm indicates that the diagnostics data corresponding to the fault was saved on the memory card. The diagnostics data is saved in the following folder: /USER/SINAMICS/DATA/SMTRC00.BIN ... /USER/SINAMICS/DATA/SMTRC07.BIN /USER/SINAMICS/DATA/SMTRCIDX.TXT The following information is contained in the TXT file: - Display of the last written BIN file. - Number of write operations that are still possible (from 10000 downwards). Note: Only Siemens can evaluate the BIN files.
Remedy:	Not necessary. This alarm is automatically withdrawn. The data logger is ready to record the next fault case.

233940 <location>Encoder 3: Spindle sensor S1 voltage incorrect

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The voltage of analog sensor S1 is outside the permissible range. Alarm value (r2124, interpret decimal): Signal level from sensor S1. Note: A signal level of 500 mV corresponds to the numerical value 500 dec.
Remedy:	- check the clamped tool. - check the tolerance and if required, adapt (p5040). - check the thresholds and if required, adapt (p5041). - check analog sensor S1 and connections. See also: p5040 (Spindle voltage threshold values tolerance), p5041 (Spindle voltage threshold values)

233950 <location>Encoder 3: Internal software error

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF1 (OFF2)
Acknowledge:	POWER ON
Cause:	An internal software error has occurred. Fault value (r0949, interpret decimal): Information about the fault source. Only for internal Siemens troubleshooting.
Remedy:	- if necessary, upgrade the firmware in the Sensor Module to a later version. - contact Technical Support.

233999 <location>Encoder 3: Unknown alarm

Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	New message: %1
Reaction:	NONE
Acknowledge:	NONE

Cause:	A alarm has occurred on the Sensor Module for encoder 3 that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit. Alarm value (r2124, interpret decimal): Alarm number. Note: If required, the significance of this new alarm can be read about in a more recent description of the Control Unit.
Remedy:	- replace the firmware on the Sensor Module by an older firmware version (r0148). - upgrade the firmware on the Control Unit (r0018).

234207	<location>VSM: Temperature fault threshold exceeded
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value:	%1
Reaction:	OFF2 (NONE, OFF1)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The temperature (r3666) measured using the Voltage Sensing Module (VSM) has exceeded the threshold value (p3668). Note: This fault can only be output if the temperature evaluation was activated (p3665 > 0). Fault value (r0949, interpret decimal): Temperature actual value at the time of initiation [0.1 °C]. See also: r3666 (VSM temperature actual value), p3668
Remedy:	- check the fan. - reduce the power. - check the temperature sensor type setting (p3665). - infeed: check the line filter type setting (p0220). See also: p3665 (VSM temperature evaluation sensor type)

234211	<location>VSM: Temperature alarm threshold exceeded
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The temperature (r3666) measured using the Voltage Sensing Module (VSM) has exceeded the threshold value (p3667). Alarm value (r2124, interpret decimal): Temperature actual value at the time of initiation [0.1 °C]. See also: r3666 (VSM temperature actual value), p3667
Remedy:	- check the fan. - reduce the power. - check the temperature sensor type setting (p3665). - infeed: check the line filter type setting (p0220). See also: p3665 (VSM temperature evaluation sensor type)

234800	<location>VSM: Group signal
Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value:	-
Reaction:	Infeed: OFF2 (NONE, OFF1)
Acknowledge:	NONE
Cause:	The Voltage Sensing Module (VSM) has detected at least one fault.
Remedy:	Evaluates other actual messages.

234801 <location>VSM DRIVE-CLiQ: Sign-of-life missing

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value: Component number: %1, fault cause: %2
Reaction: OFF2 (NONE, OFF1)
Acknowledge: IMMEDIATELY
Cause: A DRIVE-CLiQ communications error has occurred from the Control Unit to the Voltage Sensing Module (VSM).
Fault cause:
10 (= 0A hex):
The sign-of-life bit in the receive telegram is not set.
Note regarding the message value:
The individual information is coded as follows in the message value (r0949/r2124):
0000yyxx hex: yy = component number, xx = error cause
Remedy:
- check the DRIVE-CLiQ connection.
- replace the Voltage Sensing Module (VSM).

234802 <location>VSM: Time slice overflow

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value: -
Reaction: Infeed: OFF2 (NONE, OFF1)
Acknowledge: IMMEDIATELY
Cause: A time slice overflow has occurred on the Voltage Sensing Module.
Remedy: Replace the Voltage Sensing Module.

234803 <location>VSM: Memory test

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value: -
Reaction: Infeed: OFF2 (NONE, OFF1)
Acknowledge: IMMEDIATELY
Cause: An error has occurred during the memory test on the Voltage Sensing Module.
Remedy:
- check whether the permissible ambient temperature for the Voltage Sensing Module is being maintained.
- replace the Voltage Sensing Module.

234804 <location>VSM: CRC

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value: %1
Reaction: Infeed: OFF2 (NONE, OFF1)
Acknowledge: IMMEDIATELY
Cause: A checksum error has occurred when reading-out the program memory on the Voltage Sensing Module (VSM).
Remedy:
- check whether the permissible ambient temperature for the component is maintained.
- replace the Voltage Sensing Module.

234805 <location>VSM: EEPROM checksum error

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value: %1
Reaction: Infeed: OFF2 (NONE, OFF1)
Acknowledge: IMMEDIATELY

Cause: Internal parameter data is corrupted.
Fault value (r0949, interpret hexadecimal):
01: EEPROM access error.
02: Too many blocks in the EEPROM.

Remedy: - check whether the permissible ambient temperature for the component is maintained.
- replace the Voltage Sensing Module (VSM).

234806 <location>VSM: Initialization

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: -

Reaction: Infeed: OFF2 (NONE, OFF1)

Acknowledge: IMMEDIATELY

Cause: For the Voltage Sensing Module (VSM), a fault has occurred while initializing.

Remedy: Replace the Voltage Sensing Module.

234807 <location>VSM: Sequence control time monitoring

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: Error, timeout in the sequence control on the Voltage Sensing Module (VSM).

Remedy: Replace the Voltage Sensing Module.

234820 <location>VSM DRIVE-CLiQ: Telegram error

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: Component number: %1, fault cause: %2

Reaction: Infeed: OFF2 (NONE, OFF1)

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communications error has occurred from the Control Unit to the Voltage Sensing Module involved.

Fault cause:

1 (= 01 hex):

Checksum error (CRC error).

2 (= 02 hex):

Telegram is shorter than specified in the length byte or in the receive list.

3 (= 03 hex):

Telegram is longer than specified in the length byte or in the receive list.

4 (= 04 hex):

The length of the receive telegram does not match the receive list.

5 (= 05 hex):

The type of the receive telegram does not match the receive list.

6 (= 06 hex):

The address of the component in the telegram and in the receive list do not match.

7 (= 07 hex):

A SYNC telegram is expected - but the received telegram is not a SYNC telegram.

8 (= 08 hex):

No SYNC telegram is expected - but the received telegram is one.

9 (= 09 hex):

The error bit in the receive telegram is set.

16 (= 10 hex):

The receive telegram is too early.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy:

- carry out a POWER ON (switch-off/switch-on).

- check the electrical cabinet design and cable routing for EMC compliance

- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

234835 <location>VSM DRIVE-CLiQ: Cyclic data transfer error

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: Component number: %1, fault cause: %2

Reaction: Infeed: OFF2 (NONE, OFF1)

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communications error has occurred from the Control Unit to the Voltage Sensing Module involved. The nodes do not send and receive in synchronism.

Fault cause:

33 (= 21 hex):

The cyclic telegram has not been received.

34 (= 22 hex):

Timeout in the telegram receive list.

64 (= 40 hex):

Timeout in the telegram send list.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy:

- carry out a POWER ON.

- replace the component involved.

234836 <location>VSM DRIVE-CLiQ: Send error for DRIVE-CLiQ data

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value:	Component number: %1, fault cause: %2
Reaction:	Infeed: OFF2 (NONE, OFF1)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communications error has occurred from the Control Unit to the Voltage Sensing Module. Data were not able to be sent. Fault cause: 65 (= 41 hex): Telegram type does not match send list. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON.

234837 <location>VSM DRIVE-CLiQ: Component fault

Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Infeed: OFF2 (NONE, OFF1)
Acknowledge:	IMMEDIATELY
Cause:	Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded. Fault cause: 32 (= 20 hex): Error in the telegram header. 35 (= 23 hex): Receive error: The telegram buffer memory contains an error. 66 (= 42 hex): Send error: The telegram buffer memory contains an error. 67 (= 43 hex): Send error: The telegram buffer memory contains an error. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...). - check the electrical cabinet design and cable routing for EMC compliance - if required, use another DRIVE-CLiQ socket (p9904). - replace the component involved.

234845 <location>VSM DRIVE-CLiQ: Cyclic data transfer error

Drive object:	A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	Infeed: OFF2 (NONE, OFF1)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communications error has occurred from the Control Unit to the Voltage Sensing Module (VSM). Fault cause: 11 (= 0B hex): Synchronization error during alternating cyclic data transfer. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON.

234850 <location>VSM: Internal software error

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value: %1
Reaction: Infeed: OFF1 (NONE, OFF2)
Acknowledge: POWER ON
Cause: An internal software error in the Voltage Sensing Module (VSM) has occurred.
Fault value (r0949, interpret decimal):
1: Background time slice is blocked.
2: Checksum over the code memory is not OK.
Remedy: - replace the Voltage Sensing Module (VSM).
- if required, upgrade the firmware in the Voltage Sensing Module.
- contact Technical Support.

234851 <location>VSM DRIVE-CLiQ (CU): Sign-of-life missing

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value: Component number: %1, fault cause: %2
Reaction: Infeed: OFF2 (NONE, OFF1)
Servo: NONE (OFF1, OFF2)
Hla: NONE (OFF1, OFF2)
Acknowledge: IMMEDIATELY
Cause: A DRIVE-CLiQ communications error has occurred from the Voltage Sensing Module involved (VSM) to the Control Unit.
The DRIVE-CLiQ component did not set the sign-of-life to the Control Unit.
Fault cause:
10 (= 0A hex):
The sign-of-life bit in the receive telegram is not set.
Note regarding the message value:
The individual information is coded as follows in the message value (r0949/r2124):
0000yyxx hex: yy = component number, xx = error cause
Remedy: Upgrade the firmware of the component involved.

234860 <location>VSM DRIVE-CLiQ (CU): Telegram error

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value: Component number: %1, fault cause: %2
Reaction: Infeed: OFF2 (NONE, OFF1)
Servo: NONE (OFF1, OFF2)
Hla: NONE (OFF1, OFF2)
Acknowledge: IMMEDIATELY

Cause:	A DRIVE-CLiQ communications error has occurred from the Voltage Sensing Module involved (VSM) to the Control Unit. Fault cause: 1 (= 01 hex): Checksum error (CRC error). 2 (= 02 hex): Telegram is shorter than specified in the length byte or in the receive list. 3 (= 03 hex): Telegram is longer than specified in the length byte or in the receive list. 4 (= 04 hex): The length of the receive telegram does not match the receive list. 5 (= 05 hex): The type of the receive telegram does not match the receive list. 6 (= 06 hex): The address of the power unit in the telegram and in the receive list do not match. 9 (= 09 hex): The DRIVE-CLiQ communication from the DRIVE-CLiQ component involved to the Control Unit signals that the supply voltage has failed. 16 (= 10 hex): The receive telegram is too early. 17 (= 11 hex): CRC error and the receive telegram is too early. 18 (= 12 hex): The telegram is shorter than that specified in the length byte or in the receive list and the receive telegram is too early. 19 (= 13 hex): The telegram is longer than that specified in the length byte or in the receive list and the receive telegram is too early. 20 (= 14 hex): The length of the receive telegram does not match the receive list and the receive telegram is too early. 21 (= 15 hex): The type of the receive telegram does not match the receive list and the receive telegram is too early. 22 (= 16 hex): The address of the power unit in the telegram and in the receive list does not match and the receive telegram is too early. 25 (= 19 hex): The error bit in the receive telegram is set and the receive telegram is too early. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON (switch-off/switch-on). - check the electrical cabinet design and cable routing for EMC compliance - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

234875	<location>VSM: power supply voltage failed
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF2
Acknowledge:	IMMEDIATELY

Cause:	The DRIVE-CLiQ communication from the DRIVE-CLiQ component involved to the Control Unit signals that the supply voltage has failed. Fault cause: 9 (= 09 hex): The power supply voltage for the components has failed. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON (switch-off/switch-on). - check the power supply voltage wiring for the DRIVE-CLiQ component (interrupted cable, contacts, ...). - check the dimensioning of the power supply for the DRIVE-CLiQ component.

234885 <location>VSM DRIVE-CLiQ (CU): Cyclic data transfer error

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	Component number: %1, fault cause: %2
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: NONE (OFF1, OFF2) Hla: NONE (OFF1, OFF2)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communications error has occurred from the Voltage Sensing Module involved (VSM) to the Control Unit. The nodes do not send and receive in synchronism. Fault cause: 26 (= 1A hex): Sign-of-life bit in the receive telegram not set and the receive telegram is too early. 33 (= 21 hex): The cyclic telegram has not been received. 34 (= 22 hex): Timeout in the telegram receive list. 64 (= 40 hex): Timeout in the telegram send list. 98 (= 62 hex): Error at the transition to cyclic operation. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the power supply voltage of the component involved. - carry out a POWER ON. - replace the component involved.

234886 <location>VSM DRIVE-CLiQ (CU): Error when sending DRIVE-CLiQ data

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	Component number: %1, fault cause: %2
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: NONE (OFF1, OFF2) Hla: NONE (OFF1, OFF2)
Acknowledge:	IMMEDIATELY

Cause:	A DRIVE-CLiQ communications error has occurred from the Voltage Sensing Module involved (VSM) to the Control Unit. Data were not able to be sent. Fault cause: 65 (= 41 hex): Telegram type does not match send list. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON.

234887	<location>VSM DRIVE-CLiQ (CU): Component fault
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	Component number: %1, fault cause: %2
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: NONE (OFF1, OFF2) Hla: NONE (OFF1, OFF2)
Acknowledge:	IMMEDIATELY
Cause:	Fault detected on the DRIVE-CLiQ component (Voltage Sensing Module) involved. Faulty hardware cannot be excluded. Fault cause: 32 (= 20 hex): Error in the telegram header. 35 (= 23 hex): Receive error: The telegram buffer memory contains an error. 66 (= 42 hex): Send error: The telegram buffer memory contains an error. 67 (= 43 hex): Send error: The telegram buffer memory contains an error. 96 (= 60 hex): Response received too late during runtime measurement. 97 (= 61 hex): Time taken to exchange characteristic data too long. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...). - check the electrical cabinet design and cable routing for EMC compliance - if required, use another DRIVE-CLiQ socket (p9904). - replace the component involved.

234895	<location>VSM DRIVE-CLiQ (CU): Alternating cyclic data transfer error
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	Component number: %1, fault cause: %2
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: NONE (OFF1, OFF2) Hla: NONE (OFF1, OFF2)
Acknowledge:	IMMEDIATELY

Cause: A DRIVE-CLiQ communications error has occurred from the Voltage Sensing Module involved (VSM) to the Control Unit.
Fault cause:
11 (= 0B hex):
Synchronization error during alternating cyclic data transfer.
Note regarding the message value:
The individual information is coded as follows in the message value (r0949/r2124):
0000yyxx hex: yy = component number, xx = error cause

Remedy: Carry out a POWER ON.

234896 <location>VSM DRIVE-CLiQ (CU): Inconsistent component properties

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150

Message value: Component number: %1

Reaction: Infeed: OFF2 (NONE, OFF1)
Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2)
Hla: OFF2 (NONE, OFF1, OFF3, STOP2)

Acknowledge: IMMEDIATELY

Cause: The properties of the DRIVE-CLiQ component (Voltage Sensing Module), specified by the fault value, have changed in an incompatible fashion with respect to the properties when booted. One cause can be, e.g. that a DRIVE-CLiQ cable or DRIVE-CLiQ component has been replaced.
Fault value (r0949, interpret decimal):
Component number.

Remedy: - carry out a POWER ON.
- when a component is replaced, the same component type and if possible the same firmware version should be used.
- when a cable is replaced, only cables whose length is the same as or as close as possible to the length of the original cables should be used (ensure compliance with the maximum cable length).

234899 <location>VSM: Unknown fault

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: New message: %1

Reaction: Infeed: NONE (OFF1, OFF2)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: A fault occurred on the Voltage Sensing Module that cannot be interpreted by the Control Unit firmware.
This can occur if the firmware on this component is more recent than the firmware on the Control Unit.
Fault value (r0949, interpret decimal):
Fault number.
Note:
If required, the significance of this new fault can be read about in a more recent description of the Control Unit.

Remedy: - replace the firmware on the Voltage Sensing Module by an older firmware version (r0158).
- upgrade the firmware on the Control Unit (r0018).

234903 <location>VSM: I2C bus error occurred

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: An error has occurred when accessing the module-internal I2C bus.

Remedy: Replace the Voltage Sensing Module (VSM).

234904 <location>VSM: EEPROM

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI

Message value: -
Reaction: NONE
Acknowledge: NONE
Cause: An error has occurred accessing the non-volatile memory on the Terminal Module.
Remedy: Replace the Voltage Sensing Module (VSM).

234905 <location>VSM: Parameter access

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value: -
Reaction: NONE
Acknowledge: NONE
Cause: The Control Unit attempted to write an illegal parameter value to the Voltage Sensing Module (VSM).
Remedy: - check whether the firmware version of the VSM (r0158) matches the firmware version of Control Unit (r0018).
 - if required, replace the Voltage Sensing Module.
Note:
 The firmware versions that match each other are in the readme.txt file on the memory card.

234920 <location>VSM: overtemperature or temperature sensor fault

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value: %1
Reaction: NONE (OFF1, OFF2)
Acknowledge: IMMEDIATELY (POWER ON)
Cause: When evaluating the temperature sensor, a resistance value outside the permissible range was detected.
 Fault value (r0949, interpret decimal):
 1: overtemperature, wire breakage or sensor not connected.
 KTY: R > 1630 Ohm, PT1000: R > 1720 Ohm
 2: Measured resistance too low.
 PTC: R < 20 Ohm, KTY: R < 50 Ohm, PT1000: R < 723 Ohm
Remedy: - make sure that the sensor is connected correctly.
 - replace the sensor.
 - allow to cool down and then check the ambient conditions, load cycle and cooling (fan fuse).
 - check the temperature sensor type setting (p3665).
 - infeed: check the line filter type setting (p0220).

234950 <location>VSM: Internal software error

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value: %1
Reaction: OFF2
Acknowledge: POWER ON
Cause: An internal software error in the Voltage Sensing Module (VSM) has occurred.
 Fault value (r0949, interpret decimal):
 Information about the fault source.
 Only for internal Siemens troubleshooting.
Remedy: - if necessary, upgrade the firmware in the Voltage Sensing Module to a later version.
 - contact Technical Support.

234999 <location>VSM: Unknown alarm

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI
Message value: New message: %1

Reaction:	NONE
Acknowledge:	NONE
Cause:	A fault occurred on the Voltage Sensing Module (VSM) an alarm has occurred that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit. Alarm value (r2124, interpret decimal): Alarm number. Note: If required, the significance of this new alarm can be read about in a more recent description of the Control Unit.
Remedy:	- replace the firmware on the Voltage Sensing Module by an older firmware version (r0148). - upgrade the firmware on the Control Unit (r0018).

235000 <location>TM54F: Sampling time invalid

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	POWER ON
Cause:	The set sampling time is invalid. - not a multiple integer of the DP clock cycle. Fault value (r0949, floating point): Recommended valid sampling time.
Remedy:	Adapt the sampling time (e.g. set the recommended valid sampling time). See also: p10000 (SI TM54F communication clock cycle)

235001 <location>TM54F: Parameter value invalid

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	The functionality of Safety Basic Functions via TM54F is used. TM54F has been incorrectly parameterized (incorrect parameter assignment). Only the following signals may be parameterized: - STO active - SS1 active - internal event - safe state Possible causes: - p10024 ... p10038 not set to 0 or 255. - p10039, p10042 ... p10045 use signals from Safety Extended Functions. Fault value (r0949, interpret binary): Bits 0 ... 3 specifies for which drive group an illegal F-DI was parameterized: - Bit 0 = 1: drive group 1 error - Bit 1 = 1: drive group 2 error - Bit 2 = 1: drive group 3 error - Bit 3 = 1: drive group 4 error Bits 4 ... 7 specifies for which F-DOs incorrect links were specified: - Bit 4 = 1: F-DO 0 error (p10042) - Bit 5 = 1: F-DO 1 error (p10043) - Bit 6 = 1: F-DO 2 error (p10044) - Bit 7 = 1: F-DO 3 error (p10045)

Remedy:

- check the setting of the failsafe digital inputs (F-DI) for the Safety Extended Functions - and set to a value of 0 or 255 (p10024 ... p10039).
- check the setting of the signal sources for the failsafe digital outputs (F-DO) and if necessary, correct (p10042 ... p10045).

Note:

F-DI: Failsafe Digital Input
F-DO: Failsafe Digital Output

235002 <location>TM54F: Commissioning not possible

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: The commissioning mode activation was rejected because at least one drive belonging to the TM54F is enabled for operation.
Fault value (r0949, interpret decimal):
Drive object number of the first drive found without pulse suppression/power inhibit.

Remedy: Withdraw the operating enable for the drive specified in the fault value.

235003 <location>TM54F: Acknowledgment on the Control Unit is required

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: A fault on the Terminal Module 54F (TM54) was acknowledged using the safe acknowledgment (p10006).
An additional acknowledgment is also required at the Control Unit.

Remedy: - acknowledge all faults on the Control Unit (BI: p2102).
or
- acknowledge all faults on the drive object TM54F (BI: p2103, p2104 or p2105).

Note:
A fault acknowledgment is triggered with a 0/1 signal.

235004 <location>TM54F: communication cycle invalid

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL

Message value: Fault cause: %1 bin

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause:	- the communication cycle specified in p10000[x] does not correspond with the monitoring cycle of the drive object, which was specified in p10010[x]. As long as this fault is present, Failsafe Values are activated in TM54F. All the drives are not enabled. Fault value (r0949, interpret binary): If a bit is set in the range bit 0 ... 5, then the following applies: The communication cycle specified in p10000[x] does not correspond with the monitoring cycle of the drive object which was specified in p10010[x]. (if only p10000[0] used, then this value must be identical with all monitoring cycles of the drive objects used in p10010[0...5].) Bit 0 = 1: p10000[0] does not correspond with the monitoring cycle of p10010[0] Bit 1 = 1: p10000[1] does not correspond with the monitoring cycle of p10010[1] .. Bit 5 = 1: p10000[5] does not correspond with the monitoring cycle of p10010[5] If a bit is set in the range bit 16 ... 21, then the following applies: Bit 16 = 1: p10000[0] has been selected too low. Bit 17 = 1: p10000[1] has been selected too low. .. Bit 21 = 1: p10000[5] has been selected too low. When using an axis with Basic Safety Functions with TM54F, then the monitoring cycle should be greater than $500\mu s + 8 \cdot$ current controller clock cycles of the drive. Note: This error is also signaled if a drive controlled with TM54F is parameterized so that the basic functions are controlled via TM54F - and simultaneously the extended safety functions or ncSI have been parameterized. The following applies for fault value = 0: - since the firmware update of the TM54F it has not been switched off. - the firmware of the connected TM54F is too old. See also: p10010 (SI TM54F drive object assignment)
Remedy:	For a fault value in the range from bit 0 ... 5: - first check that all drives, which are entered in p10010, have either Extended Safety Functions or Basic Functions via TM54F. - Execute the copy function for TM54F(p9700 = 87). - adapt the checksums for TM54F(p9701 = 172). - copy RAM to ROM. - carry out a POWER ON. For a fault value in the range from bit 16 ... 21: Increase the current controller sampling time of the corresponding drive, in order to avoid faults in operation. - Execute the copy function for TM54F(p9700 = 87). - adapt the checksums for TM54F(p9701 = 172). - copy RAM to ROM. - carry out a POWER ON.

235005	<location>TM54F:parallel connection not supported
Drive object:	HLA_828, SERVO_828, SERVO_COMBI
Message value:	Fault cause: %1 bin
Reaction:	NONE
Acknowledge:	POWER ON
Cause:	The TM54F function with Basic Safety Functions is used. This function is not supported when power units are connected in parallel. All drives of the TM54F assume Failsafe Values, and are not enabled. See also: p10010 (SI TM54F drive object assignment)
Remedy:	- deactivate parallel connection or TM54F with Basic Safety Functions. - copy RAM to ROM. - carry out a POWER ON (switch-off/switch-on).

235006	<location>TM54F: drive groups invalid
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	POWER ON
Cause:	The functionality of the basic functions via TM54F is used. Drive groups have been incorrectly parameterized (incorrect parameter assignment). Fault value (r0949, interpret binary): The value specifies in which drive group Basic Safety drives are mixed with Extended Safety drives. Bit 0 = 1: drive group 1 error Bit 1 = 1: drive group 2 error Bit 2 = 1: drive group 3 error Bit 3 = 1: drive group 4 error As long as this fault is present, Failsafe Values are activated in TM54F. All the drives are not enabled. Note: -this error is also signaled if a drive controlled with TM54F is parameterized so that the basic functions are controlled via TM54F and simultaneously extended safety functions or ncSI have been parameterized.
Remedy:	Corresponding to the fault value, p10011 should be checked to ensure that no Basic Safety drives are mixed with Extended Safety drives in a drive group.
235009	<location>TM54F: Safety commissioning drive incomplete
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	For Terminal Module 54F (TM54F), a drive object was assigned (p10010), for which no safety functions or faulty safety functions are parameterized (p9501, p9601). Fault value (r0949, interpret bitwise binary): Bit 0 = 1: drive 1 error Bit 1 = 1: drive 2 error Bit 2 = 1: drive 3 error Bit 3 = 1: drive 4 error Bit 4 = 1: drive 5 error Bit 5 = 1: drive 6 error
Remedy:	- carry out the safety commissioning of the drive involved and enable the safety functions for TM54F. - commission the TM54F – and just set p9700 = 87d and p9701 = 172d.
235011	<location>TM54F: Drive object number assignment illegal
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	A drive object number was assigned twice. Each drive object number can be assigned only once.
Remedy:	Correct the assignment of the drive object numbers. See also: p10010 (SI TM54F drive object assignment)
235012	<location>TM54F: Test stop for failsafe digital inputs/outputs
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL
Message value:	-
Reaction:	NONE

Acknowledge: NONE

Cause: The forced checking procedure (test stop) for the failsafe digital inputs/outputs (F-DI/F-DO) is currently in progress.

Remedy: The alarm is automatically withdraw after successfully ending or canceling (when a fault condition occurs) the test stop.

Note:

F-DI: Failsafe Digital Input

F-DO: Failsafe Digital Output

235013 <location>TM54F: Test stop error

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: A fault has been detected during the forced checking procedure (test stop) of the failsafe digital inputs/outputs on the TM54F. Failsafe control signals (Failsafe Values) are transferred to the safety functions.

Fault value (r0949, interpret hexadecimal):

aaaabbcc hex:

aaaa: DO or F-DI (dependent on test step cc), where the expected state was not assumed (bit 0 = F-DI 0 or F-DO 0, bit 1 = F-DI 1 or F-DO 1, etc.).

bb: Fault cause

bb = 01 hex: Internal fault.

bb = 02 hex: Fault when comparing the switching signals of the two channels (F-DI or DI).

bb = 03 hex: Internal fault.

bb = 04 hex: Fault when comparing the switching signals of the two channels (Diag-DO).

cc: State of the test stop in which the fault has occurred.

The display format is as follows:

Slave fault state: (test actions)(test actions) | corresponding step for the master: (test actions)(test actions) | Description

00 hex: (L1+OFF)(L2+ON) | 0A hex: () () | Synchronization / switching step

0A hex: (L1+OFF)(L2+ON) | 15 hex: () () | Wait step

15 hex: (L1+OFF)(L2+OFF) | 20 hex: () () | 1.) F-DI 0 ... 4 check for 0 V 2.) Switch step to new level

20 hex: (L1+OFF)(L2+OFF) | 2B hex: () () | Wait step

2B hex: (L1+ON)(L2+ON) | 36 hex: () () | 1.) F-DI 5 ... 9 check for 0 V 2.) Switch step to new level

36 hex: (DO OFF)() | 41 hex: (DO OFF)() | Wait step / switching step

41 hex: (DO OFF)() | 4C hex: (DO OFF)() | Wait step

4C hex: (DO ON)() | 57 hex: (DO ON)() | 1.) Check diag-DO or diag-DI 2.) Switch step to new level

57 hex: (DO ON)() | 62 hex: (DO ON)() | Wait step

62 hex: (DO OFF)() | 6D hex: (DO ON)() | 1.) Check diag-DO or diag-DI 2.) Switch step

6D hex: (DO OFF)() | 78 hex: (DO ON)() | Wait step

78 hex: (DO ON)() | 83 hex: (DO OFF)() | 1.) Check diag-DO or diag-DI 2.) Switch step

83 hex: (DO ON)() | 8E hex: (DO OFF)() | Wait step

8E hex: (DO OFF)() | 99 hex: (DO OFF)() | 1.) Check diag-DO or diag-DI 2.) Switch step

99 hex: (DO OFF)() | A4 hex: (DO OFF)() | Wait step

A4 hex: (DO OFF)() | AF hex: (DO OFF)() | Check Diag-DO or Diag-DI

AF hex: (DO original state)() | C5 hex: (DO original state)() | Switching step

C5 hex: End of test

The expected states to be checked depend on the parameterized test mode (p10047).

The following expected states are tested in the test steps when testing the F-DOs:

The display format is as follows:

Test step (SL MA): Expected Diag-DO mode 1 | Expected DI 20 ... 23 mode 2 | Expected DI 20 ... 23 mode 3

(4C hex 57 hex): Diag-DO = 0 V | DI = 24 V | DI = 24 V

(62 hex 6D hex): Diag-DO = 0 V | DI = 0 V | DI = 0 V

(78 hex 83 hex): Diag-DO = 0 V | DI = 0 V | DI = 24 V

(8E hex 99 hex): Diag-DO = 24 V | DI = 0 V | DI = 24 V

(A4 hex AF hex): Diag-DO = 0 V | DI = 24 V | DI = 24 V

Example:

If an error with fault causes bb = 02 hex or 04 hex occurs in a test stop step, the test action for the fault took place in the previous test stop step. The expected states are tested in the next step.

Master signals fault value 0001_04AF and slave signals fault value 0001_04A4.

aaaa = 1 --> F-DO 0 is involved.

bb = 04 hex --> the test of the Diag-DO was unsuccessful.

cc = The expected states were tested in test stop step AF on the master and A4 on the slave.

The expected state Diag-DO = 0 V was checked in the table, i.e. Diag-DO was at 0 V instead of the expected 24 V. The associated test action took place in the previous step (99 hex DO OFF, A4 hex DO OFF). Both DOs were switched to OFF.

Remedy: Check the wiring of the F-DIs and F-DOs and restart the test stop.

Note:

The fault is withdrawn if the test stop is successfully completed.

For fault value = CCCCCCCC hex, DDDDDDDD hex, EEEEEEEE hex the following applies:

These fault values occur together with fault F35152.

Possible countermeasure:

- check all parameters for the test stop.

- you should also check whether the firmware version of the TM54F matches that of the Control Unit.

- check p10001, p10017, p10046 and p10047.

A POWER ON must be carried out after correcting the parameters.

F-DI: Failsafe Digital Input

F-DO: Failsafe Digital Output

235014 <location>TM54F: Test stop for failsafe digital inputs/outputs

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The time set in p10003 for the forced checking procedure (test stop) for the digital inputs/outputs has been exceeded. A new forced checking procedure is required.

After the next time the forced checking procedure is selected, the message is withdrawn and the monitoring time is reset.

Note:

- this message does not result in a safety stop response.

- the test must be performed within a defined, maximum time interval (p10003, maximum of 8760 hours) in order to comply with the requirements as laid down in the standards for timely fault detection and the conditions to calculate the failure rates of safety functions (PFH value). Operation beyond this maximum time period is permissible if it can be ensured that the forced checking procedure is performed before persons enter the hazardous area and who are depending on the safety functions correctly functioning.

See also: p10003

Remedy: Carry out the forced checking procedure for the digital inputs/outputs.

The signal source to select the forced checking procedure is set via binector input p10007.

See also: p10007

235015 <location>TM54F: Motor/Hydraulic Module replaced or configuration inconsistent

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL

Message value: Fault cause: %1 bin

Reaction: NONE

Acknowledge: NONE

Cause:	Cyclic communication of at least one drive with the Terminal Module 54F (TM54F) is not active. Possible causes: - at least one Motor Module/Hydraulic Module was replaced (e.g. hardware was replaced). - the parameterization of the TM54F (p10010) is inconsistent with the number of drives, which have drive-based motion monitoring functions activated with TM54F. - for the signaled drive, it is not permissible that the "Safe motion monitoring without selection" (p9601.5 = 1) is parameterized. - And activated drive has no communication via DRIVE-CLiQ. - p10010 of the TM54F master module is not the same as p10010 of the TM54F slave module (in this case, F35051 is also output). - in p10010 of the TM54F master or slave module, the number of a drive object was entered several times. - the control of the Basis Functions via TM54F was parameterized, and simultaneously the Extended Safety Functions or ncSI were parameterized. Alarm value (r2124, interpret binary): yyyy yyyy xxxx xxxx bin xxxx xxxx bin: inconsistent configuration Bit 0 = 1: No communication with drive 1. ... Bit 5 = 1: No communication with drive 6. yyyy yyyy bin: Motor Module/Hydraulic Module replaced or a DRIVE-CLiQ cable of a Motor/Hydraulic Module not inserted. Bit 8 = 1: Motor Module/Hydraulic Module from drive 1 was replaced or does not communicate. ... Bit 13 = 1: Motor Module/Hydraulic Module from drive 6 was replaced or does not communicate. Note: When this alarm is active, none of the drives listed in the alarm value, which have drive-based motion monitoring functions operating with TM54F, are enabled. For alarm value = 0: The number of drive objects specified in p10010 is not equal to the number of drives that have drive-based motion monitoring functions that have been enabled. See also: p10010 (SI TM54F drive object assignment)
Remedy:	For all drive objects specified in p10010, check whether the drive-based motion monitoring functions with TM54F are enabled (p9601). Check as to whether F35051 is also output and remove the cause. Check whether each drive object number is listed only once in the indices of p10010. Note: If a drive was deactivated and activated without first having established the DRIVE-CLiQ connection, then this alarm is also output. When replacing a Motor Module/Hydraulic Module, carry out the following steps: - start the copy function for the node identifier on the TM54F (p9700 = 1D hex). - acknowledge the hardware CRC on the TM54F (p9701 = EC hex). - save all parameters (p0977 = 1). - carry out a POWER ON (switch-off/switch-on) for all components. For SINUMERIK, the following applies: HMI supports the replacement of components with Safety functions (operating area "Diagnostics" --> Softkey "Alarm list" --> Softkey "Confirm SI HW" etc.). The precise procedure is given in the following document: SINUMERIK Function Manual Safety Integrated

235016	<location>TM54F: Net data communication with drive not established
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL
Message value:	-
Reaction:	NONE
Acknowledge:	NONE

Cause:	The cyclic net data communication within the Terminal Module 54F (TM54F) is still not active for at least one drive. Note: This message is output after the TM54F master and TM54F slave have booted and is automatically withdrawn as soon as communications have been established.
Remedy:	When replacing a Motor Module/Hydraulic Module, carry out the following steps: - start the copy function for the node identifier on the TM54F (p9700 = 1D hex). - acknowledge the hardware CRC on the TM54F (p9701 = EC hex). - save all parameters (p0977 = 1). - carry out a POWER ON (switch-off/switch-on) for all components. The following always applies: - for all drive objects specified in p10010, check whether the drive-based motion monitoring functions with TM54F are enabled (p9601). - check whether fault F35150 is present and if required, remove the cause of this fault. Note: The communication status of the individual drives is indicated in r10055. The corresponding drive objects can be identified together with p10010. See also: r10055 (SI TM54F communication status drive-specific)

235040 <location>TM54F: 24 V undervoltage

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL
Message value:	Fault cause: %1 bin
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	For the 24 V power supply for the Terminal Module 54F (TM54F) an undervoltage condition was detected. As fault response failsafe input terminal signals are transferred to the motion monitoring functions. Fault value (r0949, interpret binary): Bit 0 = 1: Power supply undervoltage at connection X524. Bit 1 = 1: Power supply undervoltage at connection X514.
Remedy:	- check the 24 V DC power supply for the TM54F. - carry out safe acknowledgment (p10006).

235043 <location>TM54F: 24 V overvoltage

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL
Message value:	-
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	For the 24 V power supply for the Terminal Module 54F (TM54F) an overvoltage condition was detected. As fault response failsafe input terminal signals are transferred to the motion monitoring functions.
Remedy:	- check the 24 V DC power supply for the TM54F. - carry out safe acknowledgment (p10006).

235051 <location>TM54F: Defect in a monitoring channel

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY

Cause: The Terminal Module 54F (TM54F) has identified an error in the data cross check between the two control channels. This can be the result of incorrect parameterization. However, a fault may have occurred, which was identified by the Safety Integrated software (e.g. defective hardware).
 Perform the steps listed under "Remedy" in order to rule out any defective hardware.
 As fault response failsafe input terminal signals are transferred to the motion monitoring functions.
 Fault value (r0949, interpret hexadecimal):
 aaaabbcc hex
 aaaa: A value greater than zero indicates an internal software error.
 bb: Data to be cross-compared that resulted in the error.
 If specified, check the specified parameters to ensure that they are the same for both the TM54F master and TM54F slave.
 bb = 00 hex: p10000[0]
 bb = 01 hex: p10001
 bb = 02 hex: p10002
 bb = 03 hex: p10006
 bb = 04 hex: p10008
 bb = 05 hex: p10010
 bb = 06 hex: p10011
 bb = 07 hex: p10020
 bb = 08 hex: p10021
 bb = 09 hex: p10022
 bb = 0A hex: p10023
 bb = 0B hex: p10024
 bb = 0C hex: p10025
 bb = 0D hex: p10026
 bb = 0E hex: p10027
 bb = 0F hex: p10028
 bb = 10 hex: p10036
 bb = 11 hex: p10037
 bb = 12 hex: p10038
 bb = 13 hex: p10039
 bb = 14 hex: p10040
 bb = 15 hex: p10041
 bb = 16 hex: p10042
 bb = 17 hex: p10043
 bb = 18 hex: p10044
 bb = 19 hex: p10045
 bb = 1A hex: p10046
 bb = 1B hex: p10041
 bb = 1C hex: p10046
 bb = 1D ... 1F hex: p10017, p10002, p10000
 bb = 20 ... 2A hex: p10040, p10046, p10047
 bb = 2B hex: error in the data for test stop initialization
 bb = 2C hex: error in the data for initializing the input/output calculation
 bb = 2D ... 45 hex: error in the data for the output calculation p10042 ... p10045
 bb = 46 ... 63 hex: error in the data for the calculation of drive group 1
 bb = 64 ... 81 hex: error in the data for the calculation of drive group 2
 bb = 82 ... 9F hex: error in the data for the calculation of drive group 3
 bb = A0 ... BD hex: error in the data for the calculation of the drive group 4
 bb = BE hex: debounce time of the failsafe inputs (F-DI) p10017
 bb = BF hex: debounce time of the single-channel inputs (DI) p10017
 bb = C0 hex: debounce time of the Diag inputs p10017
 bb = C1 hex: error in the internal data for p10030 SDI positive

bb = C2 hex: error in the internal data for p10031 SDI negative
bb = C3 ... CA hex: error in the data to calculate the drive groups p10030 ... p10031
bb = CB hex: p10032
bb = CC hex: p10033
bb = CD hex: p10009
bb = CE ... CF error in the data for drive group 1 SLP parameter p10032 ... p10033
bb = D0 ... D1 error in the data for drive group 2 SLP parameter p10032 ... p10033
bb = D2 ... D3 error in the data for drive group 3 SLP parameter p10032 ... p10033
bb = D4 ... D5 error in the data for drive group 4 SLP parameter p10032 ... p10033
bb = D6 error in the data for initializing the retract function
bb = D7 error in the data for the retract function SLP
bb = D8 error in parameter p10000[1...5]
bb = D9 ... E3 error in the internal data of the axis communication
bb = E4 ... F2 error in the internal data of the discrepancy check
cc: indicates the index of the data to be cross-compared that resulted in the error.

Remedy:

Carry out the following steps on the TM54F:

- check the specified parameters for incorrect parameterization.
- activate the safety commissioning mode (p0010 = 95).
- start the copy function for SI parameters (p9700 = 57 hex).
- acknowledge complete data change (p9701 = AC hex).
- exit the safety commissioning mode (p0010 = 0).
- save all parameters (p0977 = 1).
- carry out safe acknowledgment (p10006).

For an internal software error (aaaa > 0):

- For TM54F, upgrade the firmware to a later version.
- contact Technical Support.
- replace the TM54F.

235052 <location>TM54F: Internal hardware error

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: An internal software/hardware error has been detected on the Terminal Module 54F (TM54F).

Fault value (r0949, interpret decimal):

Only for internal Siemens troubleshooting.

Remedy:

- check the electrical cabinet design and cable routing for EMC compliance
- upgrade TM54F firmware to more recent version.
- contact Technical Support.
- replace the TM54F.

235053 <location>TM54F: Temperature fault threshold exceeded

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: The temperature measured using the temperature sensing on the TM54F has exceeded the threshold value to initiate this fault.

As fault response failsafe input terminal signals are transferred to the motion monitoring functions.

Fault value (r0949, interpret decimal):

Only for internal Siemens troubleshooting.

Remedy:

- allow the TM54F to cool down.
- carry out safe acknowledgment (p10006).

235054 <location>TM54F: Temperature alarm threshold exceeded

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The temperature measured using the temperature sensing on the TM54F has exceeded the threshold value to initiate this alarm.

Remedy:

- allow the TM54F to cool down.
- carry out safe acknowledgment (p10006).

235075 <location>TM54F: Error during internal communication

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: An internal communications error has occurred in the Terminal Module 54F (TM54F).

This message is also output in the following cases:

- parameter p10000 (TM54F master) is not set the same as p10000 (TM54F slave).
- parameter p10010 (TM54F master) is not set the same as p10010 (TM54F slave).

Alarm value (r2124, interpret decimal):

Only for internal Siemens diagnostics.

Remedy: For p10010/p10000 from the TM54F master not equal to the TM54F slave:

- start the copy function for the node identifier on the TM54F (p9700 = 1D hex).
- acknowledge the hardware CRC on the TM54F (p9701 = EC hex).
- save all parameters (p0977 = 1).
- carry out a POWER ON (switch-off/switch-on) for all components.

For internal communication errors:

- check the electrical cabinet design and cable routing for EMC compliance
- upgrade the software on the TM54F.
- contact Technical Support.
- replace the TM54F.

235080 <location>TM54F: Checksum error safety parameters

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The calculated checksum entered in r10004 over the safety-relevant parameters does not match the reference checksum saved in p10005 at the last machine acceptance.

Fault value (r0949, interpret binary):

Bit 0 = 1: Checksum error for functional SI parameters.

Bit 1 = 1: Checksum error for SI parameters for component assignment.

Remedy:

- check the safety-relevant parameters and if required, correct.

- set the reference checksum to the actual checksum.

- acknowledge the hardware replacement.

- carry out a POWER ON (switch-off/switch-on).

- carry out an acceptance test.

235081	<location>TM54F: Static (steady state) 1 signal at the F-DI for safe acknowledgment
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	A logical 1 signal is present at the F-DI configured in p10006 for more than 10 seconds. If, at the F-DI no acknowledgment was performed for safe acknowledgment, then a steady-state logical and 0 signal must be present. This avoids unintentional safety-relevant acknowledgment (or the "Internal Event Acknowledge" signal) if a wire breaks or one of the two digital inputs bounces.
Remedy:	Set the failsafe digital input (F-DI) to a logical 0 signal (p10006). Note: F-DI: Failsafe Digital Input
235150	<location>TM54F: Communication error
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	A communication error between the TM54F master and Control Unit or between the TM54F slave and the Motor Module/ Hydraulic Module was detected. Fault value (r0949, interpret hexadecimal): Only for internal Siemens troubleshooting.
Remedy:	When replacing a Motor Module/Hydraulic Module, carry out the following steps: - start the copy function for the node identifier on the TM54F (p9700 = 1D hex). - acknowledge the hardware CRC on the TM54F (p9701 = EC hex). - save all parameters (p0977 = 1). - carry out a POWER ON (switch-off/switch-on) for all components. The following always applies: - check the electrical cabinet design and cable routing for EMC compliance - upgrade the software on the TM54F. - contact Technical Support. - replace the TM54F.
235151	<location>TM54F: Discrepancy error
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	IMMEDIATELY

Cause:	The safe input terminals or output terminals have a different state for longer than the time parameterized in p10002 - or too many switching operations were carried out within a monitoring cycle p10002. Fault value (r0949, interpret hexadecimal): yyyyxxxx hex xxxx: The safety-relevant input terminals F-DI indicate a discrepancy. Bit 0: Discrepancy for F-DI 0 ... Bit 9: Discrepancy for F-DI 9 yyyy: The safety-relevant output terminals F-DO indicate a discrepancy. Bit 0: Discrepancy for F-DO 0 ... Bit 3: Discrepancy for F-DO 3 Note: If several discrepancy errors occur consecutively, then this fault is only signaled for the first error that occurs. The following options are available to analyze all of the discrepancy errors: - using the commissioning tool, evaluate the input states and output states of the TM54F. All discrepancy errors are displayed here. - compare parameters p10051 and p10052 from the TM54F master and TM54F slave for discrepancy.
Remedy:	Check the wiring of the corresponding F-DI (contact problems). If the wiring is correct, and for example there is no wire breakage, then a check must be made as to whether the switching frequency at F-DI is too high and must therefore be reduced (switching pulses must have a longer time between them). The time interval between each signal edge at an F-DI must be at least equal to the discrepancy time before the input is switched again. Discrepancy errors in the failsafe digital inputs (F-DI) can only be completely acknowledged if, after the cause of the error was resolved, safe acknowledgment was carried out (see p10006). As long as safety acknowledgment was not carried out, the corresponding F-DI stays in the safe state internally. Sets the discrepancy time for fast switching operations at the F-DIs: For fast switching operations at the failsafe digital inputs (F-DI), it may be necessary to adapt the discrepancy time to the switching frequency: - the period of a cyclic switching pulse must be less than half of the discrepancy time (if necessary, round down). - the time between two switching pulses should be longer than the discrepancy time (if necessary, round up). - the discrepancy time must be at least r10003 (it must always be rounded-down or rounded-up to an integer multiple of the SI sampling time r10003). If a debounce time has been parameterized (p10017 > 0), then the shortest possible discrepancy time is directly specified using the debounce time. - the period of a cyclic switching pulse must be less than half of the discrepancy time p10017 (if necessary, round down). - the time between two fast switching pulses should be longer than the discrepancy time+p10017 (if necessary, round up). - the discrepancy time must be at least r10003. The debounce time must always be set less than the discrepancy time. Example: If the SI sampling cycle is 12 ms and the switching frequency is 110 ms (p10017 = 0), the maximum discrepancy time which can be set is as follows: $p10002 \leq 110/2 \text{ ms} - 12 \text{ ms} = 43 \text{ ms} \rightarrow \text{rounded-off, the following is obtained } p10002 \leq 36 \text{ ms}$ Since the discrepancy time can only be accepted as a whole SI sampling time, the value will need to be rounded up or down to a whole SI sampling time value if it is not an exact integer multiple of an SI sampling time. Basic secondary condition to set the discrepancy time: The discrepancy time of the F-DIs must always be longer than the longest SI sampling time of all drives that use Safety Integrated with TM54F (p9780/p9500). F-DI: Failsafe Digital Input F-DO: Failsafe Digital Output

235152 <location>TM54F: Internal software error

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE

Acknowledge: IMMEDIATELY

Cause: An internal software error has occurred in the Terminal Module 54F (TM54F).
The failsafe digital inputs and digital outputs (F-DI, F-DO) on the TM54F have been set to the safe state.
Fault value (r0949, interpret decimal):
Only for internal Siemens troubleshooting.

Note:

F-DI: Failsafe Digital Input

F-DO: Failsafe Digital Output

Remedy: Check that the firmware version of the TM54F matches the Control Unit's firmware version.

The automatic firmware update must be activated in the project.

Note:

This signal will also appear, for example, in conjunction with fault F35013. In this case, check all the parameters for the test stop on the TM54F (p10001, p10003, p10007, p10041, p10046, p10047). In this case, a POWER ON is required after the parameters have been corrected.

235200 **<location>TM: Calibration data**

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: An error was detected in the calibration data of the Terminal Module.

Alarm value (r2124, interpret decimal):

ddcbaa dec: dd = component number, c = AI/AO, b = fault type, aa = number

c = 0: analog input (AI)

c = 1: analog output (AO)

b = 0: No calibration data available.

b = 1: Offset too high (> 100 mV).

Remedy: - carry out a POWER ON (switch-off/switch-on) for all components.

- replace the component if necessary.

235207 **<location>TM: Temperature fault/alarm threshold channel 0 exceeded**

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150

Message value: %1

Reaction: Infeed: OFF2 (NONE, OFF1)

Servo: OFF2 (NONE, OFF1, OFF3)

Hla: OFF2 (NONE, OFF1, OFF3)

Acknowledge: IMMEDIATELY (POWER ON)

Cause:	For the temperature evaluation via the Terminal Module (TM), at least one of the following conditions to initiate this fault is fulfilled: - alarm threshold has been exceeded longer than that set in the timer (p4102[0], p4103[0]). or - fault threshold exceeded (p4102[1]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[0] = 1, 4), the following applies: - if r4101[0] > 1650 ohms, the temperature r4105[0] = 250 °C - if r4101[0] ≤ 1650 ohms, the temperature r4105[0] = -50 °C The temperature actual value is displayed via connector output r4105[0] and can be interconnected. Notice: This fault only causes the drive to shut down if there is at least one BICO interconnection between the drive and the Terminal Module. Fault value (r0949, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	- allow the temperature sensor to cool down to below p4102[1] - hysteresis (5 K, for TM150, can be set using p4118[0]). - if required, set the fault response to NONE (p2100, p2101). See also: p4102

235208	<location>TM: Temperature fault/alarm threshold channel 1 exceeded
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	%1
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (NONE, OFF1, OFF3) Hla: OFF2 (NONE, OFF1, OFF3)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	For the temperature evaluation via the Terminal Module (TM), at least one of the following conditions to initiate this fault is fulfilled: - alarm threshold has been exceeded longer than that set in the timer (p4102[2], p4103[1]). or - fault threshold exceeded (p4102[3]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[1] = 1, 4), the following applies: - if r4101[1] > 1650 ohms, the temperature r4105[1] = 250 °C - if r4101[1] ≤ 1650 ohms, the temperature r4105[1] = -50 °C The temperature actual value is displayed via connector output r4105[1] and can be interconnected. Notice: This fault only causes the drive to shut down if there is at least one BICO interconnection between the drive and the Terminal Module. Fault value (r0949, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	- allow the temperature sensor to cool down to below p4102[3] - hysteresis (5 K, for TM150, can be set using p4118[1]). - if required, set the fault response to NONE (p2100, p2101). See also: p4102

235209	<location>TM: Temperature fault/alarm threshold channel 2 exceeded
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	%1
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (NONE, OFF1, OFF3) Hla: OFF2 (NONE, OFF1, OFF3)
Acknowledge:	IMMEDIATELY (POWER ON)

Cause:	For the temperature evaluation via the Terminal Module (TM), at least one of the following conditions to initiate this fault is fulfilled: - alarm threshold has been exceeded longer than that set in the timer (p4102[4], p4103[2]). or - fault threshold exceeded (p4102[5]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[2] = 1, 4), the following applies: - if r4101[2] > 1650 ohms, the temperature r4105[2] = 250 °C - if r4101[2] <= 1650 ohms, the temperature r4105[2] = -50 °C The temperature actual value is displayed via connector output r4105[2] and can be interconnected. Notice: This fault only causes the drive to shut down if there is at least one BICO interconnection between the drive and the Terminal Module. Fault value (r0949, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	- allow the temperature sensor to cool down to below p4102[5] - hysteresis (5 K, for TM150, can be set using p4118[2]). - if required, set the fault response to NONE (p2100, p2101). See also: p4102

235210 <location>TM: Temperature fault/alarm threshold channel 3 exceeded

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	%1
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (NONE, OFF1, OFF3) Hla: OFF2 (NONE, OFF1, OFF3)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	For the temperature evaluation via the Terminal Module (TM), at least one of the following conditions to initiate this fault is fulfilled: - alarm threshold has been exceeded longer than that set in the timer (p4102[6], p4103[3]). or - fault threshold exceeded (p4102[7]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[3] = 1, 4), the following applies: - if r4101[3] > 1650 ohms, the temperature r4105[3] = 250 °C - if r4101[3] <= 1650 ohms, the temperature r4105[3] = -50 °C The temperature actual value is displayed via connector output r4105[3] and can be interconnected. Notice: This fault only causes the drive to shut down if there is at least one BICO interconnection between the drive and the Terminal Module. Fault value (r0949, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	- allow the temperature sensor to cool down to below p4102[7] - hysteresis (5 K, for TM150, can be set using p4118[3]). - if required, set the fault response to NONE (p2100, p2101). See also: p4102

235211 <location>TM: Temperature alarm threshold channel 0 exceeded

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE

Cause:	The temperature measured using the temperature sensing of the Terminal Module (TM) (r4105[0]) has exceeded the threshold value to initiate this alarm (p4102[0]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[0] = 1, 4), the following applies: - if r4101[0] > 1650 ohms, the temperature r4105[0] = 250 °C - if r4101[0] ≤ 1650 ohms, the temperature r4105[0] = -50 °C Alarm value (r2124, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	Allow the temperature sensor to cool down to below p4102[0] - hysteresis (5 K, for TM150, can be set using p4118[0]). See also: p4102

235212	<location>TM: Temperature alarm threshold channel 1 exceeded
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The temperature measured using the temperature sensing of the Terminal Module (TM) (r4105[1]) has exceeded the threshold value to initiate this alarm (p4102[2]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[1] = 1, 4), the following applies: - if r4101[1] > 1650 ohms, the temperature r4105[1] = 250 °C - if r4101[1] ≤ 1650 ohms, the temperature r4105[1] = -50 °C Alarm value (r2124, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	Allow the temperature sensor to cool down to below p4102[4] - hysteresis (5 K, for TM150, can be set using p4118[1]). See also: p4102

235213	<location>TM: Temperature alarm threshold channel 2 exceeded
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The temperature measured using the temperature sensing of the Terminal Module (TM) (r4105[2]) has exceeded the threshold value to initiate this alarm (p4102[4]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[2] = 1, 4), the following applies: - if r4101[2] > 1650 ohms, the temperature r4105[2] = 250 °C - if r4101[2] ≤ 1650 ohms, the temperature r4105[2] = -50 °C Alarm value (r2124, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	Allow the temperature sensor to cool down to below p4102[4] - hysteresis (5 K, for TM150, can be set using p4118[2]). See also: p4102

235214	<location>TM: Temperature alarm threshold channel 3 exceeded
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE

Cause:	The temperature measured using the temperature sensing of the Terminal Module (TM) (r4105[3]) has exceeded the threshold value to initiate this alarm (p4102[6]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[3] = 1, 4), the following applies: - if r4101[3] > 1650 ohms, the temperature r4105[3] = 250 °C - if r4101[3] ≤ 1650 ohms, the temperature r4105[3] = -50 °C Alarm value (r2124, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	Allow the temperature sensor to cool down to below p4102[6] - hysteresis (5 K, for TM150, can be set using p4118[3]). See also: p4102

235220 <location>TM: Frequency limit reached for signal output

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: Infeed: OFF1 (NONE, OFF2)
Servo: OFF1 (NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The signals output from the Terminal Module 41 (TM41) for tracks A/B have reached the limit frequency. The output signals are no longer in synchronism with the specified setpoint.

SIMOTION (p4400 = 0) operating mode:

- if the TM41 has been configured as the technology project, this fault is also output in response to short-circuited A/B signals in X520.

SINAMICS (p4400 = 1) operating mode:

- the fine resolution of TM41 in p0418 does not match that of the connector input that was interconnected at p4420
- the encoder position actual value r0479 interconnected at connector input p4420 has an excessively high actual speed
- the output signals correspond to a speed, which is greater than the maximum speed (r1082 of TM41).

Remedy: SIMOTION (p4400 = 0) operating mode:

- enter a lower speed setpoint (p1155).
- reduce the encoder pulse number (p0408).
- check track A/B for short-circuits.

SINAMICS (p4400 = 1) operating mode:

- enter a lower speed setpoint (p1155).
- reduce the encoder pulse number (p0408).

Notice:

The output signal is no longer monitored after changing the message type to "Alarm" (A).

235221 <location>TM: Setpoint - actual value deviation outside the tolerance range

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: Infeed: OFF1 (NONE, OFF2)
Servo: OFF1 (NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The deviation between the setpoint and the output signals (track A/B) exceeds the tolerance of +/-3 %. The deviation between the internal and external measured value is too high (> 1000 pulses).

Remedy: - reduce the basic clock cycle (p0110, p0111).
- if required, replace the component (e.g. internal short-circuit).

235222 <location>TM: Encoder pulse number not permissible

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The encoder pulse number entered does not match the permissible pulse number from a hardware perspective. Alarm value (r2124, interpret decimal): 1: Encoder pulse number is too high. 2: Encoder pulse number is too low. 4: Encoder pulse number is less than the zero mark offset (p4426).
Remedy:	- enter the encoder pulse number in the permissible range (p0408). - if necessary, replace TM41 SAC with TM41 DAC. Note: TM41 SAC: Article No. = 6SL3055-0AA00-3PA0 TM41 DAC: Article No. = 6SL3055-0AA00-3PA1 The following applies for TM41 SAC: - minimum/maximum value for p0408: 1000/8192 The following applies for TM41 DAC: - minimum/maximum value for p0408: 1000/16384 See also: p0408

235223	<location>TM: Zero mark offset not permissible
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The entered zero mark offset is not permissible. Alarm value (r2124, interpret decimal): 1: Zero mark offset is too high.
Remedy:	Enter the zero mark offset in the permissible range (p4426).

235224	<location>TM: Zero mark synchronization interrupted
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The zero mark synchronization with the encoder to be emulated was interrupted. Alarm value (r2124, interpret decimal): 0: The encoder is not in the ready state (e.g. encoder parked) 1: An absolute encoder was connected. 2: The encoder r0479[0...2] interconnected via connector input: p4420 is already communicating with another TM41 (precisely one TM41 can be interconnected with a specific r0479[0...2]). 3: The BICO interconnection to Terminal Module 41 (TM41) was removed (CI: p4420 = 0 signal). 4: The encoder interconnected via connector input: p4420 has carried out an EDS changeover or has been re-parameterized (this operation is not supported, set p4420 to 0 and interconnect again). 5: The maximum number of revolutions of the encoder was exceeded. 6: Encoder in an invalid state. 7: Encoder in an invalid state. 8: Encoder in an invalid state (the encoder is not parameterized or the interconnected signal source is not in the cyclic state).

Remedy: Not necessary.

- if the encoder changes into the ready state, then a synchronization operation that was previously interrupted is carried out again.
- if the synchronization was interrupted due to the maximum permissible synchronization duration, then a new synchronization is not carried out.
- the alarm is only output, if, for an absolute encoder, the zero mark synchronization is set to the zero position (p4401.0 = 1 and p4401.1=0).

235225 <location>TM: Zero mark synchronization held - encoder not in the ready state

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The zero mark synchronization with the encoder to be emulated was held.
The encoder is not in the "ready" state.

Remedy: Bring the encoder into the "ready" state.

235226 <location>TM: Tracks A/B are deactivated

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: There is no frequency setpoint for the Terminal Module 41 (TM41). The output of tracks A/B has been held (frozen).
Possible causes:

- connector input p4420 is not interconnected.
- the leading encoder is not in the "ready" state (parking encoder or encoder data set not parameterized).
- TM41 has a fault.
- the TM41 is in the commissioning mode (p0010 > 0).
- the TM41 component is not connected to DRIVE-CLiQ.

Remedy: - appropriately interconnect connector input p4420.
- bring the leading encoder into the "ready" state.
- remove any TM41 faults.

235227 <location>EDS changeover/encoder data set change not supported

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: Terminal Module 41 (TM41) does not support the following application cases:
- the encoder interconnected via connector input p4420 has carried out an EDS changeover.
- the encoder interconnected with the TM41 was re-parameterized so that the position actual value of the encoder must be newly interpreted.

For example, this is the case when changing the direction of rotation of the motor (p0410, p1821) or when changing the fine resolution (p0418). This may result in a sudden change in the position actual value of the encoder (position setpoint of the TM41), which must not be output at the TM41.

Remedy: Set connector input p4420 = 0 and re-wire.

235228 <location>TM: Sampling time p4099[3] invalid

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge:	NONE
Cause:	The sampling time set in p4099[3] for incremental encoder emulation in Terminal Module 41 (TM41) does not correspond to the valid value. To resolve the problem, correct the setting of p4099[3]. The system automatically performs a warm restart/sub-boot. Alarm value (r2124, interpret decimal): 1: A sampling time p4099[3] < 125 µs was set. 2: An integer multiple of the DRIVE-CLiQ clock cycle was not entered in p4099[3]. 3: - in the SINAMICS mode (p4400 = 1), the sampling time in p4099[3] is not an integer multiple of the current controller sampling time (p0115[0]) of the drive object, which supplies the position setpoint (CI: p4420) for the incremental encoder simulation. - the encoder interconnected via connector input p4420 (e.g. an SSI encoder) is sampled in a slower clock cycle.
Remedy:	- if necessary, cancel the BICO interconnection via connector input p4420. - check the rules specified under cause for setting the sampling time in p4099[3]. - if necessary, set the BICO interconnection via connector input p4420 again. Note: Every time the BICO interconnection is reset via connector input p4420, the sampling time is checked in p4099[3] and, where necessary, this message is output.

235229	<location>TM: Time slice deactivated
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	Infeed: OFF1 (NONE, OFF2) Servo: NONE Hla: NONE
Acknowledge:	IMMEDIATELY
Cause:	The required value of a cycle time in p4099[0...2] is invalid. The corresponding time slice was not activated. Alarm value (r2124, interpret decimal): 0: Digital input/outputs (p4099[0]) 1: Analog inputs (p4099[1]) 3: Encoder emulation (p4099[3]). 4: Encoder emulation speed setpoint (p4099[3]). 5: Encoder emulation speed setpoint (p4099[3]). 6: Internal sequence control of the TM41 (internal error)
Remedy:	Change the sampling time according to the alarm value. Note: The sampling time p4099[0] may not be zero.

235230	<location>TM: Hardware fault
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	%1
Reaction:	Infeed: OFF1 (NONE, OFF2) Servo: NONE Hla: NONE
Acknowledge:	POWER ON
Cause:	The Terminal Module (TM) used has signaled internal errors. Signals from this module may not be evaluated because they are very likely to be incorrect.
Remedy:	If required, replace the Terminal Module.

235231 <location>TM: Master control by PLC missing**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** -**Reaction:** NONE**Acknowledge:** NONE

Cause: The "master control by PLC" signal was missing in operation.

- interconnection of the binector input for "master control by PLC" is incorrect (p0854).
- the higher-level control has withdrawn the "master control by PLC" signal.
- data transfer via the fieldbus (master/drive) was interrupted.

Note:

This alarm is only decisive in the "SIMOTION" operating mode (p4400 = 0).

In the "SINAMICS" operating mode (p4400 = 1), the setpoints at p4420 are evaluated independent of binector input p0854.

Remedy:

- check the interconnection of the binector input for "master control by PLC" (p0854).
- check the "master control by PLC" signal and, if required, switch in.
- check the data transfer via the fieldbus (master/drive).
- check the setting of parameter p2037.

235232 <location>TM41: Zero mark no longer synchronous POWER ON required**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI**Message value:** -**Reaction:** NONE**Acknowledge:** NONE

Cause: SINAMICS (p4400 = 1) operating mode:

When parameterizing a Terminal Module 41 (TM41) or when operating a TM41 Module, an operating state was reached which required a POWER ON.

These include:

- changing the encoder pulse number (p0408).
- changing the fine resolution (p0418).
- withdrawing the DRIVE-CLiQ cable without first deactivating TM41 via p0105.

If this alarm was output, then the zero mark of the TM41 can no longer be output in synchronism to that of the encoder interconnected at p4420.

SIMOTION (p4400 = 0) operating mode:

A previously set zero mark position (p4426) no longer matches encoder position (r0479) due to the change in the pulse number (p0408).

Remedy: The incremental position at output X520 of TM41 can still be evaluated independent of the zero mark.
A POWER ON must be carried out if the TM41 zero mark is evaluated.

235233 <location>DRIVE-CLiQ component function not supported**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150**Message value:** %1**Reaction:** OFF2**Acknowledge:** IMMEDIATELY

Cause: A function requested by the Control Unit is not supported by a DRIVE-CLiQ component.

Fault value (r0949, interpret decimal):

- 1: Terminal Module 31 does not support the function "Timer for temperature evaluation" (X522.7/8, p4103 > 0.000).
- 4: The improved actual value resolution is not supported (p4401.4).
- 5: The improved setpoint resolution is not supported (p4401.5).
- 6: The residual value handling in the setpoint channel cannot be deactivated (p4401.6).
- 7: Output frequencies greater than 750 kHz cannot be activated (p4401.7).

Remedy: For fault value = 1:
 - Deactivate timer for temperature evaluation (X522.7/8) (p4103 = 0.000).
 - use Terminal Module 31 and the relevant firmware version to enable the "Timer for temperature evaluation" function (Article No. 6SL3055-0AA00-3AA1, firmware version 2.6 and higher).
 See also: p4103

235400 <location>TM: Temperature fault/alarm threshold channel 4 exceeded

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150

Message value: %1

Reaction: Infeed: OFF2 (NONE, OFF1)
 Servo: OFF2 (NONE, OFF1, OFF3)
 Hla: OFF2 (NONE, OFF1, OFF3)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: For the temperature evaluation via the Terminal Module 150 (TM150), at least one of the following conditions to initiate this fault is fulfilled:

- alarm threshold has been exceeded longer than that set in the timer (p4102[8], p4103[4]).
- or
- fault threshold exceeded (p4102[9]).

Note:

For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[4] = 1, 4), the following applies:

- if r4101[4] > 1650 ohms, the temperature r4105[4] = 250 °C
- if r4101[4] ≤ 1650 ohms, the temperature r4105[4] = -50 °C

The temperature actual value is displayed via connector output r4105[4] and can be interconnected.

Notice:

This fault only causes the drive to shut down if there is at least one BICO interconnection between the drive and the Terminal Module.

Fault value (r0949, interpret decimal):

Temperature actual value at the time of initiation [0.1 °C].

Remedy: - allow the temperature sensor to cool down to below p4102[9] - hysteresis (p4118[4]).
 - if required, set the fault response to NONE (p2100, p2101).
 See also: p4102

235401 <location>TM: Temperature fault/alarm threshold channel 5 exceeded

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150

Message value: %1

Reaction: Infeed: OFF2 (NONE, OFF1)
 Servo: OFF2 (NONE, OFF1, OFF3)
 Hla: OFF2 (NONE, OFF1, OFF3)

Acknowledge: IMMEDIATELY (POWER ON)

Cause:	For the temperature evaluation via the Terminal Module 150 (TM150), at least one of the following conditions to initiate this fault is fulfilled: - alarm threshold has been exceeded longer than that set in the timer (p4102[10], p4103[5]). or - fault threshold exceeded (p4102[11]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[5] = 1, 4), the following applies: - if r4101[5] > 1650 ohms, the temperature r4105[5] = 250 °C - if r4101[5] <= 1650 ohms, the temperature r4105[5] = -50 °C The temperature actual value is displayed via connector output r4105[5] and can be interconnected. Notice: This fault only causes the drive to shut down if there is at least one BICO interconnection between the drive and the Terminal Module. Fault value (r0949, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	- allow the temperature sensor to cool down to below p4102[11] - hysteresis (p4118[5]). - if required, set the fault response to NONE (p2100, p2101). See also: p4102

235402 <location>TM: Temperature fault/alarm threshold channel 6 exceeded

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value:	%1
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (NONE, OFF1, OFF3) Hla: OFF2 (NONE, OFF1, OFF3)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	For the temperature evaluation via the Terminal Module 150 (TM150), at least one of the following conditions to initiate this fault is fulfilled: - alarm threshold has been exceeded longer than that set in the timer (p4102[12], p4103[6]). or - fault threshold exceeded (p4102[13]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[6] = 1, 4), the following applies: - if r4101[6] > 1650 ohms, the temperature r4105[6] = 250 °C - if r4101[6] <= 1650 ohms, the temperature r4105[6] = -50 °C The temperature actual value is displayed via connector output r4105[6] and can be interconnected. Notice: This fault only causes the drive to shut down if there is at least one BICO interconnection between the drive and the Terminal Module. Fault value (r0949, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	- allow the temperature sensor to cool down to below p4102[13] - hysteresis (p4118[6]). - if required, set the fault response to NONE (p2100, p2101). See also: p4102

235403 <location>TM: Temperature fault/alarm threshold channel 7 exceeded

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value:	%1
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (NONE, OFF1, OFF3) Hla: OFF2 (NONE, OFF1, OFF3)
Acknowledge:	IMMEDIATELY (POWER ON)

Cause:	For the temperature evaluation via the Terminal Module 150 (TM150), at least one of the following conditions to initiate this fault is fulfilled: - alarm threshold has been exceeded longer than that set in the timer (p4102[14], p4103[7]). or - fault threshold exceeded (p4102[15]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[7] = 1, 4), the following applies: - if r4101[7] > 1650 ohms, the temperature r4105[7] = 250 °C - if r4101[7] ≤ 1650 ohms, the temperature r4105[7] = -50 °C The temperature actual value is displayed via connector output r4105[7] and can be interconnected. Notice: This fault only causes the drive to shut down if there is at least one BICO interconnection between the drive and the Terminal Module. Fault value (r0949, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	- allow the temperature sensor to cool down to below p4102[15] - hysteresis (p4118[7]). - if required, set the fault response to NONE (p2100, p2101). See also: p4102

235404	<location>TM: Temperature fault/alarm threshold channel 8 exceeded
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value:	%1
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (NONE, OFF1, OFF3) Hla: OFF2 (NONE, OFF1, OFF3)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	For the temperature evaluation via the Terminal Module 150 (TM150), at least one of the following conditions to initiate this fault is fulfilled: - alarm threshold has been exceeded longer than that set in the timer (p4102[16], p4103[8]). or - fault threshold exceeded (p4102[17]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[8] = 1, 4), the following applies: - if r4101[8] > 1650 ohms, the temperature r4105[8] = 250 °C - if r4101[8] ≤ 1650 ohms, the temperature r4105[8] = -50 °C The temperature actual value is displayed via connector output r4105[8] and can be interconnected. Notice: This fault only causes the drive to shut down if there is at least one BICO interconnection between the drive and the Terminal Module. Fault value (r0949, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	- allow the temperature sensor to cool down to below p4102[17] - hysteresis (p4118[8]). - if required, set the fault response to NONE (p2100, p2101). See also: p4102

235405	<location>TM: Temperature fault/alarm threshold channel 9 exceeded
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value:	%1
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (NONE, OFF1, OFF3) Hla: OFF2 (NONE, OFF1, OFF3)
Acknowledge:	IMMEDIATELY (POWER ON)

Cause:	For the temperature evaluation via the Terminal Module 150 (TM150), at least one of the following conditions to initiate this fault is fulfilled: - alarm threshold has been exceeded longer than that set in the timer (p4102[18], p4103[9]). or - fault threshold exceeded (p4102[19]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[9] = 1, 4), the following applies: - if r4101[9] > 1650 ohms, the temperature r4105[9] = 250 °C - if r4101[9] <= 1650 ohms, the temperature r4105[9] = -50 °C The temperature actual value is displayed via connector output r4105[9] and can be interconnected. Notice: This fault only causes the drive to shut down if there is at least one BICO interconnection between the drive and the Terminal Module. Fault value (r0949, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	- allow the temperature sensor to cool down to below p4102[19] - hysteresis (p4118[9]). - if required, set the fault response to NONE (p2100, p2101). See also: p4102

235406 <location>TM: Temperature fault/alarm threshold channel 10 exceeded

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value:	%1
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (NONE, OFF1, OFF3) Hla: OFF2 (NONE, OFF1, OFF3)
Acknowledge:	IMMEDIATELY (POWER ON)
Cause:	For the temperature evaluation via the Terminal Module 150 (TM150), at least one of the following conditions to initiate this fault is fulfilled: - alarm threshold has been exceeded longer than that set in the timer (p4102[20], p4103[10]). or - fault threshold exceeded (p4102[21]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[10] = 1, 4), the following applies: - if r4101[10] > 1650 ohms, the temperature r4105[10] = 250 °C - if r4101[10] <= 1650 ohms, the temperature r4105[10] = -50 °C The temperature actual value is displayed via connector output r4105[10] and can be interconnected. Notice: This fault only causes the drive to shut down if there is at least one BICO interconnection between the drive and the Terminal Module. Fault value (r0949, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	- allow the temperature sensor to cool down to below p4102[21] - hysteresis (p4118[10]). - if required, set the fault response to NONE (p2100, p2101). See also: p4102

235407 <location>TM: Temperature fault/alarm threshold channel 11 exceeded

Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value:	%1
Reaction:	Infeed: OFF2 (NONE, OFF1) Servo: OFF2 (NONE, OFF1, OFF3) Hla: OFF2 (NONE, OFF1, OFF3)
Acknowledge:	IMMEDIATELY (POWER ON)

Cause:	For the temperature evaluation via the Terminal Module 150 (TM150), at least one of the following conditions to initiate this fault is fulfilled: - alarm threshold has been exceeded longer than that set in the timer (p4102[22], p4103[11]). or - fault threshold exceeded (p4102[23]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[11] = 1, 4), the following applies: - if r4101[11] > 1650 ohms, the temperature r4105[11] = 250 °C - if r4101[11] ≤ 1650 ohms, the temperature r4105[11] = -50 °C The temperature actual value is displayed via connector output r4105[11] and can be interconnected. Notice: This fault only causes the drive to shut down if there is at least one BICO interconnection between the drive and the Terminal Module. Fault value (r0949, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	- allow the temperature sensor to cool down to below p4102[23] - hysteresis (p4118[11]). - if required, set the fault response to NONE (p2100, p2101). See also: p4102

235410	<location>TM: Temperature alarm threshold channel 4 exceeded
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The temperature (r4105[4]) measured using the temperature sensing of the Terminal Module 150 (TM150) has exceeded the threshold value to initiate this alarm (p4102[8]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[4] = 1, 4), the following applies: - if r4101[4] > 1650 ohms, the temperature r4105[4] = 250 °C - if r4101[4] ≤ 1650 ohms, the temperature r4105[4] = -50 °C Alarm value (r2124, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	Allow the temperature sensor to cool down to below p4102[8] - hysteresis (p4118[4]). See also: p4102

235411	<location>TM: Temperature alarm threshold channel 5 exceeded
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The temperature (r4105[5]) measured using the temperature sensing of the Terminal Module 150 (TM150) has exceeded the threshold value to initiate this alarm (p4102[10]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[5] = 1, 4), the following applies: - if r4101[5] > 1650 ohms, the temperature r4105[5] = 250 °C - if r4101[5] ≤ 1650 ohms, the temperature r4105[5] = -50 °C Alarm value (r2124, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	Allow the temperature sensor to cool down to below p4102[10] - hysteresis (p4118[5]). See also: p4102

235412 <location>TM: Temperature alarm threshold channel 6 exceeded**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE**Cause:** The temperature (r4105[6]) measured using the temperature sensing of the Terminal Module 150 (TM150) has exceeded the threshold value to initiate this alarm (p4102[12]).**Note:**

For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[6] = 1, 4), the following applies:

- if r4101[6] > 1650 ohms, the temperature r4105[6] = 250 °C

- if r4101[6] ≤ 1650 ohms, the temperature r4105[6] = -50 °C

Alarm value (r2124, interpret decimal):

Temperature actual value at the time of initiation [0.1 °C].

Remedy: Allow the temperature sensor to cool down to below p4102[12] - hysteresis (p4118[6]).See also: p4102

235413 <location>TM: Temperature alarm threshold channel 7 exceeded**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE**Cause:** The temperature (r4105[7]) measured using the temperature sensing of the Terminal Module 150 (TM150) has exceeded the threshold value to initiate this alarm (p4102[14]).**Note:**

For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[7] = 1, 4), the following applies:

- if r4101[7] > 1650 ohms, the temperature r4105[7] = 250 °C

- if r4101[7] ≤ 1650 ohms, the temperature r4105[7] = -50 °C

Alarm value (r2124, interpret decimal):

Temperature actual value at the time of initiation [0.1 °C].

Remedy: Allow the temperature sensor to cool down to below p4102[14] - hysteresis (p4118[7]).See also: p4102

235414 <location>TM: Temperature alarm threshold channel 8 exceeded**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE**Cause:** The temperature (r4105[8]) measured using the temperature sensing of the Terminal Module 150 (TM150) has exceeded the threshold value to initiate this alarm (p4102[16]).**Note:**

For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[8] = 1, 4), the following applies:

- if r4101[8] > 1650 ohms, the temperature r4105[8] = 250 °C

- if r4101[8] ≤ 1650 ohms, the temperature r4105[8] = -50 °C

Alarm value (r2124, interpret decimal):

Temperature actual value at the time of initiation [0.1 °C].

Remedy: Allow the temperature sensor to cool down to below p4102[16] - hysteresis (p4118[8]).See also: p4102

235415 <location>TM: Temperature alarm threshold channel 9 exceeded**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150

Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The temperature (r4105[9]) measured using the temperature sensing of the Terminal Module 150 (TM150) has exceeded the threshold value to initiate this alarm (p4102[18]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[9] = 1, 4), the following applies: - if r4101[9] > 1650 ohms, the temperature r4105[9] = 250 °C - if r4101[9] ≤ 1650 ohms, the temperature r4105[9] = -50 °C Alarm value (r2124, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	Allow the temperature sensor to cool down to below p4102[18] - hysteresis (p4118[9]). See also: p4102

235416	<location>TM: Temperature alarm threshold channel 10 exceeded
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The temperature (r4105[10]) measured using the temperature sensing of the Terminal Module 150 (TM150) has exceeded the threshold value to initiate this alarm (p4102[20]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[10] = 1, 4), the following applies: - if r4101[10] > 1650 ohms, the temperature r4105[10] = 250 °C - if r4101[10] ≤ 1650 ohms, the temperature r4105[10] = -50 °C Alarm value (r2124, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	Allow the temperature sensor to cool down to below p4102[20] - hysteresis (p4118[10]). See also: p4102

235417	<location>TM: Temperature alarm threshold channel 11 exceeded
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	The temperature (r4105[11]) measured using the temperature sensing of the Terminal Module 150 (TM150) has exceeded the threshold value to initiate this alarm (p4102[22]). Note: For sensor type "PTC thermistor" and "Bimetallic NC contact" (p4100[11] = 1, 4), the following applies: - if r4101[11] > 1650 ohms, the temperature r4105[11] = 250 °C - if r4101[11] ≤ 1650 ohms, the temperature r4105[11] = -50 °C Alarm value (r2124, interpret decimal): Temperature actual value at the time of initiation [0.1 °C].
Remedy:	Allow the temperature sensor to cool down to below p4102[22] - hysteresis (p4118[11]). See also: p4102

235800	<location>TM: Group signal
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	-

Reaction: Infeed: OFF2 (NONE, OFF1)
Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2)
Hla: OFF2 (NONE, OFF1, OFF3, STOP2)

Acknowledge: NONE

Cause: The Terminal Module has detected at least one fault.

Remedy: Evaluates other actual messages.

235801 <location>TM DRIVE-CLiQ: Sign-of-life missing

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: Component number: %1, fault cause: %2

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communication error has occurred between the Control Unit and the Terminal Module involved.
Fault cause:
10 (= 0A hex):
The sign-of-life bit in the receive telegram is not set.
Note regarding the message value:
The individual information is coded as follows in the message value (r0949/r2124):
0000yyxx hex: yy = component number, xx = error cause

Remedy: - check the DRIVE-CLiQ connection.
- replace the component involved.

235802 <location>TM: Time slice overflow

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: A time slice overflow has occurred on the Terminal Module.

Remedy: Replace the Terminal Module.

235803 <location>TM: Memory test

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: An error has occurred during the memory test on the Terminal Module.

Remedy: - check whether the permissible ambient temperature for the Terminal Module is being maintained.
- replace the Terminal Module.

235804 <location>TM: CRC

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: A checksum error has occurred when reading-out the program memory on the Terminal Module.
Fault value (r0949, interpret hexadecimal):
Difference between the checksum at POWER ON and the actual checksum.

Remedy:

- check whether the permissible ambient temperature for the component is maintained.
- replace the Terminal Module.

235805 <location>TM: EEPROM checksum error

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: Internal parameter data is corrupted.
Alarm value (r2124, interpret hexadecimal):
01: EEPROM access error.
02: Too many blocks in the EEPROM.

Remedy:

- check whether the permissible ambient temperature for the component is maintained.
- replace the Terminal Module 31 (TM31).

235807 <location>TM: Sequence control time monitoring

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: Error, timeout, sequence control on the Terminal Module.

Remedy: Replace the Terminal Module.

235820 <location>TM DRIVE-CLiQ: Telegram error

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: Component number: %1, fault cause: %2

Reaction: OFF1 (OFF2)

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communication error has occurred from the Control Unit to the Terminal Module involved.

Fault cause:

1 (= 01 hex):

Checksum error (CRC error).

2 (= 02 hex):

Telegram is shorter than specified in the length byte or in the receive list.

3 (= 03 hex):

Telegram is longer than specified in the length byte or in the receive list.

4 (= 04 hex):

The length of the receive telegram does not match the receive list.

5 (= 05 hex):

The type of the receive telegram does not match the receive list.

6 (= 06 hex):

The address of the component in the telegram and in the receive list do not match.

7 (= 07 hex):

A SYNC telegram is expected - but the received telegram is not a SYNC telegram.

8 (= 08 hex):

No SYNC telegram is expected - but the received telegram is one.

9 (= 09 hex):

The error bit in the receive telegram is set.

16 (= 10 hex):

The receive telegram is too early.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy:

- carry out a POWER ON (switch-off/switch-on).

- check the electrical cabinet design and cable routing for EMC compliance

- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

235835 <location>TM DRIVE-CLiQ: Cyclic data transfer error

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: Component number: %1, fault cause: %2

Reaction: OFF1 (OFF2)

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communication error has occurred from the Control Unit to the Terminal Module involved. The nodes do not send and receive in synchronism.

Fault cause:

33 (= 21 hex):

The cyclic telegram has not been received.

34 (= 22 hex):

Timeout in the telegram receive list.

64 (= 40 hex):

Timeout in the telegram send list.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy:

- carry out a POWER ON.

- replace the component involved.

235836	<location>TM DRIVE-CLiQ: Send error for DRIVE-CLiQ data
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF1 (OFF2)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred between the Control Unit and the Terminal Module involved. Data were not able to be sent. Fault cause: 65 (= 41 hex): Telegram type does not match send list. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON.
235837	<location>PTM DRIVE-CLiQ: Component fault
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF1 (OFF2)
Acknowledge:	IMMEDIATELY
Cause:	Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded. Fault cause: 32 (= 20 hex): Error in the telegram header. 35 (= 23 hex): Receive error: The telegram buffer memory contains an error. 66 (= 42 hex): Send error: The telegram buffer memory contains an error. 67 (= 43 hex): Send error: The telegram buffer memory contains an error. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...). - check the electrical cabinet design and cable routing for EMC compliance - if required, use another DRIVE-CLiQ socket (p9904). - replace the component involved.
235845	<location>TM DRIVE-CLiQ: Cyclic data transfer error
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF1 (OFF2)
Acknowledge:	IMMEDIATELY

Cause: A DRIVE-CLiQ communication error has occurred between the Control Unit and the Terminal Module (TM) involved.
Fault cause:
11 (= 0B hex):
Synchronization error during alternating cyclic data transfer.
Note regarding the message value:
The individual information is coded as follows in the message value (r0949/r2124):
0000yyxx hex: yy = component number, xx = error cause

Remedy: Carry out a POWER ON.

235850 <location>TM: Internal software error

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1

Reaction: Infeed: OFF1 (NONE, OFF2)
Servo: OFF1 (NONE, OFF2, OFF3)
Hla: OFF1 (NONE, OFF2, OFF3)

Acknowledge: POWER ON

Cause: An internal software error in the Terminal Module (TM) has occurred.
Fault value (r0949, interpret decimal):
1: Background time slice is blocked.
2: Checksum over the code memory is not OK.

Remedy: - replace the Terminal Module (TM).
- if required, upgrade the firmware in the Terminal Module.
- contact Technical Support.

235851 <location>TM DRIVE-CLiQ (CU): Sign-of-life missing

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: Component number: %1, fault cause: %2

Reaction: OFF1 (OFF2)

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communication error has occurred from the Terminal Module involved (TM) to the Control Unit.
The DRIVE-CLiQ component did not set the sign-of-life to the Control Unit.
Fault cause:
10 (= 0A hex):
The sign-of-life bit in the receive telegram is not set.
Note regarding the message value:
The individual information is coded as follows in the message value (r0949/r2124):
0000yyxx hex: yy = component number, xx = error cause

Remedy: Upgrade the firmware of the component involved.

235860 <location>TM DRIVE-CLiQ (CU): Telegram error

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: Component number: %1, fault cause: %2

Reaction: OFF1 (OFF2)

Acknowledge: IMMEDIATELY

Cause:	A DRIVE-CLiQ communication error has occurred from the Terminal Module involved (TM) to the Control Unit. Fault cause: 1 (= 01 hex): Checksum error (CRC error). 2 (= 02 hex): Telegram is shorter than specified in the length byte or in the receive list. 3 (= 03 hex): Telegram is longer than specified in the length byte or in the receive list. 4 (= 04 hex): The length of the receive telegram does not match the receive list. 5 (= 05 hex): The type of the receive telegram does not match the receive list. 6 (= 06 hex): The address of the power unit in the telegram and in the receive list do not match. 9 (= 09 hex): The DRIVE-CLiQ communication from the DRIVE-CLiQ component involved to the Control Unit signals that the supply voltage has failed. 16 (= 10 hex): The receive telegram is too early. 17 (= 11 hex): CRC error and the receive telegram is too early. 18 (= 12 hex): The telegram is shorter than that specified in the length byte or in the receive list and the receive telegram is too early. 19 (= 13 hex): The telegram is longer than that specified in the length byte or in the receive list and the receive telegram is too early. 20 (= 14 hex): The length of the receive telegram does not match the receive list and the receive telegram is too early. 21 (= 15 hex): The type of the receive telegram does not match the receive list and the receive telegram is too early. 22 (= 16 hex): The address of the power unit in the telegram and in the receive list does not match and the receive telegram is too early. 25 (= 19 hex): The error bit in the receive telegram is set and the receive telegram is too early. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON (switch-off/switch-on). - check the electrical cabinet design and cable routing for EMC compliance - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

235875	<location>TM: power supply voltage failed
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF1 (OFF2)
Acknowledge:	IMMEDIATELY

Cause:	The DRIVE-CLiQ communication from the DRIVE-CLiQ component involved to the Control Unit signals that the supply voltage has failed. Fault cause: 9 (= 09 hex): The power supply voltage for the components has failed. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON (switch-off/switch-on). - check the power supply voltage wiring for the DRIVE-CLiQ component (interrupted cable, contacts, ...). - check the dimensioning of the power supply for the DRIVE-CLiQ component.

235885 <location>TM DRIVE-CLiQ (CU): Cyclic data transfer error

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF1 (OFF2)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Terminal Module involved (TM) to the Control Unit. The nodes do not send and receive in synchronism. Fault cause: 26 (= 1A hex): Sign-of-life bit in the receive telegram not set and the receive telegram is too early. 33 (= 21 hex): The cyclic telegram has not been received. 34 (= 22 hex): Timeout in the telegram receive list. 64 (= 40 hex): Timeout in the telegram send list. 98 (= 62 hex): Error at the transition to cyclic operation. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the power supply voltage of the component involved. - carry out a POWER ON. - replace the component involved.

235886 <location>TM DRIVE-CLiQ (CU): Error when sending DRIVE-CLiQ data

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF1 (OFF2)
Acknowledge:	IMMEDIATELY

Cause:	A DRIVE-CLiQ communication error has occurred from the Terminal Module involved (TM) to the Control Unit. Data were not able to be sent. Fault cause: 65 (= 41 hex): Telegram type does not match send list. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON.

235887 <location>TM DRIVE-CLiQ (CU): Component fault

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF1 (OFF2)
Acknowledge:	IMMEDIATELY
Cause:	Fault detected on the DRIVE-CLiQ component (Terminal Module) involved. Faulty hardware cannot be excluded. Fault cause: 32 (= 20 hex): Error in the telegram header. 35 (= 23 hex): Receive error: The telegram buffer memory contains an error. 66 (= 42 hex): Send error: The telegram buffer memory contains an error. 67 (= 43 hex): Send error: The telegram buffer memory contains an error. 96 (= 60 hex): Response received too late during runtime measurement. 97 (= 61 hex): Time taken to exchange characteristic data too long. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...). - check the electrical cabinet design and cable routing for EMC compliance - if required, use another DRIVE-CLiQ socket (p9904). - replace the component involved.

235895 <location>TM DRIVE-CLiQ (CU): Alternating cyclic data transfer error

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF1 (OFF2)
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communication error has occurred from the Terminal Module involved (TM) to the Control Unit. Fault cause: 11 (= 0B hex): Synchronization error during alternating cyclic data transfer. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause

Remedy: Carry out a POWER ON.

235896 <location>TM DRIVE-CLiQ (CU): Inconsistent component properties

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: Component number: %1

Reaction: Infeed: OFF2 (NONE, OFF1)
Servo: OFF2 (IASC/DCBRK, NONE, OFF1, OFF3, STOP2)
Hla: OFF2 (NONE, OFF1, OFF3, STOP2)

Acknowledge: IMMEDIATELY

Cause: The properties of the DRIVE-CLiQ component (Terminal Module), specified by the fault value, have changed in an incompatible fashion with respect to the properties when booted. One cause can be, e.g. that a DRIVE-CLiQ component has been replaced.

Fault value (r0949, interpret decimal):

Component number.

Remedy: - carry out a POWER ON.
- when a component is replaced, the same component type and if possible the same firmware version should be used.
- when a cable is replaced, only cables whose length is the same as or as close as possible to the length of the original cables should be used (ensure compliance with the maximum cable length).

235899 <location>TM: Unknown fault

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: New message: %1

Reaction: Infeed: NONE (OFF1, OFF2)
Servo: NONE (IASC/DCBRK, OFF1, OFF2, OFF3, STOP2)
Hla: NONE (OFF1, OFF2, OFF3, STOP2)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: A fault has occurred on the Terminal Module that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit.

Fault value (r0949, interpret decimal):

Fault number.

Note:

If required, the significance of this new fault can be read about in a more recent description of the Control Unit.

Remedy: - replace the firmware on the Terminal Module by an older firmware version (r0158).
- upgrade the firmware on the Control Unit (r0018).

235903 <location>TM: I2C bus error occurred

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: An error has occurred while accessing the internal I2C bus of the Terminal Module.

Remedy: Replace the Terminal Module.

235904 <location>TM: EEPROM

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: An error has occurred accessing the non-volatile memory on the Terminal Module.

Remedy: Replace the Terminal Module.

235905 <location>TM: Parameter access

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The Control Unit attempted to write an illegal parameter value to the Terminal Module.

Remedy: - check whether the firmware version of the Terminal Module (r0158) matches the firmware version of Control Unit (r0018).
- if required, replace the Terminal Module.

Note:

The firmware versions that match each other are in the readme.txt file on the memory card.

235906 <location>TM: 24 V power supply missing

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The 24 V power supply for the digital outputs is missing.

Alarm value (r2124, interpret hexadecimal):

01: TM17 24 V power supply for DI/DO 0 ... 7 missing.

02: TM17 24 V power supply for DI/DO 8 ... 15 missing.

04: TM15 24 V power supply for DI/DO 0 ... 7 (X520) missing.

08: TM15 24 V power supply for DI/DO 8 ... 15 (X521) missing.

10: TM15 24 V power supply for DI/DO 16 ... 23 (X522) missing.

20: TM41 24 V power supply for DI/DO 0 ... 3 missing.

Remedy: Check the terminals for the power supply voltage (L1+, L2+, L3+, M or +24 V_1 for TM41).

235907 <location>TM: Hardware initialization error

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The Terminal Module was not successfully initialized.

Alarm value (r2124, interpret hexadecimal):

01: TM17 or TM41 - incorrect configuration request.

02: TM17 or TM41 - programming not successful.

04: TM17 or TM41 - invalid time stamp

Remedy: Carry out a POWER ON.

235910 <location>TM: Module overtemperature

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The temperature in the module has exceeded the highest permissible limit.

Remedy: - reduce the ambient temperature.

- replace the Terminal Module.

235911	<location>TM: Clock synchronous operation sign-of-life missing
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	-
Reaction:	NONE
Acknowledge:	NONE
Cause:	The maximum permissible number of errors in the master sign-of-life (clock synchronous operation) has been exceeded in cyclic operation. When the alarm is output, the module outputs are reset up to the next synchronization.
Remedy:	- check the physical bus configuration (terminating resistor, shielding, etc.). - check the interconnection of the master sign-of-life (r4201 via p0915). - check whether the master correctly sends the sign-of-life (e.g. set up a trace with r4201.12 ... r4201.15 and trigger signal r4301.9). - check the bus and master for utilization level (e.g. bus cycle time Tdp was set too short).
235920	<location>TM: Error temperature sensor channel 0
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	When evaluating the temperature sensor, an error occurred. Alarm value (r2124, interpret decimal): 1: Wire breakage or sensor not connected. KTY84: R > 1630 Ohm (TM150: R > 2170 Ohm), PT100: R > 194 Ohm, PT1000: R > 1720 Ohm (TM150: R > 1944 Ohm) 2: Measured resistance too low. PTC thermistor: R < 20 Ohm, KTY84: R < 50 Ohm (TM150: R < 180 Ohm), PT100: R < 60 Ohm, PT1000: R < 603 Ohm
Remedy:	- make sure that the sensor is connected correctly. - replace the sensor.
235921	<location>TM: Error temperature sensor channel 1
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	When evaluating the temperature sensor, an error occurred. Alarm value (r2124, interpret decimal): 1: Wire breakage or sensor not connected. KTY84: R > 1630 Ohm (TM150: R > 2170 Ohm), PT100: R > 194 Ohm, PT1000: R > 1720 Ohm (TM150: R > 1944 Ohm) 2: Measured resistance too low. PTC thermistor: R < 20 Ohm, KTY84: R < 50 Ohm (TM150: R < 180 Ohm), PT100: R < 60 Ohm, PT1000: R < 603 Ohm
Remedy:	- make sure that the sensor is connected correctly. - replace the sensor.
235922	<location>TM: Error temperature sensor channel 2
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE

Cause:	When evaluating the temperature sensor, an error occurred. Alarm value (r2124, interpret decimal): 1: Wire breakage or sensor not connected. KTY84: R > 1630 Ohm (TM150: R > 2170 Ohm), PT100: R > 194 Ohm, PT1000: R > 1720 Ohm (TM150: R > 1944 Ohm) 2: Measured resistance too low. PTC thermistor: R < 20 Ohm, KTY84: R < 50 Ohm (TM150: R < 180 Ohm), PT100: R < 60 Ohm, PT1000: R < 603 Ohm
Remedy:	- make sure that the sensor is connected correctly. - replace the sensor.

235923	<location>TM: Error temperature sensor channel 3
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	When evaluating the temperature sensor, an error occurred. Alarm value (r2124, interpret decimal): 1: Wire breakage or sensor not connected. KTY84: R > 1630 Ohm (TM150: R > 2170 Ohm), PT100: R > 194 Ohm, PT1000: R > 1720 Ohm (TM150: R > 1944 Ohm) 2: Measured resistance too low. PTC thermistor: R < 20 Ohm, KTY84: R < 50 Ohm (TM150: R < 180 Ohm), PT100: R < 60 Ohm, PT1000: R < 603 Ohm
Remedy:	- make sure that the sensor is connected correctly. - replace the sensor.

235924	<location>TM: Error temperature sensor channel 4
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	When evaluating the temperature sensor, an error occurred. Alarm value (r2124, interpret decimal): 1: Wire breakage or sensor not connected. KTY84: R > 2170 Ohm, PT100: R > 194 Ohm, PT1000: R > 1944 Ohm 2: Measured resistance too low. PTC thermistor: R < 20 Ohm, KTY84: R < 180 Ohm, PT100: R < 60 Ohm, PT1000: R < 603 Ohm
Remedy:	- make sure that the sensor is connected correctly. - replace the sensor.

235925	<location>TM: Error temperature sensor channel 5
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	When evaluating the temperature sensor, an error occurred. Alarm value (r2124, interpret decimal): 1: Wire breakage or sensor not connected. KTY84: R > 2170 Ohm, PT100: R > 194 Ohm, PT1000: R > 1944 Ohm 2: Measured resistance too low. PTC thermistor: R < 20 Ohm, KTY84: R < 180 Ohm, PT100: R < 60 Ohm, PT1000: R < 603 Ohm
Remedy:	- make sure that the sensor is connected correctly. - replace the sensor.

235926 <location>TM: Error temperature sensor channel 6**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE**Cause:** When evaluating the temperature sensor, an error occurred.

Alarm value (r2124, interpret decimal):

1: Wire breakage or sensor not connected.

KTY84: R > 2170 Ohm, PT100: R > 194 Ohm, PT1000: R > 1944 Ohm

2: Measured resistance too low.

PTC thermistor: R < 20 Ohm, KTY84: R < 180 Ohm, PT100: R < 60 Ohm, PT1000: R < 603 Ohm

Remedy:

- make sure that the sensor is connected correctly.
- replace the sensor.

235927 <location>TM: Error temperature sensor channel 7**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE**Cause:** When evaluating the temperature sensor, an error occurred.

Alarm value (r2124, interpret decimal):

1: Wire breakage or sensor not connected.

KTY84: R > 2170 Ohm, PT100: R > 194 Ohm, PT1000: R > 1944 Ohm

2: Measured resistance too low.

PTC thermistor: R < 20 Ohm, KTY84: R < 180 Ohm, PT100: R < 60 Ohm, PT1000: R < 603 Ohm

Remedy:

- make sure that the sensor is connected correctly.
- replace the sensor.

235928 <location>TM: Error temperature sensor channel 8**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE**Cause:** When evaluating the temperature sensor, an error occurred.

Alarm value (r2124, interpret decimal):

1: Wire breakage or sensor not connected.

KTY84: R > 2170 Ohm, PT100: R > 194 Ohm, PT1000: R > 1944 Ohm

2: Measured resistance too low.

PTC thermistor: R < 20 Ohm, KTY84: R < 180 Ohm, PT100: R < 60 Ohm, PT1000: R < 603 Ohm

Remedy:

- make sure that the sensor is connected correctly.
- replace the sensor.

235929 <location>TM: Error temperature sensor channel 9**Drive object:** A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE

Cause:	When evaluating the temperature sensor, an error occurred. Alarm value (r2124, interpret decimal): 1: Wire breakage or sensor not connected. KTY84: R > 2170 Ohm, PT100: R > 194 Ohm, PT1000: R > 1944 Ohm 2: Measured resistance too low. PTC thermistor: R < 20 Ohm, KTY84: R < 180 Ohm, PT100: R < 60 Ohm, PT1000: R < 603 Ohm
Remedy:	- make sure that the sensor is connected correctly. - replace the sensor.

235930	<location>TM: Error temperature sensor channel 10
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	When evaluating the temperature sensor, an error occurred. Alarm value (r2124, interpret decimal): 1: Wire breakage or sensor not connected. KTY84: R > 2170 Ohm, PT100: R > 194 Ohm, PT1000: R > 1944 Ohm 2: Measured resistance too low. PTC thermistor: R < 20 Ohm, KTY84: R < 180 Ohm, PT100: R < 60 Ohm, PT1000: R < 603 Ohm
Remedy:	- make sure that the sensor is connected correctly. - replace the sensor.

235931	<location>TM: Error temperature sensor channel 11
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM150
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	When evaluating the temperature sensor, an error occurred. Alarm value (r2124, interpret decimal): 1: Wire breakage or sensor not connected. KTY84: R > 2170 Ohm, PT100: R > 194 Ohm, PT1000: R > 1944 Ohm 2: Measured resistance too low. PTC thermistor: R < 20 Ohm, KTY84: R < 180 Ohm, PT100: R < 60 Ohm, PT1000: R < 603 Ohm
Remedy:	- make sure that the sensor is connected correctly. - replace the sensor.

235950	<location>TM: Internal software error
Drive object:	A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	OFF2 (NONE)
Acknowledge:	POWER ON
Cause:	An internal software error has occurred. Fault value (r0949, interpret decimal): Information about the fault source. Only for internal Siemens troubleshooting.
Remedy:	- if necessary, upgrade the firmware in the Terminal Module to a later version. - contact Technical Support.

235999 <location>TM: Unknown alarm

Drive object: A_INF_828, B_INF_828, HLA_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: New message: %1

Reaction: NONE

Acknowledge: NONE

Cause: An alarm has occurred on the Terminal Module that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit.
Alarm value (r2124, interpret decimal):
Alarm number.
Note:
If required, the significance of this new alarm can be read about in a more recent description of the Control Unit.

Remedy: - replace the firmware on the Terminal Module by an older firmware version (r0158).
- upgrade the firmware on the Control Unit (r0018).

236207 <location>Hub: Overtemperature component

Drive object: A_INF_828, B_INF_828, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE (OFF1, OFF2)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The temperature on the DRIVE-CLiQ Hub Module has exceeded the fault threshold.
Fault value (r0949, interpret decimal):
Actual temperature in 0.1 °C resolution.

Remedy: - check ambient temperature at component installation location.
- replace the component involved.

236211 <location>Hub: Overtemperature alarm component

Drive object: A_INF_828, B_INF_828, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The temperature on the DRIVE-CLiQ Hub Module has exceeded the alarm threshold.
Alarm value (r2124, interpret decimal):
Actual temperature in 0.1 °C resolution.

Remedy: - check ambient temperature at component installation location.
- replace the component involved.

236214 <location>Hub: overvoltage fault 24 V supply

Drive object: A_INF_828, B_INF_828, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE (OFF1, OFF2)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The 24 V power supply on the DRIVE-CLiQ Hub Module has exceeded the fault threshold.
Fault value (r0949, interpret decimal):
Actual operating voltage in 0.1 °C resolution

Remedy: - check the supply voltage of the component involved.
- replace the component involved.

236216 <location>Hub: undervoltage fault 24 V supply

Drive object: A_INF_828, B_INF_828, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE (OFF1, OFF2)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The 24 V power supply on the DRIVE-CLiQ Hub Module has undershot the fault threshold.
Fault value (r0949, interpret decimal):
Actual operating voltage in 0.1 °C resolution

Remedy: - check the supply voltage of the component involved.
- replace the component involved.

236217 <location>Hub: undervoltage alarm 24 V supply

Drive object: A_INF_828, B_INF_828, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The 24 V power supply on the DRIVE-CLiQ Hub Module has undershot the alarm threshold.
Alarm value (r2124, interpret decimal):
Actual operating voltage in 0.1 °C resolution

Remedy: - check the supply voltage of the component involved.
- replace the component involved.

236800 <location>Hub: Group signal

Drive object: A_INF_828, B_INF_828, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The DRIVE-CLiQ Hub Module has detected at least one fault.

Remedy: Evaluates other actual messages.

236801 <location>Hub DRIVE-CLiQ: Sign-of-life missing

Drive object: A_INF_828, B_INF_828, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: Component number: %1, fault cause: %2

Reaction: NONE

Acknowledge: NONE

Cause: A DRIVE-CLiQ communications error has occurred from the Control Unit to the DRIVE-CLiQ Hub Module involved.
Fault cause:
10 (= 0A hex):
The sign-of-life bit in the receive telegram is not set.
Note regarding the message value:
The individual information is coded as follows in the message value (r0949/r2124):
0000yyxx hex: yy = component number, xx = error cause

Remedy: - check the DRIVE-CLiQ connection.
- replace the component involved.

236802 <location>Hub: Time slice overflow

Drive object: A_INF_828, B_INF_828, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: A time slice overflow has occurred on the DRIVE-CLiQ Hub Module.
Fault value (r0949, interpret decimal):
xx: Time slice number xx

Remedy:

- reduce the current controller frequency.
- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade firmware to later version.
- contact Technical Support.

236804 <location>Hub: Checksum error

Drive object: A_INF_828, B_INF_828, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: A checksum error has occurred when reading out the program memory on the DRIVE-CLiQ Hub Module.
Fault value (r0949, interpret hexadecimal):
Difference between the checksum at POWER ON and the actual checksum.

Remedy:

- check whether the permissible ambient temperature for the component is maintained.
- replace the DRIVE-CLiQ Hub Module.

236805 <location>Hub: EEPROM checksum incorrect

Drive object: A_INF_828, B_INF_828, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY (POWER ON)

Cause: The internal parameter data on the DRIVE-CLiQ Hub Module is incorrect.
Alarm value (r2124, interpret hexadecimal):
01: EEPROM access error.
02: Too many blocks in the EEPROM.

Remedy:

- check whether the permissible ambient temperature for the component is maintained.
- replace the DRIVE-CLiQ Hub Module.

236820 <location>Hub DRIVE-CLiQ: Telegram error

Drive object: A_INF_828, B_INF_828, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: Component number: %1, fault cause: %2

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communications error has occurred from the Control Unit to the DRIVE-CLiQ Hub Module involved.

Fault cause:

1 (= 01 hex):

Checksum error (CRC error).

2 (= 02 hex):

Telegram is shorter than specified in the length byte or in the receive list.

3 (= 03 hex):

Telegram is longer than specified in the length byte or in the receive list.

4 (= 04 hex):

The length of the receive telegram does not match the receive list.

5 (= 05 hex):

The type of the receive telegram does not match the receive list.

6 (= 06 hex):

The address of the component in the telegram and in the receive list do not match.

7 (= 07 hex):

A SYNC telegram is expected - but the received telegram is not a SYNC telegram.

8 (= 08 hex):

No SYNC telegram is expected - but the received telegram is one.

9 (= 09 hex):

The error bit in the receive telegram is set.

16 (= 10 hex):

The receive telegram is too early.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy:

- carry out a POWER ON (switch-off/switch-on).
- check the electrical cabinet design and cable routing for EMC compliance
- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

236835 <location>Hub DRIVE-CLiQ: Cyclic data transfer error

Drive object: A_INF_828, B_INF_828, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: Component number: %1, fault cause: %2

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communications error has occurred from the Control Unit to the DRIVE-CLiQ Hub Module involved. The nodes do not send and receive in synchronism.

Fault cause:

33 (= 21 hex):

The cyclic telegram has not been received.

34 (= 22 hex):

Timeout in the telegram receive list.

64 (= 40 hex):

Timeout in the telegram send list.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy:

- carry out a POWER ON.
- replace the component involved.

236836 <location>Hub DRIVE-CLiQ: Send error for DRIVE-CLiQ data

Drive object: A_INF_828, B_INF_828, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: Component number: %1, fault cause: %2
Reaction: NONE
Acknowledge: IMMEDIATELY
Cause: A DRIVE-CLiQ communications error has occurred from the Control Unit to the DRIVE-CLiQ Hub Module involved. Data were not able to be sent.
 Fault cause:
 65 (= 41 hex):
 Telegram type does not match send list.
 Note regarding the message value:
 The individual information is coded as follows in the message value (r0949/r2124):
 0000yyxx hex: yy = component number, xx = error cause
Remedy: Carry out a POWER ON.

236837 <location>Hub DRIVE-CLiQ: Component fault

Drive object: A_INF_828, B_INF_828, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value: Component number: %1, fault cause: %2
Reaction: NONE
Acknowledge: IMMEDIATELY
Cause: Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded.
 Fault cause:
 32 (= 20 hex):
 Error in the telegram header.
 35 (= 23 hex):
 Receive error: The telegram buffer memory contains an error.
 66 (= 42 hex):
 Send error: The telegram buffer memory contains an error.
 67 (= 43 hex):
 Send error: The telegram buffer memory contains an error.
 Note regarding the message value:
 The individual information is coded as follows in the message value (r0949/r2124):
 0000yyxx hex: yy = component number, xx = error cause
Remedy: - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).
 - check the electrical cabinet design and cable routing for EMC compliance
 - if required, use another DRIVE-CLiQ socket (p9904).
 - replace the component involved.

236845 <location>Hub DRIVE-CLiQ: Cyclic data transfer error

Drive object: A_INF_828, B_INF_828, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI
Message value: Component number: %1, fault cause: %2
Reaction: NONE
Acknowledge: IMMEDIATELY
Cause: A DRIVE-CLiQ communications error has occurred from the Control Unit to the DRIVE-CLiQ Hub Module involved.
 Fault cause:
 11 (= 0B hex):
 Synchronization error during alternating cyclic data transfer.
 Note regarding the message value:
 The individual information is coded as follows in the message value (r0949/r2124):
 0000yyxx hex: yy = component number, xx = error cause
Remedy: Carry out a POWER ON.

236851 <location>Hub DRIVE-CLiQ (CU): Sign-of-life missing

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150

Message value: Component number: %1, fault cause: %2

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: DRIVE-CLiQ communication error from DRIVE-CLiQ Hub Module in question to Control Unit.

The DRIVE-CLiQ component did not set the sign-of-life to the Control Unit.

Fault cause:

10 (= 0A hex):

The sign-of-life bit in the receive telegram is not set.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy: Upgrade the firmware of the component involved.

236860 <location>Hub DRIVE-CLiQ (CU): Telegram error

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150

Message value: Component number: %1, fault cause: %2

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause:	DRIVE-CLiQ communication error from DRIVE-CLiQ Hub Module in question to Control Unit. Fault cause: 1 (= 01 hex): Checksum error (CRC error). 2 (= 02 hex): Telegram is shorter than specified in the length byte or in the receive list. 3 (= 03 hex): Telegram is longer than specified in the length byte or in the receive list. 4 (= 04 hex): The length of the receive telegram does not match the receive list. 5 (= 05 hex): The type of the receive telegram does not match the receive list. 6 (= 06 hex): The address of the power unit in the telegram and in the receive list do not match. 9 (= 09 hex): The DRIVE-CLiQ communication from the DRIVE-CLiQ component involved to the Control Unit signals that the supply voltage has failed. 16 (= 10 hex): The receive telegram is too early. 17 (= 11 hex): CRC error and the receive telegram is too early. 18 (= 12 hex): The telegram is shorter than that specified in the length byte or in the receive list and the receive telegram is too early. 19 (= 13 hex): The telegram is longer than that specified in the length byte or in the receive list and the receive telegram is too early. 20 (= 14 hex): The length of the receive telegram does not match the receive list and the receive telegram is too early. 21 (= 15 hex): The type of the receive telegram does not match the receive list and the receive telegram is too early. 22 (= 16 hex): The address of the power unit in the telegram and in the receive list does not match and the receive telegram is too early. 25 (= 19 hex): The error bit in the receive telegram is set and the receive telegram is too early. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON (switch-off/switch-on). - check the electrical cabinet design and cable routing for EMC compliance - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

236875 <location>HUB: power supply voltage failed

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF1 (OFF2)
Acknowledge:	IMMEDIATELY

Cause:	The DRIVE-CLiQ communication from the DRIVE-CLiQ component involved to the Control Unit signals that the supply voltage has failed. Fault cause: 9 (= 09 hex): The power supply voltage for the components has failed. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON (switch-off/switch-on). - check the power supply voltage wiring for the DRIVE-CLiQ component (interrupted cable, contacts, ...). - check the dimensioning of the power supply for the DRIVE-CLiQ component.

236885	<location>Hub DRIVE-CLiQ (CU): Cyclic data transfer error
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	Component number: %1, fault cause: %2
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	DRIVE-CLiQ communication error from DRIVE-CLiQ Hub Module in question to the Control Unit. The nodes do not send and receive in synchronism. Fault cause: 26 (= 1A hex): Sign-of-life bit in the receive telegram not set and the receive telegram is too early. 33 (= 21 hex): The cyclic telegram has not been received. 34 (= 22 hex): Timeout in the telegram receive list. 64 (= 40 hex): Timeout in the telegram send list. 98 (= 62 hex): Error at the transition to cyclic operation. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the supply voltage of the component involved. - carry out a POWER ON. - replace the component involved.

236886	<location>Hub DRIVE-CLiQ (CU): Error when sending DRIVE-CLiQ data
Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	Component number: %1, fault cause: %2
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	DRIVE-CLiQ communication error from DRIVE-CLiQ Hub Module in question to Control Unit. Data were not able to be sent. Fault cause: 65 (= 41 hex): Telegram type does not match send list. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON.

236887 <location>Hub DRIVE-CLiQ (CU): Component fault

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	Component number: %1, fault cause: %2
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	Fault detected on the DRIVE-CLiQ component (DRIVE-CLiQ Hub Module) involved. Faulty hardware cannot be excluded. Fault cause: 32 (= 20 hex): Error in the telegram header. 35 (= 23 hex): Receive error: The telegram buffer memory contains an error. 66 (= 42 hex): Send error: The telegram buffer memory contains an error. 67 (= 43 hex): Send error: The telegram buffer memory contains an error. 96 (= 60 hex): Response received too late during runtime measurement. 97 (= 61 hex): Time taken to exchange characteristic data too long. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...). - check the electrical cabinet design and cable routing for EMC compliance - if required, use another DRIVE-CLiQ socket (p9904). - replace the component involved.

236895 <location>Hub DRIVE-CLiQ (CU): Alternating cyclic data transfer error

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	Component number: %1, fault cause: %2
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	DRIVE-CLiQ communication error from DRIVE-CLiQ Hub Module in question to Control Unit. Fault cause: 11 (= 0B hex): Synchronization error during alternating cyclic data transfer. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON.

236896 <location>Hub DRIVE-CLiQ (CU): Inconsistent component properties

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150
Message value:	Component number: %1
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	The properties of the DRIVE-CLiQ component (DRIVE-CLiQ Hub Module), specified by the fault value, have changed in an incompatible fashion with respect to the properties when booted. One cause can be, e.g. that a DRIVE-CLiQ cable or DRIVE-CLiQ component has been replaced. Fault value (r0949, interpret decimal): Component number.

Remedy:

- carry out a POWER ON.
- when a component is replaced, the same component type and if possible the same firmware version should be used.
- when a cable is replaced, only cables whose length is the same as or as close as possible to the length of the original cables should be used (ensure compliance with the maximum cable length).

236899 <location>Hub: Unknown fault

Drive object: A_INF_828, B_INF_828, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: New message: %1

Reaction: Infeed: NONE (OFF1, OFF2)
Servo: NONE (IASC/DCBRK, OFF1, OFF2, OFF3, STOP2)
Hla: NONE (OFF1, OFF2, OFF3, STOP2)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: A fault occurred on the DRIVE-CLiQ Hub Module that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit.
Fault value (r0949, interpret decimal):
Fault number.
Note:
If required, the significance of this new fault can be read about in a more recent description of the Control Unit.

Remedy:

- replace the firmware on the DRIVE-CLiQ Hub Module with older firmware (r0158).
- upgrade the firmware on the Control Unit (r0018).

236950 <location>Hub: Internal software error

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2 (NONE)

Acknowledge: POWER ON

Cause: An internal software error has occurred.
Fault value (r0949, interpret decimal):
Information about the fault source.
Only for internal Siemens troubleshooting.

Remedy:

- if required, upgrade the firmware in the DRIVE-CLiQ Hub Module to a more recent version.
- contact Technical Support.

236999 <location>Hub: Unknown alarm

Drive object: A_INF_828, B_INF_828, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: New message: %1

Reaction: NONE

Acknowledge: NONE

Cause: An alarm occurred on the DRIVE-CLiQ Hub Module that cannot be interpreted by the Control Unit firmware. This can occur if the firmware on this component is more recent than the firmware on the Control Unit.
Alarm value (r2124, interpret decimal):
Alarm number.
Note:
If required, the significance of this new alarm can be read about in a more recent description of the Control Unit.

Remedy:

- replace the firmware on the DRIVE-CLiQ Hub Module with older firmware (r0158).
- upgrade the firmware on the Control Unit (r0018).

237001 <location>HF Damping Module: overcurrent

Drive object: SERVO_828, SERVO_COMBI

Message value: Fault cause: %1 bin

Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	The power unit has detected an overcurrent condition. - HF Choke Module or HF Damping Module defective. - Resonance frequency of the output filter was excited. Fault value (r0949, interpret bitwise binary): Bit 0: Phase U. Bit 1: Phase V. Bit 2: Phase W.
Remedy:	- check HF Choke Module and HF Damping Module and if required, replace. - reduce the motor power in the proximity of the fault-generating frequency. Note: HF Choke Module (reactor module) HF Damping Module

237002 <location>HF Damping Module: Damping voltage too high

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	The damping voltage has reached an inadmissibly high value. - a motor harmonic with a high amplitude has coincided with the resonance frequency of the output filter. - the current controller excessively excites the resonance of the output filter. Fault value (r0949, interpret decimal): Damping voltage in the case of a fault [mV]. See also: r5171 (HF damping voltage actual value)
Remedy:	- reduce the motor power in the proximity of the fault-generating frequency. - check the current controller and if required, adapt. - if required, use another motor. Note: HF Damping Module

237003 <location>HF Damping Module: Damping voltage not established

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	A damping voltage was not able to be established. Fault value (r0949, interpret decimal): Damping voltage in the case of a fault [mV].
Remedy:	Check the HF Damping Module wiring. See also: r5171 (HF damping voltage actual value)

237004 <location>HF Damping Module: Heat sink overtemperature

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY

Cause:	The temperature of the heat sink in the HF Damping Module has exceeded the permissible limit value. - insufficient cooling, fan failure. - overload. - ambient temperature too high. Fault value (r0949, interpret decimal): Temperature [0.01 °C].
Remedy:	- check whether the fan is running. - check the fan elements. - check whether the ambient temperature is in the permissible range. Notice: This fault can only be acknowledged after the alarm threshold for alarm A05000 has been undershot. Note: HF Damping Module

237005 <location>HF Damping Module: I2t overload

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	The filter capacitor of the HF Damping Module was overloaded (r5173 = 100 %). - the filter resonance frequency was excessively excited. - the HF Choke Module is defective. Fault value (r0949, interpret decimal): I2t [100 % = 16384].
Remedy:	- reduce the motor power in the proximity of the fault-generating frequency. - the system should not stay in a steady-state condition in the vicinity of the fault-generating frequency. - check the HF Choke Module and if required replace. Note: HF Choke Module (reactor module) HF Damping Module See also: r5173 (HF Damping Module I2t overload)

237012 <location>HF Damping Module: Heat sink temperature sensor wire breakage

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF1 (OFF2)
Acknowledge:	IMMEDIATELY
Cause:	The connection to one of the heat sink temperature sensors in the HF Damping Module is interrupted. Fault value (r0949, interpret binary): Bit 0: HF Damping Module Bit 1: HF Choke Module
Remedy:	Contact the manufacturer. Note: HF Choke Module (reactor module) HF Damping Module

237013 <location>HF Damping Module: Heat sink temperature sensor short-circuit

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF1 (OFF2)

Acknowledge: IMMEDIATELY

Cause: The heat sink temperature sensor in the HF Damping Module is short-circuited.
 Fault value (r0949, interpret binary):
 Bit 0: HF Damping Module
 Bit 1: HF Choke Module

Remedy: Contact the manufacturer.
 Note:
 HF Choke Module (reactor module)
 HF Damping Module

237024 **<location>HF Damping Module: Overtemperature thermal model**

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The temperature difference between the heat sink and chip has exceeded the permissible limit value.
 - the permissible load duty cycle was not maintained.
 - insufficient cooling, fan failure.
 - overload.
 - ambient temperature too high.
 - pulse frequency too high.
 See also: r0037

Remedy: - adapt the load duty cycle.
 - check whether the fan is running.
 - check the fan elements.
 - check whether the ambient temperature is in the permissible range.
 - check the motor load.
 - reduce the pulse frequency if this is higher than the rated pulse frequency.

237025 **<location>HF Damping Module: Chip overtemperature**

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The chip temperature has exceeded the permissible limit value.
 - the permissible load duty cycle was not maintained.
 - insufficient cooling, fan failure.
 - overload.
 - ambient temperature too high.
 - pulse frequency too high.
 Fault value (r0949, interpret decimal):
 Temperature difference between the heat sink and chip [0.01 °C].

Remedy: - adapt the load duty cycle.
 - check whether the fan is running.
 - check the fan elements.
 - check whether the ambient temperature is in the permissible range.
 - check the motor load.
 - reduce the pulse frequency if this is higher than the rated pulse frequency.
 Note:
 HF Damping Module
 See also: r0037

237034 <location>HF Damping Module: Internal overtemperature**Drive object:** SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:** NONE**Acknowledge:** NONE

Cause: The alarm threshold for internal overtemperature has been reached.
 If the temperature inside the unit continues to increase, fault F37036 may be triggered.

- ambient temperature might be too high.
- insufficient cooling, fan failure.

Fault value (r0949, interpret binary):
 Bit 0 = 1: Control electronics range.
 Bit 1 = 1: Power electronics range.

Remedy: - check the ambient temperature.
 - check the fan for the inside of the unit.

Note:

HF Damping Module

237036 <location>HF Damping Module: Internal overtemperature**Drive object:** SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:** OFF2**Acknowledge:** IMMEDIATELY

Cause: The temperature inside the HF Damping Module has exceeded the permissible temperature limit.

- insufficient cooling, fan failure.
- overload.
- ambient temperature too high.

Fault value (r0949, interpret binary):
 Bit 0 = 1: Control electronics range.
 Bit 1 = 1: Power electronics range.

Remedy: - check whether the fan is running.
 - check the fan elements.
 - check whether the ambient temperature is in the permissible range.

Notice:

This fault can only be acknowledged once the permissible temperature limit minus 5 K has been undershot.

Note:

HF Damping Module

237040 <location>HF Damping Module: 24 V undervoltage**Drive object:** SERVO_828, SERVO_COMBI**Message value:** %1**Reaction:** OFF2**Acknowledge:** IMMEDIATELY (POWER ON)

Cause: Failure of the 24 V power supply for the HF Damping Module.

- the undervoltage threshold was undershot for longer than 3 ms.

Fault value (r0949, interpret decimal):
 24 V voltage [0.1 V].

Remedy: - check the 24 V DC voltage supply of the HF Damping Module.
 - carry out a POWER ON (switch-off/switch-on) for the component.

Note:

HF Damping Module

237041 <location>HF Damping Module: 24 V undervoltage alarm

Drive object: SERVO_828, SERVO_COMBI
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: Fault in the 24 V power supply for the HF Damping Module.
- the 16 V threshold was undershot..
Alarm value (r2124, interpret decimal):
24 V voltage [0.1 V].
Remedy: - check the 24 V DC voltage supply of the HF Damping Module.
- carry out a POWER ON (switch-off/switch-on) for the component.
Note:
HF Damping Module

237043 <location>HF Damping Module: 24 V overvoltage

Drive object: SERVO_828, SERVO_COMBI
Message value: -
Reaction: OFF2
Acknowledge: POWER ON
Cause: Overvoltage of the 24 V power supply for the HF Damping Module.
- the 31.5 V threshold was exceeded for more than 3 ms.
Remedy: Check the 24 V DC voltage supply of the HF Damping Module.
Note:
HF Damping Module

237044 <location>HF Damping Module: 24 V overvoltage alarm

Drive object: SERVO_828, SERVO_COMBI
Message value: -
Reaction: NONE
Acknowledge: NONE
Cause: Fault in the 24 V power supply for the HF Damping Module.
- the 32.0 V threshold was exceeded.
Remedy: Check the 24 V DC voltage supply of the HF Damping Module.
Note:
HF Damping Module

237045 <location>HF Damping Module: Supply undervoltage

Drive object: SERVO_828, SERVO_COMBI
Message value: %1
Reaction: OFF2
Acknowledge: IMMEDIATELY (POWER ON)
Cause: Power supply fault in the HF Damping Module.
- the voltage monitor signals an undervoltage fault on the module.
Fault value (r0949, interpret decimal):
24 V voltage [0.1 V].

Remedy:

- check the 24 V DC voltage supply of the HF Damping Module.
- carry out a POWER ON (switch-off/switch-on) for the component.
- replace the module if necessary.

Note:

HF Damping Module

237049 <location>HF Damping Module: Internal fan defective

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The internal fan of the HF Damping Module has failed.

Remedy: Check the internal fan of the HF Damping Module and replace if necessary.

237050 <location>HF Damping Module: 24 V overvoltage fault

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: POWER ON

Cause: The voltage monitor signals an overvoltage fault on the module.

Remedy:

- check the 24 V power supply.
- replace the module if necessary.

237052 <location>HF Damping Module: EEPROM data error

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: POWER ON

Cause: EEPROM data error of the HF Damping Module.
 Fault value (r0949, interpret hexadecimal):
 0: The EEPROM data read in from the HF Damping Module is inconsistent.
 1: EEPROM data is not compatible to the firmware of the HF Damping Module.
 Additional values:
 Only for internal Siemens troubleshooting.

Remedy: For fault value = 0:
 Replace the HF Damping Module or update the EEPROM data.
 For fault value = 1:
 If necessary, upgrade the firmware to a later version.
 Note:
 HF Damping Module

237056 <location>HF Damping Module: Heat sink overtemperature

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The temperature of the HF Damping Module heat sink has exceeded the permissible limit value.
 - insufficient cooling, fan failure.
 - overload.
 - ambient temperature too high.
 Alarm value (r2124, interpret decimal):
 Temperature [0.01 °C].

Remedy: - check whether the fan is running.
 - check the fan elements.
 - check whether the ambient temperature is in the permissible range.

Notice:
 This fault can only be acknowledged after the alarm threshold for alarm A05000 has been undershot.

Note:
 HF Damping Module

237310 <location>HF Choke Module: Overtemperature

Drive object: SERVO_828, SERVO_COMBI
Message value: %1
Reaction: NONE
Acknowledge: NONE

Cause: The temperature of the HF Choke Module heat sink has exceeded the permissible limit value.
 - insufficient cooling, fan failure.
 - overload.
 - ambient temperature too high.
 Alarm value (r2124, interpret decimal):
 Temperature [0.01 °C].

Remedy: - check whether the fan is running.
 - check the fan elements.
 - check whether the ambient temperature is in the permissible range.

Notice:
 This fault can only be acknowledged after the alarm threshold for alarm A05000 has been undershot.

Note:
 HF Choke Module (reactor module)

237311 <location>HF Choke Module: Heat sink overtemperature

Drive object: SERVO_828, SERVO_COMBI
Message value: %1
Reaction: OFF2
Acknowledge: IMMEDIATELY

Cause: The temperature of the HF Choke Module heat sink has exceeded the permissible limit value.
 - insufficient cooling, fan failure.
 - overload.
 - ambient temperature too high.
 Fault value (r0949, interpret decimal):
 Temperature [0.01 °C].

Remedy:

- check whether the fan is running.
- check the fan elements.
- check whether the ambient temperature is in the permissible range.
- check the motor load.

Notice:
This fault can only be acknowledged after this alarm threshold for alarm A05000 has been undershot.

Note:
HF Choke Module (reactor module)

237312 <location>HF Choke Module: Overtemperature or fan failure

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The HF Choke Module signals an overtemperature or fan failure.
Fault F37313 is output if the alarm is present for longer than 30 s.

Remedy:

- the cable between the HF Choke Module and the HF Damping Module has been withdrawn or is defective (X21).
- check the fan of the HF Choke Module and replace if necessary.
- check whether the ambient temperature is in the permissible range.

Note:
HF Choke Module (reactor module)
HF Damping Module

237313 <location>HF Choke Module: Overtemperature or fan failure

Drive object: SERVO_828, SERVO_COMBI

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY (POWER ON)

Cause: Alarm A37312 to display overtemperature or fan failure in the HF Choke Module was signaled for longer than 30 s.

Remedy:

- the cable between the HF Choke Module and the HF Damping Module has been withdrawn or is defective (X21).
- check the fan of the HF Choke Module and replace if necessary.
- check whether the ambient temperature is in the permissible range.

Note:
HF Choke Module (reactor module)
HF Damping Module

237502 <location>HF Damping Module: Damping voltage too high

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: The damping voltage has exceeded the alarm threshold.

- a motor harmonic with a high amplitude has coincided with the resonance frequency of the output filter.
- the current controller excessively excites the resonance of the output filter.

If the damping voltage exceeds an inadmissibly high value, F37002 is output.

Alarm value (r2124, interpret decimal):
Damping voltage in the case of a fault [mV].
See also: r5171 (HF damping voltage actual value)

Remedy:

- reduce the motor power in the proximity of the fault-generating frequency.
- check the current controller and if required, adapt.
- if required, use another motor.

Note:
HF Damping Module

237800 <location>HF Damping Module: Group signal

Drive object: SERVO_828, SERVO_COMBI
Message value: -
Reaction: NONE
Acknowledge: NONE
Cause: The HF Damping Module has detected at least one fault.
Remedy: Evaluates other actual messages.

237801 <location>HF Damping Module: Sign-of-life missing

Drive object: SERVO_828, SERVO_COMBI
Message value: Component number: %1, fault cause: %2
Reaction: NONE
Acknowledge: NONE
Cause: There is a DRIVE-CLiQ communication error between the Control Unit and the HF Damping Module.
Fault cause:
10 (= 0A hex):
The sign-of-life bit in the receive telegram is not set.
Note regarding the message value:
The individual information is coded as follows in the message value (r0949/r2124):
0000yyxx hex: yy = component number, xx = error cause
Remedy:

- check the DRIVE-CLiQ connection.
- replace the component involved.

Note:
HF Damping Module

237802 <location>HF Damping Module: time slice overflow

Drive object: SERVO_828, SERVO_COMBI
Message value: -
Reaction: OFF2
Acknowledge: IMMEDIATELY
Cause: A time slice overflow has occurred.
Remedy:

- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade firmware to later version.
- contact Technical Support.

237804 <location>HF Damping Module: CRC

Drive object: SERVO_828, SERVO_COMBI
Message value: %1
Reaction: OFF2 (OFF1, OFF3)
Acknowledge: IMMEDIATELY
Cause: A checksum error (CRC error) has occurred for the HF Damping Module.

Remedy:

- carry out a POWER ON (switch-off/switch-on) for all components.
- upgrade firmware to later version.
- contact Technical Support.

Note:
HF Damping Module

237805 <location>HF Damping Module: EEPROM checksum incorrect

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: Internal parameter data is corrupted.
Fault value (r0949, interpret hexadecimal):
01: EEPROM access error.
02: Too many blocks in the EEPROM.

Remedy: Replace the module.

Note:
HF Damping Module

237820 <location>HF Damping Module: Telegram error

Drive object: SERVO_828, SERVO_COMBI

Message value: Component number: %1, fault cause: %2

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communication error has occurred from the Control Unit to the damping module.
Fault cause:
1 (= 01 hex):
Checksum error (CRC error).
2 (= 02 hex):
Telegram is shorter than specified in the length byte or in the receive list.
3 (= 03 hex):
Telegram is longer than specified in the length byte or in the receive list.
4 (= 04 hex):
The length of the receive telegram does not match the receive list.
5 (= 05 hex):
The type of the receive telegram does not match the receive list.
6 (= 06 hex):
The address of the component in the telegram and in the receive list do not match.
7 (= 07 hex):
A SYNC telegram is expected - but the received telegram is not a SYNC telegram.
8 (= 08 hex):
No SYNC telegram is expected - but the received telegram is one.
9 (= 09 hex):
The error bit in the receive telegram is set.
16 (= 10 hex):
The receive telegram is too early.
Note regarding the message value:
The individual information is coded as follows in the message value (r0949/r2124):
0000yyxx hex: yy = component number, xx = error cause

Remedy:

- carry out a POWER ON (switch-off/switch-on).
- check the electrical cabinet design and cable routing for EMC compliance
- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

Note:

HF Damping Module

237835 <location>HF Damping Module: Cyclic data transmission error

Drive object: SERVO_828, SERVO_COMBI

Message value: Component number: %1, fault cause: %2

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: There is a DRIVE-CLiQ communication error between the Control Unit and the HF Damping Module. The nodes do not send and receive in synchronism.

Fault cause:

33 (= 21 hex):

The cyclic telegram has not been received.

34 (= 22 hex):

Timeout in the telegram receive list.

64 (= 40 hex):

Timeout in the telegram send list.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy:

- carry out a POWER ON.
- replace the component involved.

Note:

HF Damping Module

237836 <location>HF Damping Module: Send error for DRIVE-CLiQ data

Drive object: SERVO_828, SERVO_COMBI

Message value: Component number: %1, fault cause: %2

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: There is a DRIVE-CLiQ communication error between the Control Unit and the HF Damping Module. Data were not able to be sent.

Fault cause:

65 (= 41 hex):

Telegram type does not match send list.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy: Carry out a POWER ON.

Note:

HF Damping Module

237837 <location>HF Damping Module: Component faulted

Drive object: SERVO_828, SERVO_COMBI

Message value: Component number: %1, fault cause: %2

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause:	Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded. Fault cause: 32 (= 20 hex): Error in the telegram header. 35 (= 23 hex): Receive error: The telegram buffer memory contains an error. 66 (= 42 hex): Send error: The telegram buffer memory contains an error. 67 (= 43 hex): Send error: The telegram buffer memory contains an error. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...). - check the electrical cabinet design and cable routing for EMC compliance - if required, use another DRIVE-CLiQ socket (p9904). - replace the component involved. Note: HF Damping Module

237845 <location>HF Damping Module: Cyclic data transmission error

Drive object:	SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	There is a DRIVE-CLiQ communication error between the Control Unit and the HF Damping Module. Fault cause: 11 (= 0B hex): Synchronization error during alternating cyclic data transfer. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON. Note: HF Damping Module

237850 <location>HF Damping Module: Internal software error

Drive object:	SERVO_828, SERVO_COMBI
Message value:	%1
Reaction:	OFF1 (NONE, OFF2, OFF3)
Acknowledge:	POWER ON
Cause:	An internal software error in the HF Damping Module has occurred. Fault value (r0949, interpret decimal): Only for internal Siemens troubleshooting.
Remedy:	- Replace the HF Damping Module - if required, upgrade the firmware in the HF Damping Module. - contact Technical Support. Note: HF Damping Module

237851 <location>HF Damping Module (CU): Sign-of-life missing**Drive object:** SERVO_828, SERVO_COMBI**Message value:** Component number: %1, fault cause: %2**Reaction:** NONE**Acknowledge:** IMMEDIATELY**Cause:** DRIVE-CLiQ communication error from the HF Damping Module to the Control Unit.

The DRIVE-CLiQ component did not set the sign-of-life to the Control Unit.

Fault cause:

10 (= 0A hex):

The sign-of-life bit in the receive telegram is not set.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy: Upgrade the firmware of the component involved.

Note:

HF Damping Module

237860 <location>HF Damping Module (CU): Telegram error**Drive object:** SERVO_828, SERVO_COMBI**Message value:** Component number: %1, fault cause: %2**Reaction:** NONE**Acknowledge:** IMMEDIATELY

Cause:	DRIVE-CLiQ communication error from the HF Damping Module to the Control Unit. Fault cause: 1 (= 01 hex): Checksum error (CRC error). 2 (= 02 hex): Telegram is shorter than specified in the length byte or in the receive list. 3 (= 03 hex): Telegram is longer than specified in the length byte or in the receive list. 4 (= 04 hex): The length of the receive telegram does not match the receive list. 5 (= 05 hex): The type of the receive telegram does not match the receive list. 6 (= 06 hex): The address of the power unit in the telegram and in the receive list do not match. 9 (= 09 hex): The DRIVE-CLiQ communication from the DRIVE-CLiQ component involved to the Control Unit signals that the supply voltage has failed. 16 (= 10 hex): The receive telegram is too early. 17 (= 11 hex): CRC error and the receive telegram is too early. 18 (= 12 hex): The telegram is shorter than that specified in the length byte or in the receive list and the receive telegram is too early. 19 (= 13 hex): The telegram is longer than that specified in the length byte or in the receive list and the receive telegram is too early. 20 (= 14 hex): The length of the receive telegram does not match the receive list and the receive telegram is too early. 21 (= 15 hex): The type of the receive telegram does not match the receive list and the receive telegram is too early. 22 (= 16 hex): The address of the power unit in the telegram and in the receive list does not match and the receive telegram is too early. 25 (= 19 hex): The error bit in the receive telegram is set and the receive telegram is too early. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON (switch-off/switch-on). - check the electrical cabinet design and cable routing for EMC compliance - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...). Note: HF Damping Module

237875 <location>HF Damping Module: power supply voltage failed

Drive object:	SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF1 (OFF2)
Acknowledge:	IMMEDIATELY

Cause:	The DRIVE-CLiQ communication from the DRIVE-CLiQ component involved to the Control Unit signals that the supply voltage has failed. Fault cause: 9 (= 09 hex): The power supply voltage for the components has failed. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON (switch-off/switch-on). - check the power supply voltage wiring for the DRIVE-CLiQ component (interrupted cable, contacts, ...). - check the dimensioning of the power supply for the DRIVE-CLiQ component.

237885 <location>HF Damping Module (CU): Cyclic data transmission error

Drive object:	SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	DRIVE-CLiQ communication error from the damping module to the Control Unit. The nodes do not send and receive in synchronism. Fault cause: 26 (= 1A hex): Sign-of-life bit in the receive telegram not set and the receive telegram is too early. 33 (= 21 hex): The cyclic telegram has not been received. 34 (= 22 hex): Timeout in the telegram receive list. 64 (= 40 hex): Timeout in the telegram send list. 98 (= 62 hex): Error at the transition to cyclic operation. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the supply voltage of the component involved. - carry out a POWER ON. - replace the component involved. Note: HF Damping Module

237886 <location>HF Damping Module (CU): Error when sending DRIVE-CLiQ data

Drive object:	SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	NONE
Acknowledge:	IMMEDIATELY

Cause:	DRIVE-CLiQ communication error from the HF Damping Module to the Control Unit. Data were not able to be sent. Fault cause: 65 (= 41 hex): Telegram type does not match send list. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON. Note: HF Damping Module

237887 <location>HF Damping Module (CU): Component faulted

Drive object:	SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	NONE
Acknowledge:	IMMEDIATELY
Cause:	Fault detected on the DRIVE-CLiQ component (HF Damping Module) involved. Faulty hardware cannot be excluded. Fault cause: 32 (= 20 hex): Error in the telegram header. 35 (= 23 hex): Receive error: The telegram buffer memory contains an error. 66 (= 42 hex): Send error: The telegram buffer memory contains an error. 67 (= 43 hex): Send error: The telegram buffer memory contains an error. 96 (= 60 hex): Response received too late during runtime measurement. 97 (= 61 hex): Time taken to exchange characteristic data too long. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...). - check the electrical cabinet design and cable routing for EMC compliance - if required, use another DRIVE-CLiQ socket (p9904). - replace the component involved. Note: HF Damping Module

237895 <location>HF Damping Module (CU): Alternating cyclic data transmission error

Drive object:	SERVO_828, SERVO_COMBI
Message value:	Component number: %1, fault cause: %2
Reaction:	NONE
Acknowledge:	IMMEDIATELY

Cause: DRIVE-CLiQ communication error from the HF Damping Module to the Control Unit.

Fault cause:

11 (= 0B hex):

Synchronization error during alternating cyclic data transfer.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy: Carry out a POWER ON.

Note:

HF Damping Module

237896 <location>HF Damping Module (CU): Component properties inconsistent

Drive object: SERVO_828, SERVO_COMBI

Message value: Component number: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: The properties of the DRIVE-CLiQ component (HF Damping Module), specified by the fault value, have changed in an incompatible fashion with respect to the properties when booted. One cause can be, e.g. that a DRIVE-CLiQ component has been replaced.

Fault value (r0949, interpret decimal):

Component number.

Remedy: - carry out a POWER ON.

- when a component is replaced, the same component type and if possible the same firmware version should be used.

- when a cable is replaced, only cables whose length is the same as or as close as possible to the length of the original cables should be used (ensure compliance with the maximum cable length).

Note:

HF Damping Module

237899 <location>HF Damping Module: Unknown fault

Drive object: SERVO_828, SERVO_COMBI

Message value: New message: %1

Reaction: NONE (IASC/DCBRK, OFF1, OFF2, OFF3, STOP2)

Acknowledge: IMMEDIATELY (POWER ON)

Cause: A fault has occurred on the HF Damping Module that cannot be interpreted by the Control Unit firmware.

This can occur if the firmware on this component is more recent than the firmware on the Control Unit.

Fault value (r0949, interpret decimal):

Fault number.

Note:

If required, the significance of this new fault can be read about in a more recent description of the Control Unit.

Remedy: - replace the firmware on the HF Damping Module by an older firmware version (r0168).

- upgrade the firmware on the Control Unit (r0018).

Note:

HF Damping Module

237903 <location>HF Damping Module: I2C bus error occurred

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE (IASC/DCBRK, OFF1, OFF2, OFF3, STOP2)

Acknowledge: IMMEDIATELY

Cause: Communications error with an EEPROM or an analog/digital converter.

Fault value (r0949, interpret hexadecimal):

80000000 hex:

- internal software error.

00000001 hex ... 0000FFFF hex:

- module fault.

Remedy: For fault value = 80000000 hex:

- upgrade firmware to later version.

For fault value = 00000001 hex ... 0000FFFF hex:

- replace the module.

Note:

HF Damping Module

237950 <location>HF Damping Module: Internal software error

Drive object: SERVO_828, SERVO_COMBI

Message value: %1

Reaction: OFF2

Acknowledge: POWER ON

Cause: An internal software error has occurred.

Fault value (r0949, interpret decimal):

Information about the fault source.

Only for internal Siemens troubleshooting.

Remedy: - if necessary, upgrade the firmware in the HF Damping Module to a later version.

- contact Technical Support.

Note:

HF Damping Module

237999 <location>HF Damping Module: Unknown alarm

Drive object: SERVO_828, SERVO_COMBI

Message value: New message: %1

Reaction: NONE

Acknowledge: NONE

Cause: An alarm has occurred on the HF Damping Module that cannot be interpreted by the Control Unit firmware.

This can occur if the firmware on this component is more recent than the firmware on the Control Unit.

Alarm value (r2124, interpret decimal):

Alarm number.

Note:

If required, the significance of this new alarm can be read about in a more recent description of the Control Unit.

Remedy: - replace the firmware on the HF Damping Module by an older firmware version (r0168).

- upgrade the firmware on the Control Unit (r0018).

Note:

HF Damping Module

240000 <location>Fault at DRIVE-CLiQ socket X100

Drive object: All objects

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: A fault has occurred at the drive object at the DRIVE-CLiQ socket X100.
Fault value (r0949, interpret decimal):
First fault that has occurred for this drive object.

Remedy: Evaluate the fault buffer of the specified object.

240001 <location>Fault at DRIVE-CLiQ socket X101

Drive object: All objects

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: A fault has occurred at the drive object at the DRIVE-CLiQ socket X101.
Fault value (r0949, interpret decimal):
First fault that has occurred for this drive object.

Remedy: Evaluate the fault buffer of the specified object.

240002 <location>Fault at DRIVE-CLiQ socket X102

Drive object: All objects

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: A fault has occurred at the drive object at the DRIVE-CLiQ socket X102.
Fault value (r0949, interpret decimal):
First fault that has occurred for this drive object.

Remedy: Evaluate the fault buffer of the specified object.

240003 <location>Fault at DRIVE-CLiQ socket X103

Drive object: All objects

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: A fault has occurred at the drive object at the DRIVE-CLiQ socket X103.
Fault value (r0949, interpret decimal):
First fault that has occurred for this drive object.

Remedy: Evaluate the fault buffer of the specified object.

240004 <location>Fault at DRIVE-CLiQ socket X104

Drive object: All objects

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY

Cause: A fault has occurred at the drive object at the DRIVE-CLiQ socket X104.
Fault value (r0949, interpret decimal):
First fault that has occurred for this drive object.

Remedy: Evaluate the fault buffer of the specified object.

240005 <location>Fault at DRIVE-CLiQ socket X105

Drive object: All objects

Message value: %1

Reaction: NONE

Acknowledge: IMMEDIATELY
Cause: A fault has occurred at the drive object at the DRIVE-CLiQ socket X105.
 Fault value (r0949, interpret decimal):
 First fault that has occurred for this drive object.
Remedy: Evaluate the fault buffer of the specified object.

240100 <location>Alarm at DRIVE-CLiQ socket X100

Drive object: All objects
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: An alarm has occurred at the drive object at the DRIVE-CLiQ socket X100.
 Alarm value (r2124, interpret decimal):
 First alarm that has occurred for this drive object.
Remedy: Evaluate the alarm buffer of the specified object.

240101 <location>Alarm at DRIVE-CLiQ socket X101

Drive object: All objects
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: An alarm has occurred at the drive object at the DRIVE-CLiQ socket X101.
 Alarm value (r2124, interpret decimal):
 First alarm that has occurred for this drive object.
Remedy: Evaluate the alarm buffer of the specified object.

240102 <location>Alarm at DRIVE-CLiQ socket X102

Drive object: All objects
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: An alarm has occurred at the drive object at the DRIVE-CLiQ socket X102.
 Alarm value (r2124, interpret decimal):
 First alarm that has occurred for this drive object.
Remedy: Evaluate the alarm buffer of the specified object.

240103 <location>Alarm at DRIVE-CLiQ socket X103

Drive object: All objects
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: An alarm has occurred at the drive object at the DRIVE-CLiQ socket X103.
 Alarm value (r2124, interpret decimal):
 First alarm that has occurred for this drive object.
Remedy: Evaluate the alarm buffer of the specified object.

240104 <location>Alarm at DRIVE-CLiQ socket X104

Drive object: All objects
Message value: %1

Reaction: NONE
Acknowledge: NONE
Cause: An alarm has occurred at the drive object at the DRIVE-CLiQ socket X104.
Alarm value (r2124, interpret decimal):
First alarm that has occurred for this drive object.
Remedy: Evaluate the alarm buffer of the specified object.

240105 **<location>Alarm at DRIVE-CLiQ socket X105**
Drive object: All objects
Message value: %1
Reaction: NONE
Acknowledge: NONE
Cause: An alarm has occurred at the drive object at the DRIVE-CLiQ socket X105.
Alarm value (r2124, interpret decimal):
First alarm that has occurred for this drive object.
Remedy: Evaluate the alarm buffer of the specified object.

240799 **<location>CX32: Configured transfer end time exceeded**
Drive object: All objects
Message value: -
Reaction: NONE
Acknowledge: IMMEDIATELY
Cause: The configured transfer end time when transferring the cyclic actual values was exceeded.
Remedy: - carry out a POWER ON (switch-off/switch-on) for all components.
- contact Technical Support.

240801 **<location>CX32 DRIVE-CLiQ: Sign-of-life missing**
Drive object: All objects
Message value: Component number: %1, fault cause: %2
Reaction: OFF2
Acknowledge: IMMEDIATELY
Cause: A DRIVE-CLiQ communications error has occurred from the Control Unit to the controller extension involved.
Fault cause:
10 (= 0A hex):
The sign-of-life bit in the receive telegram is not set.
Note regarding the message value:
The individual information is coded as follows in the message value (r0949/r2124):
0000yyxx hex: yy = component number, xx = error cause
Remedy: - carry out a POWER ON (switch-off/switch-on).
- replace the component involved.

240820 **<location>CX32 DRIVE-CLiQ: Telegram error**
Drive object: All objects
Message value: Component number: %1, fault cause: %2
Reaction: OFF2
Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communications error has occurred from the Control Unit to the controller extension involved.

Fault cause:

1 (= 01 hex):

Checksum error (CRC error).

2 (= 02 hex):

Telegram is shorter than specified in the length byte or in the receive list.

3 (= 03 hex):

Telegram is longer than specified in the length byte or in the receive list.

4 (= 04 hex):

The length of the receive telegram does not match the receive list.

5 (= 05 hex):

The type of the receive telegram does not match the receive list.

6 (= 06 hex):

The address of the component in the telegram and in the receive list do not match.

7 (= 07 hex):

A SYNC telegram is expected - but the received telegram is not a SYNC telegram.

8 (= 08 hex):

No SYNC telegram is expected - but the received telegram is one.

9 (= 09 hex):

The error bit in the receive telegram is set.

16 (= 10 hex):

The receive telegram is too early.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy:

- carry out a POWER ON (switch-off/switch-on).
- check the electrical cabinet design and cable routing for EMC compliance
- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

240825 <location>CX32 DRIVE-CLiQ: Supply voltage failed

Drive object: All objects

Message value: Component number: %1, fault cause: %2

Reaction: OFF1 (OFF2)

Acknowledge: IMMEDIATELY

Cause: The DRIVE-CLiQ communication from the DRIVE-CLiQ component involved to the Control Unit signals that the supply voltage has failed.

Fault cause:

9 (= 09 hex):

The power supply voltage for the components has failed.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy:

- carry out a POWER ON (switch-off/switch-on).
- check the supply voltage wiring of the DRIVE-CLiQ component (interrupted cable, contacts, ...).
- check the dimensioning of the DRIVE-CLiQ component power supply.

240835 <location>CX32 DRIVE-CLiQ: Cyclic data transfer error

Drive object: All objects

Message value: Component number: %1, fault cause: %2

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause:	A DRIVE-CLiQ communications error has occurred from the Control Unit to the controller extension involved. The nodes do not send and receive in synchronism. Fault cause: 33 (= 21 hex): The cyclic telegram has not been received. 34 (= 22 hex): Timeout in the telegram receive list. 64 (= 40 hex): Timeout in the telegram send list. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON (switch-off/switch-on). - replace the component involved.

240836 <location>CX32 DRIVE-CLiQ: Send error for DRIVE-CLiQ data

Drive object:	All objects
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	A DRIVE-CLiQ communications error has occurred from the Control Unit to the controller extension involved. Data were not able to be sent. Fault cause: 65 (= 41 hex): Telegram type does not match send list. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	Carry out a POWER ON (switch-off/switch-on).

240837 <location>CX32 DRIVE-CLiQ: Component fault

Drive object:	All objects
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF2
Acknowledge:	IMMEDIATELY
Cause:	Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded. Fault cause: 32 (= 20 hex): Error in the telegram header. 35 (= 23 hex): Receive error: The telegram buffer memory contains an error. 66 (= 42 hex): Send error: The telegram buffer memory contains an error. 67 (= 43 hex): Send error: The telegram buffer memory contains an error. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause

Remedy:

- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).
- check the electrical cabinet design and cable routing for EMC compliance
- if required, use another DRIVE-CLiQ socket (p9904).
- replace the component involved.

240845 <location>CX32 DRIVE-CLiQ: Cyclic data transfer error

Drive object: All objects

Message value: Component number: %1, fault cause: %2

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communications error has occurred from the Control Unit to the controller extension involved.
 Fault cause:
 11 (= 0B hex):
 Synchronization error during alternating cyclic data transfer.
 Note regarding the message value:
 The individual information is coded as follows in the message value (r0949/r2124):
 0000yyxx hex: yy = component number, xx = error cause

Remedy: Carry out a POWER ON (switch-off/switch-on).

240851 <location>CX32 DRIVE-CLiQ (CU): Sign-of-life missing

Drive object: All objects

Message value: Component number: %1, fault cause: %2

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communications error has occurred from the controller extension involved to the Control Unit.
 The DRIVE-CLiQ component did not set the sign-of-life to the Control Unit.
 Fault cause:
 10 (= 0A hex):
 The sign-of-life bit in the receive telegram is not set.
 Note regarding the message value:
 The individual information is coded as follows in the message value (r0949/r2124):
 0000yyxx hex: yy = component number, xx = error cause

Remedy: Upgrade the firmware of the component involved.

240860 <location>CX32 DRIVE-CLiQ (CU): Telegram error

Drive object: All objects

Message value: Component number: %1, fault cause: %2

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause:	A DRIVE-CLiQ communications error has occurred from the controller extension involved to the Control Unit. Fault cause: 1 (= 01 hex): Checksum error (CRC error). 2 (= 02 hex): Telegram is shorter than specified in the length byte or in the receive list. 3 (= 03 hex): Telegram is longer than specified in the length byte or in the receive list. 4 (= 04 hex): The length of the receive telegram does not match the receive list. 5 (= 05 hex): The type of the receive telegram does not match the receive list. 6 (= 06 hex): The address of the power unit in the telegram and in the receive list do not match. 9 (= 09 hex): The error bit in the receive telegram is set. 16 (= 10 hex): The receive telegram is too early. 17 (= 11 hex): CRC error and the receive telegram is too early. 18 (= 12 hex): The telegram is shorter than that specified in the length byte or in the receive list and the receive telegram is too early. 19 (= 13 hex): The telegram is longer than that specified in the length byte or in the receive list and the receive telegram is too early. 20 (= 14 hex): The length of the receive telegram does not match the receive list and the receive telegram is too early. 21 (= 15 hex): The type of the receive telegram does not match the receive list and the receive telegram is too early. 22 (= 16 hex): The address of the power unit in the telegram and in the receive list does not match and the receive telegram is too early. 25 (= 19 hex): The error bit in the receive telegram is set and the receive telegram is too early. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause
Remedy:	- carry out a POWER ON (switch-off/switch-on). - check the electrical cabinet design and cable routing for EMC compliance - check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).

240875 <location>CX32 DRIVE-CLiQ (CU): Supply voltage failed

Drive object:	All objects
Message value:	Component number: %1, fault cause: %2
Reaction:	OFF1 (OFF2)
Acknowledge:	IMMEDIATELY
Cause:	The DRIVE-CLiQ communication from the DRIVE-CLiQ component involved to the Control Unit signals that the supply voltage has failed. Fault cause: 9 (= 09 hex): The power supply voltage for the components has failed. Note regarding the message value: The individual information is coded as follows in the message value (r0949/r2124): 0000yyxx hex: yy = component number, xx = error cause

Remedy:

- carry out a POWER ON (switch-off/switch-on).
- check the supply voltage wiring of the DRIVE-CLiQ component (interrupted cable, contacts, ...).
- check the dimensioning of the DRIVE-CLiQ component power supply.

240885 <location>CX32 DRIVE-CLiQ (CU): Cyclic data transfer error

Drive object: All objects

Message value: Component number: %1, fault cause: %2

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communications error has occurred from the controller extension involved to the Control Unit.
The nodes do not send and receive in synchronism.
Fault cause:
26 (= 1A hex):
Sign-of-life bit in the receive telegram not set and the receive telegram is too early.
33 (= 21 hex):
The cyclic telegram has not been received.
34 (= 22 hex):
Timeout in the telegram receive list.
64 (= 40 hex):
Timeout in the telegram send list.
98 (= 62 hex):
Error at the transition to cyclic operation.
Note regarding the message value:
The individual information is coded as follows in the message value (r0949/r2124):
0000yyxx hex: yy = component number, xx = error cause

Remedy:

- check the power supply voltage of the component involved.
- carry out a POWER ON (switch-off/switch-on).
- replace the component involved.

240886 <location>CX32 DRIVE-CLiQ (CU): Error when sending DRIVE-CLiQ data

Drive object: All objects

Message value: Component number: %1, fault cause: %2

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communications error has occurred from the controller extension involved to the Control Unit.
Data were not able to be sent.
Fault cause:
65 (= 41 hex):
Telegram type does not match send list.
Note regarding the message value:
The individual information is coded as follows in the message value (r0949/r2124):
0000yyxx hex: yy = component number, xx = error cause

Remedy: Carry out a POWER ON (switch-off/switch-on).

240887 <location>CX32 DRIVE-CLiQ (CU): Component fault

Drive object: All objects

Message value: Component number: %1, fault cause: %2

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: Fault detected on the DRIVE-CLiQ component concerned. Faulty hardware cannot be excluded.

Fault cause:

32 (= 20 hex):

Error in the telegram header.

35 (= 23 hex):

Receive error: The telegram buffer memory contains an error.

66 (= 42 hex):

Send error: The telegram buffer memory contains an error.

67 (= 43 hex):

Send error: The telegram buffer memory contains an error.

96 (= 60 hex):

Response received too late during runtime measurement.

97 (= 61 hex):

Time taken to exchange characteristic data too long.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy:

- check the DRIVE-CLiQ wiring (interrupted cable, contacts, ...).
- check the electrical cabinet design and cable routing for EMC compliance
- if required, use another DRIVE-CLiQ socket (p9904).
- replace the component involved.

240895 <location>CX32 DRIVE-CLiQ (CU): Cyclic data transfer error

Drive object: All objects

Message value: Component number: %1, fault cause: %2

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: A DRIVE-CLiQ communications error has occurred from the controller extension involved to the Control Unit.

Fault cause:

11 (= 0B hex):

Synchronization error during alternating cyclic data transfer.

Note regarding the message value:

The individual information is coded as follows in the message value (r0949/r2124):

0000yyxx hex: yy = component number, xx = error cause

Remedy: Carry out a POWER ON (switch-off/switch-on).

249150 <location>Cooling unit: Fault occurred

Drive object: A_INF_828, B_INF_828, S_INF_828

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The cooling unit signals a general fault.

Remedy:

- check the wiring between the cooling unit and the input terminal (Terminal Module).
- check the external control device for the cooling unit.

See also: p0266 (Cooling unit feedback signals signal source)

249151 <location>Cooling unit: Conductivity has exceeded the fault threshold

Drive object: A_INF_828, B_INF_828, S_INF_828

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The conductivity of the cooling liquid has exceeded the selected fault threshold (p0269[2]).
See also: p0261 (Cooling unit starting time 2), p0262 (Cooling unit fault conductivity delay time), p0266 (Cooling unit feedback signals signal source)

Remedy: Check the device to de-ionize the cooling liquid.

249152 <location>Cooling unit: ON command feedback signal missing

Drive object: A_INF_828, B_INF_828, S_INF_828

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The feedback signal of the ON command of the cooling unit is missing.
- after the ON command, the feedback signal has not been received within the selected starting time (p0260).
- the feedback signal has failed in operation.
- the cooling unit was stopped by an external signal.
See also: p0260 (Cooling unit starting time 1), r0267 (Cooling unit status word)

Remedy: - check the wiring between the cooling unit and the input terminal (Terminal Module).
- check the wiring between the output terminal (Terminal Module) and the cooling unit.
- check the external control device for the cooling unit.

249153 <location>Cooling unit: Liquid flow too low

Drive object: A_INF_828, B_INF_828, S_INF_828

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The drive converter cooling unit signals that the cooling liquid flow is too low.
- after the ON command, the feedback signal has not been received within the selected starting time (p0260).
- in operation, the feedback signal has failed for longer than the permitted failure time (p0263).
See also: p0260 (Cooling unit starting time 1), p0263 (Cooling unit fault liquid flow delay time), r0267 (Cooling unit status word)

Remedy: - check the wiring between the cooling unit and the input terminal (Terminal Module).
- check the external control device for the cooling unit.

249154 <location>Cooling unit: Liquid leak is present

Drive object: A_INF_828, B_INF_828, S_INF_828

Message value: -

Reaction: OFF2

Acknowledge: IMMEDIATELY

Cause: The liquid leakage monitoring function has responded.
Caution:
If this fault is reparameterized as an alarm, then using other monitoring functions it must be ensured that when cooling water is lost, the drive is switched off!
See also: r0267 (Cooling unit status word)

Remedy: - check the cooling system for leaks in the cooling circuit.
- check the wiring of the input terminal (Terminal Module) used to monitor leaking fluid.

249155 <location>Cooling unit: Power Stack Adapter, firmware version too old

Drive object: A_INF_828, B_INF_828, S_INF_828

Message value: -

Reaction: OFF2

Acknowledge: POWER ON
Cause: The firmware version in the Power Stack Adapter (PSA) is too old and does not support the liquid cooling.
Remedy: Upgrade the firmware. Check EEPROM data.

249156 <location>Cooling unit: Cooling liquid temperature has exceeded the fault threshold

Drive object: A_INF_828, B_INF_828, S_INF_828
Message value: -
Reaction: OFF2
Acknowledge: IMMEDIATELY
Cause: The cooling liquid intake temperature has exceeded the specified fault threshold.
Note:
The value for the fault threshold depends on the power unit (hardware description data, e.g. 52 ... 55 °C).
Remedy: Check the cooling system and the ambient conditions.

249170 <location>Cooling unit: Alarm has occurred

Drive object: A_INF_828, B_INF_828, S_INF_828
Message value: -
Reaction: NONE
Acknowledge: NONE
Cause: The cooling unit signals a general alarm.
Remedy: - check the wiring between the cooling unit and the input terminal (Terminal Module).
- check the external control device for the cooling unit.

249171 <location>Cooling unit: Conductivity has exceeded the alarm threshold

Drive object: A_INF_828, B_INF_828, S_INF_828
Message value: -
Reaction: NONE
Acknowledge: NONE
Cause: The conductivity of the cooling liquid has exceeded the selected alarm threshold (p0269[1]).
Note:
The threshold cannot be set higher than the fault threshold specified in the equipment description.
Remedy: Check the device to de-ionize the cooling liquid.

249172 <location>Cooling unit: Conductivity actual value is not valid

Drive object: A_INF_828, B_INF_828, S_INF_828
Message value: -
Reaction: NONE
Acknowledge: NONE
Cause: When monitoring the conductivity of the cooling liquid, there is a fault in the wiring or in the sensor.
Remedy: - check the wiring between the cooling unit and the Power Stack Adapter (PSA).
- check the function of the sensor to measure the conductivity.

249173 <location>Cooling unit: Cooling liquid temperature has exceeded the alarm threshold

Drive object: A_INF_828, B_INF_828, S_INF_828
Message value: -
Reaction: NONE
Acknowledge: NONE

Cause: The cooling liquid intake temperature has exceeded the specified alarm threshold.
Note:
 The value for the alarm threshold depends on the power unit (hardware description data, e.g. 42 ... 50 °C).
Remedy: Check the cooling system and the ambient conditions.

249920 <location>Protective breaker main circuit tripped

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The protective breaker in the main circuit of the power supply has tripped.

Note:

This message is output via the signal source of binector input p6577[1] of the Control Unit.

Remedy: Check the main circuit.

249921 <location>Protective breaker redundant main circuit tripped

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The protective breaker in the main circuit for the redundant feed to the power supply has tripped.

Note:

This message is output via the signal source of binector input p6577[2] of the Control Unit.

Remedy: Check the redundant main circuit.

249922 <location>Protective breaker 24 V circuit has tripped

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: A protective breaker in the 24 V circuit has tripped.

Note:

This message is output via the signal source of binector input p6577[3] of the Control Unit.

Remedy: Check the 24 V circuit

249923 <location>Protective breaker terminal strip 24 V circuit has tripped

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: A protective breaker for the terminal strip in the 24 V circuit has tripped.

Note:

This message is output via the signal source of binector input p6577[6] of the Control Unit.

Remedy: Check the terminal strip for the 24 V circuit.

249924 <location>Protective breaker power unit supply circuit tripped

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: A protective breaker in the circuit of the power unit supply has tripped.

Note:

This message is output via the signal source of binector input p6577[9] of the Control Unit.

Remedy: Check the power unit supply circuit.

249926 <location>Protective breaker synchronizing voltage tripped

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: A protective breaker for the synchronizing voltage has tripped.

Note:

This message is output via the signal source of binector input p6577[13] of the Control Unit.

Remedy: Check the synchronizing voltage.

249927 <location>Protective breaker auxiliary fan circuit has tripped

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The protective breaker in the fan circuit of the auxiliary fan has tripped.

Note:

This message is output via the signal source of binector input p6577[14] of the Control Unit.

Remedy: Check the auxiliary fan.

249933 <location>Protective breaker excitation 230 V AC circuit tripped

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The protective breaker in the 230 V AC circuit of the excitation has tripped.

Note:

This message is output via the signal source of binector input p6577[17] of the Control Unit.

Remedy: Check the 230 V AC circuit of the excitation.

249934 <location>Protective breaker output cooling unit 230 V AC circuit tripped

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The protective breaker in the 230 V AC circuit of the outgoing feeder of the cooling unit has tripped.

Note:

This message is output via the signal source of binector input p6577[18] of the Control Unit.

Remedy: Check the 230 V AC circuit of the outgoing feeder of the cooling unit.

249935 <location>Protective breaker power unit door solenoids 24 V circuit has tripped

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The protective breaker in the 24 V circuit of the door solenoids in the power unit has tripped.

Note:

This message is output via the signal source of binector input p6577[19] of the Control Unit.

Remedy: Check the 24 V circuit of the door solenoids in the power unit.

249936 <location>Prot. breaker lighting supply/socket outlets 230V AC cct has tripped

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The protective breaker in the 230 V AC circuit for the lighting supply/socket outlets has tripped.

Note:

This message is output via the signal source of binector input p6577[20] of the Control Unit.

Remedy: Check the 230V AC circuit for the lighting supply/socket outlets.

249937 <location>UPS not ready

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The uninterruptible power supply (UPS) is not ready.

Note:

This message is output via the signal source of binector input p6577[25] of the Control Unit.

UPS: Uninterruptible Power Supply

Remedy: Check the UPS.

249938 <location>UPS battery operation

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The uninterruptible power supply (UPS) is in battery operation.

Note:

This message is output via the signal source of binector input p6577[26] of the Control Unit.

UPS: Uninterruptible Power Supply

Remedy: Check the power supply of the control cabinet.

249939 <location>UPS battery discharged

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The uninterruptible power supply (UPS) battery is discharged.

Note:

This message is output via the signal source of binector input p6577[27] of the Control Unit.

UPS: Uninterruptible Power Supply

Remedy: Check the UPS battery.

249940 <location>Protective breaker tripped PU supply 400 V circuit

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The protective breaker for the 400 V AC supply of the power unit has tripped.

Note:

This message is output via the signal source of binector input p6577[28] of the Control Unit.

Remedy: Check the 400 V AC supply voltage for the power unit.

249941 <location>Protective breaker anti-condensation heating tripped

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The protective breaker for the anti-condensation heating was tripped.

Note:

This message is output via the signal source of binector input p6577[29] of the Control Unit.

Remedy: Check the anti-condensation heating circuit.

249942 <location>Protective breaker SITOP supply circuit tripped

Drive object: A_INF_828, B_INF_828, CU_I_828, CU_I_COMBI, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: -

Reaction: NONE

Acknowledge: NONE

Cause: The protective breaker for the SITOP 24 V circuit has tripped.

Note:

This message is output via the signal source of binector input p6577[21] of the Control Unit.

Remedy: Check the SITOP power supply.

249998 <location>Recorder trigger event occurred

Drive object: A_INF_828, B_INF_828, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause:	A recorder trigger event has occurred. The data are then written to the memory card, specifying the event number. Alarm value (r2124, interpret decimal): Event number.
Remedy:	Not necessary. This message disappears automatically.

250002 <location>COMM BOARD: Alarm 2

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	%1
Reaction:	NONE
Acknowledge:	NONE
Cause:	CBE20 SINAMICS Link: A specific telegram word (send) is being used twice. Alarm value (r2124, interpret decimal): Telegram word used twice See also: p8871 (SINAMICS Link PZD send word)
Remedy:	CBE20 SINAMICS Link: Correct the parameter assignment. See also: p8871 (SINAMICS Link PZD send word)

250003 <location>COMM BOARD: Alarm 3

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	Info 1: %1, Info 2: %2
Reaction:	NONE
Acknowledge:	NONE
Cause:	CBE20 SINAMICS Link: A specific telegram word (receive) is being used twice. Alarm value (r2124, interpret hexadecimal): yyyyxxxx hex: yyyy = info. 1, xxxx = info. 2 Info. 1 (decimal) = Address of sender Info. 2 (decimal) = Receive telegram word See also: p8870 (SINAMICS Link PZD receive word), p8872 (SINAMICS Link PZD receive address)
Remedy:	CBE20 SINAMICS Link: Correct the parameter assignment.

250004 <location>COMM BOARD: Alarm 4

Drive object:	A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL
Message value:	Info 1: %1, Info 2: %2
Reaction:	NONE
Acknowledge:	NONE
Cause:	CBE20 SINAMICS Link: - telegram word (receive) and address of sender inconsistent. Both values have to be either equal to zero or not equal to zero. - address of the sender > maximum project address. Alarm value (r2124, interpret hexadecimal): yyyyxxxx hex: yyyy = info. 1, xxxx = info. 2 Info. 1 (decimal) = Drive object number from p8870, p8872 Info. 2 (decimal) = Index from p8870, p8872 See also: p8870, p8872

Remedy: In the case of CBE20 SINAMICS Link:
Correct the parameter assignment.

250005 <location>COMM BOARD: Alarm 5

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: CBE20 SINAMICS Link:
Sender not found on SINAMICS Link.
Alarm value (r2124, interpret decimal):
0: synchronization to the bus clock cycle unsuccessful.
1 ... 64: address of the sender that was not found.
See also: p8872 (SINAMICS Link PZD receive address)

Remedy: CBE20 SINAMICS Link:
Check the connection to the sender.
Set parameters p8811, p8812[1] to identical values for all participants/nodes.
Check parameter p8836 for all participants.

250006 <location>COMM BOARD: Alarm 6

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: Info 1: %1, Info 2: %2

Reaction: NONE

Acknowledge: NONE

Cause: CBE20 SINAMICS Link:
The parameter assignment indicates that the sender and the receiver are one and the same. This is not permitted.
Alarm value (r2124, interpret hexadecimal):
yyyyxxxx hex: yyyy = info. 1, xxxx = info. 2
Info. 1 (decimal) = Drive object number from p8872
Info. 2 (decimal) = Index from p8872
See also: p8872 (SINAMICS Link PZD receive address)

Remedy: In the case of CBE20 SINAMICS Link:
Correct the parameter assignment. All p8872[index] must be set to a value not equal to p8836.

250007 <location>COMM BOARD: Alarm 7

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: Info 1: %1, Info 2: %2

Reaction: NONE

Acknowledge: NONE

Cause: CBE20 SINAMICS Link:
A send telegram word is greater than possible in the project.
Alarm value (r2124, interpret hexadecimal):
yyyyxxxx hex: yyyy = info. 1, xxxx = info. 2
Info. 1 (decimal) = drive object number from p8871
Info. 2 (decimal) = index from p8871
See also: p8871 (SINAMICS Link PZD send word)

Remedy: In the case of CBE20 SINAMICS Link:
Correct the parameter assignment.

250008 <location>COMM BOARD: Alarm 8

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: Info 1: %1, Info 2: %2

Reaction: NONE

Acknowledge: NONE

Cause: CBE20 SINAMICS Link:
A receive telegram word is greater than possible in the project.
Alarm value (r2124, interpret hexadecimal):
yyyyxxxx hex: yyyy = info. 1, xxxx = info. 2
Info. 1 (decimal) = drive object number from p8870
Info. 2 (decimal) = index from p8870
See also: p8870 (SINAMICS Link PZD receive word)

Remedy: In the case of CBE20 SINAMICS Link:
Correct the parameter assignment.

250011 <location>EtherNet/IP/COMM BOARD: configuration error

Drive object: A_INF_828, B_INF_828, CU_LINK, HLA_828, HUB, S_INF_828, S_INF_COMBI, SERVO_828, SERVO_COMBI, TM120, TM150, TM54F_MA, TM54F_SL

Message value: %1

Reaction: NONE

Acknowledge: NONE

Cause: CBE20 EtherNet/IP:
An EtherNet/IP controller attempts to establish a connection using an incorrect configuring telegram.
The telegram length set in the controller does not match the parameterization in the drive device.

Remedy: Check the set telegram length.
Note:
PZD interface 1:
For p0922 not equal to 999, then the length of the selected telegram applies.
For p0922 = 999, the maximum interconnected PZD (r2067) applies.
PZD interface 2:
The maximum interconnected PZD (r8867) applies.
See also: p0922, r2067, r8867

I/O alarms

300402	System error in drive link. Error codes %1, %2
Parameters:	%1 = Error code 1 %2 = Error code 2
Explanation:	An internal software error or serious error condition has occurred, which could possibly be rectified by a hardware reset.
Reaction:	NC not ready. The NC switches to follow-up mode. Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display. NC Stop on alarm.
Remedy:	If you experience such a system error, please contact Technical Support. www.siemens.com/sinumerik/help Please supply the following information to ensure quick processing: - Alarm number together with alarm text - Description of the operation/mode before the alarm message - Generate log files using the key combination: <Ctrl> + <Alt> + <D>
Programm continuation:	Switch control OFF - ON.
300406	Problem in the non-cyclic communication for basic address %1, additional information %2, %3, %4
Explanation:	For PROFIdrive only: A problem occurred during the non-cyclic communication with the logical start address. The additional information defines the location of the problem. If the logical start address 0 is output, only the additional information is relevant.
Reaction:	Alarm display. Warning display.
Remedy:	Please inform the authorized personnel/service department. The alarm can be suppressed with MD11411 \$MN_ENABLE_ALARM_MASK bit 1 = 0 If you experience such a system error, please contact Technical Support. www.siemens.com/sinumerik/help Please supply the following information to ensure quick processing: - Alarm number together with alarm text - Description of the operation/mode before the alarm message - Generate log files using the key combination: <Ctrl> + <Alt> + <D>
Programm continuation:	Clear alarm with the Delete key or NC START.
300410	Axis %1 drive %2 error when storing a file (%3, %4)
Parameters:	%1 = NC axis number %2 = Drive number %3 = Error code 1 %4 = Error code 2

Explanation:	An attempt to save a data block, e. g. the result of a measuring function, in the file system has failed. On error code 1 == 291: An error occurred during preparation of the ACC information. Basic information prepared on the drive contains an error or has an unknown format. On error code 1 == 292: Memory shortage during preparation of the ACC information.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Inform the authorized personnel/service department. You have the following possibilities of eliminating the error: Ensure that there is adequate memory in the file system. For example, delete 2 NC programs or create 4 to 8 kbytes more memory space. Increase the number of files per directory or the size of the file system itself. This requires the following actions: - A complete data backup - Change the setting of the MDs - MD18280 \$MM_NUM_FILES_PER_DIR - MD18320 \$MM_NUM_FILES_IN_FILESYSTEM - MD18321 \$MM_MAXNUM_SYSTEM_FILES_IN_FILESYSTEM - MD18350 \$MM_USER_FILE_MEM_MINIMUM - and, if necessary those of - MD18270 \$MM_NUM_SUBDIR_PER_DIR, - MD18310 \$MM_NUM_DIR_IN_FILESYSTEM, - Power On - Reload saved data - On error code 1 == 291: Replace the drive software and use a version with suitable ACC basic information. - On error code 1 == 292: Replace the drive software and use fewer different versions of the drive software.
Programm continuation:	Clear alarm with the RESET key. Restart part program

300412 Error when storing a file (%1, %2)

Parameters:	%1 = Error code 1 %2 = Error code 2
Explanation:	An attempt to save a data block, e.g. the result of a measuring function, in the file system has failed.
Reaction:	Interface signals are set. Alarm display.
Remedy:	Inform the authorized personnel/service department. You have the following possibilities of eliminating the error: Ensure that there is adequate memory in the file system. For example, delete 2 NC programs or create an additional 4 to 8 kbytes of memory space. Increase the number of files per directory or the total size of the file system itself. This requires the following actions: - A complete data backup - Change the settings of machine data - MD18280 \$MM_NUM_FILES_PER_DIR - MD18320 \$MM_NUM_FILES_IN_FILESYSTEM - MD18321 \$MM_MAXNUM_SYSTEM_FILES_IN_FILESYSTEM - MD18350 \$MM_USER_FILE_MEM_MINIMUM - and, if necessary, of - MD18270 \$MM_NUM_SUBDIR_PER_DIR - MD18310 \$MM_NUM_DIR_IN_FILESYSTEM - Power On - Reload the data backup
Programm continuation:	Clear alarm with the RESET key. Restart part program

300423 Measuring result could not be read (%1)**Parameters:** %1 = Error code

Explanation: An attempt to read a measurement result has failed:

- Error code = 4: Not enough space for test result
- Error code = 16: Measurement not yet finished

Reaction: Interface signals are set.
Alarm display.

Remedy: Repeat the measurement. Alter the measuring time if necessary.

Programm continuation: Clear alarm with the RESET key. Restart part program

380001 PROFIBUS/PROFINET: Startup error, reason %1 parameter %2 %3 %4.

Parameters: %1 = Cause of the error
%2 = Parameter 1
%3 = Parameter 2
%4 = Parameter 3

Explanation: An error occurred during startup of the PROFIBUS/PROFINET master.

Overview: Cause of the error, Par 1, Par 2, Par 3:

- 01 = DPM version, DPM version, DPA version, --
- 02 = DPM ramp-up timeout, DPM actual value status, DPM setpoint value status, --
- 03 = DPM ramp-up status, DPM actual value status, DPM setpoint value status, DPM error code
- 04 = DPM ramp-up error, DPM actual value status, DPM setpoint value status, DPM error code
- 05 = DPM-PLL sync error, --, --, --
- 07 = Alarm queue too long, Actual number, Setpoint number, --
- 08 = Unknown client, Client ID, --, --
- 09 = Client version, Client ID, Client version, DPA version
- 10 = Too many clients, Client number, max. number of clients, --
- 11 = Log.basic address used several times; bus no.; slot no.; log.basic address --
- 20 = Slave/device address used several times, slave/device address --
- 21 = Slave/device address unknown, slave/device address, --
- 22 = Erroneous configuration telegram, slave/device address, error code, --
- 23 = OMI incompatible (data), drive version, CDA version, --, --
- 24 = OMI incompatible (driver), drive version, CDA version, --, --
- 25 = CPI initialization failed, error code, --, --, --
- 26 = DMA not active
- 27 = Reserved
- 28 = Reserved
- 29 = Reserved
- The 1000s digit of the error cause = number of the affected bus
- (Special case: Error causes in the 5000 range indicate problems with the NCU-LINK communication)

Clients are the following components of the control system that use the PROFIBUS/PROFINET:

Client ID = 1: PLC

Client ID = 2: NCK

Possible causes are:

- Error in contents of PROFIBUS/PROFINET configuration
- Corruption of parts of the system program
- Hardware defect on NC component

Reaction: Channel not ready.
NC Start disable in this channel.
Interface signals are set.
Alarm display.

Remedy:

Remedy for 1-11

1. Check the control project, check MD11240 \$MN_PROFIBUS_SDB_NUMBER, and reload it when using a user-specific SDB.
2. Increase the monitoring time for the PLC run-up in MD10120 \$MN_PLC_RUNNINGUP_TIMEOUT
3. If the error still occurs, back up data, and restart the control with the standard values as per the as-delivered condition.
4. If run-up is satisfactory, reload the user data stage by stage.
5. If the error still occurs during run-up with standard values, reboot the system from the PC card or update the software.
6. If the error still occurs, replace the hardware.

Remedy for 20-21

1. Check/correct the addresses of the connected slaves/devices.

Remedy for 22

See SINAMICS warning 1903 for a description of the meaning behind the error codes.

1. Check PROFIBUS/PROFINET configuration
 - Check the type and length of the message frame
 - Match slot assignment with P978
2. Evaluate the drive alarms/warnings

Remedy for 23-24

1. Software replacement required

Remedy for 25

1. Change the message frame type
2. Reduce the number of slots
3. Reduce the number of slaves/devices
4. Create a new PROFIBUS/PROFINET configuration
5. Software must be replaced

If the error can still not be rectified after this procedure, send the error message to the control manufacturer.

**Programm
continuation:**

Switch control OFF - ON.

380003 PROFIBUS/PROFINET: Operating error, reason %1 parameter %2 %3 %4.**Parameters:**

%1 = Cause of the error
%2 = Parameter 1
%3 = Parameter 2
%4 = Parameter 3

Explanation:

An operating error occurred on the PROFIBUS/PROFINET in cyclic mode.

Overview: Cause of the error, Par 1, Par 2, Par 3:

- 01 = unknown alarm, alarm class, logical address, --
- 02 = DPM cycle timeout, DPM actual value status, DPM setpoint value status, --
- 03 = DPM cycle status, DPM actual value status, DPM setpoint value status, DPM error code
- 04 = DPM cycle error, DPM actual value status, DPM setpoint value status, DPM error code
- 05 = Client not registered, client number, max. number of clients, --
- 06 = Synchronization error, number of sync violation, --, --
- 07 = Spinlock timeout, PLC spinlock, NCK spinlock, --
- 1000s digit of the error cause = number of the affected bus
- (Special case: Error causes in the 5000 range indicate problems with the NCU-LINK communication)

Alarm class: (see alarm 380 060)

The following can be primary causes:

- For error cause 01: Data transfer error on the PROFIBUS/PROFINET
- For error causes 02, 03, 04: Error in contents of PROFIBUS/PROFINET configuration
- For error causes 02, 03, 04, 05, 07: Corruption of parts of system program
- For error cause 06: The PCI bus cycle does not match the expected rate, so synchronization is not possible. The correct PCI bus cycle must be entered.

The error can also be caused by a hardware problem on the MCI module.

Reaction:	Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- For error cause 01: - Check compliance with the electrical and fault-related specifications for PROFIBUS/PROFINET, assess the cable installation - Check the terminating resistors of the PROFIBUS connectors (ON setting at ends of cables, otherwise OFF setting required) - Check slave/device - For error causes 02, 03, 04: - Check PROFIBUS/PROFINET configuration - For error causes 02, 03, 04, 05, 07: - Follow the procedure described for troubleshooting alarm 380 001 - For error cause 06: - The correct PCI bus cycle must be entered. If the error cannot be eliminated by this procedure, send the error text to the control system manufacturer.
Programm continuation:	Clear alarm with the RESET key. Restart part program

380005	PROFIBUS/PROFINET: Bus access conflict
Explanation:	An access conflict occurred on the PROFIBUS/PROFINET in cyclic mode: An attempt has been made in the NCK to write data to the bus or to read from the bus while cyclic data transfer was active. This may lead to inconsistent data, sign-of-life errors or additional transmission dead times on the bus.
Reaction:	Alarm display.
Remedy:	- Check the effective timing in MD10063 \$MN_POSCTRL_CYCLE_DIAGNOSIS, and ensure in particular that the settings in MD10050 \$MN_SYSCLOCK_CYCLE_TIME and MD10062 \$MN_POSCTRL_CYCLE_DELAY are correct: - Use MD10062 \$MN_POSCTRL_CYCLE_DELAY = 0 for automatic setting of the position control cycle delay. - If alarm-free operation cannot be achieved with MD10062 \$MN_POSCTRL_CYCLE_DELAY = 0, MD10050 \$MN_SYSCLOCK_CYCLE_TIME should be increased.
Programm continuation:	Switch control OFF - ON.

380020 PROFIBUS/PROFINET: Bus %3 SDB %4 error %1 source %2

Parameters:	%1 = Error %2 = SDB source %3 = Bus number %4 = SDB number
Explanation:	Error in SDB for configuring PROFIBUS/PROFINET. Causes of the error: - 01 = SDB does not exist in source. - 02 = SDB from source is too large. - 03 = SDB from source cannot be activated. - 04 = Source is empty. - 05 = Source is not present. SDB source: - 99 = Passive file system: _N_SDB_DIR - 100 = Memory card: /siemens/sinumerik/sdb/... - 101 = Memory card: /addon/sinumerik/sdb/... - 102 = Memory card: /oem/sinumerik/sdb/... - 103 = Memory card: /user/sinumerik/sdb/... Reaction: PROFIBUS/PROFINET is inactive or working with the default SDB.

Reaction:	Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	- Check the setting of MD 11240 \$MN_PROFIBUS_SDB_NUMBER. - If source = 100: Check directory _N_SDB_DIR in the passive file system. - If source = 103-106: Check directories on memory card
Programm continuation:	Switch control OFF - ON.

380022 PROFIBUS/PROFINET: Configuration of DP master bus %1 has been changed

Parameters:	%1 = Number of the affected bus
Explanation:	The PROFIBUS/PROFINET configuration on the DP master was changed during operation, e.g. by downloading a new hardware configuration. As the cycle data may also have changed, operation cannot be continued, and a warm restart is required. If the master functionality is within the PLC, the PLC will have been stopped anyway for the download, and alarm 2000 (PLC sign-of-life) output.
Reaction:	Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	NCK restart If the error cannot be eliminated by this procedure, please make a note of the error text and contact the control system manufacturer.
Programm continuation:	Switch control OFF - ON.

380040 PROFIBUS/PROFINET: Bus %3, configuration error %1, parameter %2

Parameters:	%1 = Cause of the error %2 = Parameter %3 = Number of the affected bus
--------------------	--

Explanation:	The PROFIBUS/PROFINET configuration (SDB) does not conform to the configuration specifications of the NC in use. Overview: Cause of the error, par 1: - 01 = SDB contains slave/device without diagnostics slot, slave/device address - 02 = SDB contains too many slot entries, identifier - 03 = SDB contains no equidistance data, no function - 04 = PNIO: SDB contains different Tdp (also TDC) on one device - 05 = PNIO: SDB contains different Tmapc (also CACF) on one device - 06 = PNIO: SDB contains different TI on one device - 07 = PNIO: SDB contains different TO on one device - 08 = PNIO: SDB contains device numbers that are too high (with values higher than 126/255), slave/device address - 09 = SDB content transferred segmented (too many slots/frames) - 10 = Not enough memory space for segmented SDB content (too many slots/frames) - 11 = The telegram configured in the SDB is too short for the selected telegram acc. to \$MN_DRIVE_TELEGRAM_TYPE. - 20 = SDB contains too many slaves/devices, quantity - 21 = SDB missing or contains invalid data, error code - 22 = SDB configuration data incorrect, slave/device address, error code - 23 = Reserved - 24 = Reserved - 25 = Reserved - 26 = Reserved - 27 = Reserved - 28 = Reserved - 29 = Reserved
Reaction:	Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Check that the corresponding PROFIBUS/PROFINET configuration: - Contains a diagnostics slot for every slave/device - Contains only slave/device entries relevant to the application In principle, it is possible to include a superset of slaves/devices in the PROFIBUS/PROFINET configuration that is partially relevant for different end versions of the product. However, this overloads the NC memory and runtime capacity and should, therefore, always be avoided. If this alarm occurs, reduce the PROFIBUS/PROFINET configuration to a minimum. If the code for the error cause is 03, check that equidistance is activated in the PROFIBUS/PROFINET configuration. If the code for the error cause is 10, reduce the number of slaves/slots on the bus concerned. If the alarm continues to occur, please send the error text to the control system manufacturer. If the code for the error cause is 11, select a larger telegram as appropriate or select a smaller telegram at \$MN_DRIVE_TELEGRAM_TYPE.
Programm continuation:	Switch control OFF - ON.

380050	PROFIBUS/PROFINET: Multiple assignment of inputs on address %1
Parameters:	%1 = Logical address
Explanation:	Multiple assignments of input data have been detected in the logical address space. Logical address: Base address of the address area defined several times
Reaction:	Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display.

Remedy:	The address partitioning should be checked as follows: Check for multiple assignments in the following machine data: - MD13050 \$MN_DRIVE_LOGIC_ADDRESS[0] - MD13050 \$MN_DRIVE_LOGIC_ADDRESS[n-1] : n = highest axis index on control system - MD12970 \$MN_PLC_DIG_IN_LOGIC_ADDRESS, MD12971 \$MN_PLC_DIG_IN_NUM : PLC address area for digital inputs - MD12978 \$MN_PLC_ANA_IN_LOGIC_ADDRESS, MD12979 \$MN_PLC_ANA_IN_NUM : PLC address area for analog inputs If no inconsistencies can be found in the parameters, compare these machine data with the PROFIBUS/PROFINET configuration. In particular, check that the lengths configured for the individual slots do not result in area overlaps. When you find the cause of the error, change the machine data and/or the PROFIBUS/PROFINET configuration.
Programm continuation:	Switch control OFF - ON.

380051 PROFIBUS/PROFINET: Multiple assignment of outputs on address %1

Parameters:	%1 = Logical address
Explanation:	Multiple assignments of input data have been detected in the logical address space. Logical address: Base address of the address area defined several times
Reaction:	Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	The address partitioning should be checked as follows: Check for multiple assignments in the following machine data: - MD13050 \$MN_DRIVE_LOGIC_ADDRESS[0] - MD13050 \$MN_DRIVE_LOGIC_ADDRESS [n-1] : n = highest axis index on control system - MD12974 \$MN_PLC_DIG_OUT_LOGIC_ADDRESS, MD12975 \$MN_PLC_DIG_OUT_NUM : PLC address area for digital outputs - MD12982 \$MN_PLC_ANA_OUT_LOGIC_ADDRESS, MD12983 \$MN_PLC_ANA_OUT_NUM : PLC address area for analog outputs If no inconsistencies can be found in the parameters, compare these machine data with the PROFIBUS/PROFINET configuration. In particular, check that the lengths configured for the individual slots do not result in area overlaps. When you find the cause of the error, change the machine data and/or the PROFIBUS/PROFINET configuration.
Programm continuation:	Switch control OFF - ON.

380070 PROFIBUS/PROFINET: No input slot available for basic address %1 (length %2)

Parameters:	%1 = Logical base address of the requested area %2 = Size of the area in bytes
Explanation:	An incorrect logical base address was specified for a digital or analog input. Either no slot has been configured for this base address or the requested area extends beyond the end of the slot. Length=1 indicates a digital input. Length=2 indicates an analog input.
Reaction:	Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Enter correct base addresses in the machine data: - For length=1: Correct machine data MN_HW_ASSIGN_DIG_FASTIN. - For length=2: Correct machine data MN_HW_ASSIGN_ANA_FASTIN. - NCK restart If the error cannot be eliminated by this procedure, please make a note of the error text and contact the control system manufacturer.
Programm continuation:	Switch control OFF - ON.

380071	PROFIBUS/PROFINET: No output slot available for basic address %1 (size %2)
Parameters:	%1 = Logical base address of the requested area %2 = Size of the area in bytes
Explanation:	An incorrect logical base address was specified for a digital or analog input. Either no slot has been configured for this base address or the requested area extends beyond the end of the slot. For length =1 it is a digital output, For length =2 it is an analog output.
Reaction:	Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Enter correct base addresses in the machine data: - For length=1: Correct machine data MN_HW_ASSIGN_DIG_FASTOUT. - For length=2: Correct machine data MN_HW_ASSIGN_ANA_FASTOUT. - NCK restart If the error cannot be eliminated by this procedure, please make a note of the error text and contact the control system manufacturer.
Programm continuation:	Switch control OFF - ON.
380072	PROFIBUS/PROFINET: Output slot for basic address %1 (size %2) not allowed
Parameters:	%1 = Logical base address of the requested area %2 = Size of the area in bytes
Explanation:	An incorrect logical base address was set for a digital or analog output, the area is resides in the access range of the PLC. For length =1 it is a digital output, For length =2 it is an analog output.
Reaction:	Channel not ready. NC Start disable in this channel. Interface signals are set. Alarm display.
Remedy:	Only use addresses outside the PLC process image (e.g. >= 256) for output slots. Enter correct basic addresses in the machine data: - For length=1: Correct machine data MN_HW_ASSIGN_DIG_FASTOUT. - For length=2: Correct machine data MN_HW_ASSIGN_ANA_FASTOUT. - NCK restart If the error cannot be eliminated by this procedure, please make a note of the error text and contact the control system manufacturer.
Programm continuation:	Switch control OFF - ON.
380075	PROFIBUS/PROFINET: Failure of DP I/O bus %2 slave/device %1 logical start address %3
Parameters:	%1 = Slave/device address %2 = Number of the affected bus %3 = PROFINET: Logical start address with input-IOPS=BAD
Explanation:	Failure of a PROFIBUS/PROFINET slot used by the NCK for digital or analog I/Os. PROFINET: Input IOPS=BAD was reported at logical start address
Reaction:	Alarm display.
Remedy:	Check that the slave/device is operating correctly (all slaves/devices must be included in the bus, green LEDs).
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

380076 PROFIBUS/PROFINET: No DO1 message frame: Bus %2 slave/device %1**Parameters:** %1 = Slave/device address

%2 = Number of the affected bus

Explanation: Note for the system setup engineer: A PROFIBUS slave/PROFINET device used as an NCK drive does not have a valid DO1 message frame assignment (see MD13120 \$MN_CONTROL_UNIT_LOGIC_ADDRESS with the PROFIBUS/PROFINET configuration).

This alarm indicates that the alarm time-of-day synchronization is not working between the controller and this slave/device.

Reaction: Alarm display.**Remedy:** Enter a valid value in MD13120 \$MN_CONTROL_UNIT_LOGIC_ADDRESS.**Programm continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

380077 PROFIBUS/PROFINET: Too many DOs: Currently minimum %2, maximum %3 in DO group %1**Parameters:** %1 = DO group

%2 = Current number of DOs

%3 = Maximum permissible number of DOs

Explanation: Note for the system setup engineer: The number of equivalent DOs ("drive objects" group) on all busses (configured and connected) exceeds predefined limit values.

The services linked to these DOs (e.g. time synchronization, alarm display, HMI diagnostics, HMI data archiving) can no longer be guaranteed for all DOs in this group.

The following different DO groups exist (see parameter %1):

0 = Device (CU, DO1)

1 = Communications (CU-LINK)

2 = Drive (SERVO, VECTOR)

3 = Infeed (ALM etc.)

4 = Terminal block (TB)

5 = Terminal module (TM)

Reaction: Alarm display.**Remedy:** Reduce the number of devices (containing DOs of this type) on the bus.

Use a more powerful type of controller (one which supports more DOs).

Programm continuation: Switch control OFF - ON.

380500 PROFIBUS/PROFINET: Fault on drive %1, code %2, value %3, time %4**Parameters:** %1 = Axis

%2 = Fault code of drive (P947/I945)/P824)

%3 = Fault value of drive ((P949/P826)

%4 = Fault time of drive (P948/P825)

Explanation: Contents of fault memory of assigned drive.**Reaction:** Alarm display.**Remedy:** See drive documentation for fault codes/fault values.**Programm continuation:** Alarm display showing cause of alarm disappears. No further operator action necessary.

380501 PROFIBUS/PROFINET: Fault on bus, slave/device, DO ID %1, code %2, value %3, time %4**Parameters:** %1 = 8 bit bus number, 8 bit slave/device number, 16 bit DO ID

%2 = Fault code of drive (P947)

%3 = Fault value of the drive (P949)

%4 = Fault time of the drive (P948)

Explanation: Contents of the fault memory of the assigned slave/device.**Reaction:** Alarm display.

Remedy: See drive documentation for fault codes/fault values.
Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

380502 PROFIBUS/PROFINET: Bus %1, slave/device %2 configuration changed

Parameters: %1 = Bus number
%2 = Slave/device address

Explanation: The bus configuration has changed.
Causes:
- First commissioning
- New slave/device recognized on the bus

Reaction: Interface signals are set.
Alarm display.

Remedy: In order to operate the bus with the new configuration, an additional restart will be required.
Programm continuation: Switch control OFF - ON.

380503 PROFIBUS/PROFINET: Bus %1 configuration changed

Parameters: %1 = Bus number

Explanation: The PROFIBUS/PROFINET configuration has been changed.
The new settings will not be activated until the next bus power up.

Reaction: Interface signals are set.
Alarm display.

Remedy: In order to operate the bus with the new configuration, an additional restart will be required.
Programm continuation: Switch control OFF - ON.

PLC alarms

400000 PLC STOP %1

Explanation:	PLC not in cyclic mode. Travel with the machine is not possible. %1: 1 Ready (User program has not been started) 2 Break (User program has been interrupted) 3 Error (Other PLC alarm with PLC Stop active)
Reaction:	Alarm display.
Remedy:	Rectify other PLC alarm; set PLC stop from Startup menu or test user program.
Programm continuation:	Alarm display showing cause of alarm disappears. No further operator action necessary.

400001 System error (%1) %2

Explanation:	%1 : Error code (numerical) %2 : Error text (optional error details) This alarm is used to display internal error states which, in conjunction with the transferred error text, provide information about the cause and location of the error.
Reaction:	PLC Stop
Remedy:	Notify Siemens of this error together with the error message.
Programm continuation:	Switch control OFF - ON.

400002 System error %1

Explanation:	%1 : Type number Internal error states are displayed with this alarm. An error number is also specified to provide further details about the cause and location of the error.
Reaction:	PLC Stop
Remedy:	Report this error to Siemens along with the type number.
Programm continuation:	Switch control OFF - ON.

400003 System error, connection error to MCP: %1

Explanation:	%1 : Internal error code This alarm reports a communication error to the MCP. Code 1: Invalid sign-of-life value received (during operation) Code 2: Sign-of-life failure of the MCP (during operation) Code 3: No sign of life received by the MCP (run-up) Code 4: General error Code 5: MCP indicates error status during operation
Reaction:	PLC Stop
Remedy:	Check MCP connection. If the error persists, please contact the hotline.
Programm continuation:	Clear alarm with the Delete key or NC START.

400004 Code error: %2 network %1

Explanation: %1 : Network number
%2 : Internal error code, module type
The user program contains an operation which is not supported by the control.
Type 1: Incorrect operand
Type 2: Incorrect operation
Type 3: Timer already used (TON or TONR)
Type 4: User program too large - memory overflow
Type 5: Excessive number of internal jump marks
Type 6: Excessive number of global jump marks
Type 7: Excessive number of SBRs
Type 8: Link error, unresolved references

Reaction: PLC Stop

Remedy: Modify and reload user program.

Programm continuation: Switch control OFF - ON.

400005 PLC stop specified from start-up menu

Explanation: User program is not being processed

Reaction: Alarm display.

Remedy: Switch controller off/on

Programm continuation: Switch control OFF - ON.

400006 Loss of remanent PLC data

Explanation: The following causes are possible:
Control handling (e.g. standard PLC deletion, power up with default values)
Control handling of power up with backed up data without backing up data in advance
Support time exceeded

Reaction: Alarm display.

Remedy: Update the data required.

Programm continuation: Clear alarm with the Delete key or NC START.

400007 Operand error: %3 %2 network %1

Explanation: %1 : Network number
%2 : Block type, block number.
%3 : Variable address

Reaction: PLC Stop

Remedy: The variable displayed must be checked in the user program for violation of the address range, impermissible data type and alignment errors.

Programm continuation: Switch control OFF - ON.

400008 Programming tool - version is not compatible %1 %2

Explanation: %1 : Programming tool version
This version is not compatible with the product version of the control system.

Reaction: PLC Stop

Remedy: Translate the user program using a suitable programming tool version and load in the control.

**Programm
continuation:** Switch control OFF - ON.

400009 Computing time overrun at PLC level: %2 network %1

Explanation: %1 : Network number
%2 : Module type
Check user program of the corresponding network displayed.

Reaction: PLC Stop

Remedy: Change user program

**Programm
continuation:** Switch control OFF - ON.

400010 Arithmetic error in user program: Type %2 network %1

Explanation: Check user program in the specified network.
%1 Network number, module ID
%2 = 1: Division by zero using fixed-point arithmetic
2: Floating-point arithmetic

Reaction: PLC Stop

Remedy: Change user program.

**Programm
continuation:** Switch control OFF - ON.

400011 Maximum number of subroutine levels exceeded: %2 network %1

Explanation: %1 Network number
%2 Module ID
Check user program in the specified network.

Reaction: PLC Stop

Remedy: Change user program.

**Programm
continuation:** Switch control OFF - ON.

400012 Error affecting indirect addressing: %2, network %1

Explanation: %1 Network number
%2 Module ID
Check user program in the specified network.

Reaction: PLC Stop

Remedy: Change user program.

**Programm
continuation:** Switch control OFF - ON.

400013 PLC user program is incorrect

Explanation: The PLC user program in the control is incorrect or is not available.

Reaction: PLC Stop

Remedy: Reload PLC user program.

**Programm
continuation:** Switch control OFF - ON.

400014 PROFINET - I/O ramp-up fault type: %1

Explanation: %1: 1 PROFINET - I/O not ramped-up
 2 Software version NC - PLC incompatibility
 3 Number of slots per function exceeded
 4 PROFINET I/O server not ready

Reaction: PLC Stop

Remedy: Type 1: Check PROFINET hardware and/or MD 12986, MD 11240 and MD 11241
 Types 2 to 3: Report error to Siemens
 Type 4: 828D - Check and/or replace PCU hardware and/or check MD 11240 and MD 11241

**Programm
continuation:** Switch control OFF - ON.

400015 PROFINET - IO I/O fault: log. addr. %1 bus/station: %2

Explanation: The PLC-UP is using I/O addresses which are not available.
 %1 Logical I/O address
 %2 Bus number/station number
 Causes of error:
 Bus I/O has no voltage
 Bus address set incorrectly
 Bus connection faulty
 PROFINET hardware defective

Reaction: PLC Stop

Remedy: Rectify the error using the error cause

**Programm
continuation:** Switch control OFF - ON.

400017 PLC TOOLMAN: missing table in DB9900

Explanation: The PLC TOOLMAN cannot find one of the tables 9900, 9901 or 9902.

Reaction: PLC Stop

Remedy: Create the missing table(s).

**Programm
continuation:** Switch control OFF - ON.

400018 PLC TOOLMAN: Spindle or load location invalid

Explanation: The PLC TOOLMAN does not know the specified spindle or load location number.

Reaction: PLC Stop

Remedy: Specify the correct number.

**Programm
continuation:** Switch control OFF - ON.

400019 PLC maintenance planner: Error in DB 9903 or 9904

Explanation: PLC maintenance planner: DBs 9903 and 9904 must be present and must have the same length.

Reaction: PLC Stop

Remedy: Create block(s) correctly.

**Programm
continuation:** Switch control OFF - ON.

400020 PLC maintenance request %1 : Initial data not plausible

Explanation: Redefine the initial data in accordance with the documentation.
 Error causes:
 Too many alarms for the interval length
 Time of first alarm too late
 Time of first alarm greater than interval

Reaction: Alarm display.

Remedy: Specify correct initial data according to the documentation.

Programm continuation: Clear alarm with the Delete key or NC START.

400021 Wait until I/O access is possible

Explanation: I/O access is not possible at the current time.

Reaction: Alarm display.

Remedy:

Programm continuation: Clear alarm with the Delete key or NC START.

400022 The PLC functionality: %2 is not permitted.

Explanation: PLC functionality: %2
 The specified PLC functionality is not supported.

Reaction: Alarm display.

Remedy: You are not permitted to use the specified PLC functionality.

Programm continuation: Clear alarm with the Delete key or NC START.

400023 Arithmetic problem in UP (REAL-Operation) OB/SBR/INT %1 Netzwerk %2

Explanation: Problems with REAL operands during the PLC-UP execution
 %1 Module No.
 %2 Network No.

Reaction: Alarm display.

Remedy: The variables used have to be checked for valid values.

Programm continuation: Clear alarm with the Delete key or NC START.

400024 Dynamically managed memory used up, area %1

Explanation: Memory overflow in area corresponding to memory area identification
 %1 = 1xx: dynamic RAM, xx refers to internal RAM class
 %1 = 2: MMF (user project)
 %1 = 3: buffered RAM
 %1 = 4: UP-RAM

Reaction: Alarm display.

Remedy: With %1 = 1xx: Internal error due to too many external communications requirements
 With %1 > 1: User project too large or too many operations

Programm continuation: Clear alarm with the Delete key or NC START.

400025 PLC Ctrl Energy: Error in DB 9906

Explanation: PLC Ctrl Energy: DB 9906 has been deleted.

Reaction: PLC Stop

Remedy: DB 9906 of the programming tool library must be incorporated into the project.
Programm continuation: Switch control OFF - ON.

400026 Alarm PLC cycle time, cycle time: %1 microseconds

Explanation: PLC cycle time has exceeded the alarm threshold
 %1 = xxxx: duration of the previous PLC cycle in µs
Reaction: Alarm display.
Remedy: User project is almost too large, too many operations or too many loops
Programm continuation: Clear alarm with the Delete key or NC START.

400027 Error PLC cycle time, cycle time: %1 microseconds

Explanation: PLC cycle time has exceeded the maximum value
 %1 = xxxx: duration of the previous PLC cycle in µs
Reaction: PLC Stop
Remedy: User project too large, too many operations or too many loops
Programm continuation: Switch control OFF - ON.

400028 Option (%1) for additional LadderSteps not possible on this hardware

Explanation: %1 = Option level
 The PLC option for additional LadderSteps (32000 or more) cannot be implemented on this hardware.
 The option must be reduced to a smaller level or reset completely
 For up to 32000 LadderSteps (level 1), at least one PPU2xx.3 is required
 For up to 100000 LadderSteps (level 2|3), at least one PPU2xx.4 is required
Reaction: Alarm display.
Remedy: PLC option cannot be implemented in this product variant
Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

400029 Code warning %2 in the network %1

Explanation: Too many branches in the network
 %1 : Network number
 %2 : Error code 13, block type
Reaction: Alarm display.
Remedy: Network contains too many branches; distribute logic better over a number of networks
Programm continuation: Alarm display showing cause of alarm disappears. No further operator action necessary.

400030 System error, USB machine control panel unsuitable

Explanation: Connected USB machine control panel is not suitable for this CNC.
Reaction: PLC Stop
Remedy: Replace USB-MCP
Programm continuation: Clear alarm with the Delete key or NC START.

400031 System error, the project is not compatible with NCK

Explanation: This project has not been released for this machine.
Reaction: PLC Stop

Remedy: Load original project.
Programm continuation: Clear alarm with the Delete key or NC START.

400032 System error, the project cannot run on this PLC version

Explanation: The project comprises instructions which are not known in this PLC version
Reaction: PLC Stop
Remedy: Load original project.
Programm continuation: Clear alarm with the Delete key or NC START.

400033 Permissible number of commands exceeded: %2 Network %1

Explanation: Permissible number of commands exceeded
 %1 : Network number
 %2 : Current number of commands, block
Reaction: PLC Stop
Remedy: The user project comprises too many commands, shorten user project or activate the option number of commands
Programm continuation: Clear alarm with the Delete key or NC START.

400034 Alarm %1 does not function. The data block DB9913 (ALARM_INI) is not present.

Explanation: Data block DB9913 together with the configuration of the alarm reaction, cancel criterion and channel assignment are not included in the user project.
 %1 : Alarm number of the activated alarm
Reaction: Alarm display.
Remedy: In the PLC programming tool, the special data block DB9913 must be copied from "Libraries" into the project. Alarm reaction, cancel criterion and channel assignment must be specified accordingly. The project must be loaded into the PLC.
Programm continuation: Switch control OFF - ON.

400035 Activation of the infeed via PLC data block, configuration error type %1

Explanation: The infeed cannot be activated because of a configuration error.
 Type 1: Data block DB9914 not included in user project
 Type 2: Settings of the ALM machine data do not match the SDB configuration
Reaction: Alarm display.
Remedy: Type 1: Insert data block DB9914 into user project
 Type 2: Check ALM machine data and SDB configuration
Programm continuation: Switch control OFF - ON.

400036 USB MCP access conflict in the I/O image: log addr. %1 Bus/station/type: %2

Explanation: The memory area intended for the USB MCP is already being used by another device.
 %1 Logical I/O address
 %2 Bus number/station number/type
 Type 0: Address conflict with the inputs.
 Type 1: Address conflict with the outputs.
 Causes of error:
 Incorrect configuration of the I/O in MD12986
 Erroneous "Enable I/O addressing activated for USB MCP" (MD19720, bit_1)
 Incorrect configuration of the I/O in MD12950 (USB MCP address)
Reaction: PLC Stop

Remedy: Check machine data setting MD12950, MD12951, MD12952, MD12986, MD12987, MD19720.1
**Programm
continuation:** Switch control OFF - ON.

400037 USB MCP - invalid configuration in MD19720

Explanation: Mutually exclusive settings are active in the stated machine data (MD19720).
Causes of error:
Bit_1 and bit_0 are set simultaneously.
If a USB MCP is used, only one of the two bits may be set.
(If no USB MCP is configured, then bit_1 is not evaluated)

Reaction: PLC Stop

Remedy: Correct the setting in machine data (MD19720) or remove USB MCP from the configuration (MD12950)

**Programm
continuation:** Switch control OFF - ON.

System responses

10.1 System reactions to SINUMERIK alarms

Response	Effect
Correction block with reorganization	Block preparation has detected an error, which can be corrected by modifying the program. Reorganization is performed after a program modification.
Correction block	Block preparation has detected an error, which can be corrected by modifying the program.
NC switches into the tracking mode	The axes follow-up.
Interpreter stop	Program execution is canceled after all the prepared blocks (IPO buffer) have been processed.
Local alarm response	A local alarm response is output. In the program code, individual actions can be executed, which are checked using this response. For example, the block sequence is interrupted in preprocessing if a compile cycle alarm appears with this response.
No alarm response	No alarm response is initiated.
NC not ready	NC ready is not set: Active fast braking (i.e. with the maximum braking current) for all drives. The controller enable for all NC axes is deleted. NC ready relay contact drops out.
Mode group not ready	Mode group ready is not set: Active fast braking (i.e. with the maximum braking current) is realized for all drives of this mode group. The controller enable of the NC axes involved is deleted.
Channel not ready	Channel ready is not set: Active fast braking (i.e. with the maximum braking current) is realized for all drives of this channel. The controller enable of the NC axes involved is deleted.
NC start inhibit in this channel	A program cannot be started in this channel.
Re-reference axes in this channel	The axes in this channel have to be referenced again.
Interface signals are set	A VDI interface signal alarm is set.
Alarm display	The alarm is displayed at the user interface.
NC stop for alarm	All channel are stopped using a ramp stop.
NC Stop for an alarm at end of block	NC stops if the end of a block is reached.
Alarm reaction in automatic mode	The alarm is displayed whenever bit 0 of machine data MD11411 \$MN_ENABLE_ALARM_MASK is set. The response is be set whenever an alarm should only occur during automatic mode without manual operation by a user.
Message display	The alarm is displayed when bit 1 of machine data MD11411 \$MN_ENABLE_ALARM_MASK is set. The message display is for alarms that are normally suppressed.

10.1 System reactions to SINUMERIK alarms

Response	Effect
Mode group is not ready, is also effective on individual axes	The NC ready is canceled in all mode groups. As a consequence, the response corresponds to an "NC not ready" with the following difference: The "NC ready" is not withdrawn and the corresponding VDI bit is not set, e.g. for Emergency Stop.
All channel-specific alarm reactions delayed on alarm, alarm display	All responses are buffered on a channel-for-channel-specific basis from the incoming alarms and are therefore not active. The alarms are displayed at the user interface. The responses from the mode group and NC are transferred. The delayed alarm responses are activated if the responses are deleted by an activated internal NC code, or by the configured alarm response "Alarm response delay is canceled".
All alarm responses are delayed by one IPO cycle on alarm	All alarm responses are delayed by one cycle when an alarm is issued. This functionality is required as part of ESR development.
The alarm response delay is canceled	The state of "All channel-specific alarm responses delayed on alarm, alarm display" is canceled.
NC start inhibit in this channel, ASUB starts, where relevant, are permitted	A program cannot be started in this channel. ASUBs, where relevant, are permitted.

10.2 Cancel criteria for alarms

Cancel criteria	Effect
Clear the alarm with the Clear key or with NC start.	The alarm is cleared in any channel by pressing the <ALARM CANCEL> key. In addition, the alarm is cleared by pressing the <CYCLE START> or <RESET> key.
The alarm is no longer displayed when the alarm cause has been removed. No other operator actions are required.	Self-clearing alarm. The alarm is not cleared by an operator action, but explicitly by an activated internal NC code.
Clear the alarm with NC start or RESET key and continue the program.	The alarm is cleared by pressing the <CYCLE START> key in the channel in which the alarm occurred. In addition, the alarm is cleared by pressing the <RESET> key.
Switch the control OFF - ON.	The alarm is canceled by switching off the control and switching it on again.
Clear the alarm with the RESET key. Restart the part program.	The alarm is cleared by pressing the <RESET> key in the channel in which the alarm occurred. Then restart the part program.
Press the RESET key to clear the alarm in all channels of this mode group. Restart the part program.	The alarm is cleared in the channels, in which the mode group alarm has occurred, by pressing the <RESET> key. Then restart the part program.
Clear alarm in all channels with the RESET key. Restart the part program.	The alarm is cleared in the channels by pressing the <RESET> key. Then restart the part program.

10.3 System reactions for SINAMICS alarms

Fault responses

The fault reactions used and their meanings are described below:

Designation	NONE
Response	None
Description	No reaction when a fault occurs.

Designation	OFF1
Response	Braking along the ramp-function generator deceleration ramp followed by pulse disable.
Description	Closed loop speed control (p1300 = 20, 21) - The immediate specification of n_set = 0 at the ramp generator deceleration ramp (p1121) causes the drive to be braked. - When zero speed is detected, the motor holding brake (if parameterized) is closed (p1215). The pulses are suppressed when the brake closing time (p1217) expires. The standstill is detected when the speed actual value falls below the speed threshold (p1226) or when the monitoring time (p1227) started when speed setpoint ≤ speed threshold (p1226) has expired. Closed loop torque control (p1300 = 23) - The following applies for torque control: Response as for OFF2. - When the system switches to torque control with p1501, the following applies: There is no separate braking reaction. If the actual speed value falls below the speed threshold (p1226) or the timer stage (p1227) has expired, the motor holding brake (if parameterized) is closed. The pulses are suppressed when the brake closing time (p1217) expires.

Designation	OFF1_DELAYED
Response	As for OFF1, however delayed.
Description	Faults with this fault reaction only become effective after the delay time on p3136 has expired. The remaining time up to OFF1 is displayed in r3137.

Designation	OFF2
Response	Internal/external pulse disable
Description	Closed-loop speed and torque control - Instantaneous pulse suppression, the drive "coasts down". - The motor holding brake (if one is being used) is closed immediately. - Switch-on inhibit is activated.

Designation	OFF3
Response	Braking along the OFF3 deceleration ramp followed by pulse disable
Description	Closed loop speed control (p1300 = 20, 21) - The drive is braked along the OFF3 down ramp (p1135) by immediately entering $n_{set} = 0$. - When zero speed is detected, the motor holding brake (if parameterized) is closed. The pulses are suppressed when the closing time of the holding brake (p1217) expires. Standstill is detected when the speed actual value falls below the speed threshold (p1226) or when the monitoring time (p1227) started when speed setpoint $\leq$ speed threshold (p1226) has expired. - Switch-on inhibit is activated. Closed loop torque control (p1300 = 23) - Switchover to speed-controlled operation and other reactions as described for speed-controlled operation.

Designation	STOP2
Response	$n_{set} = 0$
Description	- The drive is braked along the OFF3 down ramp (p1135) by immediately entering $n_{set} = 0$. - The drive remains in closed-loop speed control.

Designation	IASC/DCBRK
Response	-
Description	- For synchronous motors, the following applies: If a fault occurs with this fault reaction, an internal armature short-circuit is triggered. The conditions for p1231 = 4 must be observed. - For induction motors, the following applies: If a fault occurs with this fault reaction, DC braking is triggered. DC braking must have been commissioned (p1232, p1233, p1234).

Designation	ENCODER
Response	Internal/external pulse disable (p0491)
Description	The fault reaction ENCODER is applied as a function of the setting in p0491. Factory setting: p0491 = 0 → Encoder fault causes OFF2 Please note: When changing p0491, it is imperative that the information in the description of this parameter is carefully observed.

Acknowledge faults

Specifies the default method of acknowledging faults after the cause has been removed.

Designation	POWER ON
Description	The fault is acknowledged by a POWER ON process (switch drive unit off and on again). Note: If the fault cause has still not been resolved, then the fault is immediately displayed again after booting.

Designation	IMMEDIATELY
Description	Faults can be acknowledged on one drive object (Points 1 to 3) or on all drive objects (Point 4) as follows: 1. Acknowledge via setting parameter: – p3981 = 0 → 1 2. Acknowledge via binector inputs: – p2103 BI: 1. Acknowledge faults – p2104 BI: 2. Acknowledge faults – p2105 BI: 3. Acknowledge faults 3. Acknowledging via a PROFIdrive control signal: – STW1.7 = 0 --> 1 (edge) 4. Acknowledge all faults – p2102 BI: Acknowledge all faults Note • These faults can also be acknowledged by a POWER ON. • If this action has not eliminated the fault cause, the fault will continue to be displayed after acknowledgment. • Safety Integrated faults The "Safe Torque Off" (STO) function must be activated in case of these faults: Safe Torque Off must be deselected before these faults are acknowledged.

Designation	PULSE DISABLE
Description	The fault can only be acknowledged with a pulse disable (r0899.11 = 0). The same options are available for acknowledging as described under acknowledgment with IMMEDIATE.

Reference to SINAMICS parameters

In some fields, reference is made to a SINAMICS parameter for the alarms.

The parameter number consists of the letter "p" or "r" as prefix, followed by a 4-digit number (xxxx), and optionally an index, e.g. p0918[0...3].

References

A detailed description of the SINAMICS parameters is provided in the:

SINAMICS S120/S150 List Manual

Stop conditions

0	No stop state active
Reaction:	none
1	Stop: No NC Ready
Reaction:	stop
2	Stop: No Mode Group Ready
Reaction:	stop
3	Stop: Emergency Stop active
Reaction:	stop
4	Stop: Alarm active with Stop
Reaction:	stop
5	Stop: M0/M1 active
Reaction:	stop
6	Stop: Block ended in SBL mode
Reaction:	stop
7	Stop: NC Stop active
Reaction:	stop
8	Wait: Read-in enable missing
Reaction:	stop
9	Wait: Feedrate enable missing
Reaction:	stop
10	Dwell time F%1 still %2 s
Parameters:	%1 = Dwell time: specification from part program %2 = Remaining dwell time
Reaction:	wait
11	Waiting: Aux. funct. ack. missing
Reaction:	stop

12	Wait: Axis enable missing %2 %3 %4
Parameters:	%2 = Channel axis/spindle identifier (before spindle converter) %3 = Channel axis/spindle identifier (before spindle converter) %4 = Channel axis/spindle identifier (before spindle converter)
Reaction:	wait
13	Wait: Exact stop not reached
Reaction:	wait
14	Wait: For positioning axis %2 %3 %4
Reaction:	wait
15	Wait: For spindle %1
Parameters:	%1 = Channel axis identifier
Reaction:	wait
16	Waiting for other channel: %3 %4 %5
Parameters:	%3 = Channel identifier %4 = Channel identifier %5 = Channel identifier
Reaction:	wait
17	Wait: Feedrate override
Reaction:	stop
18	Faulty NC block / user alarm
Reaction:	stop
19	Wait: For NC blocks from external
Reaction:	stop
20	Waiting due to SYNACT instruction
Reaction:	wait
21	Waiting: block search active
Reaction:	wait
22	Wait: No spindle enable %2 %3 %4
Parameters:	%2 = Channel axis identifier %3 = Channel axis identifier %4 = Channel axis identifier
Reaction:	stop
23	Wait: Axis feedrate override is 0: %2 %3 %4
Parameters:	%2 = Channel axis identifier %3 = Channel axis identifier %4 = Channel axis identifier
Reaction:	stop

24 Wait for tool change - acknowledgment

Reaction: wait

25 Wait for gear ratio change %2 %3 %4

Reaction: wait

26 Wait for position control %2 %3 %4

Reaction: wait

27 Wait for thread first cut

Reaction: wait

28 Wait

Reaction: wait

29 Wait for punching

Reaction: wait

30 Wait for safe operation

Reaction: wait

31 STOP: No Channel Ready

Reaction: stop

32 STOP: Reciprocation active

Reaction: wait

33 STOP: Axis replacement active %2 %3 %4

Parameters: %2 = Channel axis identifier

%3 = Channel axis identifier

%4 = Channel axis identifier

Reaction: wait

34 Wait for axis container rotation %2 %3 %4

Parameters: %2 = Axis container

%3 = Axis container

%4 = Axis container

Reaction: wait

35 Wait: AXCT following axis active %2 %3 %4

Parameters: %2 = Axis container

%3 = Axis container

%4 = Axis container

Reaction: wait

36 Wait: AXCT leading axis active %2 %3 %4

Parameters: %2 = Axis container
 %3 = Axis container
 %4 = Axis container

Reaction: wait

37 Wait: Follow up AXCT axis %2 %3 %4

Parameters: %2 = Axis container
 %3 = Axis container
 %4 = Axis container

Reaction: wait

38 Wait: AXCT axis status change %2 %3 %4

Parameters: %2 = Axis container
 %3 = Axis container
 %4 = Axis container

Reaction: wait

39 Wait: AXCT axis/spindle disable %2 %3 %4

Parameters: %2 = Axis container
 %3 = Axis container
 %4 = Axis container

Reaction: wait

40 Wait: AXCT axis superimposed motion active %2 %3 %4

Parameters: %2 = Axis container
 %3 = Axis container
 %4 = Axis container

Reaction: wait

41 Wait: AXCT axis replacement active %2 %3 %4

Parameters: %2 = Axis container
 %3 = Axis container
 %4 = Axis container

Reaction: wait

42 Wait: AXCT axis interpol. active %2 %3 %4

Parameters: %2 = Axis container
 %3 = Axis container
 %4 = Axis container

Reaction: wait

43 Wait for compile cycle

Reaction: wait

44 Wait: Access to system variable %2

Parameters: %2 = Identifier of the system variable with indices.

Reaction: wait

45 Wait: Search target found

Reaction: stop

46 Wait: Rapid retraction triggered

Reaction: wait

47 Wait: AXCT: Wait for spindle stop

Reaction: wait

48 Wait: Synchron. of machine data %2 %3 %4

Parameters: %2 = Axis container

 %3 = Axis container

 %4 = Axis container

Reaction: wait

49 Wait: Axis replacement: Axis coupled %2 %3 %4

Parameters: %2 = Channel axis identifier

 %3 = Channel axis identifier

 %4 = Channel axis identifier

Reaction: wait

50 Wait: Axis repl.: Liftfast active %2 %3 %4

Parameters: %2 = Channel axis identifier

 %3 = Channel axis identifier

 %4 = Channel axis identifier

Reaction: wait

51 Wait: Axis replace.: new config. active %2 %3 %4

Parameters: %2 = Channel axis identifier

 %3 = Channel axis identifier

 %4 = Channel axis identifier

Reaction: wait

52 Wait: Axis replacement: AXCTSW active %2 %3 %4

Parameters: %2 = Channel axis identifier

 %3 = Channel axis identifier

 %4 = Channel axis identifier

Reaction: wait

53 Wait: Axis replacement: Waitp active %2 %3 %4

Parameters: %2 = Channel axis identifier

 %3 = Channel axis identifier

 %4 = Channel axis identifier

Reaction: wait

54	Wait: Axis in another channel %2 %3 %4
Parameters:	%2 = Channel axis identifier %3 = Channel axis identifier %4 = Channel axis identifier
Reaction:	wait
55	Wait: Axis replacement: Axis is PLC axis %2 %3 %4
Parameters:	%2 = Channel axis identifier %3 = Channel axis identifier %4 = Channel axis identifier
Reaction:	wait
56	Wait: Axis replace.: Axis is recip. axis %2 %3 %4
Parameters:	%2 = Channel axis identifier %3 = Channel axis identifier %4 = Channel axis identifier
Reaction:	wait
57	Wait: Axis replacement: axis is JOG axis %2 %3 %4
Parameters:	%2 = Channel axis identifier %3 = Channel axis identifier %4 = Channel axis identifier
Reaction:	wait
58	Wait: Axis replacement: Command axis %2 %3 %4
Parameters:	%2 = Channel axis identifier %3 = Channel axis identifier %4 = Channel axis identifier
Reaction:	wait
59	Wait: Axis replacement: Axis is OEM axis %2 %3 %4
Parameters:	%2 = Channel axis identifier %3 = Channel axis identifier %4 = Channel axis identifier
Reaction:	wait
60	Wait: Coupled following axis %2 %3 %4
Parameters:	%2 = Channel axis identifier %3 = Channel axis identifier %4 = Channel axis identifier
Reaction:	wait
61	Wait: Coupled-motion following axis %2 %3 %4
Parameters:	%2 = Channel axis identifier %3 = Channel axis identifier %4 = Channel axis identifier
Reaction:	wait

62 Wait: Coupled slave axis %2 %3 %4

Parameters: %2 = Channel axis identifier
%3 = Channel axis identifier
%4 = Channel axis identifier

Reaction: wait

63 Stop at cycle end M0

Reaction: stop

64 Stop at cycle end M1

Reaction: stop

65 Axis is at fixed stop %2 %3 %4

Parameters: %2 = Channel axis identifier
%3 = Channel axis identifier
%4 = Channel axis identifier

Reaction: wait

66 Master-slave switchover active

Reaction: wait

67 Axis replace.: axis single axis %2 %3 %4

Parameters: %2 = Channel axis identifier
%3 = Channel axis identifier
%4 = Channel axis identifier

Reaction: wait

68 Stop: destination reached after block search

Reaction: stop

69 Synchronism: Synchronous spindle

Reaction: wait

70 Deactivation position synchron. spindle

Reaction: wait

71 Wait for transformation axis enable %2 %3 %4

Parameters: %2 = Channel axis identifier
%3 = Channel axis identifier
%4 = Channel axis identifier

Reaction: wait

72 Wait because of possible collision

Reaction: stop

73 JOG: Position reached %2 %3 %4

Parameters: %2 = Channel axis identifier
 %3 = Channel axis identifier
 %4 = Channel axis identifier

Reaction: stop

74 Jog: Direction disabled %2 %3 %4

Parameters: %2 = Channel axis identifier
 %3 = Channel axis identifier
 %4 = Channel axis identifier

Reaction: stop

75 Context sensitive stop request %2 %3 %4

Parameters: %2 = Channel axis identifier
 %3 = Channel axis identifier
 %4 = Channel axis identifier
 %7 = Braking priority with sign for the direction of the motion command

Reaction: wait

76 Wait: G4 S%1 still: %2 U

Parameters: %1 = Programmed dwell time in revolutions
 %2 = Remaining revolutions

Reaction: wait

77 Axial feed disable from PLC %2 %3 %4

Parameters: %2 = Channel axis identifier
 %3 = Channel axis identifier
 %4 = Channel axis identifier

Reaction: stop

78 Waiting for axial feedrate enable

Reaction: stop

79 Axial feed disable from Synact %2 %3 %4

Parameters: %2 = Channel axis identifier
 %3 = Channel axis identifier
 %4 = Channel axis identifier

Reaction: wait

80 Wait for speed of master spindle %1

Parameters: %1 = Channel axis identifier

Reaction: wait

81 Wait for parameter set change %2 %3 %4

Parameters: %2 = Channel axis identifier
 %3 = Channel axis identifier
 %4 = Channel axis identifier

Reaction: wait

82 Wait for axis before transformer change %2 %3 %4

Parameters: %2 = Channel axis identifier
 %3 = Channel axis identifier
 %4 = Channel axis identifier

Reaction: wait

83 Waiting for cutting calculation

Parameters: %1 = Progress display

Reaction: wait

84 Wait for measuring system axis %2 %3 %4

Parameters: %2 = Channel axis identifier
 %3 = Channel axis identifier
 %4 = Channel axis identifier

Reaction: wait

85 Override limited: %1

Parameters: %1 = Feedrate override value

Reaction: wait

86 Wait for MMC command

Reaction: wait

87 Overlap not released %2 %3 %4

Reaction: wait

88 Waiting for drive parameter of %2

Parameters: %2 = Part program command "ESRR" or "ESRS"

Reaction: wait

89 Waiting for external device %2

Parameters: %2 = Programmed identifier of the external device"

Reaction: wait

90 Wait for end of program in the channel %3 %4 %5

Parameters: %3 = Channel identifier
 %4 = Channel identifier
 %5 = Channel identifier

Reaction: wait

91 Wait for interpolation buffer

Reaction: wait

92 Configured stop CST G0->G0

Reaction: stop

93 Configured stop CST G0->G1

Reaction: stop

Stop conditions

94	Configured stop CST G1->G0
-----------	--------------------------------------

Reaction:	stop
-----------	------

95	Configured stop CST
-----------	----------------------------

Reaction:	stop
-----------	------

96	Configured stop CST ON
-----------	-------------------------------

Reaction:	stop
-----------	------

97	Configured stop CST WAIT marker
-----------	--

Reaction:	stop
-----------	------

Appendix

A.1 List of abbreviations

Abbreviation	Derivation of the abbreviation	Meaning
AC	Adaptive Control	
ALM	Active Line Module	Infeed module for drives
AP	User program	
AS	Automation system	
ASCII	American Standard Code for Information Interchange	American coding standard for the exchange of information
ASIC	Application Specific Integrated Circuit	User switching circuit
ASUP	Asynchronous subprogram	
AUTO		Operating mode "Automatic"
AUXFU	Auxiliary Function	Auxiliary functions
STL	Statement list	
BA	Operating mode	
Mode group	Mode group	
BERO	Proximity limit switch with feedback oscillator	
BI	Binector Input	
HHU	Handheld unit	
BICO	Binector Connector	Interconnection technology for the drive
BIN	Binary Files	Binary files
BIOS	Basic Input Output System	
BCS	Basic coordinate system	
SSM	System status message	In connection with PLC messages
BO	Binector Output	
OPI	Operator Panel Interface	
CAD	Computer-Aided Design	
CAM	Computer-Aided Manufacturing	
CC	Compile Cycle	Compile cycles
CI	Connector Input	
CF-Card	Compact Flash-Card	
CNC	Computerized Numerical Control	Computerized numerical control
CO	Connector Output	
COM Board	Communication Board	
CP	Communication Processor	
CPU	Central Processing Unit	Central processing unit
CR	Carriage Return	
CRC	Cyclic Redundancy Check	Checksum test
CRT	Cathode Ray Tube	Picture tube

Abbreviation	Derivation of the abbreviation	Meaning
CSB	Central Service Board	PLC module
CTS	Clear To Send	Signals that data is ready to be sent for serial data interfaces
CUTCOM	Cutter Radius Compensation	Tool radius compensation
DB	Data block	Data block in the PLC
DBB	Data-block byte	Data block-byte in the PLC
DBW	Data-block word	Data-block word in the PLC
DBX	Data-block bit	Data-block bit in the PLC
DDE	Dynamic Data Exchange	Dynamic data exchange
DDS	Drive Data Set	Drive data set
DIN	Deutsche Industrie Norm (German Industry Standard)	
DIR	Directory	Directory
DLL	Dynamic Link Library	
DO	Drive Object	Drive object
DPM	Dual Port Memory	
DRAM	Dynamic Random Access Memory	Dynamic memory block
DRF	Differential Resolver Function	Differential resolver function (handwheel)
DRIVE-CLiQ	Drive Component Link with IQ	
DRY	Dry Run	DRY run feedrate
DSB	Decoding Single Block	Decoding single block
DSC	Dynamic Servo Control / Dynamic Stiffness Control	
DSR	Data Send Ready	Signals the availability of serial data interfaces
DW	Data word	
DWORD	Double word (currently 32 bits)	
I	Input	
I/O	Input/Output	
ENC	Encoder	Actual value encoder
EPROM	Erasable Programmable Read Only Memory	Erasable, electronically programmable read-only memory
EQN		Type designation for an absolute encoder with 2048 sine signals per revolution
ESR	Extended stop and retract	
ETC	ETC key	Expansion of the softkey bar in the same menu
FB	Function block	
FBS	Flat screen	
FC	Function Call	Function block in the PLC
FDD	Feed Disable	Feed disable
FdStop	Feed Stop	Feed stop
FEPROM	Flash-EPROM	Read and write memory
FIFO	First In - First Out	Method of storing and retrieving data in a memory
FIPO	Fine interpolator	
FM	Error message	In connection with PLC alarms

Abbreviation	Derivation of the abbreviation	Meaning
FM	Function Module	Hardware (I/O module)
FPU	Floating Point Unit	Floating-point unit
FRA	Frame block	
FRAME	Data set	Coordinate conversion with the components work off-set, rotation, scaling, mirroring
CRC	Cutter radius compensation	
FST	Feed Stop	Feed stop
CSF	Control system flowchart (PLC programming method)	
FW	Firmware	
GC	Global Control	PROFIBUS: Broadcast telegram
GD	Global data	
GEO	Geometry, e.g. geometry axis	
GP	Basic program	
GS	Gear stage	
GUD	Global User Data	Global user data
HD	Hard Disk	Hard disk
HEX	Abbreviation for hexadecimal number	
AuxF	Auxiliary function	
HMI	Human Machine Interface	SINUMERIK user interface
MSD	Main spindle drive	
HT	Handheld Terminal	Handheld unit
HW	Hardware	
COMM	Commissioning	
IF	Drive module pulse enable	
IK (GD)	Implicit communication (global data)	
IKA	Interpolative Compensation	Interpolatory compensation
IM	Interface Modul	Interface module
INC	Increment	Increment
INI	Initializing Data	Initializing data
IGBT	Insulated Gate Bipolar Transistor	
IPO	Interpolator	
ISO	International Organization for Standardization	International Organization for Standardization
JOG	"Jogging" operating mode	
KD	Coordinate rotation	
KDV	Crosswise data comparison	Crosswise data comparison between the NC and PLC
K _v	Servo-gain factor	Gain factor of control loop
LAD	Ladder diagram	PLC programming method
LCD	Liquid Crystal Display	Liquid crystal display
LED	Light Emitting Diode	Light emitting diode
LF	Line Feed	
LMS		Position measuring system
LSB	Least Significant Bit	Least significant bit

Abbreviation	Derivation of the abbreviation	Meaning
LUD	Local User Data	User data
MAC	Media Access Control	
MAIN	Main program	Main program (OB1, PLC)
MB	Megabyte	
MCI	Motion Control Interface	
MCIS	Motion Control Information System	
MCP	Machine Control Panel	Machine control panel
MD	Machine data	
MDI	"Manual Data Automatic" operating mode	Manual input
MCS	Machine coordinate system	
MPF	Main Program File	Main program (NC part program)
MPI	Multi Point Interface	Multi-point interface
NC	Numerical Control	Numerical control
NCK	Numerical Control Kernel	Numerical control kernel
NCSD	NC Start Disable	NC start disable
NCU	Numerical Control Unit	NC hardware unit
IF	Interfaces	Interface signal
WO	Zero offset	
NX	Numerical Extension	Axis expansion module
OB	Organization block in the PLC	
OEM	Original Equipment Manufacturer	
OP	Operation Panel	Operator panel
OPI	Operation Panel Interface	Interface for connection to the operator panel
OSI	Open Systems Interconnection	Standard for computer communications
OPT	Options	Options
PIQ	Process Image Output	
PII	Process Image Input	
P bus	Peripheral bus	
PC	Personal Computer	
PCMCIA	Personal Computer Memory Card International Association	Standard for plug-in memory cards
PCU	Programmable Control Unit	
PI	Programm Instanz	
PG	Programming device	
PLC	Programmable Logic Control	Programmable Logic Controller
PN	PROFINET	
PO	POWER ON	
POU	Program organization unit	Unit in the PLC user program
PPU	Panel Processing Unit	Panel-based control
PTP	Point to Point	Point-to-point
PZD	Process data for drives	
QEC	Quadrant Error Compensation	Quadrant error compensation
QEC	Quadrant error compensation	

Abbreviation	Derivation of the abbreviation	Meaning
RAM	Random Access Memory	Program memory that can be read and written to
REF POINT		Function "Reference point approach" in JOG mode
REPOS		Function "Repositioning" in JOG mode
RID	Read In Disable	Read-in disable
RPA	R-Parameter Active	Memory area on the NC for R parameter numbers
RPY	Roll Pitch Yaw	Rotation type of a coordinate system
RTC	Real Time Clock	Real-time clock
RTS	Request To Send	RTS, control signal of serial data interfaces
SBL	Single Block	Single block
SBR	Subroutine	Subroutine (PLC)
SBT	Safe Brake Test	Safe Brake Test
SCC	Safety Control Channel	
SCL	Structured Control Language	Preferred STEP 7 programming language
SD	Setting-Datum	
SDB	System data block	
SDI	Safe Direction	Safe Motion Direction
SEA	Setting Data Active	Identifier (file type) for setting data
SERUPRO	Search-Run by Program Test	Search run by program test
SFC	System Function Call	
SGE	Safety-related input	
SGA	Safety-related output	
SH	Safe Stop	
SIC	Safety Info Channel	
SK	Softkey	
SKP	Skip	Skip block
SLM	Smart Line Module	
SLP	Safe Limited Position	Safely-Limited Position
SLS	Safely Limited Speed	Safely-Limited Speed
SM	Stepper Motor	
SOS	Safe Operating Stop	Safe Operating Stop
SS1	Safe Stop 1	Safe Stop 1 (time-monitored, ramp-monitored)
SS2	Safe Stop 2	Safe Stop 2
SPF	Subprogram file	Subprogram (NC)
PLC	Programmable Logic Controller	
SRAM	Static Random Access Memory	Static memory block
TNRC	Tool nose radius compensation	
LEC	Leadscrew error compensation	
SSI	Serial synchronous interface	Serial synchronous interface
STO	Safe Torque Off	Safe Torque Off
STW	Control word	
GWPS	Grinding wheel peripheral speed	
SW	Software	
SYF	System Files	System files

Abbreviation	Derivation of the abbreviation	Meaning
SYNACT	SYNACT Synchronized Action	Synchronized action
TB	Terminal Board (SINAMICS)	
TEA	Testing Data Aktive	Identifier for machine data
TCP	Tool Center Point	Tool tip
TCU	Thin Client Unit	
TEA	Testing Data Active	Identifier for machine data
TM	Terminal Module (SINAMICS)	
TO	Tool Offset	Tool offset
TOA	Tool Offset Active	Identifier (file type) for tool offsets
TRANSMIT	Transform Milling into Turning	Coordinate conversion on turning machines for milling operations
TTL	Transistor–Transistor–Logik	Interface type
UFR	User Frame	Zero offset
SR	Subroutine	
USB	Universal Serial Bus	
UPS	Uninterruptible Power Supply	
VDI		Internal communication interface between NC and PLC
FDD	Feed drive	
VPM	Voltage Protection Module	
VSM	Voltage Sensing Module	
WAB		Function "Smooth Approach and Retraction"
WCS	Workpiece coordinate system	
T	Tool coordinate system	
TLC	Tool length compensation	
WPD	Work Piece Directory	Workpiece directory
T	Tool	
TM	Tool management	
TC	Tool change	
ZWS		Buffer location
ZOA	Zero Offset Active	Identifier (file type) for zero offset data
ZSW	Status word (of drive)	

Index

"

"Siemens Industry Online Support" app, 12

A

Alert

0, 25
1000, 25
1001, 25
1002, 26
1004, 26
1005, 26
1010, 27
1011, 27
1012, 28
1013, 28
1014, 29
1015, 29
1016, 29
1017, 30
1018, 30
1019, 31
1020, 31
10203, 102
10204, 103
10208, 103
10209, 103
10222, 104
10223, 104
10225, 104
10226, 104
10299, 104
10601, 105
10604, 105
10605, 105
10610, 106
10620, 106
10621, 107
10622, 107
10625, 107
10630, 108
10631, 108
10632, 108
10633, 109
10634, 109
10635, 109

10636, 109
10637, 110
10650, 110
10651, 110
10652, 111
10653, 111
10654, 112
10655, 112
10656, 112
10657, 112
10658, 113
10700, 113
10701, 114
10702, 114
10703, 114
10704, 115
10706, 115
10707, 115
10720, 115
10721, 116
10722, 116
10723, 117
10730, 118
10731, 119
10732, 119
10733, 120
10735, 120
10736, 121
10740, 121
10741, 122
10742, 122
10743, 122
10744, 122
10745, 123
10746, 123
10747, 123
10748, 124
10750, 124
10751, 124
10752, 125
10753, 125
10754, 126
10755, 126
10756, 127
10757, 127
10758, 127
10759, 128
10760, 128
10761, 129

10762, 129	10990, 145
10763, 129	1160, 31
10764, 130	12000, 146
10770, 130	12010, 146
10776, 130	12020, 146
10777, 131	120200, 615
10778, 131	12030, 147
10780, 131	12040, 147
10781, 132	120400, 615
10782, 132	120401, 615
10784, 132	120402, 615
10785, 133	120403, 616
10790, 133	120404, 616
10791, 133	120405, 616
10792, 134	120406, 616
10793, 134	120407, 617
10794, 134	120408, 617
10795, 134	120409, 617
10805, 135	12050, 147
10810, 135	12060, 148
10820, 135	12070, 148
10860, 136	12080, 148
10861, 136	12090, 149
10862, 137	12100, 149
10865, 137	12110, 150
10866, 137	12120, 150
10870, 138	12140, 150
10880, 138	12150, 151
10881, 138	12160, 151
10882, 139	12161, 151
10883, 139	12162, 152
10890, 139	12163, 154
10891, 139	12164, 154
10900, 140	12170, 154
10910, 140	12180, 155
10911, 140	12185, 155
10913, 141	12190, 155
10914, 141	12200, 156
10915, 141	12205, 156
10916, 142	12210, 156
10917, 142	12220, 157
10930, 142	12230, 157
10931, 143	12240, 157
10932, 143	12250, 158
10933, 143	12260, 158
10934, 143	12261, 158
10950, 144	12270, 159
10959, 144	12280, 159
10960, 144	12290, 159
10961, 145	12300, 160
10963, 145	12310, 160
10964, 145	12320, 161

12330, 161	12641, 180
12340, 162	12650, 180
12350, 162	12660, 181
12360, 163	12661, 181
12370, 163	12700, 181
12380, 163	12701, 181
12390, 164	12710, 182
12400, 164	12712, 182
12410, 165	12720, 182
12420, 165	12722, 182
12430, 165	12724, 183
12440, 166	12726, 183
12450, 166	12728, 183
12460, 166	12730, 183
12470, 167	12740, 184
12475, 167	12750, 184
12480, 168	12755, 184
12481, 168	12780, 185
12490, 168	14000, 185
12495, 169	14001, 185
12500, 169	14004, 186
12510, 169	14005, 186
12520, 170	14006, 186
12530, 170	14007, 186
12540, 171	14009, 187
12550, 171	14010, 187
12551, 171	14011, 187
12552, 172	14012, 188
12553, 172	14013, 188
12554, 173	14014, 189
12555, 173	14015, 189
12556, 173	14016, 189
12560, 174	14017, 190
12571, 174	14018, 190
12572, 174	14019, 190
12573, 175	14020, 191
12580, 175	14021, 191
12581, 175	14022, 191
12582, 175	14024, 192
12583, 176	14025, 192
12584, 176	14026, 192
12585, 177	14027, 192
12586, 177	14028, 193
12587, 177	14030, 193
12588, 178	14034, 193
12589, 178	14035, 193
12590, 178	14036, 194
12600, 179	14037, 194
12610, 179	14038, 194
12620, 179	14039, 194
12630, 179	14040, 195
12640, 180	14045, 195

14048, 195	14210, 216
14050, 196	14250, 217
14051, 196	14260, 217
14055, 196	14270, 218
14060, 197	14280, 218
14065, 197	14290, 218
14066, 197	14300, 218
14070, 198	14320, 219
14080, 199	14400, 219
14082, 199	14401, 220
14085, 199	14402, 221
14088, 200	14404, 221
14089, 200	14406, 222
14091, 200	14407, 223
14092, 201	14408, 223
14093, 202	14409, 223
14094, 202	14410, 224
14095, 202	14411, 224
14096, 202	14412, 224
14097, 203	14413, 224
14098, 203	14414, 225
14099, 204	14415, 225
14102, 204	14420, 225
14103, 204	14430, 226
14109, 205	14432, 226
14130, 206	14434, 226
14140, 206	14500, 226
14144, 206	14510, 227
14146, 206	14520, 227
14149, 207	14530, 227
14150, 209	14540, 228
14151, 209	14541, 228
14152, 209	14542, 228
14153, 210	14543, 229
14154, 210	14544, 229
14155, 210	14545, 229
14156, 211	14546, 229
14157, 211	14547, 230
14159, 211	14548, 230
14160, 211	14549, 230
14161, 212	14550, 231
14162, 212	14551, 231
14163, 213	14600, 232
14165, 213	14601, 232
14166, 214	14602, 232
14170, 214	14603, 233
14180, 214	14615, 233
14185, 215	14620, 233
14196, 215	14621, 234
14197, 216	14622, 234
14199, 216	14623, 234
14200, 216	14624, 234

14625, 234	150004, 618
14650, 235	150005, 618
14660, 235	150006, 618
14700, 235	15010, 252
14701, 236	150100, 619
14710, 236	15020, 252
14711, 238	150201, 619
14712, 238	150202, 619
14750, 239	150204, 619
14751, 239	150205, 620
14752, 240	150206, 620
14753, 240	150207, 620
14754, 240	15021, 253
14756, 241	15025, 253
14757, 241	15030, 254
14758, 241	150300, 620
14760, 242	150301, 620
14761, 242	150400, 620
14762, 242	150401, 621
14769, 243	150402, 621
14770, 243	150403, 621
14780, 243	150404, 621
14781, 244	150405, 621
14782, 244	150406, 622
14783, 244	150407, 622
14784, 245	150408, 622
14785, 245	150410, 622
14790, 245	150411, 622
14800, 246	150412, 622
14810, 246	150413, 623
14811, 246	150414, 623
14812, 247	150420, 623
14815, 247	150421, 623
14820, 247	150422, 623
14821, 247	150423, 624
14822, 248	150424, 624
14823, 249	150425, 624
14824, 249	15100, 254
14840, 249	15110, 254
14850, 250	15120, 255
14860, 250	15122, 255
14861, 250	15150, 255
14862, 251	15160, 256
14863, 251	15165, 256
14900, 251	15166, 257
14910, 251	15170, 257
14920, 252	15171, 257
15000, 252	15172, 258
150000, 617	15173, 258
150001, 617	15175, 258
150002, 618	15176, 258
150003, 618	15177, 259

15180, 259	16500, 274
15182, 259	16510, 274
15185, 260	16600, 275
15186, 260	16605, 275
15187, 260	16670, 276
15188, 260	16671, 276
15190, 261	16672, 276
15300, 261	16673, 277
15320, 261	16674, 277
15330, 262	16675, 277
15340, 262	16676, 278
15350, 262	16677, 278
15370, 262	16678, 278
15380, 262	16679, 279
15390, 263	16680, 279
15395, 263	16681, 279
15400, 263	16682, 280
15410, 264	16684, 280
15420, 264	16685, 280
15450, 264	16686, 280
15460, 264	16687, 281
15500, 265	16690, 281
15700, 265	16692, 281
15701, 265	16694, 282
15800, 265	16695, 282
15810, 266	16696, 282
15900, 266	16697, 282
15950, 267	16698, 283
15960, 267	16699, 283
16000, 267	16700, 283
16005, 267	16701, 284
16010, 268	16715, 284
16015, 268	16720, 284
16016, 268	16730, 284
16017, 268	16735, 285
16020, 269	16736, 285
16025, 270	16740, 286
16100, 270	16746, 286
16105, 270	16747, 286
16111, 271	16748, 287
16112, 271	16750, 287
16120, 271	16751, 287
16130, 272	16757, 288
16140, 272	16758, 288
16150, 272	16760, 288
16200, 272	16761, 289
16300, 273	16762, 289
16400, 273	16763, 289
16410, 273	16765, 289
16420, 273	16766, 290
16430, 274	16767, 290
16440, 274	16769, 290

16770, 290	16932, 304
16771, 291	16933, 305
16772, 291	16934, 305
16773, 291	16935, 305
16774, 292	16936, 305
16775, 292	16937, 306
16778, 292	16938, 306
16779, 293	16939, 306
16780, 293	16940, 306
16781, 293	16941, 307
16782, 293	16942, 307
16783, 294	16943, 307
16785, 294	16944, 308
16787, 294	16945, 308
16788, 295	16946, 309
16790, 295	16947, 309
16791, 295	16948, 309
16792, 295	16949, 309
16793, 296	16950, 310
16794, 296	16951, 310
16795, 296	16952, 311
16796, 296	16953, 311
16797, 297	16954, 311
16800, 297	16955, 312
16810, 297	16956, 312
16820, 298	16957, 312
16830, 298	16959, 312
16904, 298	16960, 313
16905, 298	16961, 313
16906, 299	16962, 313
16907, 299	16963, 313
16908, 299	16964, 313
16909, 299	16966, 314
16911, 299	16967, 314
16912, 300	16968, 314
16913, 300	17001, 315
16914, 300	17010, 315
16915, 300	17018, 316
16916, 300	17020, 316
16918, 301	17030, 317
16919, 301	17035, 317
16920, 301	17040, 317
16921, 301	17050, 317
16922, 302	17052, 318
16923, 302	17055, 318
16924, 302	17060, 319
16925, 302	17070, 319
16926, 303	17071, 319
16927, 303	17080, 319
16928, 303	17090, 320
16930, 304	17095, 320
16931, 304	17100, 320

17110, 320	17630, 338
17120, 321	17640, 338
17130, 321	17650, 339
17140, 321	17800, 339
17150, 322	17810, 339
17160, 322	17811, 339
17170, 322	17812, 340
17180, 323	17813, 340
17181, 323	17814, 340
17182, 323	17815, 341
17183, 324	17821, 341
17184, 324	17822, 341
17188, 324	17823, 341
17189, 325	17825, 342
17190, 325	17830, 342
17191, 326	17831, 342
17192, 326	17833, 342
17193, 326	17900, 343
17194, 327	18000, 343
17195, 327	18001, 344
17200, 327	18002, 344
17202, 328	18003, 345
17210, 328	18004, 346
17212, 329	18005, 347
17214, 329	18006, 347
17215, 329	18100, 347
17216, 330	18101, 347
17218, 330	18102, 348
17220, 330	18205, 348
17224, 330	18300, 348
17230, 331	18310, 348
17240, 331	18311, 349
17241, 331	18312, 349
17250, 332	18313, 349
17255, 332	18314, 349
17260, 332	2000, 32
17261, 332	20000, 350
17262, 333	20001, 350
17270, 333	20002, 351
17500, 334	20003, 351
17501, 334	20004, 351
17502, 335	20005, 352
17503, 335	20006, 352
17505, 335	20007, 353
17510, 335	20008, 353
17600, 336	2001, 32
17601, 336	20050, 353
17602, 337	20051, 353
17603, 337	20052, 354
17604, 337	20053, 354
17610, 338	20054, 354
17620, 338	20055, 354

20056, 355	201034, 633
20057, 355	201035, 633
20058, 355	201036, 633
20059, 356	201038, 634
20060, 356	201039, 634
20062, 356	201040, 635
20064, 357	201041, 635
20065, 357	201042, 636
20070, 357	201043, 638
20071, 357	201044, 639
20072, 358	201045, 639
20073, 358	201049, 639
20075, 358	201050, 639
20076, 358	201054, 640
20077, 359	201055, 640
20078, 359	201056, 640
20079, 359	201057, 641
20080, 360	201058, 641
20082, 360	201059, 641
20083, 360	201060, 641
20085, 361	201061, 642
20090, 361	201063, 642
20091, 361	201064, 642
20092, 362	201068, 642
20093, 362	201069, 643
20094, 362	201070, 643
20095, 363	201072, 643
20096, 363	201073, 643
20097, 364	201082, 644
201000, 625	201097, 646
201001, 625	201099, 646
201002, 626	201100, 646
201003, 626	201105, 647
201004, 626	201106, 647
201005, 626	201107, 647
201006, 627	201110, 647
201007, 628	201111, 647
201009, 628	201112, 648
201010, 628	201120, 648
201011, 628	201122, 648, 649
201012, 629	201123, 649
201013, 629	201150, 649
201014, 629	201151, 649
201015, 630	201152, 650
201016, 630	20120, 364
201017, 630	201200, 650
201020, 631	201205, 650
201023, 631	20121, 364
201030, 631	20122, 364
201031, 632	201221, 651
201032, 632	201222, 651
201033, 632	201223, 651

201224, 653	20141, 367
20123, 364	201416, 675
20124, 365	201420, 675
20125, 365	201425, 676
201250, 653	201428, 677
201251, 653	20143, 367
201255, 653	20144, 367
201256, 654	20145, 368
201260, 654	201451, 677
201275, 654	20146, 368
201276, 655	20147, 368
20130, 365	20148, 369
201302, 655	201481, 678, 679
201303, 655	201482, 679
201304, 656	201483, 680
201305, 656	201484, 681
201306, 657	201485, 681
201314, 657	201486, 682
201317, 657	201487, 682
201318, 658	201489, 683
201319, 658	20149, 369
201320, 658	20150, 369
201321, 659	201507, 683
201322, 659	201508, 684
201323, 659	201510, 684
201324, 659	201511, 684
201325, 660	201512, 685
201330, 660	201513, 685
201331, 662	201514, 685
201340, 662	201515, 686
201341, 663	201590, 686
201354, 664	20160, 370
201355, 664	201600, 686, 687
201356, 665	201611, 687, 691
201357, 665	201612, 695
201358, 666	201620, 696
201359, 666	201621, 696
201360, 666	201625, 696
201361, 667	201630, 697
201362, 668	201631, 698
201375, 669	201632, 698
20138, 366	201640, 699, 700
201380, 670	201641, 700, 701
201381, 670, 671	201649, 702
201382, 672	201650, 702, 704
201383, 672	201651, 706
201384, 673	201652, 707, 709
201385, 673	201653, 712
201386, 674	201654, 712
201389, 674	201655, 713
20139, 366	201656, 713
20140, 366	201657, 714

201658, 714	201752, 770
201659, 714, 717, 718	201780, 770
201660, 719	201781, 770
201663, 719	201782, 771
201664, 720	201783, 771
201665, 720	201784, 772
201669, 721	201785, 773
201670, 721	201786, 773
201671, 722	201787, 773
201672, 722, 723	201788, 774
201673, 724	201789, 774
201674, 724	201794, 774
201675, 725	201795, 775
201679, 725	201796, 775
201680, 725	201797, 776
201681, 726, 730	201798, 776
201682, 734, 735	201799, 776
201683, 737	201800, 777
201684, 737	201839, 777
201685, 738	201840, 778
201686, 738	201900, 778
201687, 739	201902, 780
201688, 739	201903, 781
201689, 740	201910, 781
201690, 740	201911, 782
201691, 741	201912, 782
201692, 741	201913, 782
201693, 741	201914, 783
201694, 742	201915, 783
201695, 742	201920, 783
201696, 743	201921, 783
201697, 743	201930, 784
201698, 743	201931, 784
201699, 744	201932, 784
20170, 370	201940, 784
201700, 744	201941, 785
201701, 745	201943, 785
201706, 745, 746	201944, 785
201707, 746	201945, 786
201708, 747	201946, 786
201709, 747	201950, 786
201710, 748	201951, 786
201711, 748, 755	201952, 787
201712, 765	201953, 787
201714, 767	201954, 787
201715, 767	201955, 788
201716, 767	201970, 788
201717, 768	201971, 788
201730, 768	201977, 788
201745, 769	201978, 789
201750, 769	201979, 789
201751, 769	201980, 789

201981, 789	203000, 803
201982, 790	203001, 803
201983, 790	20302, 372
201989, 790	20304, 372
201990, 790	20306, 372
20200, 370	20308, 372
202000, 791	20310, 372
202005, 791	203500, 803
202006, 791	203501, 804
202007, 791	203505, 804
202008, 792	203506, 805
202009, 792	203507, 805
20201, 370	203510, 806, 807
202010, 792	203550, 807
202011, 793	203590, 807
202015, 793	205000, 808
202016, 793	205001, 808
202020, 793	205002, 808
202025, 794	205003, 808
202026, 794	205004, 809
20203, 371	205005, 809
202030, 794	205006, 809
20204, 371	205007, 809
202040, 795	205050, 810
202041, 795	205051, 810
202047, 795	205052, 810
20205, 371	205053, 810
202050, 796	205054, 811
202051, 796	205055, 811
202055, 796	205056, 811
202056, 796	205057, 811
202057, 797	205058, 812
202058, 797	205059, 812
202059, 797	205060, 812
202060, 797	205061, 812
202061, 798	205064, 812
202062, 798	205066, 813
202063, 798	205118, 813
202070, 798	205119, 814
202075, 798	206000, 814
202080, 799	206010, 815
202085, 799	206050, 815
202095, 799	206052, 816
202096, 799	206080, 816
202097, 800	206100, 816
202098, 800	206105, 817
202099, 801	206200, 817
202100, 801	206205, 817
202150, 801	206206, 818
202151, 802	206207, 819
202152, 802	206208, 819
202153, 802	206210, 819

206211, 820	207085, 839
206215, 820	207086, 839
206250, 821	207087, 839
206255, 821	207088, 840
206260, 822	207089, 840
206261, 822	207090, 840
206262, 822	207091, 841
206300, 823	207092, 841
206301, 823	207093, 841
206310, 823	207094, 842
206311, 824	207095, 842
206320, 824	207097, 842
206321, 824	207098, 843
206350, 825	207100, 843
206351, 825	207110, 843
206400, 826	207140, 844
206401, 826	207200, 844
206500, 826	207220, 844
206502, 827	207300, 844, 845
206503, 827	207320, 845
206504, 827	207321, 845
206505, 828	207329, 846
206601, 828	207334, 846
206602, 828	207350, 846
206700, 829	207351, 847
206800, 829	207354, 847
206810, 829	207355, 848
206849, 829	207356, 849
206850, 830	207400, 849
206851, 830	207402, 850
206855, 830	207403, 850
206860, 831	207404, 850
206900, 831	207405, 850
206901, 831	207410, 851
206904, 832	207411, 851
206905, 832	207412, 851
206906, 832	207413, 852
206907, 832	207414, 853
206908, 833	207415, 853
206909, 833	207419, 854
207011, 833	207420, 854
207012, 834	207421, 855
207013, 835	207422, 855
207014, 835	207429, 855
207015, 836	207430, 856
207016, 836	207431, 856
207017, 836	207432, 856
207018, 837	207433, 857
207080, 837	207434, 857
207082, 837	207435, 858
207083, 838	207439, 858
207084, 838	207448, 859

207449, 859	207820, 878
207500, 860	207840, 879
207501, 860	207841, 879
207502, 860	207850, 880
207504, 861	207851, 880
207509, 861	207852, 880
207510, 861	207860, 880
207511, 862	207861, 881
207512, 862	207862, 881
207514, 862	207890, 881
207515, 863	207900, 881
207516, 863	207901, 882
207517, 864	207902, 882
207518, 864	207903, 883
207519, 864	207904, 883
207520, 865	207905, 884
207530, 865	207906, 884
207531, 865	207907, 885
207532, 865	207908, 885
207541, 866	207909, 886
207550, 866	207910, 886
207551, 867	207913, 886
207552, 867	207914, 887
207553, 868	207918, 887
207555, 868	207927, 887
207556, 869	207928, 887
207560, 869	207930, 888
207561, 870	207931, 889
207562, 870	207932, 889
207563, 871	207934, 889
207565, 871	207935, 890
207566, 871	207950, 891
207567, 871	207955, 891
207569, 872	207956, 892
207570, 872	207960, 892
207575, 872	207961, 893
207576, 873	207963, 893
207580, 873	207965, 894
207750, 873	207966, 894
207751, 873	207971, 895
207752, 874	207979, 895
207753, 874	207980, 895
207754, 874	207990, 895, 897
207755, 875	207991, 901
207756, 875	207993, 901
207800, 875	207995, 901
207801, 876	207996, 904
207802, 876	207998, 905
207805, 877	207999, 905
207808, 877	208000, 905
207810, 877	208010, 905
207815, 877, 878	208500, 906

208501, 906	21612, 374
208502, 906	21614, 375
208504, 906	21616, 375
208510, 907	21617, 375
208511, 907	21618, 375
208520, 908	21619, 376
208526, 908	21620, 376
208530, 908	21621, 377
208531, 909	21650, 377
208550, 909	21660, 377
208560, 909	21675, 378
208561, 909	21700, 378
208562, 910	21701, 378
208563, 910	21702, 379
208564, 911	21703, 379
208565, 911	21740, 380
208700, 911	21760, 380
208701, 912	21800, 380
208702, 912	21900, 381
208703, 913	22000, 382
208751, 913	22001, 382
208752, 913	22002, 383
208753, 913	22005, 383
208754, 914	22006, 384
208755, 914	22010, 384
208756, 914	22011, 384
208757, 914	22012, 384
208758, 915	22013, 385
208759, 915	22014, 385
208760, 915	22015, 385
208800, 916	22016, 386
209000, 916	22018, 386
2110, 33	22019, 386
2130, 33	22020, 386
213000, 916	22022, 387
213001, 917	22024, 387
213009, 917	22025, 388
213010, 918	22026, 388
213020, 918	22030, 388
213021, 918	22033, 388
213030, 918	22035, 389
213031, 919	22036, 389
213032, 919	22037, 390
213033, 919	22038, 390
213100, 919	22040, 390
213101, 920	22050, 391
213102, 920	22051, 391
2140, 33	22052, 391
21550, 373	22053, 392
21600, 373	22055, 392
21610, 373	22057, 392
21611, 374	22058, 393

22062, 393	230032, 932
22064, 393	230033, 932
22065, 394	230034, 933
22066, 394	230035, 933
22067, 394	230036, 933
22068, 395	230037, 934
22069, 395	230038, 934
22070, 395	230039, 934
22071, 396	230040, 935
22100, 396	230041, 935
22200, 397	230042, 936
22250, 397	230043, 936
22270, 397	230044, 937
22271, 398	230045, 937
22272, 398	230046, 938
22275, 398	230047, 938
22280, 399	230048, 938
22282, 399	230049, 939
22290, 399	230050, 939
22291, 400	230051, 939
22292, 400	230052, 940
22295, 401	230053, 940
22296, 402	230054, 940
22297, 402	230055, 940
22320, 403	230057, 941
22321, 403	230058, 941
22322, 403	230059, 941
22324, 403	230060, 942
22326, 404	230061, 942
22400, 404	230066, 942
230001, 920	230067, 943
230002, 921	230068, 943
230003, 922	230070, 943
230004, 922	230071, 944
230005, 923	230072, 944
230006, 923	230073, 944
230008, 923	230074, 944
230010, 924	230075, 945
230011, 924	230076, 945
230012, 924	230077, 946
230013, 925	230078, 946
230015, 925	230079, 946
230016, 926	230080, 946
230017, 926	230081, 947
230020, 927	230082, 948
230021, 928	230083, 948
230022, 928	230086, 949
230024, 929	230087, 949
230025, 929	230105, 949
230027, 929	230314, 949
230030, 931	230315, 949
230031, 931	230502, 950

230600, 950	230802, 992
230611, 951, 953	230804, 993
230620, 956	230805, 993
230621, 956	230809, 993
230625, 956	230810, 993
230630, 957	230820, 993
230631, 958	230835, 994
230632, 958	230836, 995
230640, 959, 960	230837, 995
230649, 961	230845, 995
230650, 961	230850, 996
230651, 962	230851, 996
230652, 962	230853, 996
230655, 963	230860, 996
230656, 963	230875, 997
230657, 964	230885, 998
230659, 964, 965	230886, 998
230664, 966	230887, 999
230665, 966	230895, 999
230666, 967	230896, 999
230672, 967	230899, 1000
230674, 967	230903, 1000
230680, 968	230907, 1000
230681, 968, 970	230919, 1001
230682, 972, 973	230920, 1001
230683, 974	230930, 1001
230684, 975	230950, 1001
230685, 975	230999, 1002
230686, 975	231100, 1002
230688, 976	231101, 1002
230692, 976	231103, 1003
230693, 977	231110, 1003
230700, 977	231111, 1005
230701, 978	231112, 1006
230706, 978, 979	231115, 1007
230707, 979	231116, 1007
230708, 980	231117, 1008
230709, 980	231118, 1008
230710, 981	231120, 1009
230711, 981, 984	231121, 1009
230712, 988	231122, 1010
230714, 988	231123, 1010
230715, 989	231125, 1010
230716, 989	231126, 1011
230717, 990	231129, 1011
230730, 990	231130, 1012
230788, 991	231131, 1012
230797, 991	231135, 1013
230798, 991	231136, 1014
230799, 991	231137, 1015
230800, 992	231138, 1017
230801, 992	231142, 1019

231150, 1019	231875, 1040
231151, 1019	231885, 1041
231152, 1019	231886, 1041
231153, 1020	231887, 1042
231160, 1020	231895, 1042
231161, 1020	231896, 1043
231163, 1021	231899, 1043
231400, 1021	231902, 1043
231401, 1021	231903, 1044
231405, 1022	231905, 1044
231407, 1022	231912, 1045
231410, 1022	231915, 1046
231411, 1023	231916, 1046
231412, 1023	231920, 1047
231414, 1024	231930, 1047
231415, 1024	231940, 1048
231418, 1025	231950, 1048
231419, 1025	231999, 1048
231421, 1026	232100, 1048
231422, 1026	232101, 1049
231429, 1027	232103, 1049
231431, 1027	232110, 1050
231432, 1027	232111, 1051
231442, 1028	232112, 1052
231443, 1028	232115, 1052
231460, 1028	232116, 1053
231461, 1029	232117, 1053
231462, 1029	232118, 1054
231463, 1029	232120, 1054
231470, 1030	232121, 1055
231500, 1030	232122, 1055
231501, 1030	232123, 1056
231502, 1031	232125, 1056
231503, 1031	232126, 1056
231700, 1031	232129, 1057
231800, 1031	232130, 1057
231801, 1032	232131, 1058
231802, 1032	232135, 1058
231804, 1032	232136, 1059
231805, 1033	232137, 1060
231806, 1033	232138, 1063
231811, 1034	232142, 1065
231812, 1035	232150, 1065
231813, 1035	232151, 1065
231820, 1036	232152, 1065
231835, 1036	232153, 1066
231836, 1037	232160, 1066
231837, 1037	232161, 1066
231845, 1038	232163, 1067
231850, 1038	232400, 1067
231851, 1039	232401, 1067
231860, 1039	232405, 1068

232407, 1068	232912, 1089
232410, 1068	232915, 1089
232411, 1069	232916, 1090
232412, 1069	232920, 1090
232414, 1070	232930, 1090
232415, 1070	232940, 1091
232418, 1071	232950, 1091
232419, 1071	232999, 1091
232421, 1071	233100, 1092
232422, 1072	233101, 1092
232429, 1072	233103, 1092
232431, 1073	233110, 1093
232432, 1073	233111, 1095
232442, 1073	233112, 1095
232443, 1073	233115, 1096
232460, 1074	233116, 1096
232461, 1074	233117, 1097
232462, 1075	233118, 1097
232463, 1075	233120, 1097
232470, 1075	233121, 1098
232500, 1075	233122, 1098
232501, 1076	233123, 1099
232502, 1076	233125, 1099
232503, 1076	233126, 1099
232700, 1076	233129, 1100
232800, 1077	233130, 1100
232801, 1077	233131, 1101
232802, 1077	233135, 1101
232804, 1077	233136, 1102
232805, 1078	233137, 1103
232806, 1078	233138, 1106
232811, 1079	233142, 1108
232812, 1080	233150, 1108
232813, 1080	233151, 1108
232820, 1080	233152, 1108
232835, 1081	233153, 1109
232836, 1082	233160, 1109
232837, 1082	233161, 1109
232845, 1082	233163, 1110
232850, 1083	233400, 1110
232851, 1083	233401, 1110
232860, 1084	233405, 1111
232875, 1084	233407, 1111
232885, 1085	233410, 1111
232886, 1085	233411, 1112
232887, 1086	233412, 1112
232895, 1086	233414, 1113
232896, 1087	233415, 1113
232899, 1087	233418, 1114
232902, 1087	233419, 1114
232903, 1087	233421, 1114
232905, 1088	233422, 1115

233429, 1115	234800, 1135
233431, 1116	234801, 1136
233432, 1116	234802, 1136
233442, 1116	234803, 1136
233443, 1116	234804, 1136
233460, 1117	234805, 1136
233461, 1117	234806, 1137
233462, 1118	234807, 1137
233463, 1118	234820, 1137
233470, 1118	234835, 1138
233500, 1118	234836, 1138
233501, 1119	234837, 1139
233502, 1119	234845, 1139
233503, 1119	234850, 1140
233700, 1119	234851, 1140
233800, 1120	234860, 1140
233801, 1120	234875, 1141
233802, 1120	234885, 1142
233804, 1120	234886, 1142
233805, 1121	234887, 1143
233806, 1121	234895, 1143
233811, 1122	234896, 1144
233812, 1123	234899, 1144
233813, 1123	234903, 1144
233820, 1123	234904, 1144
233835, 1124	234905, 1145
233836, 1125	234920, 1145
233837, 1125	234950, 1145
233845, 1125	234999, 1145
233850, 1126	235000, 1146
233851, 1126	235001, 1146
233860, 1127	235002, 1147
233875, 1127	235003, 1147
233885, 1128	235004, 1147
233886, 1128	235005, 1148
233887, 1129	235006, 1149
233895, 1129	235009, 1149
233896, 1130	235011, 1149
233899, 1130	235012, 1149
233902, 1130	235013, 1150
233903, 1130	235014, 1152
233905, 1131	235015, 1152
233912, 1132	235016, 1153
233915, 1132	235040, 1154
233916, 1133	235043, 1154
233920, 1133	235051, 1154
233930, 1133	235052, 1156
233940, 1134	235053, 1156
233950, 1134	235054, 1157
233999, 1134	235075, 1157
234207, 1135	235080, 1157
234211, 1135	235081, 1158

235150, 1158	235837, 1179
235151, 1158	235845, 1179
235152, 1159	235850, 1180
235200, 1160	235851, 1180
235207, 1160	235860, 1180
235208, 1161	235875, 1181
235209, 1161	235885, 1182
235210, 1162	235886, 1182
235211, 1162	235887, 1183
235212, 1163	235895, 1183
235213, 1163	235896, 1184
235214, 1163	235899, 1184
235220, 1164	235903, 1184
235221, 1164	235904, 1184
235222, 1164	235905, 1185
235223, 1165	235906, 1185
235224, 1165	235907, 1185
235225, 1166	235910, 1185
235226, 1166	235911, 1186
235227, 1166	235920, 1186
235228, 1166	235921, 1186
235229, 1167	235922, 1186
235230, 1167	235923, 1187
235231, 1168	235924, 1187
235232, 1168	235925, 1187
235233, 1168	235926, 1188
235400, 1169	235927, 1188
235401, 1169	235928, 1188
235402, 1170	235929, 1188
235403, 1170	235930, 1189
235404, 1171	235931, 1189
235405, 1171	235950, 1189
235406, 1172	235999, 1190
235407, 1172	236207, 1190
235410, 1173	236211, 1190
235411, 1173	236214, 1190
235412, 1174	236216, 1191
235413, 1174	236217, 1191
235414, 1174	236800, 1191
235415, 1174	236801, 1191
235416, 1175	236802, 1191
235417, 1175	236804, 1192
235800, 1175	236805, 1192
235801, 1176	236820, 1192
235802, 1176	236835, 1193
235803, 1176	236836, 1193
235804, 1176	236837, 1194
235805, 1177	236845, 1194
235807, 1177	236851, 1195
235820, 1177	236860, 1195
235835, 1178	236875, 1196
235836, 1179	236885, 1197

236886, 1197	237903, 1216
236887, 1198	237950, 1217
236895, 1198	237999, 1217
236896, 1198	240000, 1217
236899, 1199	240001, 1218
236950, 1199	240002, 1218
236999, 1199	240003, 1218
237001, 1199	240004, 1218
237002, 1200	240005, 1218
237003, 1200	240100, 1219
237004, 1200	240101, 1219
237005, 1201	240102, 1219
237012, 1201	240103, 1219
237013, 1201	240104, 1219
237024, 1202	240105, 1220
237025, 1202	240799, 1220
237034, 1203	240801, 1220
237036, 1203	240820, 1220
237040, 1203	240825, 1221
237041, 1204	240835, 1221
237043, 1204	240836, 1222
237044, 1204	240837, 1222
237045, 1204	240845, 1223
237049, 1205	240851, 1223
237050, 1205	240860, 1223
237052, 1205	240875, 1224
237056, 1205	240885, 1225
237310, 1206	240886, 1225
237311, 1206	240887, 1225
237312, 1207	240895, 1226
237313, 1207	249150, 1226
237502, 1207	249151, 1226
237800, 1208	249152, 1227
237801, 1208	249153, 1227
237802, 1208	249154, 1227
237804, 1208	249155, 1227
237805, 1209	249156, 1228
237820, 1209	249170, 1228
237835, 1210	249171, 1228
237836, 1210	249172, 1228
237837, 1210	249173, 1228
237845, 1211	249920, 1229
237850, 1211	249921, 1229
237851, 1212	249922, 1229
237860, 1212	249923, 1229
237875, 1213	249924, 1230
237885, 1214	249926, 1230
237886, 1214	249927, 1230
237887, 1215	249933, 1230
237895, 1215	249934, 1230
237896, 1216	249935, 1231
237899, 1216	249936, 1231

249937, 1231	26016, 418
249938, 1231	26017, 419
249939, 1232	26018, 419
249940, 1232	26019, 419
249941, 1232	26020, 420
249942, 1232	26022, 420
249998, 1232	26024, 420
25000, 404	26025, 421
250002, 1233	26026, 421
250003, 1233	26027, 421
250004, 1233	26028, 422
250005, 1234	26029, 422
250006, 1234	26030, 422
250007, 1234	26031, 423
250008, 1235	26032, 423
25001, 405	26040, 423
250011, 1235	26050, 424
25010, 405	26051, 424
25011, 406	26052, 424
25020, 406	26053, 425
25021, 406	26054, 425
25022, 407	26070, 425
25030, 407	26072, 426
25031, 407	26074, 426
25040, 408	26075, 426
25042, 408	26076, 426
25050, 409	26077, 427
25060, 409	26078, 427
25070, 409	26080, 427
25080, 410	26081, 427
25100, 410	26082, 427
25105, 411	26100, 428
25110, 411	26101, 428
25200, 411	26102, 428
25201, 412	26105, 429
25202, 412	26106, 429
25220, 413	26110, 430
26000, 413	26120, 430
26001, 413	26121, 430
26002, 414	26122, 430
26003, 415	26126, 431
26004, 415	26201, 431
26005, 415	26202, 432
26006, 416	26204, 432
26007, 416	26208, 432
26008, 417	26210, 432
26009, 417	26211, 433
26010, 417	26216, 433
26011, 417	26218, 433
26012, 418	26220, 434
26014, 418	26237, 434
26015, 418	26260, 434

26261, 435	380075, 1245
26265, 435	380076, 1246
26278, 435	380077, 1246
26280, 435	380500, 1246
26281, 436	380501, 1246
26285, 436	380502, 1247
26286, 436	380503, 1247
26300, 437	4000, 34
26302, 437	400000, 1249
26303, 437	400001, 1249
26350, 437	400002, 1249
26351, 437	400003, 1249
26352, 438	400004, 1250
26353, 438	400005, 1250
26354, 438	400006, 1250
26355, 438	400007, 1250
26370, 438	400008, 1250
26371, 439	400009, 1251
26372, 439	400010, 1251
26373, 439	400011, 1251
26374, 439	400012, 1251
26375, 440	400013, 1251
26376, 440	400014, 1252
26380, 440	400015, 1252
27008, 441	400017, 1252
27033, 441	400018, 1252
27811, 443	400019, 1252
27812, 444	400020, 1253
27813, 444	400021, 1253
27830, 444	400022, 1253
27900, 444	400023, 1253
27910, 445	400024, 1253
2900, 34	400025, 1253
29033, 445	400026, 1254
3000, 34	400027, 1254
3001, 34	400028, 1254
300402, 1237	400029, 1254
300406, 1237	400030, 1254
300410, 1237	400031, 1254
300412, 1238	400032, 1255
300423, 1239	400033, 1255
380001, 1239	400034, 1255
380003, 1240	400035, 1255
380005, 1241	400036, 1255
380020, 1241	400037, 1256
380022, 1242	4001, 35
380040, 1242	4002, 35
380050, 1243	4003, 36
380051, 1244	4004, 37
380070, 1244	4005, 37
380071, 1245	4006, 37
380072, 1245	4009, 38

4010, 38	4341, 55
4011, 39	4343, 56
4012, 39	4344, 56
4020, 39	4345, 56
4021, 40	4346, 57
4030, 40	4347, 57
4032, 40	4348, 58
4040, 41	4349, 62
4045, 41	4400, 63
4050, 41	4402, 63
4058, 42	4500, 63
4059, 42	4501, 63
4060, 43	4503, 64
4062, 43	4600, 64
4065, 43	4610, 64
4070, 44	4611, 64
4071, 44	4620, 64
4075, 44	4621, 65
4076, 44	4630, 65
4077, 45	4631, 65
4080, 45	4632, 65
4082, 46	4640, 66
4087, 46	4641, 66
4088, 46	5000, 66
4090, 47	5010, 66
4099, 47	5020, 67
4115, 47	5030, 67
4150, 47	6000, 67
4152, 48	6010, 67
4170, 48	6020, 69
4182, 48	6030, 70
4183, 49	6035, 70
4184, 49	61000, 447
4185, 49	61001, 447
4200, 50	61002, 447
4210, 50	61003, 447
4215, 50	61004, 448
4220, 51	61005, 448
4225, 51	61006, 448
4230, 51	61007, 448
4240, 52	61008, 448
4270, 52	61009, 449
4275, 53	61010, 449
4280, 53	61011, 449
4282, 53	61012, 449
4300, 53	61013, 450
4310, 54	61014, 450
4320, 54	61015, 450
4334, 54	61016, 450
4336, 55	61017, 450
4338, 55	61018, 451
4340, 55	61019, 451

61020, 452	61072, 466
61021, 452	61073, 467
61022, 453	61074, 467
61023, 453	61075, 467
61024, 453	61076, 467
61025, 454	61077, 468
61026, 454	61098, 468
61027, 454	61099, 468
61028, 455	61100, 468
61029, 455	61101, 469
61030, 455	61102, 469
61031, 455	61103, 469
61032, 456	61104, 469
61033, 456	61105, 470
61034, 456	61106, 470
61035, 456	61107, 470
61036, 457	61108, 470
61037, 457	61109, 471
61038, 457	61110, 471
61039, 457	61111, 471
61040, 458	61112, 471
61041, 458	61113, 472
61042, 458	61114, 472
61043, 458	61115, 472
61044, 459	61116, 472
61045, 459	61117, 473
61046, 460	61118, 473
61047, 460	61119, 473
61048, 460	61120, 473
61049, 460	61121, 474
61050, 461	61122, 474
61051, 461	61123, 474
61052, 461	61124, 474
61053, 461	61125, 475
61054, 462	61126, 475
61055, 462	61127, 475
61056, 462	61128, 475
61057, 462	61129, 476
61058, 463	61130, 476
61059, 463	61131, 476
61060, 463	61132, 476
61061, 463	61133, 477
61062, 464	61134, 477
61063, 464	61135, 477
61064, 464	61136, 477
61065, 464	61137, 478
61066, 465	61138, 478
61067, 465	61139, 478
61068, 465	61140, 478
61069, 465	61141, 479
61070, 466	61142, 479
61071, 466	61143, 479

61144, 480	61196, 491
61145, 480	61197, 492
61146, 480	61198, 492
61147, 480	61199, 492
61148, 481	61200, 492
61149, 481	61201, 492
61150, 481	61202, 493
61151, 482	61203, 493
61152, 482	61204, 493
61153, 482	61205, 493
61154, 483	61206, 494
61155, 483	61207, 494
61156, 483	61208, 494
61157, 483	61209, 494
61158, 484	61210, 495
61159, 484	61211, 495
61160, 484	61212, 495
61161, 484	61213, 495
61162, 484	61214, 496
61163, 484	61215, 496
61164, 485	61216, 496
61165, 485	61217, 496
61166, 485	61218, 496
61167, 485	61219, 497
61168, 485	61220, 497
61169, 485	61221, 497
61170, 485	61222, 497
61171, 485	61223, 498
61172, 486	61224, 498
61173, 486	61225, 498
61174, 486	61226, 498
61175, 486	61227, 499
61176, 486	61228, 499
61177, 487	61229, 499
61178, 487	61230, 499
61179, 487	61231, 499
61180, 487	61232, 500
61181, 487	61233, 500
61182, 488	61234, 500
61183, 488	61235, 500
61184, 488	61236, 501
61185, 488	61237, 501
61186, 488	61238, 501
61187, 488	61239, 501
61188, 489	61240, 502
61189, 489	61241, 502
61190, 489	61242, 502
61191, 490	61243, 502
61192, 490	61244, 503
61193, 491	61245, 503
61194, 491	61246, 503
61195, 491	61247, 503

61248, 504	61300, 517
61249, 504	61301, 517
61250, 504	61302, 518
61251, 504	61303, 518
61252, 505	61304, 518
61253, 505	61305, 518
61254, 505	61306, 519
61255, 505	61307, 519
61256, 506	61308, 519
61257, 506	61309, 519
61258, 506	61310, 519
61259, 507	61311, 520
61260, 507	61312, 520
61261, 507	61313, 520
61262, 507	61314, 520
61263, 508	61315, 520
61264, 508	61316, 520
61265, 508	61317, 521
61266, 508	61318, 521
61267, 509	61319, 521
61268, 509	61320, 521
61269, 509	61321, 521
61270, 509	61322, 522
61271, 510	61323, 522
61272, 510	61324, 522
61273, 510	61325, 522
61274, 510	61326, 522
61275, 511	61327, 522
61276, 511	61328, 522
61277, 511	61329, 523
61278, 511	61330, 523
61279, 512	61331, 523
61280, 512	61332, 523
61281, 512	61333, 523
61282, 512	61334, 523
61283, 513	61335, 523
61284, 513	61336, 524
61285, 513	61337, 524
61286, 513	61338, 524
61287, 514	61339, 524
61288, 514	61340, 524
61289, 514	61341, 524
61290, 514	61342, 525
61291, 515	61343, 525
61292, 515	61344, 525
61293, 515	61345, 525
61294, 516	61346, 525
61295, 516	61347, 525
61296, 516	61348, 525
61297, 516	61349, 526
61298, 517	61350, 526
61299, 517	61351, 526

61352, 526	61418, 535
61353, 526	61419, 535
61354, 526	61420, 536
61355, 527	61421, 536
61356, 527	61422, 536
61357, 527	61423, 536
61358, 527	61424, 536
61359, 528	61425, 537
61360, 528	61426, 537
61361, 528	61427, 537
61362, 528	61428, 538
61363, 528	61429, 538
61364, 528	61430, 538
61365, 529	61431, 539
61366, 529	61432, 539
61367, 529	61440, 540
61368, 529	61441, 540
61369, 529	61442, 540
61371, 529	61443, 540
61372, 530	61444, 540
61373, 530	61445, 540
61374, 530	61446, 541
61375, 530	61447, 541
61376, 530	61501, 541
61377, 531	61502, 541
61378, 531	61503, 541
61379, 531	61504, 541
61380, 531	61505, 542
61381, 531	61506, 542
61382, 531	61507, 542
61383, 532	61508, 542
61384, 532	61509, 542
61385, 532	61510, 542
61386, 532	61511, 543
61387, 532	61512, 543
61401, 532	61513, 543
61402, 533	61514, 543
61403, 533	61515, 543
61404, 533	61517, 543
61405, 533	61518, 544
61406, 533	61519, 544
61407, 534	61520, 544
61408, 534	61521, 544
61409, 534	61522, 544
61410, 534	61523, 544
61411, 534	61524, 545
61412, 534	61525, 545
61413, 534	61526, 545
61414, 535	61527, 545
61415, 535	61529, 545
61416, 535	61530, 545
61417, 535	61531, 546

61532, 546	61613, 556
61533, 546	61614, 556
61540, 546	61615, 557
61541, 546	61616, 557
61542, 546	61617, 557
61543, 547	61618, 557
61544, 547	61619, 558
61545, 547	61620, 558
61546, 547	61621, 558
61547, 547	61622, 558
61548, 547	61623, 559
61549, 548	61624, 559
61550, 548	61625, 559
61551, 548	61626, 560
61552, 548	61627, 560
61553, 548	61628, 560
61555, 549	61695, 560
61556, 549	61696, 561
61557, 549	61697, 561
61558, 549	61698, 561
61559, 549	61699, 561
61560, 550	61700, 562
61561, 550	61701, 562
61562, 550	61702, 562
61563, 550	61703, 562
61564, 550	61704, 563
61565, 550	61705, 563
61566, 551	61706, 563
61567, 551	61707, 563
61568, 551	61708, 564
61569, 551	61709, 564
61570, 551	61710, 564
61571, 552	61711, 564
61572, 552	61712, 565
61573, 552	61713, 565
61574, 552	61714, 565
61575, 553	61730, 565
61576, 553	61731, 566
61577, 553	61732, 566
61578, 554	61733, 566
61601, 554	61734, 566
61602, 554	61735, 567
61603, 554	61736, 567
61604, 554	61737, 567
61605, 555	61738, 567
61606, 555	61739, 568
61607, 555	61740, 568
61608, 555	61741, 568
61609, 555	61742, 568
61610, 555	61743, 569
61611, 556	61744, 569
61612, 556	61745, 569

61746, 569	61861, 582
61747, 570	61862, 583
61748, 570	61863, 583
61749, 570	61864, 583
61750, 570	61865, 583
61751, 571	61866, 584
61752, 571	61867, 584
61753, 571	61868, 584
61754, 571	61869, 584
61755, 572	61870, 585
61756, 572	61900, 585
61757, 572	61901, 585
61758, 572	61902, 585
61759, 573	61903, 586
61800, 573	61904, 586
61801, 573	61905, 586
61802, 573	61906, 586
61803, 574	61907, 587
61804, 574	61908, 587
61805, 574	61909, 587
61806, 574	61910, 587
61807, 575	61911, 588
61808, 575	61912, 588
61809, 575	61913, 588
61810, 575	61914, 588
61811, 576	61915, 589
61812, 576	61916, 589
61813, 576	61917, 589
61814, 576	61918, 589
61815, 576	61919, 590
61816, 577	61920, 590
61817, 577	61921, 590
61818, 577	61922, 590
61819, 577	61923, 591
61836, 578	61924, 591
61837, 578	61925, 591
61838, 578	61926, 591
61839, 578	61927, 592
61840, 579	61928, 592
61841, 579	61929, 592
61842, 579	61930, 592
61850, 580	61931, 593
61851, 580	61932, 593
61852, 580	61933, 593
61853, 580	61934, 593
61854, 581	61935, 594
61855, 581	61936, 594
61856, 581	61937, 594
61857, 581	61938, 594
61858, 582	61939, 595
61859, 582	61940, 595
61860, 582	61941, 595

61942, 595	62300, 607
61943, 596	62301, 608
61944, 596	62303, 608
61945, 596	62304, 608
61946, 597	62305, 608
61947, 597	62306, 609
61948, 597	62307, 609
61949, 597	62310, 609
61950, 598	62311, 609
61951, 598	62312, 609
61952, 598	62314, 610
61953, 598	62315, 610
61954, 599	62316, 610
61955, 599	62317, 610
61956, 599	62318, 611
61957, 599	62319, 611
61958, 600	62320, 611
61959, 600	62321, 611
61960, 600	62322, 612
61961, 600	62377, 612
61962, 601	62500, 612
61963, 601	62501, 612
61964, 601	62502, 612
61965, 601	62503, 612
61966, 602	6401, 70
61967, 602	6402, 71
61968, 602	6403, 71
61969, 602	6404, 71
62000, 603	6405, 71
62001, 603	6406, 72
62098, 603	6407, 73
62100, 603	6408, 73
62101, 603	6409, 73
62102, 604	6410, 74
62103, 604	6411, 74
62104, 604	6412, 74
62105, 604	6413, 75
62106, 604	6421, 75
62107, 605	6422, 75
62108, 605	6423, 76
62109, 605	6424, 76
62180, 605	6425, 76
62181, 605	6430, 77
62182, 606	6431, 77
62183, 606	6432, 77
62184, 606	6433, 78
62185, 606	6434, 78
62186, 606	6436, 78
62187, 607	6437, 79
62200, 607	6438, 79
62201, 607	6441, 79
62202, 607	6442, 80

6450, 80
6451, 80
6452, 80
6453, 81
6454, 81
6455, 81
6460, 82
6462, 82
6500, 82
6510, 82
6520, 83
6540, 83
6560, 83
6568, 83
6569, 83
6570, 84
6581, 84
6582, 84
6583, 84
6584, 84
6693, 84
6694, 85
6700, 85
6710, 85
6720, 85
6730, 86
6740, 86
7500, 86
8010, 86
8012, 87
8020, 87
8021, 87
8022, 87
8024, 88
8025, 88
8026, 88
8027, 88
8028, 89
8029, 89
8030, 89
8031, 90
8037, 90
8040, 90
8041, 90
8042, 91
8043, 91
8045, 91
8046, 92
8050, 92
8052, 92
8053, 92
8055, 93
8060, 93
8061, 94
8062, 94
8063, 95
8064, 95
8065, 95
8066, 95
8067, 96
8080, 96
8081, 96
8082, 96
8083, 97
8084, 97
8085, 97
8086, 97
8089, 98
8090, 98
8100, 98
8101, 98
8102, 99
8122, 99
8124, 100
8126, 100
8128, 101
8130, 101
9000, 102

C

Cancel criteria, 1259

D

Data matrix code, 13

G

General Data Protection Regulation, 14

M

mySupport documentation, 11

O

OpenSSL, 14

P

Product support, 12

S

Send feedback, 10

Siemens Industry Online Support
App, 12

SINUMERIK, 5

Standard scope, 6

T

Technical support, 12

Training, 12

W

Websites of third-party companies, 7