LE250 and LE550 Analog-Discrete Laser Gauging L-GAGE® Sensor Product Manual

Original Instructions
p/n: 175094 Rev. J
22-Aug-25
© Banner Engineering Corp. All rights reserved. www.bannerengineering.com

ПРОМЭЛЕКТРОНИКА/ sales@prom-elec.com

Contents

Chapter 1 Product Description 4
Models 4
Overview 4
Features and Indicators 5
LE Laser Display 5
Buttons 5
Specifications 6
Performance Curves 7
Dimensions 9
Class 1 Laser Description and Safety Information 9
Class 2 Laser Description and Safety Information 10

Chapter 2 Sensor Installation 12
Sensor Orientation 12
Mount the Device 12
Wiring Diagrams 13

Chapter 3 LE Laser Sensor Programming 14
Quick Menu 14
Sensor Menu (MENU) 15
Remote Input 15
Locking and Unlocking the Sensor 17
Analog Output Menu (A_OUT) 17
TEACH 4 mA (0 V) and TEACH 20 mA (10 V) 18
Midpoint TEACH 20
Adjust 4 mA (0 V) 22
Adjust 20 mA (10 V) 22
Slope 22
Loss of Signal 23
Discrete Output Menu (D_OUT) 25
Two-Point TEACH 25
Midpoint TEACH 27
Adjust Switch Point One 29
Adjust Switch Point Two 29
TEACH Switch Point 29
Adjust Switch Point 30
Mode 30
Switch Point Reference (SPtRef) 32
Timer 32
Polarity 33
Input Menu (INPUT) 33
Input Type 33
Input Active 34
Measure Menu (MEASURE) 34
Speed 34
Trigger 35
Display Menu (DISPLAY) 37
Units 37
View 37
Sleep 38
Information Menu (INFO) 38
Reset Menu (RESET) 38
Factory Default Settings 39
Sync Master/Slave 40

Chapter 4 Additional Remote TEACH Procedures 41
TEACH Analog Output and Discrete Output Switch Points Together 41
TEACH Analog Output and Discrete Output Midpoints Together 42

Chapter 5 Accessories 43
Cordsets 43
Brackets 44

Chapter 6 Product Support and Maintenance 45

© Banner Engineering Corp. All rights reserved. www.bannerengineering.com

Troubleshooting 45
Sensor Menu Full Map (LE550 Analog/Discrete Models) 46
Repairs 47
Contact Us 47
Banner Engineering Corp Limited Warranty 47

© Banner Engineering Corp. All rights reserved. www.bannerengineering.com

Chapter Contents

Models 4
Overview 4
Specifications 6

Chapter 1 Product Description

Laser displacement sensor with both analog and discrete (switched) outputs



- Easy to set up and use with a 2-line, 8-character display
- Economical sensor with high accuracy
- Repeatability and accuracy for challenging targets, from shiny metal to black rubber
- Various sizes of visible red laser, depending on target size, distance, and color characteristics
- Sensing range options up to 1 meter

WARNING:

- **Do not use this device for personnel protection**
- Using this device for personnel protection could result in serious injury or death.
- This device does not include the self-checking redundant circuitry necessary to allow its use in personnel safety applications. A device failure or malfunction can cause either an energized (on) or de-energized (off) output condition.

Models

Family	Range	Output	Laser Class	Connector
LE	**550**	**I**		**Q**
LE	550 = 100-1000 mm 250 = 100-400 mm	I = 4-20mA analog and one NPN/PNP discrete U = 0-10V analog and one NPN/PNP discrete	Blank = Class 2 Laser Cl = Class 1 Laser	Blank = 2 m integral cable Q = Rotatable M12 QD QP = 150 mm PVC cable with an M12 QD W/30 = 9 m integral cable

QD models require a mating cordset. The discrete NPN/PNP output is user configurable.

Information about additional L-GAGE LE models is available at www.bannerengineering.com.

Overview

The LE250/550 Analog/Discrete L-GAGE® Laser Sensor is a visible, bore-sighted laser displacement sensor designed for precise, color-insensitive measurements. The LE series of sensors includes models covering various ranges, spot sizes, and measurement performance.

A 2-line LCD shows the real-time distance measurement, in either millimeters or inches, and the analog output measurement, in milliamps or volts, when the sensor is in Run mode.

See "Factory Default Settings" on page 39 for a list of sensor default settings.

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Models with current or voltage analog outputs are available. This manual provides the display information and the navigation paths for the current models with the voltage model text in parentheses if it is different.

Features and Indicators

LE Analog Sensor Features

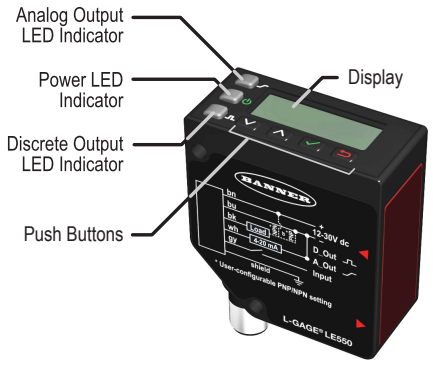

Three LED indicators provide ongoing indication of the sensing status.

Analog Output LED Indicator

Solid Amber = Displayed distance is within the taught analog output window
Off = Displayed distance is outside the taught analog output window

Power LED Indicator

Solid Green = Normal operation, power On and laser On
Flashing Green (1 Hz) = Power On and laser Off (laser enable mode)

Discrete Output LED Indicator

Solid Amber = Discrete Output is On
Off = Discrete Output is Off

LE Laser Display

LE550 Display in Run Mode



The display is a 2-line, 8-character LCD. The main screen is the Run mode screen, which shows the real-time distance measurement and the analog output measurement.

Buttons

Use the sensor buttons **Down**, **Up**, **Enter**, and **Escape** to program the sensor and to access sensor information.

Down and Up Buttons

Press **Down** and **Up** to:

- Access the Quick Menu from Run mode
- Navigate the menu systems
- Change programming settings

When navigating the menu systems, the menu items loop.

Press **Down** and **Up** to change setting values. Press and hold the buttons to cycle through numeric values. After changing a setting value, it slowly flashes until the change is saved using the **Enter** button.

Enter Button

Press **Enter** to:

- Access the Sensor Menu from Run mode
- Access the submenus
- Save changes

In the Sensor Menu, a checkmark ⋰ in the lower right corner of the display indicates that pressing **Enter** accesses a submenu.

Press **Enter** to save changes. New values flash rapidly and the sensor returns to the parent menu.

Continued on page 6

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Continued from page 5

Escape Button

Press **Escape** to:

- Leave the current menu and return to the parent menu
- Return to Run mode from the Quick Menu

IMPORTANT: Pressing **Escape** discards any unsaved programming changes.

In the Sensor Menu, a return arrow in the upper left corner of the display indicates that pressing **Escape** returns to the parent menu.

Press and hold **Escape** for 2 seconds to return to Run mode from any menu or remote teach.

Specifications

Supply Voltage (Vcc)
12 V DC to 30 V DC

Power and Current Consumption, exclusive of load
Normal Run Mode: 1.7 W, Current consumption < 70 mA at 24 V DC

Supply Protection Circuitry
Protected against reverse polarity and transient overvoltages

Output Configuration
Analog output: 4 to 20 mA or 0 to 10 V, depending on model
Discrete output rating: Discrete NPN/PNP is user-configurable

Output Ratings
Discrete Output: 100 mA maximum (protected against continuous overload and short circuit)
OFF-state leakage current—PNP: < 10 µA at 30 V
OFF-state leakage current—NPN: < 200 µA at 30 V
Output saturation voltage—PNP outputs: < 3 V at 100 mA
Output saturation voltage—NPN outputs: < 1.6 V at 100 mA
Analog current output (LE...I Models):1 kΩ max. @ 24 V; max. load resistance = [(Vcc-4.5)/0.02 Ω]
Analog voltage output (LE...U Models): 2.5 kΩ min. load resistance

Remote Input
Allowable Input Voltage Range: 0 to Vcc
Active Low (internal weak pullup—sinking current):
· High State > 4.3 V at 740 µA max.
· Low State < 1.3 V at 800 µA max.
Active High (internal weak pulldown—sourcing current):
· High State > 4.3 V at 1.7 mA max.
· Low State < 1.3 V at 1.6 mA max.

Analog Resolution
LE250: 100 mm to 250 mm: Less than 0.02 mm
LE250: 250 mm to 400 mm: Less than 0.2 mm
LE550: 100 mm to 600 mm: Less than 0.5 mm
LE550: 600 mm to 1000 mm: Less than 1 mm

Analog Linearity
LE250: Linearity is the less of Accuracy or 0.3% of full scale range (± 0.9 mm) at any given distance
LE550: Linearity is the lesser of Accuracy or 0.5% of full scale range (± 4.5 mm) at any given distance

Typical Beam Spot Size[1]

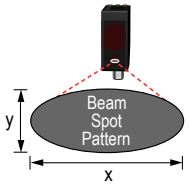

	Distance (mm)					
	LE250 Models			LE550 Models		
	100	250	400	100	550	1000
x	3.2	2.1	1.2	8.4	10.5	12.1
y	2.2	1.5	0.9	3.5	4.2	4.9

Environmental Rating
IP67, NEMA 6

Operating Conditions
Temperature: –20 °C to +55 °C (–4 °F to +131°F)
Humidity: 90% at +55 °C maximum relative humidity (non-condensing)

Storage Temperature
–30 °C to +65 °C (–22 °F to +149 °F)

Application Note
For optimum performance, allow 10 minutes for the sensor to warm up

Certifications
Industrial Control Equipment 3TJJ
UL Environmental Rating: Type 1

Sensing Beam
Class 2 laser models: visible red, 650 nm
Class 1 laser models: visible red, 650 nm

Sensing Range
LE250: 100 mm (3.94 in) to 400 mm (15.75 in)
LE550: 100 mm (3.94 in) to 1000 mm (39.37 in)

[1] Beam spot size is calculated as 1.6 times the D4σ measured value

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Delay at Power Up
2 s

Measurement/Output Rate
Class 2 laser models: < 1 ms
Class 1 laser models (fast): < 1 ms
Class 1 laser models (std/med/slow): < 2 ms

Ambient Light Immunity
Class 2 laser models: > 10,000 lux
Class 1 laser models: > 5,000 lux

Minimum Window Size, Analog and Discrete
LE250: 1 mm (0.039 in)
LE550: 10 mm (0.39 in)

Boresighting
LE250: 4 mm radius at 400 mm
LE550: 1 cm radius at 1 m

Maximum Torque
2 N·m (17.7 in-lbs)

Repeatability
See *Performance Curves*

Temperature Effect
See *Performance Curves*

Accuracy
See *Performance Curves*

Construction
Housing: die-cast zinc
Window: acrylic

Vibration/Mechanical Shock
All models meet Mil. Std. 202 G requirements method 201A. Also meets IEC 60947-5-2.

Response Time

	Class 1 Laser Models	Class 2 Laser Models
Fast [2]	2 ms	2 ms
Standard	10 ms	5 ms
Medium	30 ms	15 ms
Slow	100 ms	50 ms

Required Overcurrent Protection

WARNING: Electrical connections must be made by qualified personnel in accordance with local and national electrical codes and regulations.

Overcurrent protection is required to be provided by end product application per the supplied table.

Overcurrent protection may be provided with external fusing or via Current Limiting, Class 2 Power Supply.

Supply wiring leads < 24 AWG shall not be spliced.

For additional product support, go to www.bannerengineering.com.

Supply Wiring (AWG)	Required Overcurrent Protection (A)	Supply Wiring (AWG)	Required Overcurrent Protection (A)
20	5.0	26	1.0
22	3.0	28	0.8
24	2.0	30	0.5

[2] Response time for lateral entry of object into measurement range < 5 ms

Performance Curves

LE250 Models	LE550 Models
Repeatability (90% to 6% reflectance)	*Repeatability (90% to 6% reflectance)*

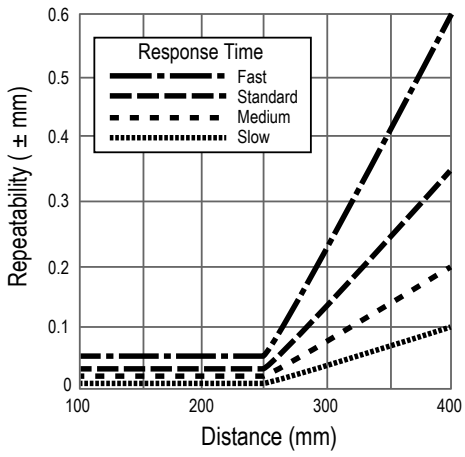

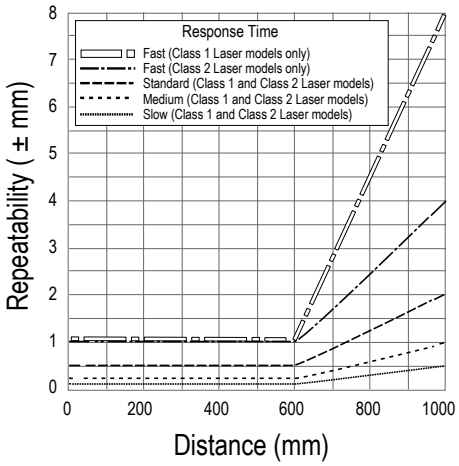

Continued on page 8

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Continued from page 7

LE250 Models	LE550 Models
Accuracy (90% to 6% reflectance) 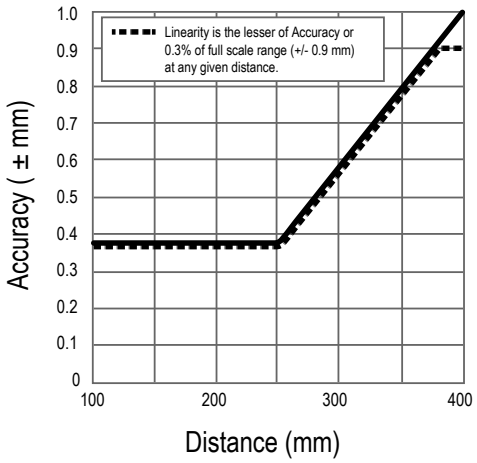	*Accuracy (90% to 6% reflectance)* 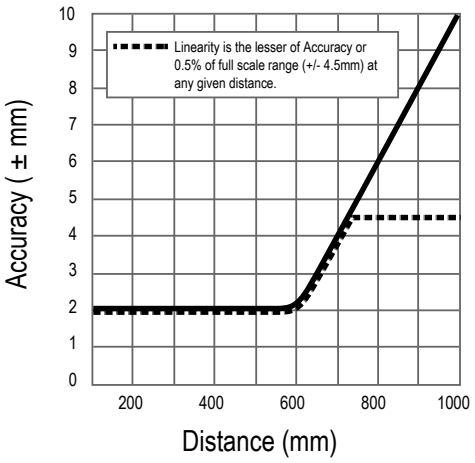
Temperature Effect 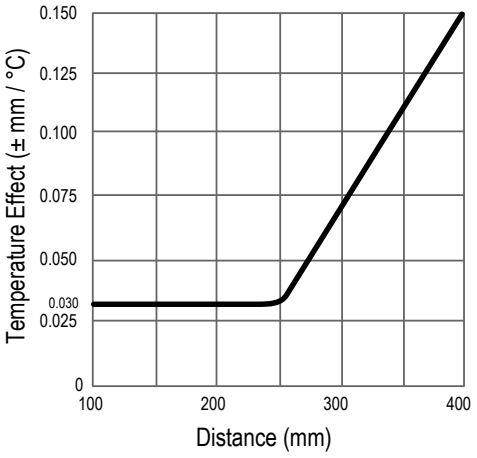	*Temperature Effect* 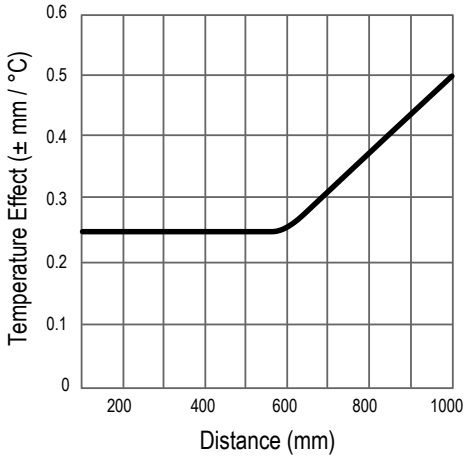

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Dimensions

All measurements are listed in millimeters [inches], unless noted otherwise. The measurements provided are subject to change.

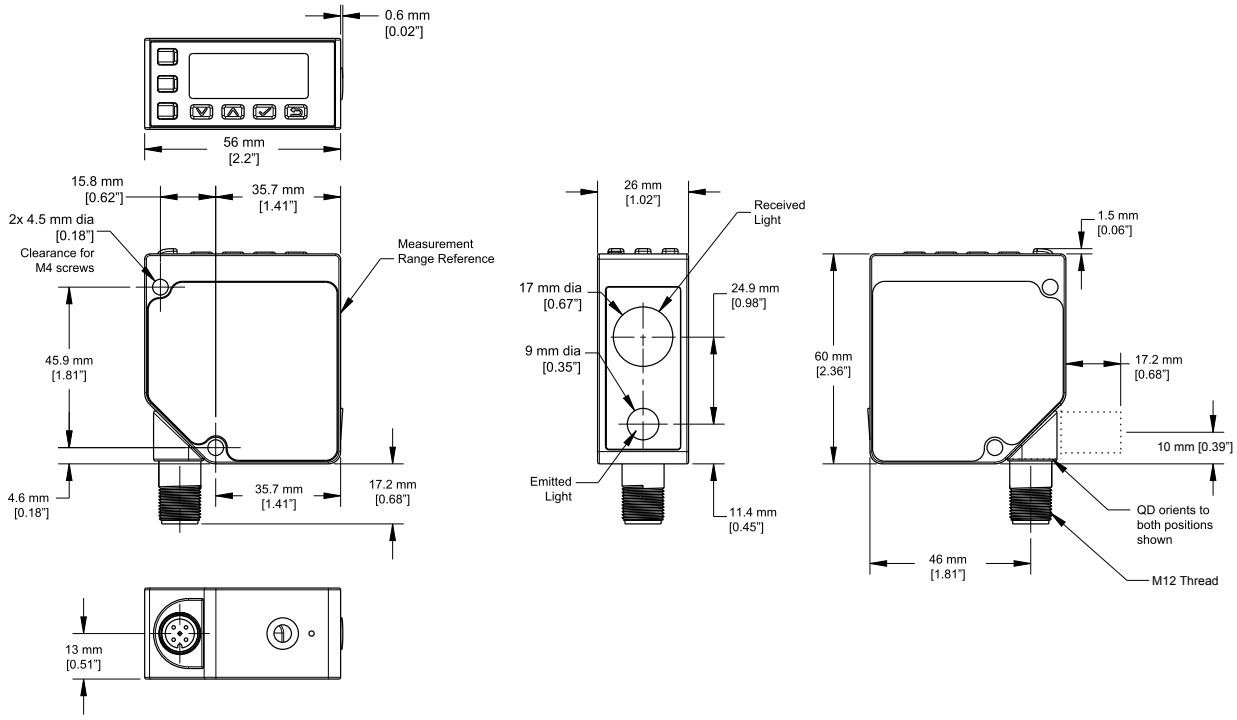

Class 1 Laser Description and Safety Information



Laser light. Do not stare into the beam.

Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 56, dated May 8, 2019.

**CLASS 1
LASER PRODUCT**

CAUTION:

- **Never stare directly into the sensor lens.**
- Laser light can damage your eyes.
- Avoid placing any mirror-like object in the beam. Never use a mirror as a retroreflective target.

CAUTION:

- **Return defective units to the manufacturer.**
- Use of controls or adjustments or performance of procedures other than those specified herein may result in hazardous radiation exposure.
- Do not attempt to disassemble this sensor for repair. A defective unit must be returned to the manufacturer.

CAUTION:

- **Ne regardez jamais directement la lentille du capteur.**
- La lumière laser peut endommager la vision.
- Évitez de placer un objet réfléchissant (de type miroir) dans la trajectoire du faisceau. N'utilisez jamais de miroir comme cible rétro-réfléchissante.

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

CAUTION:

- **Tout dispositif défectueux doit être renvoyé au fabricant.**
- L'utilisation de commandes, de réglages ou de procédures autres que celles décrites dans le présent document peut entraîner une exposition dangereuse aux radiations.
- N'essayez pas de démonter ce capteur pour le réparer. Tout dispositif défectueux doit être renvoyé au fabricant.

Class 1 lasers are lasers that are safe under reasonably foreseeable conditions of operation, including the use of optical instruments for intrabeam viewing.

Complies with IEC 60825-1:2014 and EN 60825-1:2014+A11:2021.

For safe laser use:

- Do not stare at the laser.
- Do not point the laser at a person's eye.
- Mount open laser beam paths either above or below eye level, where practical.
- Terminate the beam emitted by the laser product at the end of its useful path.

Class 1 Laser Characteristics

Output power: <0.22 mW
Laser wavelength: 650 nm
Pulse duration: 150-900 µs

Class 2 Laser Description and Safety Information



Laser light. Do not stare into the beam.

Complies with 21 CFR 1040.10 and 1040.11 except for deviations pursuant to Laser Notice No. 56, dated May 8, 2019.



CAUTION:

- **Never stare directly into the sensor lens.**
- Laser light can damage your eyes.
- Avoid placing any mirror-like object in the beam. Never use a mirror as a retroreflective target.

CAUTION:

- **Return defective units to the manufacturer.**
- Use of controls or adjustments or performance of procedures other than those specified herein may result in hazardous radiation exposure.
- Do not attempt to disassemble this sensor for repair. A defective unit must be returned to the manufacturer.

CAUTION:

- **Ne regardez jamais directement la lentille du capteur.**
- La lumière laser peut endommager la vision.
- Évitez de placer un objet réfléchissant (de type miroir) dans la trajectoire du faisceau. N'utilisez jamais de miroir comme cible rétro-réfléchissante.

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

CAUTION:

- **Tout dispositif défectueux doit être renvoyé au fabricant.**
- L'utilisation de commandes, de réglages ou de procédures autres que celles décrites dans le présent document peut entraîner une exposition dangereuse aux radiations.
- N'essayez pas de démonter ce capteur pour le réparer. Tout dispositif défectueux doit être renvoyé au fabricant.

Class 2 lasers are lasers that emit visible radiation in the wavelength range from 400 nm to 700 nm, where eye protection is normally afforded by aversion responses, including the blink reflex. This reaction may be expected to provide adequate protection under reasonably foreseeable conditions of operation, including the use of optical instruments for intrabeam viewing.

Complies with IEC 60825-1:2014 and EN 60825-1:2014+A11:2021.

Class 2 Laser Safety Notes. Low-power lasers are, by definition, incapable of causing eye injury within the duration of a blink (aversion response) of 0.25 seconds. They also must emit only visible wavelengths (400 nm to 700 nm). Therefore, an ocular hazard may exist only if individuals overcome their natural aversion to bright light and stare directly into the laser beam.

For safe laser use:

- Do not stare at the laser.
- Do not point the laser at a person’s eye.
- Mount open laser beam paths either above or below eye level, where practical.
- Terminate the beam emitted by the laser product at the end of its useful path.

IMPORTANT: This laser device is not bore-sighted.

Class 2 Laser Characteristics

Output power: <1 mW
Laser wavelength: 650 nm
Pulse duration: 150-400 µs

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Chapter Contents

Sensor Orientation 12
Mount the Device 12
Wiring Diagrams 13

Chapter 2 Sensor Installation

NOTE: Handle the sensor with care during installation and operation. Sensor windows soiled by fingerprints, dust, water, oil, etc. may create stray light that may degrade the peak performance of the sensor. Blow the window clear using filtered, compressed air, then clean as necessary using 70% isopropyl alcohol and cotton swabs or water and a soft cloth.

Sensor Orientation

Correct sensor-to-object orientation is important to ensure proper sensing. See the following figures for examples of correct and incorrect sensor-to-object orientation as certain placements may pose problems for sensing distances.

Orientation by a wall

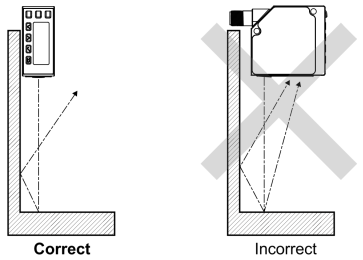

Orientation in an opening

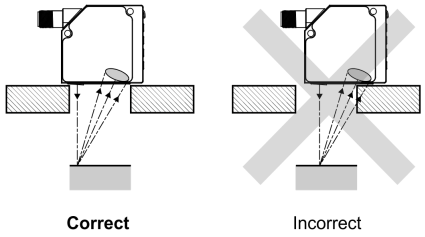

Orientation for a turning object

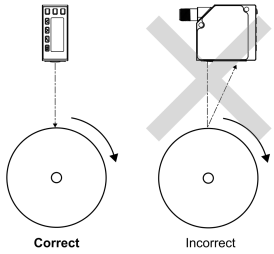

Orientation for a height difference

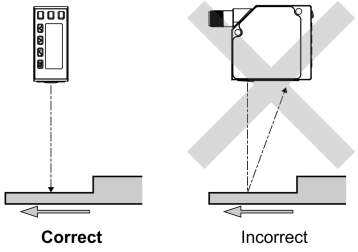

Orientation for a color or luster difference

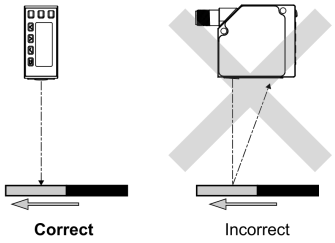

Orientation for a highly reflective target

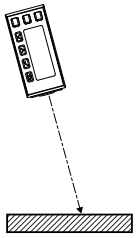

Applying tilt to sensor may improve performance on reflective targets. The direction and magnitude of the tilt depends on the application, but a 15° tilt is often sufficient.

Mount the Device

1. If a bracket is needed, mount the device onto the bracket.
2. Mount the device (or the device and the bracket) to the machine or equipment at the desired location. Do not tighten the mounting screws at this time.
3. Check the device alignment.
4. Tighten the mounting screws to secure the device (or the device and the bracket) in the aligned position.

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Wiring Diagrams

Analog Current Model

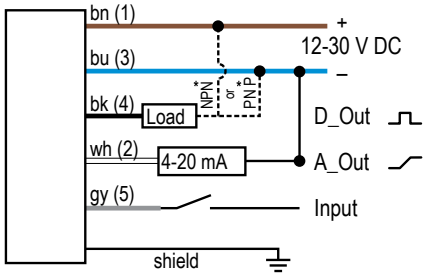

* User-configurable PNP/NPN setting

Analog Voltage Model

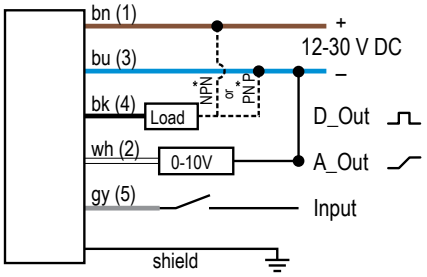

* User-configurable PNP/NPN setting

Key



1 = Brown
2 = White
3 = Blue
4 = Black
5 = Gray

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Chapter Contents

Quick Menu 14
Sensor Menu (MENU) 15
Remote Input 15
Locking and Unlocking the Sensor 17
Analog Output Menu (A_OUT) 17
Discrete Output Menu (D_OUT) 25
Input Menu (INPUT) 33
Measure Menu (MEASURE) 34
Display Menu (DISPLAY) 37
Information Menu (INFO) 38
Reset Menu (RESET) 38
Sync Master/Slave 40

Chapter 3 LE Laser Sensor Programming

Program the sensor using the buttons on the sensor or the remote input (limited programming options).

From Run mode, use the buttons to access the Quick Menu and the Sensor Menu. See "Quick Menu" on page 14 and "Sensor Menu (MENU)" on page 15 for more information on the options available from each menu. For TEACH options, follow the TEACH instructions.

In addition to programming the sensor, use the remote input to disable the buttons for security, preventing unauthorized or accidental programming changes. See "Remote Input" on page 15 for more information.

Accessing the Menus

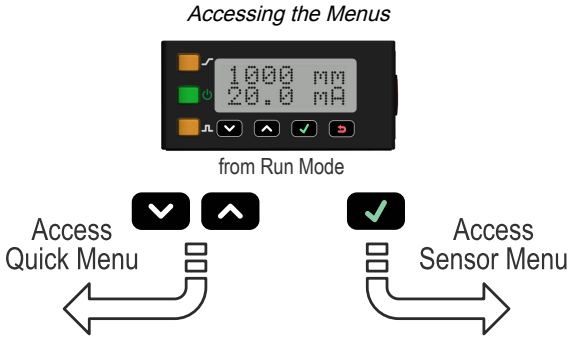

Quick Menu

The sensor includes a Quick Menu with easy access to view and change the analog and discrete output switch points.

Access the Quick Menu by pressing **Down** or **Up** from Run mode. When in the Quick Menu, the current distance measurement displays on the first line and the menu name and the analog value alternate on the second line of the display.

Press **Enter** to access the switch points. Press **Down** or **Up** to change the switch point to the desired value.

Press **Enter** to save the new value and return to the Quick Menu.

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Quick Menu Map (Window Mode)

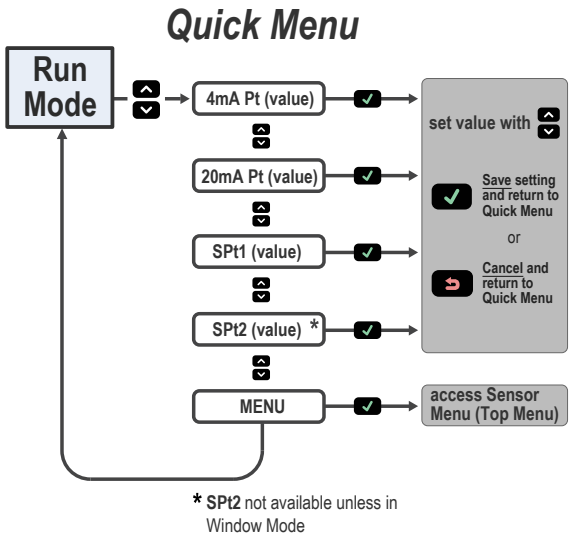

Sensor Menu (MENU)

Access the Sensor Menu by pressing **Enter** from Run mode. The Sensor Menu is also accessible from the Quick Menu: navigate to **MENU** and press **Enter**. The Sensor Menu includes several submenus that provide access to view and change sensor settings and to view sensor information.

Sensor Menu Basic Map

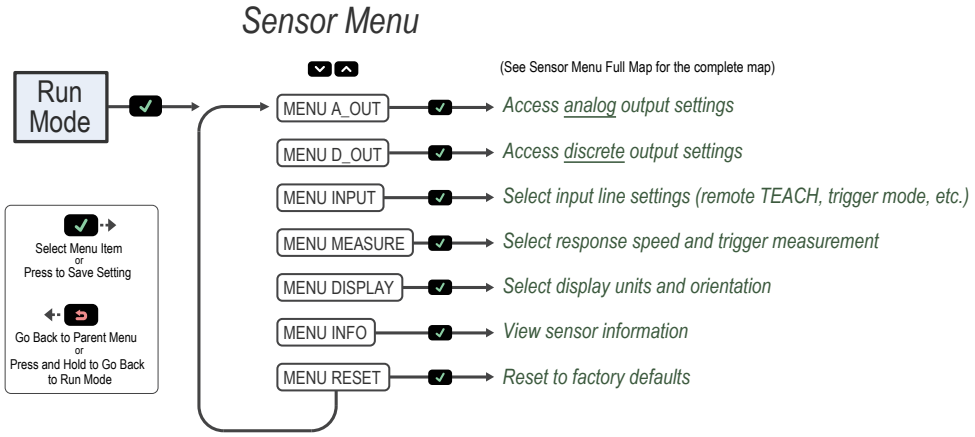

See "Sensor Menu Full Map (LE550 Analog/Discrete Models)" on page 46 and the Menu sections of this manual for more information.

Remote Input

Use the remote input to program the sensor remotely. The remote input provides limited programming options.

The remote input is Active Low by default. For Active Low, connect the gray input wire to ground (0 V DC), with a remote switch connected between the wire and ground. To use the Active High function, configure the sensor for Active High using the buttons on the sensor, then connect the gray input wire to V+ (12 to 30 V DC). Pulse the remote input according to the diagram and the instructions provided in this manual.

The length of the individual programming pulses is equal to the value **T: 0.04 seconds ≤ T ≤ 0.8 seconds**.

Exit remote programming modes by holding the remote input low for > 2 seconds, or waiting for the automatic 60-second timeout, or by pressing and holding **Escape** for 2 seconds. The sensor returns to Run mode without saving any new settings.

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Remote Input Map

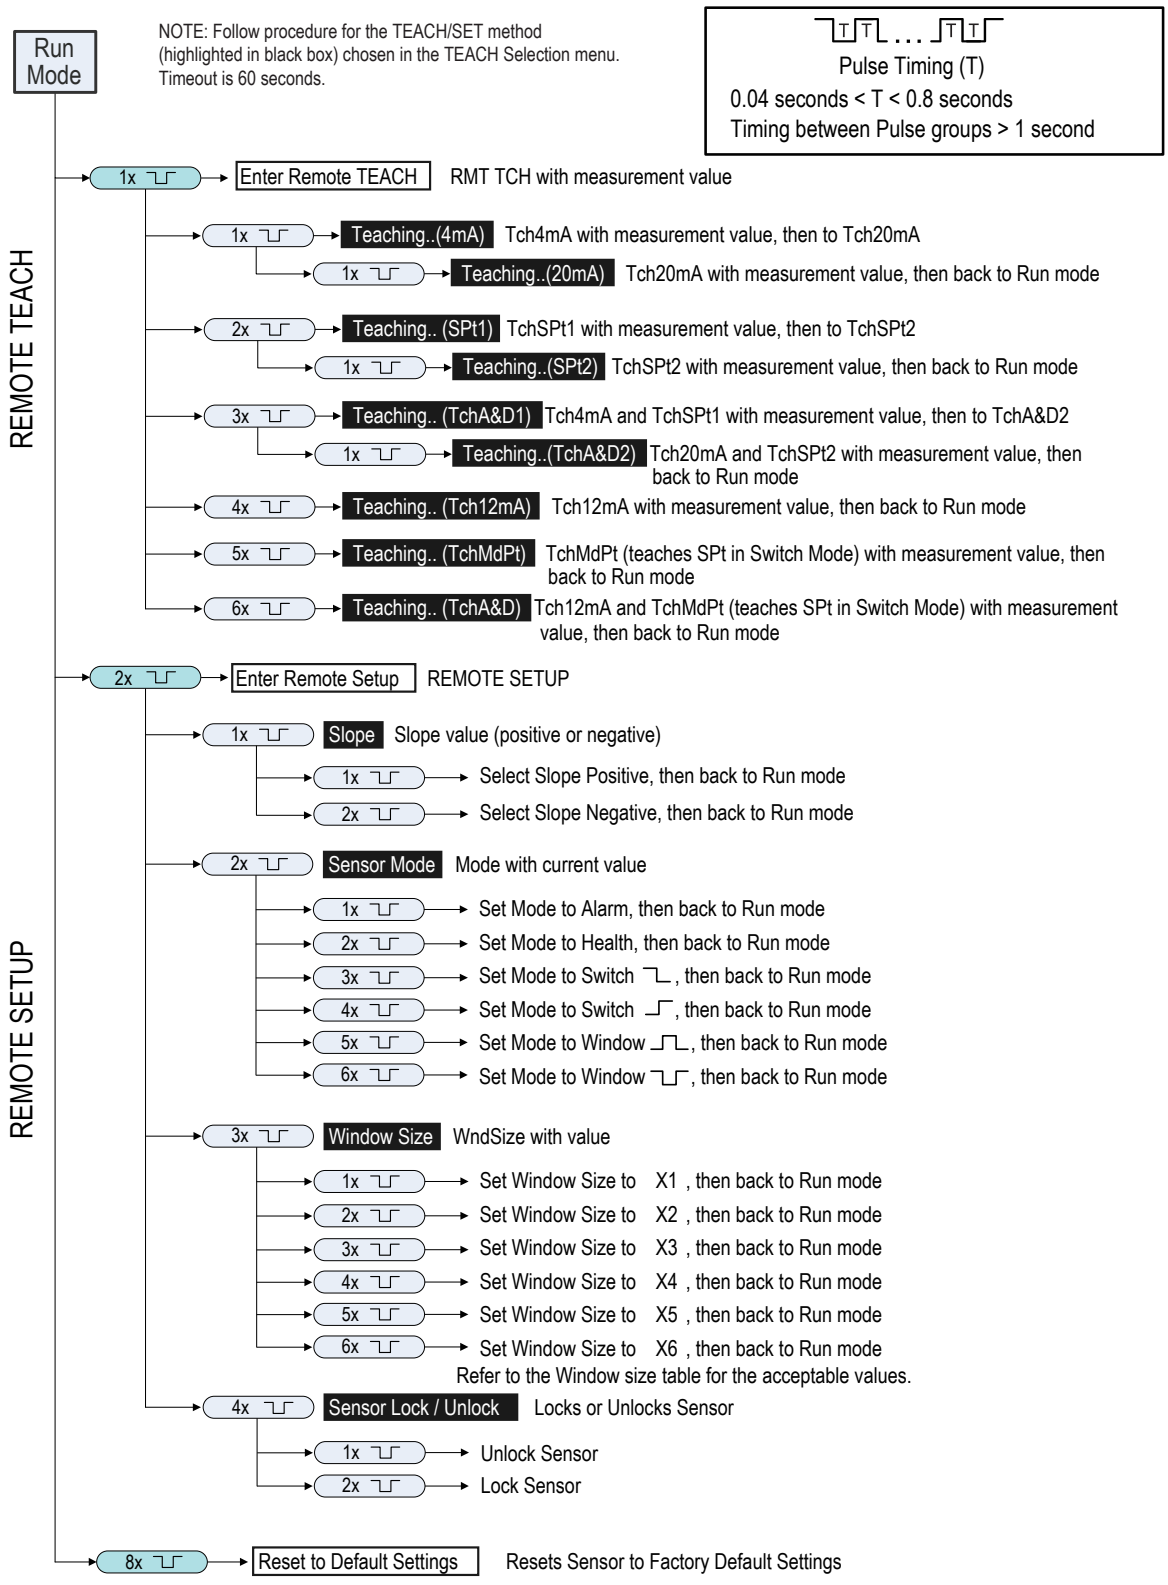

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Window size (WndSize)

Variable	LE250 Models (mm)	LE550 Models (mm)
X1	1	10
X2	10	50
X3	50	100
X4	100	300
X5	150	500
X6	250	800

Locking and Unlocking the Sensor

Use the lock and unlock feature to prevent unauthorized or accidental programming changes. A lock symbol displays in the upper left corner of the display to indicate when the sensor is locked. When locked, the menus are available to view settings, but the values cannot be changed. The remote input is also disabled, except for the unlock function.

Button Instructions--To lock or unlock the sensor using the buttons, press and hold **Down** and **Escape** simultaneously for 3 seconds.

Remote Input Instructions

1. Access the setup mode.

Action		Result
Double-pulse the remote input.		"**REMOTE SETUP**" displays.

2. Access the lock/unlock function.

Action		Result
Four-pulse the remote input.		"**LOCK**" and the current status (unlocked or locked) display.

3. Lock or unlock the sensor.

Action		Result
Unlock : Single-pulse the remote line.		"**Unlocked**" flashes and the sensor returns to Run mode. The sensor is unlocked.
Lock: Double-pulse the remote input.		"**Locked**" flashes and the sensor returns to Run mode. The sensor is locked and the lock symbol displays in the upper left corner.

Analog Output Menu (A_OUT)

Use the Analog Output menu to view or change:

- 4 mA (0 V) setpoint
- 20 mA (10 V) setpoint
- 12 mA (5 V) window
- Slope
- Loss of signal behavior

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Analog Output Menu Map

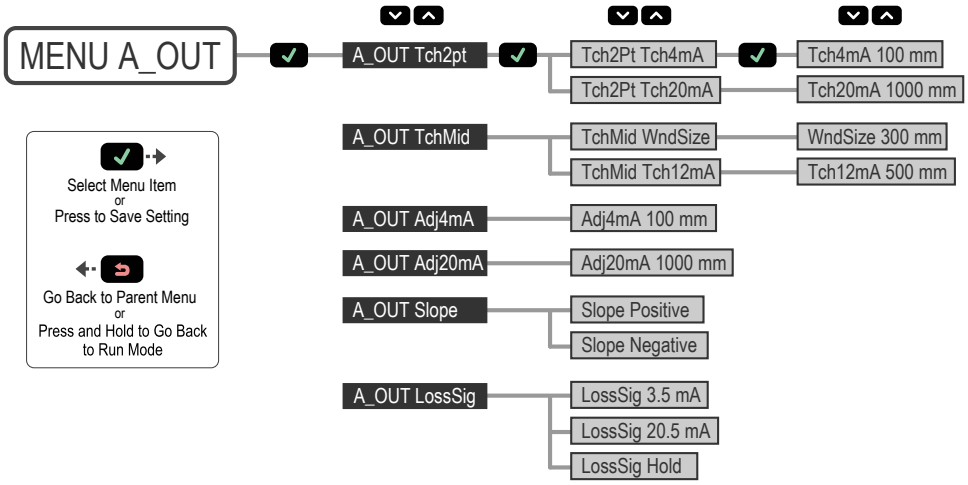

TEACH 4 mA (0 V) and TEACH 20 mA (10 V)

The Tch4mA (Tch0V) and Tch20mA (Tch10V) options use targets to set the 4 mA (0 V) and 20 mA (10 V) to the desired setpoints. When using the buttons, only one value needs to be set if the second value is valid. When using the remote input, both values must be set.

Navigate: MENU › A_OUT › Tch2Pt › Tch4mA (Tch0V) or navigate: **MENU › A_OUT › Tch2Pt › Tch20mA (Tch10V)**

Remote input: Available

Button Instructions

1. Present the target.

Action	Result
Present the target. The target must be within the sensor's measurement range.	The target's analog output measurement and distance measurement values display.

2. Access the TEACH mode and TEACH the sensor.

Action	Result
Navigate: **MENU › A_OUT › Tch2Pt › Tch4mA (Tch0V)** OR Navigate: **MENU › A_OUT › Tch2Pt › Tch20mA (Tch10V)**	The selected TEACH mode and "**Teaching**" display while the sensor is being taught. **TEACH Accepted** The new value is shown on the second line of the display and flashes before it is saved and the sensor returns to the parent menu. **TEACH Not Accepted** "**FAIL**" and a warning message display, and the sensor returns to the parent menu.

3. Repeat steps 1 to 2 for the other setpoint, if desired.

Remote Input Instructions

Teaches both the 4 mA (0 V) and 20 mA (10 V) setpoints.

1. Access the TEACH mode.

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Action		Result
Single-pulse the remote input.		"**RMT TCH**" and the current measurement value display.

2. Present the target.

Action	Result
Present the 4 mA (0 V) target.	"**RMT TCH**" and the target's measurement value display.

3. TEACH the sensor.

Action		Result
Single-pulse the remote input.		"**Tch4mA (Tch0V) Teaching**" displays while the sensor is being taught. **TEACH Accepted** The new value displays on the second line of the display, flashes, and then "**Tch20mA (Tch10V)**" and the current measurement value display. **TEACH Not Accepted** "**FAIL**" flashes, the sensor returns to step 2, and "**RMT TCH**" displays.

4. Present the target.

Action	Result
Present the 20 mA (10 V) target.	"**Tch20mA (Tch10V)**" and the target's measurement value display.

5. TEACH the sensor.

Action		Result
Single-pulse the remote input.		"**Tch20mA (Tch10V) Teaching**" displays while the sensor is being taught. **TEACH Accepted** The new value displays on the second line of the display, flashes, and the sensor returns to Run mode. **TEACH Not Accepted** "**FAIL**" flashes, the sensor returns to step 2, and "**RMT TCH**" displays.

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Midpoint TEACH

The Midpoint TEACH uses both the window size and the 12 mA (5 V) setpoint to determine the actual measurement window. For example, a window of 200 mm with a 12 mA (5 V) setpoint of 600 mm places the measurement window from 500 mm to 700 mm.

Window and Midpoint Example

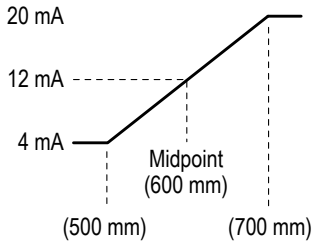

To use the Midpoint TEACH:

1. Set the window size.
2. Set the measurement window using "TEACH 12 mA (5 V)" on page 21.

The Analog Output Midpoint TEACH and the Discrete Output Midpoint TEACH are independent settings (see "Midpoint TEACH" on page 27).

Window Size

The WndSize option sets the window size that the Midpoint TEACH uses to set the 4 mA (0 V) and 20 mA (10 V) setpoints.

The Midpoint TEACH fails if one of the setpoints is beyond the measurement range. The bigger the window size, the smaller the acceptable TEACH range.

The Analog Output window size is a different setting than the Discrete Output window size when defined using the push buttons.

	LE250 Laser Sensor	LE550 Laser Sensor
Window Size Minimum	1 mm	10 mm
Window Size Maximum	250 mm	800 mm
Range	100 mm to 400 mm	100 mm to 1000 mm
Default Window Size	50 mm	300 mm

Navigate: MENU › A_OUT › TchMid › WndSize

Remote Input: Available

Default: 300 (11.8 in) mm for LE550 models; 50.0 mm (1.97") for LE250 models

1. Access the Window Size mode.

Method	Action		Result
Push Button	Navigate: **MENU › A_OUT › TchMid › WndSize**		"**WndSize**" and the current window size value display.
Remote Input	a. Double-pulse the remote input to enter setup mode. b. Three-pulse the remote input to enter window size mode.	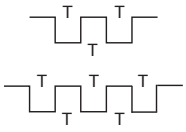	a. "**REMOTE SETUP**" displays. b. "**WndSize**" and the current window size value display.

2. Set the window size.

Method	Action	Result
Push Button	a. Use **Down** and **Up** and to set the desired window size—the value changes in increments of 2. b. Press **Enter** to save the new value.	a. "**WndSize**" and the new value display. b. The new value flashes and the sensor returns to "**TchMid WndSize**".

Continued on page 21

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Continued from page 20

<table>
<tr><th>Method</th><th>Action</th><th>Result</th></tr>
<tr><td>Remote Input (Sets A_OUT and D_OUT window Size)</td><td>Pulse the remote input 1 to 6 times to select the desired window size.
<table>
<tr><th rowspan="2">Pulses</th><th colspan="2">Window Size</th></tr>
<tr><th>LE250</th><th>LE550</th></tr>
<tr><td>1</td><td>1 mm</td><td>10 mm</td></tr>
<tr><td>2</td><td>10 mm</td><td>50 mm</td></tr>
<tr><td>3</td><td>50 mm</td><td>100 mm</td></tr>
<tr><td>4</td><td>100 mm</td><td>300 mm</td></tr>
<tr><td>5</td><td>150 mm</td><td>500 mm</td></tr>
<tr><td>6</td><td>250 mm</td><td>800 mm</td></tr>
</table></td><td>The new value flashes and the sensor returns to Run mode.</td></tr>
</table>

TEACH 12 mA (5 V)

The Tch12mA (Tch5V) option sets the midpoint that determines the actual measurement window.

Navigate: MENU › A_OUT › TchMid › Tch12mA (Tch5V)

Remote Input: Available

Button Instructions

1. Present the target.

Action	Result
Present the target.	The target's analog output measurement and distance measurement values display.

2. Access the TEACH 12 mA (5 V) mode and TEACH the sensor.

Action	Result
Navigate: **MENU › A_OUT › TchMid › Tch12mA (Tch5V)**.	"**Tch12mA (Tch5V) Teaching**" displays while the sensor is being taught. TEACH Accepted The new value is shown on the second line of the display and flashes before it is saved and the sensor returns to "**TchMid Tch12mA (Tch5V)**". TEACH Not Accepted "**FAIL**" and a warning message display and the sensor returns to "**Tch Mid Tch12mA (Tch5V)**".

Remote Input Instructions

1. Access the TEACH mode.

Action		Result
Single-pulse the remote input.		"**RMT TCH**" and the current measurement value display.

2. Present the target.

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Action	Result
Present the target.	"**RMT TCH**" and the target's measurement value display.

3. TEACH the sensor.

Action		Result
Four-pulse the remote input.		"**Tch12mA (Tch5V) Teaching**" displays while the sensor is being taught. **TEACH Accepted** The new value displays on the second line of the display, flashes, and the sensor returns to Run mode **TEACH Not Accepted** "**FAIL**" flashes, the sensor returns step 2, and "**RMT TCH**" displays.

Adjust 4 mA (0 V)

The Adj4mA (Adj0V) option manually adjusts the distance at which the Analog Output is 4mA (0 V). The value is adjustable within the sensor's range. It is required to at least maintain the minimum window size.

Navigate: MENU › A_OUT › Adj4mA (Adj0V)

Remote Input: Not available

Default: 100 mm (3.94 in) for both LE250 and LE550 models

Adjust 20 mA (10 V)

The Adj20mA (Adj10V) option manually adjusts the distance at which the Analog Output is 20 mA (10 V). The value is adjustable between the sensor's range. It is required to at least maintain the minimum window size.

Navigate: MENU › A_OUT › Adj20mA (Adj10V)

Remote Input: Not available

Default: 400 mm for the LE250 models; 1000 mm (39.37 in) for the LE550 models

Slope

The Slope option sets the slope as positive or negative. This swaps the 4 mA and 20 mA (0 V and 10 V) values.

Navigate: MENU › A_OUT › Slope

Remote Input: Available

Default: Positive

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Slope—Current-Sourcing Models

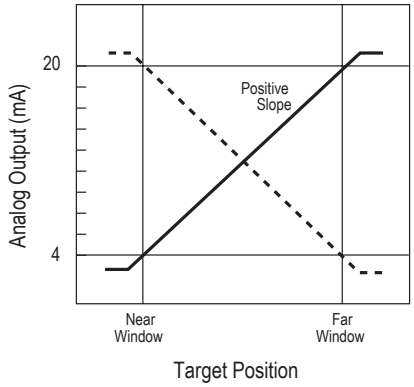

The analog current output tracks slightly beyond each window limit (from 3.8 mA to 20.2 mA)

Slope—Voltage-Sourcing Models

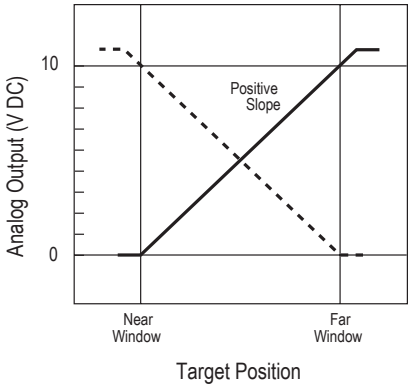

The analog voltage output tracks slightly beyond the upper window limit (up to 10.2 V)

1. Access the slope setting.

Method	Action		Result
Push Button	Navigate: **MENU › A_OUT › Slope**		"**Slope**" and the current setting display.
Remote Input	a. Double-pulse the remote input to enter setup mode. b. Single-pulse the remote input to access **A_OUT Slope**.		a. "**REMOTE SETUP**" displays. b. "**Slope**" and the current setting display.

2. Set the slope.

Method	Action		Result
Push Button	a. Use **Down** and **Up** to change the slope between Positive and Negative. b. Press **Enter** to save the selection.		a. The selection flashes rapidly on the display. b. The selection is saved and the sensor returns to "**A_OUT Slope**".
Remote Input	Positive slope: Single-pulse the remote input Negative slope: Double-pulse the remote input		The selection flashes rapidly on the display, and the sensor returns to Run mode.

Loss of Signal

The LossSig option sets the Analog Output value used by the sensor during a loss of signal. When a signal is restored, measurement resumes.

Navigate: **Menu › A_Out › LossSig**

Remote Input: Not available

Default: 3.5 mA (0 V)

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Option	Description
3.5 mA (0 V)	The Analog Output switches to this value 2 seconds after a loss of signal. When advanced measurements are enabled, the Analog Output is updated to this value immediately upon the release of the trigger input. For Voltage models, this is 0 V. (Default)
20.5 mA (10.5 V)	The Analog Output switches to this value 2 seconds after a loss of signal. When advanced measurements are enabled, the Analog Output is updated to this value immediately upon the release of the trigger input. For Voltage models, this is 10.5 V.
Hold	The Analog Output holds the last value indefinitely during a loss of signal. When advanced measurements are enabled, the last value is held across the triggered measurement periods.

The Range advanced measurement behavior is affected by the Loss of Signal option. For additional information on advanced measurements, see "Trigger" on page 35. The Range advanced measurement tracks a maximum and a minimum during the measurement period, and calculates the range as follows:

```
Range = maximum distance – minimum distance
```

If the maximum and/or minimum measurements are outside of the taught setpoints, the Loss of Signal option determines how the range is calculated.

Option	Sensor Behavior in Range Mode
3.5 mA (0 V)	If the maximum or minimum measurement is outside of the taught setpoints, the sensor outputs 3.5 mA (0 V) to indicate an out-of-range measurement.
20.5 mA (10.5 V)	If the maximum or minimum measurement is outside of the taught setpoints, the sensor outputs 20.5 mA (10.5 V) to indicate an out-of-range measurement.
Hold	The sensor limits the maximum and minimum measurements to not exceed the taught setpoints.

© Banner Engineering Corp. All rights reserved.

Discrete Output Menu (D_OUT)

Use this menu to view or change

- Setpoints
- Midpoint
- Mode
- Timers
- Polarity

Discrete Output Menu Map

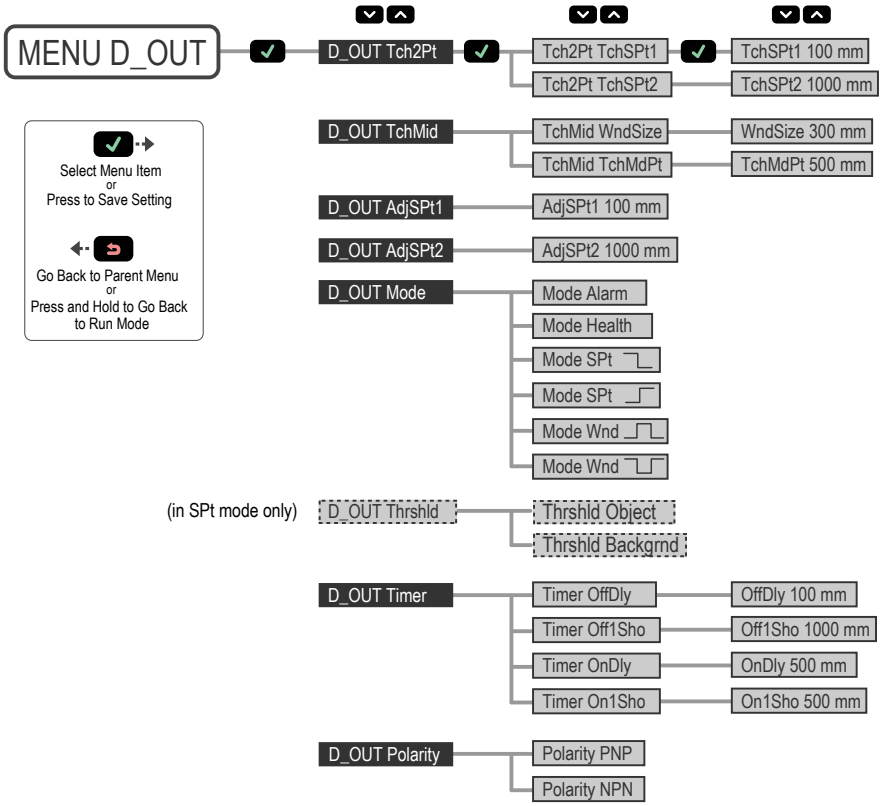

Two-Point TEACH

The TchSpt1 and TchSPt2 options teach the desired switch points. When using the buttons, the switch points can be taught independently. Both values must be taught when using the remote input.

NOTE: When in Switch mode, see "TEACH Switch Point" on page 29.

Navigate: MENU › D_OUT › Tch2Pt › TchSPt1 and navigate: **MENU › D_OUT › Tch2Pt › TchSPt2**

Remote Input: Available

Button Instructions

1. Present the target.

Action	Result
Present the target. The target must be within the sensor's range..	The target's analog output measurement and distance measurement value display.

2. Access the TEACH mode and TEACH the sensor.

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Action	Result
Navigate: **MENU › D_OUT › Tch2Pt › TchSPt1** OR Navigate: **MENU › D_OUT › Tch2Pt › TchSPt2**	The selected TEACH mode and "**Teaching**" display while the sensor is being taught. TEACH Accepted The new value is shown on the second line of the display and flashes before it is saved and the sensor returns to the parent menu. TEACH Not Accepted "**FAIL**" and a warning message display, and the sensor returns to the parent menu.

3. Repeat steps 1 to 2 for the other switch point, if desired.

Remote Input Instructions

1. Access the TEACH mode.

Action		Result
Single-pulse the remote input.		"**RMT TCH**" and the current switch point value displays.

2. Present the target.

Action	Result
Present the switch point one target.	"**RMT TCH**" and the target's measurement value display.

3. TEACH the sensor.

Action		Result
Double-pulse the remote input.		"**TchSPt1 Teaching**" displays while the sensor is being taught. TEACH Accepted The new value displays on the second line of the display, flashes, and the sensor goes to "**TchSPt2**" and the current measurement value. TEACH Not Accepted "**FAIL**" flashes, the sensor returns to step 2, and "**RMT TCH**" displays.

4. Present the target.

Action	Result
Present the switch point two target.	"**TchSPt2**" and the target's measurement value display.

5. TEACH the sensor.

© Banner Engineering Corp. All rights reserved.

Action		Result
Single-pulse the remote input.		"**TchSPt2 Teaching**" displays while the sensor is being taught. **TEACH Accepted** The new value displays on the second line of the display, flashes, and the sensor returns to Run mode. **TEACH Not Accepted** "**FAIL**" flashes, the sensor returns to step 2, and "**RMT TCH**" displays.

Midpoint TEACH

The Midpoint TEACH uses both the window size and the TEACH midpoint to determine the actual measurement window. For example, a window of 200 mm with a midpoint of 600 mm places the measurement window from 500 mm to 700 mm.

Window and Midpoint Example

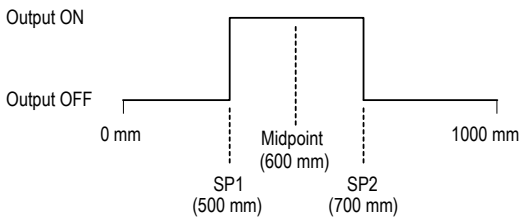

To use Midpoint TEACH:

1. Set the window size.
2. Set the measurement window using "TEACH Midpoint" on page 28.

The Discrete Output Midpoint TEACH and the Analog Output Midpoint TEACH are independent settings.

Window Size

The WndSize option sets the window size that the Midpoint TEACH uses to set the setpoint one and setpoint two thresholds.

The Midpoint TEACH fails if one of the setpoints is beyond the measurement range. The bigger the window size, the smaller the acceptable TEACH range.

The Discrete Output window size is a different setting than the Analog Output window size when defined using the button.

	LE250 Laser Sensor	LE550 Laser Sensor
Window Size Minimum	1 mm	10 mm
Window Size Maximum	250 mm	800 mm
Range	100 mm to 400 mm	100 mm to 1000 mm
Default Window Size	50 mm	300 mm

Navigate: MENU › D_OUT › TchMid › WndSize

Remote Input: Available

1. Access the setup mode.

Method	Action		Result
Push Button	Navigate: **MENU › D_OUT › TchMid › WndSize**.		"**WndSize**" and the current window size value display.
Remote Input	a. Double-pulse the remote input to enter setup mode. b. Three-pulse the remote input to enter window size mode.	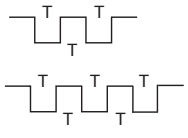	a. "**REMOTE SETUP**" displays. b. "**WndSize**" and the current value display.

2. Set the window size.

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

<table>
<tr><th>Method</th><th>Action</th><th>Result</th></tr>
<tr><td>Push Button</td><td>a. Use Down and Up to set the desired window size—the value changes in increments of 2.
b. Press Enter to save the new value.</td><td>a. "WndSize" and the new value display.
b. The new value flashes and returns to "TchMid WndSize".</td></tr>
<tr><td>Remote Input (Sets A_OUT and D_OUT window Size)</td><td>Pulse the remote input 1 to 6 times to select the desired window size.
<table><tr><th rowspan="2">Pulses</th><th colspan="2">Window Size</th></tr><tr><th>LE250</th><th>LE550</th></tr><tr><td>1</td><td>1 mm</td><td>10 mm</td></tr><tr><td>2</td><td>10 mm</td><td>50 mm</td></tr><tr><td>3</td><td>50 mm</td><td>100 mm</td></tr><tr><td>4</td><td>100 mm</td><td>300 mm</td></tr><tr><td>5</td><td>150 mm</td><td>500 mm</td></tr><tr><td>6</td><td>250 mm</td><td>800 mm</td></tr></table></td><td>The new value flashes and the sensor returns to Run mode.</td></tr>
</table>

TEACH Midpoint

The TchMdPt option sets the midpoint that determines the actual measurement window.

Navigate: MENU › D_OUT › TchMid › TchMdPt

Remote Input: Available

Button Instructions

1. Present the target.

Action	Result
Present the target.	The target's analog output measurement and distance measurement value display.

2. Access the TEACH midpoint mode and TEACH the sensor.

Action	Result
Navigate: **MENU › D_OUT › TchMid › TchMdPt**	"**TchMdPt Teaching**" displays while the sensor is being taught. TEACH Accepted The new value is shown on the second line of the display and flashes before it is saved and the sensor returns to "**TchMid TchMdPt**". TEACH Not Accepted "**FAIL**" and a warning message display, and the sensor returns to "**TchMid TchMdPt**".

Remote Input Instructions

1. Access the TEACH mode.

Action		Result
Single-pulse the remote input.		"**RMT TCH**" and the current measurement value display.

2. Present the target.

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Action	Result
Present the target.	"**RMT TCH**" and the target's measurement value display.

3. TEACH the sensor.

Action		Result
Five-pulse the remote input.		"**TchMdpt Teaching**" displays while the sensor is being taught. **TEACH Accepted** The new value displays on the second line of the display, flashes, and the sensor returns to Run mode. **TEACH Not Accepted** "**FAIL**" and a warning message display, the sensor returns to step 2, and "**RMT TCH**" displays.

Adjust Switch Point One

The AdjSPt1 option manually adjusts the value of the switch point one threshold for the Discrete Output when the sensor is in Window mode. The value is adjustable within the sensor's range. It is required to maintain the minimum window size between switch points. This menu is not available when the sensor is in Switch, Alarm, or Health mode.

Navigate: **MENU › D_OUT › AdjSPt1**

Remote Input: Not available

Default: 100 mm for both the LE250 and LE550 models.

Adjust Switch Point Two

The AdjSPt2 option manually adjusts the value of the switch point two threshold for the Discrete Output when the sensor is in Window mode. The value is adjustable with the sensor's range. It is required to maintain the minimum window size between switch points. This menu is not available when the sensor is in Switch, Alarm, or Health mode.

Navigate: **MENU › D_OUT › AdjSPt2**

Remote Input: Not available

Default: 400 mm for LE250 models and 1000 mm for LE550 models.

TEACH Switch Point

The TchSPt option teaches the distance at which the switch point threshold is placed when the Discrete Output is in Switch mode. This menu is not available when the sensor is in Window, Alarm, or Health mode.

Navigate: **MENU › D_OUT › TchSPt**

Remote Input: Available

Button Instructions

1. Present the target.

Action	Result
Present the target. The target must be within the sensor's range.	The target's analog output measurement and distance measurement value display.

2. Access the switch point TEACH mode and TEACH the sensor.

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Action	Result
Navigate: **MENU › D_OUT › TchSPt**	"**TchSPt Teaching**" displays while the sensor is being taught. TEACH Accepted The new value is shown on the second line of the display and flashes before it is saved and the sensor returns to "**D_OUT TchSPt**". TEACH Not Accepted "**FAIL**" and a warning message display, and the sensor returns to "**D_OUT TchSPt**".

Remote Input Instructions

1. Verify the sensor is in Switch mode.
2. Access the TEACH mode.

Action		Result
Single-pulse the remote input.		"**RMT TCH**" and the current measurement value display.

3. Present the target.

Action	Result
Present the target.	"**RMT TCH**" and the target's measurement value display.

4. TEACH the sensor.

Action		Result
Five-pulse the remote input.		"**TchSPt Teaching**" displays while the sensor is being taught. TEACH Accepted The new value displays on the second line of the display, flashes, and the sensor returns to Run mode. TEACH Not Accepted "**FAIL**" flashes, the sensor returns to step 3, and "**RMT TCH**" displays.

Adjust Switch Point

The AdjSPt option manually adjusts the value of the switch point threshold for the discrete output when the sensor is in Switch mode. The value is adjustable within the sensor's range. This menu is not available when the sensor is in Window, Alarm, or Health mode.

Navigate: **MENU › D_OUT › AdjSPt**

Remote Input: Not available

Default: 100 mm for the LE250 and LE550 models

Mode

The Mode option sets the output to the desired mode.

Navigate:**MENU › D_OUT › Mode**

Remote Input: Available

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Default: Wnd (Discrete Output is On while a target is detected between the SPt1 and SPt2 thresholds) mode

The following table describes the sensor modes.

Mode	Description
Alarm	**Alarm Mode:** The Discrete Output is Off while a target is detected by the sensor at any distance. When a loss of signal occurs, the Discrete Output is On. This mode has no associated thresholds.
Health	**Health Mode:** The Discrete Output is On while a target is detected by the sensor at any distance. When a loss of signal occurs, the Discrete Output is Off. This mode has no associated thresholds.
Swtch ⌞	**Switch Mode:** The Discrete Output is On while a target is detected nearer than the switch point threshold. When a target is detected farther than the switch point threshold or the signal is lost, the Discrete Output is Off.
Swtch ⌜	**Switch Mode:** The Discrete Output is Off while a target is detected nearer than the switch point threshold. When a target is detected farther than the switch point threshold or the signal is lost, the Discrete Output is On.
Wnd ⌐⌙	**Window Mode:** The Discrete Output is On while a target is detected between the SPt1 and SPt2 thresholds. (Default) When a target is detected outside the SPt1 and SPt2 thresholds or the signal is lost, the Discrete Output is Off.
Wnd ⌙⌐	**Window Mode:** The Discrete Output is Off while a target is detected between the SPt1 and SPt2 thresholds. When a target is detected outside the SPt1 and SPt2 thresholds or the signal is lost, the Discrete Output is On.

Remote Input Instructions

1. Access the setup mode.

Action		Result
Double-pulse the remote input.		"**REMOTE SETUP**" displays.

2. View the current mode.

Action		Result
Double-pulse the remote input.		The current mode displays.

3. Program the sensor.

Action	Result
Pulse the remote input 1 to 6 times to select the desired mode.	The selected mode flashes and the sensor returns to Run mode.

Pulses		Mode
1		Alarm
2		Health
3		Swtch ⌞
4		Swtch ⌜

Continued on page 32

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Continued from page 31

Pulses		Mode
5		Wnd
6		Wnd

Switch Point Reference (SPtRef)

The SPtRef menu only displays for a discrete output when it is set to switch mode. The SPtRef settings, object or background, for the two discrete outputs are set independently. This setting cannot be changed with remote teach.

- **Object** (default). Object mode sets the switching threshold just past the location of the taught object, farther away from the sensor's face.
- **Background**. Background mode sets the switching threshold in front of the taught object, closer to the sensor's face.

The distance between the surface of the taught object and the switching threshold varies depending on measurement strength and can be affected by target distance, color, reflectivity, etc. Use object mode when teaching an object if a change in state is required when the object is no longer present. Use background mode when teaching background so that the output state changes when a new object is in front of the background.

Navigate: **MENU › Dx_OUT › SPtRef**

Remote Input: Not available

Default: Object

Timer

The Timer option sets the delays and timers. On/Off Delays and On/Off One-Shot timers can be programmed between 1 to 9999 ms (a value of 0 disables the delay/timer). The following figure defines how the delays/timers affect the output behavior.

Navigate: MENU › D_OUT › Timer

Remote Input: not available

Default: 0 ms for all timers

Delays/Timers

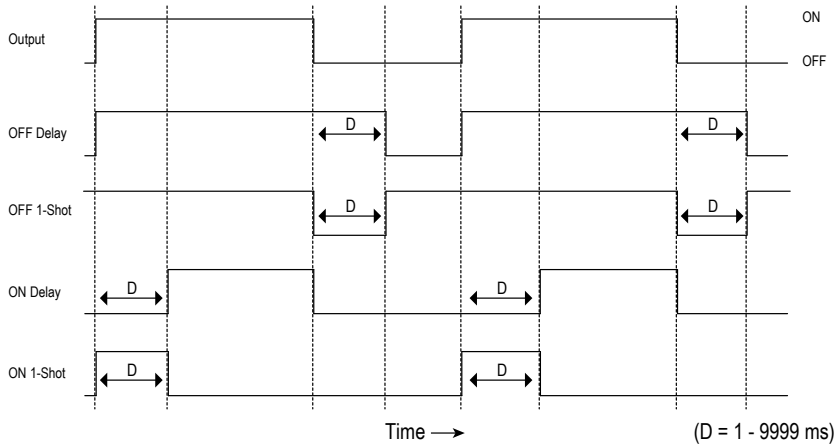

Some combinations of delays/timers are not allowed. The programming menu automatically disables invalid combinations of delays/timers. The following table shows the allowable combinations of delays/timers.

	Off Delay	Off One-Shot Timer	On Delay	On One-Shot Timer
Off Delay (OffDly)	OK	OK	OK	N/A
Off One-Shot Timer (Off1Sho)	OK	OK	N/A	N/A

Continued on page 33

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Continued from page 32

	Off Delay	Off One-Shot Timer	On Delay	On One-Shot Timer
On Delay (OnDly)	OK	N/A	OK	OK
On One-Shot Timer (On1Sho)	N/A	N/A	OK	OK

Polarity

The Polarity option sets the discrete output polarity to either PNP (current sourcing) or NPN (current sinking). The physical wiring of the sensor and the sensor polarity setting must match.

Navigate: **MENU › D_OUT › Polarity**

Remote Input: Not available

Default: PNP

Input Menu (INPUT)

Use this menu to view or change the:

- Multi-function input type
- Active state of the remote input

Input Menu map

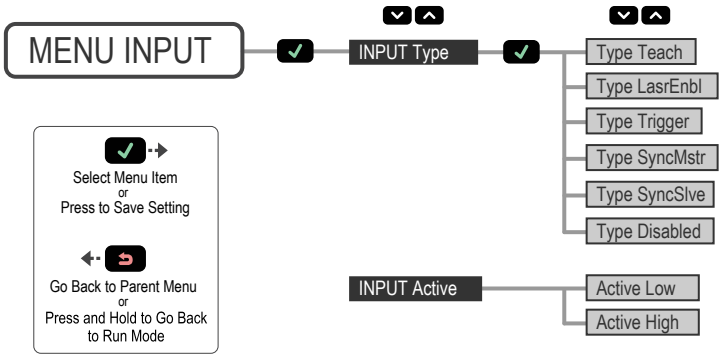

Input Type

The Type option sets the input type.

Navigate: **MENU › INPUT › Type**

Remote Input: Not available

Default: Teach

Input Type	Description
Teach	The remote input is used to TEACH and program the sensor.
LasrEnbl	The remote input is used to control when the laser emitter is On/Off.
Trigger	The remote input is used to trigger advanced measurements To enable advanced measurements, the Input Type option must be set to Trigger (see "Trigger" on page 35).
SyncMstr	The remote input is used as the Master Sync output to an attached Slave sensor (see "Sync Master/ Slave" on page 40).
SyncSlve	The remote input is used as the Slave Sync input from an attached Master sensor (see "Sync Master/ Slave" on page 40).
Disabled	The remote input is disabled. (Default)

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Input Active

The Active option sets the active state of the remote input. Use the Active options to change the active input to Low or High.

Navigate: **MENU › INPUT › Active**

Remote Input: Not available

Default: Low

Input Active	Description
Low	The remote input detects low (0 V) inputs and high-to-low transitions. (Default)
High	The remote input detects high (V+) inputs and low-to-high transitions.

Measure Menu (MEASURE)

Use this menu to view or change the:

- Speed
- Trigger

Measure Menu Map

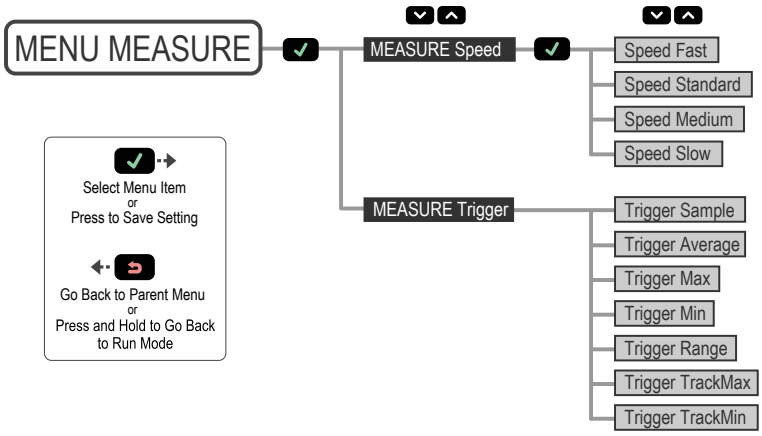

Speed

The Speed option sets the speed at which the measurement is calculated. This process uses averaging in the digital processing of the signal to calculate the measurement. A slower speed increases the response time of the sensor but improves the repeatability. See "Repeatability (90% to 6% reflectance)" on page 7 for repeatability specifications for each speed.

Navigate:**MENU › MEASURE › Speed**

Remote Input: Not available

Default: Standard

	Class 1 Laser Models		Class 2 Laser Models	
Speed	Response Time	Response Time in Sync Mode	Response Time	Response Time in Sync Mode
Fast	2 ms	4 ms	2 ms	4 ms
Standard	10 ms (default)	20 ms	5 ms (default)	10 ms
Medium	30 ms	60 ms	15 ms	30 ms

Continued on page 35

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Continued from page 34

	Class 1 Laser Models		Class 2 Laser Models	
Speed	**Response Time**	**Response Time in Sync Mode**	**Response Time**	**Response Time in Sync Mode**
Slow	100 ms	200 ms	50 ms	100 ms

Trigger

The Trigger option sets the advanced measurement that is calculated when a trigger event is detected on the remote input. The analog output updates with the new advanced measurement on each trigger event. To use these Trigger options, the sensor Input Type option must be set to Trigger; see "Input Type" on page 33.

Navigate: **MENU › MEASURE › Trigger**

Remote Input: Not available

Default: Sample

Trigger	Description
Sample	The current distance at the time of the trigger event. (Default) The Analog Output tracks the sample values during the measuring period.
Average	The average distance since the last trigger event.
Maximum (Max)	The maximum distance since the last trigger event.
Minimum (Min)	The minimum distance since the last trigger event.
Range	The difference between the maximum and minimum distance since the last trigger event. For additional information on the Range measurement behavior when the maximum or minimum distance is outside of the taught setpoints, see "Loss of Signal" on page 23.
TrackMax	The maximum distance since the last trigger event. The Analog Output tracks new maximum values during the measurement period.
TrackMin	The minimum distance since the last trigger event. The Analog Output tracks new minimum values during the measurement period.

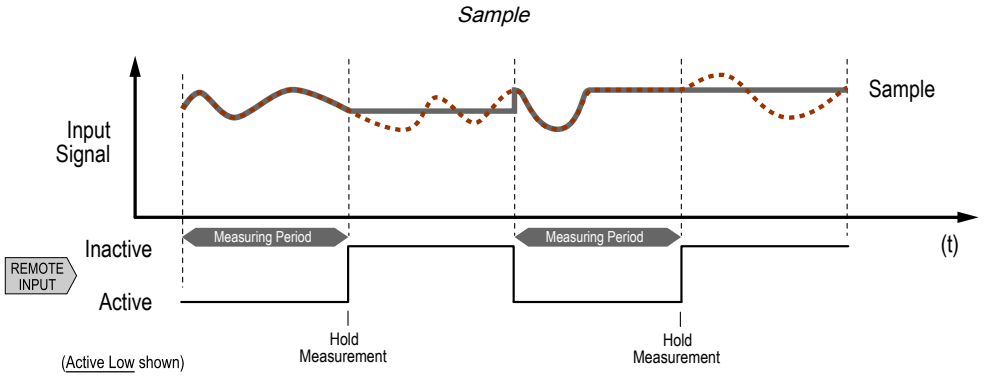

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Average

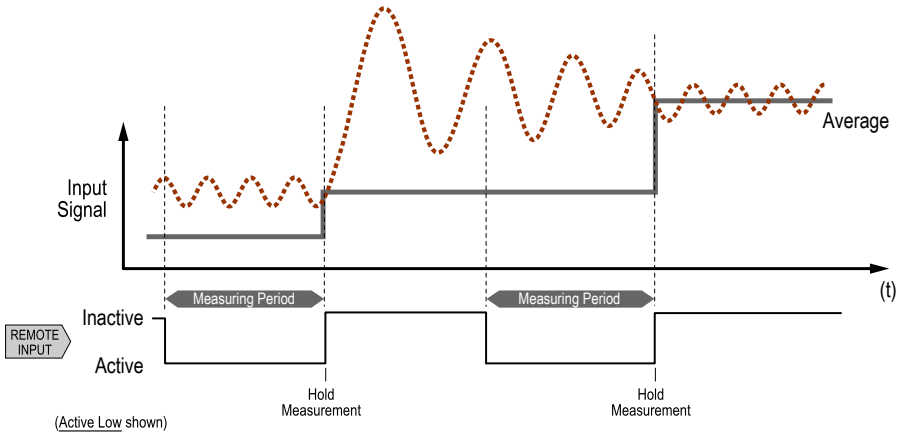

Maximum and Minimum

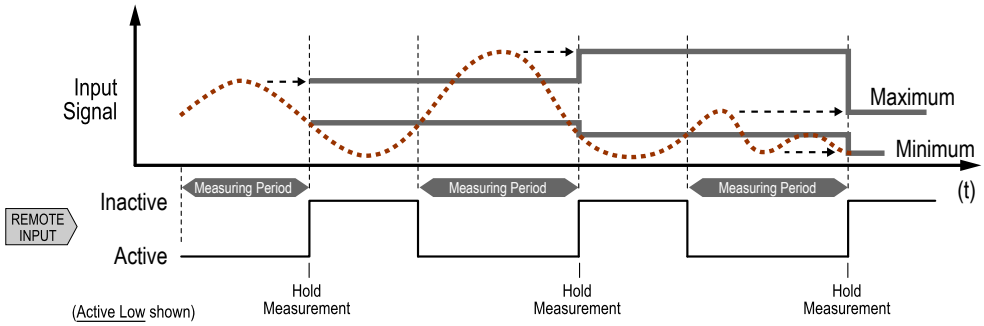

Range

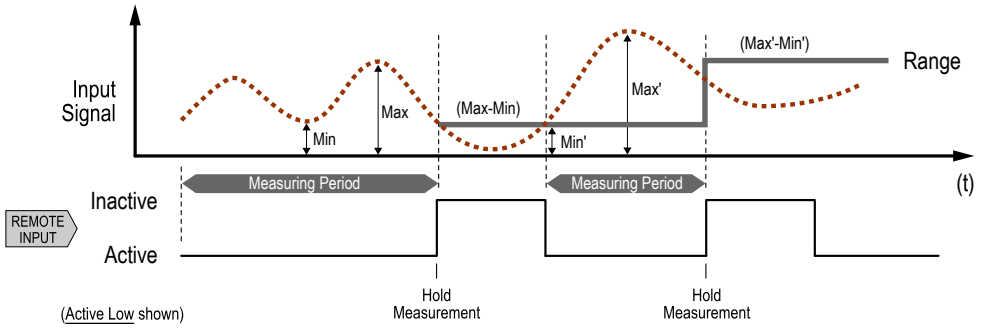

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Track Maximum and Track Minimum

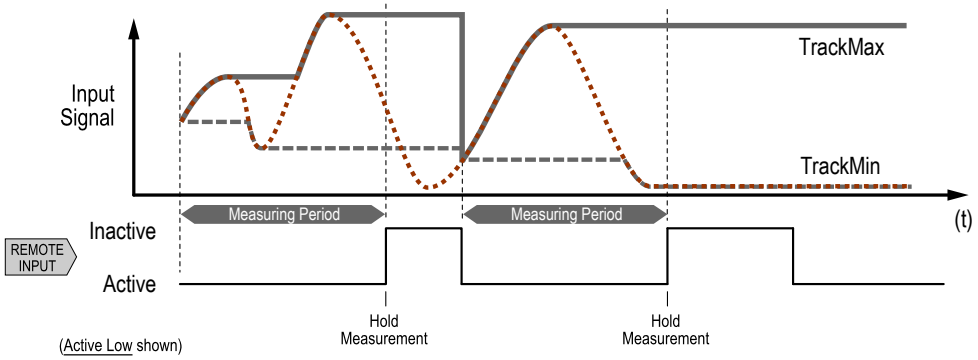

Display Menu (DISPLAY)

Use this menu to view or change the:

- Display units
- Display orientation
- Sleep mode settings

Display Menu Map

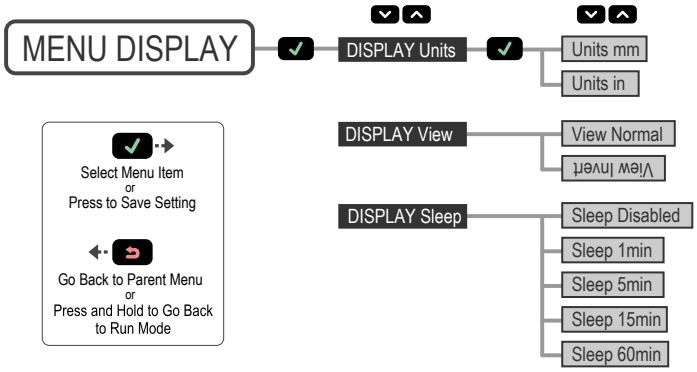

Units

The Units option sets the displayed units to millimeters (mm) or inches (in).

Navigate: **MENU › DISPLAY › Units**

Remote Input: Not available

Default: mm

View

The View option sets the display orientation of the sensor. Invert the display for applications where the device is mounted upside down. This rotates the display 180°. The Down and Up buttons do not change when the display is inverted.

Navigate: **MENU › DISPLAY › View**

Remote Input: Not available

Default: Normal

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

LE550 Normal Display Orientation



LE550 Inverted Display Orientation



Sleep

The Sleep option sets when the display is put to sleep. Four timing options are available: 1, 5, 15, or 60 minutes. Sleep mode is disabled by default. Sleep occurs in Run mode and any menu. To wake the sensor and return to the last viewed mode or menu, press any button.

Navigate: **MENU › DISPLAY › Sleep**

Remote Input: Not available

Default: Disabled

Information Menu (INFO)

LE550 Information Menu Map

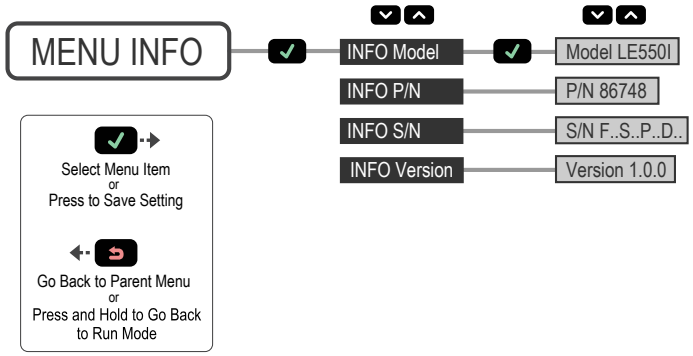

Use this menu to view model, part number (P/N), serial number (S/N), and firmware version (Version) information. Select one of these options to view specific information for your sensor. This information is read-only.

Navigate: **MENU › INFO**

Remote Input: Not available

Reset Menu (RESET)

Use this menu to restore the sensor to the factory default settings.

Navigate: **MENU › RESET.** Select Yes to apply the factory defaults; select No to return to the Reset option without changing any sensor settings.

Remote Input: Eight-pulse the remote input

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Reset Menu Map

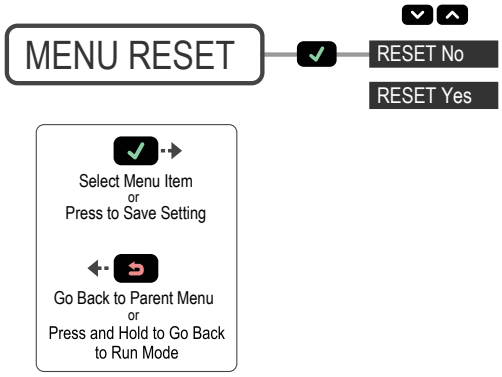

Factory Default Settings

Analog Output Settings	LE250	LE550
Adjust 4 mA (0 V)	100 mm	100 mm
Adjust 20 mA (10 V)	400 mm	1000 mm
Loss of Signal	3.5 mA (0 V)	
Slope	Positive	
Window Size	50 mm	300 mm

Discrete Output Settings	LE250	LE550
Adjust Switch Point One	100 mm	100 mm
Adjust Switch Point Two	400 mm	1000 mm
Mode	Wnd	
Polarity	PNP	
Timer	0 ms for all timers	
Window Size	50 mm	300 mm

Input Settings	LE250 and LE550
Input Active	Low
Input Type	Teach

Measure Settings	LE250 and LE550
Speed	Standard
Trigger	Sample

Display Settings	LE250 and LE550
Sleep	Disabled
Units	mm
View	Normal

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Sync Master/Slave

Two LE250/550 Laser sensors may be used together in a single sensing application. To eliminate crosstalk between the two sensors, configure one sensor to be the master and one to be the slave. In this mode, the sensors alternate taking measurements and the response speed doubles.

1. Configure the first sensor as the master; navigate: **MENU › INPUT › Type › SyncMstr.**
2. Configure the second sensor as the slave; navigate: **MENU › INPUT › Type › SyncSlve.**
3. Connect the gray (input) wires of the two sensors together.

If using a combination of Class 1 and Class 2 laser models, the Class 1 laser model must be used as the master.

© Banner Engineering Corp. All rights reserved.

Chapter Contents

TEACH Analog Output and Discrete Output Switch Points Together 41
TEACH Analog Output and Discrete Output Midpoints Together 42

Chapter 4 Additional Remote TEACH Procedures

TEACH Analog Output and Discrete Output Switch Points Together

Use the following procedure to teach identical Analog Output and Discrete Output switch points at the same time using the remote input. This feature is not available using the buttons.

1. Access the TEACH mode.

Action		Result
Single-pulse the remote input.		"**RMT TCH**" and the current measurement value display.

2. Present the target.

Action		Result
Present the switch point one target.		"**RMT TCH**"and the target's measurement value display.

3. TEACH the sensor.

Action		Result
Three-pulse the remote input.		"**TchA&D1 Teaching**" displays while the sensor is being taught. **TEACH Accepted** The new value displays on the second line of the display, flashes, and then "**TchA&D2**" and the current measurement value display. **TEACH Not Accepted** "**FAIL**" flashes, the sensor returns to step 2, and "**RMT TCH**" displays.

4. Present the target.

Action		Result
Present the switch point two target.		"**TchA&D2**" and the target's measurement value display.

5. TEACH the sensor.

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Action		Result
Single-pulse the remote input.		"**TchA&D2 Teaching**" displays while the sensor is being taught. **TEACH Accepted** The new value displays on the second line of the display, flashes, and the sensor returns to Run mode. **TEACH Not Accepted** "**FAIL**" flashes, the sensor returns to step 2, and "**RMT TCH**" displays.

TEACH Analog Output and Discrete Output Midpoints Together

Use the following procedure to teach an identical Analog Output 12 mA (5 V) point and Discrete Output midpoint (switch point) at the same time using the remote input.This feature is not available using the buttons. Note that if the window sizes were set independently (using the buttons), the windows taught using the following procedure could be different.

1. Access the TEACH mode.

Action		Result
Single-pulse the remote input.		"**RMT TCH**" and the current measurement value display.

2. Present the target.

Action	Result
Present the midpoint (switch point) target.	"**RMT TCH**"and the target's measurement value display.

3. TEACH the sensor.

Action		Result
Six-pulse the remote input.		"**TchA&D Teaching**" displays while the sensor is being taught. **TEACH Accepted** The new value displays on the second line of the display, flashes, and the sensor returns to Run mode. **TEACH Not Accepted** "**FAIL**" flashes, the sensor returns to step 2, and "**RMT TCH**" displays.

© Banner Engineering Corp. All rights reserved.

Chapter Contents

Cordsets 43
Brackets 44

Chapter 5 Accessories

Cordsets

All measurements are listed in millimeters, unless noted otherwise. The measurements provided are subject to change.

5-pin Single-Ended M12 Female Shielded Cordsets (datasheet p/n 236184)				
Model	**Length**	**Dimensions (mm)**	**Pinout (Female)**	
BC-M12F5-22-1-SF	1 m (3.28 ft)	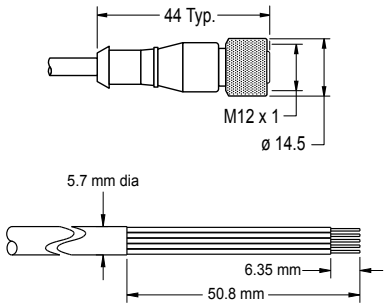		1 = Brown 2 = White 3 = Blue 4 = Black 5 = Gray
BC-M12F5-22-2-SF	2 m (6.56 ft)			
BC-M12F5-22-5-SF	5 m (16.4 ft)			
BC-M12F5-22-8-SF	8 m (26.25 ft)			
BC-M12F5-22-10-SF	10 m (30.81 ft)			
BC-M12F5-22-15-SF	15 m (49.2 ft)			

5-pin Single-Ended M12 Female Right-Angle Shielded Cordsets (datasheet p/n 236184)				
Model	**Length**	**Dimensions (mm)**	**Pinout (Female)**	
BC-M12F5A-22-1-SF	1 m (3.28 ft)	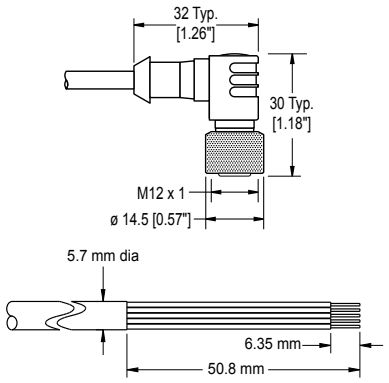		1 = Brown 2 = White 3 = Blue 4 = Black 5 = Gray
BC-M12F5A-22-2-SF	2 m (6.56 ft)			
BC-M12F5A-22-5-SF	5 m (16.4 ft)			
BC-M12F5A-22-8-SF	8 m (26.25 ft)			
BC-M12F5A-22-10-SF	10 m (30.81 ft)			
BC-M12F5A-22-15-SF	15 m (49.2 ft)			

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Brackets

All measurements are listed in millimeters, unless noted otherwise. The measurements provided are subject to change.

SMBAMSLEIP

- Includes the mounting plate and two protective windows
- 90 plus degree rotation
- Window frames are black anodized aluminum; mounting plate is stainless steel
- The mounting plate, SMBAMSLTFP, can be ordered separately
- The replacement window, RWAMSLE, can be ordered separately

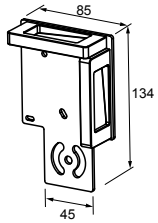

SMBAMSLTFP

- AMS mounting pattern
- 12 gauge stainless steel

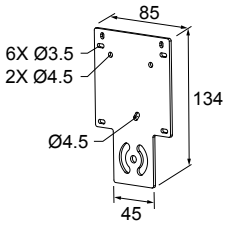

SMBLEFA

- Swivel plate bracket
- 12 gauge stainless steel

Hole size: A = 4x ø 4.5

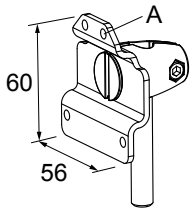

SMBLEL

- Right-angle bracket
- 12 gauge stainless steel

Hole size: A = ø 4.5 with 20° adjustability, B = ø 4.5, C = ø 5.7 with 20° adjustability

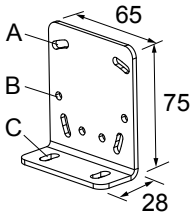

SMBLEU

- Enclosed bracket
- 16 gauge stainless steel

Hole size: A = ø 5 with 20° adjustability, B = ø 4.5, C = ø 4.5 with 10° adjustability

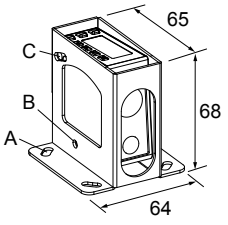

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Chapter Contents

Troubleshooting 45
Sensor Menu Full Map (LE550 Analog/Discrete Models) 46
Repairs 47
Contact Us 47
Banner Engineering Corp Limited Warranty 47

Chapter 6 Product Support and Maintenance

Troubleshooting

Message/Indicator	Description	Resolution
Fail/ Min Wnd OutRnge	The minimum window size is 1 mm for the LE250 models and 10 mm for the LE550 models. One point of the adjusted or taught window is out of range.	The sensor automatically returns to the previous setting.
Fail/ Out of Range	The TEACH failed, the target is out of range. The target might have moved out of range after the TEACH process began.	TEACH the switch point within the measurement range.
Fail/ Wnd out of Range	The window TEACH failed. • The window is out of the measurement range. • The target might have moved out of range after the TEACH process began. • The window is too large.	TEACH the window within the measurement range.
MIN Wnd xx mm (xx in)	The adjusted or taught window size is too small; the minimum window size is displayed.	The sensor automatically adjusts the window size to maintain the minimum window size and completes the adjust or TEACH operation.
OutRnge	The target is out of range, too dark, or the sensor is not measuring.	Move the target within the measurement range.
Power LED is flashing green	The sensor input is set to laser enable and the input is not active.	See "Input Type" on page 33.
Power LED is flashing red	The laser shut off, the Power LED flashes red and Output LEDs flash amber at 1Hz, and the display is blank. The laser has experienced a fault.	Contact Banner Engineering to resolve.
SPtx < Near or SPtx > Far	One of the switch points is located outside the sensor's range, either too close to the sensor or too far away.	The sensor automatically adjusts the invalid switch point to the end of range. Reduce the window size or change the teach location so both switch points are inside the valid range.
Type Sync Slave	The slave mode sensor does not see the master's pulse.	Verify the master mode sensor is configured and functioning properly. Check the input wire connection between the master and slave.

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Sensor Menu Full Map (LE550 Analog/Discrete Models)

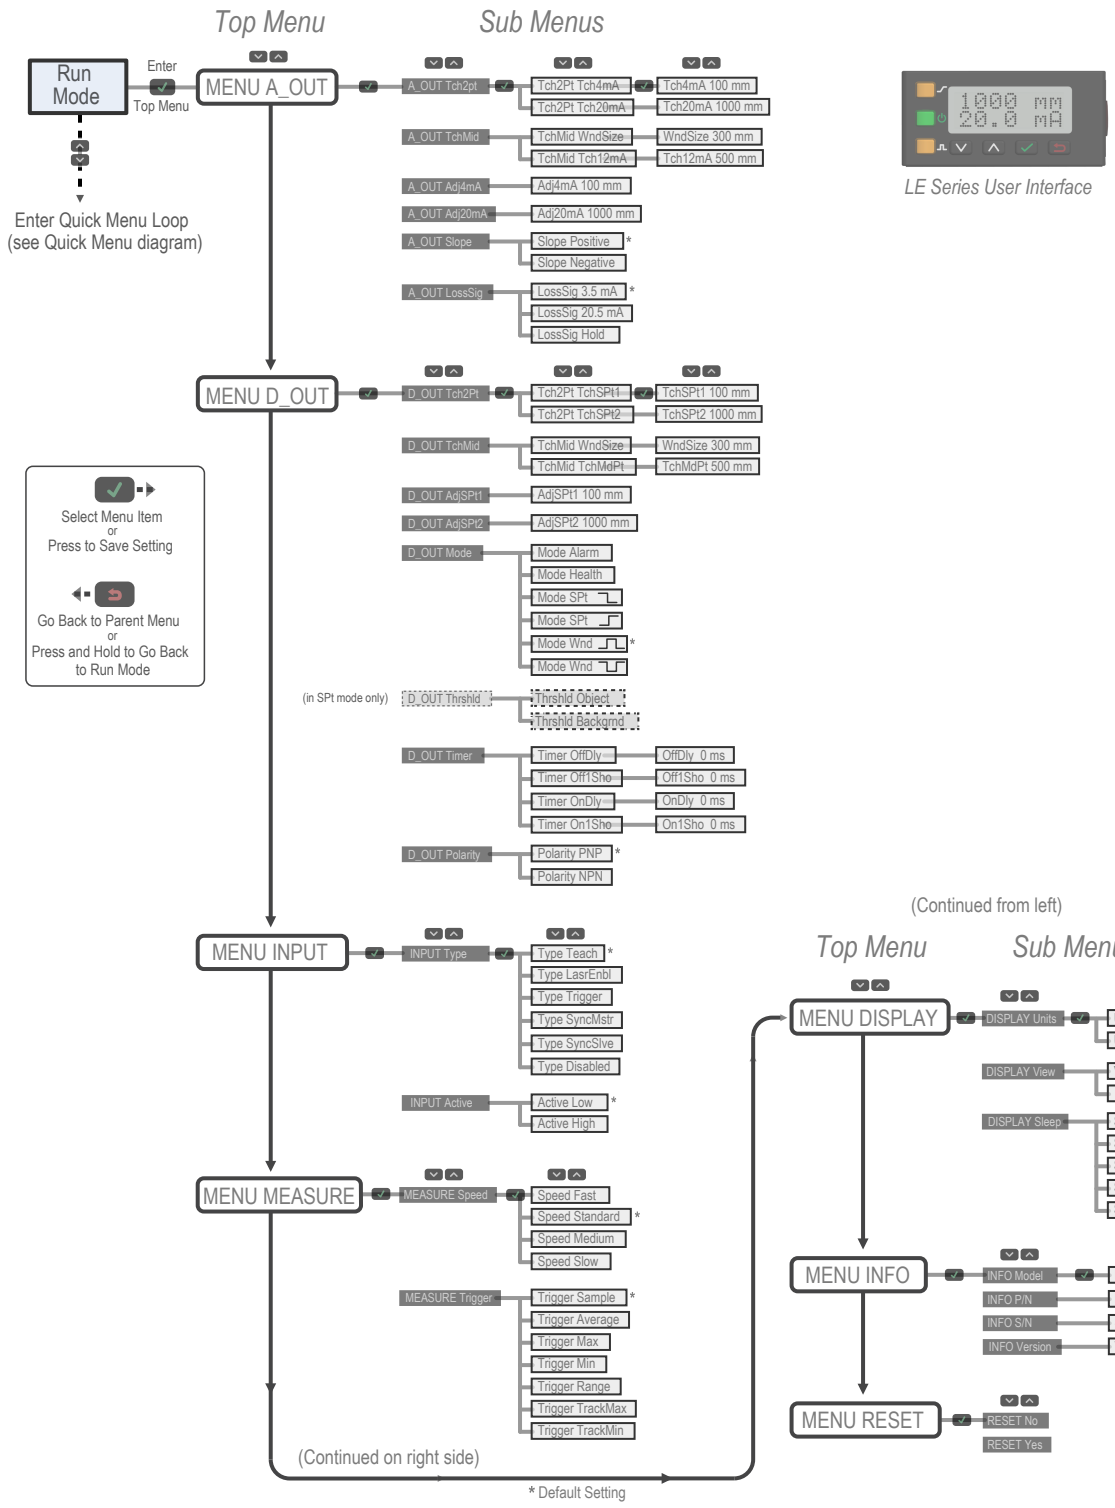

NOTE: See "Remote Input" on page 15 for remote input options.

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

Repairs

Contact Banner Engineering for troubleshooting of this device. **Do not attempt any repairs to this Banner device; it contains no field-replaceable parts or components.** If the device, device part, or device component is determined to be defective by a Banner Applications Engineer, they will advise you of Banner's RMA (Return Merchandise Authorization) procedure.

> **IMPORTANT:** If instructed to return the device, pack it with care. Damage that occurs in return shipping is not covered by warranty.

Contact Us

Banner Engineering Corp. | 9714 Tenth Avenue North | Plymouth, MN 55441, USA | Phone: + 1 888 373 6767

For worldwide locations and local representatives, visit www.bannerengineering.com.

Banner Engineering Corp Limited Warranty

Banner Engineering Corp. warrants its products to be free from defects in material and workmanship for one year following the date of shipment. Banner Engineering Corp. will repair or replace, free of charge, any product of its manufacture which, at the time it is returned to the factory, is found to have been defective during the warranty period. This warranty does not cover damage or liability for misuse, abuse, or the improper application or installation of the Banner product.

THIS LIMITED WARRANTY IS EXCLUSIVE AND IN LIEU OF ALL OTHER WARRANTIES WHETHER EXPRESS OR IMPLIED (INCLUDING, WITHOUT LIMITATION, ANY WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE), AND WHETHER ARISING UNDER COURSE OF PERFORMANCE, COURSE OF DEALING OR TRADE USAGE.

This Warranty is exclusive and limited to repair or, at the discretion of Banner Engineering Corp., replacement. **IN NO EVENT SHALL BANNER ENGINEERING CORP. BE LIABLE TO BUYER OR ANY OTHER PERSON OR ENTITY FOR ANY EXTRA COSTS, EXPENSES, LOSSES, LOSS OF PROFITS, OR ANY INCIDENTAL, CONSEQUENTIAL OR SPECIAL DAMAGES RESULTING FROM ANY PRODUCT DEFECT OR FROM THE USE OR INABILITY TO USE THE PRODUCT, WHETHER ARISING IN CONTRACT OR WARRANTY, STATUTE, TORT, STRICT LIABILITY, NEGLIGENCE, OR OTHERWISE.**

Banner Engineering Corp. reserves the right to change, modify or improve the design of the product without assuming any obligations or liabilities relating to any product previously manufactured by Banner Engineering Corp. Any misuse, abuse, or improper application or installation of this product or use of the product for personal protection applications when the product is identified as not intended for such purposes will void the product warranty. Any modifications to this product without prior express approval by Banner Engineering Corp will void the product warranties. All specifications published in this document are subject to change; Banner reserves the right to modify product specifications or update documentation at any time. Specifications and product information in English supersede that which is provided in any other language. For the most recent version of any documentation, refer to: www.bannerengineering.com.

For patent information, see www.bannerengineering.com/patents.

© Banner Engineering Corp. All rights reserved.
www.bannerengineering.com

LinkedIn

X (formerly Twitter)

Facebook



© 2025. All rights reserved.
www.bannerengineering.com